

See Report No. 2150-004

583

OCCUPANT RESPONSE COMPARISON TO FMVSS REQUIREMENTS

06/22/83

HIC

VEHICLE	OCCUPANT	HIC	T1	T2	T2-T1	%COMP. MARG.
1983 MITSUBISHI MONTERO	DRIVER	1537.46	79.25	94.37	15.12	1.54
1983 MITSUBISHI MONTERO	PASSENGER	1427.13	48.38	130.88	82.50	1.43

* VALUES GREATER THAN 1 REPRESENT NON-COMPLIANCE

OCCUPANT RESPONSE COMPARISON TO FMVSS REQUIREMENTS


06/22/83

TEST: N99043


CHAN.	VEHICLE	OCCUPANT	REQUIREMENT	RESPONSE	% COMP. MARG.
RES	1983 MITSUBISHI MONTERO	DRIVER	60.00	56.75	.97
RES	1983 MITSUBISHI MONTERO	PASSENGER	60.00	49.76	.83

49.49

* ABS(VALUES) GREATER THAN 1 REPRESENT NON-COMPLIANCE

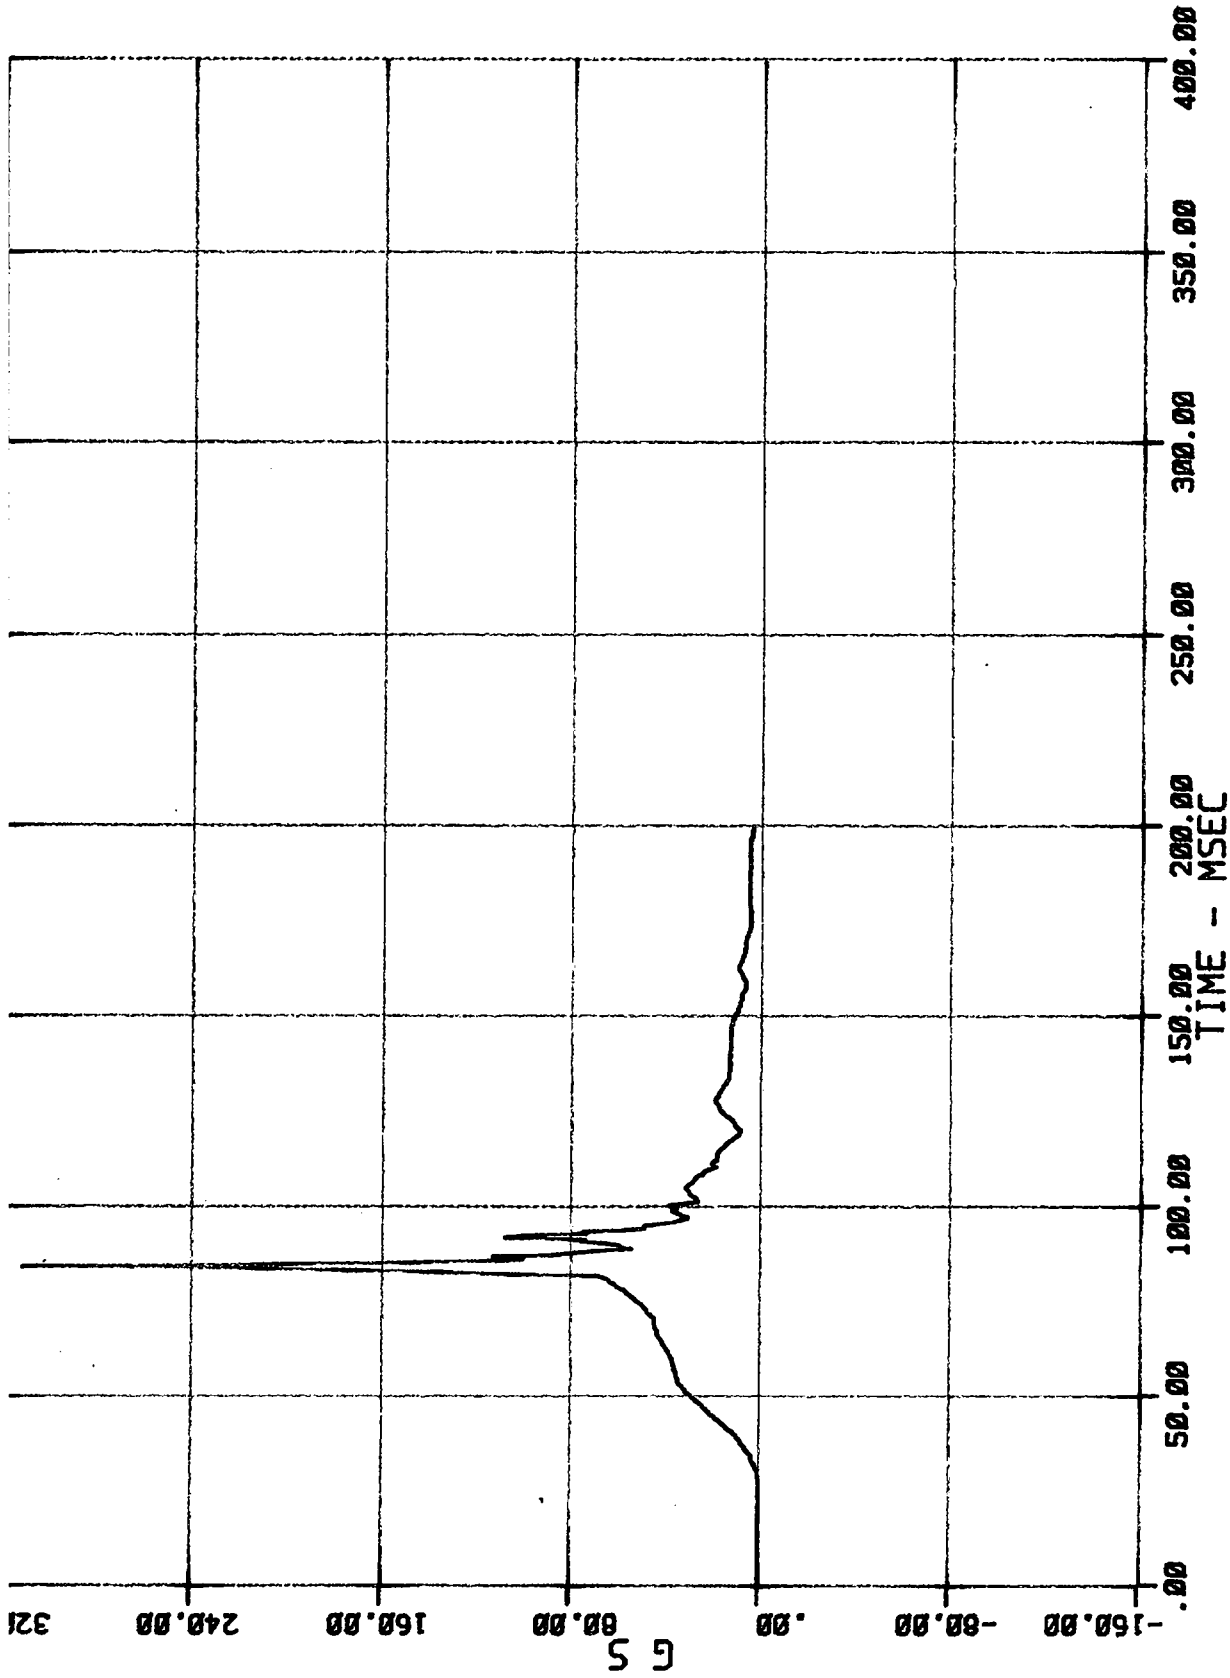


DR HED RES 01
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

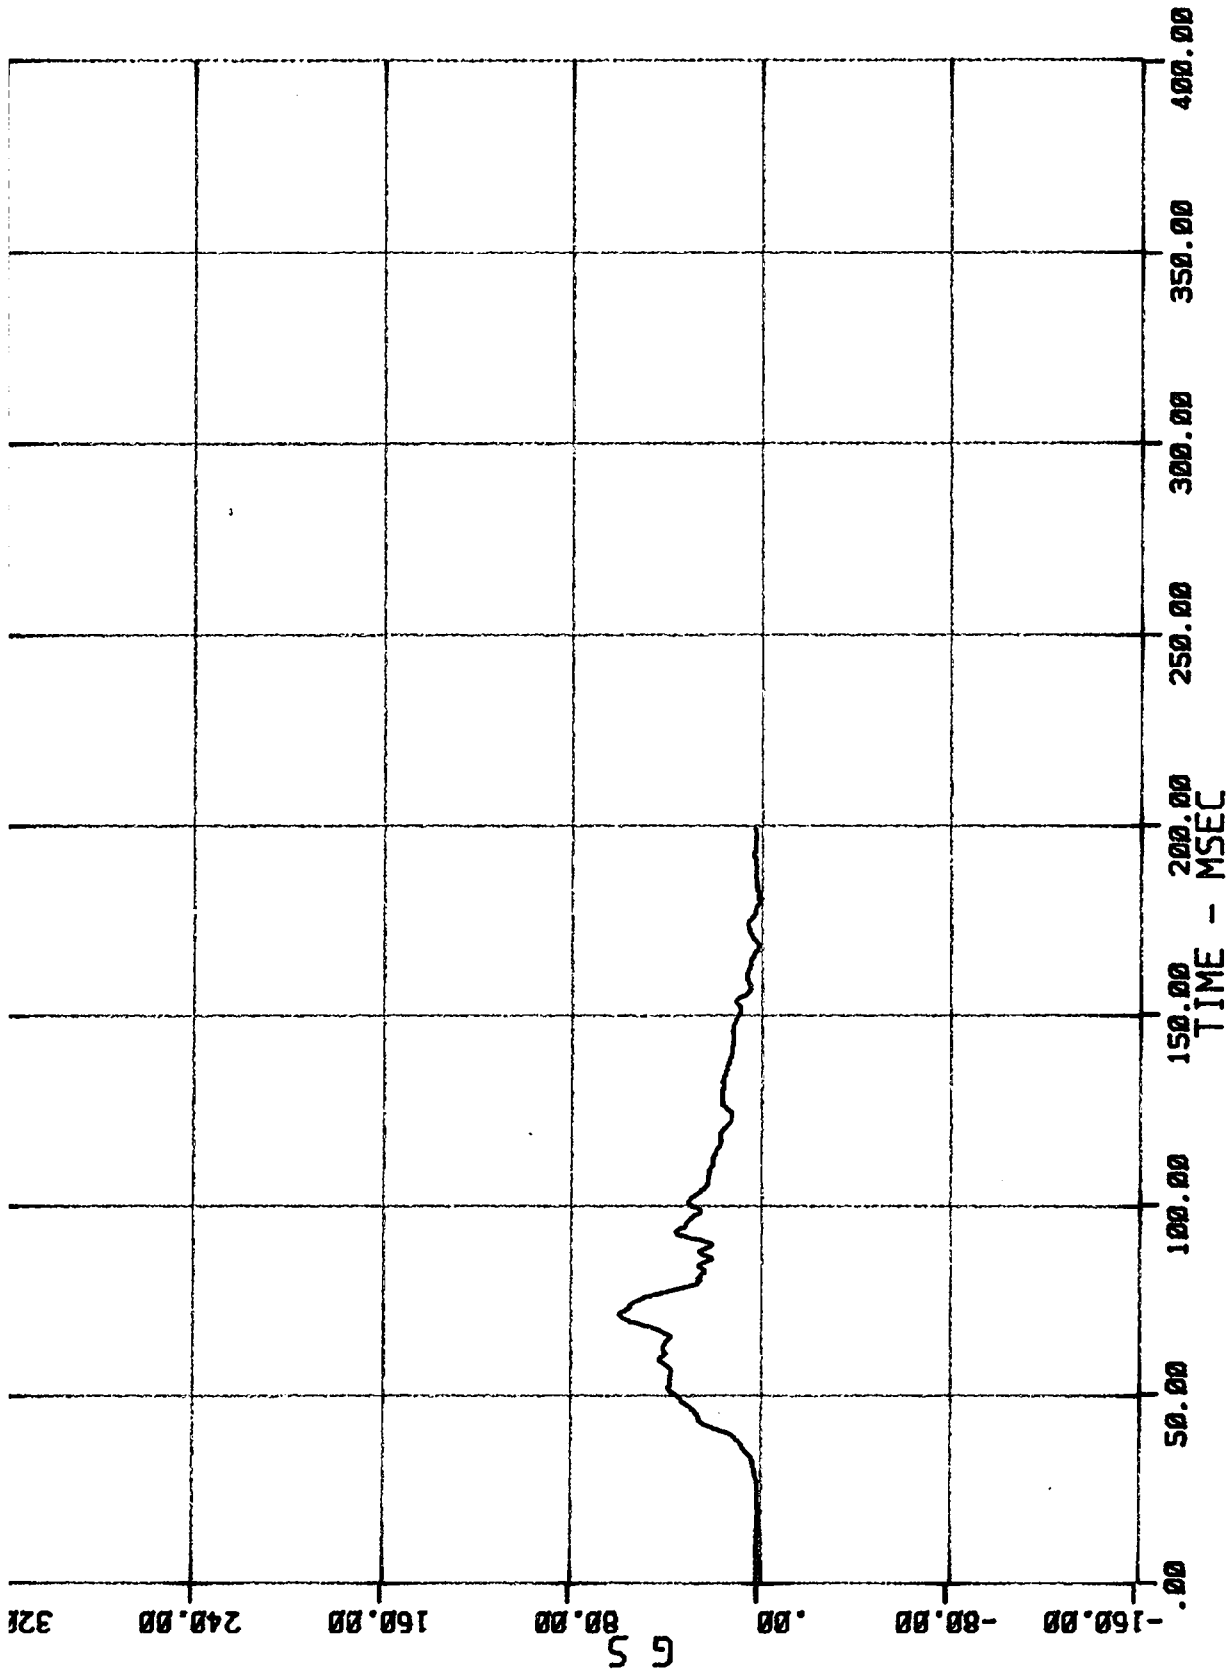


DR CST RES 04
 MSE N99043

1983 MITSUBISHI MONTERO


06/22/83

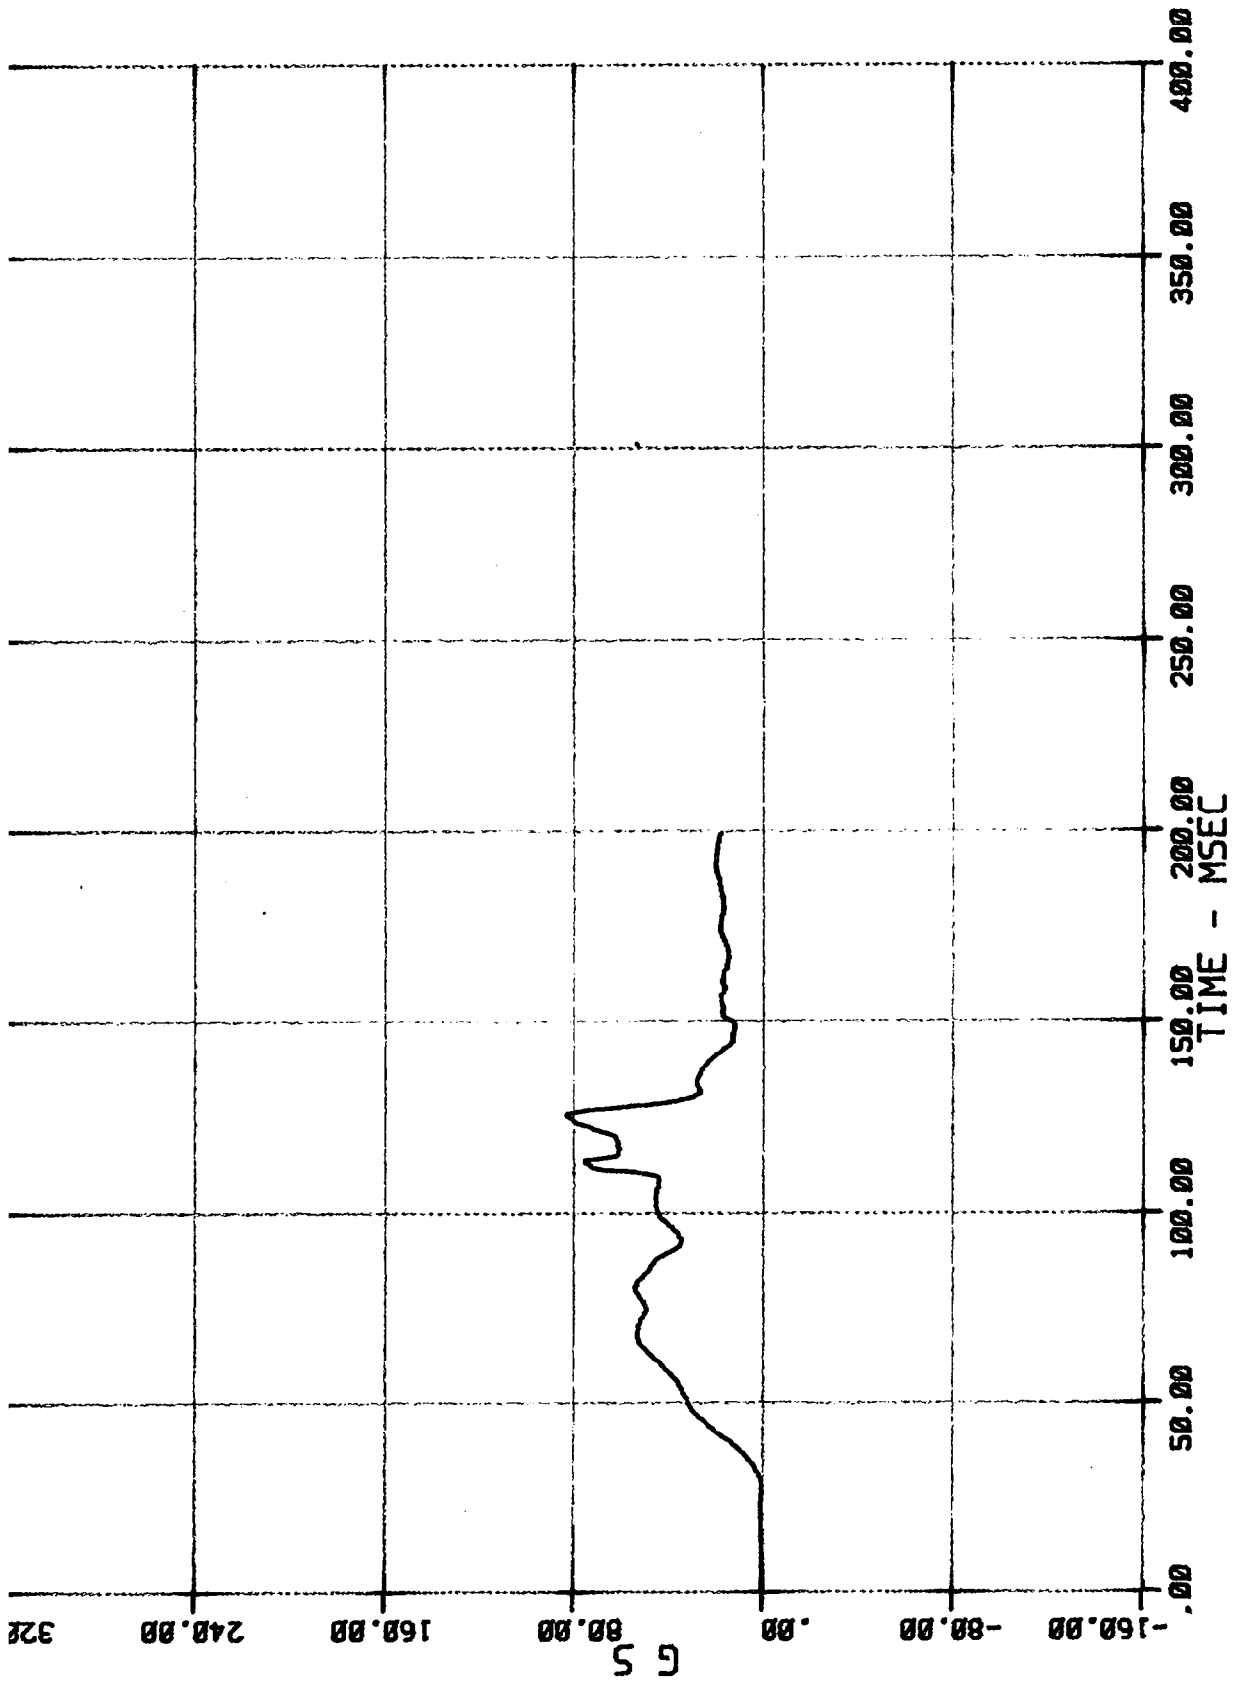

PA HED RES 07
 MSE N99043 1983 MITSUBISHI MONTERO
 06/22/83

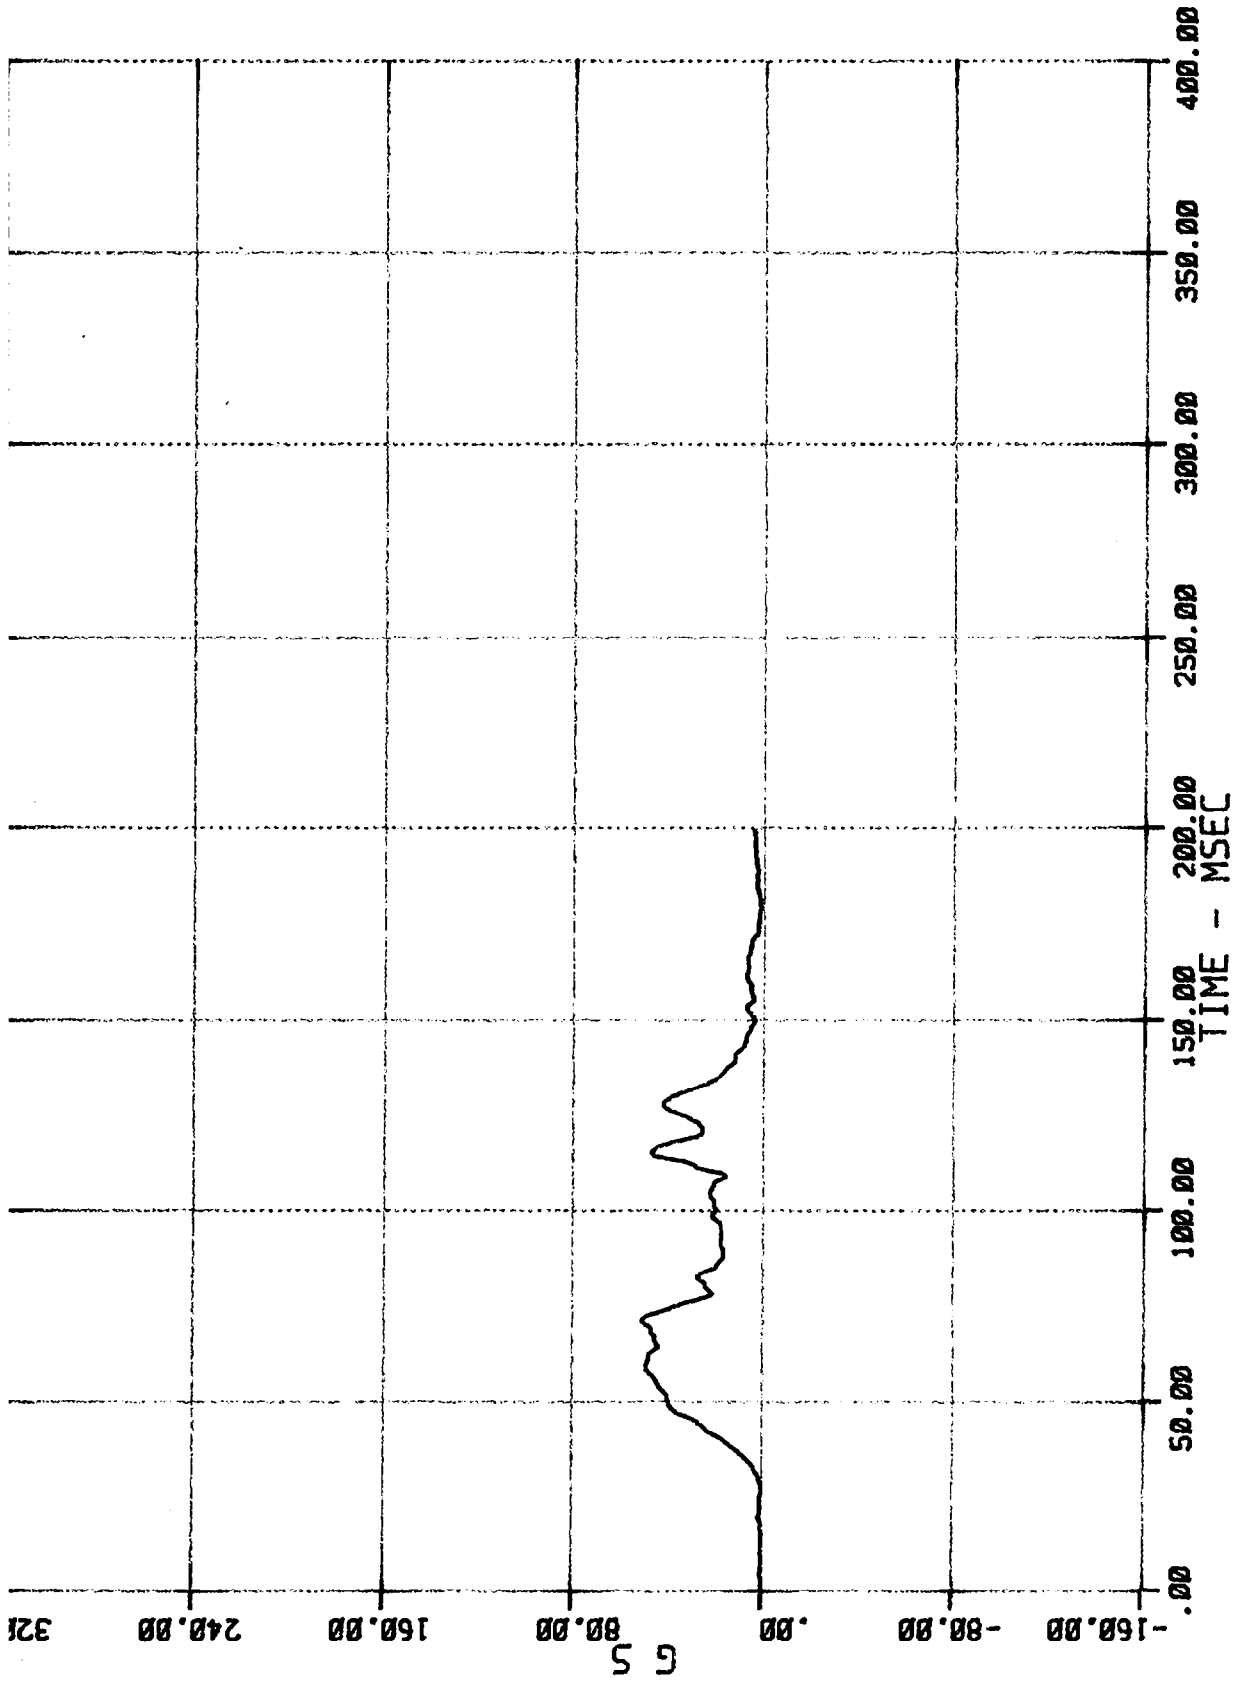


PA CST RES 10
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

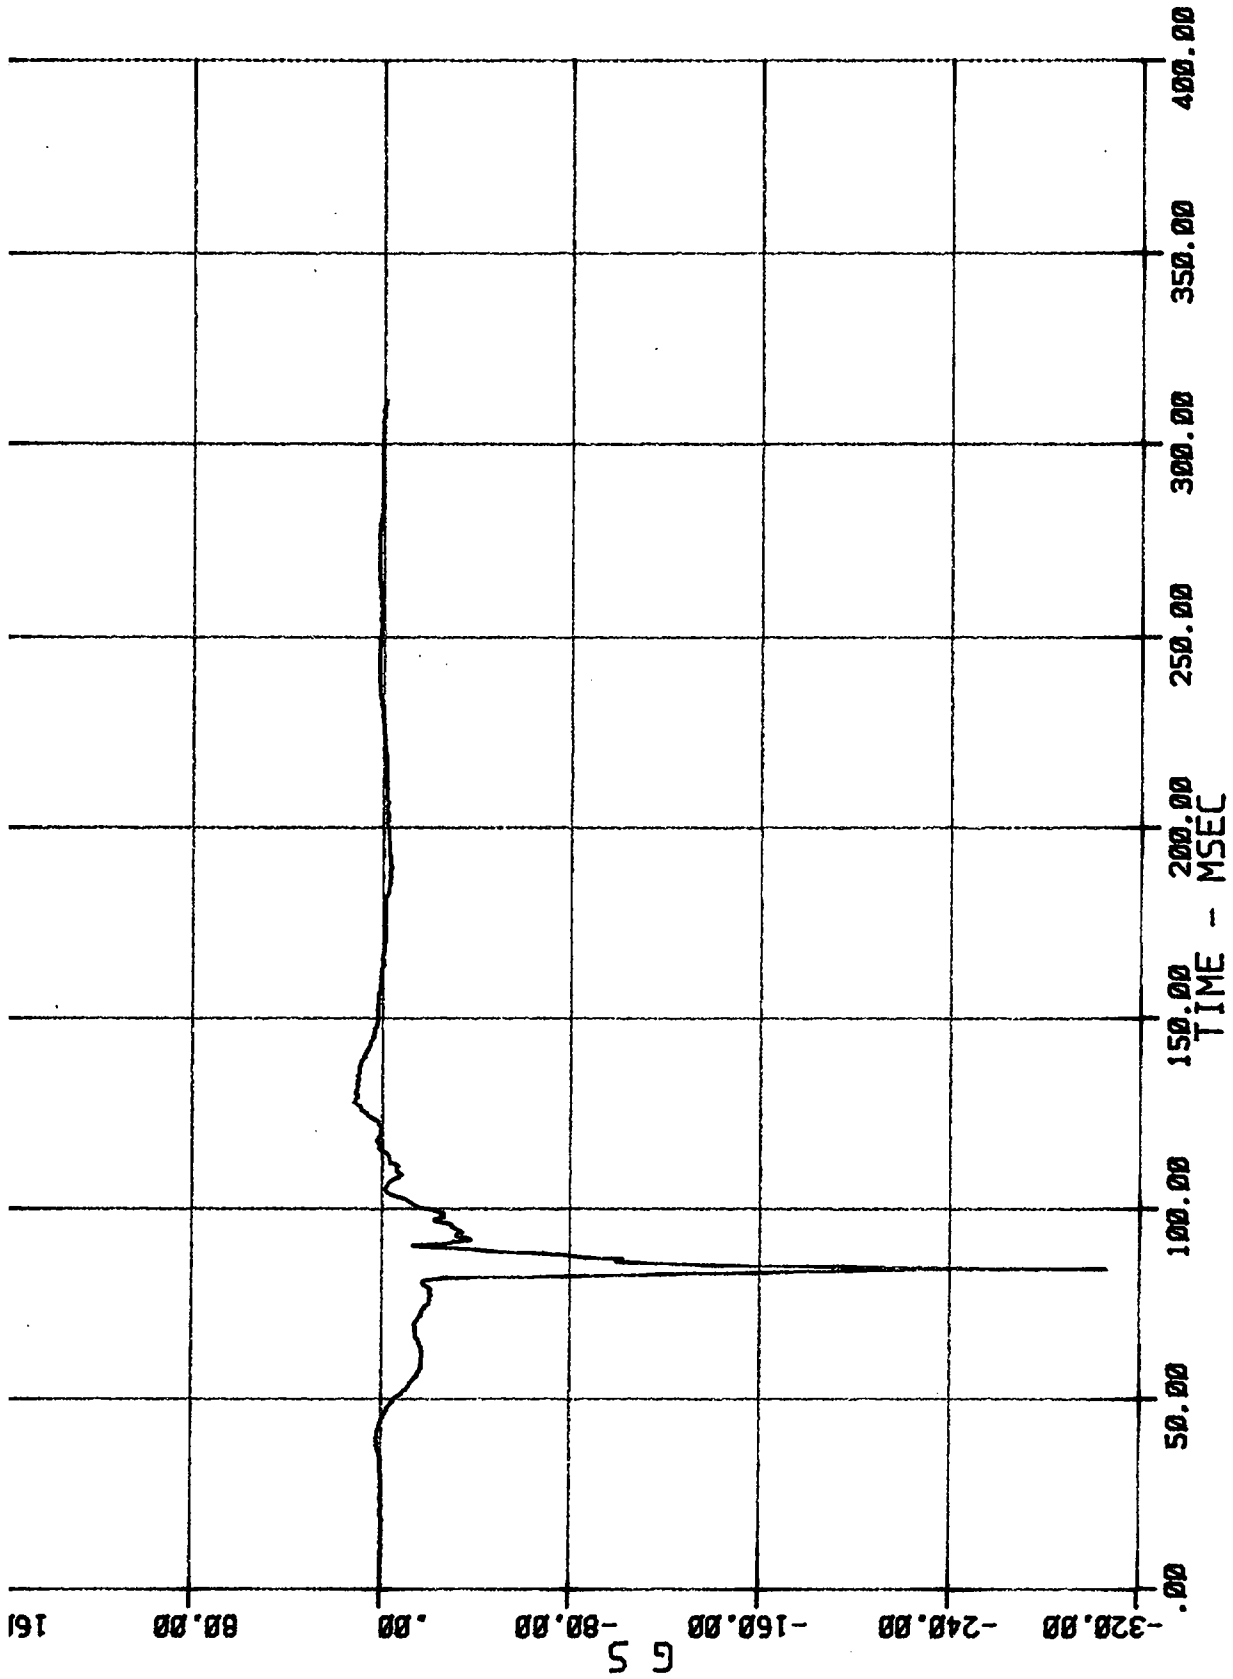


01 AC 01 1 HED X
 MSE N99043 1983 MITSUBISHI MONTERO


06/22/83

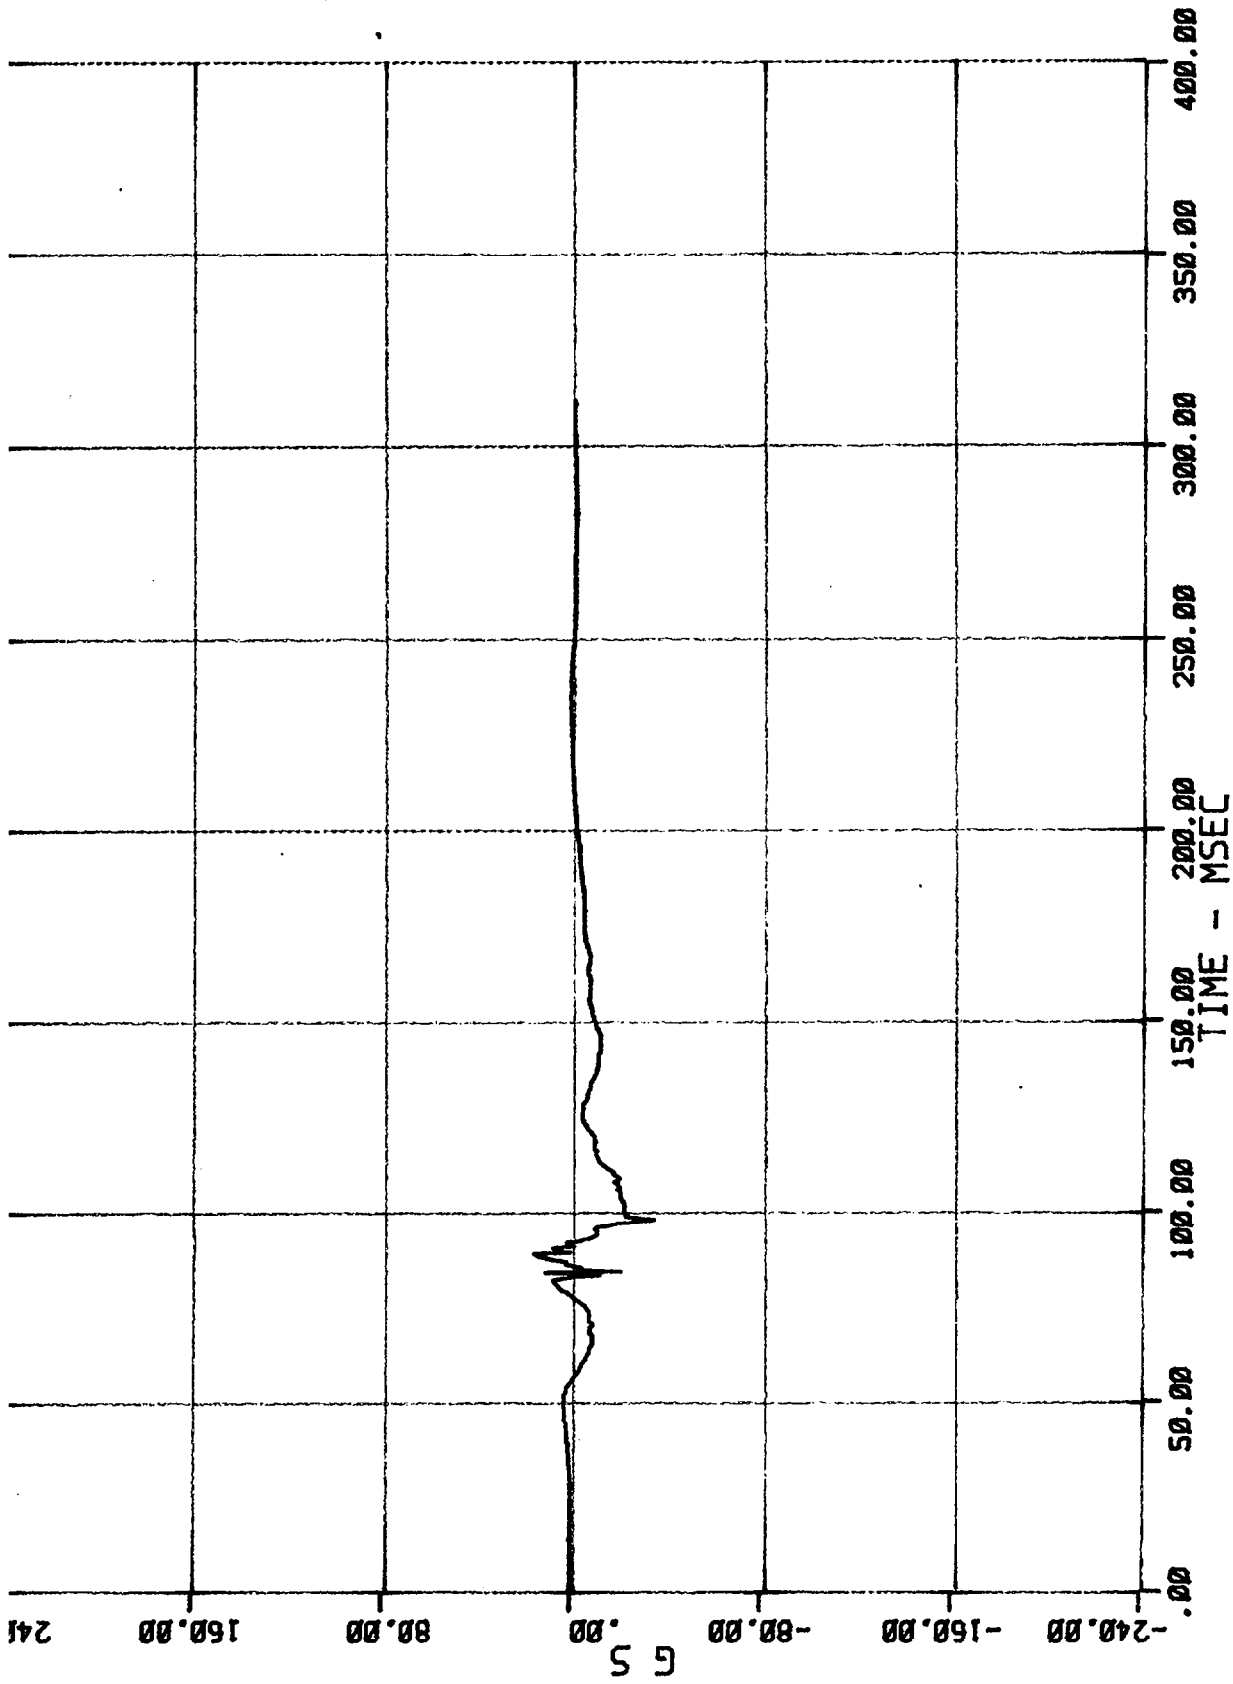

02 AC 01 1 HED Y
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

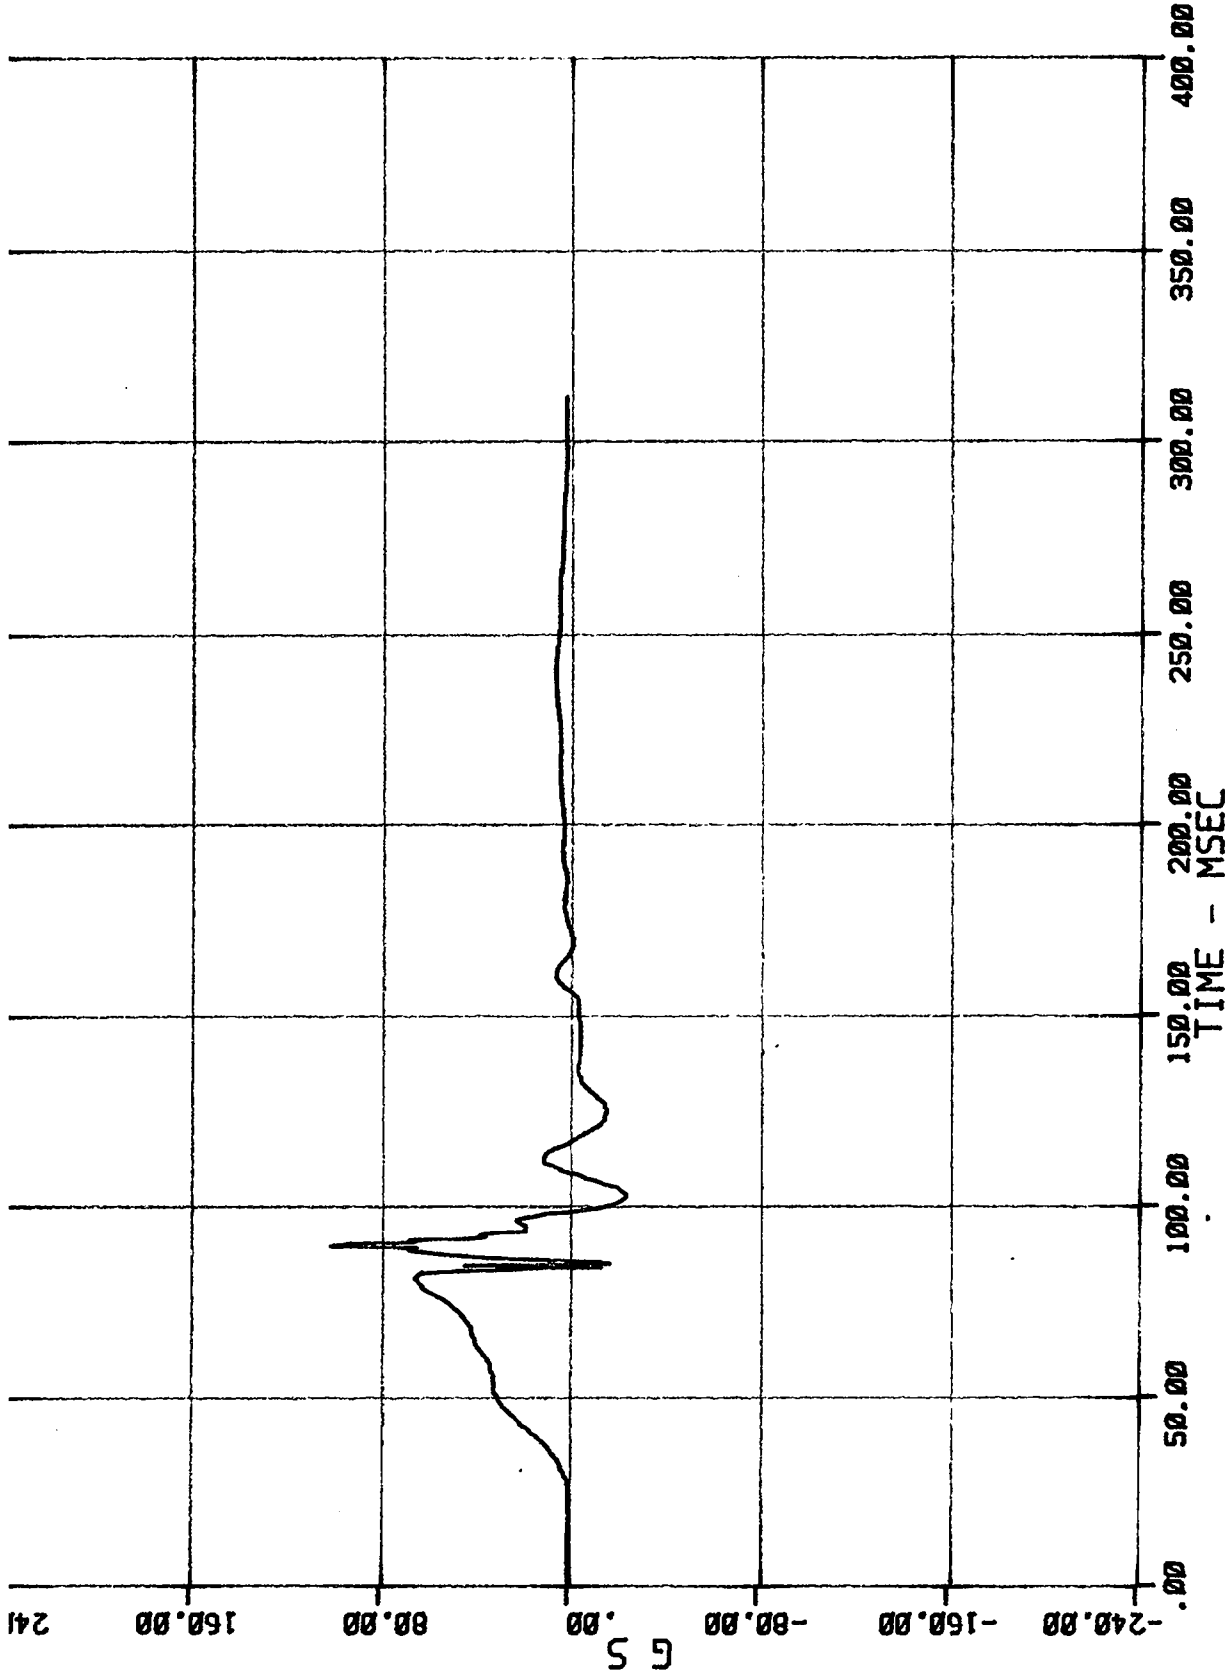


03 AC 01 1 HED Z
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

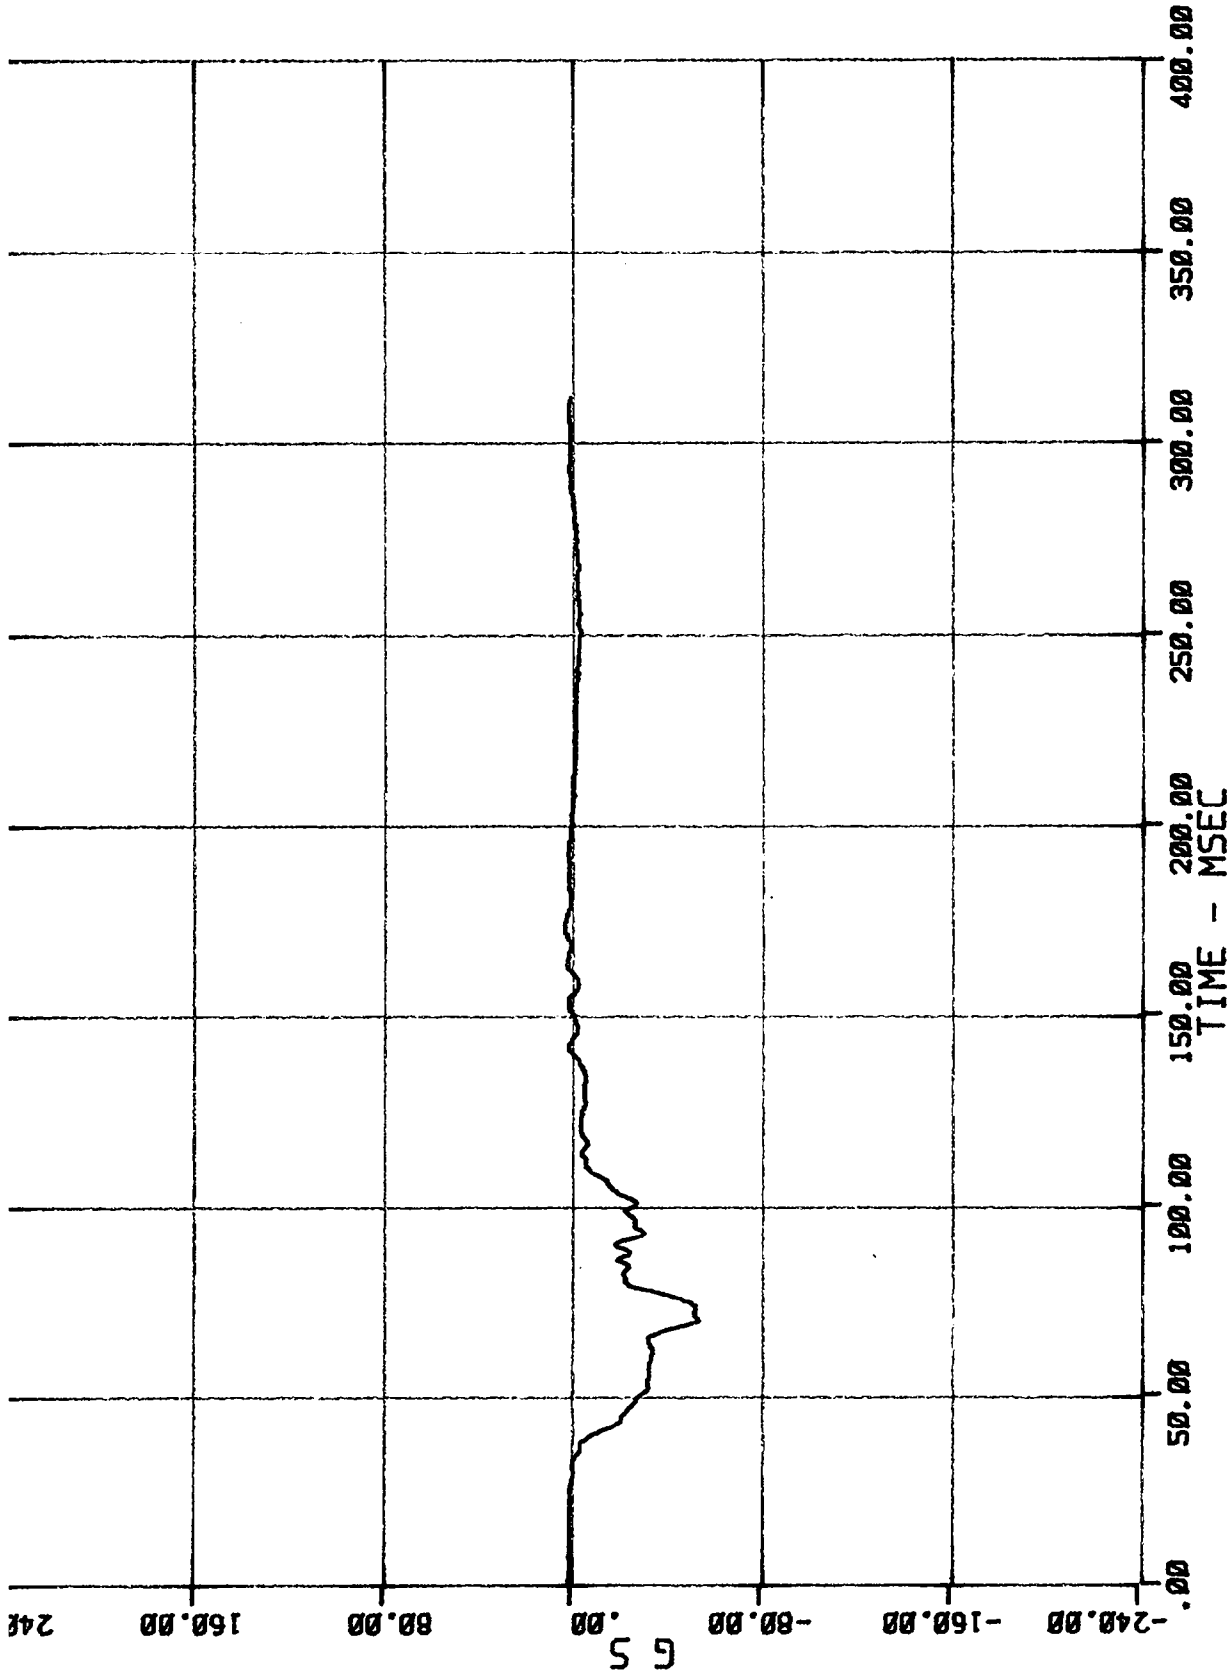


04 AC 01 1 CST X
 MSE N99043

1983 MITSUBISHI MONTERO


06/22/83

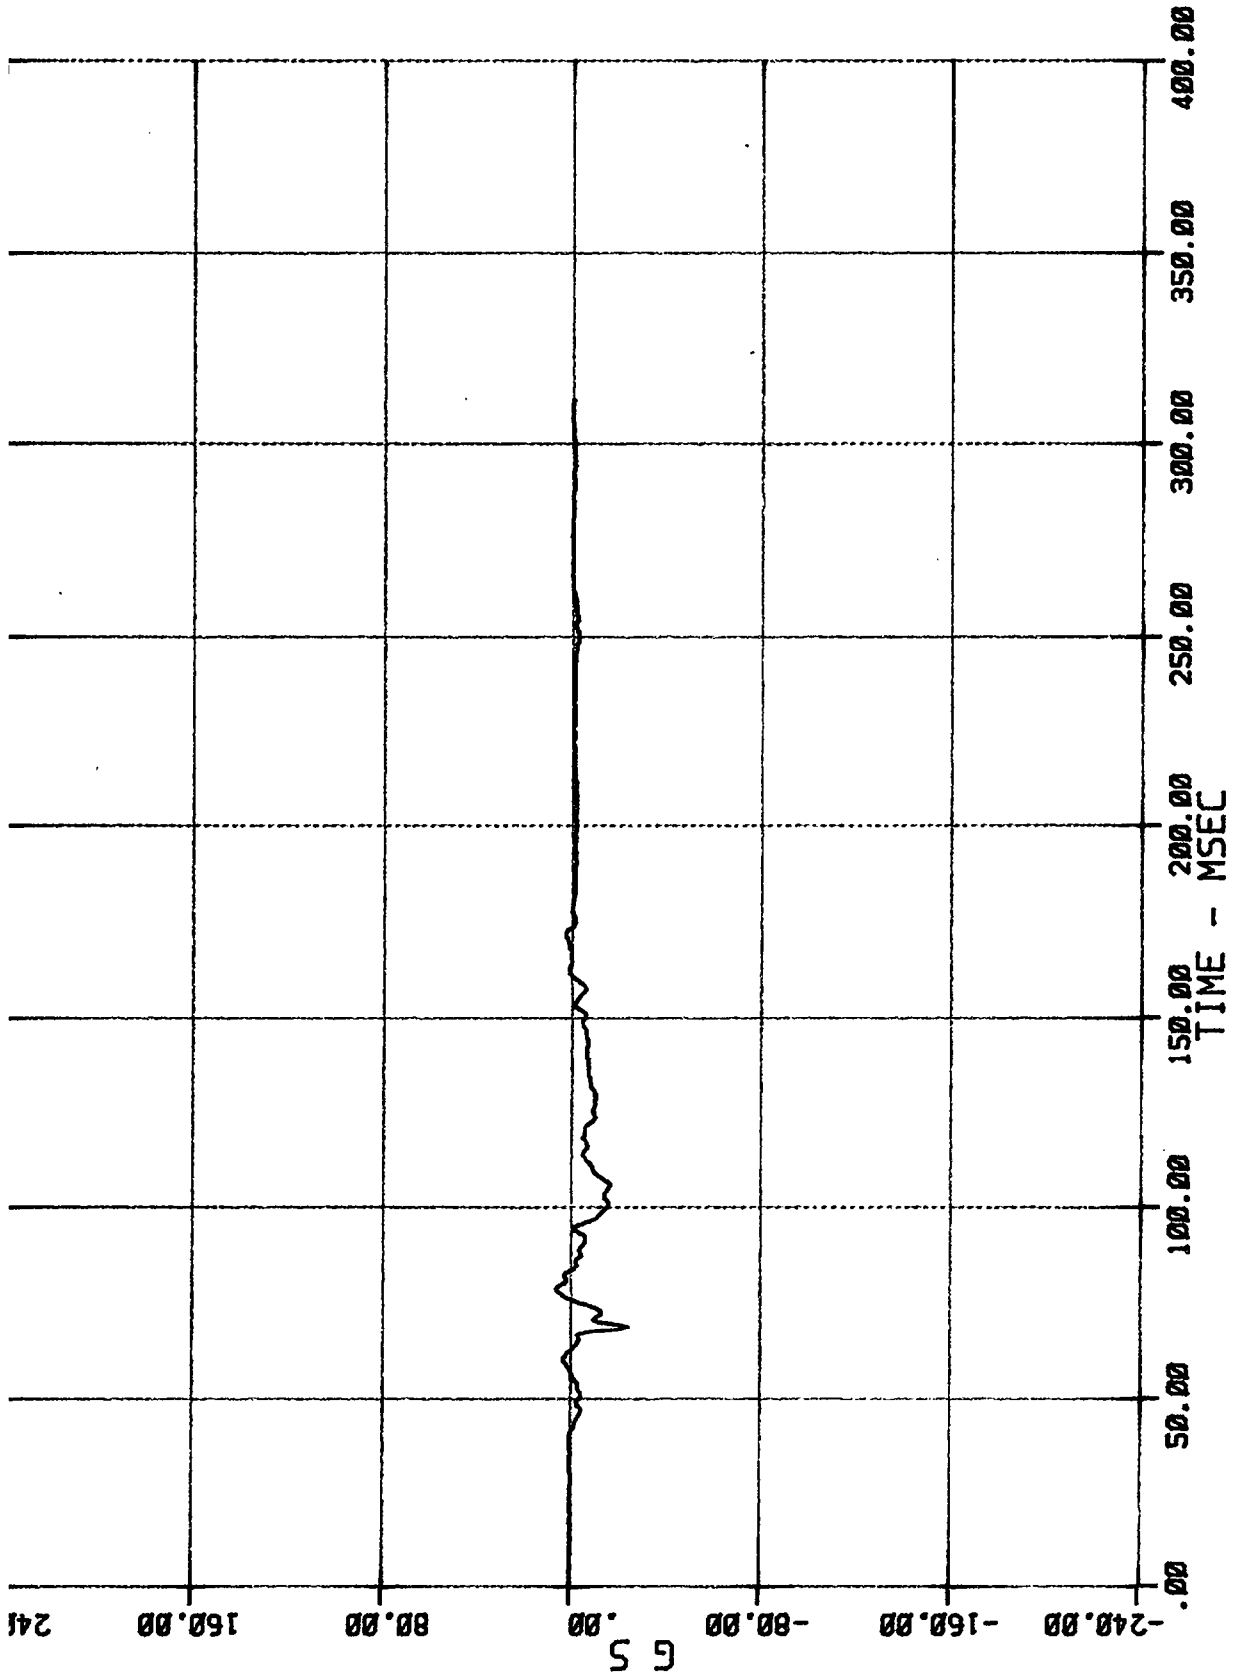

05 AC 01 1 CST Y
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

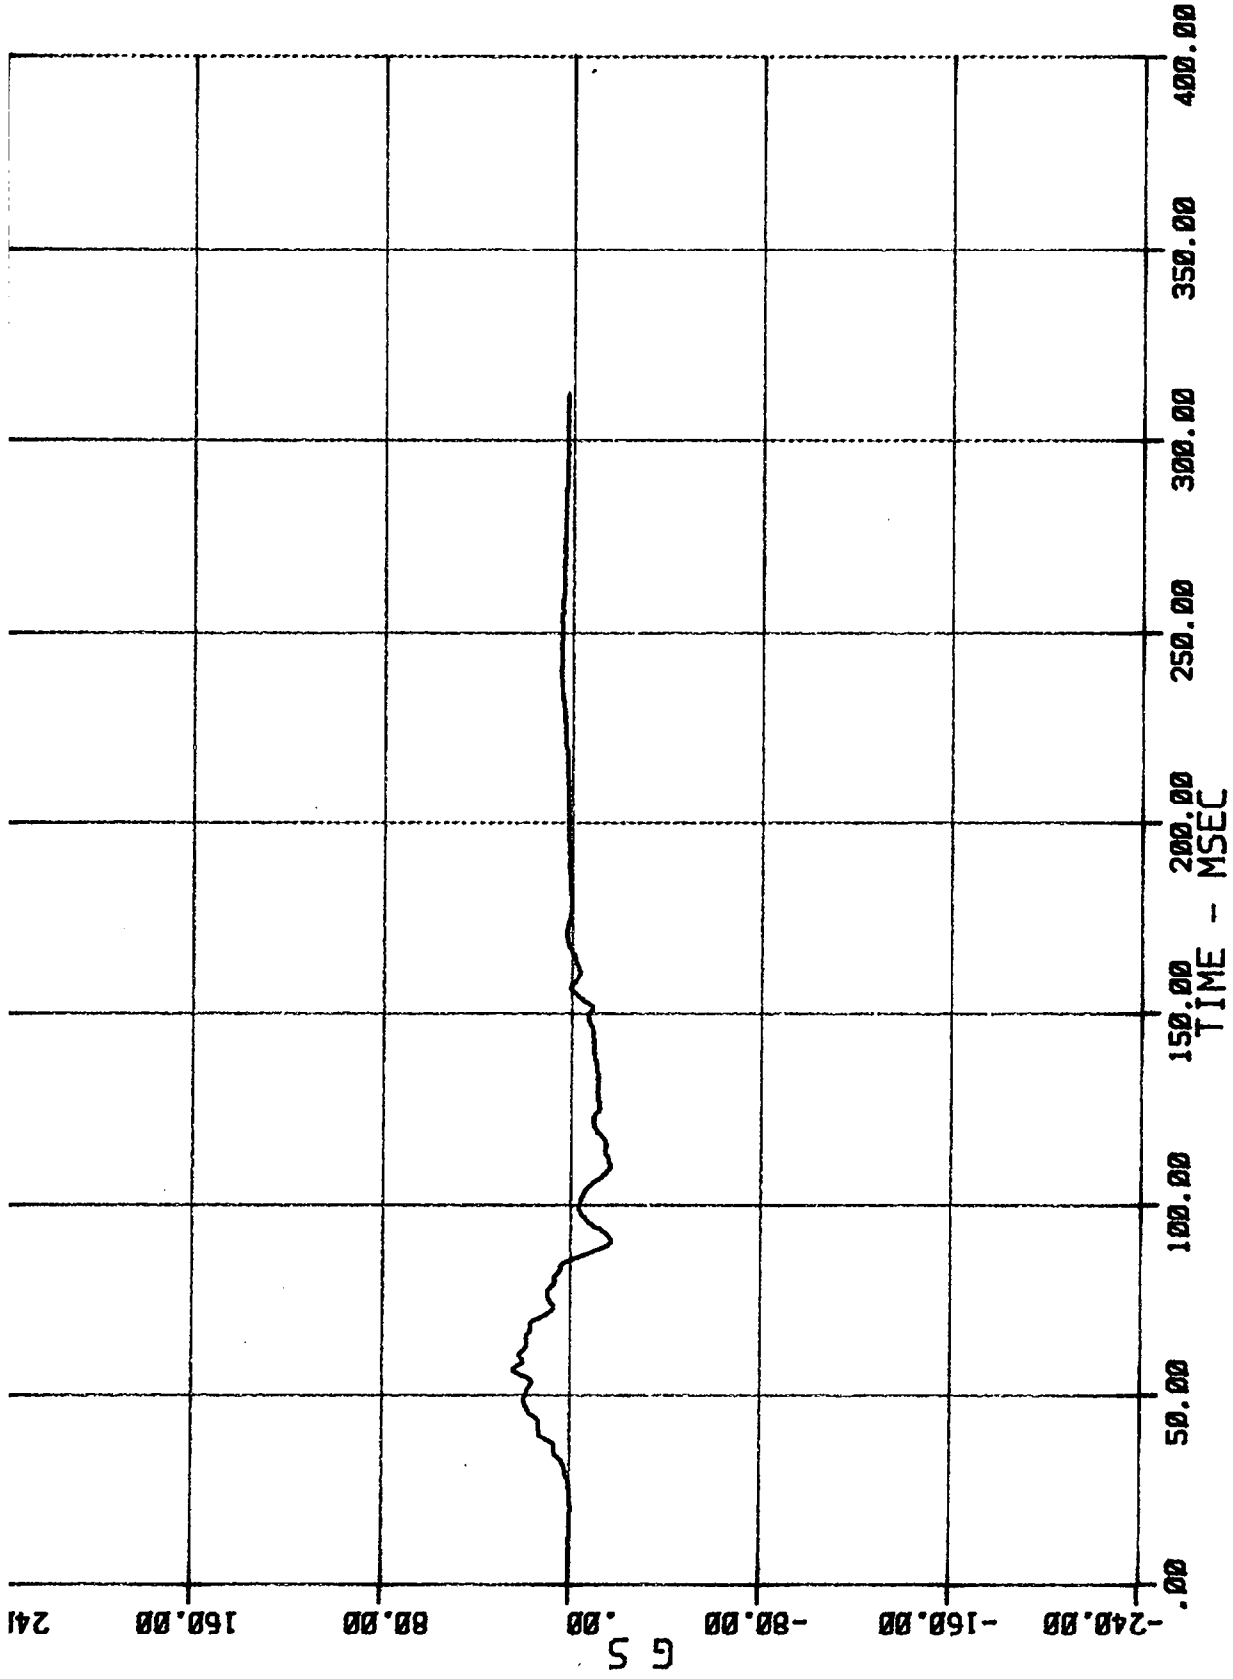


06 AC 01 1 CST Z
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

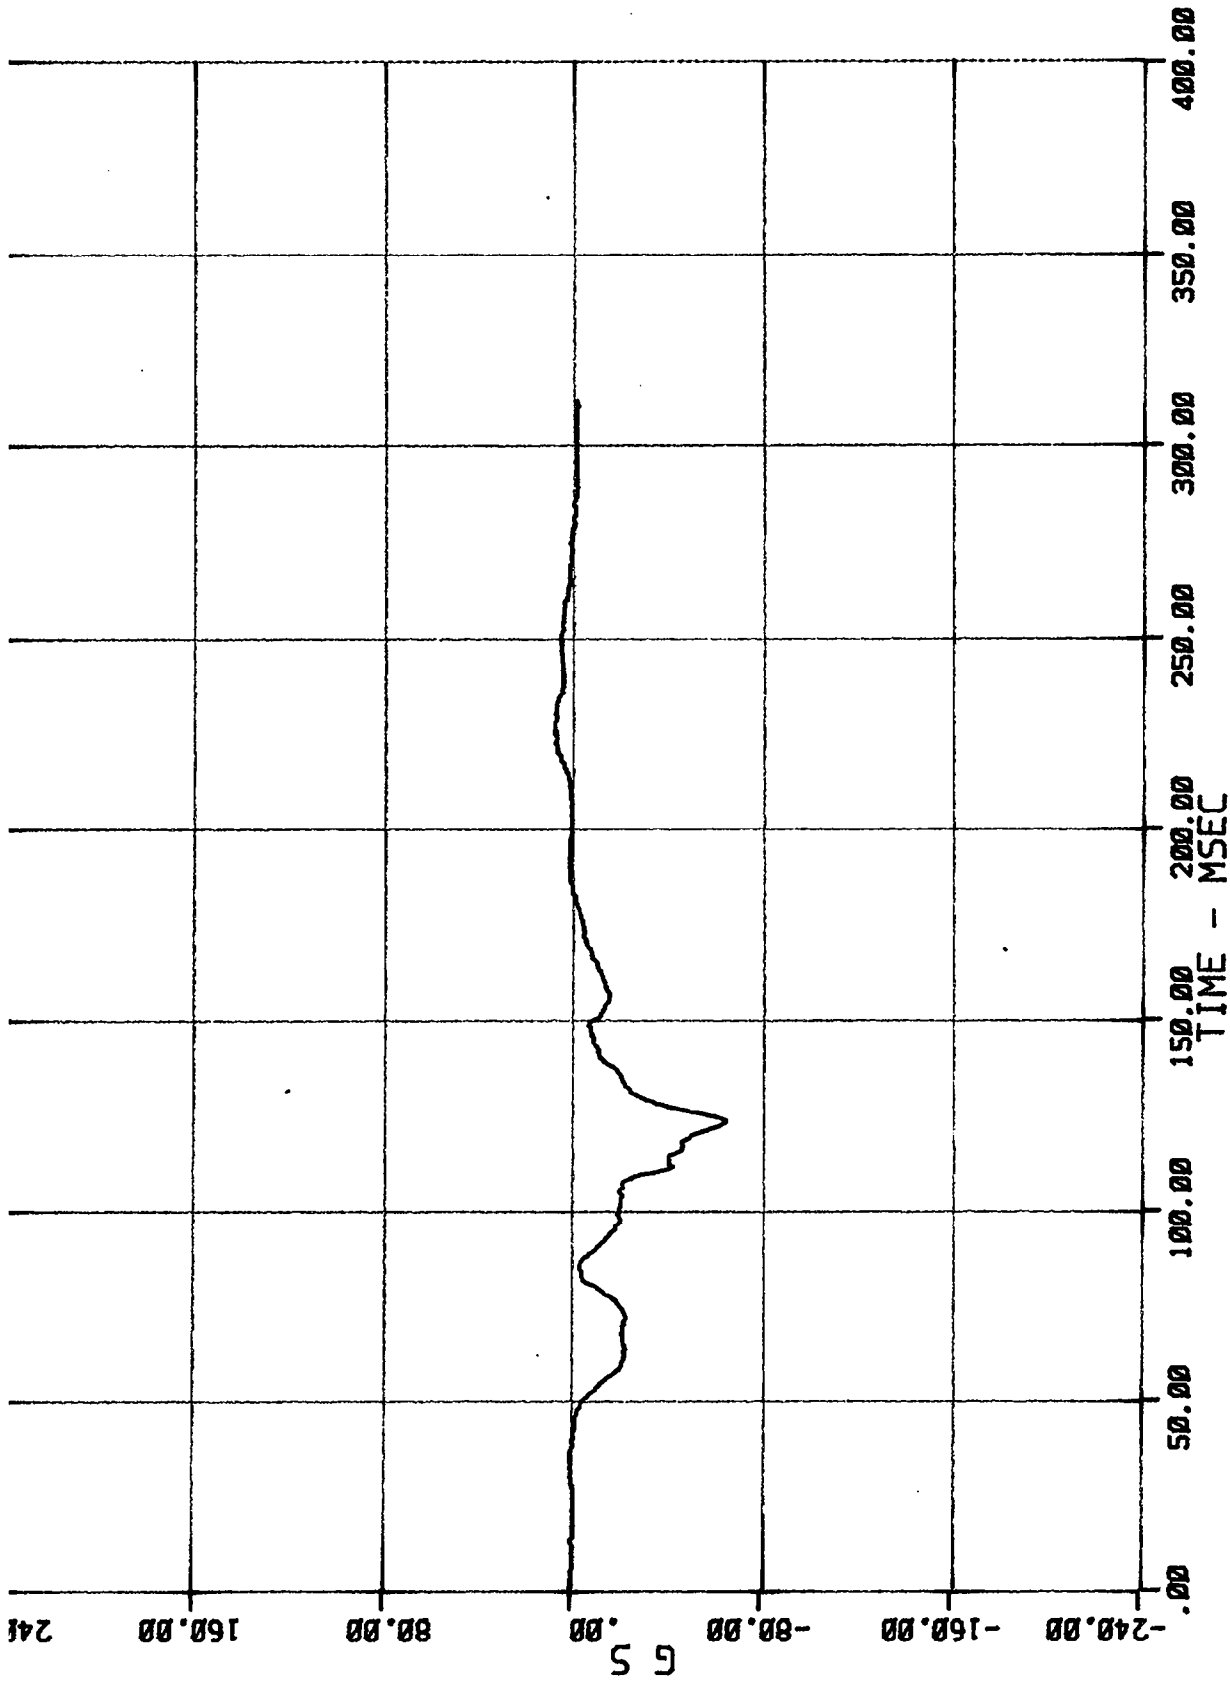


07 AC 01 2 HED X

MSE N99043 1983 MITSUBISHI MONTERO


06/22/83

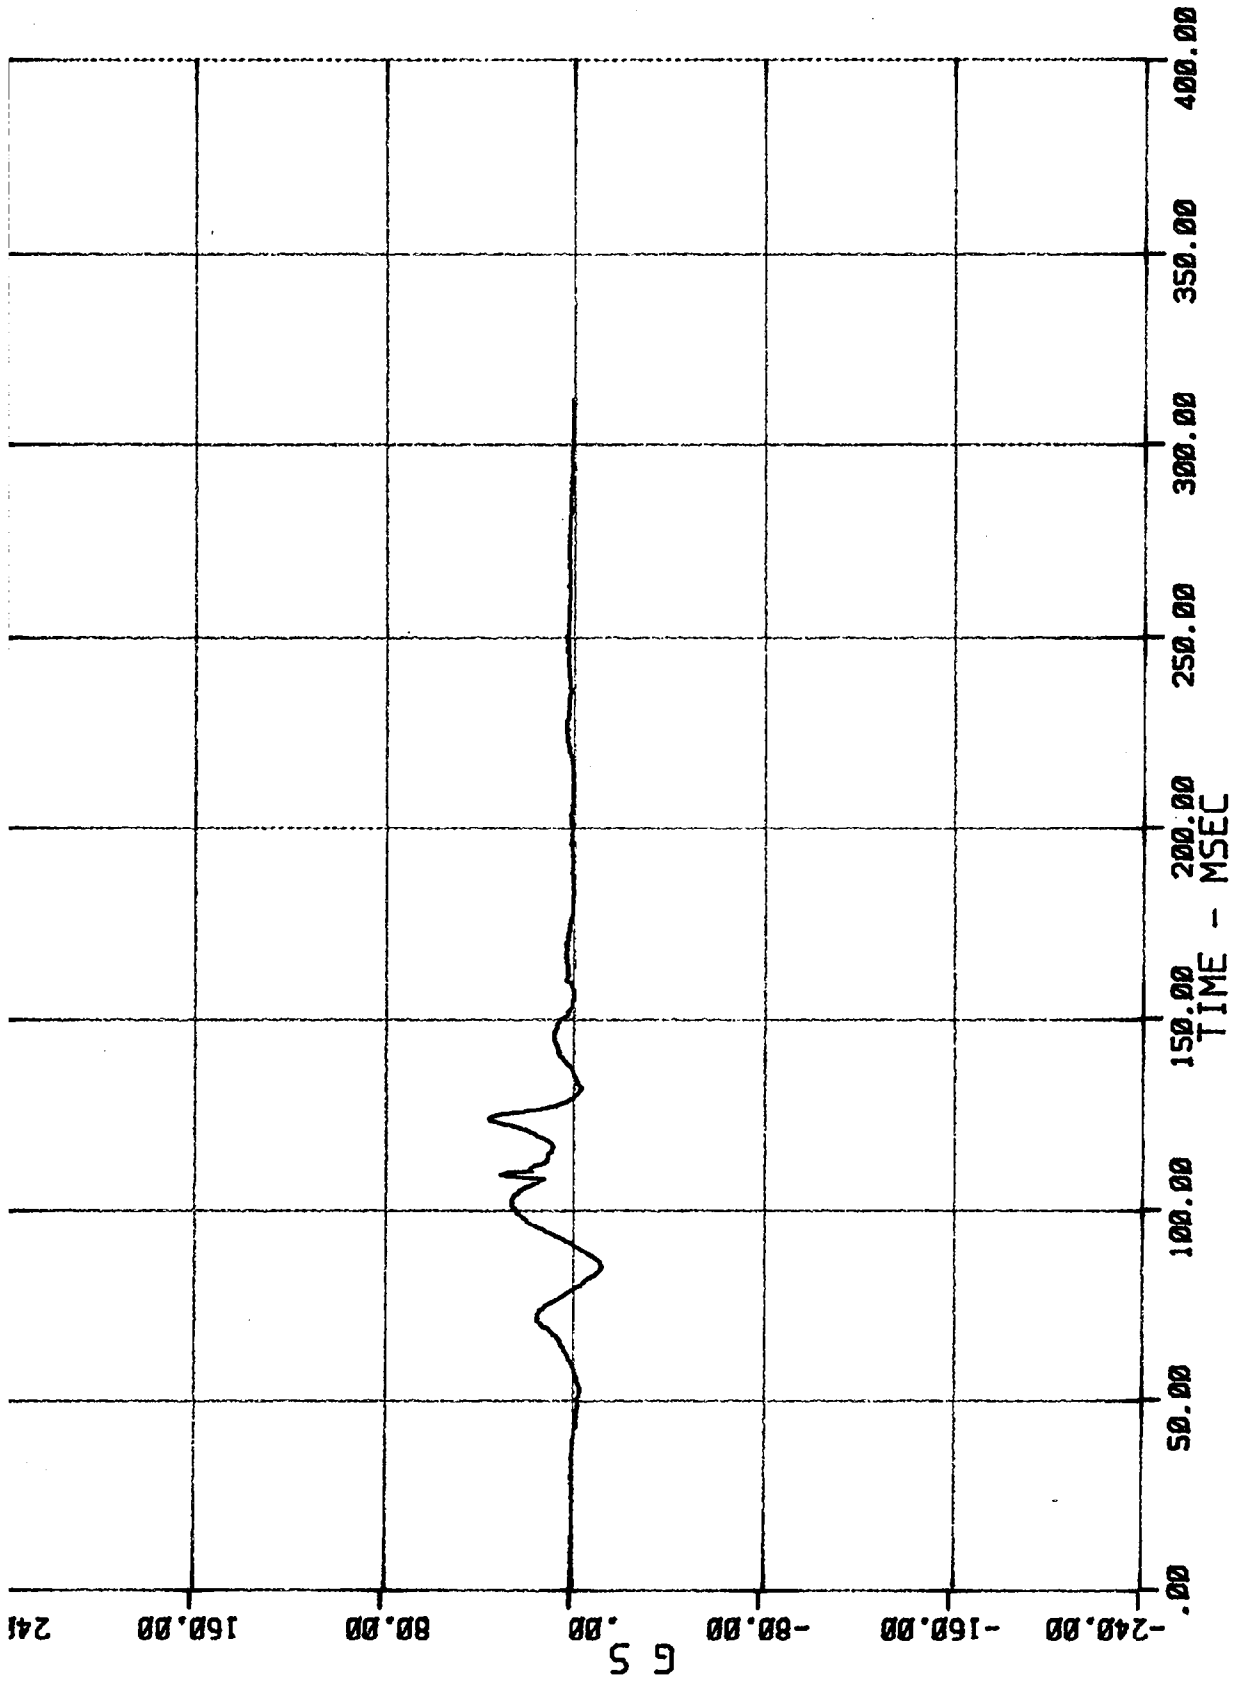


08 AC 01 2 HED Y
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

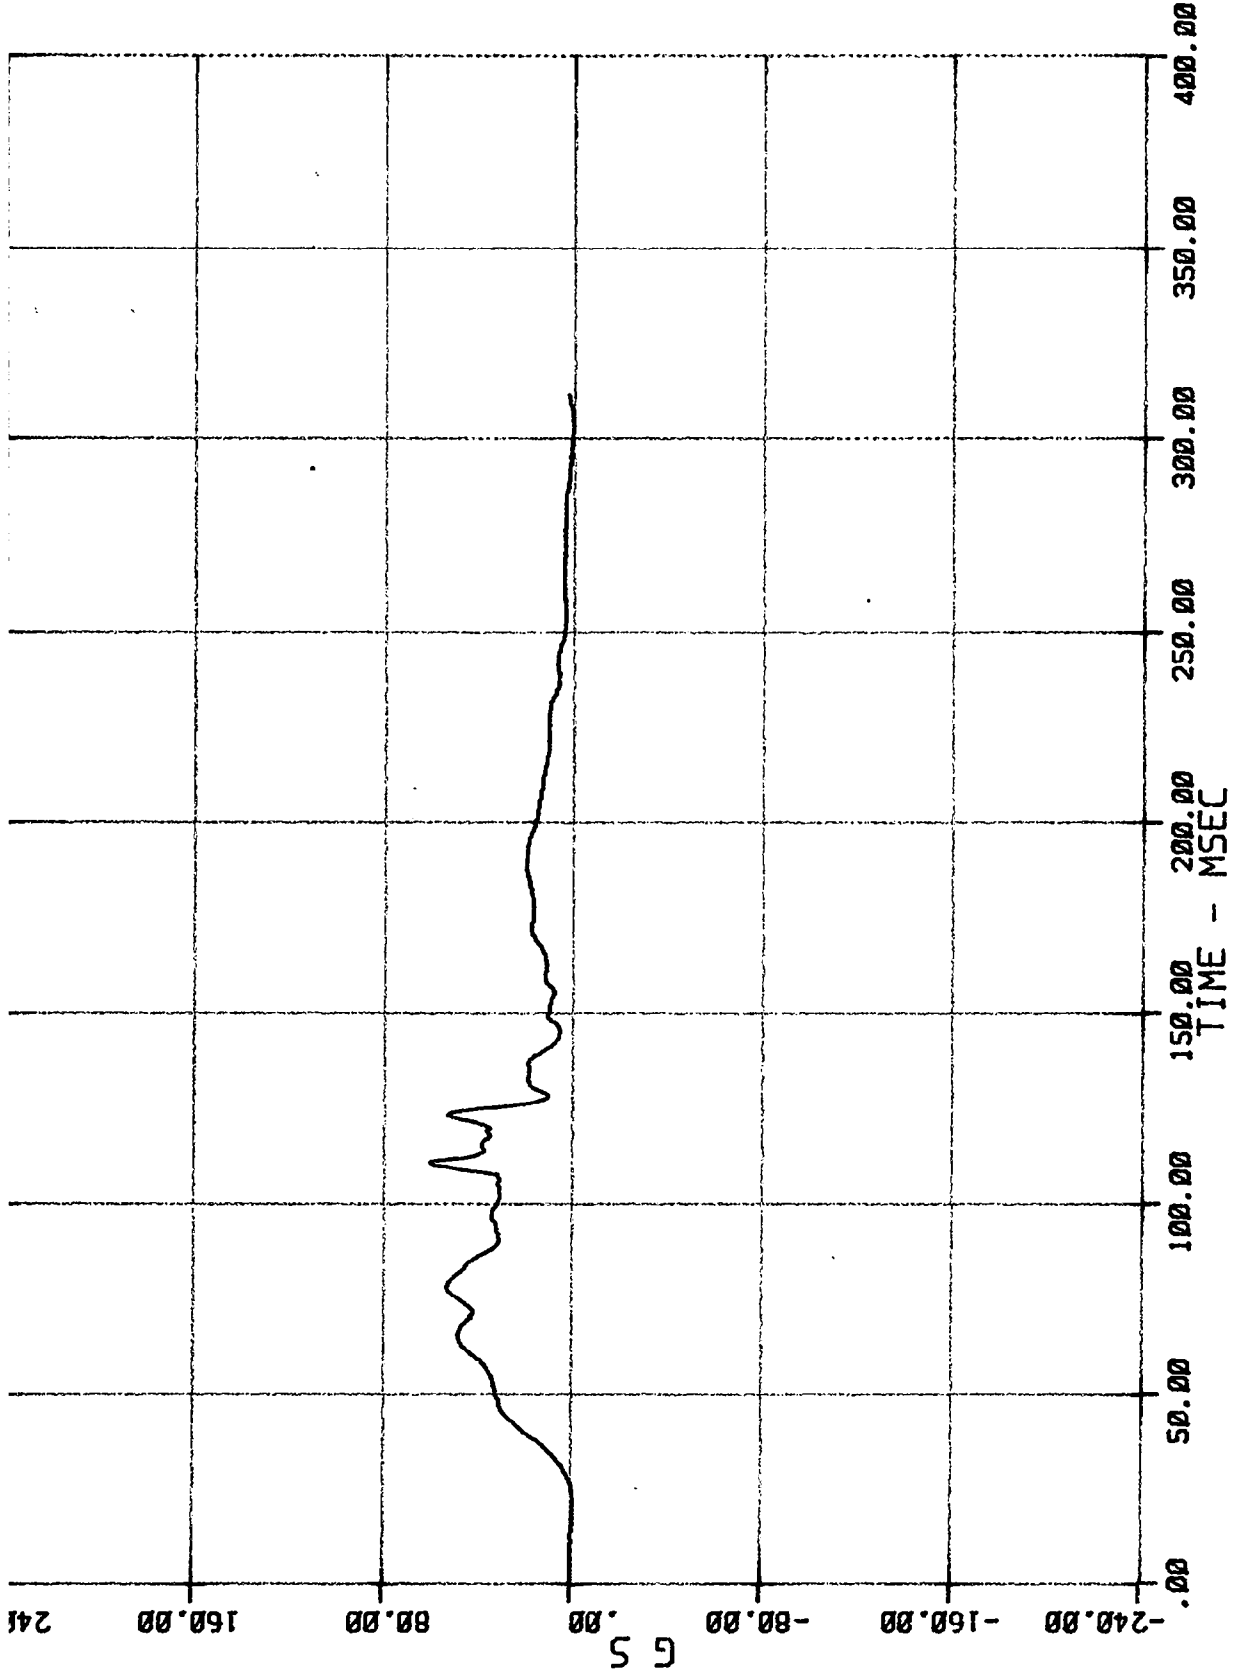


09 AC 01 2 HED Z
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

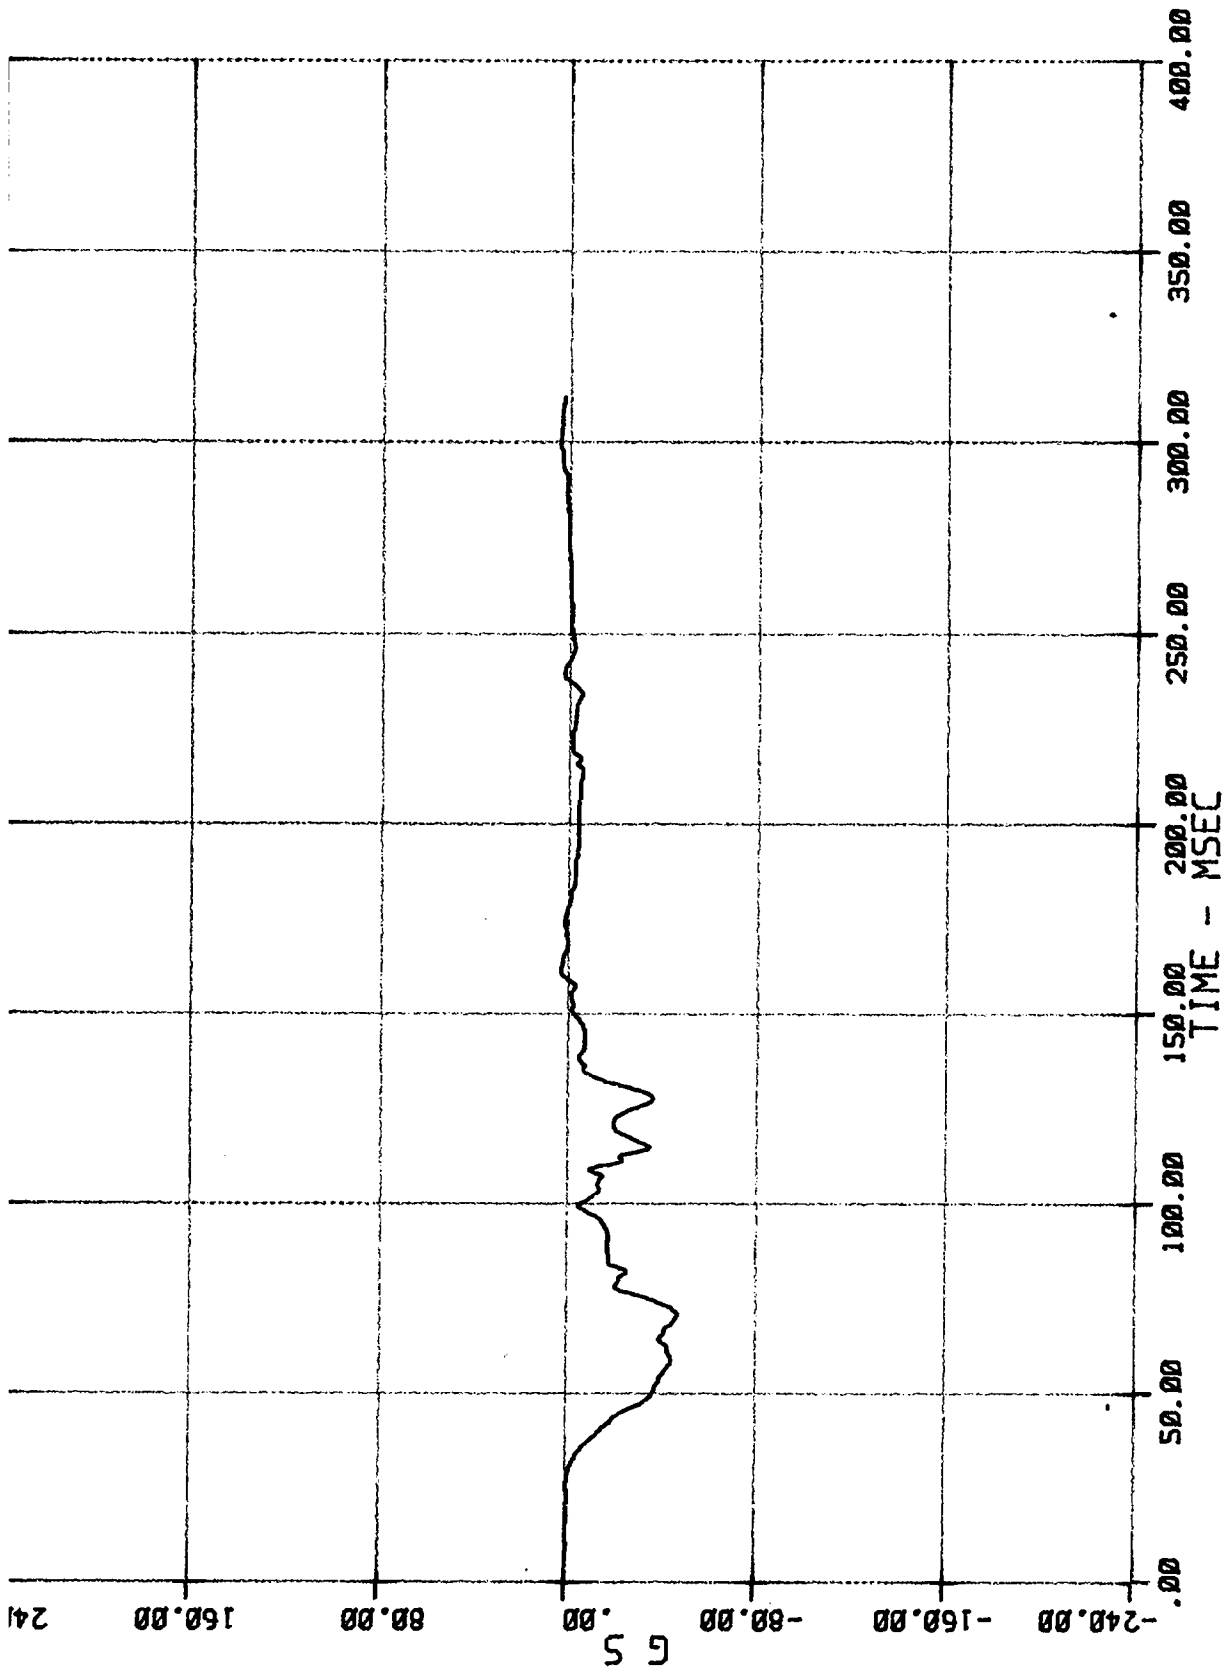


10 AC 01 2 CST X
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

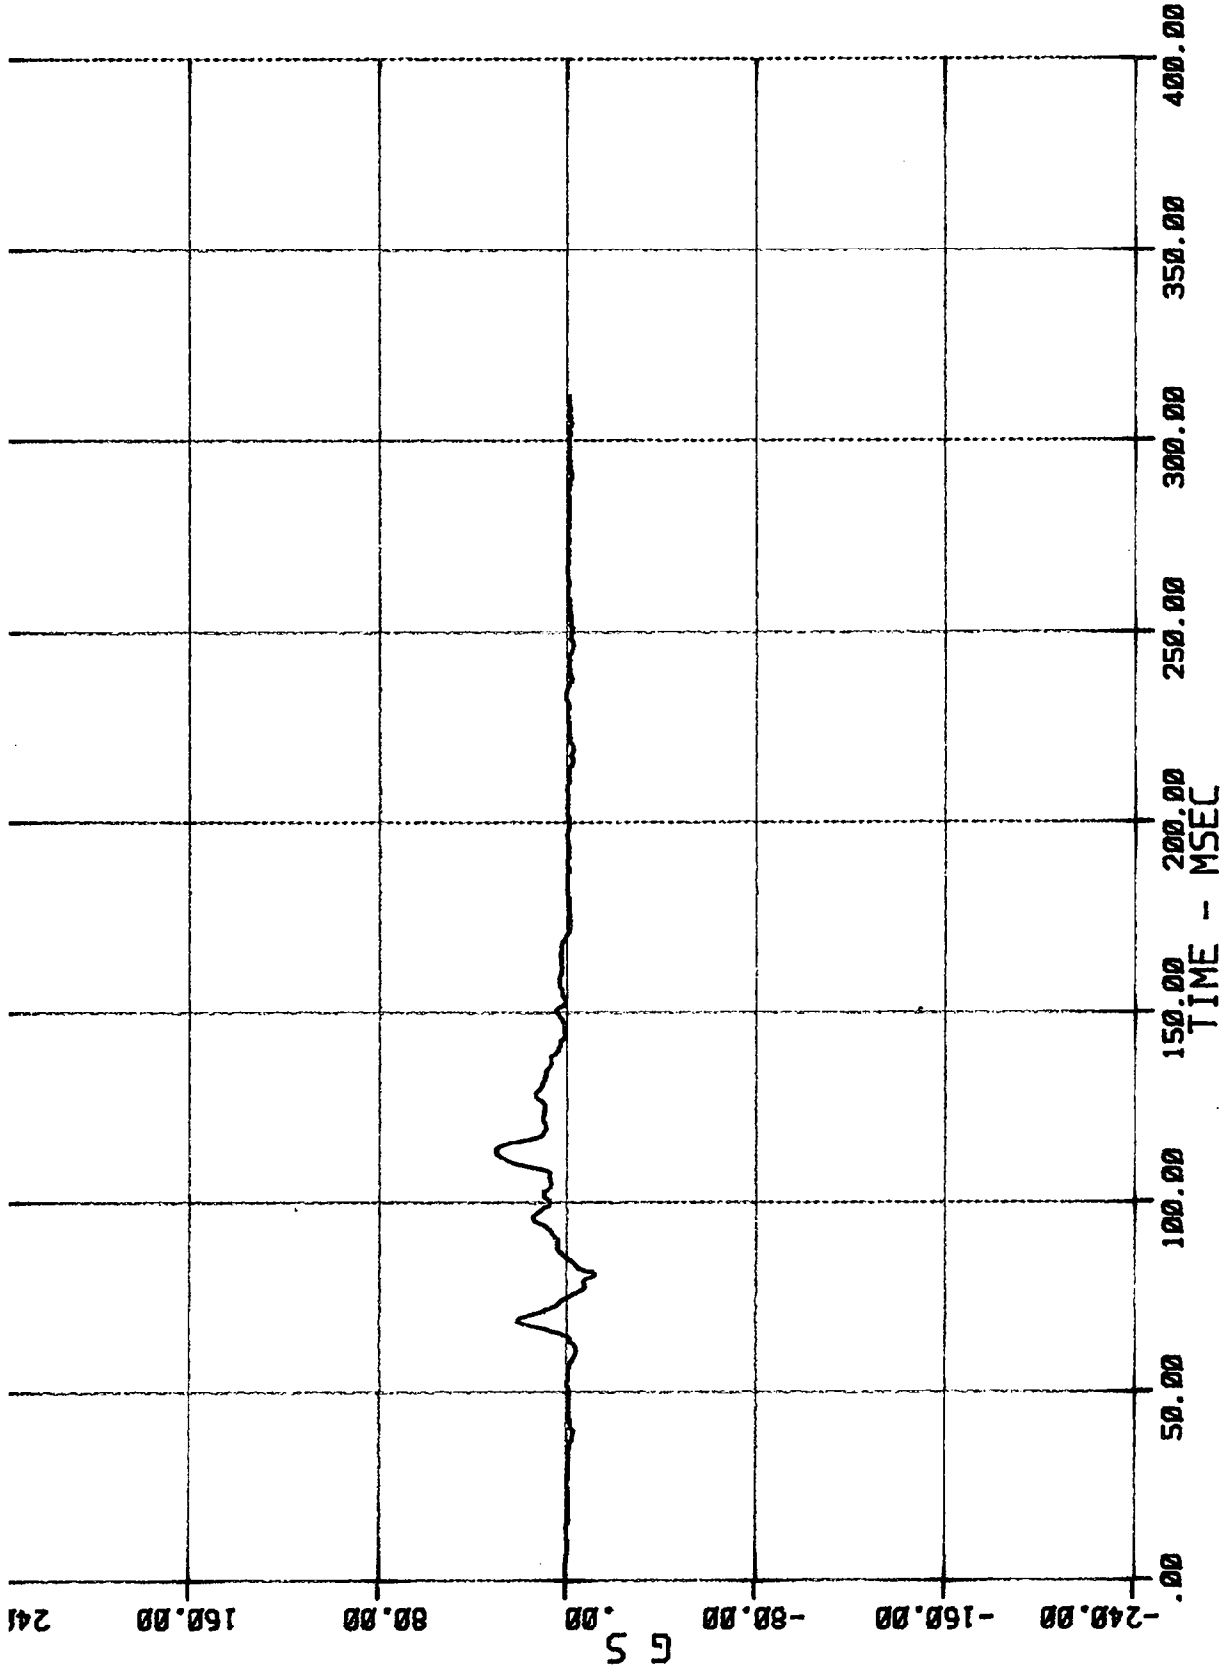


11 AC 01 2 CST Y
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

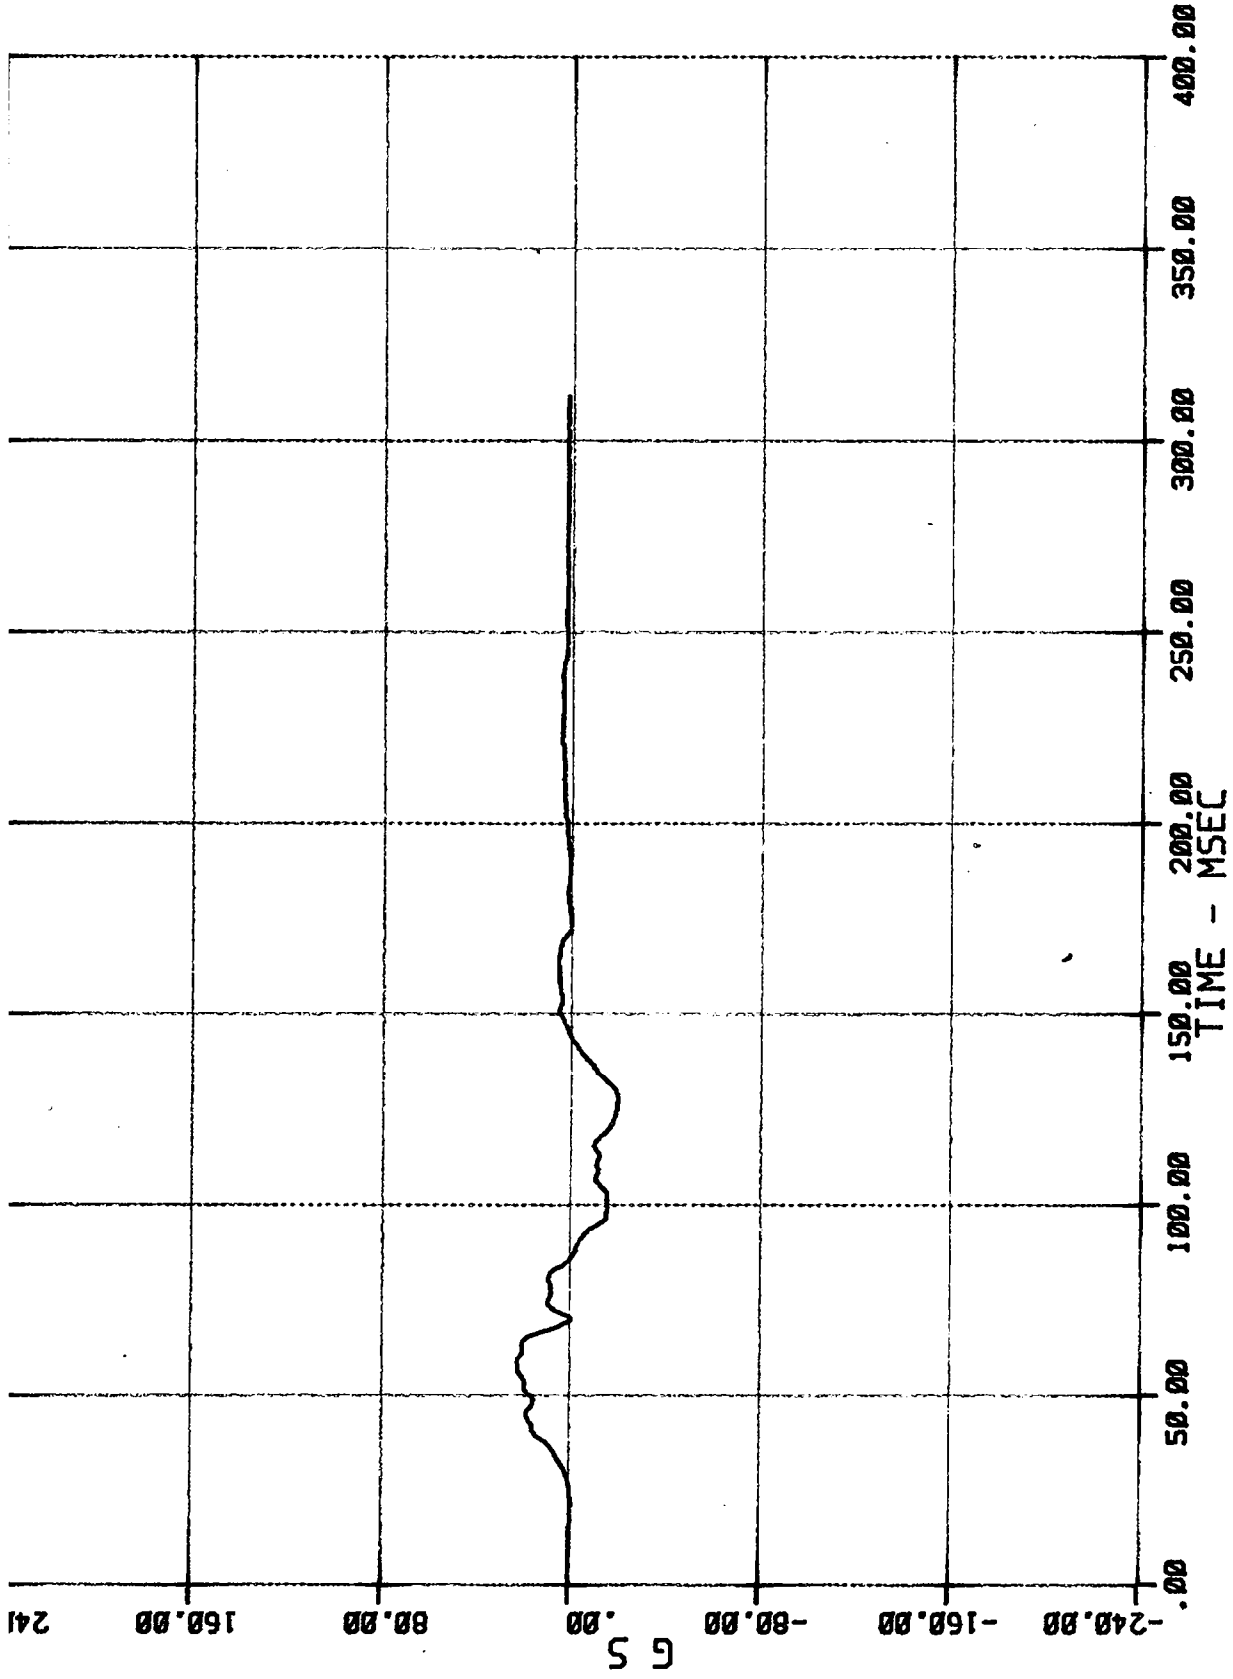

12 AC 01 2 CST Z
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

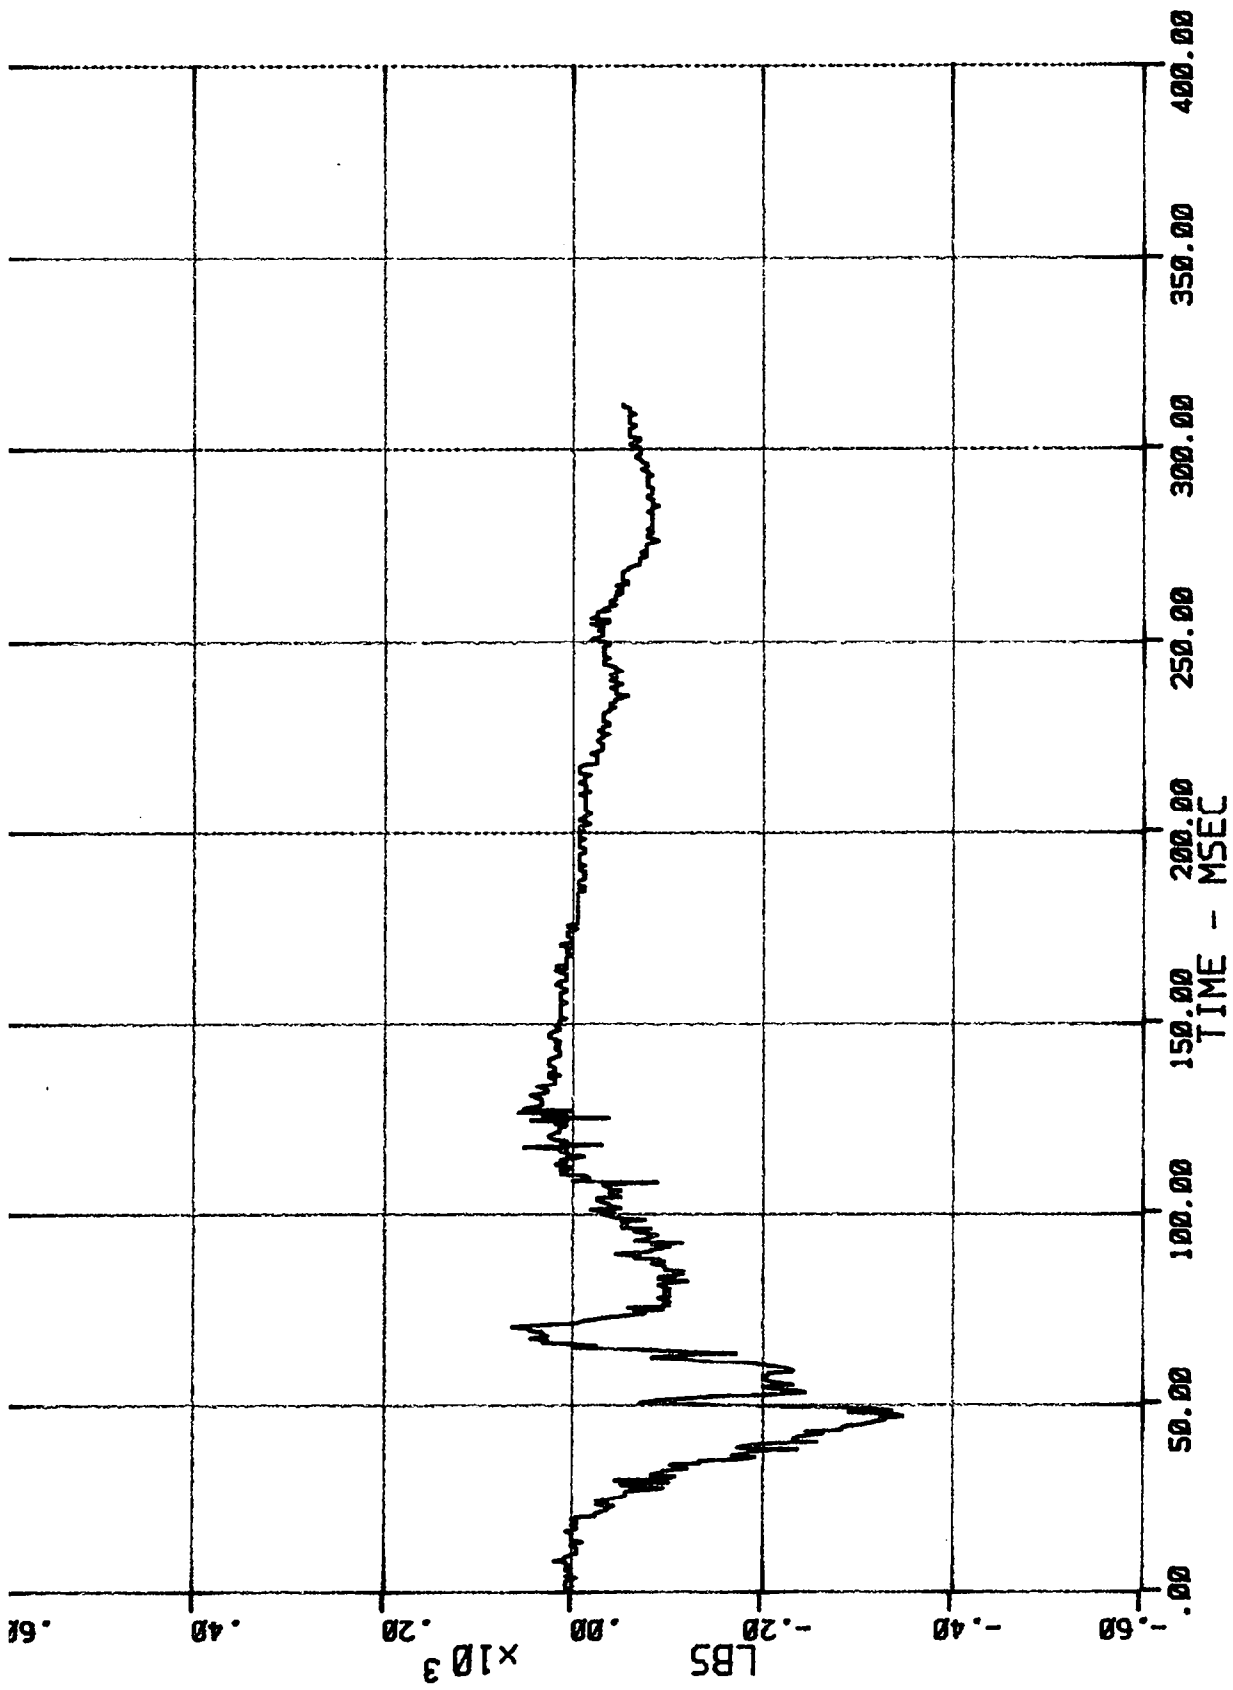


13 LC 01 1 LFM 0
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

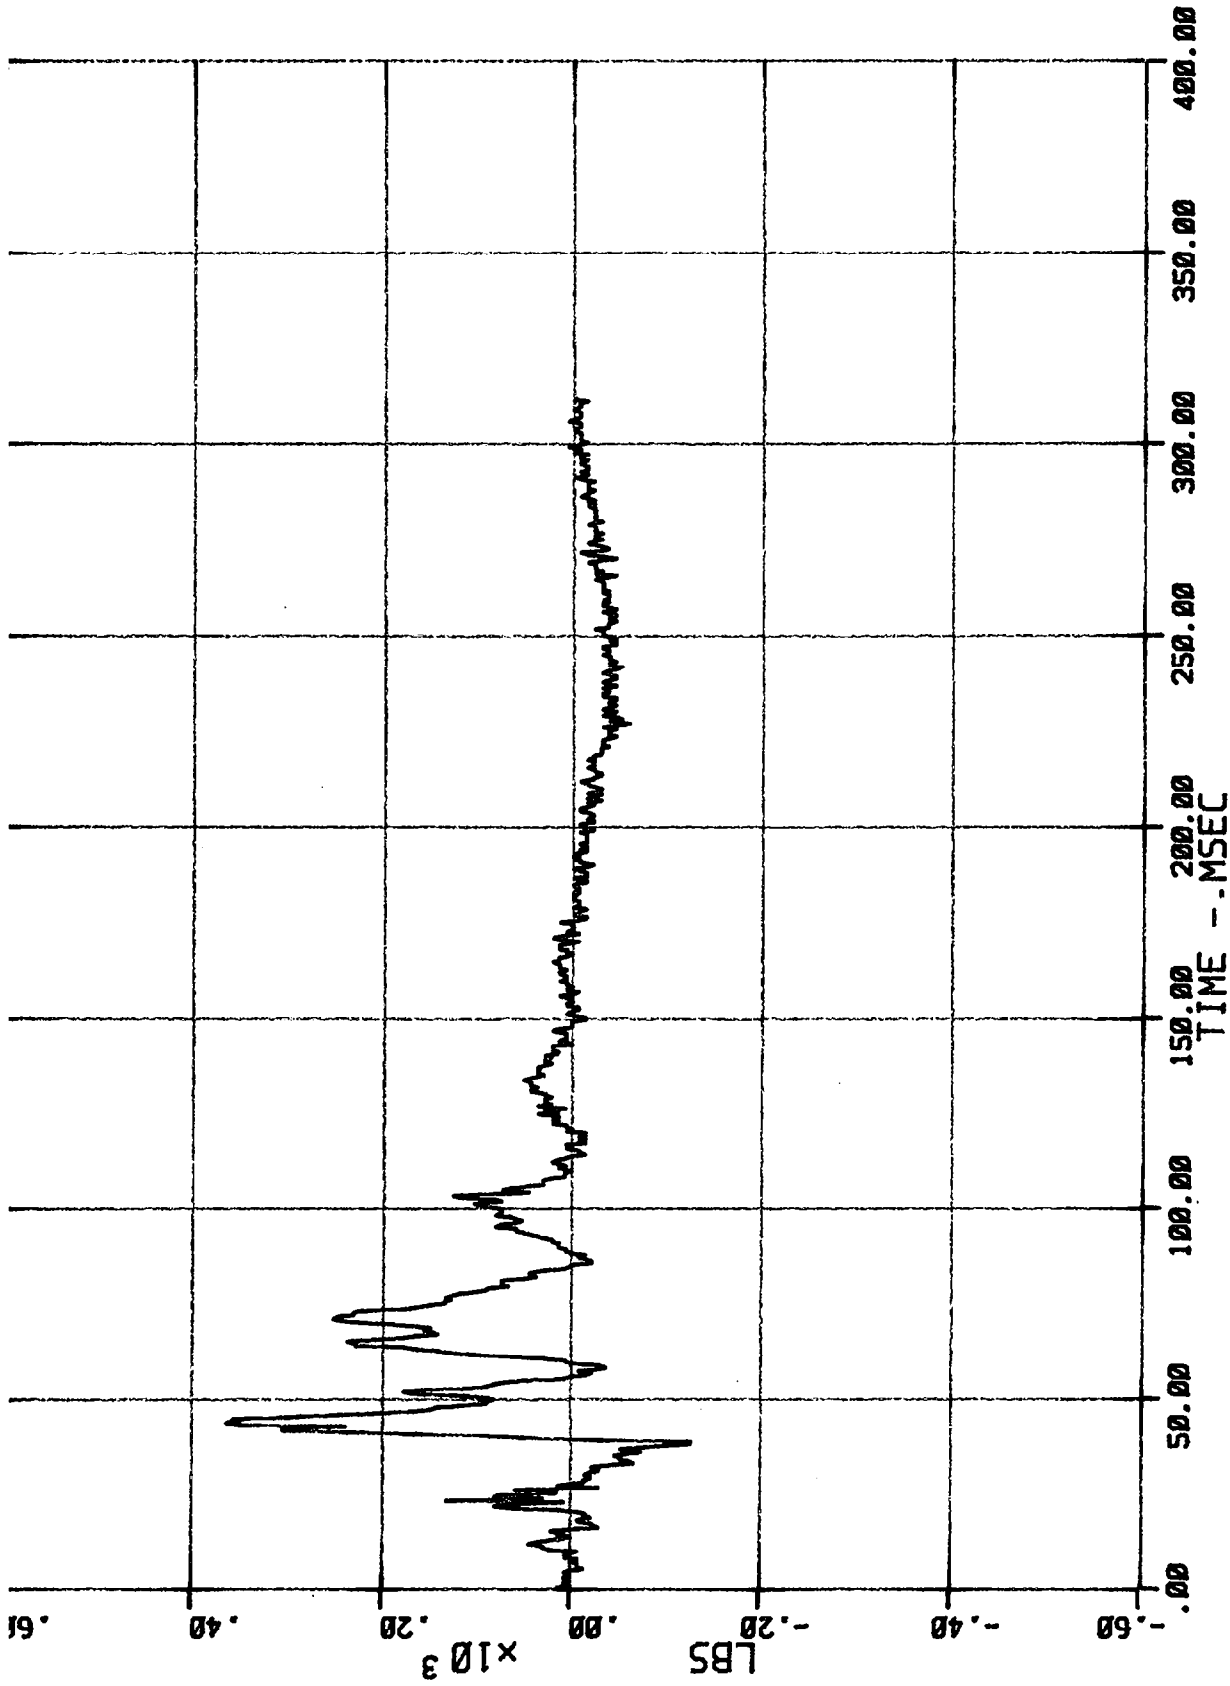


14 LC 01 1 RFM 0

MSE N99043 1983 MITSUBISHI MONTERO


06/22/83

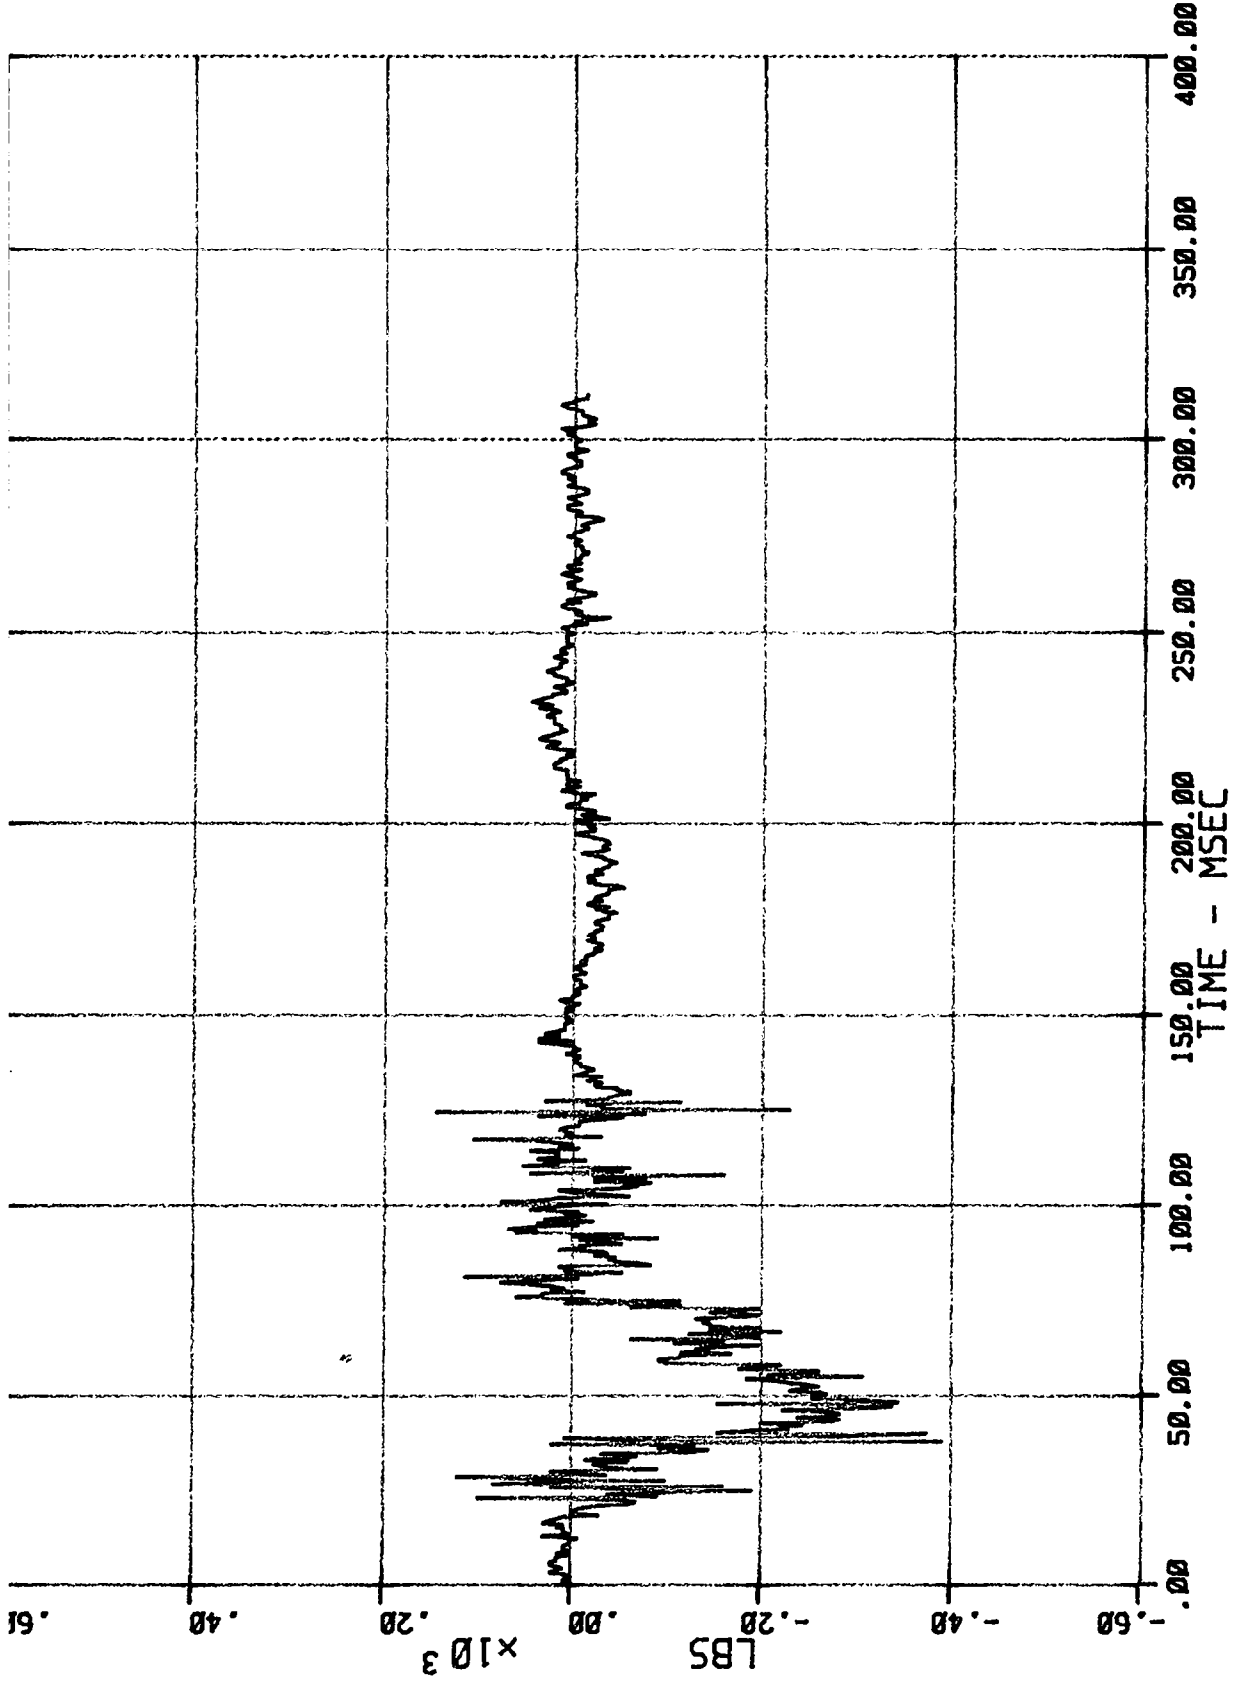


15 LC 01 2 LFM 0
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

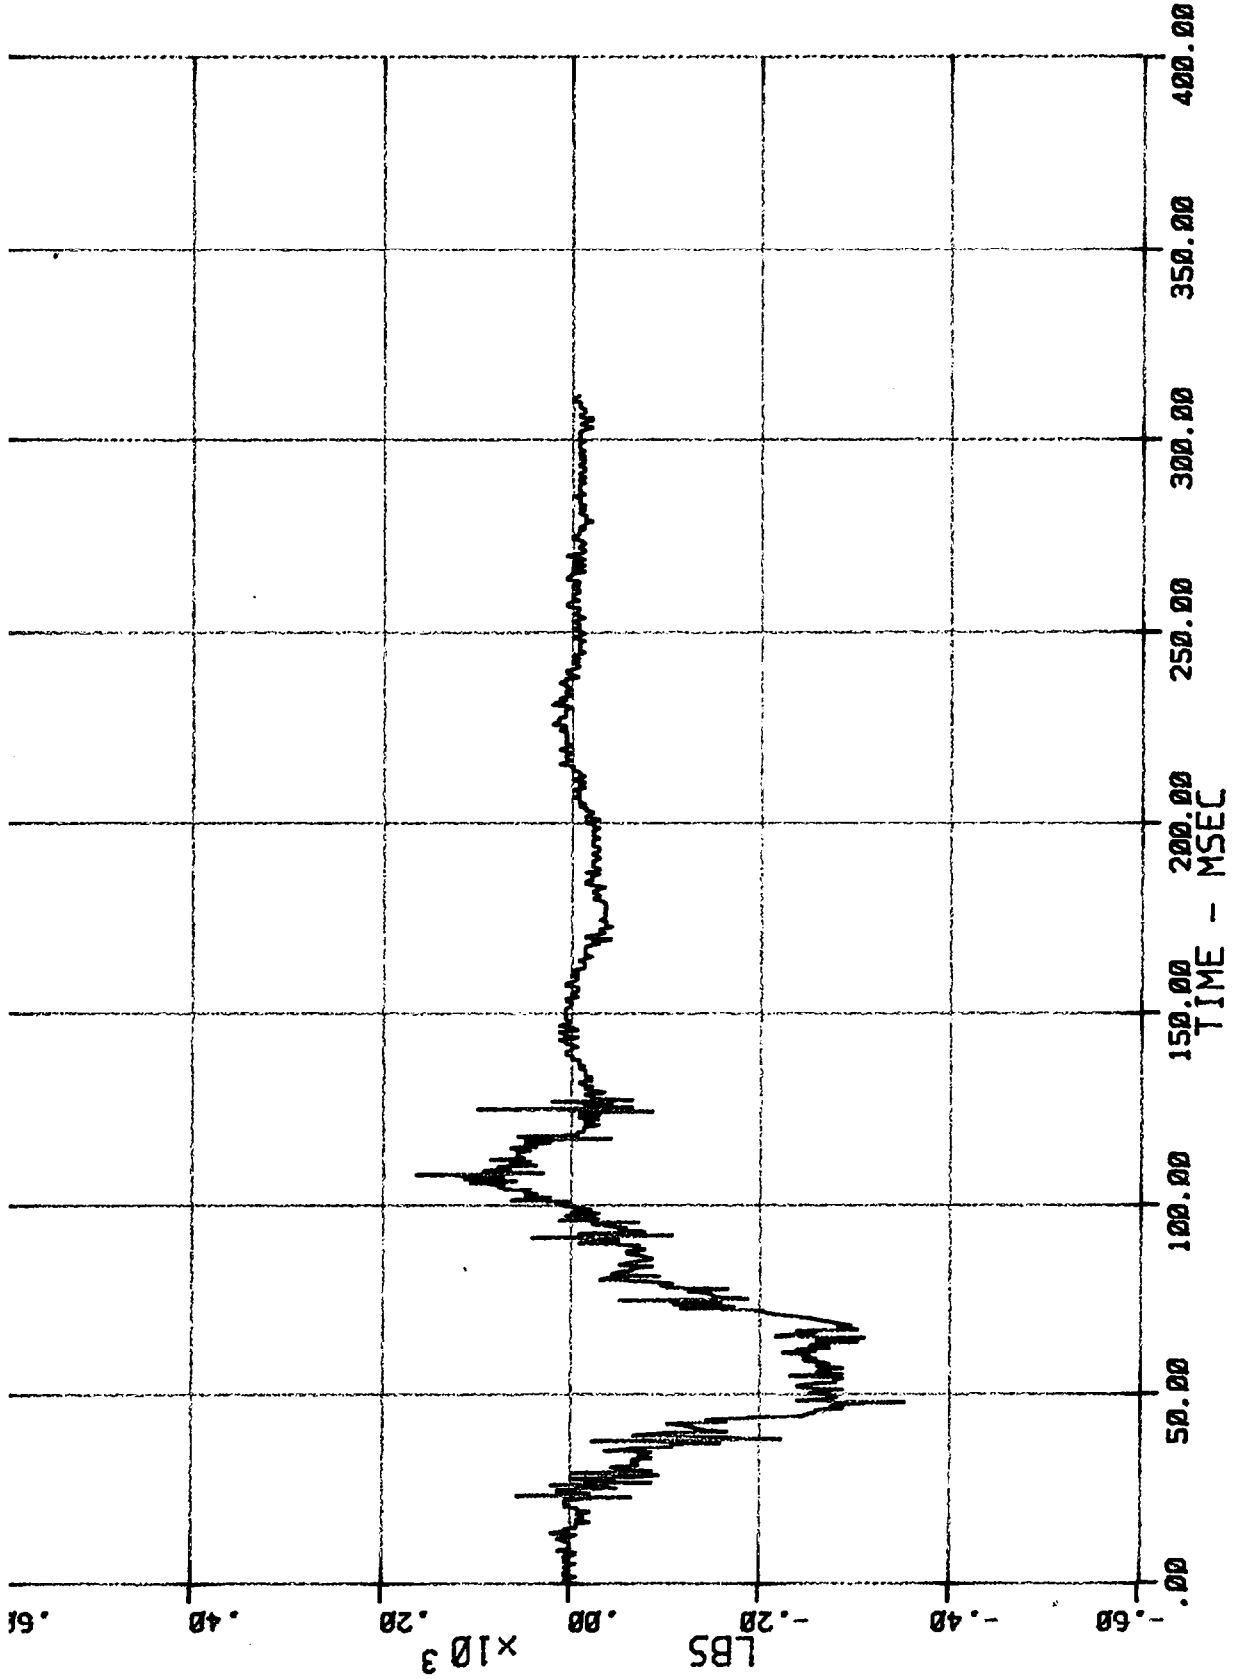


16 LC 01 2 RFM 0
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

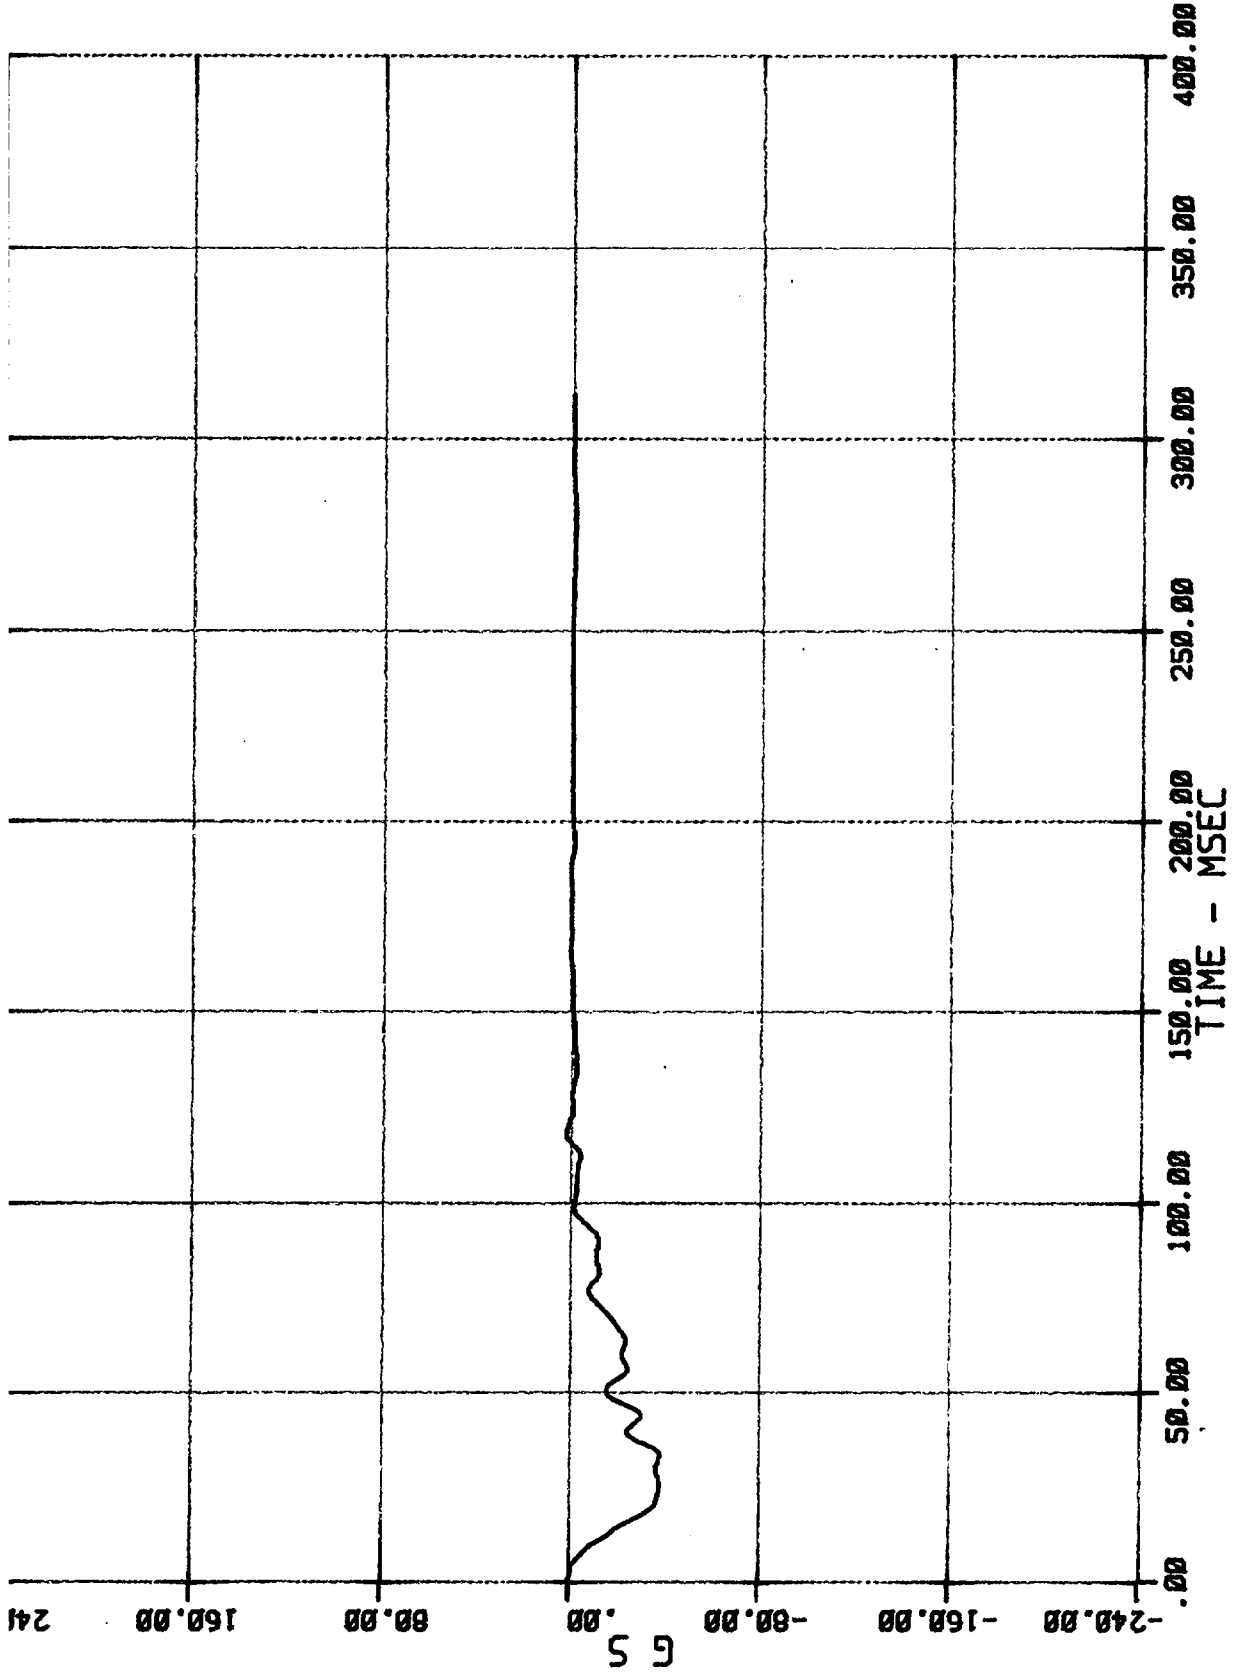


17 AC 01 N RFF X
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

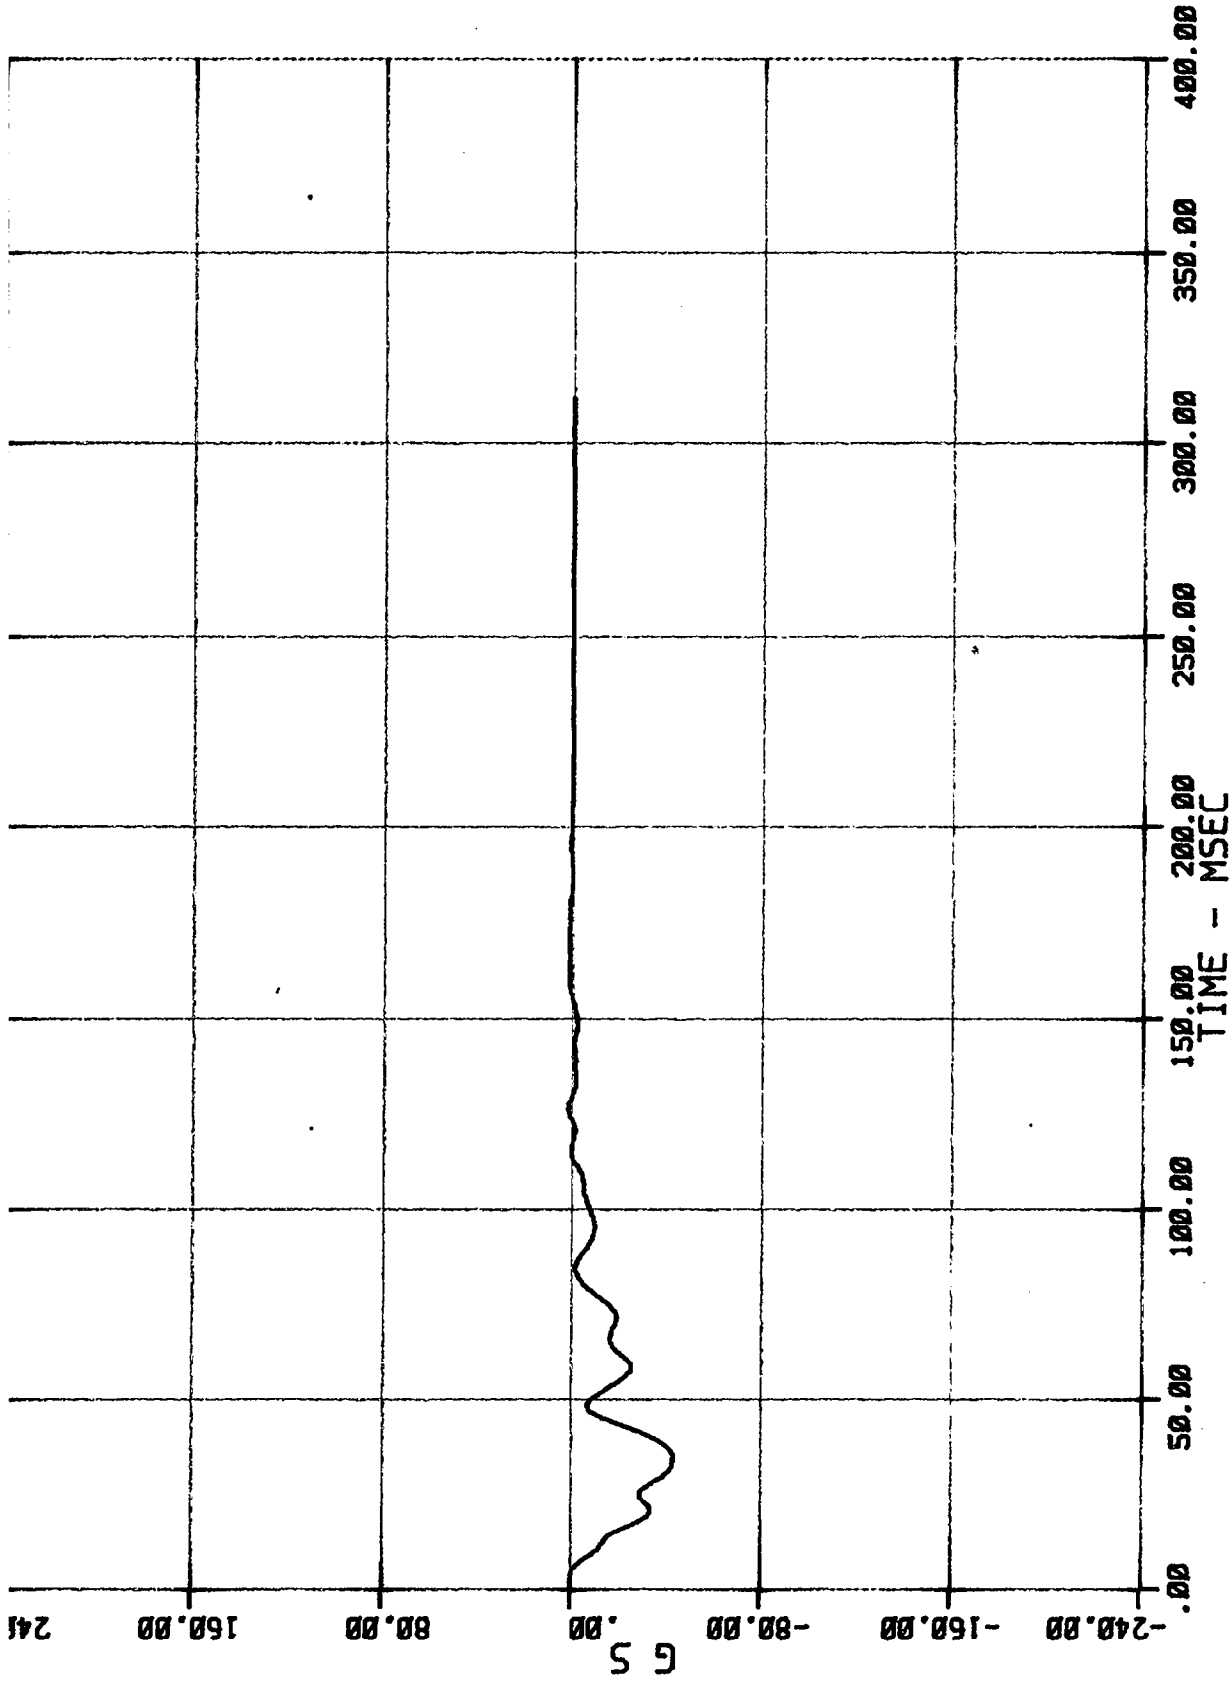


18 AC 01 N LRF X
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

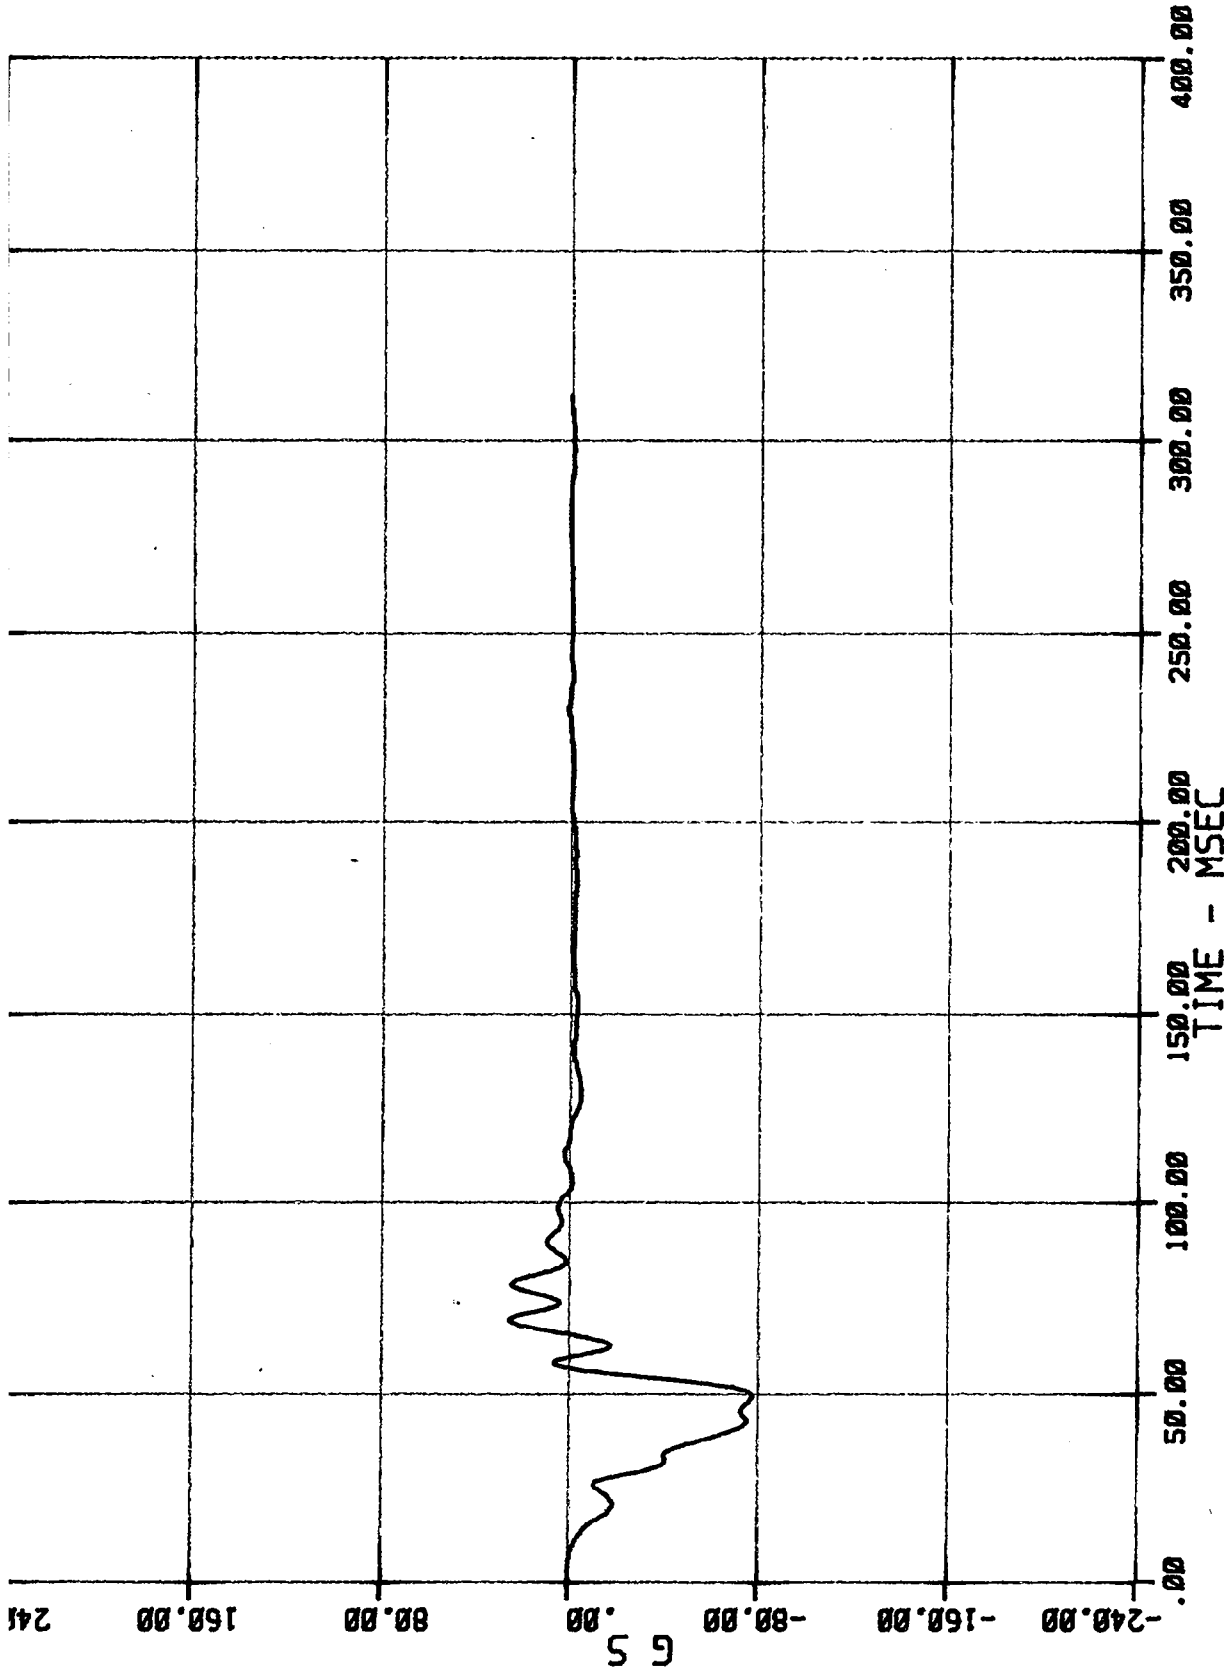


19 AC 01 N ENG X
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

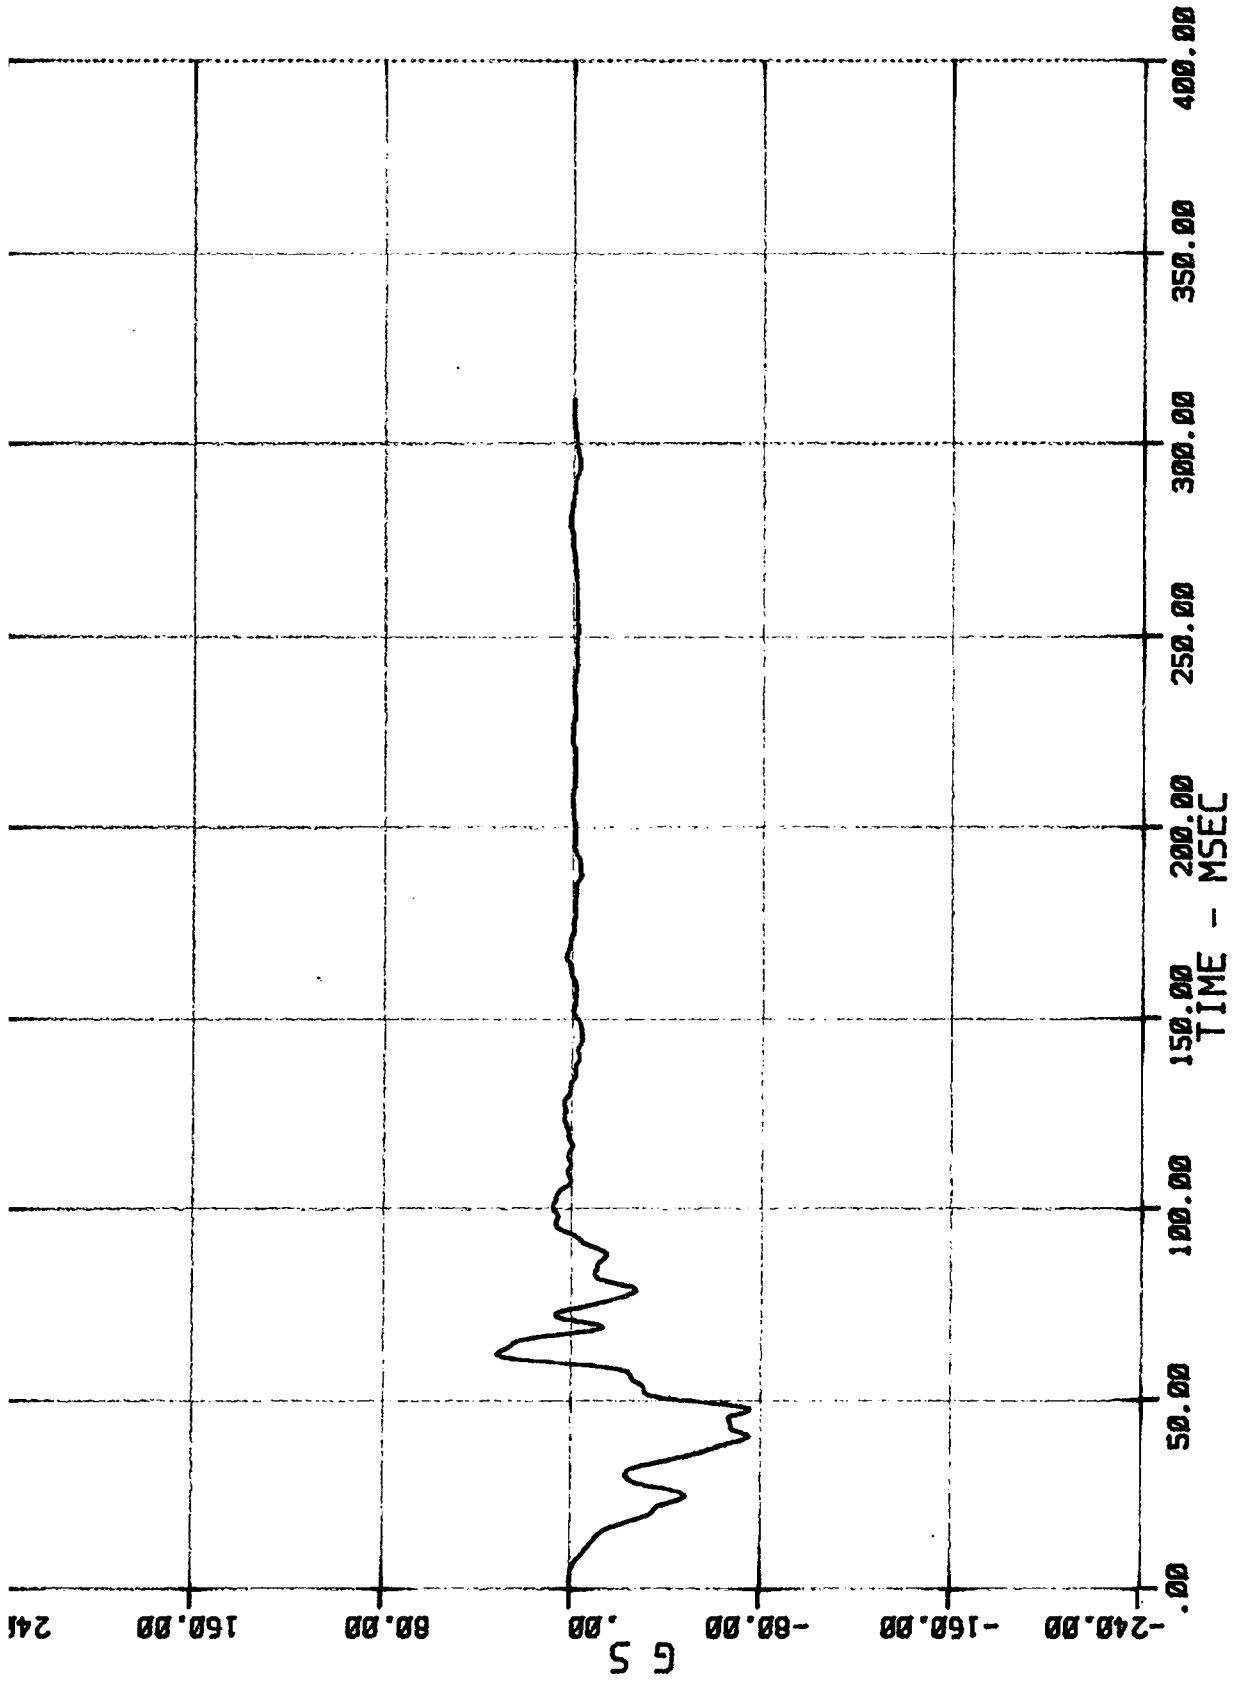

20 AC 01 N ENG X
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

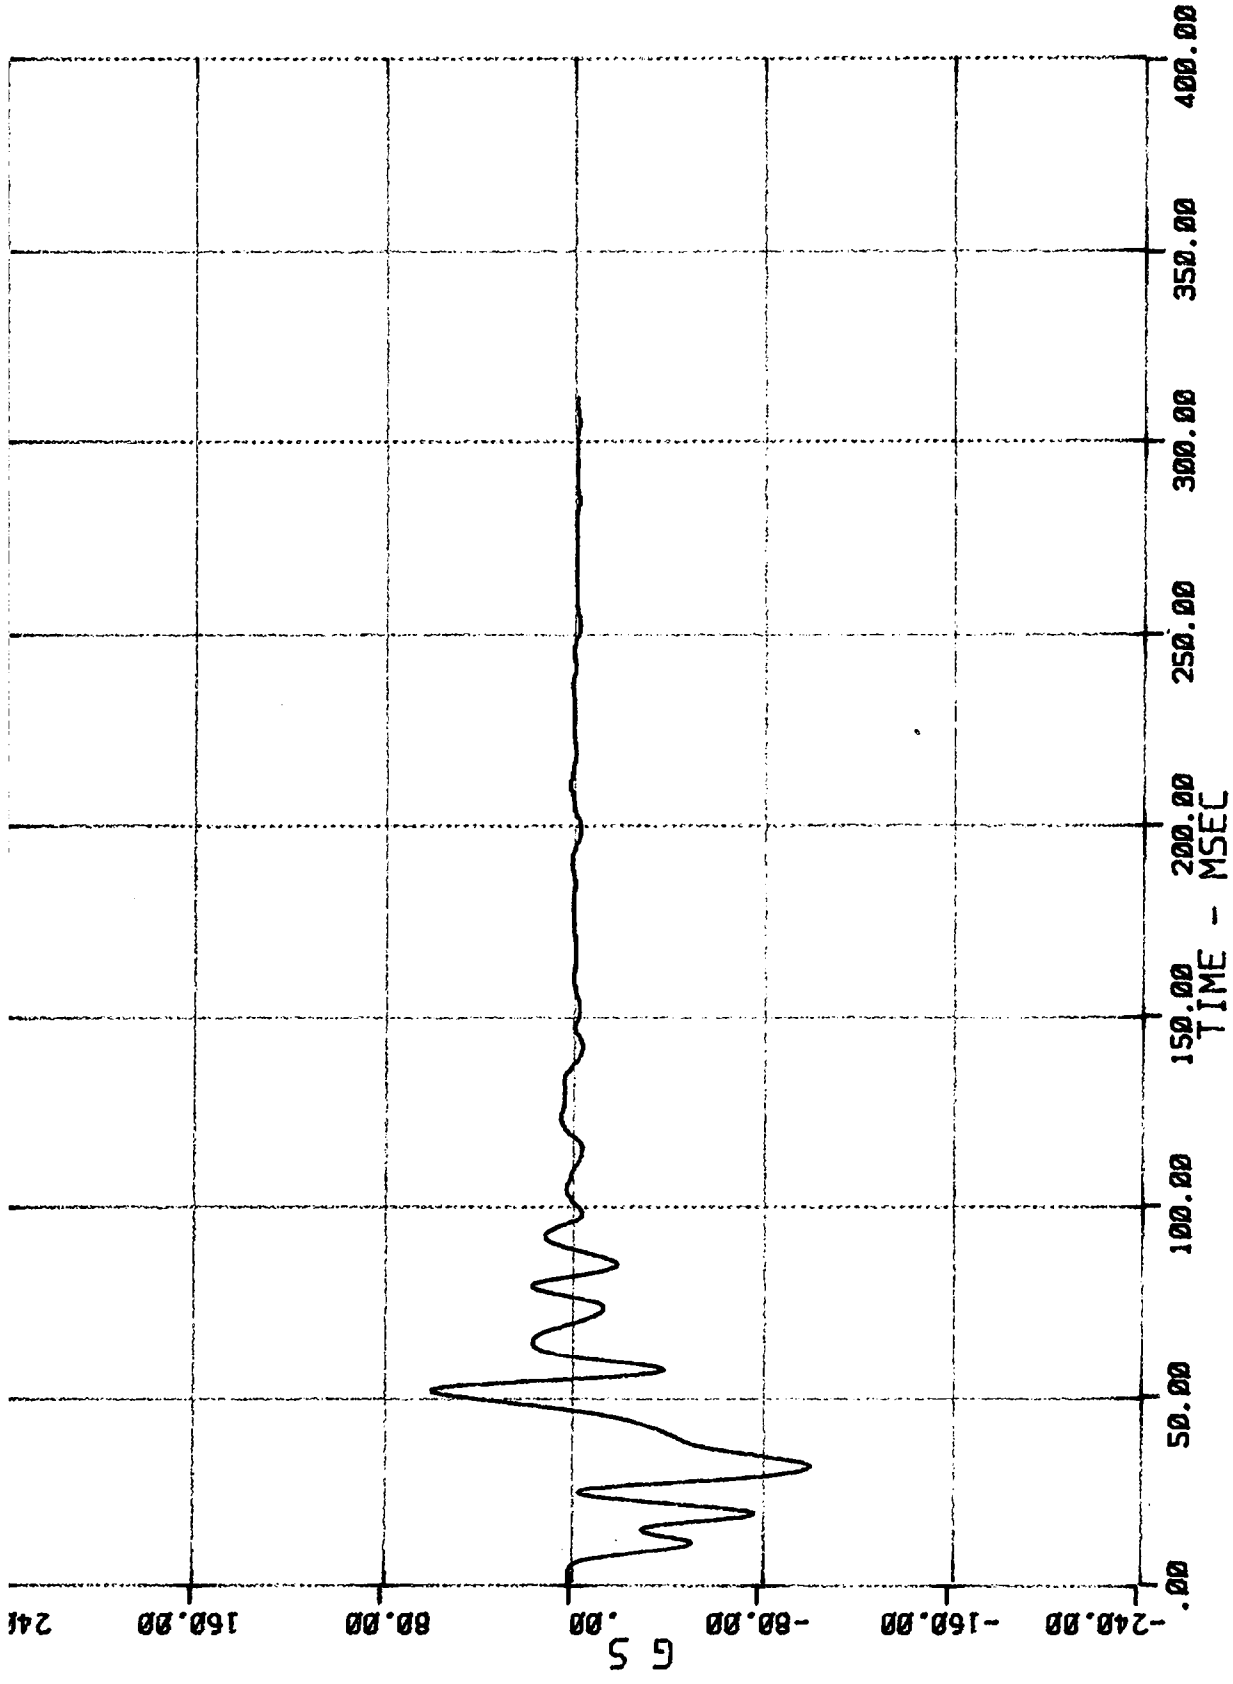


21 AC 01 N BCR X
MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

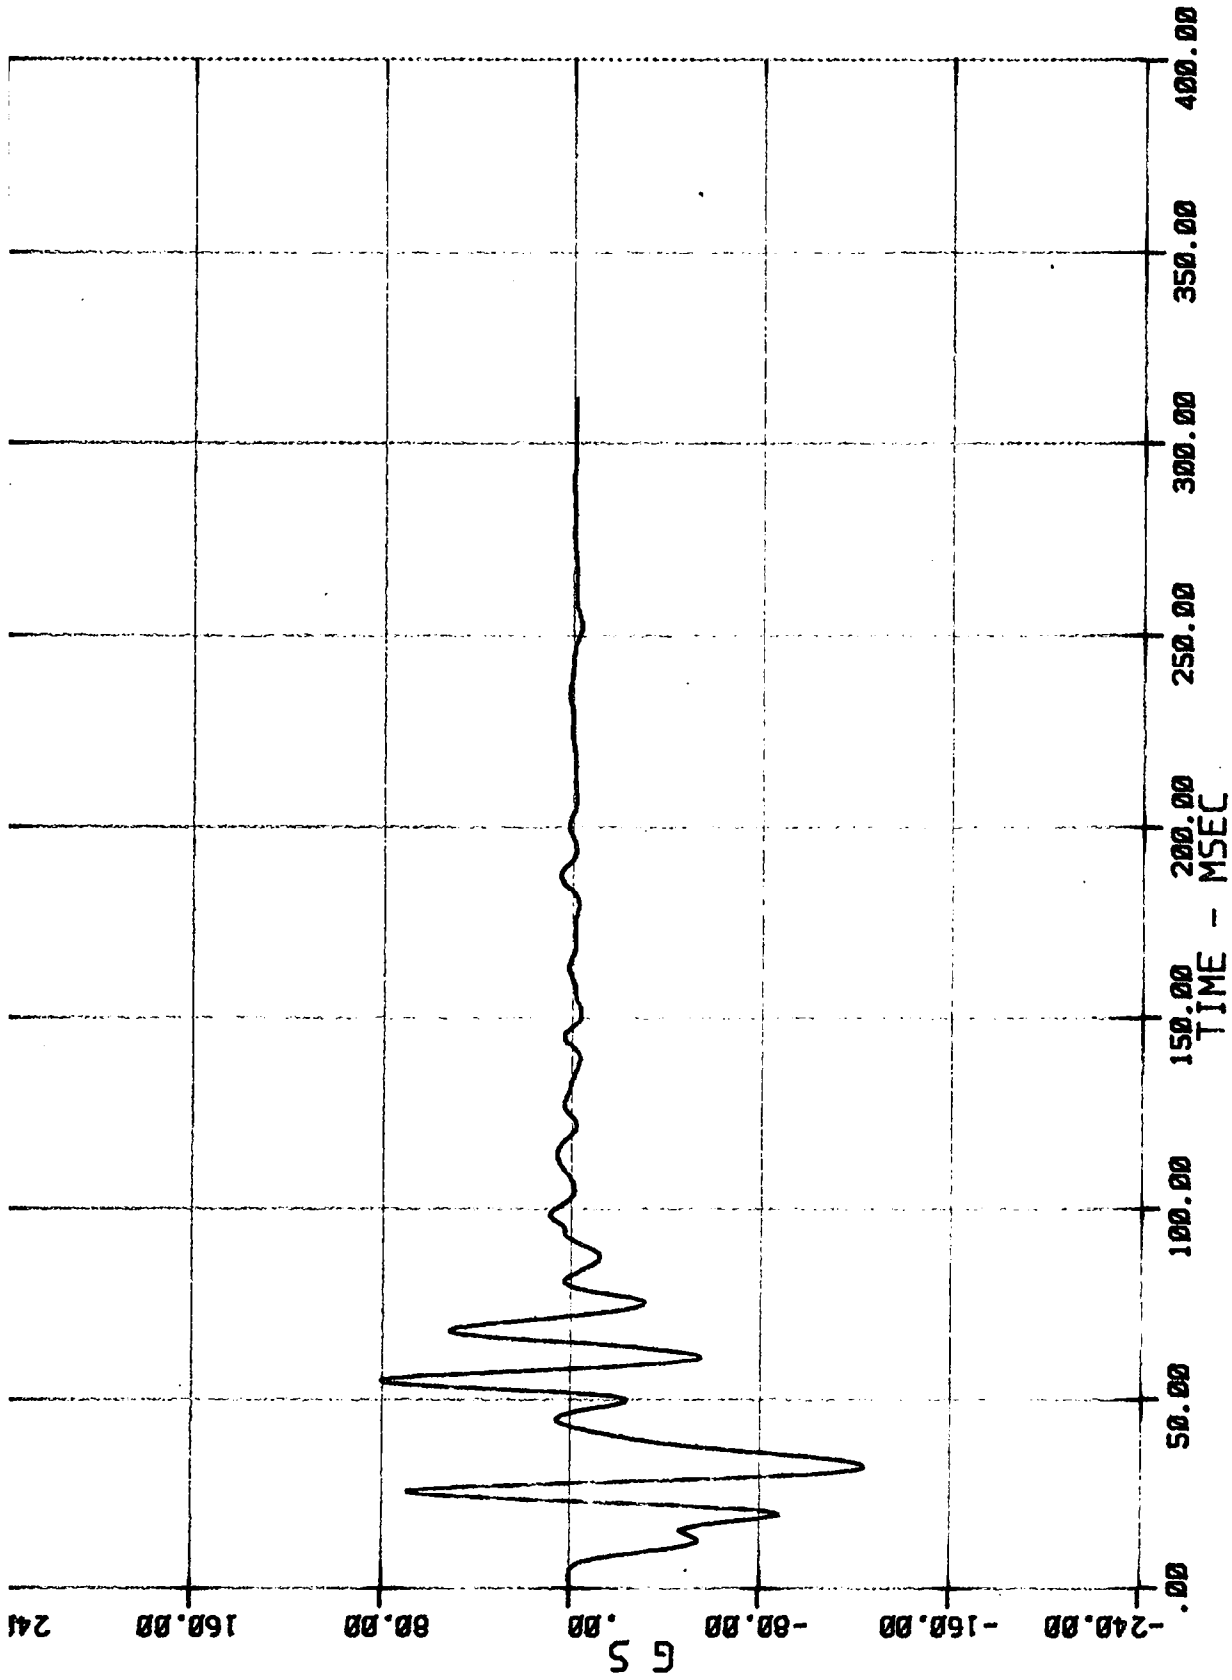

22 AC 01 N BCL X

MSE N99043 1983 MITSUBISHI MONTERO


06/22/83

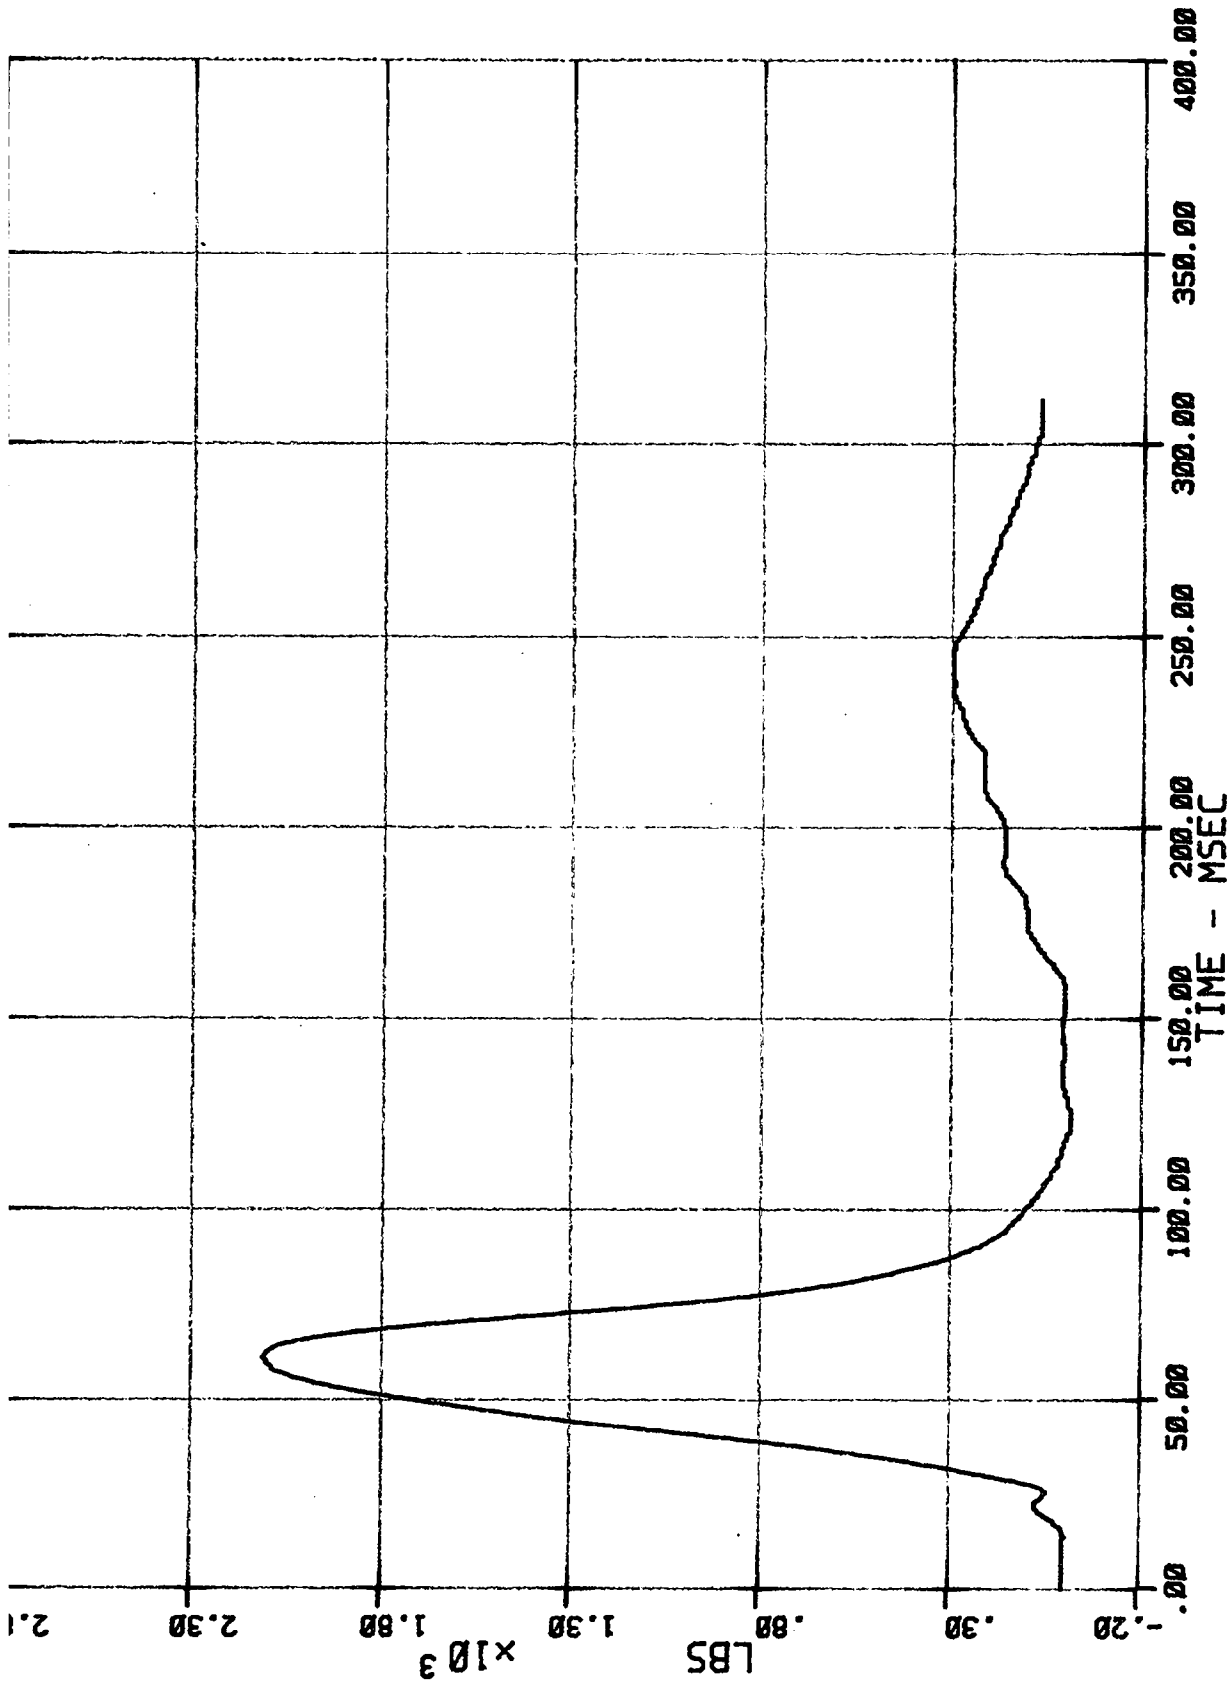


23 LC 01 1 LBO 0

MSE N99043 1983 MITSUBISHI MONTERO


06/22/83

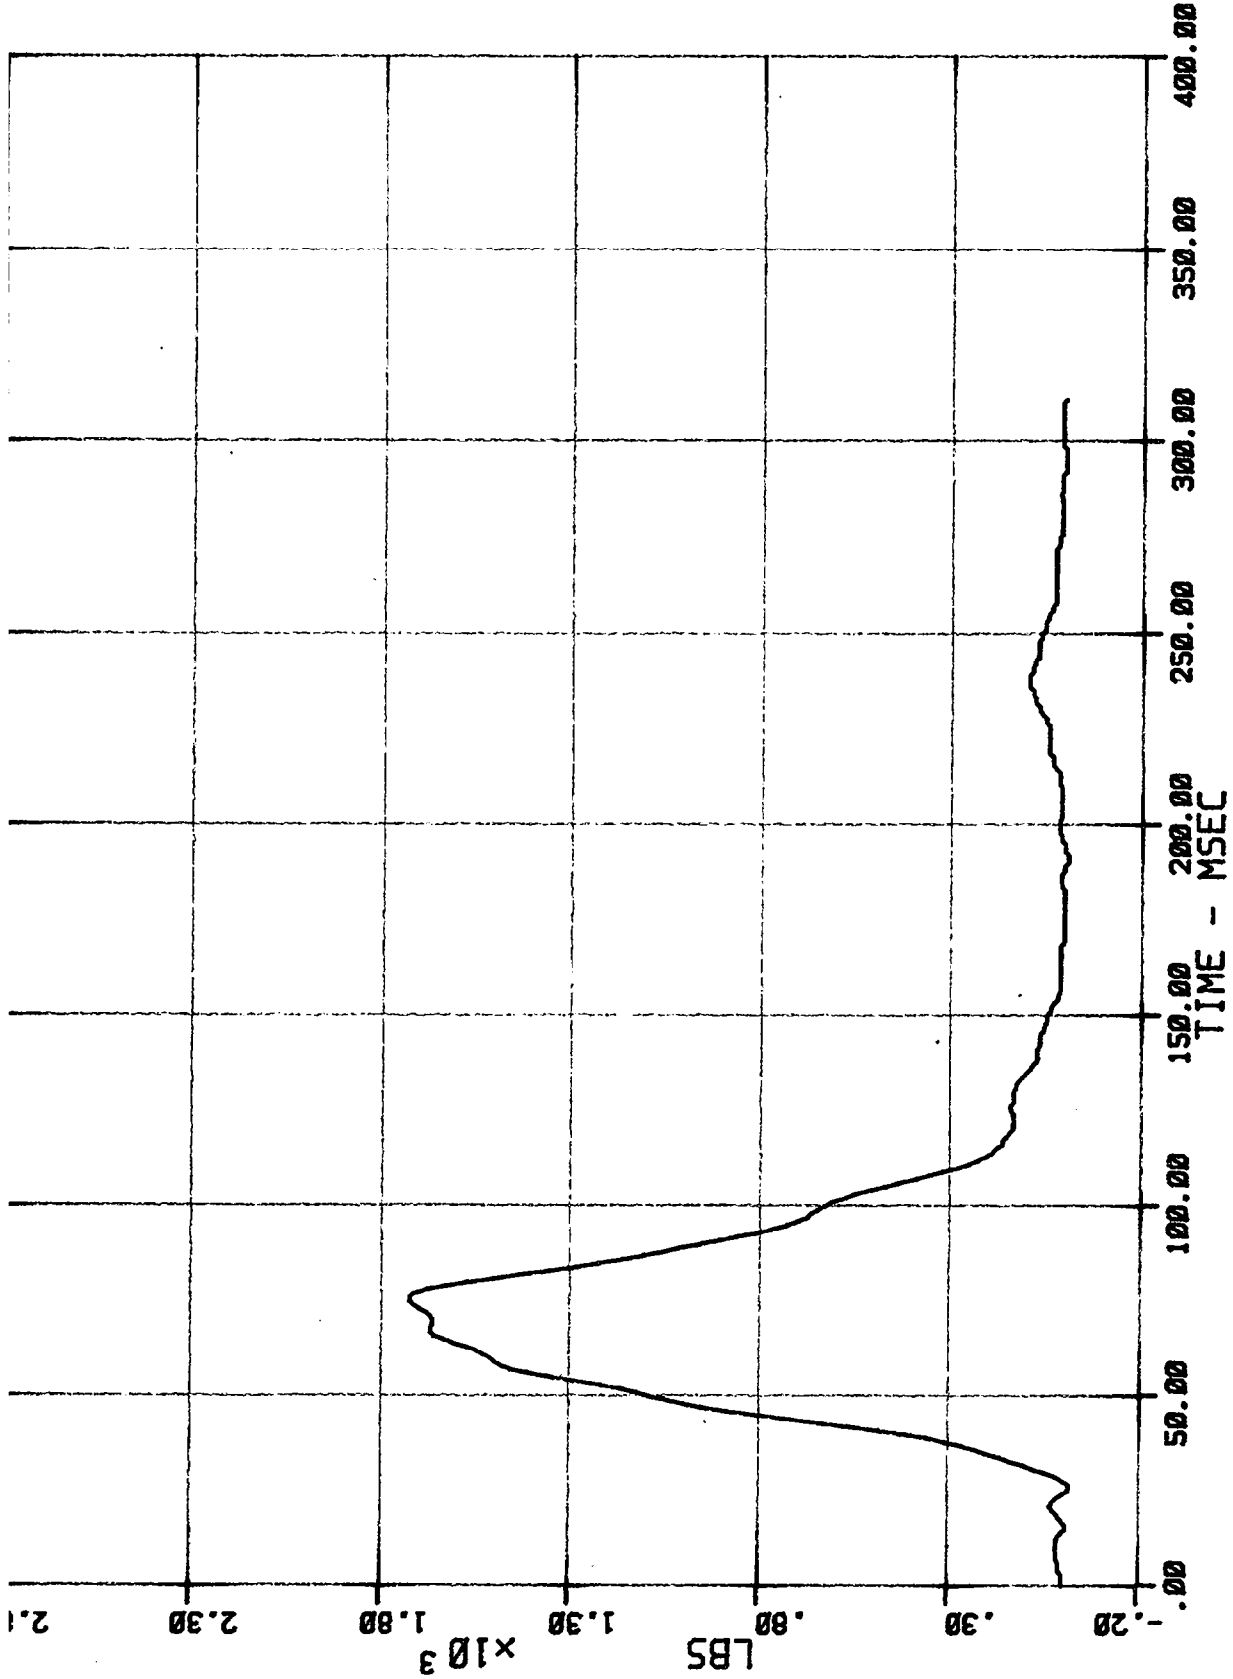


24 LC 01 1 SHB 0
 MSE N99043 1963 MITSUBISHI MONTERO 06/22/83

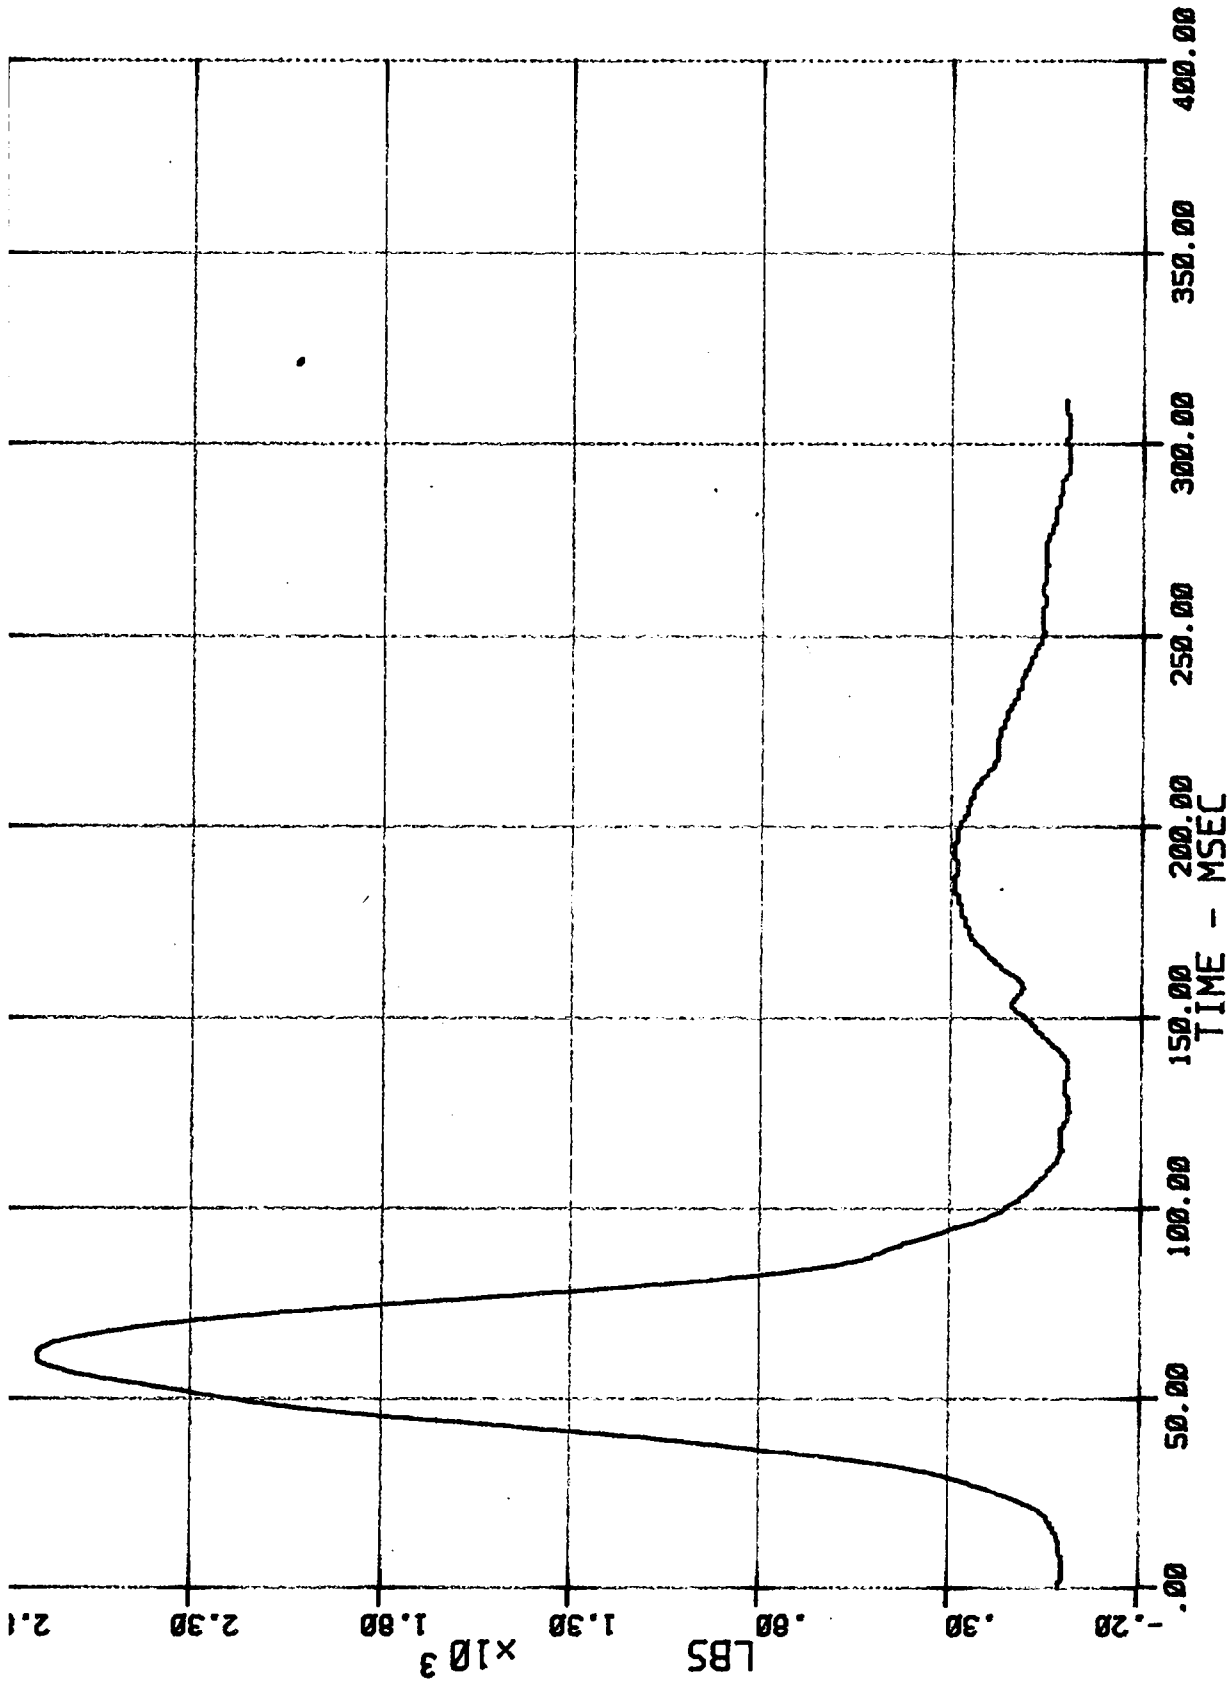

25 LC 01 2 LB0 0
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

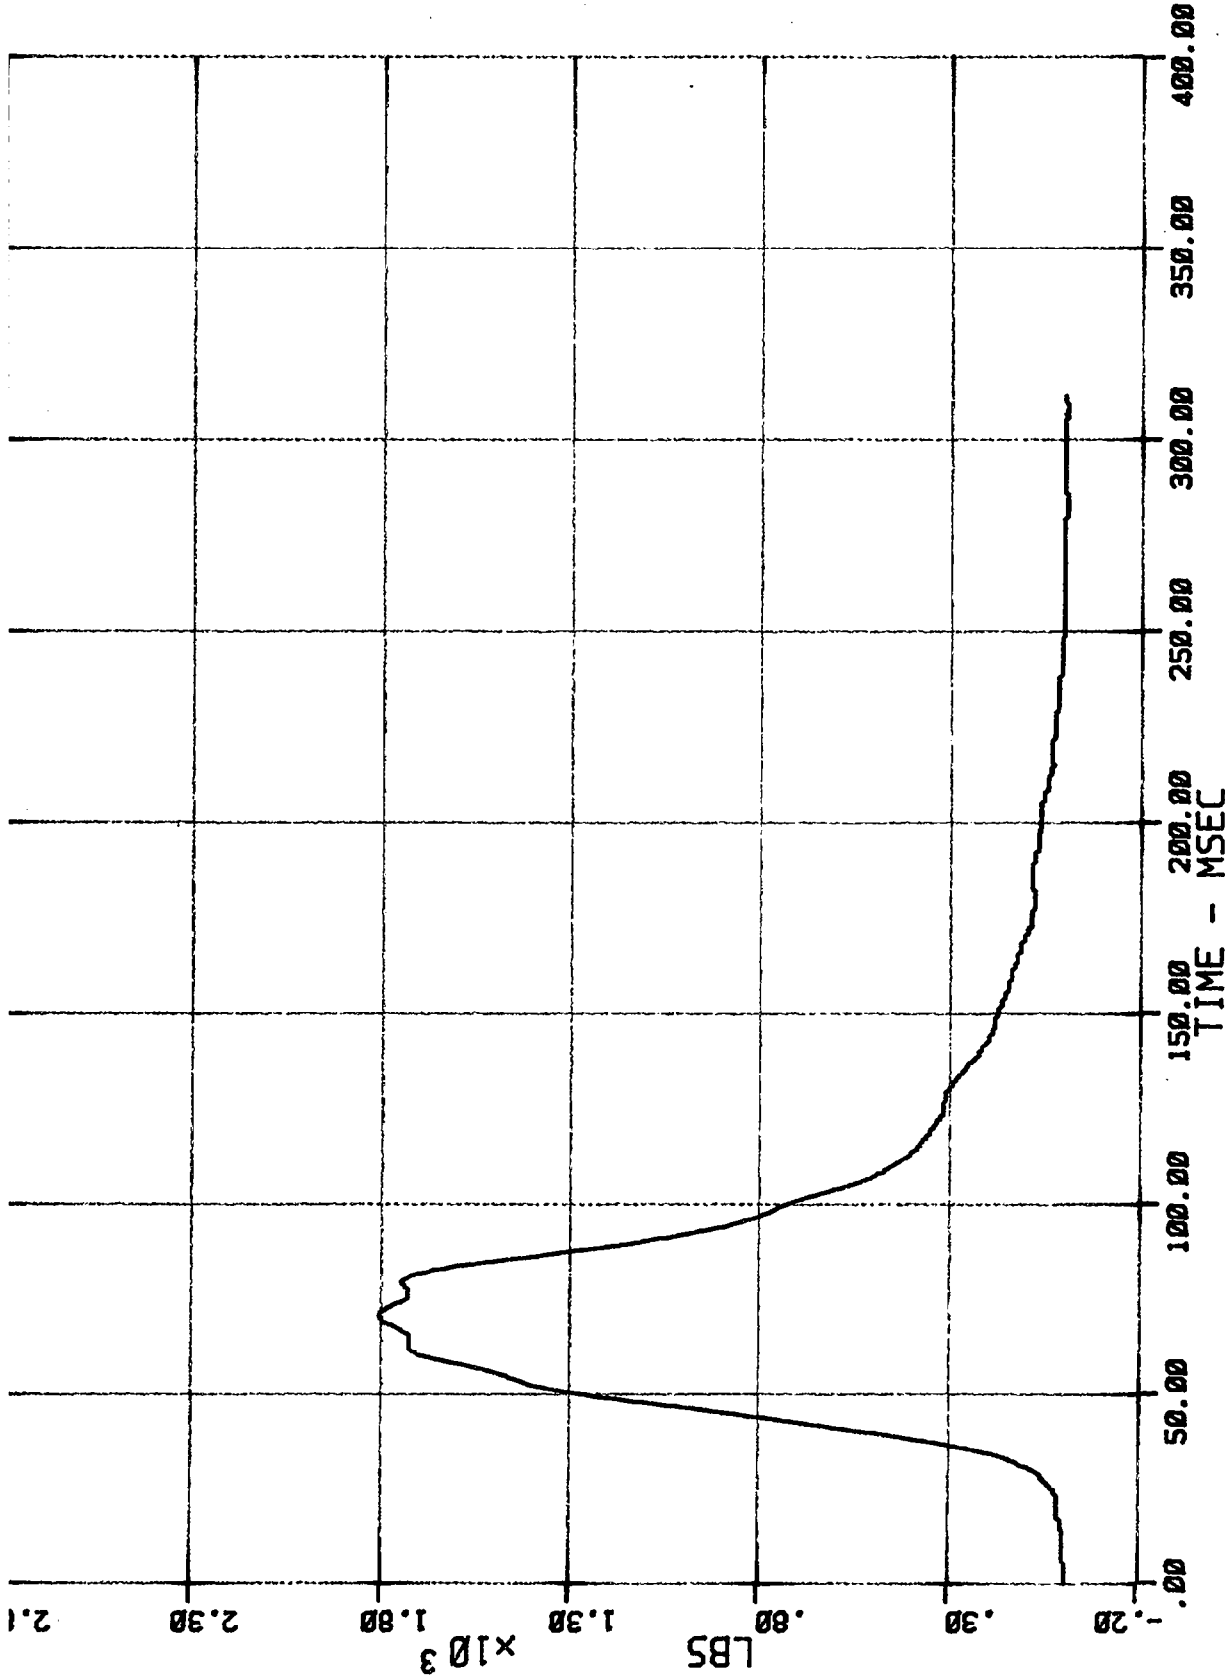


26 LC 01 2 SHB 0
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83

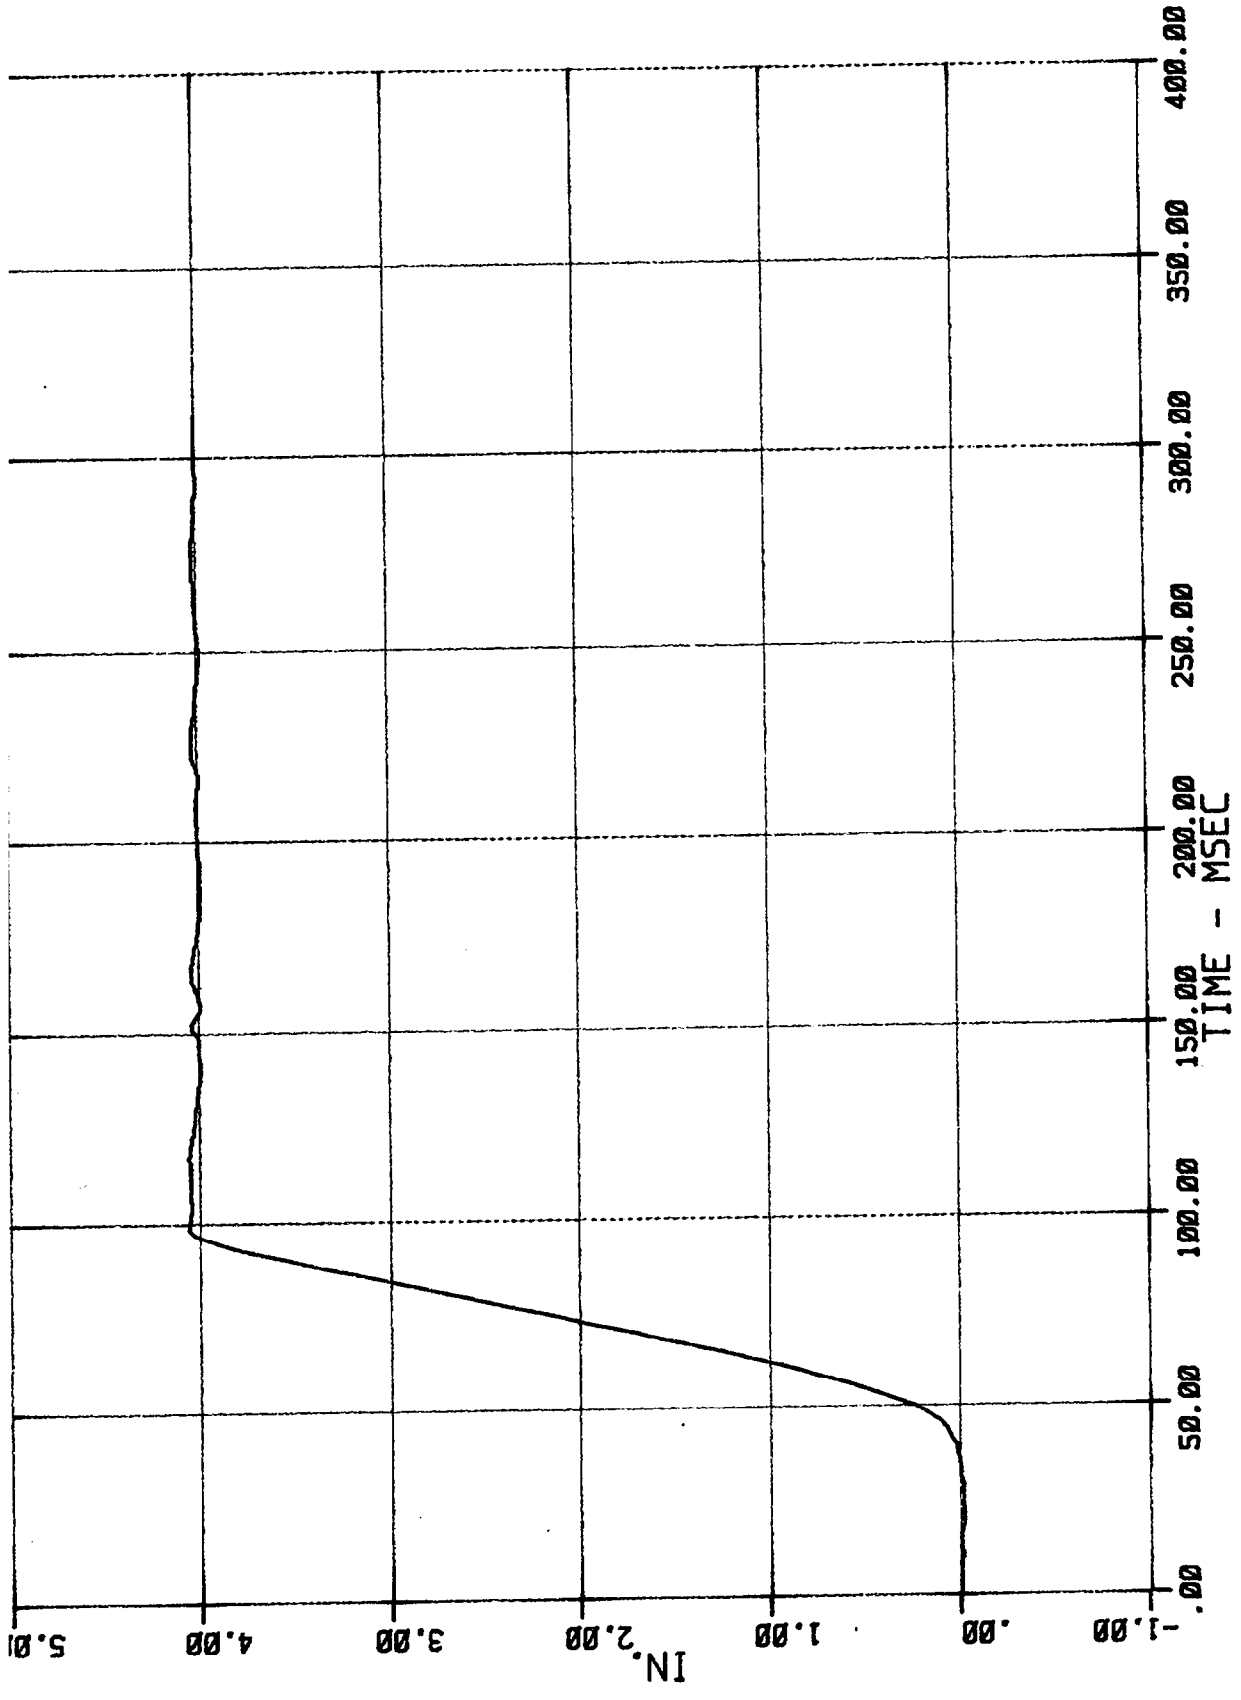

27 DT 01 1 SHB 0 (AMPL CORR --x .65)
MSE N99043 1983 MITSUBISHI MONTERO

06/22/83

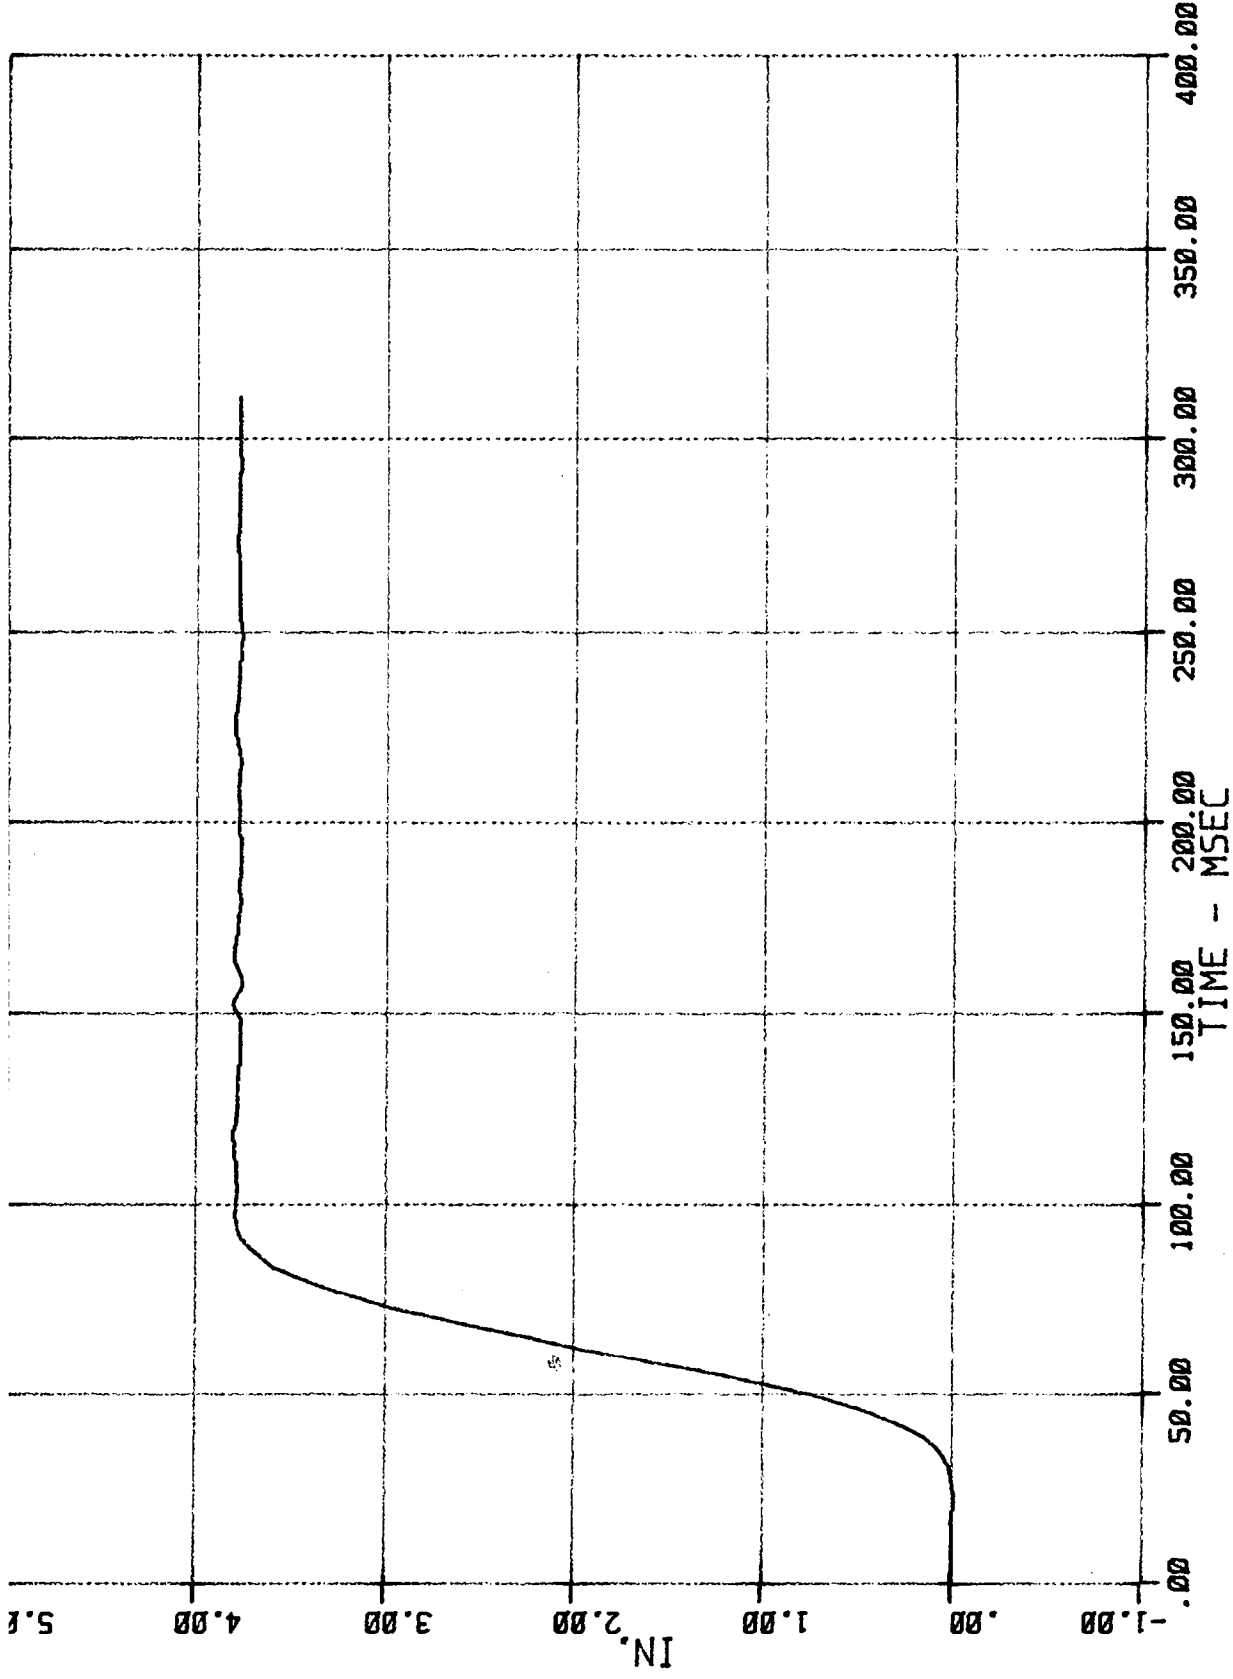

28 DT 01 2 SHB 0 (AMPL CORR -- x .68)
 MSE N99043 1983 MITSUBISHI MONTERO 06/22/83