REPORT NUMBER: 214D-CAL-24-002

NEW CAR ASSESSMENT PROGRAM (NCAP)
MOVING DEFORMABLE BARRIER SIDE IMPACT TEST

Hyundai Motor Company
2024 Genesis GV60
5 Door SUV

NHTSA No: O20244210

PREPARED BY:
CALSPAN CORPORATION
P.O. BOX 400
BUFFALO, NEW YORK 14225

October 23, 2024

FINAL REPORT

PREPARED FOR:
U. S. DEPARTMENT OF TRANSPORTATION
NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION
OFFICE OF CRASHWORTHINESS STANDARDS
MAIL CODE: NRM-110
1200 NEW JERSEY AVE SE
WASHINGTON, D.C. 20590

This final test report was prepared for the U.S. Department of Transportation, National Highway Traffic Safety Administration, in response to Contract Number 693JJ920D000016.

This publication is distributed by the U.S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof.

If trade or manufacturers' names or products are mentioned it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Prepared by: Claire Hejaily Date: October 23, 2024
Claire Hejaily, Test Engineer

Approved by: Vanessa Hansen Date: October 23, 2024
Vanessa Hansen, Test Engineer

FINAL REPORT ACCEPTANCE BY OCWS:

_____
Division Chief, New Car Assessment Program
NHTSA, Office of Crashworthiness Standards

Date: _____

_____
COTR, New Car Assessment Program
NHTSA, Office of Crashworthiness Standards

Date: _____

TECHNICAL REPORT DOCUMENTATION PAGE

1. *Report No.*	*2. Government Accession No.*	*3. Recipient's Catalog No.*
214D-CAL-24-002		

4. Title and Subtitle	*5. Report Date*
Final Report of New Car Assessment Program Side Impact MDB Testing & FMVSS 305 Indicant Testing of a 2024 Genesis GV60 5 Door SUV NHTSA No.: O20244210	October 23, 2024
	6. Performing Organization Code CAL
7. Author(s) Claire Hejaily, Test Engineer Vanessa Hansen, Test Engineer	*8. Performing Organization Report No.* CAL-DOT-2024-002
9. Performing Organization Name and Address Calspan Corporation Transportation Test Operations P.O. Box 400 Buffalo, New York 14225	*10. Work Unit No.*
	11. Contract or Grant No. 693JJ920D000016
12. Sponsoring Agency Name and Address U.S. Department of Transportation National Highway Traffic Safety Administration Office of Crashworthiness Standards (NRM-110) 1200 New Jersey Ave., SE Washington, D.C. 20590	*13. Type of Report and Period Covered:* Final Test Report January 9, 2024 - October 23, 2024
	14. Sponsoring Agency Code NEF-240

15. Supplementary Notes

16. Abstract

A 55/28, (61.90kph / 38.5 mph), 90° Moving Deformable Barrier NCAP Side Impact Test was conducted on the subject 2024 Genesis GV60 5 Door SUV in accordance with the specifications of the Office of Crashworthiness Standards Test Procedure for the generation of consumer information on vehicle side crash protection. This test was conducted at Calspan Corporation's Transportation Test Operations facility in Buffalo, New York on January 9, 2024.

The impact velocity of the Moving Deformable Barrier (MDB) was 62.13 km/h, and the ambient temperature at the struck (driver's) side of the target vehicle was 21°C. The target vehicle's maximum post-test static crush was 190 mm located at level 2. The test vehicle's occupant performance data is as follows:

Measurement Description	Driver ATD (ES-2re)		
	Units	IARV	Result
Head Injury Criteria (HIC36)		1000	61.977
Maximum Thorax Rib Deflection	mm	44	21.224
Total Abdominal Force	N	2500	763.325
Pubic Symphysis Force	N	6000	825.720
Lower Spine (T12) Resultant Acceleration	G	82*	18.092

Measurement Description	Passenger ATD (SID-IIs)		
	Units	IARV	Result
Head Injury Criteria (HIC36)		1000	74.600
Maximum Thorax Rib Deflection	mm	38*	11.624
Lower Spine (T12) Resultant Acceleration	G	82	35.614
Total Pelvic Force (sum of acetabular and iliac forces)	N	5525	1969.089
Maximum Abdominal Rib Deflection	mm	45*	12.980

**Proposed IARV*

The two doors on the struck side of the vehicle did not separate from the body at the hinges or latches and the opposite doors did not open during the side impact event.

17. Key Words	*18. Distribution Statement*
New Car Assessment Program (NCAP) Side Impact MDB ES-2re SID-IIs	Copies of this report are available from: National Highway Traffic Safety Administration Technical Information Services Division, NPO-411 1200 New Jersey Ave. SE Washington, D.C. 20590

19. Security Class. (of this report)	*20. Security Class. (of this page)*	*21. No. of Pages*	*22. Price*
UNCLASSIFIED	UNCLASSIFIED	222	

TABLE OF CONTENTS

Section		Page
1	Test Purpose and Procedure	1-1
2	Summary of Test Results	2-1
3	Occupant and Vehicle Information	3-1

Data Sheet		Page
1	General Test and Vehicle Parameter Data	3-2
2	Seat, Seat Belt, Steering Wheel Adjustment and Fuel System Data	3-6
3	Dummy Longitudinal Clearance Dimensions	3-10
4	Dummy Lateral Clearance Dimensions	3-11
5	Camera and Instrumentation Data	3-12
6	Test Vehicle Accelerometer Location	3-13
7	MDB Accelerometer Locations	3-14
8	Post-Test Observations	3-15
9	MDB Summary Results	3-17
10	Test Vehicle Profile Measurements	3-18
11	Test Vehicle Exterior Crush Measurements	3-19
12	MDB Exterior Static Crush Measurements	3-22
13	Vehicle and MDB Damage Profile Distances	3-23
14	FMVSS No. 301 Static Rollover Results	3-24
15	Dummy / Vehicle Temperature and Humidity Stabilization Data	3-25
305-1	General Test and Vehicle Parameter Data for Indicant FMVSS No. 305 Testing	3-26
305-2	Pre-Impact Data for Indicant FMVSS No. 305 Testing	3-27
305-3	Pre-Impact Electrical Isolation Measurements and Calculations for Indicant FMVSS No. 305 Testing	3-28
305-4	Post-Impact Data for Indicant FMVSS No. 305 Testing	3-29
305-5	Static Rollover Test Data for Indicant FMVSS No. 305 Testing	3-30

Appendix		Page
A	Photographs	A-1
B	Vehicle and Dummy Response Data Plots	B-1
C	Dummy Configuration and Performance Verification Data	C-1
D	Test Equipment and Instrumentation Calibration Data	D-1

SECTION 1

TEST PURPOSE AND PROCEDURE

This moving deformable barrier side impact test is part of the MY 2024 New Car Assessment Program Side Impact Test Program, sponsored by the National Highway Traffic Safety Administration (NHTSA), under contract number 693JJ920D000016. The purpose of this test is to generate comparative side impact performance in a 2024 Genesis GV60 5 Door SUV. The side impact test was conducted in accordance with the Office of Crashworthiness Standard's Laboratory Test Procedure dated March 2020.

SECTION 2
SUMMARY OF TEST RESULTS

A 2024 Genesis GV60 5 Door SUV was impacted on the left (driver's) side by a Moving Deformable Barrier (MDB) which was moving forward in a 27° crabbed position to the tow road guidance system at a velocity of 62.13 km/h. The target vehicle was stationary and was positioned at an angle of 63° to the line of forward motion. The side impact test was conducted by the Calspan Corporation's Transportation Test Operations Center in Buffalo, New York on January 9, 2024. Pre-test and post-test photographs of the test vehicle, the MDB and the dummies (ES-2re and SID-IIs) are included in this report.

Dummies were placed in the driver and left rear designated seating positions according to instructions specified in the OCWS Side Impact Laboratory Test Procedure, dated March 2020. The side impact event was documented by 9 high-speed and 2 real-time cameras. Camera locations are included in this report.

The Dummies were instrumented in the following manner:

DRIVER ATD (ES-2re)
Primary and redundant head CG tri-axial accelerometers
Chest upper rib, middle rib, and lower rib y-axis displacement potentiometers
Abdomen forward, middle, and rear y-axis load cells
Lower spine (T12) tri-axial accelerometers
Public symphysis y-axis load cell

PASSENGER ATD (SID-IIs)
Primary and redundant head CG tri-axial accelerometers
Chest upper rib, middle rib, and lower rib y-axis displacement potentiometers
Abdomen upper rib and lower rib y-axis displacement potentiometers
Lower spine (T12) tri-axial accelerometers
Acetabulum and iliac wing y-axis load cells

Appendix B contains the vehicle and dummy response data. Dummy configuration and performance verification data can be found in Appendix C of this report. Appendix D of this report contains the test equipment and instrumentation calibration data.

DUMMY INJURY VALUES

Measurement Description	Driver ATD (ES-2re)		
	Units	IARV	Result
Head Injury Criteria (HIC36)		1000	61.977
Maximum Thorax Rib Deflection	mm	44	21.224
Total Abdominal Force	N	2500	763.325
Pubic Symphysis Force	N	6000	825.720
Lower Spine (T12) Resultant Acceleration	G	82*	18.092

Measurement Description	Passenger ATD (SID-IIs)		
	Units	IARV	Result
Head Injury Criteria (HIC36)		1000	74.600
Maximum Thorax Rib Deflection	mm	38*	11.624
Lower Spine (T12) Resultant Acceleration	G	82	35.614
Total Pelvic Force (sum of acetabular and iliac forces)	N	5525	1969.089
Maximum Abdominal Rib Deflection	mm	45*	12.980

*Proposed IARV

SUPPLEMENTAL RESTRAINT INFORMATION

Restraint Type	Left Front (Driver) Occupant Location 1		Left Rear (Passenger) Occupant Location 4	
	Mounted	Deployed	Mounted	Deployed
Front Airbag	Yes	No		
Knee Airbag	Yes	No		
Side Airbag 1 - Curtain	Yes	Yes	Yes	Yes
Side Airbag 2 - Torso/Pelvis Airbag	Yes	Yes	Yes	Yes
Seat Belt Pretensioner	Yes	Yes	Yes	Yes
Seat Belt Load Limiter	Yes	Yes	Yes	Yes
Other - Center Airbag	Yes	Yes	No	N/A

GENERAL COMMENTS:

1. P1 serial number – F033
2. P4 serial number – 300

Data Anomalies:

The following channel was questionable for:

- Left Front Sill Y Acceleration, Exceeded calibration range at 7 ms
- Left Rear Sill Y Acceleration, Exceeded calibration range at 9.8 ms
- Left B-Pillar Lower Y Acceleration, Exceeded calibration range and saturated at 8.2 ms
- Left B-Pillar Middle Y Acceleration, Exceeded calibration range at 11.5 ms

SECTION 3

OCCUPANT AND VEHICLE INFORMATION

This section contains information reporting for the following Data Sheets:

Data Sheet No. 1 - General Test and Vehicle Parameter Data

Data Sheet No. 2 - Seat, Seat Belt, Steering Wheel Adjustment and Fuel Systems Data

Data Sheet No. 3 - Dummy Longitudinal Clearance Dimensions

Data Sheet No. 4 - Dummy Lateral Clearance Dimensions

Data Sheet No. 5 - Camera and Instrumentation Data

Data Sheet No. 6 - Test Vehicle Accelerometer Locations

Data Sheet No. 7- MDB Accelerometer Locations

Data Sheet No. 8 - Post-Test Observations

Data Sheet No. 9 - MDB Summary of Results

Data Sheet No. 10 - Test Vehicle Profile Measurements

Data Sheet No. 11 - Test Vehicle Exterior Crush Measurements

Data Sheet No. 12 - MDB Exterior Static Crush Measurements

Data Sheet No. 13 - Vehicle and MDB Damage Profile Distances

Data Sheet No. 14 - FMVSS No. 301 Static Rollover Results

Data Sheet No. 15 - Dummy / Vehicle Temperature and Humidity Stabilization Data

Data Sheet No. 305-1 - General Test and Parameter Data for Indicant FMVSS No. 305 Testing

Data Sheet No. 305-2 - Pre-Impact Data for Indicant FMVSS No. 305 Testing

Data Sheet No. 305-3 - Pre-Impact Electrical Isolation Measurements and Calculations for Indicant FMVSS No. 305 Testing

Data Sheet No. 305-4 - Post-Impact Data for Indicant FMVSS No. 305 Testing

Data Sheet No. 305-5 - Static Rollover Test Data for Indicant FMVSS No. 305 Testing

DATA SHEET NO. 1
GENERAL TEST AND VEHICLE PARAMETER DATA

Test Vehicle: 2024 Genesis GV60 5 Door SUV
NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test
Test Date: 01/09/2024

TEST VEHICLE INFORMATION AND OPTIONS

NHTSA No.	O20244210
Model Year	2024
Make	Genesis
Model	GV60
Body Style	SUV
VIN	KMUKB4SA6RU022331
Body Color	White
Odometer Reading (km/mi)	41 miles
Engine Displacement (L)	N/A
Type / No. Cylinders	N/A
Engine Placement	Transverse
Transmission Type	Automatic
Transmission Speeds	Direct Drive
Overdrive	N/A
Final Drive	Rear Wheel Drive
Roof Rack	No
Sunroof / T-Top	No
Running Boards	No
Tilt Steering Wheel	Yes
Power Seats	Yes
Anti-Lock Brakes (ABS)	Yes

Traction Control System (TCS)	Yes
Auto-Leveling System	No
Automatic Door Locks (ADL)	Yes
Power Window Auto-Reverse	Yes
Other Optional Feature	N/A
Driver Front Airbag	Yes
Driver Curtain Airbag	Yes
Driver Head/Torso Airbag	No
Driver Torso Airbag	No
Driver Torso / Pelvis Airbag	Yes
Driver Pelvis Airbag	No
Driver Knee Airbag	Yes
Rear Pass. Curtain Airbag	Yes
Rear Pass. Head / Torso Airbag	No
Rear Pass. Torso Airbag	No
Rear Pass. Torso / Pelvis Airbag	Yes
Rear Pass. Pelvis Airbag	No
Driver Seat Belt Pretensioner	Yes
Rear Pass. Seat Belt Pretensioner	Yes
Driver Load Limiter	Yes
Rear Pass. Load Limiter	Yes
Other Safety Restraint-Front Center Airbag	Yes

Does owner's manual provide instructions to turn off automatic door locks? No

DATA FROM CERTIFICATION LABEL

Manufactured By	Hyundai Motor Company
Date of Manufacture	SEP/2023
Vehicle Type	MPV

GVWR	2475
GAWR Front	1265
GAWR Rear	1420

VEHICLE SEATING AND WEIGHT CAPACITY DATA

Measured Parameter	Front	Rear	Third	Total	
Designated Seating Capacity (DSC)	2	3	N/A	5	
Vehicle Capacity Weight (VCW) (kg)				390	(A)
DSC x 68.0 kg				340	(B)
Cargo Weight (RCLW) (kg)				50	(A-B)

VEHICLE SEAT TYPE

Seating Location	Type Of Seat Pan				Type Of Seat Back		
	Bucket	Bench	Split Bench	Contour	Fixed	Adjustable	
						W/ Lever	W/ Knob
Front	X						X
Rear or Second Row Seat			X			X	
Third Row Seat	N/A	N/A	N/A	N/A	N/A	N/A	N/A

DATA SHEET NO. 1 … (CONTINUED)
GENERAL TEST AND VEHICLE PARAMETER DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

Collected for year, make, model, & VIN, all items circled in red, tire manufacturer and tire name

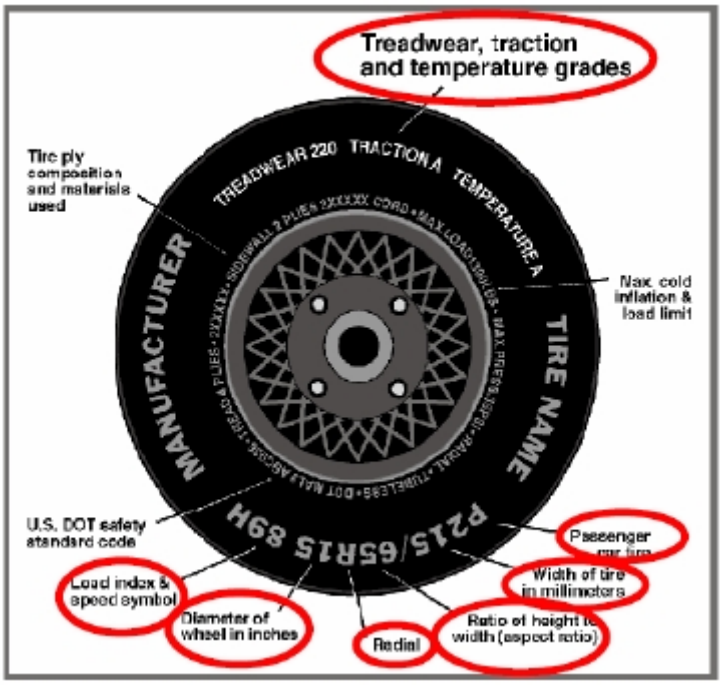

VEHICLE TIRE INFORMATION

Measured Parameter	Front	Rear
Maximum Tire Pressure (kPa)	350	350
Cold Pressure (kPa)	250	260
Recommended Tire Size	235/55R19	235/55R19
Tire Size on Vehicle	235/55R19	235/55R19
Tire Manufacturer	Michelin	Michelin
Tire Model	Primacy All Season	Primacy All Season
Treadwear	540	540
Traction	A	A
Temperature Grades	A	A
Tire Plies Sidewall	2 Polyester	2 Polyester
Tire Plies Body	2 Polyester, 2 Steel, 1 Polyamide	2 Polyester, 2 Steel, 1 Polyamide
Load Index / Speed Symbol	101H	101H
Tire Material	Rubber	Rubber
DOT Safety Code Left	1B98F0BLX1623	1B98F0BLX1723
DOT Safety Code Right	1B98F0BLX1623	1B98F0BLX1723

DATA SHEET NO. 1 … (CONTINUED)
GENERAL TEST AND VEHICLE PARAMETER DATA

Test Vehicle: 2024 Genesis GV60 5 Door SUV | NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test | Test Date: 01/09/2024

TIRE PRESSURES

	Units	LF	RF	LR	RR
As Delivered	kPa	266	266	281	279
Tire Placard	kPa	250	250	260	260
Owner's Manual	kPa	250	250	260	260
As Tested	kPa	250	250	260	260

MDB TIRE SPECIFICATIONS

	Units	Requirements	LF	RF	LR	RR
Tire Size		P205/75R15	P205/75R15	P205/75R15	P205/75R15	P205/75R15
Tire Pressure	kPa	200 ± 21	207	207	207	207

TEST VEHICLE WEIGHTS

	Units	As Delivered (UVW)			As Tested (ATW)			Fully Loaded		
		Front	Rear	Total	Front	Rear	Total	Front	Rear	Total
Left	kg	491	536		526	604		530	615	
Right	kg	472	539		504	575		484	586	
Ratio	%	47.3	52.7		46.6	53.4		45.8	54.2	
Totals	kg	963	1075	2038	1030	1179	2209	1014	1201	2215

TARGET TEST WEIGHT CALCULATION

Measured Parameter	Units	Value	
Total As Delivered Weight (UVW)	kg	2038	(A)
Sum of Actual Weight of 1 ES2re and 1 P572 ATD (SID-IIs)	kg	127	(B)
Rated Cargo / Luggage Weight (RCLW)	kg	50	(C)
Calculated Vehicle Target Weight (TVTW)	kg	2215	(A+B+C)

Does the measured As Test Vehicle Weight lie within the required weight range

(i.e. Calculated Test Vehicle Target Weight – 4.5 kg to – 9 kg)? [X] **Yes** [ ] **No**

TEST VEHICLE ATTITUDES AND CG

Measurement Description	Units	Fully Loaded	As Tested	Meets Rqmt***
LF	mm	844	835	Yes
RF	mm	847	838	Yes
RR	mm	863	855	Yes
LR	mm	853	851	Yes
Vehicle CG (Aft of Front Axle)	mm	1575	1550	
Vehicle CG (Left (+) / Right (-) from Longitudinal Centerline)	mm	28	19	

****The "As Tested" vehicle attitude measurements must be equal to or within ± 10mm of the "Fully Loaded" vehicle attitude measurements at each wheel well. Indicate "Yes" or "No" for "Meets Requirements".*

Test height adjustable suspension setting, if applicable: N/A

DATA SHEET NO. 1 … (CONTINUED)
GENERAL TEST AND VEHICLE PARAMETER DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

WEIGHT OF BALLAST AND VEHICLE COMPONENTS REMOVED TO MEET TVTW

Component Description	Weight (kg)
Jack	4
Truck carpeting & Plastics	16
Charger	2
Passenger Rear Window	3
Emergency Kit	3
Frunk	6
Ballast / Equipment Added	0

TEST SURFACE MARKINGS

	Distance from 63° Impact Location Line (mm)
Fore 25 mm target	900
Aft 25 mm target	903
Pre-Impact Angle Line	230

Parallel Track Target	X Location (mm)	Y Location (mm)
A	0	0
B	2955	1555
C	2955	3355
D	0	3000

DATA SHEET NO. 2
SEAT, SEAT BELT, STEERING WHEEL ADJUSTMENT AND FUEL SYSTEMS DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

SEAT POSITIONING

The driver's seat, front center seat (if applicable), and right front passenger's seat should be set to the mid-track, lowest, mid-angle position. The struck-side rear passenger's seat, rear center seat, and non-struck side rear passenger's seats should be set to the rear-most, lowest, mid-angle position.

SCRL ANGLE RANGE

Seat	SCRL(°)		
	Max	Min	Mid
Driver Seat	23.7	12.3	18.0
Front Passenger Seat	24.0	12.6	18.3
Front Center Seat			
Struck Side Rear Seat	Fixed	Fixed	Fixed
Non-Struck Side Rear Seat	Fixed	Fixed	Fixed
Rear Center Seat	Fixed	Fixed	Fixed

SEAT HEIGHT AND ANGLE

Seat	As Tested SCRL Angle (Mid) (°)	As Tested SCRP Height (mm)	SCRP Height Position	SCRP Height (mm)		
				Rearmost	Mid-Fore / Aft	Forward-Most
Driver Seat	18.0	14	Max	60	66	73
			Mid	34	40	46
			Min	8	14	20
Front Passenger Seat	18.3	13	Max	58	64	70
			Mid	32	38	43
			Min	7	13	18
Front Center Seat*			Max			
			Mid			
			Min			
Struck Side Rear Seat	Fixed	Fixed	Max			
			Mid			
			Min			
Non-Struck Side Rear Seat	Fixed	Fixed	Max			
			Mid			
			Min			
Rear Center Seat*	Fixed	Fixed	Max			
			Mid			
			Min			

**If applicable*

DATA SHEET NO. 2 … (CONTINUED)
SEAT, SEAT BELT, STEERING WHEEL ADJUSTMENT AND FUEL SYSTEMS DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

SEAT FORE / AFT POSITION

Seat	Total Fore / Aft Travel		Test Position from Forwardmost Position	
	mm	Detents*	mm	Detents*
Driver Seat	260	Power	130	Power
Front Passenger Seat	255	Power	127	Power
Front Center Seat				
Struck Side Rear Seat	Fixed	Fixed	Fixed	Fixed
Non-Struck Side Rear Seat	Fixed	Fixed	Fixed	Fixed
Rear Center Seat	Fixed	Fixed	Fixed	Fixed

**if applicable*

SEAT BACK ANGLE ADJUSTMENT

The driver's seat back is positioned to the manufacturer's designated design angle. The front center and front passenger's seat backs are positioned in a similar manner as the driver's seat back. The struck side rear seat back is positioned such that the dummy's head is level. The rear center and non-struck side rear outboard seat backs are positioned in a similar manner as the struck-side rear seat back.

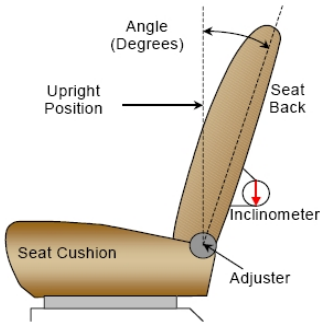

FRONT SEAT ASSEMBLY

Seat	Total Seat Back Angle Range		Test Position from Most Upright	
	Degrees	Detents*	Degrees	Detents*
Driver Seat w/ Seated Dummy	48.3	Power	0.0	Power
Front Passenger Seat	47.2	Power	0.0	Power
Front Center Seat*				
Struck Side Rear Seat w/ Seated Dummy	30.1	16 (0-15)	4.6	0
Non-Struck Side Rear Seat	30.3	16 (0-15)	5.0	0
Rear Center Seat*	30.1	16 (0-15)	4.7	0

**if applicable*

DATA SHEET NO. 2 … (CONTINUED)
SEAT, SEAT BELT, STEERING WHEEL ADJUSTMENT AND FUEL SYSTEMS DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

SEAT BELT ANCHORAGE ADJUSTMENT

Seat belt anchorages are adjusted in accordance with the information provided by the manufacturer on Form No. 1. For this test zero is defined as the uppermost position.

Seat	Total # of Positions	Placed in Position #
Driver Seat	4 (0-3)	0
Rear Seat	Fixed	Fixed

HEAD RESTRAINT ADJUSTMENT

The driver's head restraint is adjusted to the highest and most full forward in-use position. The struck-side rear passenger's head restraint is adjusted to the lowest and most full forward in-use position.

Seat	Total # of Positions	Placed in Position #
Driver Seat	6 (0-5)	Uppermost & Forwardmost
Rear Seat	3 (0-2)	Lowermost

STEERING COLUMN ADJUSTMENT

Steering wheel and column adjustments are made so that the steering wheel hub is at the center of its geometric locus it describes when it moves through its full range of motion.

	Degrees	Fore / Aft Position (mm)
Lowermost - Position No. 1	20.8	
Geometric center - Position No. 2	23.3	
Uppermost - Position No. 3	25.7	
Telescoping Steering Wheel Travel		52
Test Position	23.3	26

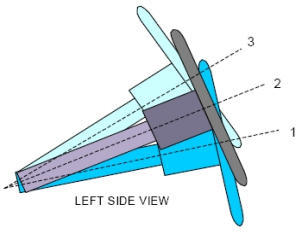

STEERING COLUMN ASSEMBLY

FUEL PUMP

Describe the fuel pump type, details about how it operates, and the location of the fuel filler neck

The vehicle is an electric vehicle. The charge port is on the right rear of the vehicle.

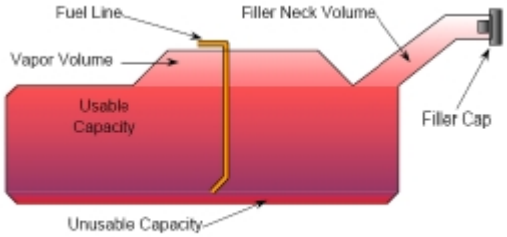

VEHICLE FUEL TANK ASSEMBLY

DATA SHEET NO. 2 … (CONTINUED)
SEAT, SEAT BELT, STEERING WHEEL ADJUSTMENT AND FUEL SYSTEMS DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

FUEL TANK CAPACITY

Description	Liters
Usable Capacity of “Standard Tank” (see Form No. 1)	N/A
Usable Capacity of “Optional Tank” (see Form No. 1)	N/A
Usable Capacity of “Standard Tank” (see Owner’s Manual)	N/A
Usable Capacity of “Optional Tank” (see Owner’s Manual)	N/A
93% of Usable Capacity	N/A
Actual Amount of Solvent Used in Test	Electric Vehicle
1/3 of Usable Capacity	N/A

Is the Actual Amount of Solvent Used in the test equal to 93% ±1% of the Usable Capacity stated in Form No. 1? [ ] **Yes** [ ] **No** [X] **N/A**

DATA SHEET NO. 3
DUMMY LONGITUDINAL CLEARANCE DIMENSIONS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

DUMMY LONGITUDINAL CLEARANCE DIMENSION INFORMATION

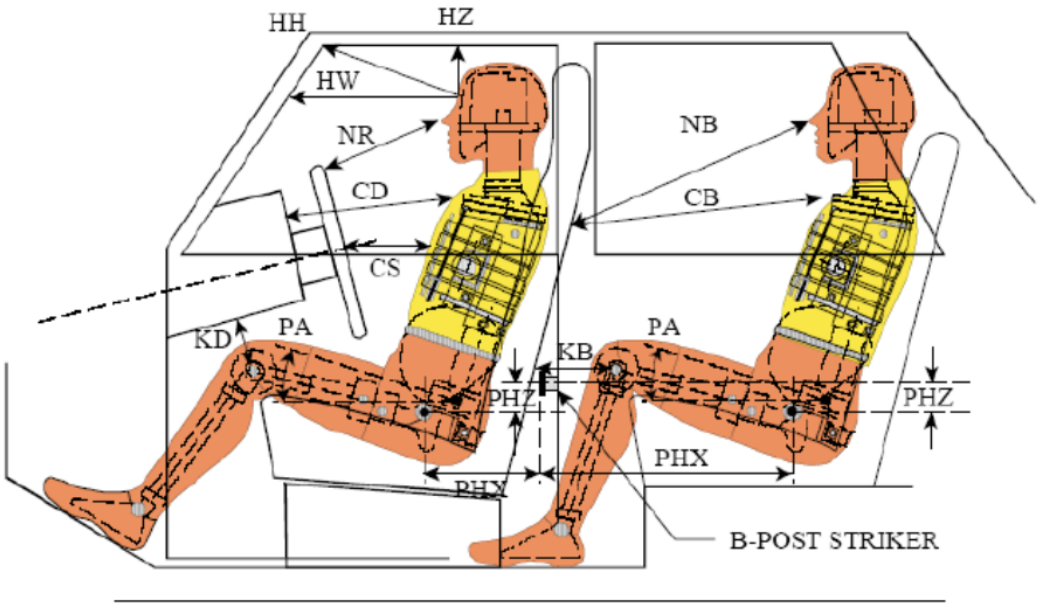

LEFT SIDE VIEW

NOTE: 2-DOOR VEHICLE SHOWN. REAR DUMMY PHX & PHZ MEASUREMENTS FOR A 4-DOOR VEHICLE WOULD USE THE C-POST STRIKER AS A REFERENCE POINT

Driver Code	Pass. Code	Description	Driver (Serial No. F033)		Left Rear Passenger (Serial No. 300)	
			Length (mm)	Angle (°)	Length (mm)	Angle (°)
HH		Header to Header	411			
HW		Header to Windshield	665			
HZ	HZ	Head to Roof Liner	180		251	
NR	NB	Nose to Rim/Seat Back	430		492	
CD	CB	Chest to Dash/Seat Back	619		512	
CS		Chest to Steering Wheel	325			
KD(L)/KDA(L)°	KB(L)/KBA(L)°	Left Knee to Dash/Seat Back	220		248	18.3
KD(R)/KDA(R)°	KB(R)/KBA(R)°	Right Knee to Dash/Seat Back	184		249	18.0
PAX°	PAX°	Pelvic Tilt Angle X		23.5		20.45
	PAY°	Pelvic Tilt Angle Y				0.2
PHX	PHX	Hip Point to Striker (X-Axis)	184		238	
PHZ	PHZ	Hip Point to Striker (Z-Axis)	208		152	

DATA SHEET NO. 4
DUMMY LATERAL CLEARANCE DIMENSIONS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

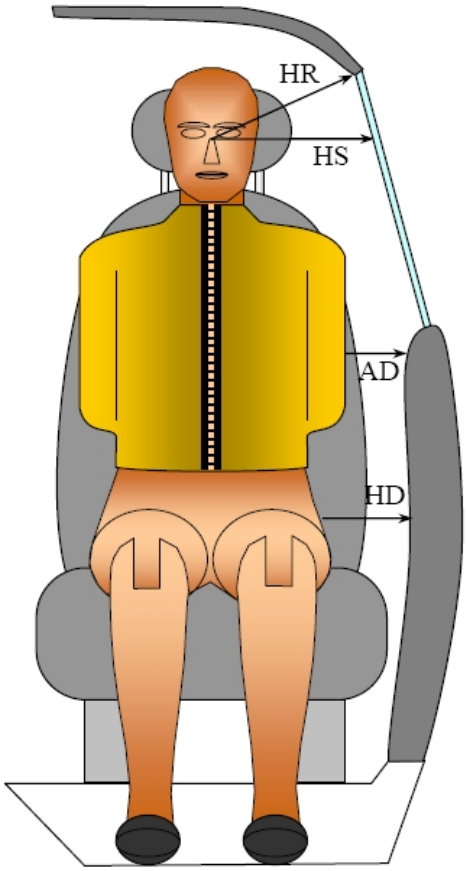

FRONT VIEW OF DUMMY

DUMMY LATERAL CLEARANCE DIMENSION INFORMATION

Code	Measurement Description	Units	Driver (Serial No. F033)	Left Rear Passenger (Serial No. 300)
HR	Head to Side Header	mm	230	267
HS	Head to Side Window	mm	354	370
AD	Arm to Door	mm	116	145
HD	Hip Point to Door	mm	154	158

DATA SHEET NO. 5
CAMERA AND INSTRUMENTATION DATA

Test Vehicle: 2024 Genesis GV60 5 Door SUV
NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test
Test Date: 01/09/2024

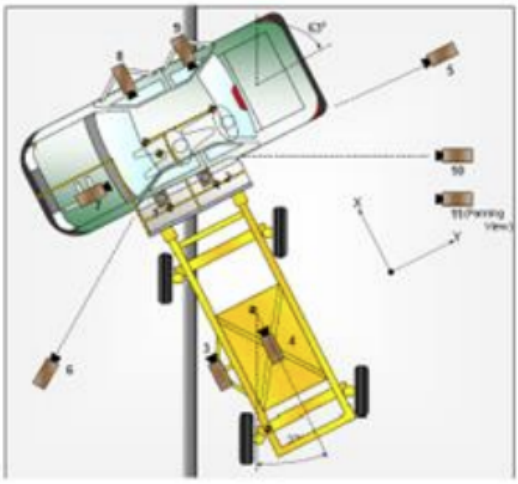

CAMERA LOCATIONS AND DATA

No.	Camera View	Location (mm)			Lens (mm)	Speed (fps)
		X	Y	Z		
1	Overhead Overall	0	-420	-8440	12.5	1000
2	Overhead Close-up	0	0	-8790	28	1000
3	Left Impact Point (MDB)	-1470	0	-847	25	1000
4	Side Overall (MDB)	-1140	878	-1587	8	1000
5	Rear	0	10900	-1455	28	1000
6	Left Front	-3400	-6515	-1540	24	1000
7	Driver Front (OB)				25	1000
8	Driver Side (OB)				12.5	1000
9	Passenger Side (OB)				12.5	1000
10	Real-time Left Rear				Zoom	60
11	Real-time In Run				Zoom	60

Notes: *Reference: Impact Point projected to Ground*
+X = To Front of MDB, +Y = To Right of MDB, +Z = Down
** All measurements accurate to ± 6 mm.*

If applicable, explain why camera(s) did not operate as intended: All cameras operated as intended.

INSTRUMENTATION

Description	Number of Channels
Driver Dummy Channels	16
Passenger Dummy Channels	16
Vehicle Structure Accelerometers	23
MDB Accelerometers	7
Total	62

DATA SHEET NO. 6
TEST VEHICLE ACCELEROMETER LOCATIONS

Test Vehicle: 2024 Genesis GV60 5 Door SUV
NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test
Test Date: 01/09/2024

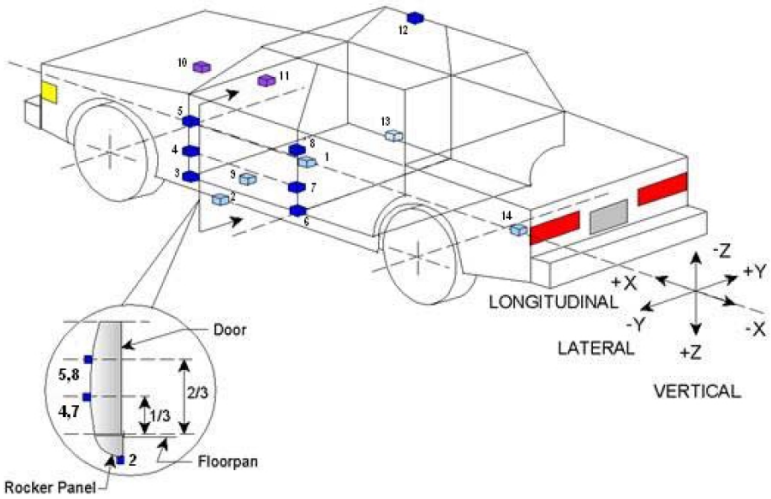

TEST VEHICLE ACCELEROMETER LOCATIONS

No.	Accelerometer Location	Coordinates (mm)		
		X	Y	Z
1	Vehicle CG	2443	1	-61
2	Right Sill at Front Seat	2689	662	316
3	Right Sill at Rear Seat	1792	661	313
4	Left Sill at Front Door	2690	-661	322
5	Left Sill at Rear Door	1808	-659	321
6	A-Post Lower	3129	-654	97
7	A-Post Middle	3028	-670	-371
8	B-Post Lower	2032	-666	-96
9	B-Post Middle	2005	-666	-356
10	Front Seat Track	2311	-575	338
11	Rear Seat Structure	1678	-405	307
12	Rt. Rear Occ. Compartment	1856	334	371
13	Engine Block	3726	-71	119
14	Rear Above Axle	698	8	111

Reference: X – Rear surface of vehicle (+ forward)
Y – Vehicle centerline (+ to right)
Z – Ground plane (+ down)

DATA SHEET NO. 7
MDB ACCELEROMETER LOCATIONS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

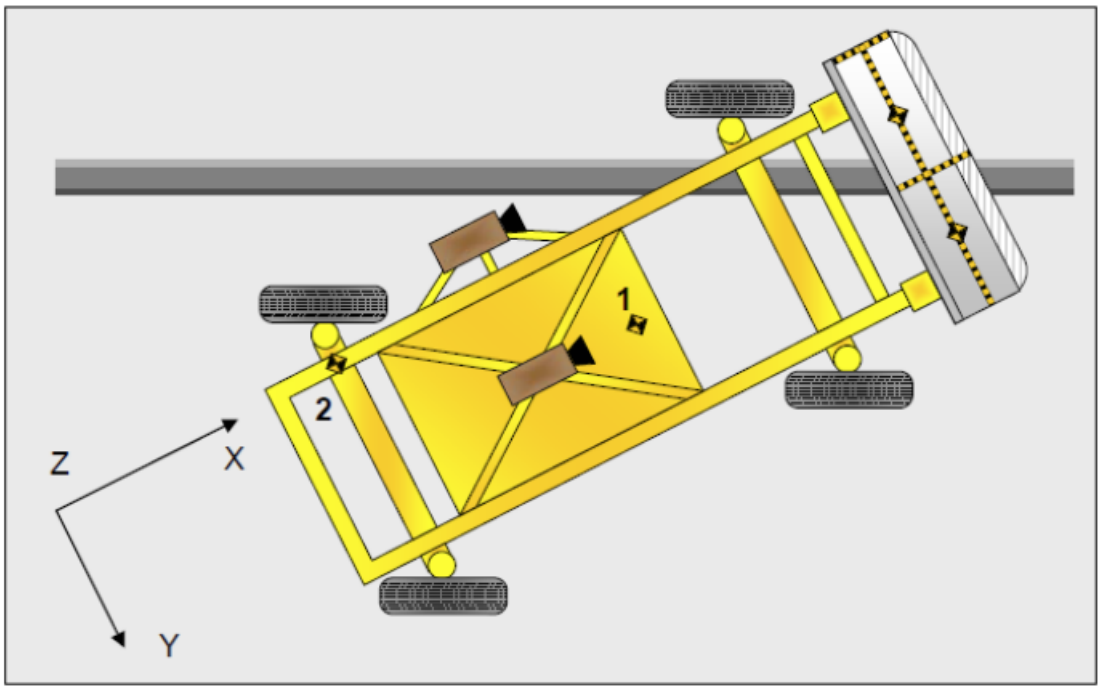

MDB ACCELEROMETER LOCATIONS

No.	Accelerometer Location	Coordinates (mm)		
		X	Y	Z
1	MDB CG	1859	0	-330
2	MDB Rear	386	-660	-660

Reference: *X – Face of MDB (+forward)*
Y – MDB centerline (+ to right)
Z – Ground plane (+down)

Width between left and right contact switches (mm): 1472

DATA SHEET NO. 8
POST-TEST OBSERVATIONS

Test Vehicle: 2024 Genesis GV60 5 Door SUV
NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test
Test Date: 01/09/2024

TEST DUMMY INFORMATION AND CONTACT POINTS

Description	Front Seat Dummy (ES-2re)	Rear Seat Dummy (SID-IIs)
Face	Curtain Airbag	Curtain Airbag
Top of Head	Curtain Airbag & Side Headliner	Curtain Airbag
Left Side of Head	Curtain Airbag	Curtain Airbag
Back of Head	Headrest, Side Headliner & Curtain Airbag	Curtain Airbag, Seatback & Center Headrest
Left Shoulder	Torso/Pelvis Airbag & Curtain Airbag	Seatback
Upper Torso	Seatback	Seatback
Lower Torso	Seatback	Seatback & Torso/Pelvis Airbag
Left Hip	Seatpan, Torso/Pelvis Airbag	Seatpan, Torso/Pelvis Airbag & Passenger Door
Left Knee	Driver Door	Passenger Door

POST-TEST DOOR PERFORMANCE

Description	Struck Side		Non-Struck Side		Rear Hatch/ Other*
	Front	Rear	Front	Rear	
Remained Closed and Operational	No	No	Yes	Yes	Yes
Total Separation from Vehicle at Hinges or Latches	No	No	No	No	No
Latch or Hinge Systems Pulled Out of Their Anchorages	No	No	No	No	No
Disengaged from Latched Position	No	No	No	No	No
Latch Separated from Striker	No	No	No	No	No
Jammed Shut	Yes	Yes	No	No	No
If Door Opened at Striker, Width of Opening at Striker (mm)	0	0	0	0	0

POST-TEST SEAT PERFORMANCE

Description	Struck Side		Non-Struck Side	
	Front	Rear	Front	Rear
Seat Movement Along Seat Track	No	No	No	No
Seat Disengagement from Floor Pan	No	No	No	No
Seat Back Movement from Initial Position	Yes	No	No	No
Seat Back Collapse	No	No	No	No

POST-TEST STRUCTURAL OBSERVATIONS

Critical Areas of Performance	Observations and Conclusions
Pillar Performance	B-Pillar buckled
Sill Separation	None
Windshield Damage	None
Side Window Damage	Driver window cracked and fell out
Other Notable Effects	Seatback reclined after impact event

DATA SHEET NO. 8 … (CONTINUED)
POST-TEST OBSERVATIONS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

SUPPLEMENTAL RESTRAINT SYSTEM INFORMATION

Restraint Type	Struck Side Driver		Struck Side Rear Passenger	
	Mounted	Deployed	Mounted	Deployed
Front Airbag	Yes	No		
Knee Airbag	Yes	No		
Side Airbag 1 - Curtain	Yes	Yes	Yes	Yes
Side Airbag 2 - Torso/Pelvis Airbag	Yes	Yes	Yes	Yes
Seat Belt Pretensioner	Yes	Yes	Yes	Yes
Seat Belt Load Limiter	Yes	Yes	Yes	Yes
Other - Center Airbag	Yes	Yes	No	N/A

IMPACT POINT LOCATION DATA

Measured Parameter	Units	Tolerance	Value
Vehicle Wheel Base	mm		2905
Vertical Impact Reference Line (Aft of Front Axle - Intended Impact Point)	mm		508
Actual Impact Point (Aft of Frontal Axle)	mm		513
Horizontal Offset (+ forward / - rearward)	mm	+/- 50 of Intended Impact Point	-5
Vertical Offset (+ down / - up)	mm	+/- 20 of Intended Impact Point	-1

DATA SHEET NO. 9
MDB SUMMARY OF RESULTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

MDB SPECIFICATIONS

Measurement Description	Length (mm)
Overall Width of Framework Carriage	1250
Overall Length Including Honeycomb Frame	4120
Wheelbase of Framework Carriage	2591
CG Location of Front Axle	1122

MDB WEIGHTS

	Units	Front Axle	Rear Axle	Total
Left	kg	396	291.5	687.5
Right	kg	377.5	301	678.5
Ratio	%	56.6	43.4	100
Totals	kg	773.5	592.5	1366

SPEED AND ANGLE AT IMPACT DATA

Measured Parameter	Units	Requirement	Value
Trap No. 1 Velocity (Primary)	km/h	61.10 to 62.70	62.13
Trap No. 2 Velocity (Redundant)	km/h	61.10 to 62.70	62.14
MDB CL to Target Vehicle CL	degrees	88.5 to 91.5	90.0
MDB Forward Line of Motion to Target Vehicle CL	degrees	62.5 to 63.5	63.0
MDB Crabbed angle to MDB Forward Line of Motion	degrees	26.0 to 28.0	27.0

MAXIMUM STATIC CRUSH OF HONEYCOMB IMPACT FACE

Vertical Location			From Centerline		Maximum Crush (mm)
Row	Description	Height (mm)	Distance (mm)	Direction	
A	Center of Bumper	432	800	Left	256
B	Top of Bumper	533	700	Left	170
C	Mid-Level	686	800	Left	169
D	Top of Stack	813	800	Left	170

DATA SHEET NO. 10
TEST VEHICLE PROFILE MEASUREMENTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

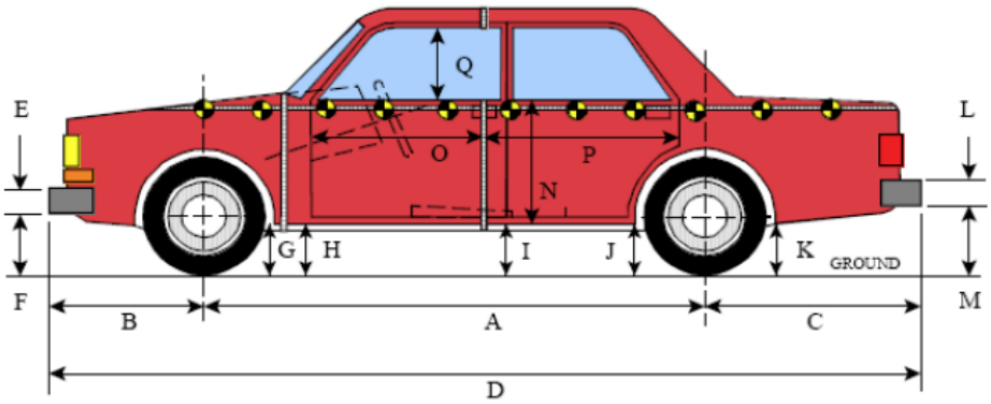

LEFT SIDE VIEW
All MEASUREMENTS IN (mm) WITH TOLERANCE OF ± 3mm

VEHICLE PRE- AND POST-TEST MEASUREMENT INFORMATION

Code.	Measurement Description	Pre-Test	Post-Test	Change
A	Wheelbase	2905	2905	0
B	Front Axle to FSOV	832	835	3
C	Rear Axle to RSOV	781	780	-1
D2	Total Length at Centerline	4520	4520	0
E	Front Bumper Thickness	260	260	0
F	Front Bumper Bottom to Ground	287	288	1
G	Sill Height at Front Wheel Well	167	168	1
H	Sill Height at Front Door Leading Edge	175	175	0
I	Sill Height at B Pillar	195	195	0
J1	Sill Height at Rear Wheel Well	188	190	2
J2	Pinch Weld Height at Rear Wheel Well	183	183	0
K	Sill Height Aft of Rear Wheel Well	241	245	4
L	Rear Bumper Thickness	184	184	0
M	Rear Bumper Bottom to Ground	440	445	5
N	Sill Height to Bottom of Front Window Sill	836	794	-42
O	Front Door Leading Edge to Impact CL	788	777	-11
P	Rear Door Trailing Edge to Impact CL	1349	1328	-21
Q	Front Window Opening	459	459	0
R	Right Side Length	4439	4438	-1
S	Left Side Length	4442	4438	-4
T	Vehicle Width at B-Pillars	1828	1718	-110
U	Front Wheel Track Width	1636	1628	-8
V	Rear Wheel Track Width	1640	1635	-5

DATA SHEET NO.11
TEST VEHICLE EXTERIOR CRUSH MEASUREMENTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

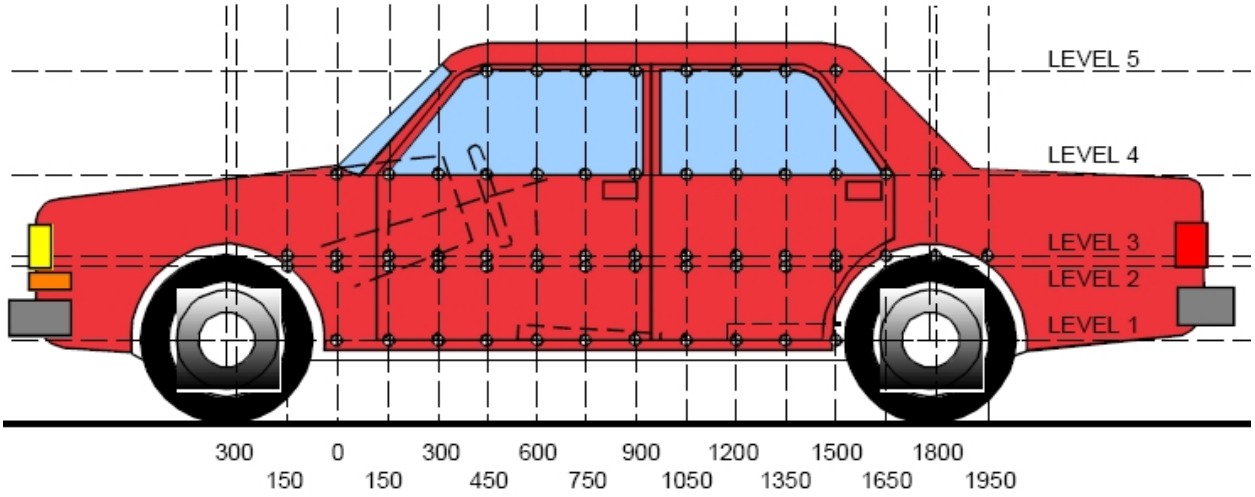

LEFT SIDE VIEW

MAXIMUM EXTERIOR CRUSH MEASUREMENTS

Level	Measurement Description	Units	Height Above Ground	Maximum Exterior Static Crush	Distance from Impact
1	Sill Top	mm	293	29	1050
2	Occupant H-Point	mm	600	190	1500
3	Mid-Door	mm	661	186	1350
4	Window Sill	mm	1022	104	1500
5	Window Top	mm	1512	7	1500

NOTE: *The above measurements should be taken along the vertical impact reference line. Vehicle measurements forward of the vertical impact reference line are negative.*

DATA SHEET NO.11 … (CONTINUED)
TEST VEHICLE EXTERIOR CRUSH MEASUREMENTS

Test Vehicle: 2024 Genesis GV60 5 Door SUV NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test Test Date: 01/09/2024

EXTERIOR CRUSH MEASUREMENTS AT EACH LEVEL

	Pre-Test					Post-Test					Crush				
	1	2	3	4	5	1	2	3	4	5	1	2	3	4	5
-900															
-750															
-600															
-450															
-300				836					833					3	
-150			943	838				940	835				3	3	
0	917	934	934	842		915	931	932	840		2	3	2	2	
150	909	921	923	843		912	827	849	833		-3	94	74	10	
300	906	915	919	850		902	793	811	840		4	122	108	10	
450	904	911	916	855		895	771	780	836		9	140	136	19	
600	903	909	914	860		889	773	767	835		14	136	147	25	
750	901	907	912	862		883	779	767	828		18	128	145	34	
900	900	906	911	865	628	877	783	764	822	626	23	123	147	43	2
1050	899	905	909	865	641	870	785	766	816	636	29	120	143	49	5
1200	897	903	907	863	640	882	781	771	793	636	15	122	136	70	4
1350	896	903	907	862	638	890	721	721	764	633	6	182	186	98	5
1500	897	905	909	861	633	899	715	726	757	626	-2	190	183	104	7
1650	900	913	916	863	621	913	734	751	766	616	-13	179	165	97	5
1800	908	926	927	872	604	925	798	812	809	601	-17	128	115	63	3
1950	918	934	943	886	581	963	897	883	850	579	-45	37	60	36	2
2100				901					889					12	
2250				910					901					9	
2400				909					903					6	
2550															
2700															
2850															
3000															

NOTE: *Pre-test measurements are taken when the vehicle is in the "As Tested" weight condition.*
Vehicle measurements forward of the vertical impact reference line are negative.
The crush profile grid is established prior to test based on an estimated impact point.

DATA SHEET NO.11 … (CONTINUED)
TEST VEHICLE EXTERIOR CRUSH MEASUREMENTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

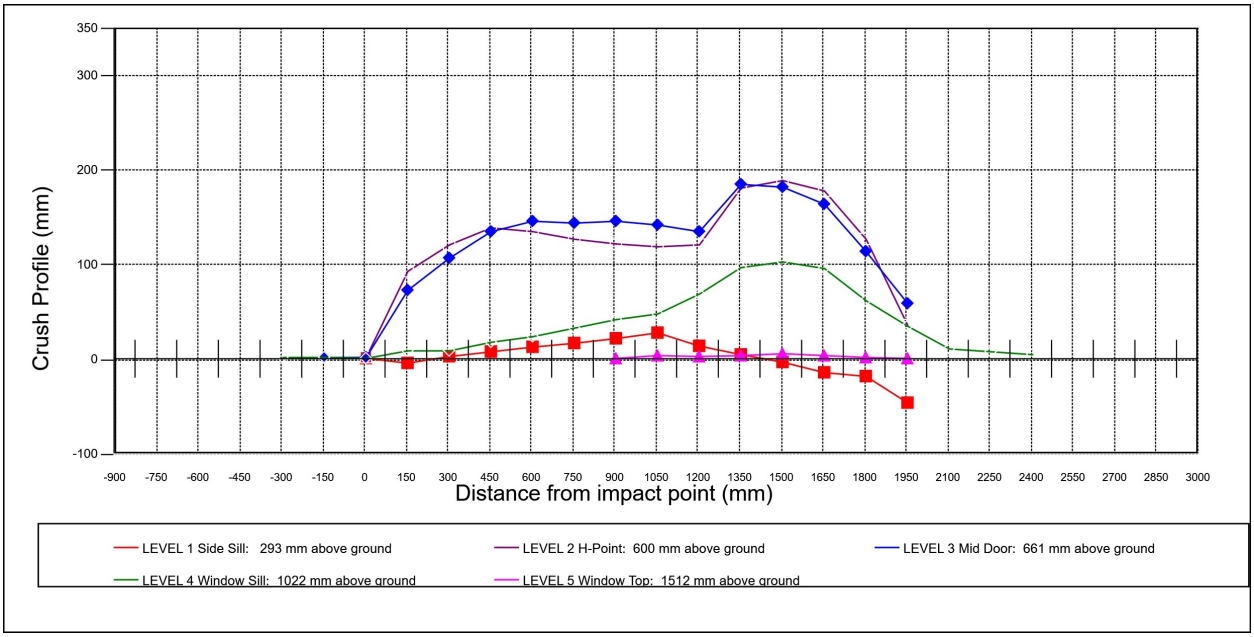

Vehicle Exterior Crush Measurements - Visual Representation

DATA SHEET NO.12
MDB EXTERIOR STATIC CRUSH MEASUREMENTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

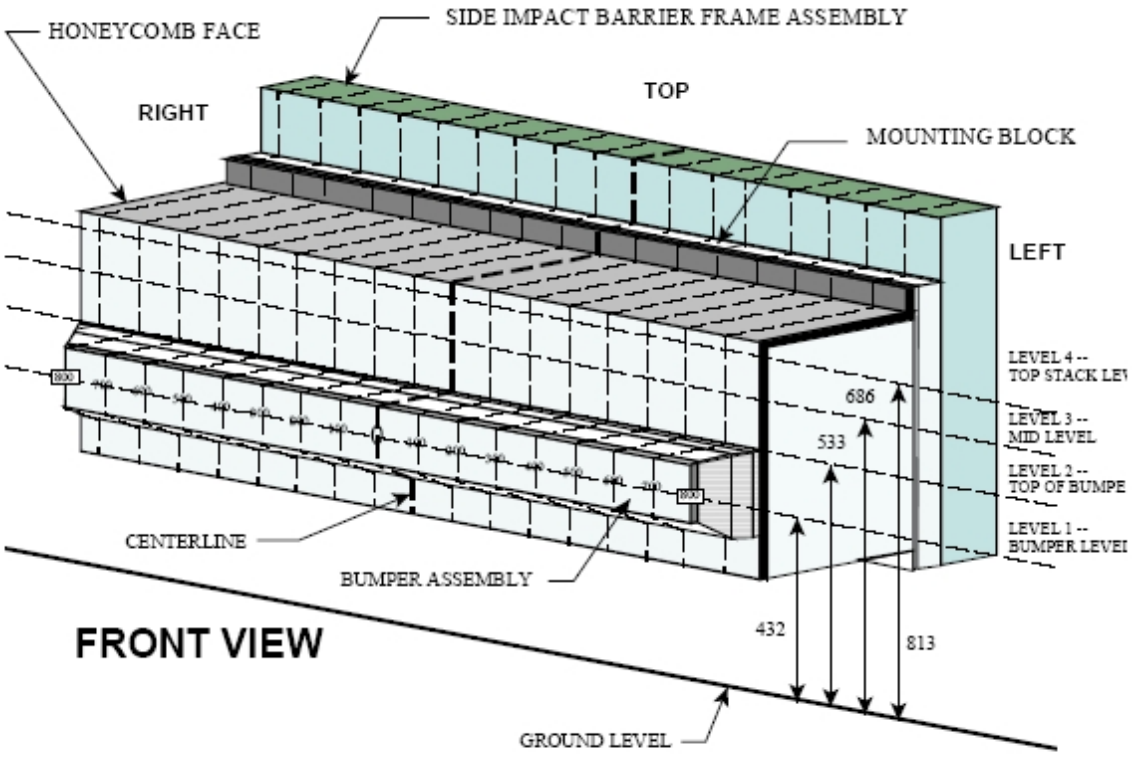

NOTE: Dimensions are shown in millimeters, mm

DEFORMABLE BARRIER STATIC CRUSH

Stack Level	Distance Right of Center								C/L	Distance Left of Center							
	800	700	600	500	400	300	200	100	0	100	200	300	400	500	600	700	800
1	244	241	239	238	238	237	235	232	231	228	227	225	224	223	222	230	256
2	144	141	141	139	140	132	152	144	135	133	128	126	124	124	124	149	170
3	144	104	83	76	79	89	100	95	87	78	69	65	65	75	95	126	169
4	115	82	63	64	80	104	143	132	107	87	89	77	94	100	117	139	170

DATA SHEET NO.13
VEHICLE AND MDB DAMAGE PROFILE DISTANCE

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

For guidance regarding damage profile distance measurements, please refer to the latest version of the *NHTSA Test Reference Guide, Volume 1: Vehicle Tests.*

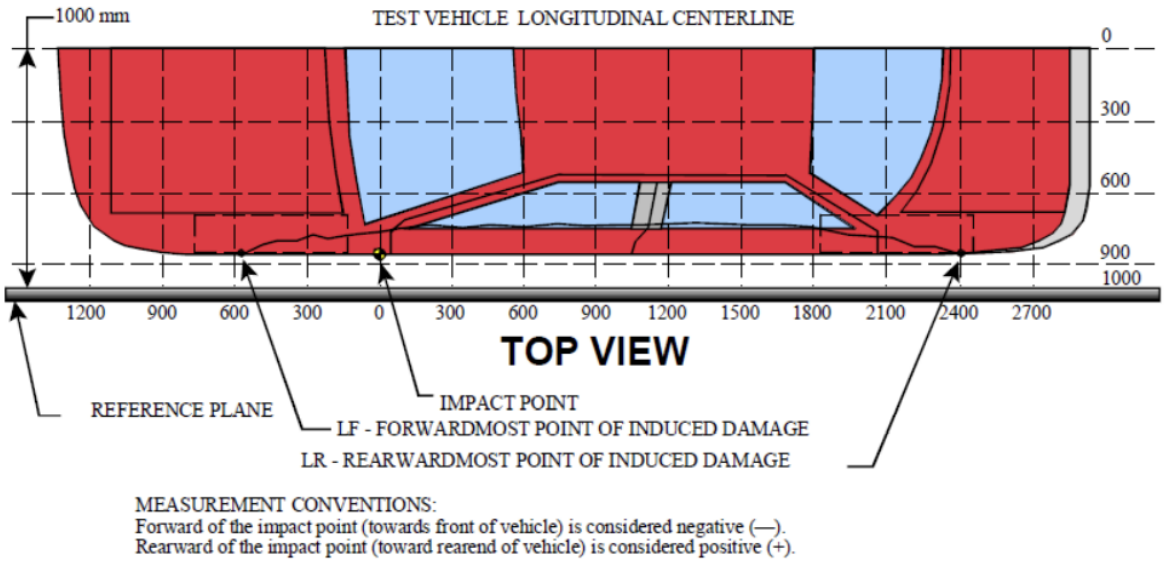

MEASUREMENT CONVENTIONS:
Forward of the impact point (towards front of vehicle) is considered negative (—).
Rearward of the impact point (toward rearend of vehicle) is considered positive (+).

VEHICLE DAMAGE PROFILE DISTANCES

DPD	Distance From Impact Point (mm)	Level	Post-Test (mm)	Pre-Test (mm)	Crush (mm)
1	-150	3	60	57	3
2	270	3	181	80	101
3	690	3	233	87	146
4	1110	3	232	92	140
5	1530	3	269	90	179
6	1950	3	117	57	60

MDB DAMAGE PROFILE DISTANCES

DPD	Distance From Center of MDB (mm)	Level	Post-Test (mm)	Pre-Test (mm)	Crush (mm)
1	800 mm left of center	1	249	505	-256
2	480 mm left of center	1	291	514	-223
3	160 mm left of center	1	287	514	-227
4	160 mm right of center	1	280	513	-234
5	480 mm right of center	1	275	513	-238
6	800 mm right of center	1	257	501	-244

DATA SHEET NO.14
FMVSS NO.301 STATIC ROLLOVER RESULTS

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024
Test Time:	10:53 AM	Temperature:	21 °C

A. From impact until vehicle motion ceases: N/A oz
(Maximum allowable is 1 oz.)
B. For the 5-minute period after motion ceases: N/A oz
(Maximum allowable is 5 oz.)
C. For the following 25 minutes: N/A oz
(Maximum allowable is 1 oz.)

D. Spillage Detail: Electric Vehicle

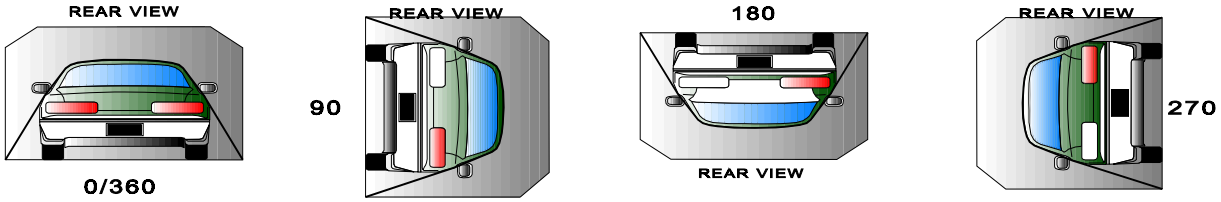

ROLLOVER SOLVENT COLLECTION TIME TABLE IN SECONDS

Test Phase	Rotation Time	Hold Time	Total Time
0° to 90°		300	
90° to 180°		300	
180° to 270°		300	
270° to 360°		300	

FMVSS 301 SPILLAGE TABLE

Test Phase	First 5 Minutes	Sixth Minute	Seventh Minute	Eighth Minute
0° to 90°				
90° to 180°				
180° to 270°				
270° to 360°				

SOLVENT SPILLAGE LOCATION TABLE

Test Phase	Spillage Location
0° to 90°	
90° to 180°	
180° to 270°	
270° to 360°	

DATA SHEET NO. 15
DUMMY / VEHICLE TEMPERATURE AND HUMIDITY STABILIZATION DATA

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

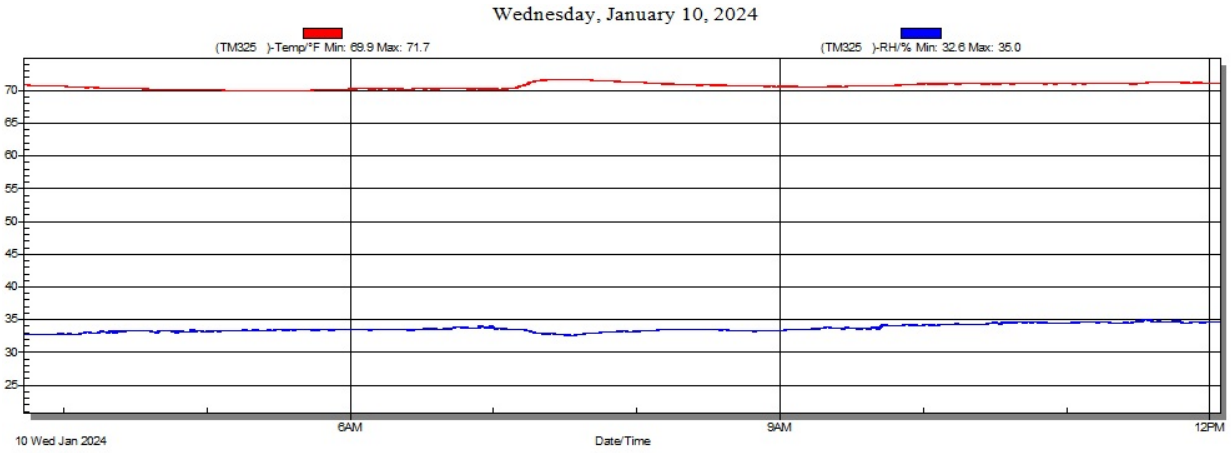

Temperature and Humidity Stabilization Chart/Data for Dummies and Test Vehicle

DATA SHEET NO. 305-1
GENERAL TEST AND VEHICLE PARAMETER DATA FOR INDICANT FMVSS NO. 305 TESTING

Test Vehicle: 2024 Genesis GV60 5 Door SUV NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test Test Date: 01/09/2024

ELECTRIC VEHICLE PROPULSION SYSTEM

Measured Parameter	Value
Type of Electric Vehicle (Electric/Gas-Electric Hybrid/Fuel Cell-Electric Hybrid)	Electric
Propulsion Battery Type	Lithium-ion Polymer
Nominal Voltage (Volts)	687
Is this Vehicle equipped with an Automatic Propulsion Battery Disconnect?	Yes
Physical Location of Automatic Propulsion Battery Disconnect, if applicable	Inside of Propulsion Battery
Auxiliary Battery Type	Lead-Acid

PROPULSION BATTERY SYSTEM DATA (COTR SUPPLIED)

Measured Parameter	Value
Electrolyte Fluid Type	Liquid solution, LiPF6 salt, Carbonate solvent
Electrolyte Fluid Specific Gravity	1.19 g/cm3
Electrolyte Fluid Kinematic Viscosity (centistokes)	2~3 cP @ 25˚C
Electrolyte Fluid Color	Transparent & Pale Yellow
Propulsion Battery Coolant Type, Color and Specific Gravity (if applicable)	Applied (Water-cooled type), Blue
Location of Battery Modules (Inside or Outside of Passenger Compartment?)	Outside

PROPULSION BATTERY STATE OF CHARGE

Measured Parameter	Units	Value
For all battery types: Voltage Range corresponding to **useable energy** of the battery:		
Minimum State of Charge	V	480
Maximum State of Charge	V	826
95% of Maximum	V	784.7
Test Voltage *	V	789
For batteries that are rechargeable ONLY by an energy source on the vehicle: Voltage range corresponding to **useable energy** of the battery:		
Minimum State of Charge	V	
Maximum State of Charge	V	
95% of Maximum	V	
Test Voltage *	V	

* *For all battery types-No less than 95% of Maximum Operating Voltage; for batteries that are rechargeable ONLY by an energy source on the vehicle-maximum practicable state of charge within normal operating range.*

DATA SHEET NO. 305-2
PRE-IMPACT DATA FOR INDICANT FMVSS NO. 305 TESTING

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

VEHICLE CHASSIS GROUND PT(S) LOCATION(S) & PROPULSION BATTERY SYSTEM

Measured Parameter	Value
Details of Vehicle Chassis Ground Points & Locations	located on vehicle body. No guidance provided by OEM.
Details of Propulsion Battery Components	None provided by OEM

DATA SHEET NO. 305-3
PRE-IMPACT ELECTRICAL ISOLATION MEASUREMENTS AND CALCULATIONS FOR INDICANT FMVSS NO. 305 TESTING

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

VOLTMETER INFORMATION

Measured Parameter	Units	Value
Make & Model		Fluke 1587
Serial No.		51800115
Internal Impedance Value	MΩ	10
Resolution	V	0.001
Last Calibration Date		06/20/2023

NOTES:

- *The voltmeter used in this test shall measure DC values and have an internal impedance of at least 10 M Ω*
- *An oscilloscope meeting the above requirements may need to be used to adequately measure voltage in some vehicles.*

PROPULSION BATTERY VOLTAGE, RESISTANCE & ELECTRICAL ISOLATION MEASUREMENTS & CALCULATIONS

Measured Parameter	Symbol	Units	Value
Normal operating voltage range specified by the manufacturer	V_b	V	480-826
Propulsion Battery Voltage: (ready to drive position)	V_b	V	789.0
Propulsion Battery to Vehicle Chassis	V_1	V	590.0
Propulsion Battery to Vehicle Chassis	V_2	V	565.0
Propulsion Battery to Vehicle Chassis Across Known Resistor	R_o	Ω	403,700
Propulsion Battery to Vehicle Chassis with R_o installed	V_1'	V	134.0
Propulsion Battery to Vehicle Chassis with R_o installed	V_2'	V	158.0
$R_{i1}= R_o*(1+V_2/V_1)*[(V_1-V_1')/V_1']$	R_{i1}	Ω	2,689,359
$R_{i2}= R_o*(1+V_1/V_2)*[(V_2-V_2')/V_2']$	R_{i2}	Ω	2,125,835
Lesser value of R_{i1} and R_{i2}	R_i	Ω	2,125,835
Electrical Isolation Value (Minimum E.I. Value is 500 Ω/V)	R_i/V_b	Ω/V	2,694

Is the Electrical Isolation Value ≥ 500 Ω/V (Yes/No)? [X] Yes [ ] No (Fail)

NOTES:

- *The measurement shall be made with the propulsion battery connected to the vehicle propulsion system, and the vehicle in the "ready-to-drive" (propulsion motor(s) activated) position.*
- *If the voltage measurement is not at the voltage or within the normal operating voltage range specified by the manufacturer, the battery must be charged.*
- *The known resistance Ro (in Ohms) should be approximately 500 times the nominal operating voltage of the vehicle (in volts) per SAE J1766*
- *If measured voltage is zero and results in a division by zero, record "Zero Volts." This "zero voltage" condition is considered as being compliant*

DATA SHEET NO. 305-4
POST-IMPACT DATA FOR INDICANT FMVSS NO. 305 TESTING

Test Vehicle:	2024 Genesis GV60 5 Door SUV	NHTSA No.:	O20244210
Test Program:	NCAP Side MDB Impact Test	Test Date:	01/09/2024

VOLTMETER INFORMATION

Measured Parameter	Units	Value
Make & Model		Fluke 1587
Serial No.		51800115
Internal Impedance Value	MΩ	10
Resolution	V	0.001
Calibration Date		06/20/2024

NOTES:

- *The voltmeter used in this test shall measure DC values and have an internal impedance of at least 10 M Ω*
- *An oscilloscope meeting the above requirements may need to be used to adequately measure voltage in some vehicles.*

ELECTRICAL ISOLATION MEASUREMENTS & IMPACT CALCULATIONS

Parameter	Value	Units		Value		Value	
V_b =	13.7	V	Time:	1	Minutes	16	Seconds
V_1 =	1.5	V	Time:	1	Minutes	24	Seconds
V_2 =	5.2	V	Time:	1	Minutes	43	Seconds
R_o =	403,700	Ω					
V_1' =	0.1	V	Time:	1	Minutes	52	Seconds
V_2' =	0.3	V	Time:	2	Minutes	2	Seconds
R_{i1} =	25,244,707	Ω	Time:	1	Minutes	52	Seconds
R_{i2} =	8,495,815	Ω	Time:	2	Minutes	2	Seconds
R_i =	8,495,815	Ω/V	Time:	2	Minutes	2	Seconds
R_i/V_b =	620,132	Ω/V	Time:	2	Minutes	2	Seconds

Is the Electrical Isolation Value ≥ 500 Ω/V (Yes/No)?	X	Yes		No (Fail)

NOTES:

- *$R_{i1}= R_o*(1+V_2/V_1)*[(V_1-V_1')/V_1']$, $R_{i2}= R_o*(1+V_1/V_2)*[(V_2-V_2')/V_2']$, R_i = Lesser value of R_{i1} and R_{i2}*
- *If measured voltage is zero and results in a division by zero, record "Zero Volts." This "zero voltage" condition is considered as being compliant*
- *Minimum Electrical Isolation Value is 500 Ω/V*

PROPULSION BATTERY SYSTEM COMPONENTS

Measured Parameter	Comments	Passed	Failed
Propulsion Battery Module movement within the passenger compartment	None	X	
Intrusion of an outside Propulsion Battery Component into the passenger compartment	None	X	
Is propulsion battery electrolyte spillage visible in the passenger compartment?	None	X	

DATA SHEET NO. 305-5
STATIC ROLLOVER TEST DATA FOR INDICANT FMVSS NO. 305 TESTING

Test Vehicle: 2024 Genesis GV60 5 Door SUV
Test Program: NCAP Side MDB Impact Test
NHTSA No.: O20244210
Test Date: 01/09/2024

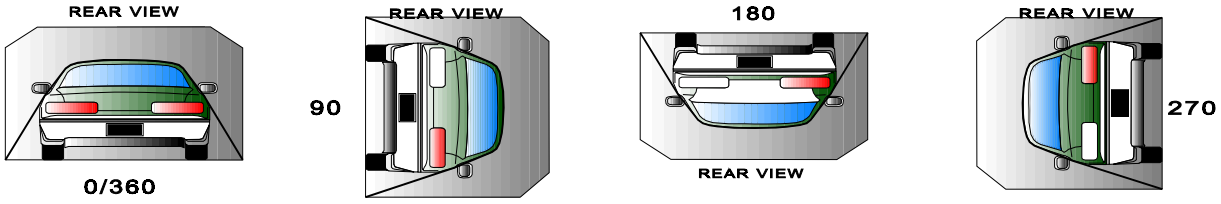

Rear View

DETERMINATION OF PROPULSION BATTERY ELECTROLYTE COLLECTION TIME PERIOD

Rollover Stage	Rotation Time (spec. 1 -3 min)		FMVSS 301 Hold Time	Total Time		Next Whole Minute Interval
	Minutes	Seconds	Minutes	Minutes	Seconds	Minutes
0° to 90°	1	12	5	6	12	7
90° to 180°	1	3	5	6	3	7
180° to 270°	1	7	5	6	7	7
270° to 360°	1	9	5	6	9	7

ACTUAL TEST VEHICLE PROPULSION BATTERY ELECTROLYTE SPILLAGE

Rollover Stage	Propulsion Battery Electrolyte Spillage	Units	Spillage Location
0° to 90°	0	Liters	No Spillage
90° to 180°	0	Liters	No Spillage
180° to 270°	0	Liters	No Spillage
270° to 360°	0	Liters	No Spillage
Total Spillage	0	Liters	No Spillage

** FMVSS 305 Requirements: Maximum allowable propulsion battery electrolyte spillage is **5.0 Liters***

Is the total spillage of propulsion battery electrolyte greater than 5.0 Liters? [ ] Yes (Fail) [X] No
Is propulsion battery electrolyte spillage visible in the passenger compartment? [ ] Yes (Fail) [X] No

VOLTMETER INFORMATION

Measured Parameter	Units	Value
Make & Model		Fluke 1587
Serial No.		51800115
Internal Impedance Value	MΩ	10
Resolution	V	0.001
Calibration Date		06/20/2024

NOTES:

- *The voltmeter used in this test shall measure DC values and have an internal impedance of at least 10 M Ω*
- *An oscilloscope meeting the above requirements may need to be used to adequately measure voltage in some vehicles.*

DATA SHEET NO. 305-5
STATIC ROLLOVER TEST DATA FOR INDICANT FMVSS NO. 305 TESTING (CONT'D)

Test Vehicle: 2024 Genesis GV60 5 Door SUV NHTSA No.: O20244210
Test Program: NCAP Side MDB Impact Test Test Date: 01/09/2024

ELECTRICAL ISOLATION MEASUREMENTS & CALCULATIONS

Parameter	Rollover Stage	Value	Units	R_0=403,700	Minutes	Seconds
V_b =	90°	13.7	V	Time:	1	14
	180°	13.7	V		12	45
	270°	13.7	V		19	18
	360°	13.7	V		26	27
V_1 =	90°	3.8	V	Time:	1	26
	180°	3.9	V		12	57
	270°	3.4	V		19	23
	360°	3.1	V		26	34
V_2 =	90°	9.7	V	Time:	1	37
	180°	9.7	V		13	8
	270°	9.8	V		19	29
	360°	9.9	V		26	45
V_1' =	90°	0.6	V	Time:	1	48
	180°	0.6	V		13	24
	270°	0.4	V		19	47
	360°	0.3	V		27	10
V_2' =	90°	0.5	V	Time:	2	17
	180°	0.7	V		13	34
	270°	0.7	V		19	57
	360°	0.7	V		27	24
R_{i1} =	90°	7,649,053	Ω	Time:	1	48
	180°	7,742,759	Ω		13	24
	270°	11,754,794	Ω		19	47
	360°	15,800,731	Ω		27	10
R_{i2} =	90°	10,338,049	Ω	Time:	2	17
	180°	7,277,302	Ω		13	34
	270°	7,068,869	Ω		19	57
	360°	6,967,175	Ω		27	24
R_i =	90°	7,649,053	Ω	Time:	1	48
	180°	7,277,302	Ω		13	24
	270°	7,068,869	Ω		19	57
	360°	6,967,175	Ω		27	24
R_i/V_b =	90°	558,325	Ω/V	Time:	1	48
	180°	531,190	Ω/V		13	24
	270°	515,976	Ω/V		19	57
	360°	508,553	Ω/V		27	24

Is the Electrical Isolation Value ≥ 500 Ω/V (Yes/No)? [X] Yes [ ] No (Fail)

APPENDIX A

PHOTOGRAPHS

TABLE OF PHOTOGRAPHS

Fig.	Description	Page
1	As-Delivered Right Front ¾ View of Test Vehicle	A-6
2	As-Delivered Left Rear ¾ View of Test Vehicle	A-6
3	Pre-Test Frontal View of Test Vehicle	A-7
4	Post-Test Frontal View of Test Vehicle	A-7
5	Pre-Test Left Front ¾ View of Test Vehicle	A-8
6	Post-Test Left Front ¾ View of Test Vehicle	A-8
7	Pre-Test Left Side View of Test Vehicle	A-9
8	Post-Test Left Side View of Test Vehicle	A-9
9	Pre-Test Left Rear ¾ View of Test Vehicle	A-10
10	Post-Test Left Rear ¾ View of Test Vehicle	A-10
11	Pre-Test Rear View of Test Vehicle	A-11
12	Post-Test Rear Side View of Test Vehicle	A-11
13	Pre-Test Right Side View of Test Vehicle	A-12
14	Post-Test Right Side View of Test Vehicle	A-12
15	Pre-Test Overhead View of Test Area	A-13
16	Post-Test Overhead View of Test Area	A-13
17	Pre-Test Left Side View of MDB Positioned Against Side of Test Vehicle	A-14
18	Pre-Test Right Side View of MDB Positioned Against Side of Test Vehicle	A-14
19	Pre-Test Close-Up View of Impact Point Target	A-15
20	Post-Test Close-Up View of Impact Point Target	A-15
21	Pre-Test Left Front Door Latch Close-Up	A-16
22	Post-Test Left Front Door Latch Close-Up	A-16
23	Pre-Test Left Rear Door Latch Close-Up	A-17
24	Post-Test Left Rear Door Latch Close-Up	A-17
25	Pre-Test Front Close-up View of Driver Dummy	A-18
26	Post-Test Front Close-up View of Driver Dummy	A-18
27	Pre-Test Left Side View of Driver Dummy Showing Belt and Chalking	A-19
28	Pre-Test Left Side View of Driver Dummy Shoulder and Door Top View	A-19
29	Post-Test Left Side View of Driver Dummy Shoulder and Door Top View	A-20
30	Pre-Test Frontal View of Driver Seat Back Prior to Dummy Positioning	A-20
31	Pre-Test Frontal View of Driver Dummy Head and Shoulders in Relation to Head Restraint	A-21
32	Pre-Test Frontal View of Driver Seat Pan Prior to Dummy Positioning	A-21
33	Pre-Test Overhead View of Driver Dummy Thighs on Seat Pan	A-22
34	Pre-Test Placement of Driver Dummy’s Feet	A-22

Fig.	Description	Page
35	Pre-Test View of Belt Anchorage for Driver Dummy	A-23
36	Pre-Test Left Side View of Steering Wheel	A-23
37	View of Disengaged Parking Brake	A-24
38	Pre-Test View of Parking Brake	A-24
39	Pre-Test Close-Up Left Side View of Driver Seat Track	A-25
40	Pre-Test Close-Up Left Side View of Driver Seat Back	A-25
41	Pre-Test Close-Up View of Driver Seat Back or Head Restraint	A-26
42	Pre-Test Driver Dummy and Door Clearance View	A-26
43	Post-Test Driver Dummy and Door Clearance View	A-27
44	Pre-Test Right Side View of Driver Dummy and Front Seat of Occupant Compartment	A-27
45	Post-Test Right Side View of Driver Dummy and Front Seat of Occupant Compartment	A-28
46	Pre-Test Driver Inner Door Panel View	A-28
47	Post-Test Driver Inner Door Panel View	A-29
48	Post-Test Driver Dummy Close-Up Head Contact with Vehicle View	A-29
49	Post-Test Driver Dummy Close-Up Head Contact with Side Air Bag View	A-30
50	Post-Test Driver Dummy Close-Up Torso Contact with Vehicle Interior View	A-30
51	Post-Test Driver Dummy Close-Up Torso Contact with Side Air Bag View	A-31
52	Post-Test Driver Dummy Close-Up Pelvis Contact View	A-31
53	Post-Test Driver Dummy Close-Up Pelvis Contact with Side Air Bag View	A-32
54	Post-Test Driver Dummy Close-Up Knee Contact View	A-32
55	Pre-Test Left Side View of Rear Passenger Dummy Showing Belt and Chalking	A-33
56	Pre-Test Left Side View of Rear Passenger Dummy Shoulder and Door Top View	A-33
57	Post-Test Left Side View of Rear Passenger Dummy Shoulder and Door Top View	A-34
58	Pre-Test Frontal View of Rear Passenger Seat Back Prior to Dummy Positioning	A-34
59	Pre-Test Frontal View of Rear Passenger Dummy Head and Shoulders in Relation to Head Restraint	A-35
60	Pre-Test Overhead View of Rear Passenger Seat Pan Prior to Dummy Positioning	A-35
61	Pre-Test Overhead View of Rear Passenger Dummy Thighs on Seat Pan	A-36
62	Pre-Test View of Rear Passenger Dummy’s Neck Showing Position of Adjustable Neck Bracket	A-36
63	Pre-Test View of Rear Passenger Dummy’s Head Showing Dummy’s Head is Level	A-37
64	Pre-Test Placement of Rear Passenger Dummy’s Feet	A-37
65	Pre-Test View of Belt Anchorage for Rear Passenger Dummy	A-38
66	Pre-Test Close-Up Left Side View of Rear Passenger Seat Track	A-38
67	Pre-Test Close-Up Left Side View of Rear Passenger Seat Back	A-39
68	Pre-Test Close-Up View of Rear Passenger Seat Back or Head Restraint	A-39

Fig.	Description	Page
69	Pre-Test Rear Passenger Dummy and Door Clearance View	A-40
70	Post-Test Rear Passenger Dummy and Door Clearance View	A-40
71	Pre-Test Right Side View of Rear Passenger Dummy and Rear Seat Occupant Compartment	A-41
72	Post-Test Right Side View of Rear Passenger Dummy and Rear Seat Occupant Compartment	A-41
73	Pre-Test Rear Passenger Inner Door Panel View	A-42
74	Post-Test Rear Passenger Inner Door Panel View Showing Rear Passenger Dummy Contact Locations	A-42
75	Post-Test Rear Passenger Dummy Close-Up Head Contact with Vehicle View	A-43
76	Post-Test Rear Passenger Dummy Close-Up Head Contact with Side Air Bag View	A-43
77	Post-Test Rear Passenger Dummy Close-Up Torso Contact with Vehicle Interior View	A-44
78	Post-Test Rear Passenger Dummy Close-Up Torso Contact with Side Air Bag View	A-44
79	Post-Test Rear Passenger Dummy Close-Up Pelvis Contact View	A-45
80	Post-Test Rear Passenger Dummy Close-Up Pelvis Contact with Side Air Bag View	A-45
81	Post-Test Rear Passenger Dummy Close-Up Knee Contact View	A-46
82	Pre-Test Charging Port	A-46
83	Post-Test Charging Port	A-47
84	Pre-Test Front View of MDB Impactor Face	A-47
85	Post-Test Front View of MDB Impactor Face	A-48
86	Pre-Test Top View of MDB Impactor Face	A-48
87	Post-Test Top View of MDB Impactor Face	A-49
88	Pre-Test Left Side View of MDB Impactor Face	A-49
89	Post-Test Left Side View of MDB Impactor Face	A-50
90	Pre-Test Right Side View of MDB Impactor Face	A-50
91	Post-Test Right Side View of MDB Impactor Face	A-51
92	Close-Up View of Vehicle’s Certification Label	A-51
93	Close-Up View of Vehicle’s Tire Information Placard or Label	A-52
94	Pre-Test Ballast View	A-52
95	Post-Test Primary and Redundant Speed Trap Read-Out	A-53
96	FMVSS No. 301 Static Rollover 0 Degrees	A-53
97	FMVSS No. 301 Static Rollover 90 Degrees	A-54
98	FMVSS No. 301 Static Rollover 180 Degrees	A-54
99	FMVSS No. 301 Static Rollover 270 Degrees	A-55
100	FMVSS No. 301 Static Rollover 360 Degrees	A-55
101	Impact Event	A-56
102	Monroney Label	A-56
103	Driver Head Restraint Use and Adjustment Information from Vehicle Owner’s Manual	A-57
104	Left Rear Passenger Head Restraint Use and Adjustment Information from Vehicle Owner’s Manual	A-57

Fig.	Description	Page
305-1	Auxiliary Power Module Warning Label	A-58
305-2	Power Inverter Warning Label	A-58
305-3	First Responder Warning Label	A-59
305-4	First Responder Warning Label Location	A-59
305-5	Other Vehicle Label(s) Related to Electrical Propulsion System	A-60
305-6	Manual High Voltage Service Disconnect in Place	A-60
305-7	Manual High Voltage Service Disconnect Removed (Plug)	A-61
305-8	Manual High Voltage Service Disconnect Removed (Location where removed)	A-61
305-9	Pre-Impact View of Propulsion Battery	A-62
305-10	Post-Impact Front View of Propulsion Battery	A-62
305-11	Post-Impact Rear View of Propulsion Battery (if any part of it is visible)	A-63
305-12	Pre-Impact View of Battery Box(s) or Container(s) Which Holds Individual Battery Modules	A-63
305-13	Post-Impact View of Battery Box(s) or Container(s) Which Holds Individual Battery Modules	A-64
305-14	Pre-Impact View of Propulsion Battery Module(s)	A-64
305-15	Post-Impact View of Propulsion Battery Module(s)	A-65
305-16	Pre-Impact View of Electric Propulsion Drive	A-65
305-17	Post-Impact View of Electric Propulsion Drive	A-66
305-18	Pre-Impact View of High Voltage Interconnect(s)	A-66
305-19	Pre-Impact View Propulsion Venting System(s)	A-67
305-20	Pre-Impact View of Other Visible Electric Propulsion Components	A-67
305-21	Pre-Impact View of Ground Lead Attached	A-68
305-22	Pre-Impact View of High Voltage Leads Attached	A-68
305-23	Pre-Impact Close-Up View of High Voltage Leads Attached	A-69
305-24	Pre-Impact View of Installed Test Interface Port	A-69
305-25	Post-Impact View of Installed Test Interface Port	A-70
305-26	Pre-Impact View of Other Test Devices	A-70
305-27	Post-Impact View of Other Test Devices	A-71
305-28	FMVSS No. 305 Static Rollover 90 Degrees	A-71
305-29	FMVSS No. 305 Static Rollover 180 Degrees	A-72
305-30	FMVSS No. 305 Static Rollover 270 Degrees	A-72
305-31	FMVSS No. 305 Static Rollover 360 Degrees	A-73
305-32	Pre-Impact View of the Vehicle Passenger Compartment Adjacent to Propulsion Battery	A-73
305-33	Post-Impact View of the Vehicle Passenger Compartment Adjacent to Propulsion Battery	A-74
305-34	Post-Impact Propulsion Battery System Mounting and/or Intrusion Failure(s)	A-74
305-35	Post-Impact View of Battery Component Intrusion	A-75
305-36	Post-Impact View of Battery Module Movement or Retention Loss	A-75
305-37	Post-Impact View of Propulsion Battery Electrolyte Spillage Location (Prior to static roll)	A-76
305-38	Post-Impact View of Propulsion Battery Electrolyte Spillage Location (After static roll)	A-76

Figure A-1: As Delivered Right Front ¾ View of Test Vehicle

Figure A-2: As Delivered Left Rear ¾ View of Test Vehicle

Figure A-3: Pre-Test Frontal View of Test Vehicle

Figure A-4: Post-Test Frontal View of Test Vehicle

Figure A-5: Pre-Test Left Front ¾ View of Test Vehicle

Figure A-6: Post-Test Left Front ¾ View of Test Vehicle

Figure A-7: Pre-Test Left Side View of Test Vehicle

Figure A-8: Post-Test Left Side View of Test Vehicle

Figure A-9: Pre-Test Left Rear ¾ View of Test Vehicle

Figure A-10: Post-Test Left Rear ¾ View of Test Vehicle

Figure A-11: Pre-Test Rear View of Test Vehicle

Figure A-12: Post-Test Rear Side View of Test Vehicle

Figure A-13: Pre-Test Right Side View of Test Vehicle

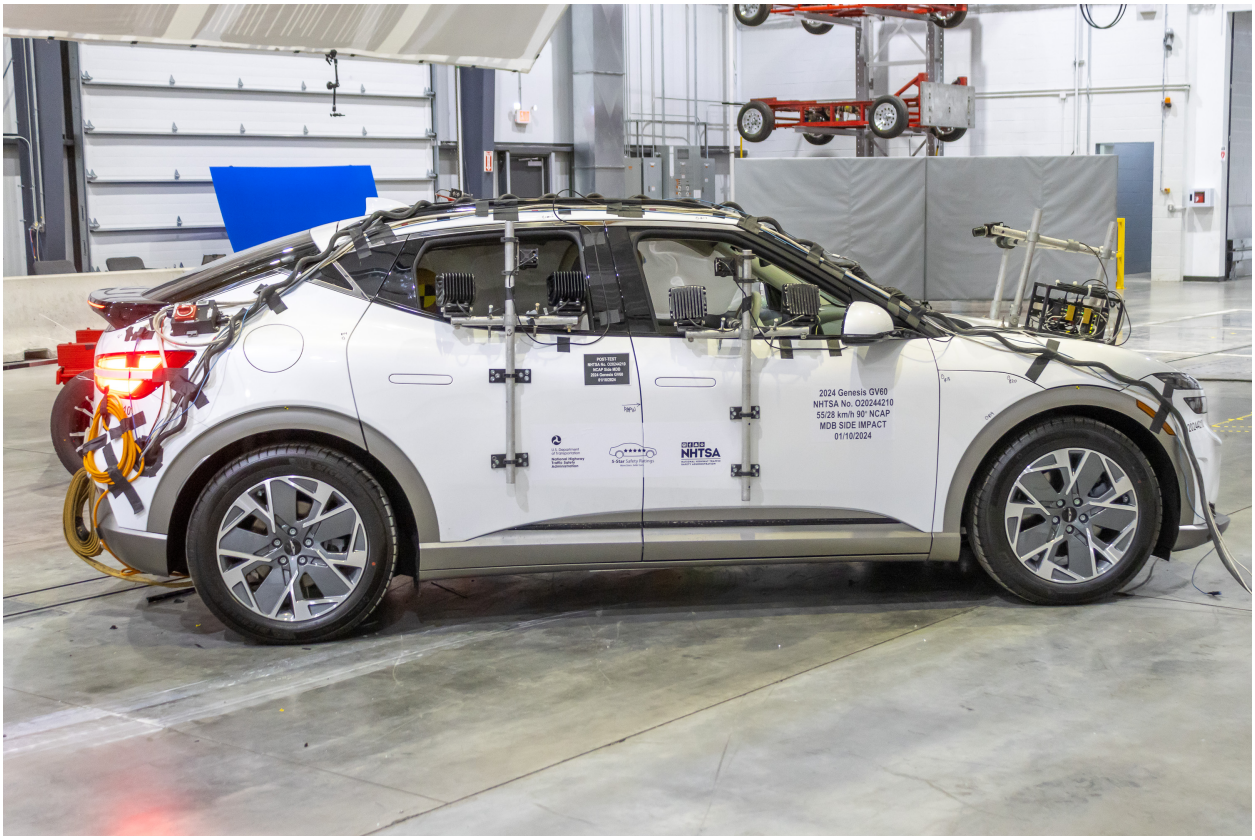

Figure A-14: Post-Test Right Side View of Test Vehicle

Figure A-15: Pre-Test Overhead View of Test Area

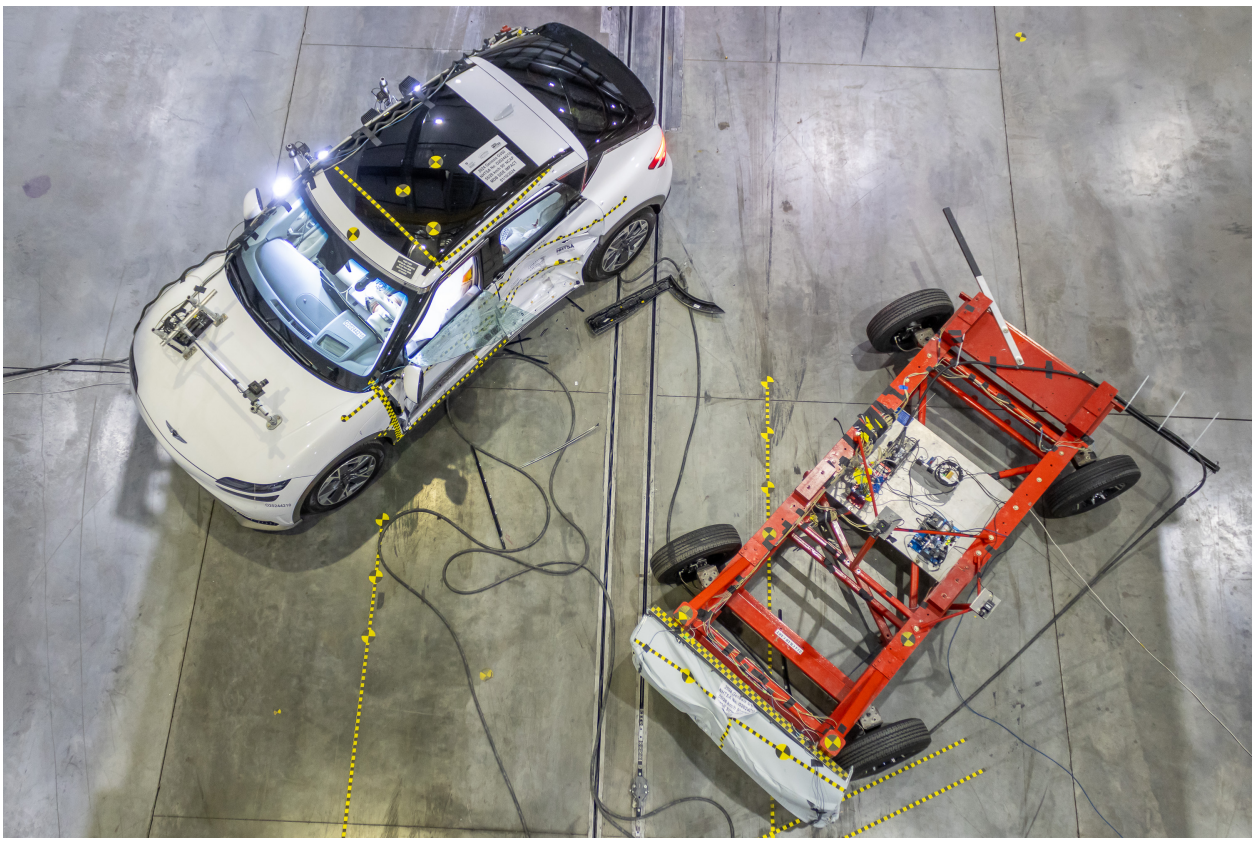

Figure A-16: Post-Test Overhead View of Test Area

Figure A-17: Pre-Test Left Side View of MDB Positioned Against Side of Test Vehicle

Figure A-18: Pre-Test Right Side View of MDB Positioned Against Side of Test Vehicle

Figure A-19: Pre-Test Close-Up View of Impact Point Target

Figure A-20: Post-Test Close-Up View of Impact Point Target

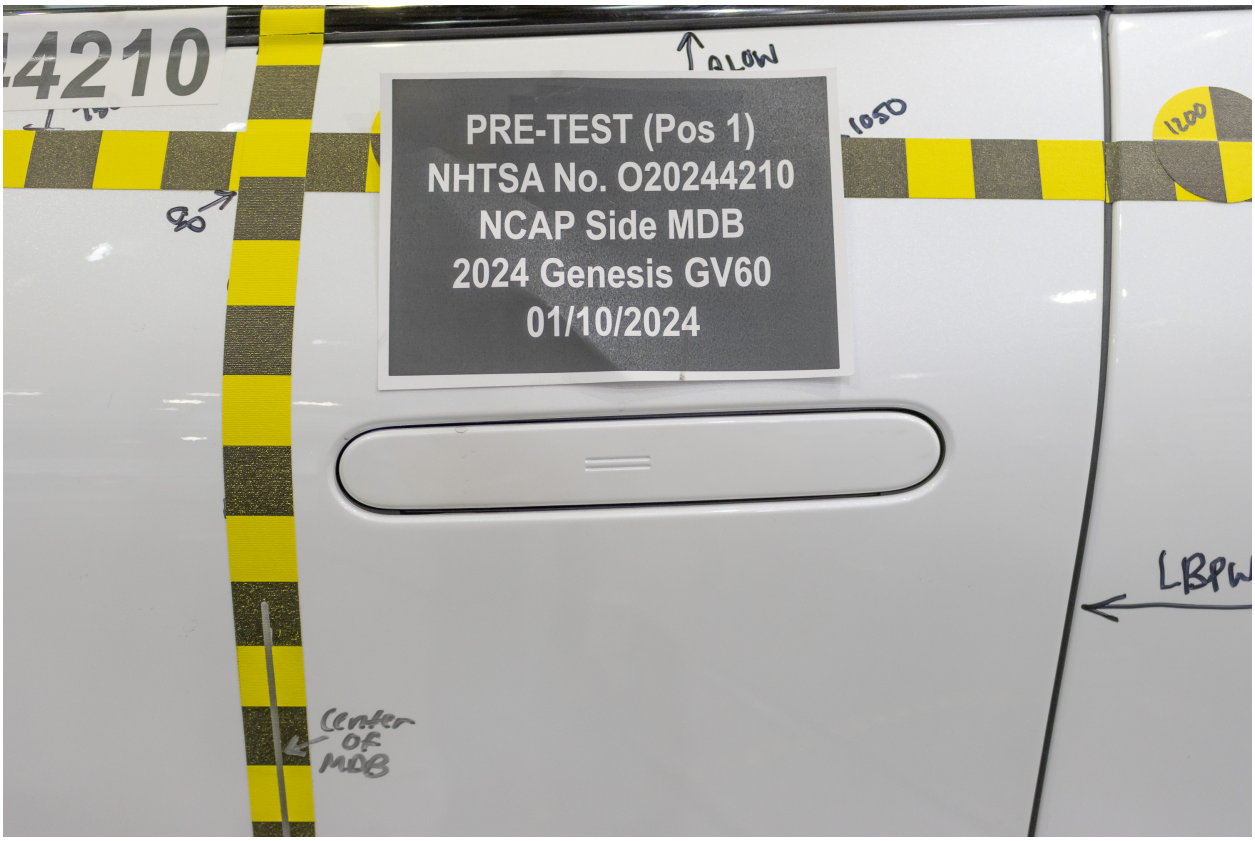

Figure A-21: Pre-Test Left Front Door Latch Close-Up

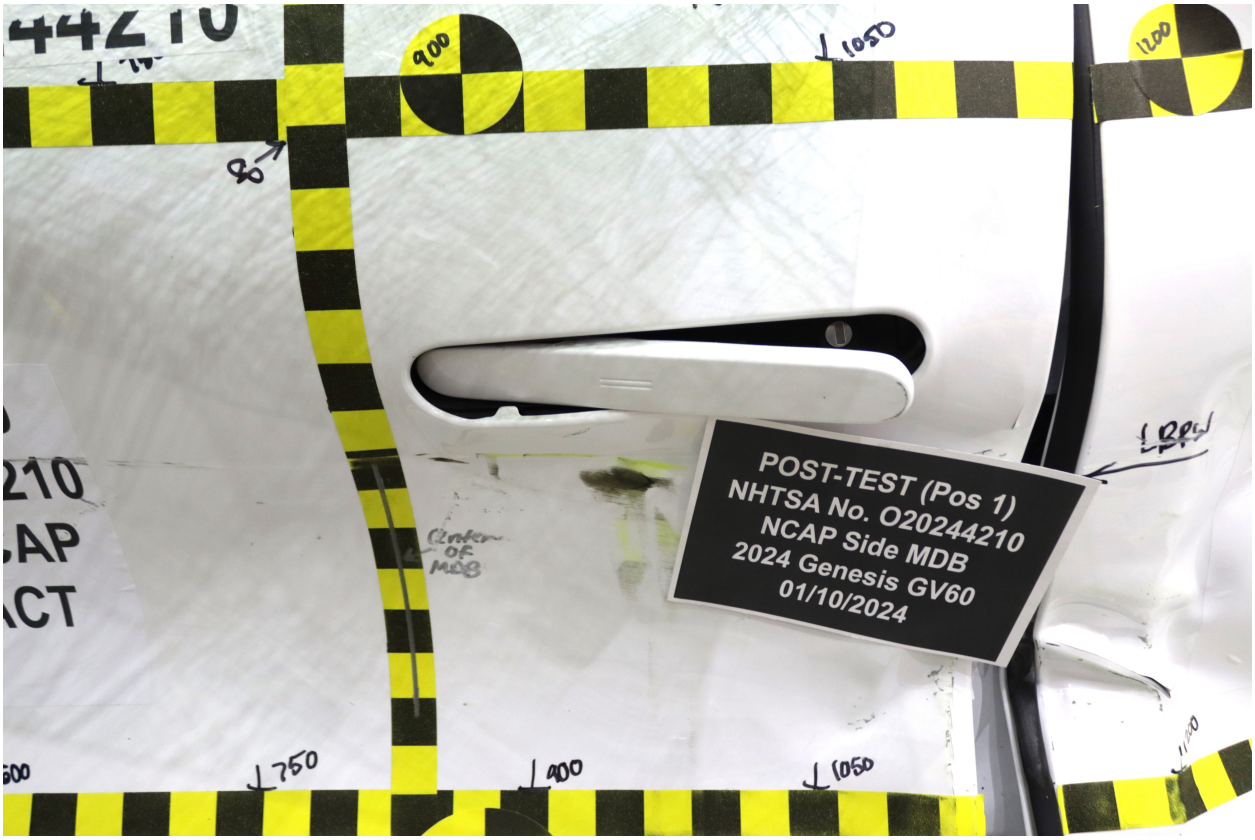

Figure A-22: Post-Test Left Front Door Latch Close-Up

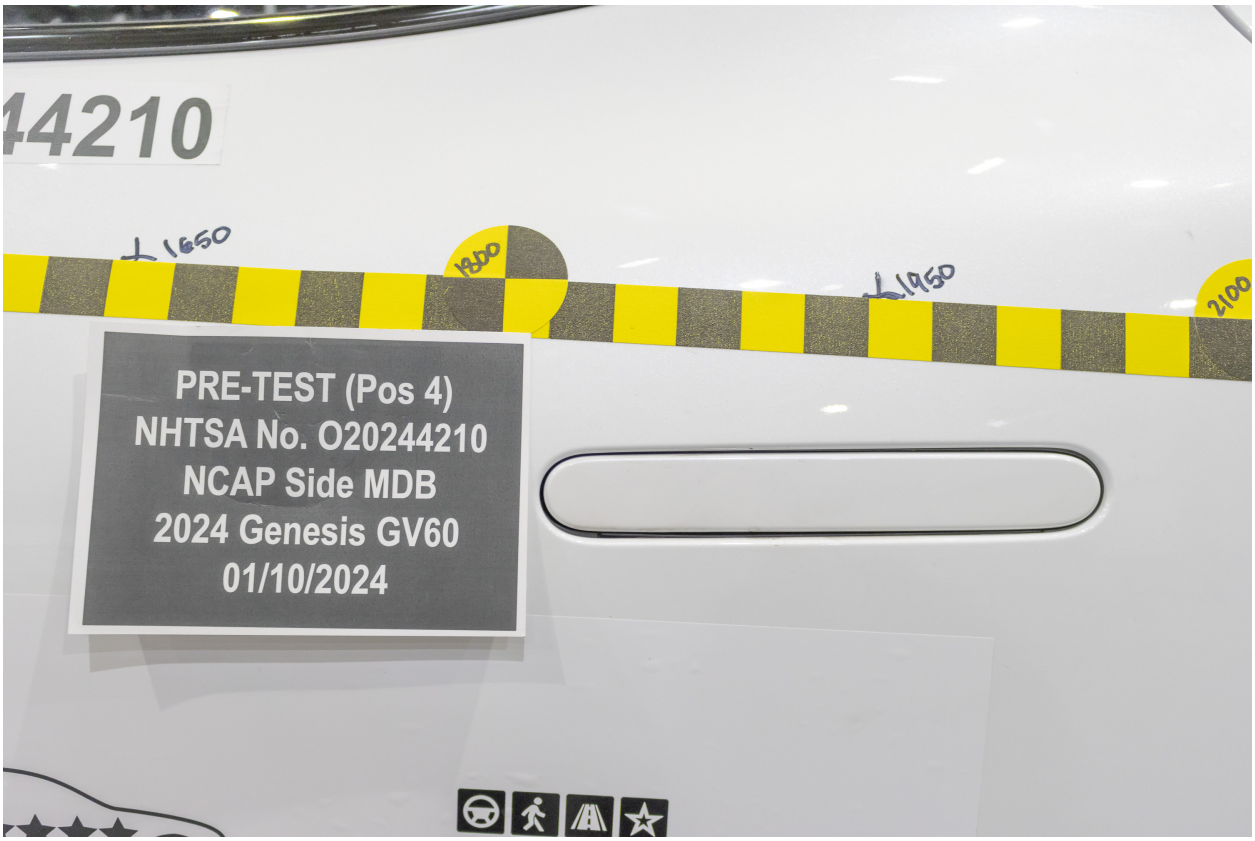

Figure A-23: Pre-Test Left Rear Door Latch Close-Up

Figure A-24: Post-Test Left Rear Door Latch Close-Up

Figure A-25: Pre-Test Front Close-up View of Driver Dummy

Figure A-26: Post-Test Front Close-up View of Driver Dummy

Figure A-27: Pre-Test Left Side View of Driver Dummy Showing Belt and Chalking

Figure A-28: Pre-Test Left Side View of Driver Dummy Shoulder and Door Top View

Figure A-29: Post-Test Left Side View of Driver Dummy Shoulder and Door Top View

Figure A-30: Pre-Test Frontal View of Driver Seat Back Prior to Dummy Positioning

Figure A-31: Pre-Test Frontal View of Driver Dummy Head and Shoulders in Relation to Head Restraint

Figure A-32: Pre-Test Frontal View of Driver Seat Pan Prior to Dummy Positioning

Figure A-33: Pre-Test Overhead View of Driver Dummy Thighs on Seat Pan

Figure A-34: Pre-Test Placement of Driver Dummy's Feet

Figure A-35: Pre-Test View of Belt Anchorage for Driver Dummy

Figure A-36: Pre-Test Left Side View of Steering Wheel

Figure A-37: View of Disengaged Parking Brake

Figure A-38: Pre-Test View of Parking Brake

Figure A-39: Pre-Test Close-Up Left Side View of Driver Seat Track

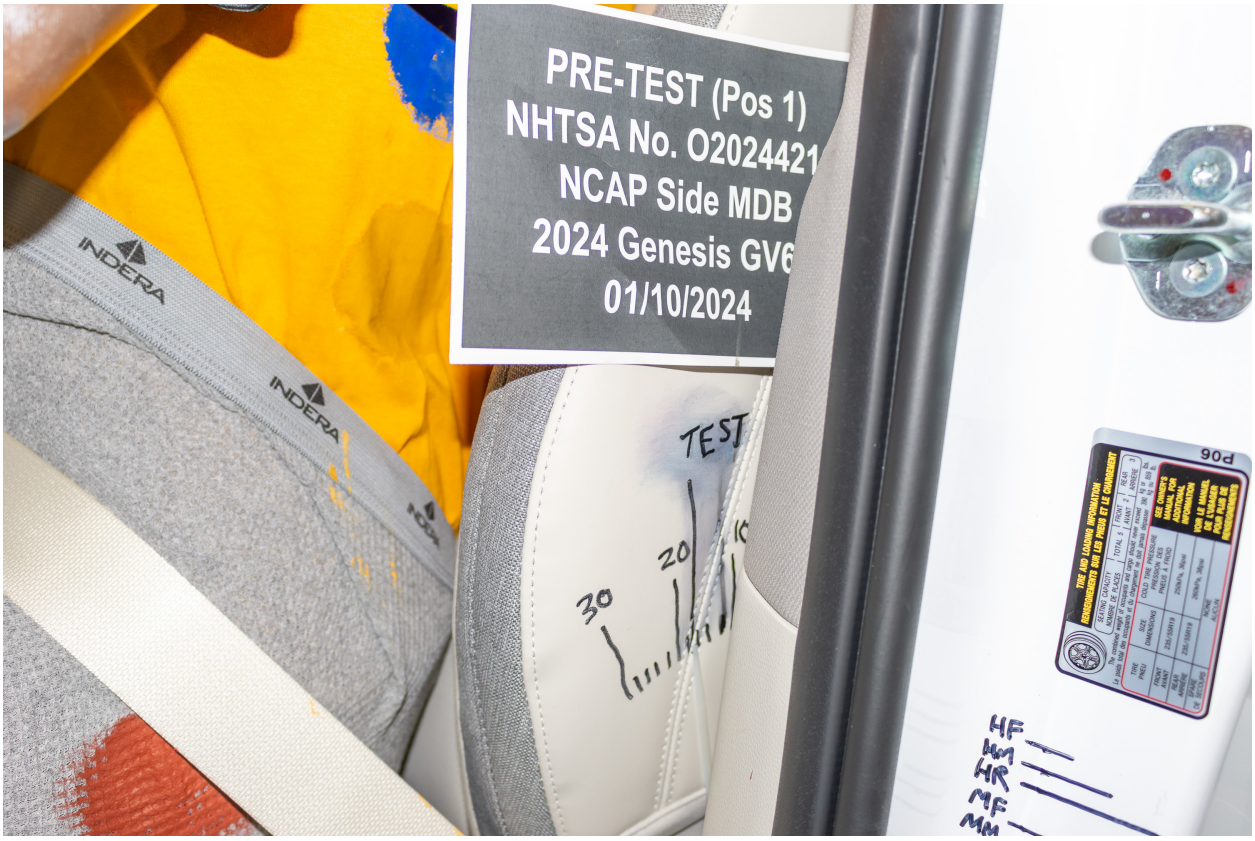

Figure A-40: Pre-Test Close-Up Left Side View of Driver Seat Back

Figure A-41: Pre-Test Close-Up View of Driver Seat Back or Head Restraint

Figure A-42: Pre-Test Driver Dummy and Door Clearance View

Figure A-43: Post-Test Driver Dummy and Door Clearance View

Figure A-44: Pre-Test Right Side View of Driver Dummy and Front Seat of Occupant Compartment

Figure A-45: Post-Test Right Side View of Driver Dummy and Front Seat of Occupant Compartment

Figure A-46: Pre-Test Driver Inner Door Panel View

Figure A-47: Post-Test Driver Inner Door Panel View

Figure A-48: Post-Test Driver Dummy Close-Up Head Contact with Vehicle View

Figure A-49: Post-Test Driver Dummy Close-Up Head Contact with Side Air Bag View

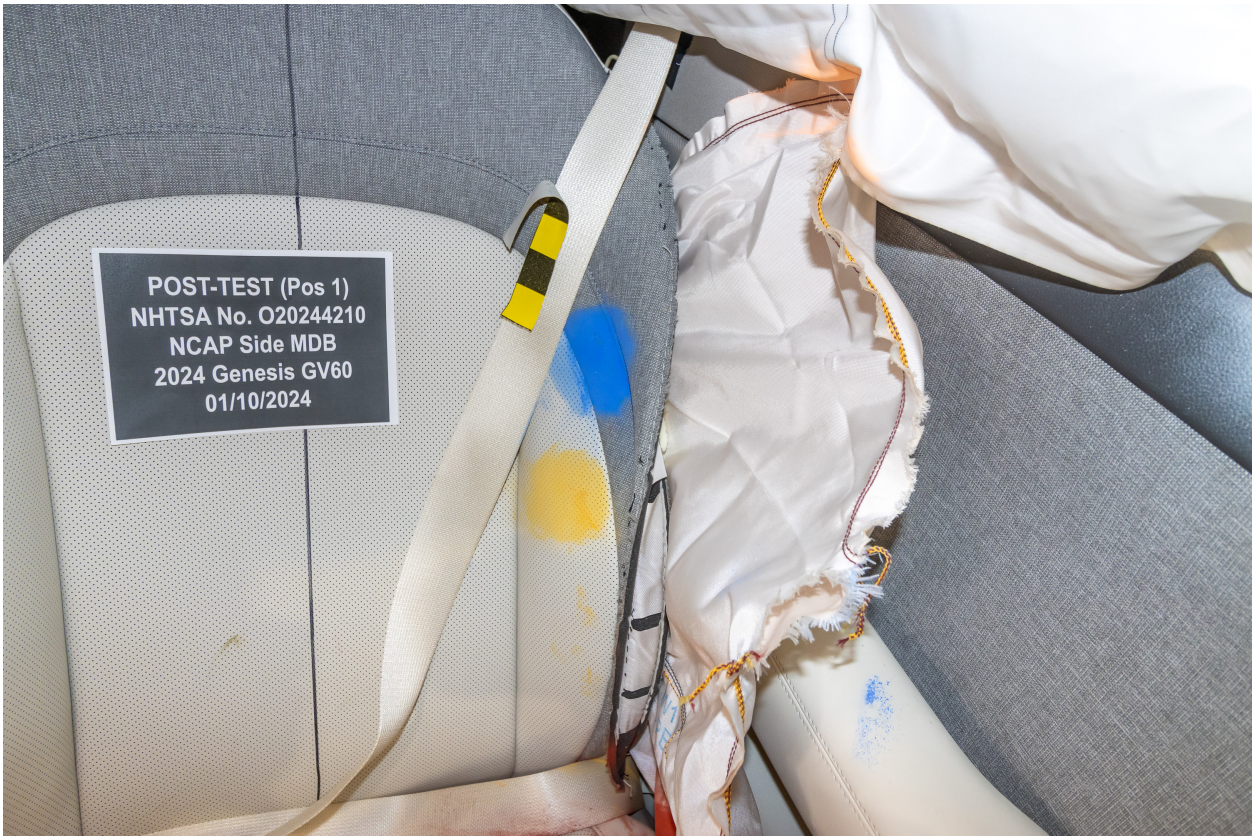

Figure A-50: Post-Test Driver Dummy Close-Up Torso Contact with Vehicle Interior View

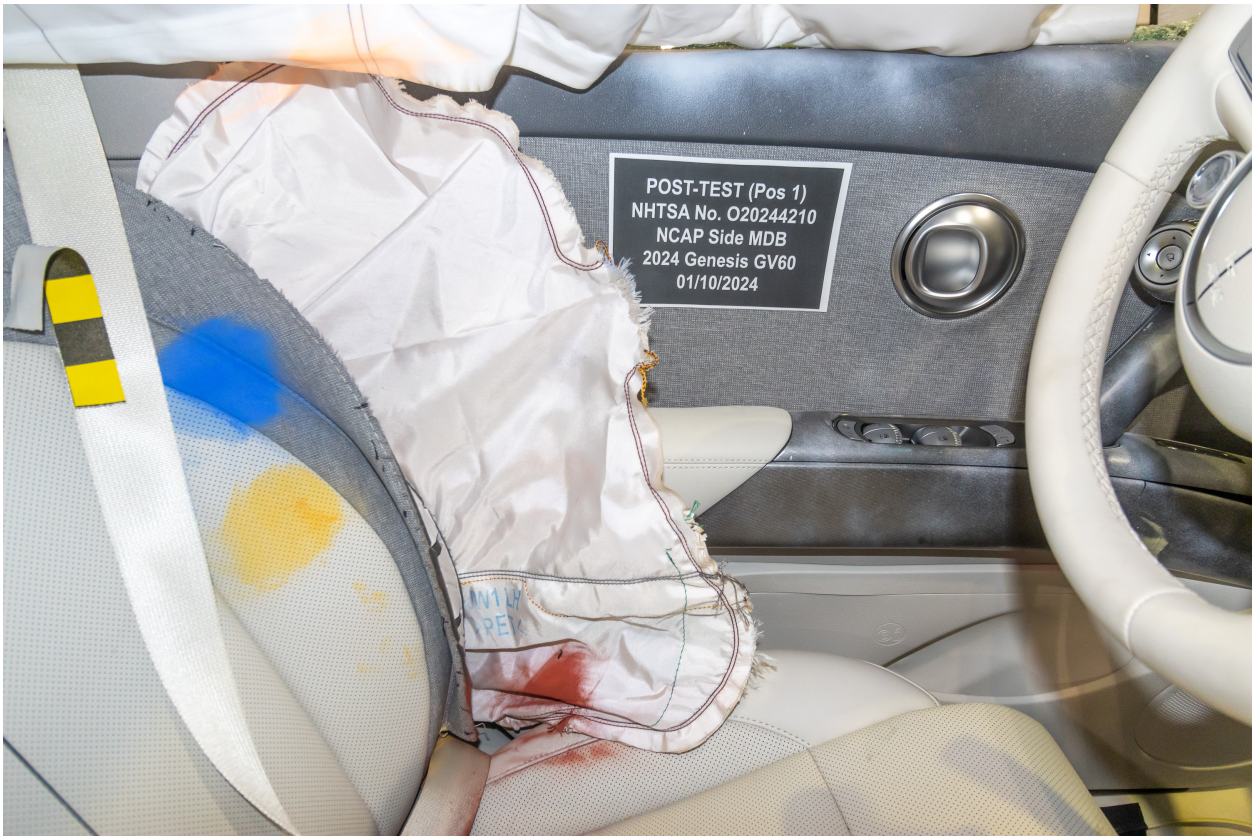

Figure A-51: Post-Test Driver Dummy Close-Up Torso Contact with Side Air Bag View

Figure A-52: Post-Test Driver Dummy Close-Up Pelvis Contact View

Figure A-53: Post-Test Driver Dummy Close-Up Pelvis Contact with Side Air Bag View

Figure A-54: Post-Test Driver Dummy Close-Up Knee Contact View

Figure A-55: Pre-Test Left Side View of Rear Passenger Dummy Showing Belt and Chalking

Figure A-56: Pre-Test Left Side View of Rear Passenger Dummy Shoulder and Door Top View

Figure A-57: Post-Test Left Side View of Rear Passenger Dummy Shoulder and Door Top View

Figure A-58: Pre-Test Frontal View of Rear Passenger Seat Back Prior to Dummy Positioning

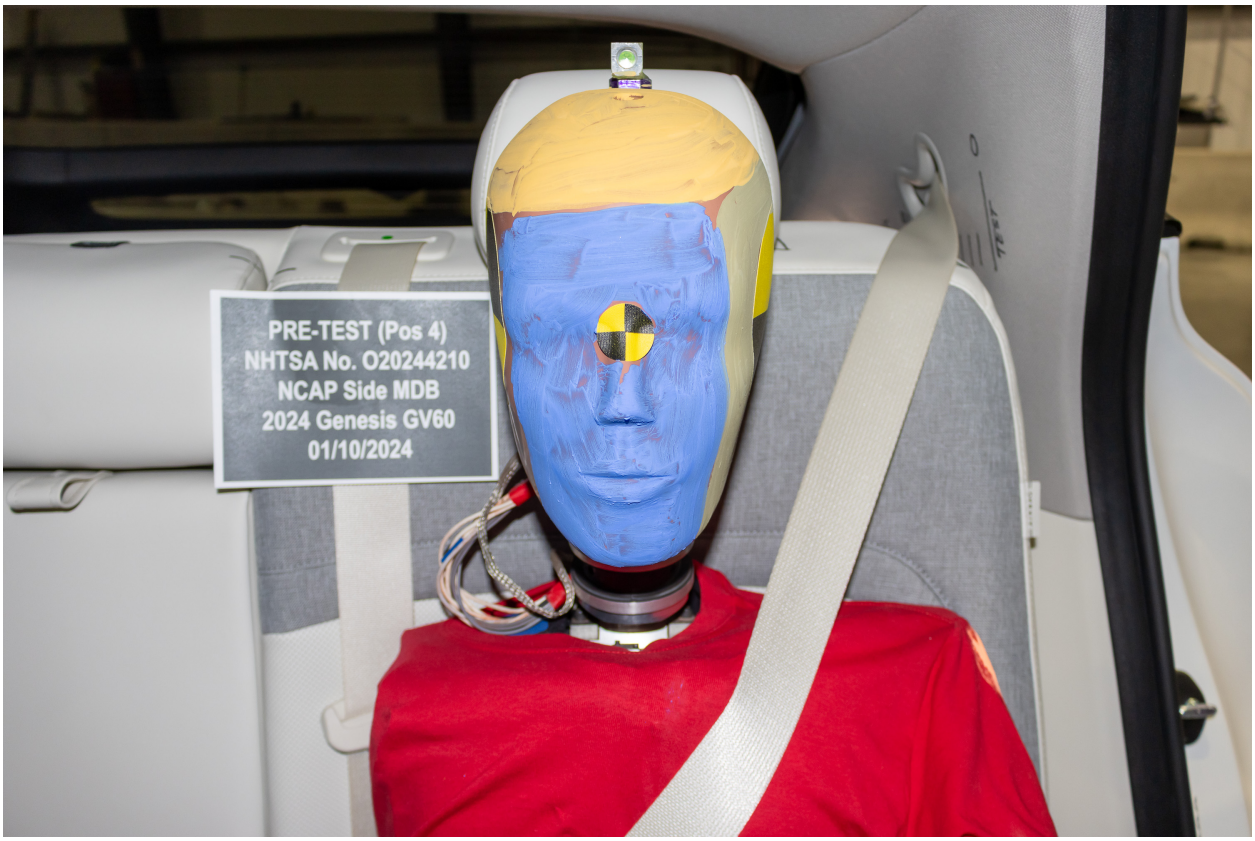

Figure A-59: Pre-Test Frontal View of Rear Passenger Dummy Head and Shoulders in Relation to Head Restraint

Figure A-60: Pre-Test Overhead View of Rear Passenger Seat Pan Prior to Dummy Positioning

Figure A-61: Pre-Test Overhead View of Rear Passenger Dummy Thighs on Seat Pan

Figure A-62: Pre-Test View of Rear Passenger Dummy's Neck Showing Position of Adjustable Neck Bracket

Figure A-63: Pre-Test View of Rear Passenger Dummy's Head Showing Dummy's Head is Level

Figure A-64: Pre-Test Placement of Rear Passenger Dummy's Feet

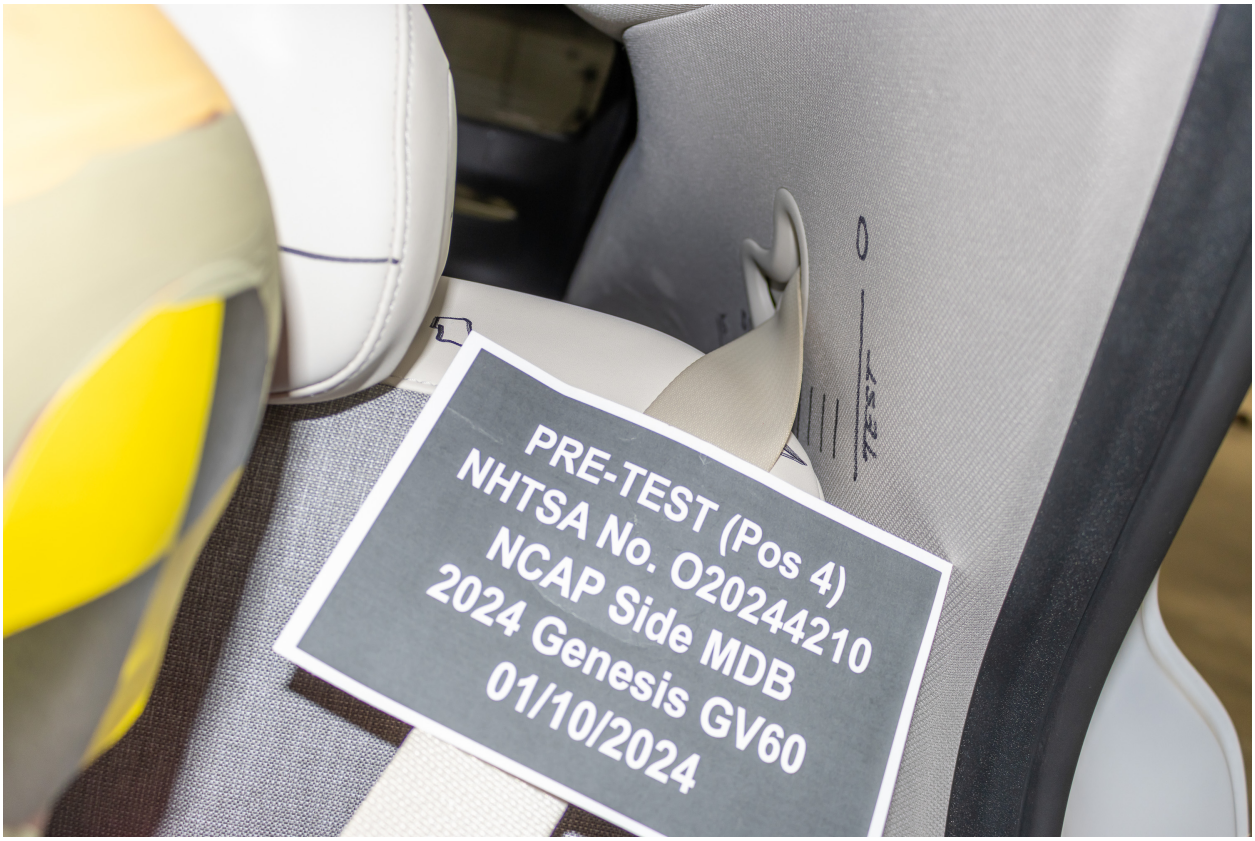

Figure A-65: Pre-Test View of Belt Anchorage for Rear Passenger Dummy

Figure A-66: Pre-Test Close-Up Left Side View of Rear Passenger Seat Track

Figure A-67: Pre-Test Close-Up Left Side View of Rear Passenger Seat Back

Figure A-68: Pre-Test Close-Up View of Rear Passenger Seat Back or Head Restraint

Figure A-69: Pre-Test Rear Passenger Dummy and Door Clearance View

Figure A-70: Post-Test Rear Passenger Dummy and Door Clearance View

Figure A-71: Pre-Test Right Side View of Rear Passenger Dummy and Rear Seat Occupant Compartment

Figure A-72: Post-Test Right Side View of Rear Passenger Dummy and Rear Seat Occupant Compartment

Figure A-73: Pre-Test Rear Passenger Inner Door Panel View

Figure A-74: Post-Test Rear Passenger Inner Door Panel View Showing Rear Passenger Dummy Contact Locations

Figure A-75: Post-Test Rear Passenger Dummy Close-Up Head Contact with Vehicle View

Figure A-76: Post-Test Rear Passenger Dummy Close-Up Head Contact with Side Air Bag View

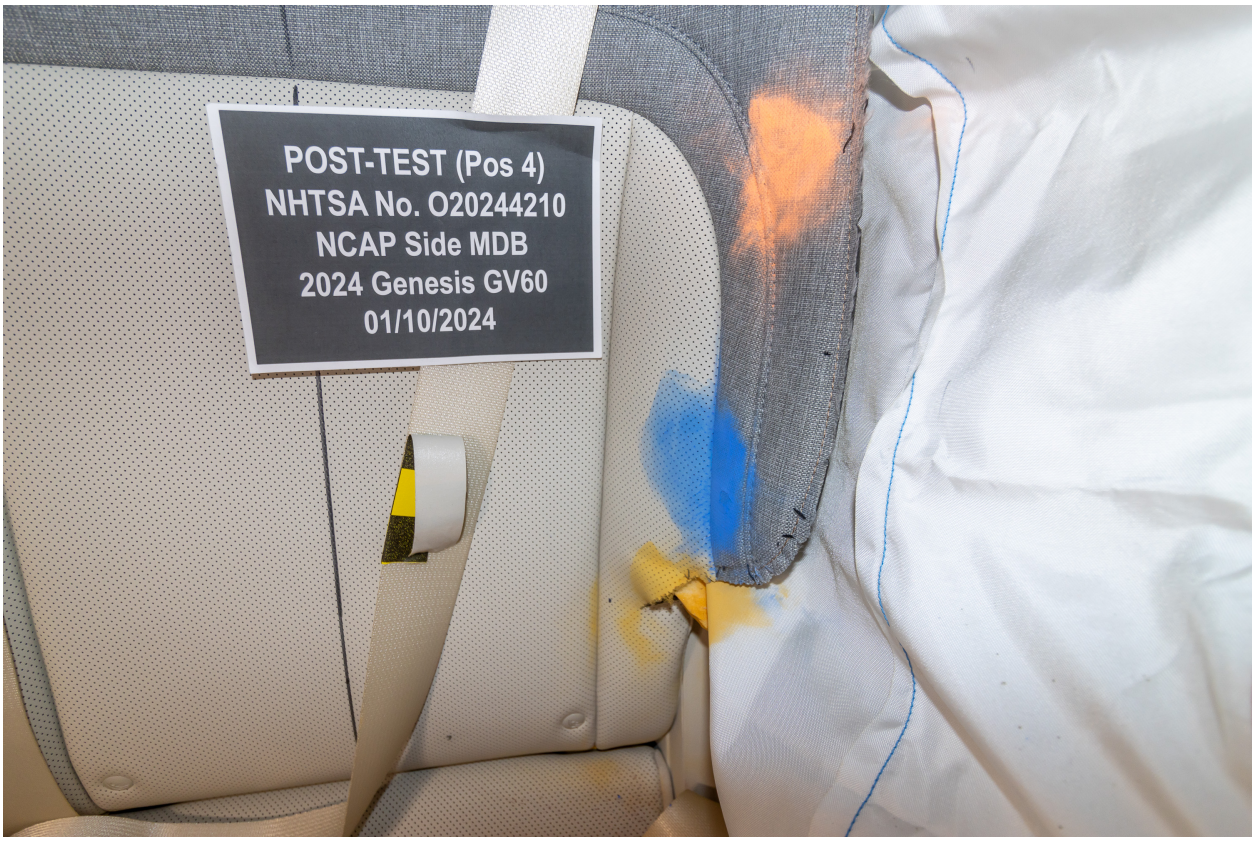

Figure A-77: Post-Test Rear Passenger Dummy Close-Up Torso Contact with Vehicle Interior View

Figure A-78: Post-Test Rear Passenger Dummy Close-Up Torso Contact with Side Air Bag View

Figure A-79: Post-Test Rear Passenger Dummy Close-Up Pelvis Contact View

Figure A-80: Post-Test Rear Passenger Dummy Close-Up Pelvis Contact with Side Air Bag View

Figure A-81: Post-Test Rear Passenger Dummy Close-Up Knee Contact View

Figure A-82: Pre-Test Charging Port

Figure A-83: Post-Test Charging Port

Figure A-84: Pre-Test Front View of MDB Impactor Face

Figure A-85: Post-Test Front View of MDB Impactor Face

Figure A-86: Pre-Test Top View of MDB Impactor Face

Figure A-87: Post-Test Top View of MDB Impactor Face

Figure A-88: Pre-Test Left Side View of MDB Impactor Face

Figure A-89: Post-Test Left Side View of MDB Impactor Face

Figure A-90: Pre-Test Right Side View of MDB Impactor Face

Figure A-91: Post-Test Right Side View of MDB Impactor Face

Figure A-92: Close-Up View of Vehicle's Certification Label

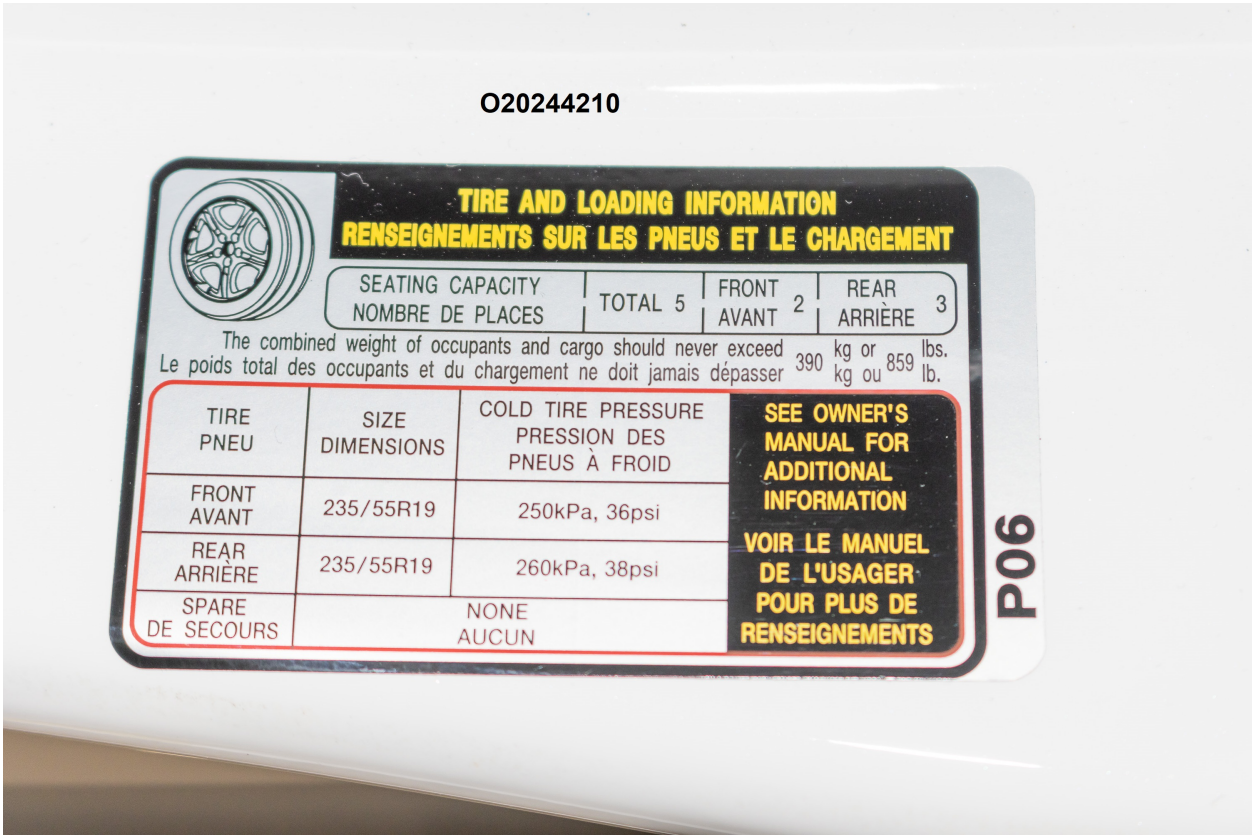

Figure A-93: Close-Up View of Vehicle's Tire Information Placard or Label

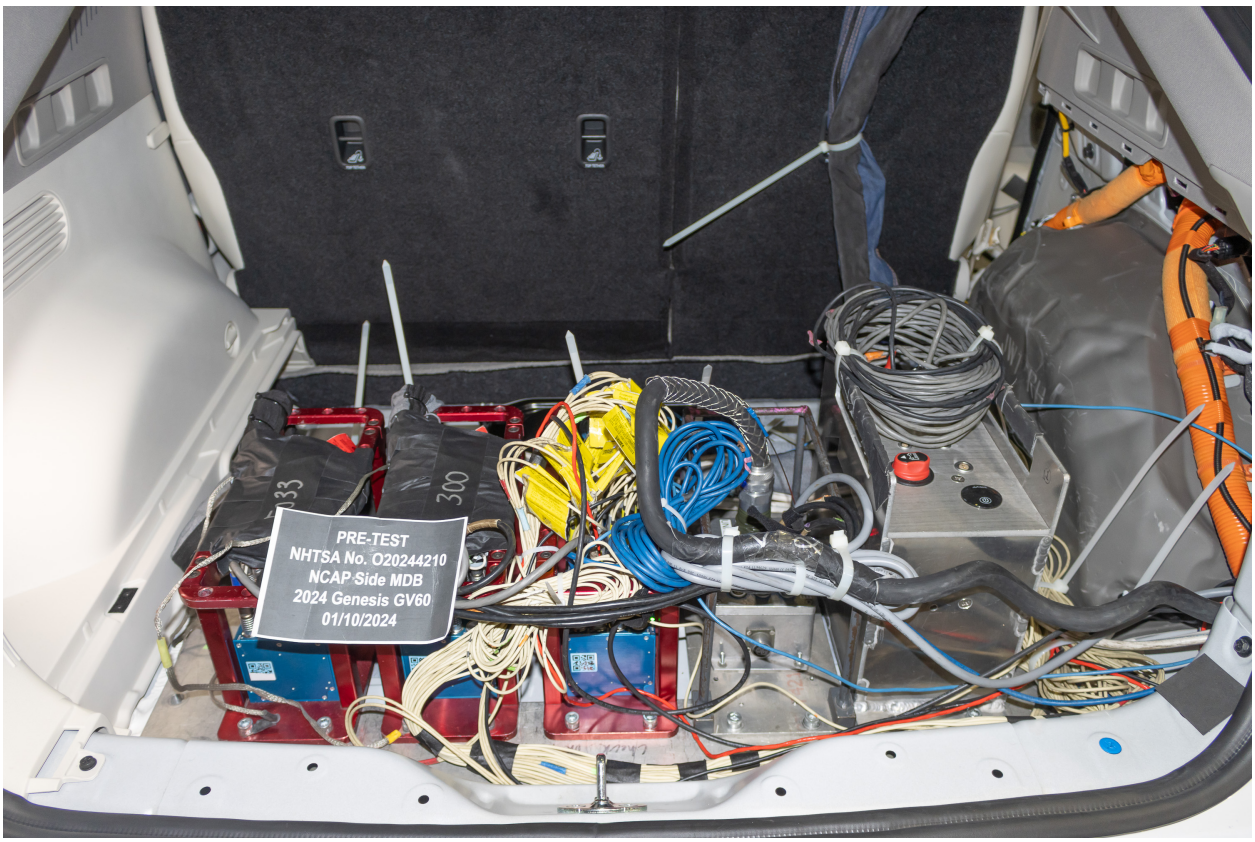

Figure A-94: Pre-Test Ballast View

Figure A-95: Post-Test Primary and Redundant Speed Trap Read-Out

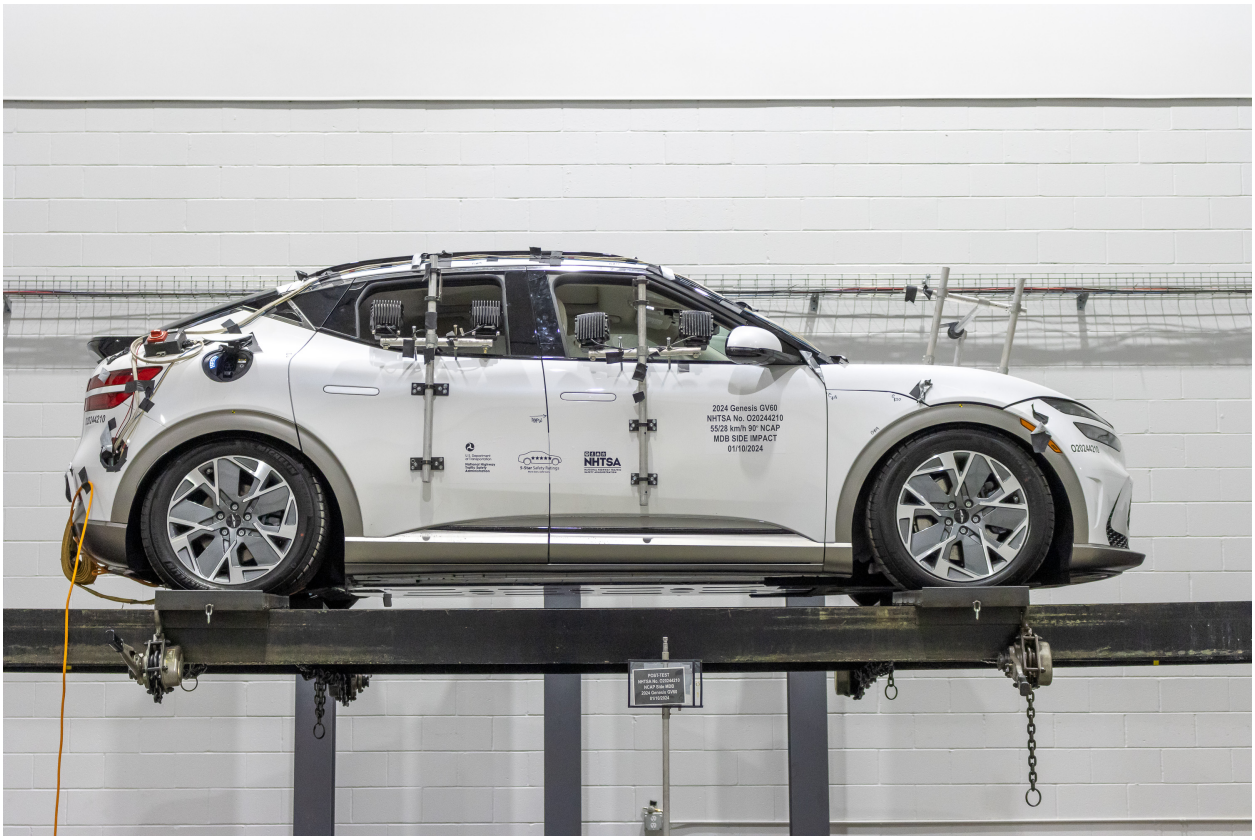

Figure A-96: FMVSS No. 301 Static Rollover 0 Degrees

Figure A-97: FMVSS No. 301 Static Rollover 90 Degrees

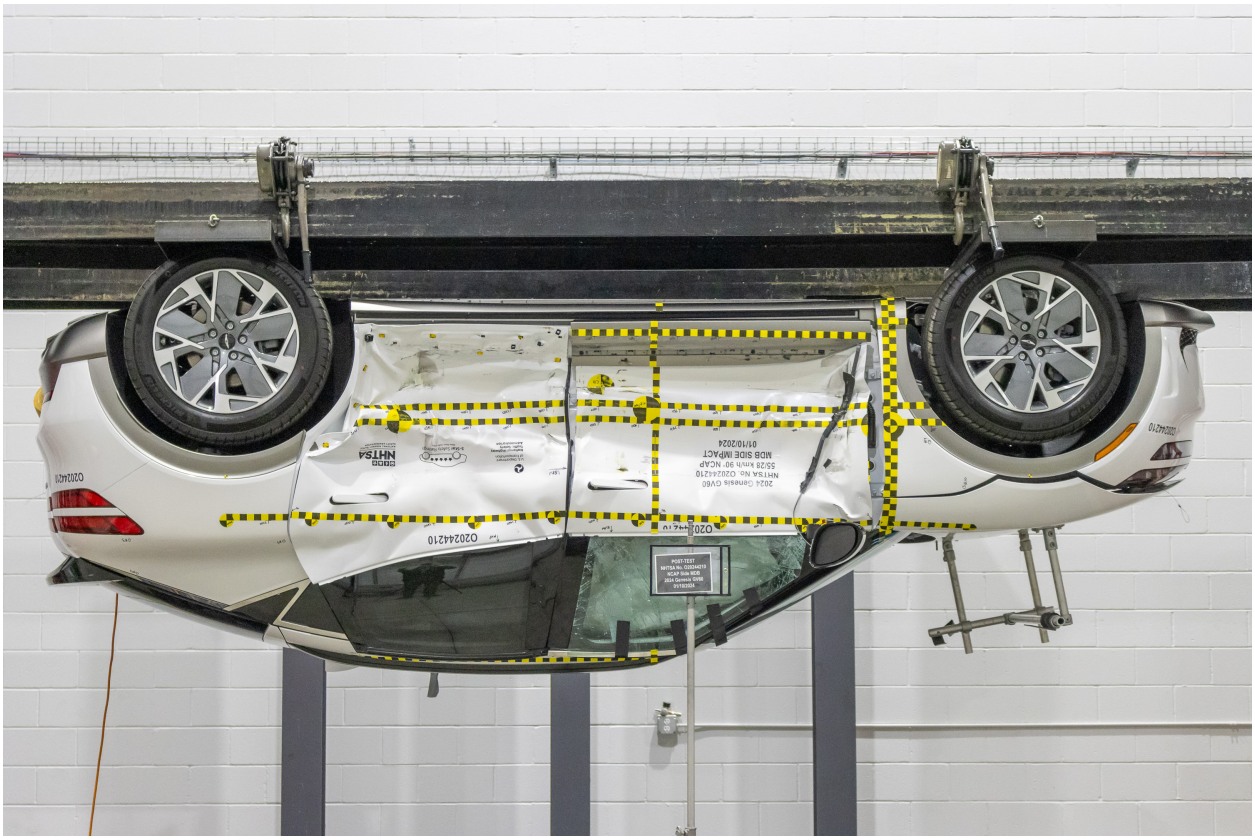

Figure A-98: FMVSS No. 301 Static Rollover 180 Degrees

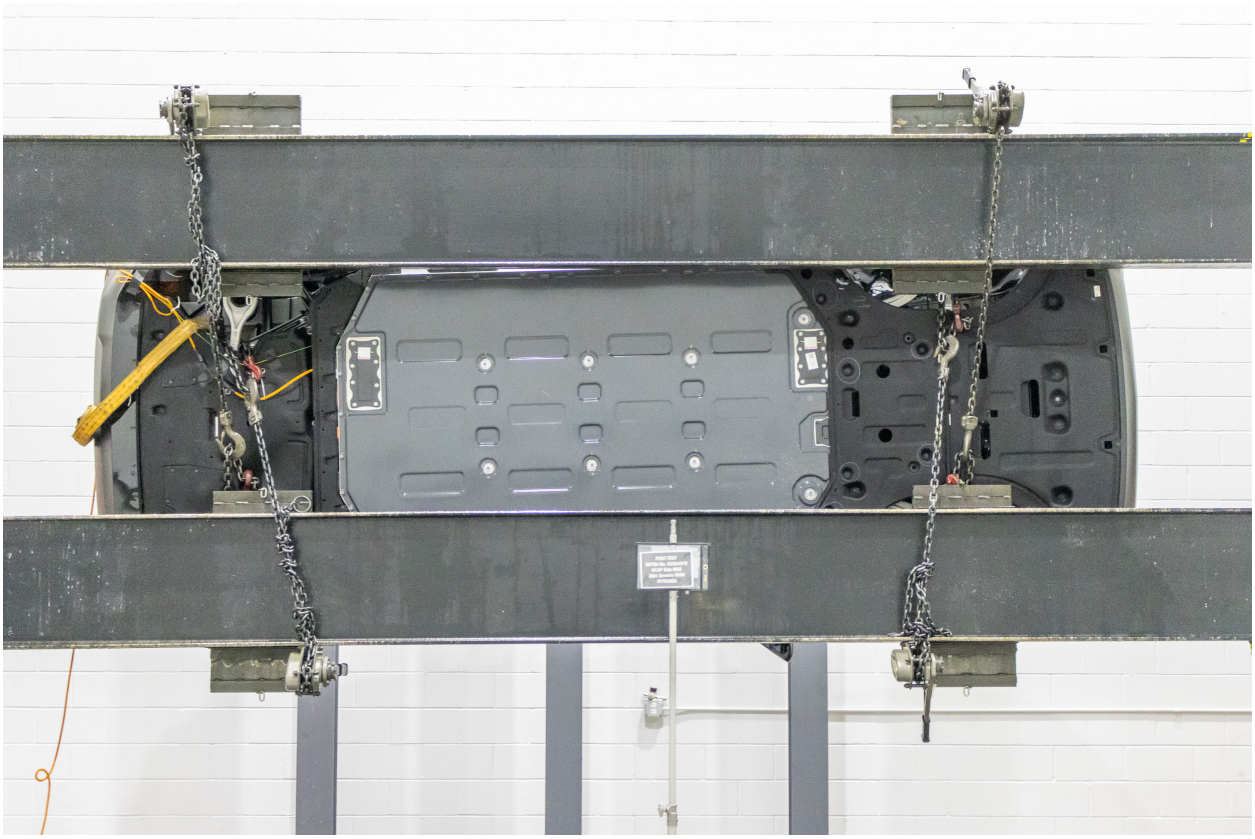

Figure A-99: FMVSS No. 301 Static Rollover 270 Degrees

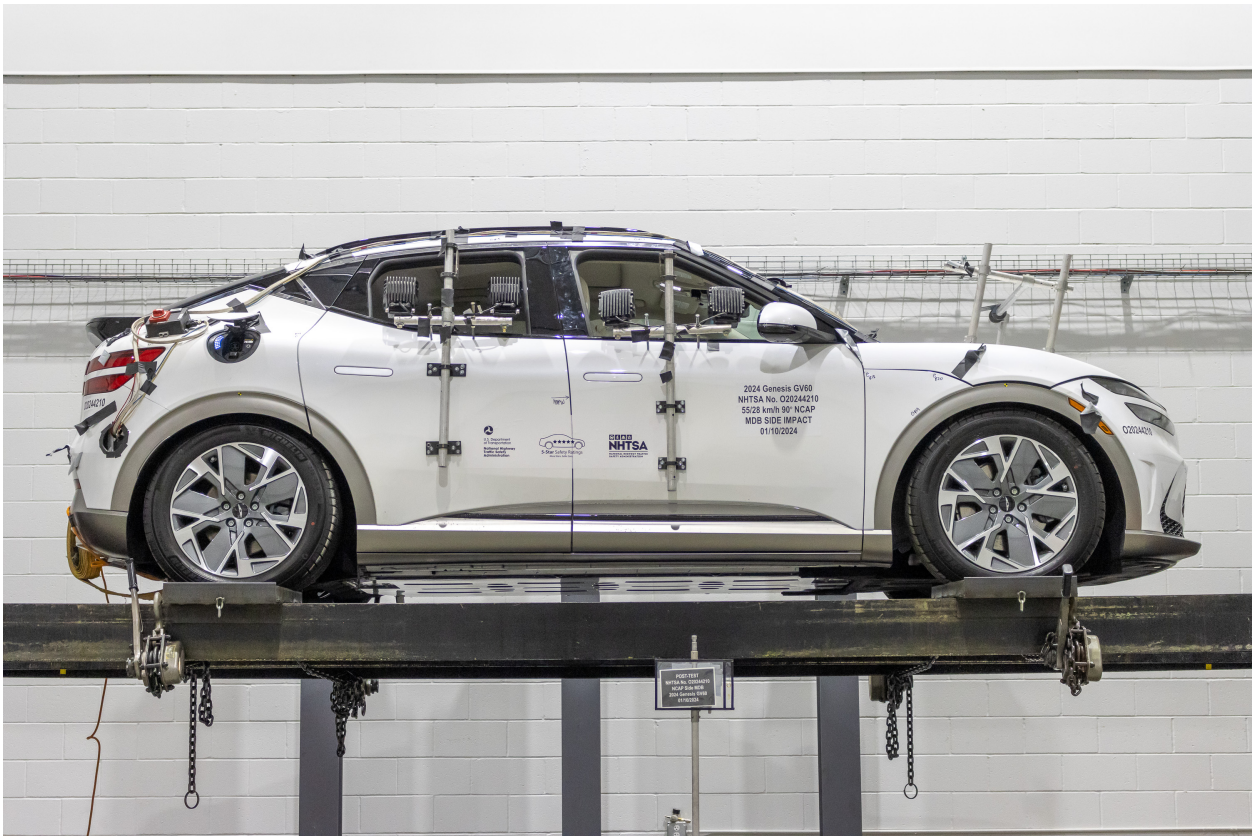

Figure A-100: FMVSS No. 301 Static Rollover 360 Degrees

Figure A-101: Impact Event

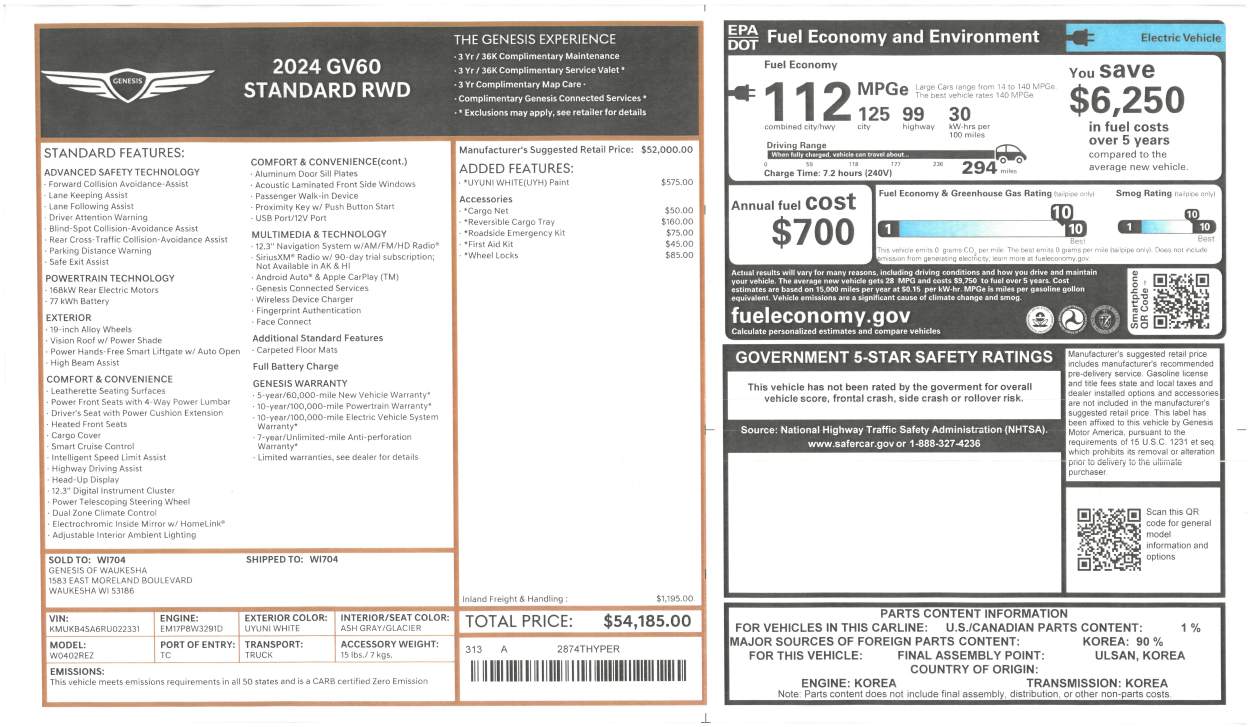

Figure A-102: Monroney Label

Armrest

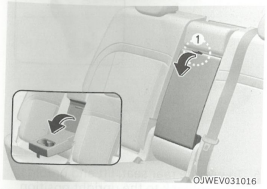

OJWEV031016

The armrest is located in the center of the rear seat.

Grab the handle (1) on the upper end of the arm rest. Then, pull down the handle to use the arm rest.

NOTICE

Do not put any items on the rear center seat.Those items may get damaged, when the arm rest is pulled down.

Headrest

The vehicle's front and rear seats have adjustable headrests. The headrests provide comfort for passengers, but more importantly they are designed to help protect passengers from whiplash and other neck and spinal injuries during an accident, especially in a rear impact collision.

WARNING

To help reduce the risk of serious injury or death in an accident, take the following precautions when adjusting your headrests:

- **Always properly adjust the headrests for all passengers BEFORE starting the vehicle.**
- **NEVER let anyone ride in a seat with the headrest removed or reversed.**

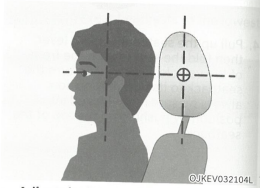

OJKEV032104L

- **Adjust the headrests so the middle of the headrest is at the same height as the height of the top of the eyes.**
- **NEVER adjust the headrest position of the driver's seat when the vehicle is in motion.**
- **Adjust the headrest as close to the passenger's head as possible. Do not use a seat cushion that holds the body away from the seatback.**
- **Make sure the headrest locks into position after adjusting it.**

WARNING

OJX1039115

When sitting on the rear seat, do not adjust the height of the headrest to the lowest position.

CAUTION

When there is no occupant in the rear seats, adjust the height of the headrest to the lowest position. The rear seat headrest can reduce the visibility of the rear area.

NOTICE

To prevent damage, NEVER hit or pull on the headrests.

Front seat headrests

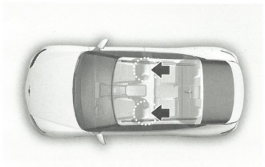

OJWEV031092L

The driver's and front passenger's seats are equipped with adjustable headrests for the passengers safety and comfort.

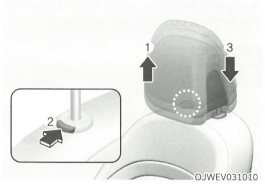

OJWEV031010

Adjusting the height up and down

To raise the headrest:

1. Pull it up to the desired position (1).

To lower the headrest:

1. Push and hold the release button (2) on the headrest support.
2. Lower the headrest to the desired position (3).

Figure A-103: Driver Head Restraint Use and Adjustment Information from Vehicle Owner's Manual

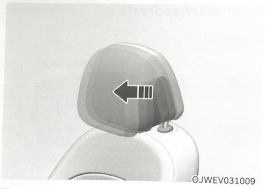

OJWEV031009

Forward and rearward adjustment

The headrest can be adjusted forward to 3 different positions by pulling the headrest forward to the desired detent. To adjust the headrest to it's furthest rearwards position, pull it fully forward to the farthest position and release it.

NOTICE

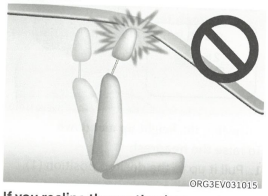

ORG3EV031015

If you recline the seatback towards the front with the headrest and seat cushion raised, the headrest may come in contact with the sunvisor or other parts of the vehicle.

OJWEV031011

Removal/Reinstall

To remove the headrest:

1. Recline the seatback (2) with the seatback angle switch (1).
2. Raise the headrest as far as it can go.
3. Press the headrest release button (3) while pulling the headrest up (4).

WARNING

NEVER allow anyone to travel in a seat with the headrest removed.

OJWEV031093L

To reinstall the headrest :

1. Recline the seatback.
2. Put the headrest poles (2) into the holes while pressing the release button (1).
3. Adjust the headrest to the appropriate height.
4. Recline the seatback (4) with the seatback angle switch (3).

WARNING

Always make sure the headrest locks into position after reinstalling and adjusting it properly.

Rear seat headrests

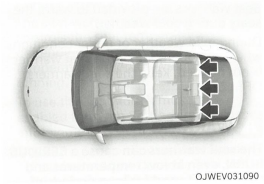

OJWEV031090

The rear seats are equipped with headrests in all the seating positions for the passenger's safety and comfort.

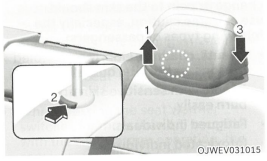

OJWEV031015

Adjusting the height up and down

To raise the headrest:

1. Pull it up to the desired position (1).

To lower the headrest:

1. Push and hold the release button (2) on the headrest support.
2. Lower the headrest to the desired position (3).

Figure A-104: Left Rear Passenger Head Restraint Use and Adjustment Information from Vehicle Owner's Manual

Figure 305-1: Auxiliary Power Module Warning Label

Figure 305-2: Power Inverter Warning Label

Figure 305-3 First Responder Warning Label

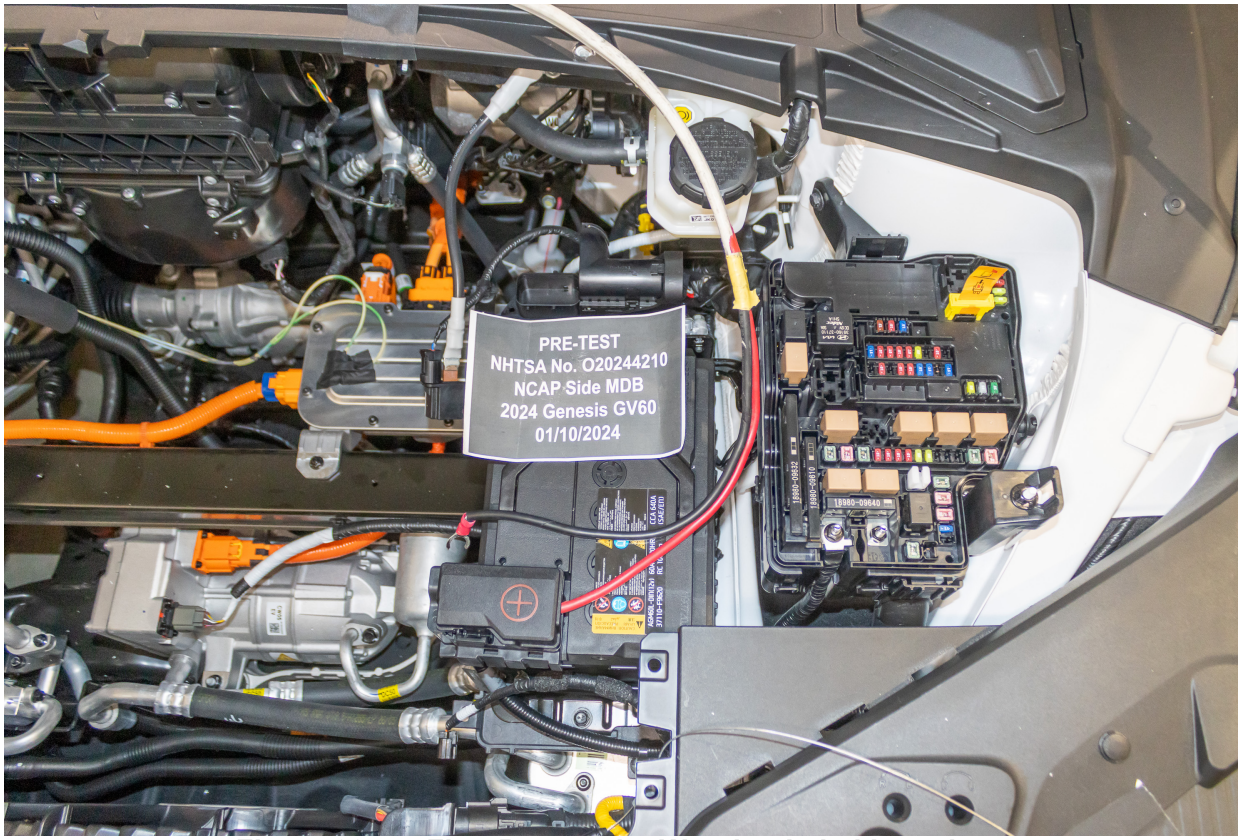

Figure 305-4: First Responder Warning Label Location

Photo Not Applicable

Figure 305-5: Other Vehicle Label(s) Related to Electrical Propulsion System

Figure 305-6: Manual High Voltage Service Disconnect in Place

Figure 305-7: Manual High Voltage Service Disconnect Removed (Plug)

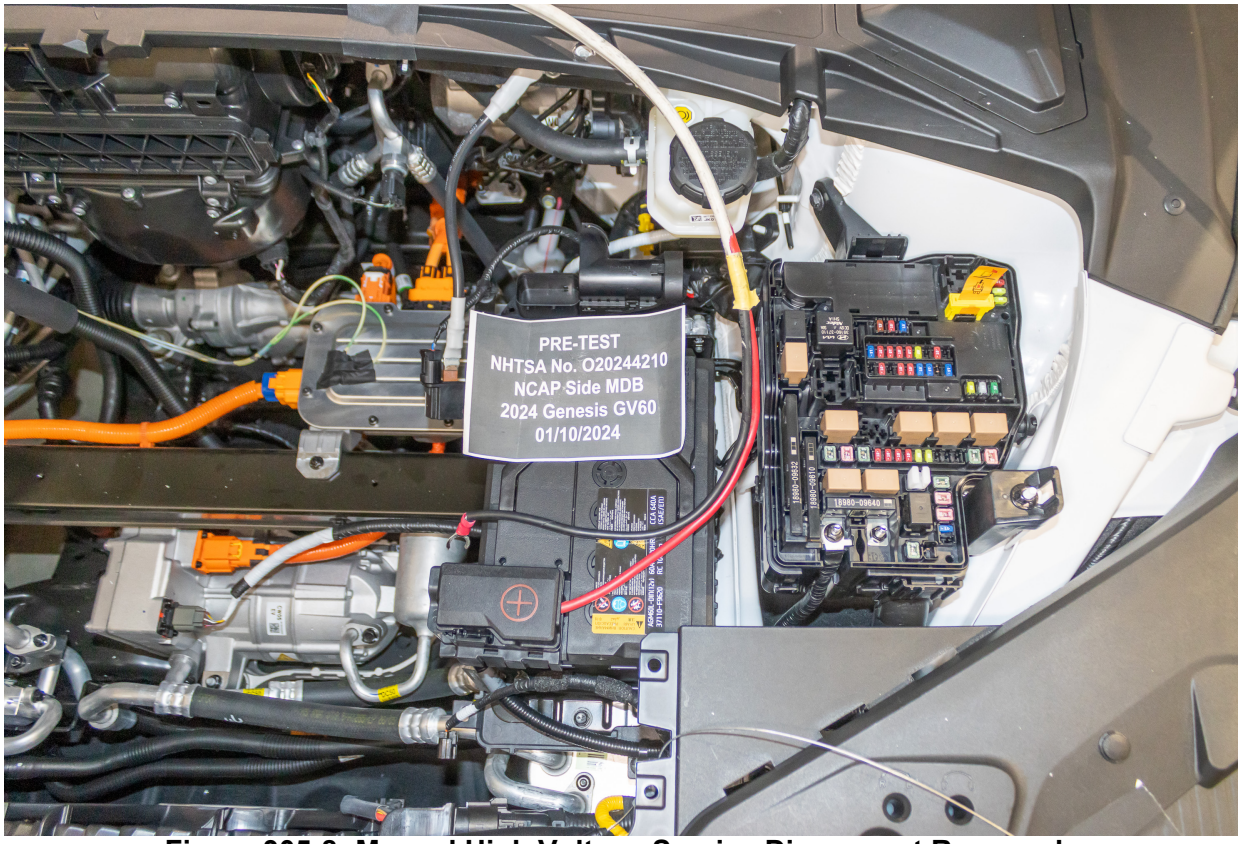

Figure 305-8: Manual High Voltage Service Disconnect Removed (Location where removed)

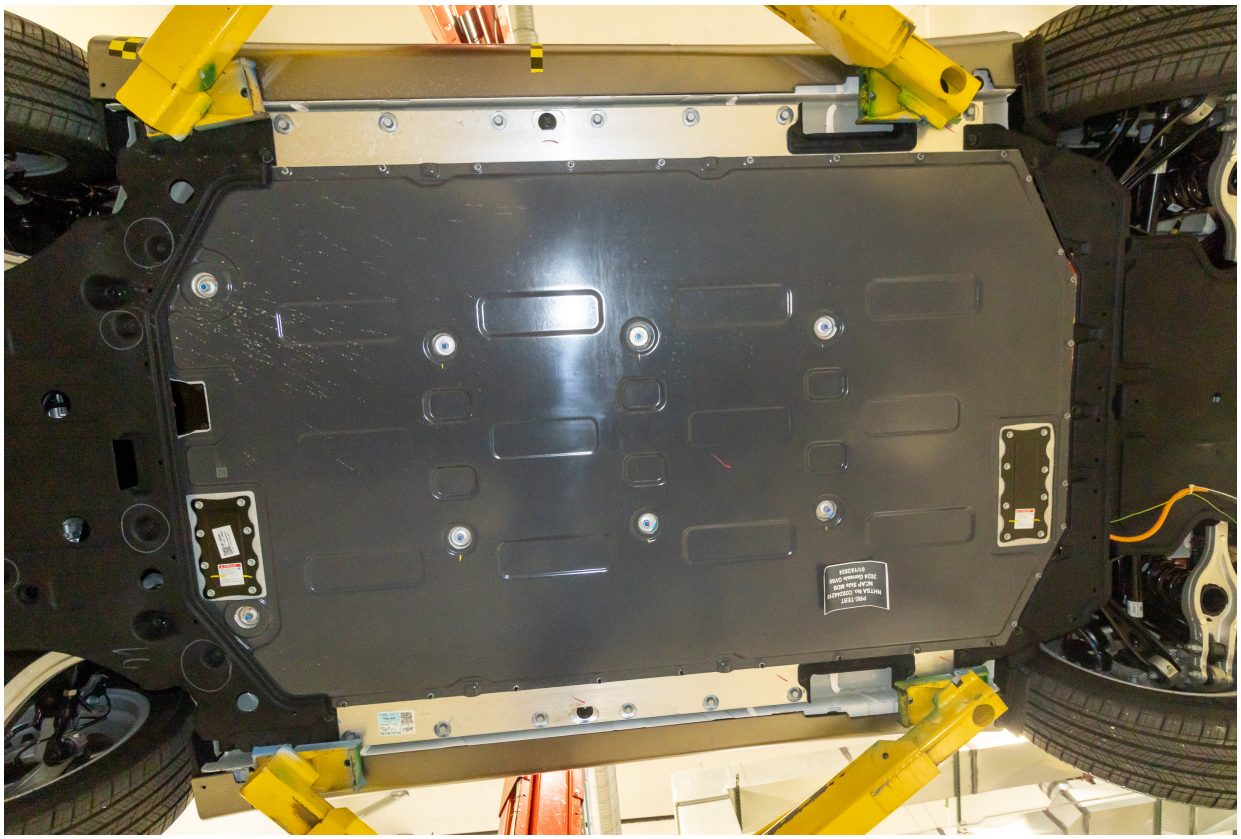

Figure 305-9: Pre-Impact View of Propulsion Battery

Figure 305-10: Post-Impact Front View of Propulsion Battery

Figure 305-11: Post-Impact Rear View of Propulsion Battery (if any part of it is visible)

Photo Not Applicable

Figure 305-12: Pre-Impact View of Battery Box(s) or Container(s) Which Holds Individual Battery Modules

Figure 305-13: Post-Impact View of Battery Box(s) or Container(s) Which Holds Individual Battery Modules

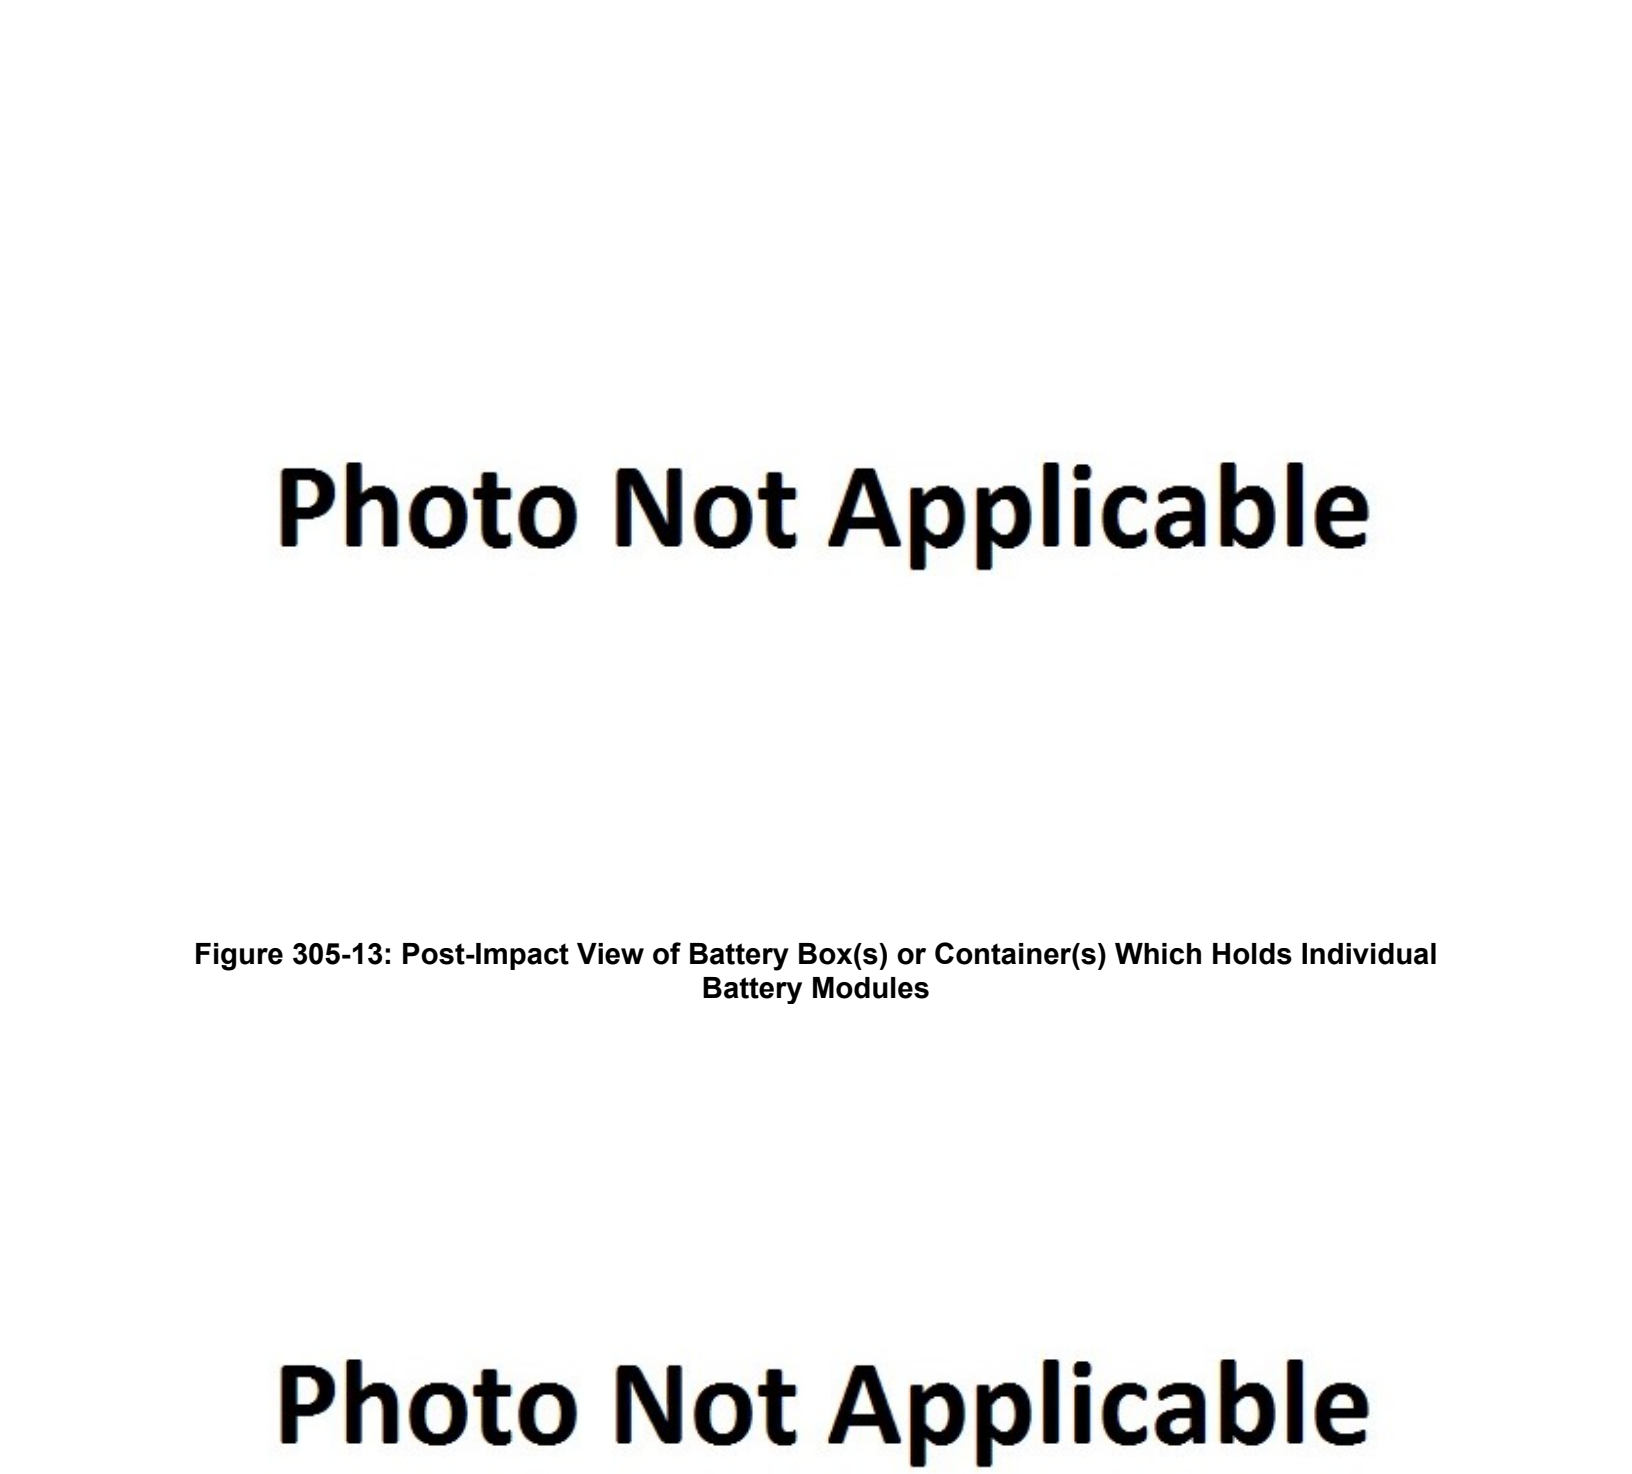

Figure 305-14: Pre-Impact View of Propulsion Battery Module(s)

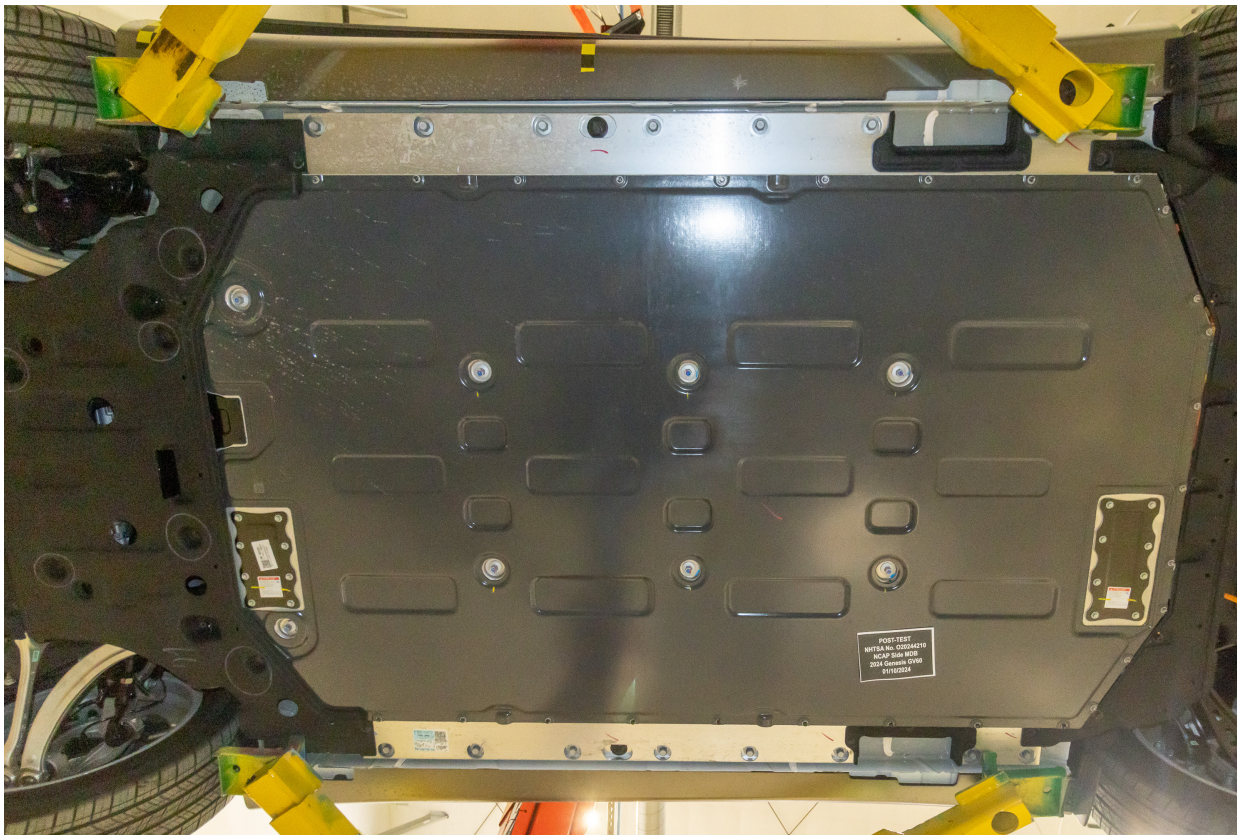

Figure 305-15: Post-Impact View of Propulsion Battery Module(s)

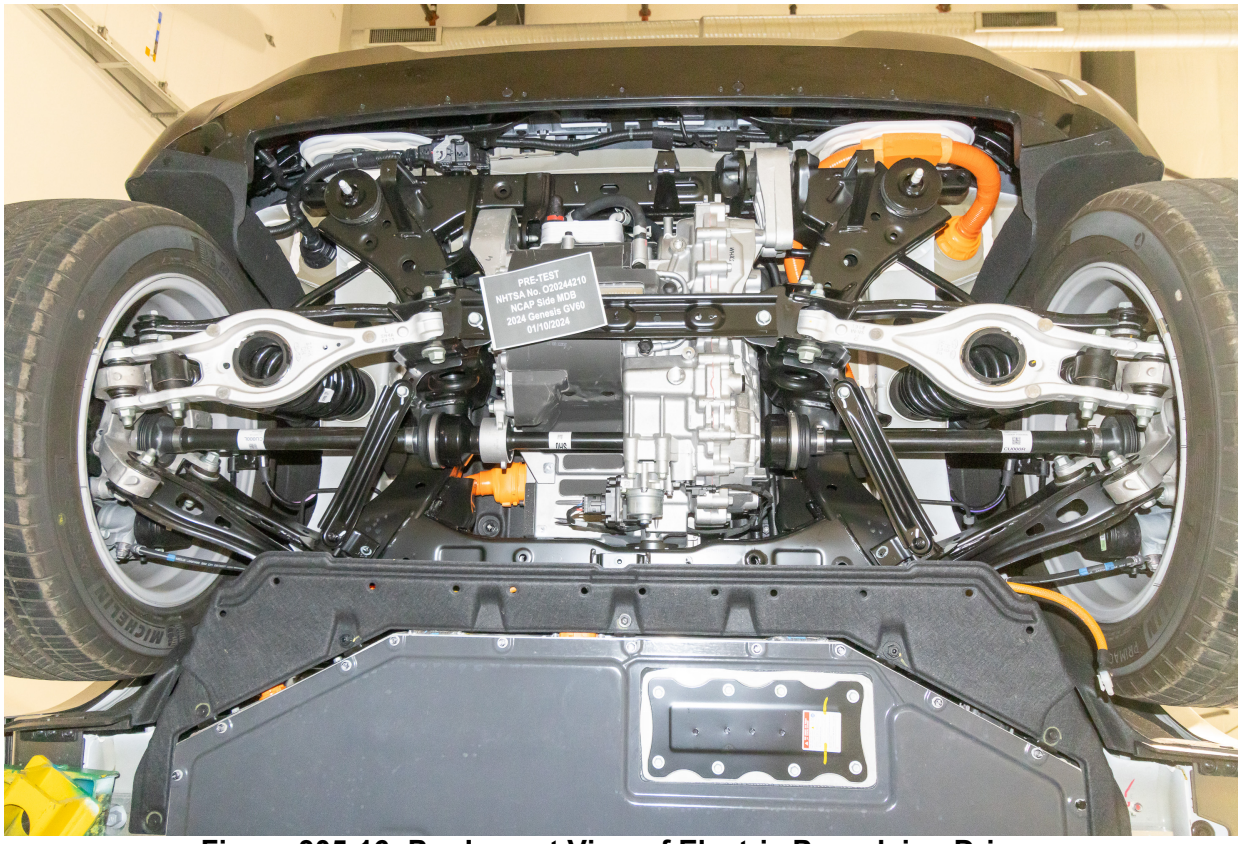

Figure 305-16: Pre-Impact View of Electric Propulsion Drive

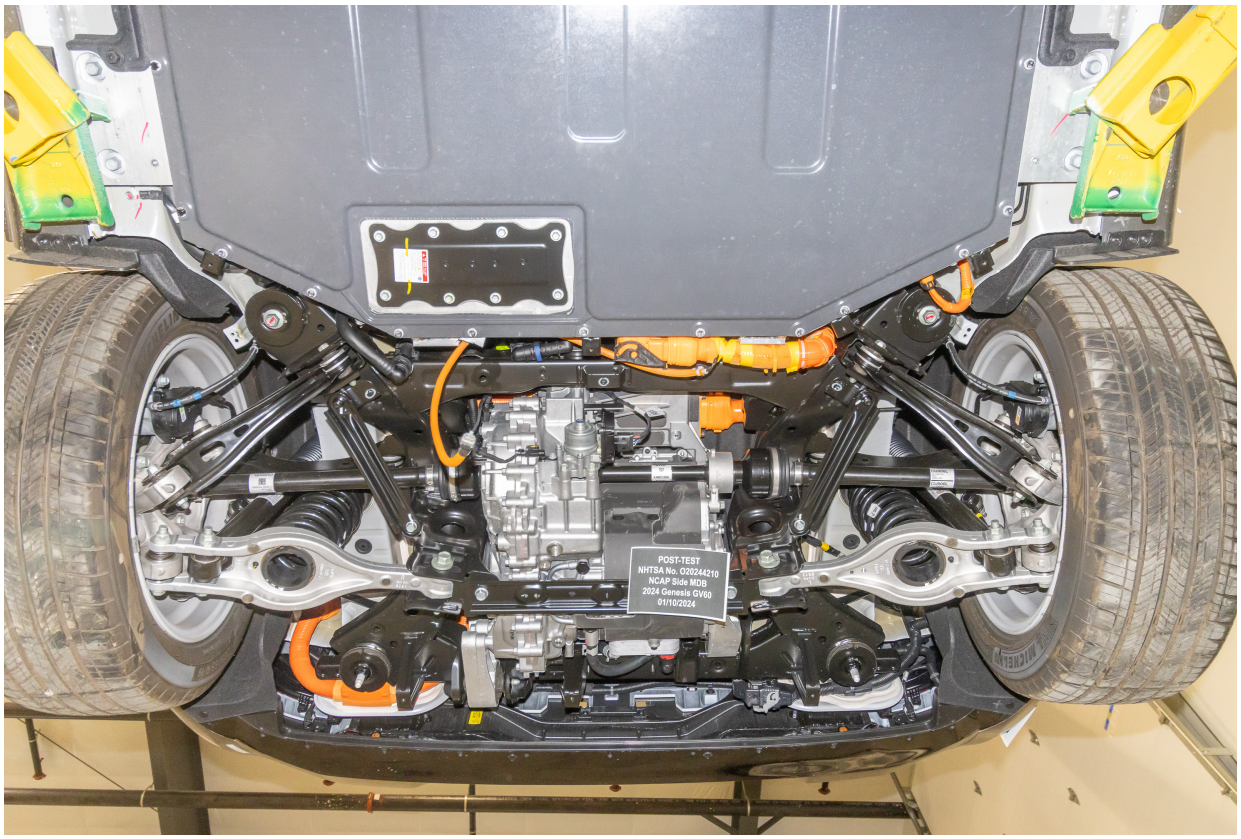

Figure 305-17: Post-Impact View of Electric Propulsion Drive

Figure 305-18: Pre-Impact View of High Voltage Interconnect(s)

Photo Not Applicable

Figure 305-19: Pre-Impact View Propulsion Venting System(s)

Figure 305-20: Pre-Impact View of Other Visible Electric Propulsion Components

Figure 305-21: Pre-Impact View of Ground Lead Attached

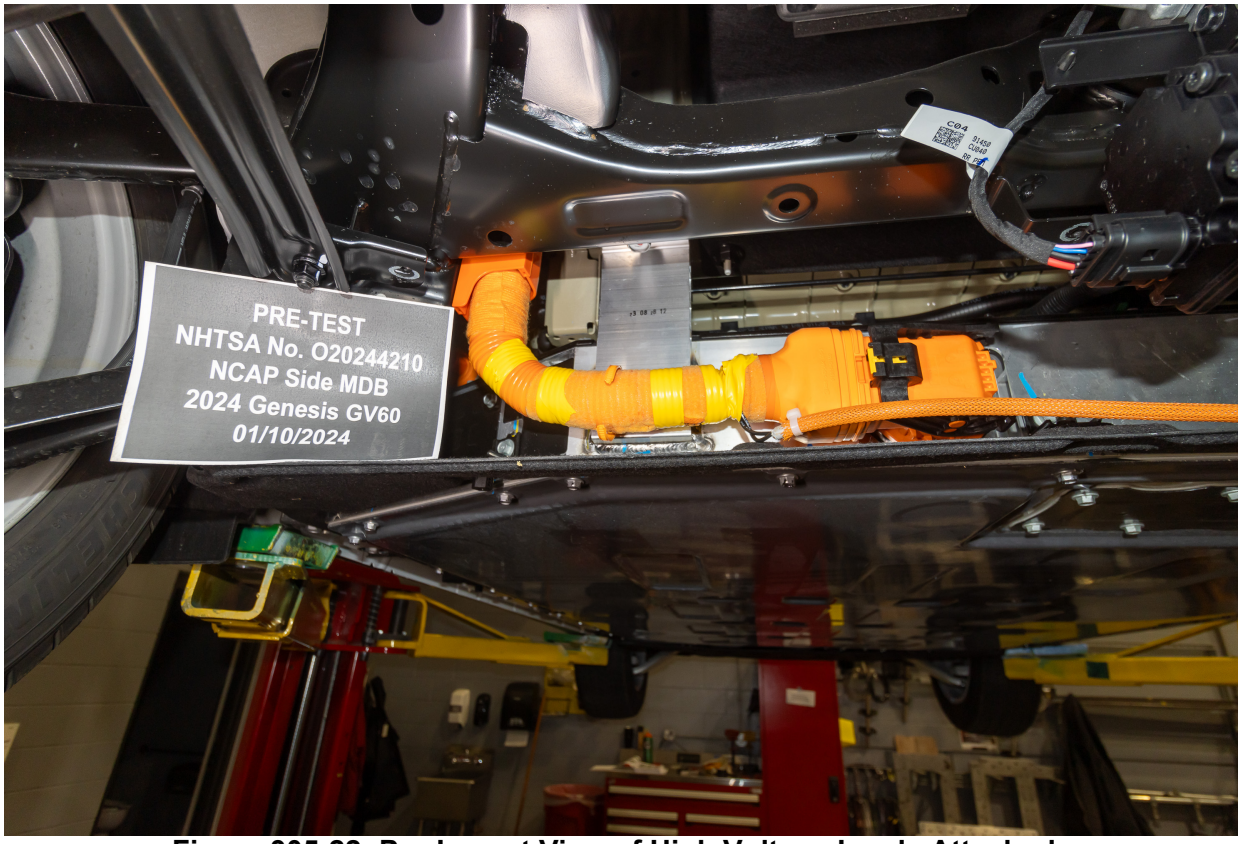

Figure 305-22: Pre-Impact View of High Voltage Leads Attached

Figure 305-23: Pre-Impact Close-Up View of High Voltage Leads Attached

Figure 305-24: Pre-Impact View of Installed Test Interface Port

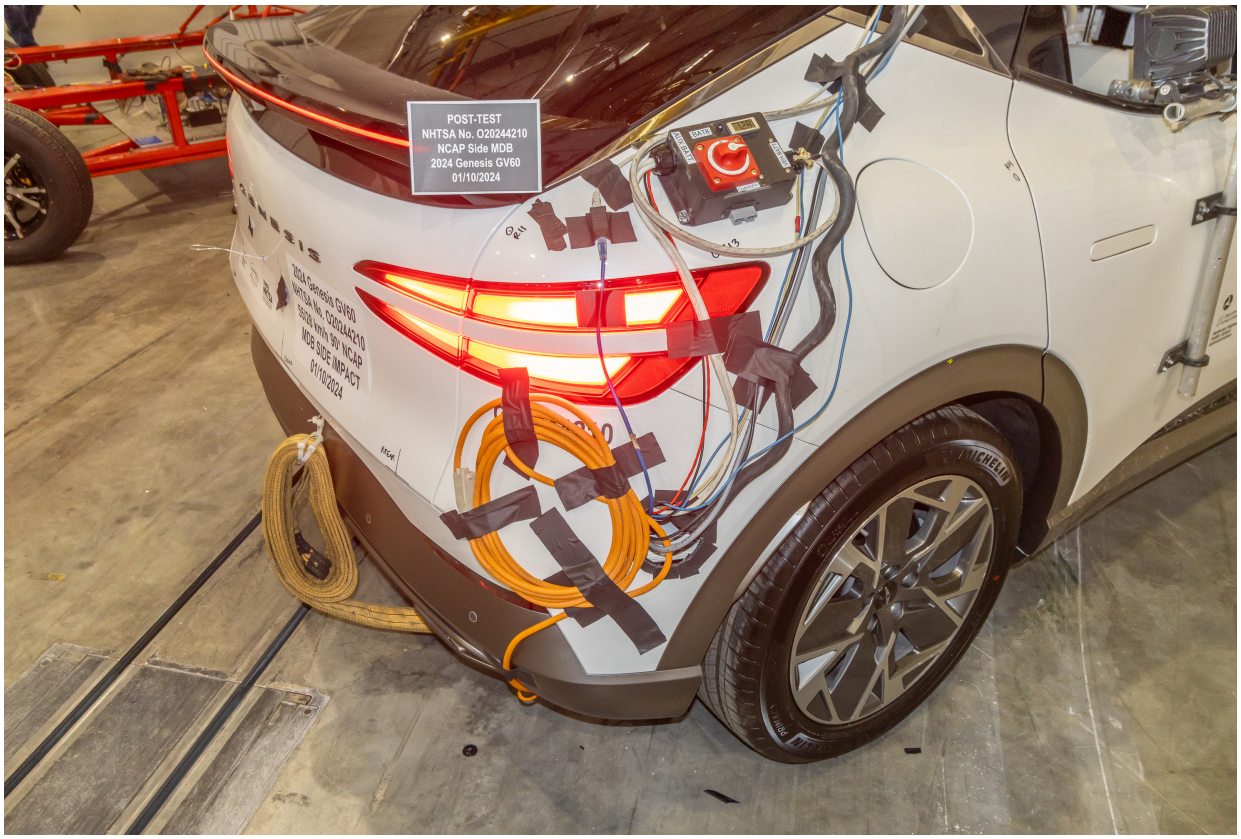

Figure 305-25: Post-Impact View of Installed Test Interface Port

Photo Not Applicable

Figure 305-26: Pre-Impact View of Other Test Devices

Photo Not Applicable

Figure 305-27: Post-Impact View of Other Test Devices

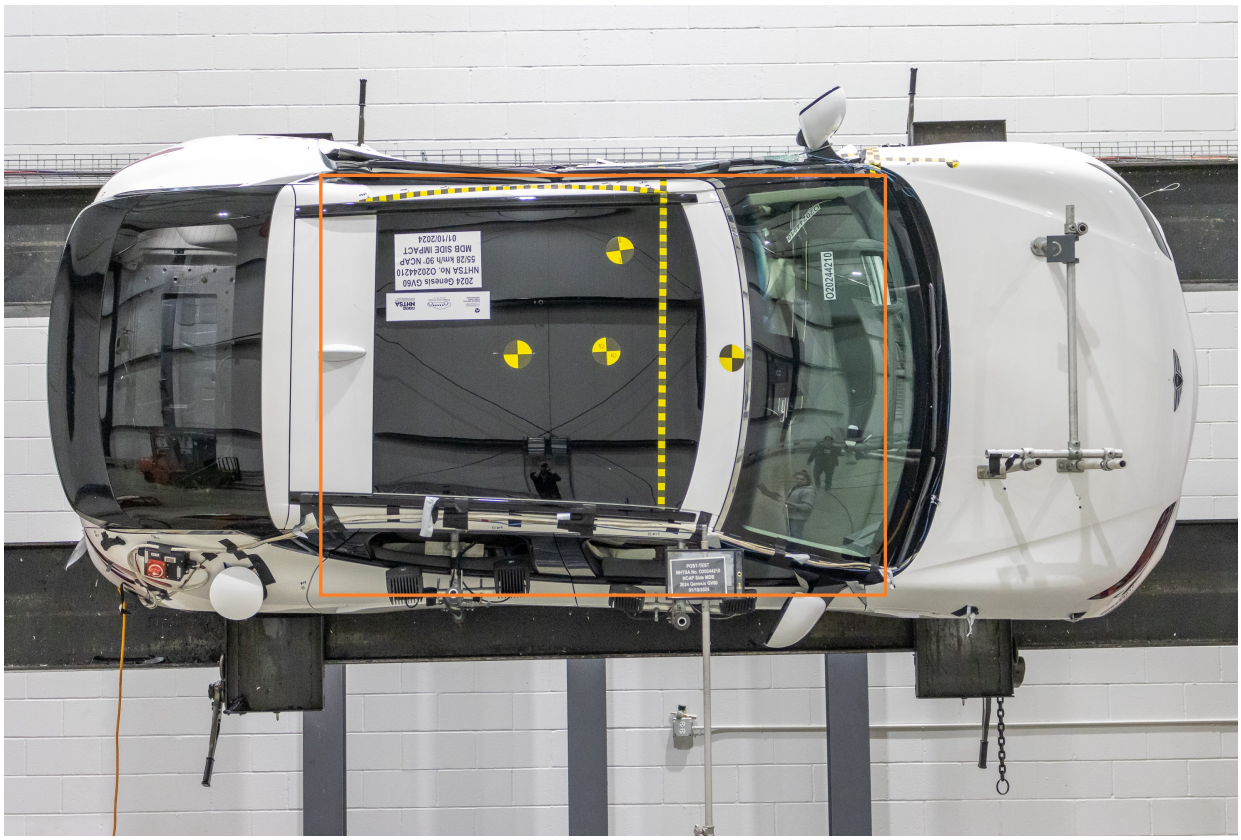

Figure 305-28: FMVSS No. 305 Static Rollover 90 Degrees

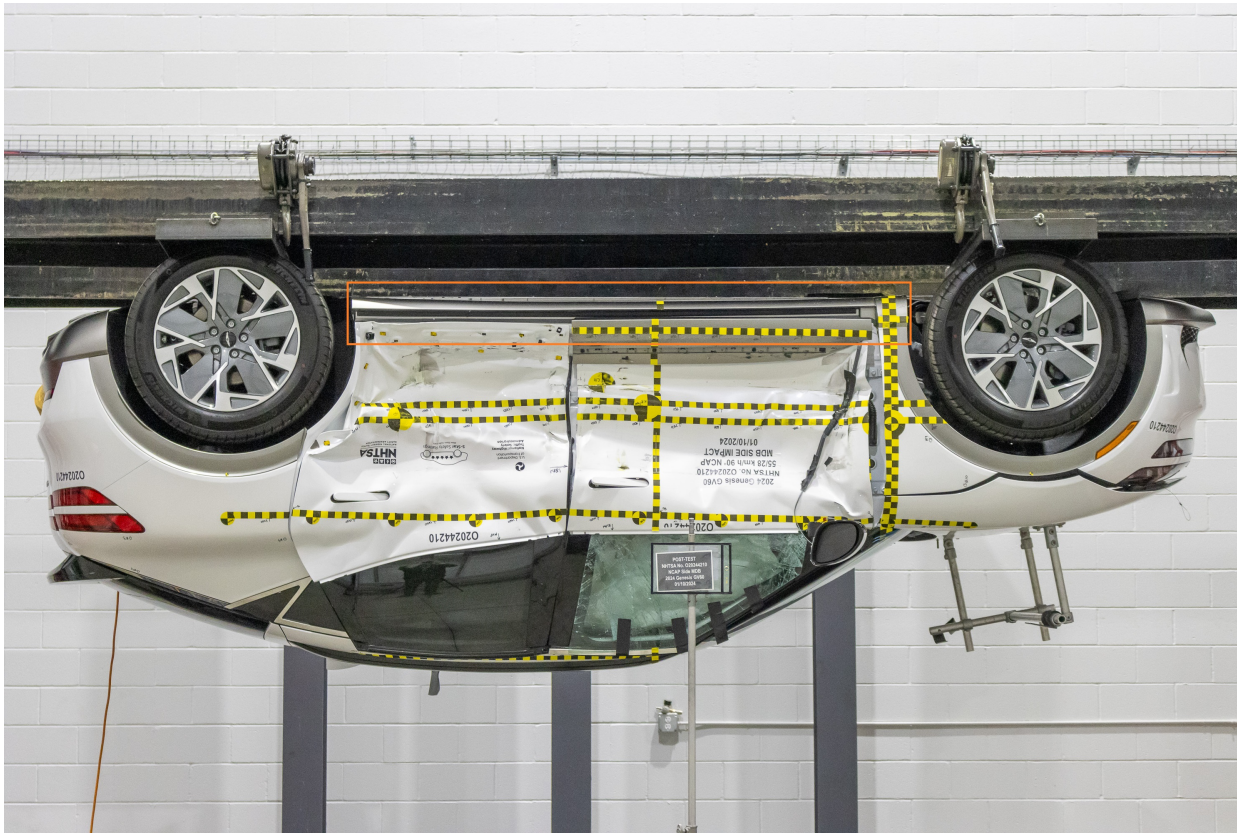

Figure 305-29: FMVSS No. 305 Static Rollover 180 Degrees

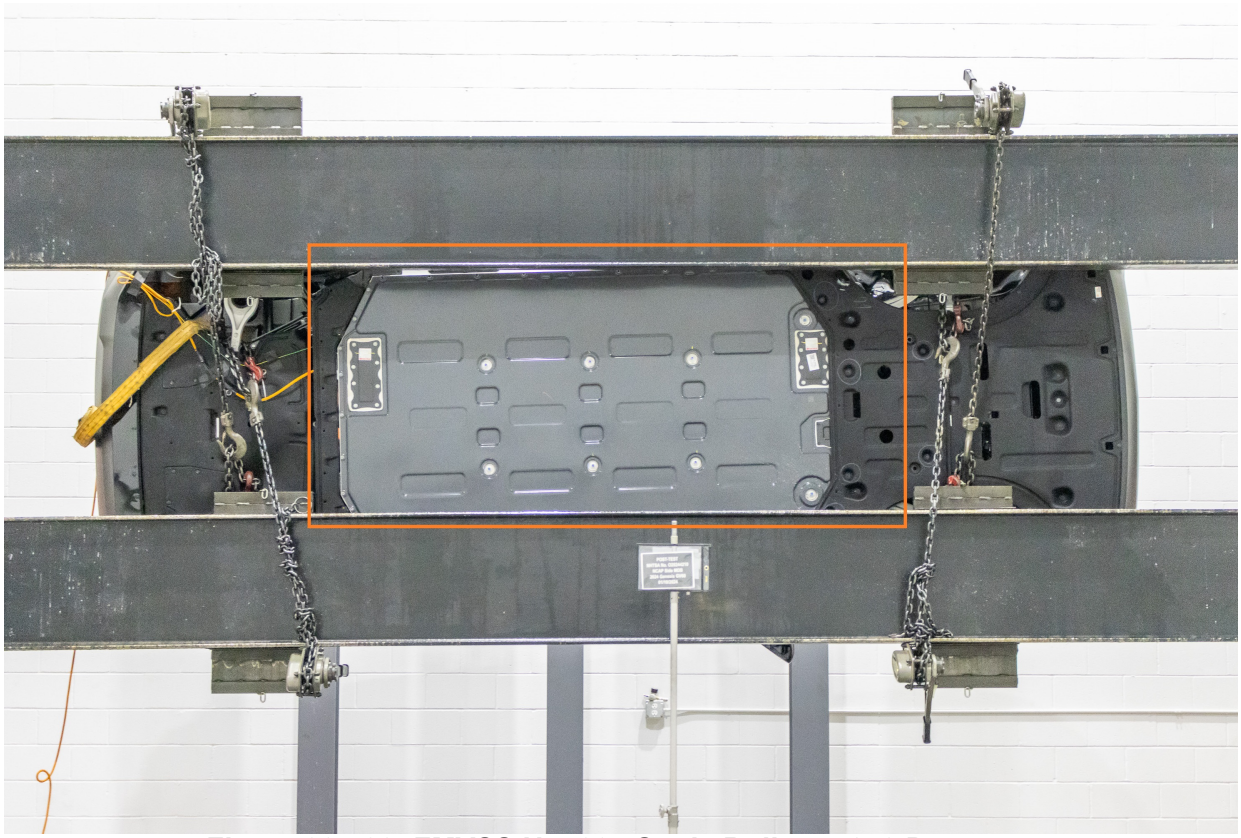

Figure 305-30: FMVSS No. 305 Static Rollover 270 Degrees

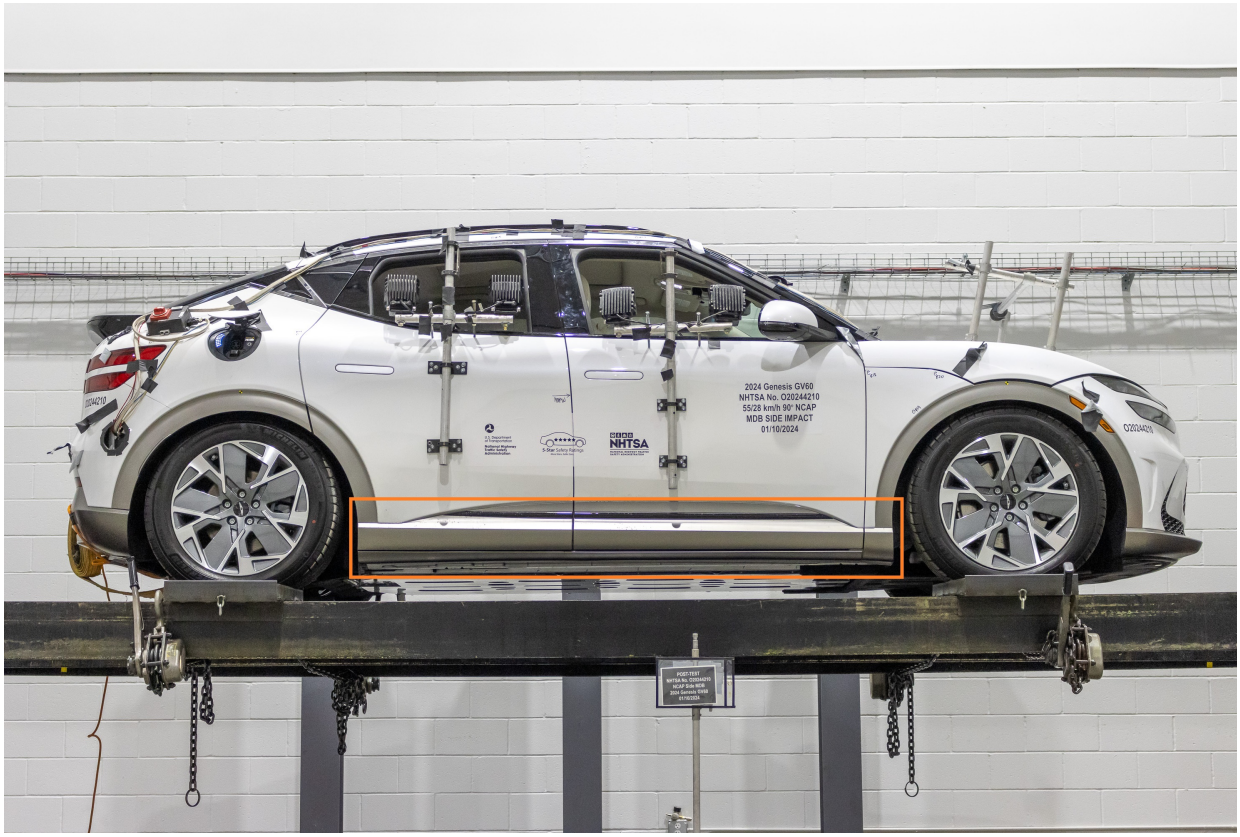

Figure 305-31: FMVSS No. 305 Static Rollover 360 Degrees

Figure 305-32: Pre-Impact View of the Vehicle Passenger Compartment Adjacent to Propulsion Battery

Figure 305-33: Post-Impact View of the Vehicle Passenger Compartment Adjacent to Propulsion Battery

Photo Not Applicable

Figure 305-34: Post-Impact Propulsion Battery System Mounting and-or Intrusion Failure(s)

Figure 305-35: Post-Impact View of Battery Component Intrusion (if applicable)

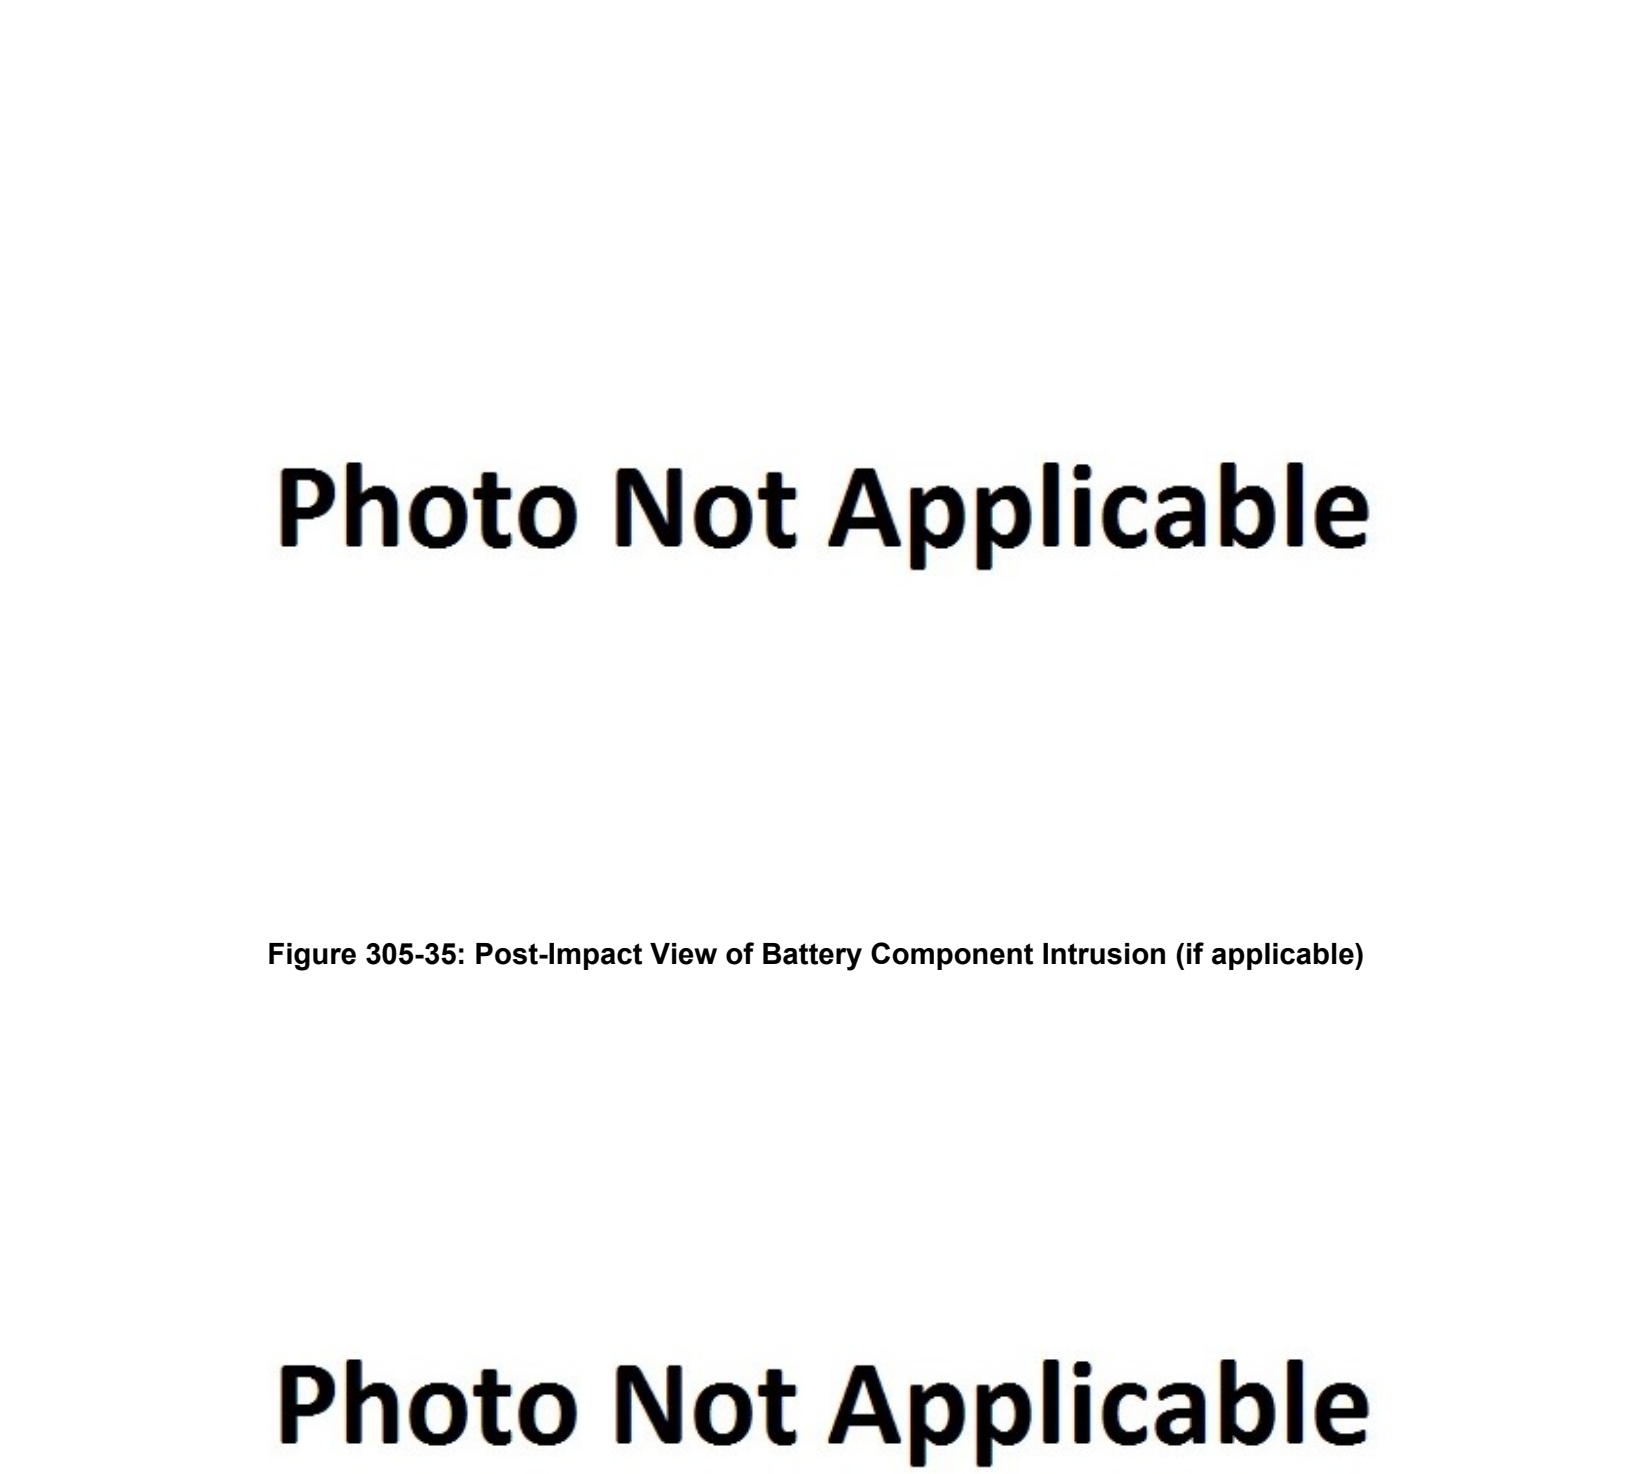

Figure 305-36: Post-Impact View of Battery Module Movement or Retention Loss (if applicable)

Figure 305-37: Post-Impact View of Propulsion Battery Electrolyte Spillage Location (Prior to static roll)

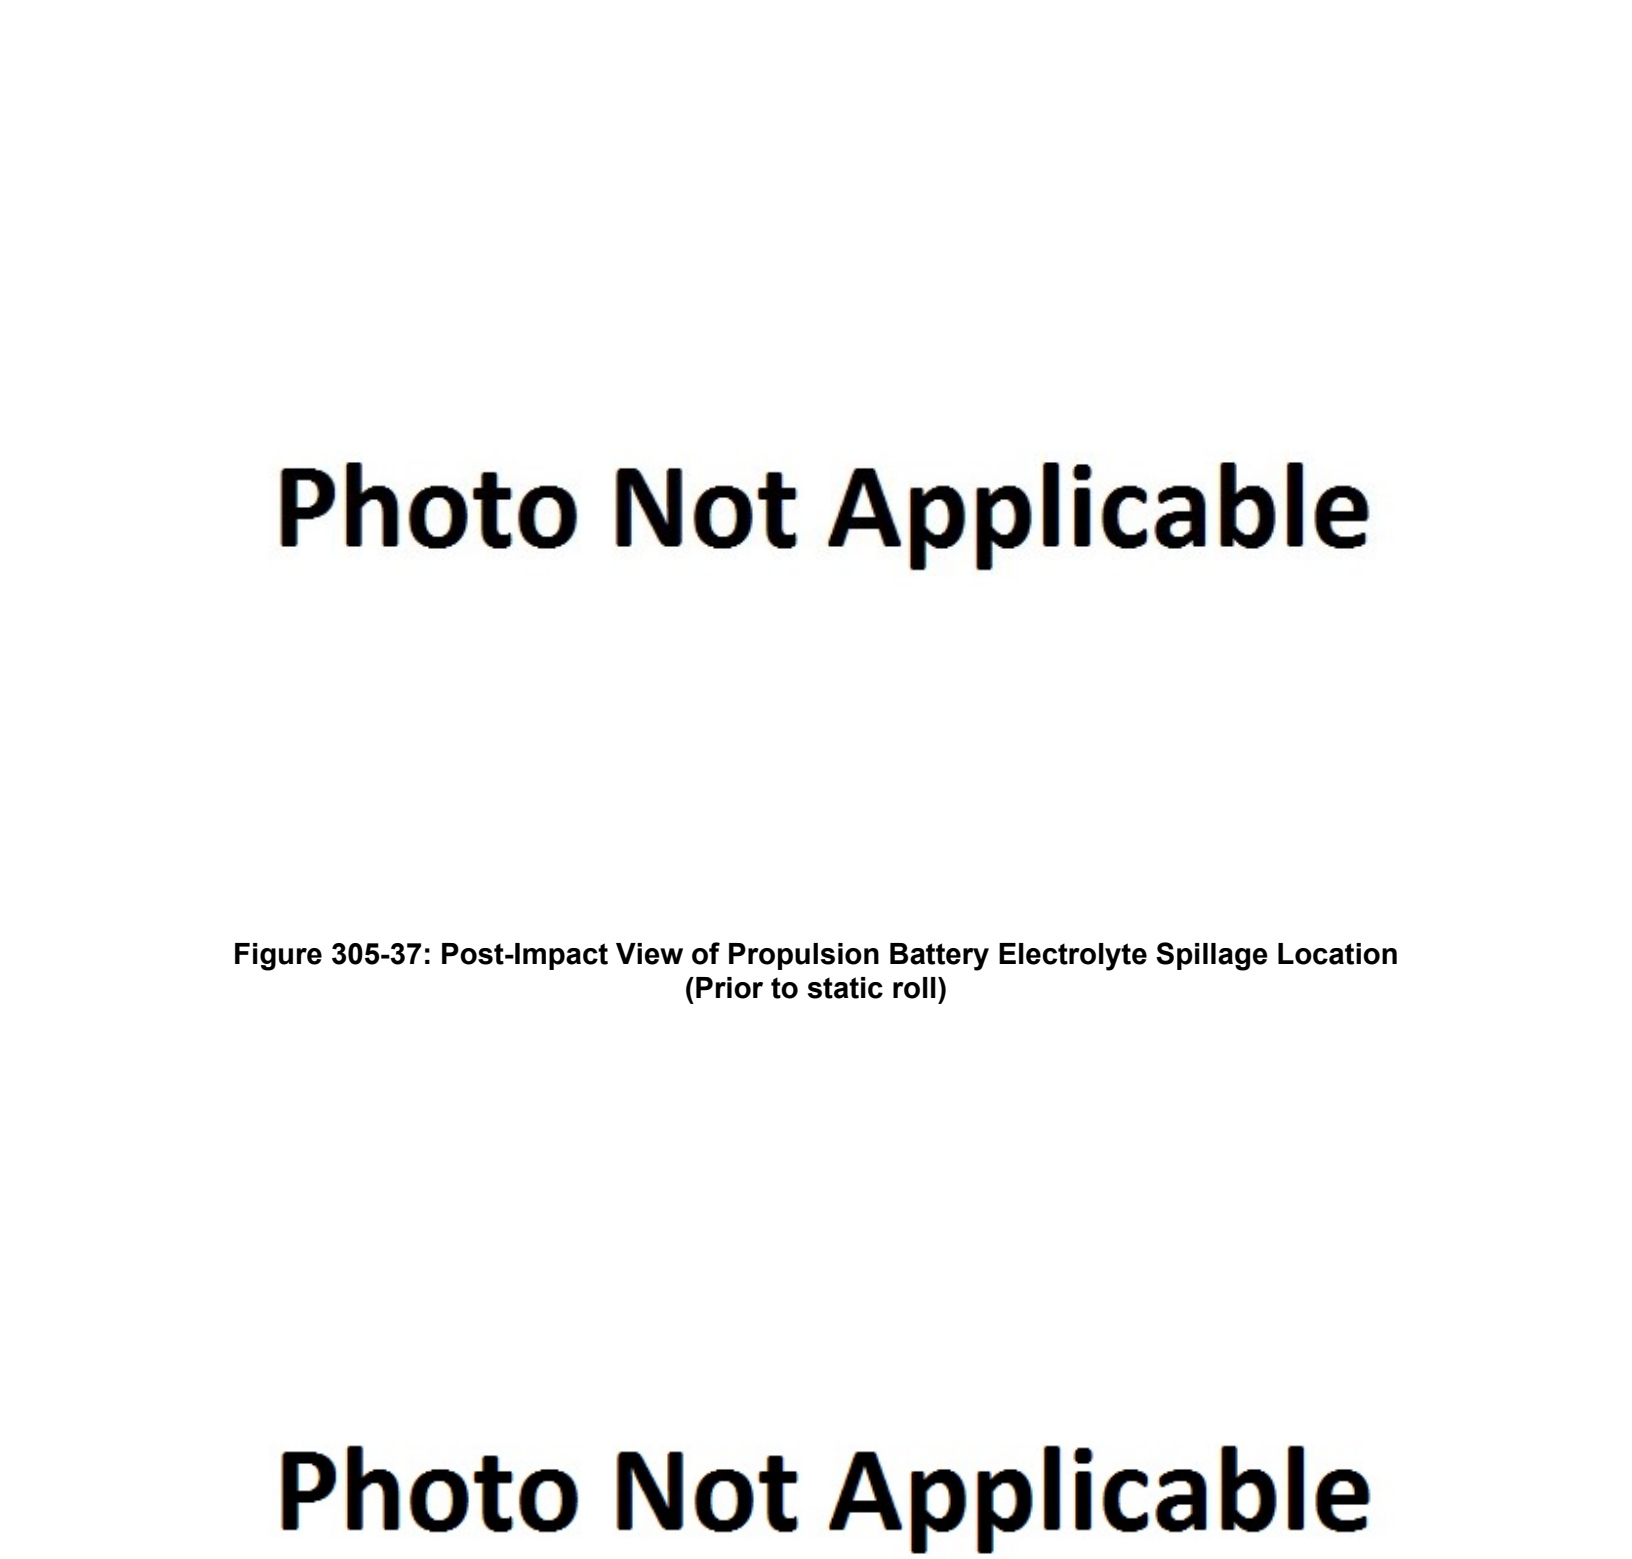

Figure 305-38: Post-Impact View of Propulsion Battery Electrolyte Spillage Location (After static roll)

APPENDIX B
VEHICLE AND DUMMY RESPONSE DATA TRACES

Table of Data Plots
Driver Dummy Instrumentation Plots

Fig.	Description	Page
Plot 1	Driver Head Acceleration (X) Primary vs. Time	B-5
Plot 2	Driver Head Acceleration (Y) Primary vs. Time	B-5
Plot 3	Driver Head Acceleration (Z) Primary vs. Time	B-5
Plot 4	Driver Head Resultant Acceleration Primary vs. Time	B-5
Plot 5	Driver Upper Thorax Rib Deflection (Y) vs. Time	B-6
Plot 6	Driver Middle Thorax Rib Deflection (Y) vs. Time	B-6
Plot 7	Driver Lower Thorax Rib Deflection (Y) vs. Time	B-6
Plot 8	Driver Thorax Rib Deflection Maximum vs. Time	B-6
Plot 9	Driver Anterior Abdominal Force (Y) vs. Time	B-7
Plot 10	Driver Middle Abdominal Force (Y) vs. Time	B-7
Plot 11	Driver Posterior Abdominal Force (Y) vs. Time	B-7
Plot 12	Driver Total Abdominal Force (Y) vs. Time	B-7
Plot 13	Driver Pubic Symphysis Force (Y) vs. Time	B-8
Plot 14	Passenger Head Acceleration (X) vs. Time Primary	B-8
Plot 15	Passenger Head Acceleration (Y) vs. Time Primary	B-8
Plot 16	Passenger Head Acceleration (Z) vs. Time Primary	B-8
Plot 17	Passenger Head Resultant Acceleration Primary vs. Time	B-9
Plot 18	Passenger Lower Spine T12 Acceleration (X) vs. Time	B-9
Plot 19	Passenger Lower Spine T12 Acceleration (Y) vs. Time	B-9
Plot 20	Passenger Lower Spine T12 Acceleration (Z) vs. Time	B-9
Plot 21	Passenger Lower Spine T12 Resultant Acceleration vs. Time	B-10
Plot 22	Passenger Iliac Force on Impact Side (Y) vs. Time	B-10
Plot 23	Passenger Acetabulum Force on Impact Side (Y) vs. Time	B-10
Plot 24	Passenger Total Pelvic Force on Impact Side (Y) vs. Time	B-10

The following additional dummy and vehicle response data can be obtained from the Research and Development section of the NHTSA website. The website can be found at www.NHTSA.gov

Additional Driver & Passenger Dummy Instrumentation Data

Driver Lower Spine T12 Acceleration (X)
Driver Lower Spine T12 Acceleration (Y)
Driver Lower Spine T12 Acceleration (Z)
Passenger Upper Thorax Rib Deflection (Y)
Passenger Middle Thorax Rib Deflection (Y)
Passenger Lower Thorax Rib Deflection (Y)
Passenger Upper Abdomen Rib Deflection (Y)
Passenger Lower Abdomen Rib Deflection (Y)
Driver Head Acceleration Redundant (X)
Driver Head Acceleration Redundant (Y)
Driver Head Acceleration Redundant (Z)
Passenger Head Acceleration Redundant (X)
Passenger Head Acceleration Redundant (Y)
Passenger Head Acceleration Redundant (Z)

Vehicle Instrumentation Data

Vehicle Center of Gravity Acceleration (X)
Vehicle Center of Gravity Acceleration (Y)
Vehicle Center of Gravity Acceleration (Z)
Right Side Sill at Front Seat Acceleration (X)
Right Side Sill at Front Seat Acceleration (Y)
Right Side Sill at Front Seat Acceleration (Z)
Right Side Sill at Rear Seat Acceleration (X)
Right Side Sill at Rear Seat Acceleration (Y)
Right Side Sill at Rear Seat Acceleration (Z)
Left Side Sill at Front Seat Acceleration (Y)
Left Side Sill at Rear Seat Acceleration (Y)
Lower A-Post Acceleration (Y)
Middle A-Post Acceleration (Y)
Lower B-Post Acceleration (Y)
Middle B-Post Acceleration (Y)
Front Seat Track Acceleration (Y)
Rear Seat Structure Acceleration (Y)
Right Rear Occupant Compartment Acceleration (Y)
Engine Block (X)
Engine Block (Y)
Rear Floorpan Above Axle Acceleration (X)
Rear Floorpan Above Axle Acceleration (Y)
Rear Floorpan Above Axle Acceleration (Z)

MDB Instrumentation Data

MDB Center of Gravity Acceleration (X)
MDB Center of Gravity Acceleration (Y)
MDB Center of Gravity Acceleration (Z)
MDB Rear Acceleration (X)
MDB Rear Acceleration (Y)
Left MDB Contact Switch
Right MDB Contact Switch

Driver Head Acceleration (X) Primary vs. Time

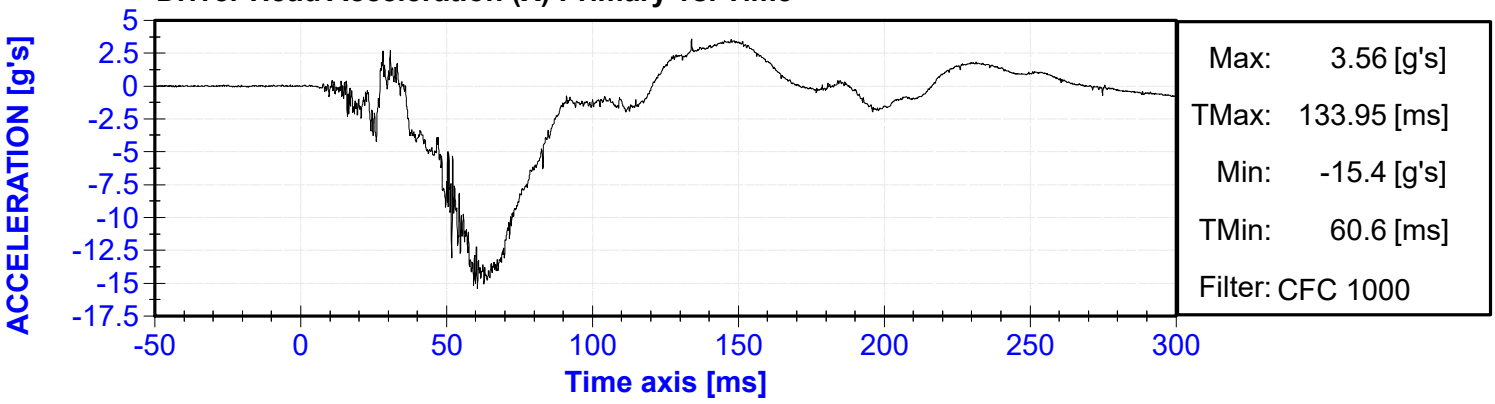

Driver Head Acceleration (Y) Primary vs. Time

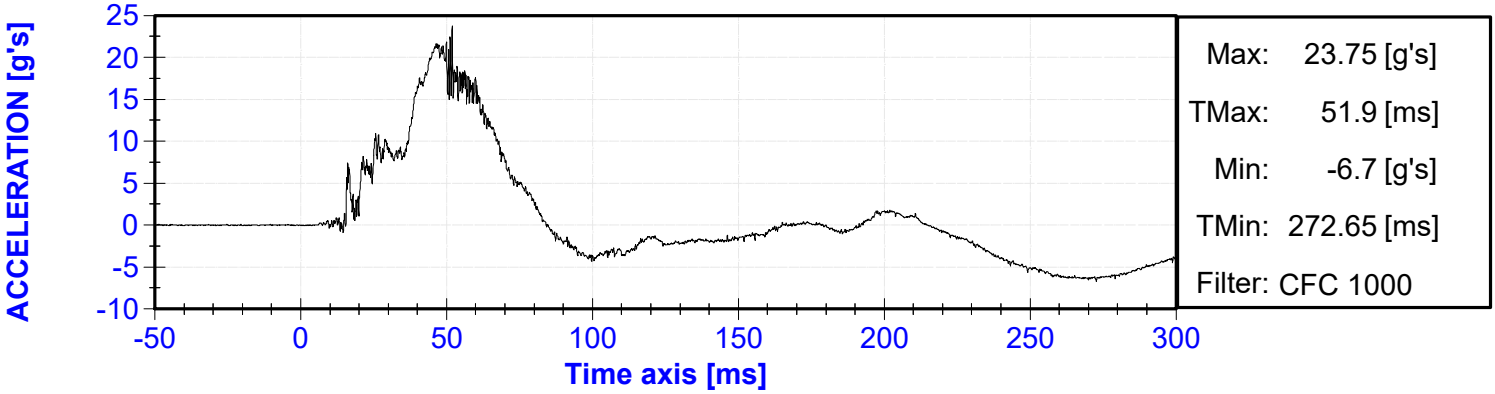

Driver Head Acceleration (Z) Primary vs. Time

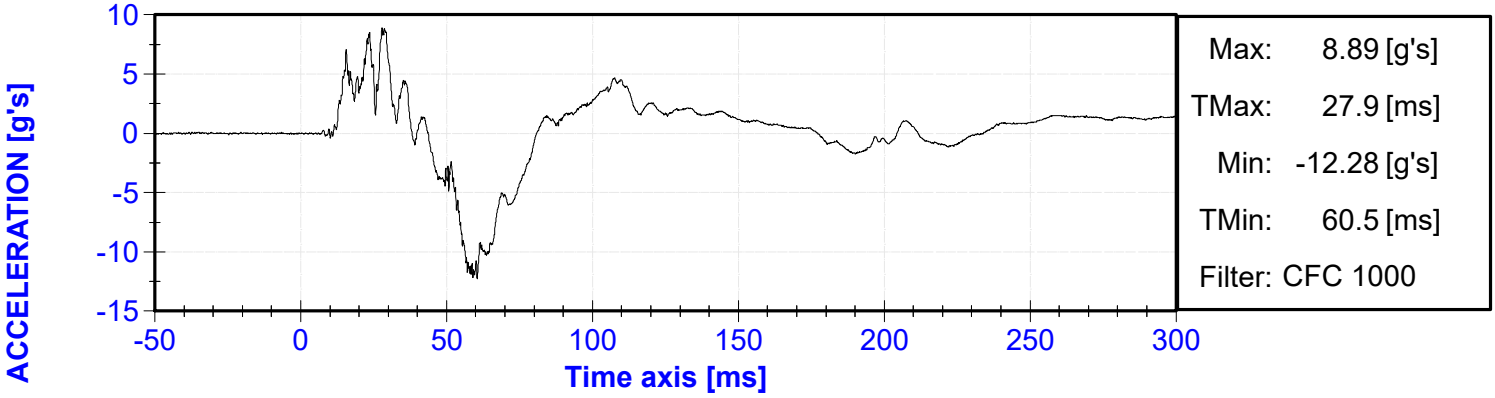

Driver Head Resultant Acceleration Primary vs. Time

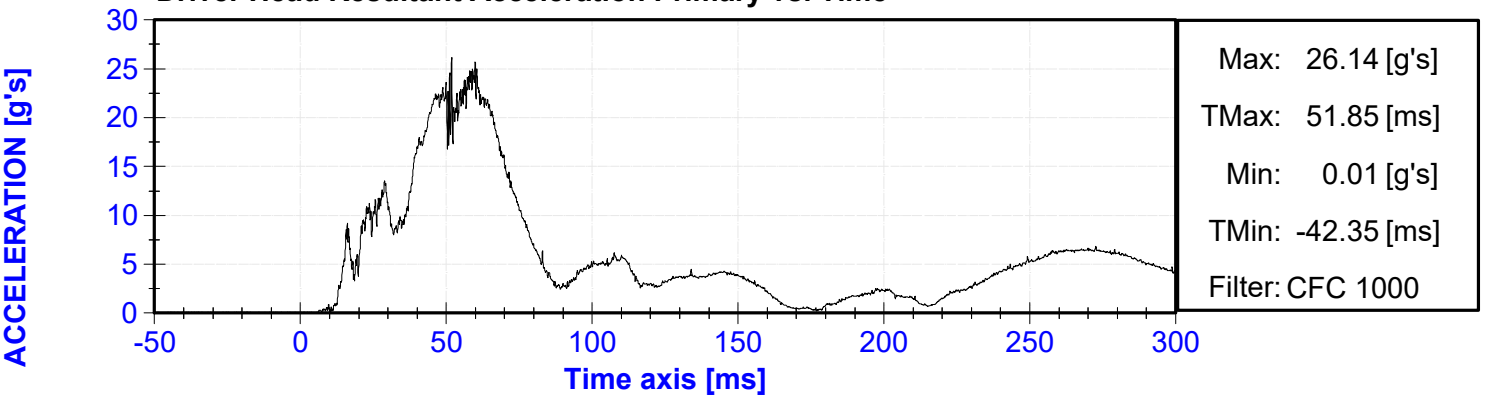

Driver Upper Thorax Rib Deflection (Y) vs. Time

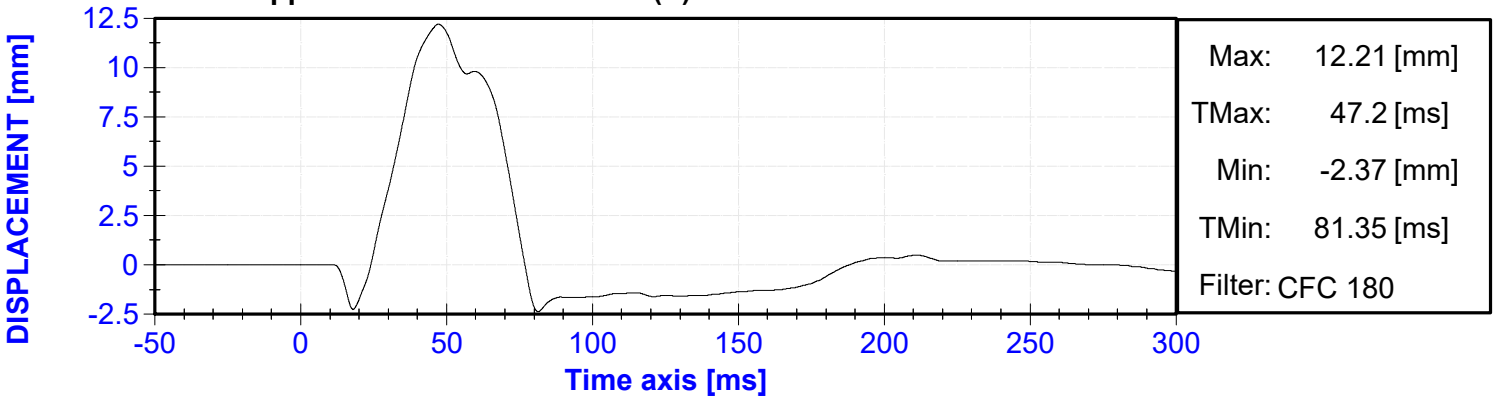

Driver Middle Thorax Rib Deflection (Y) vs. Time

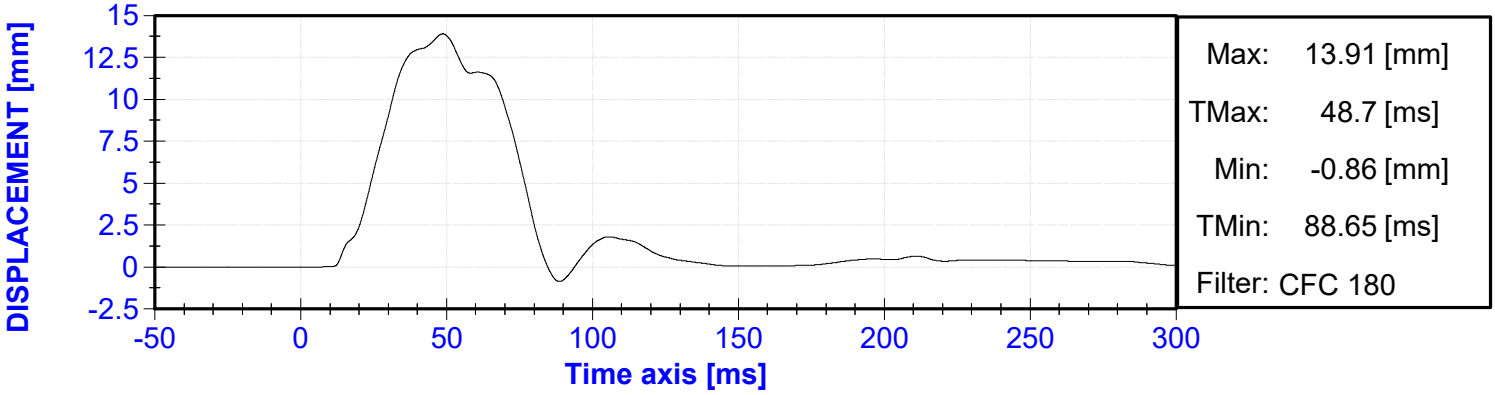

Driver Lower Thorax Rib Deflection (Y) vs. Time

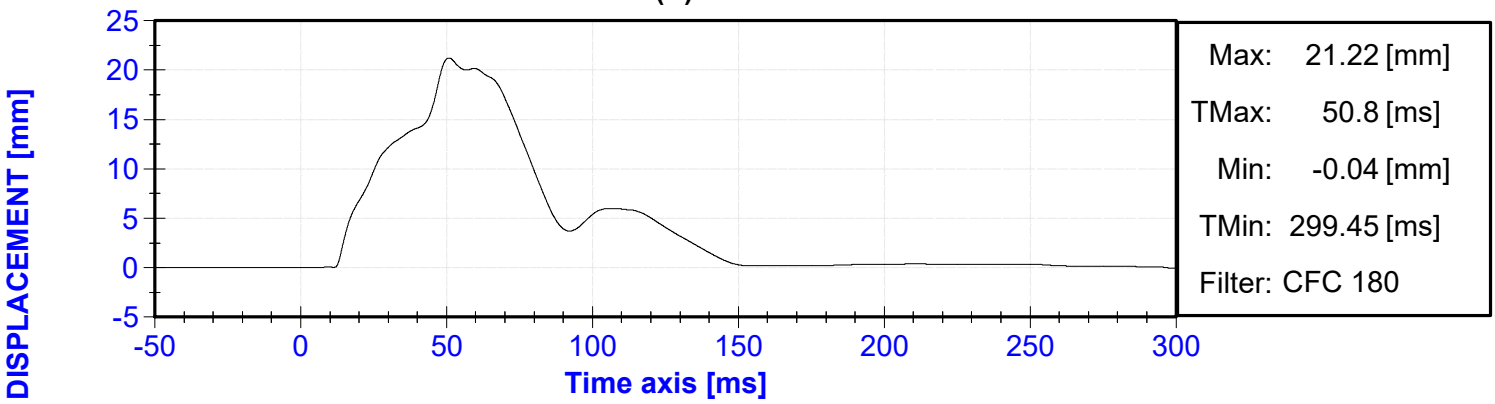

Driver Thorax Rib Deflection Maximum vs. Time

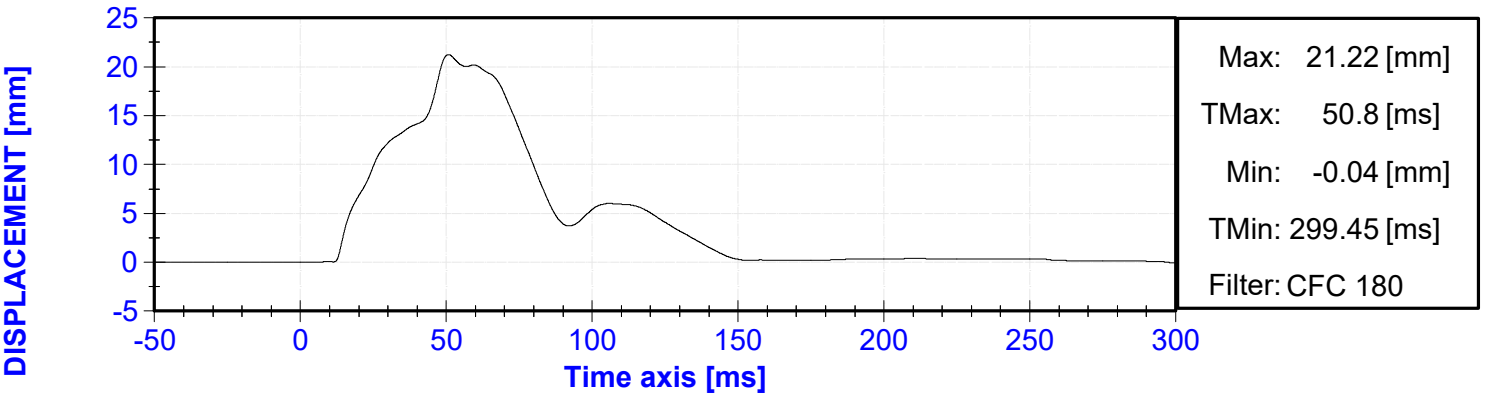

Driver Anterior Abdominal Force (Y) vs. Time

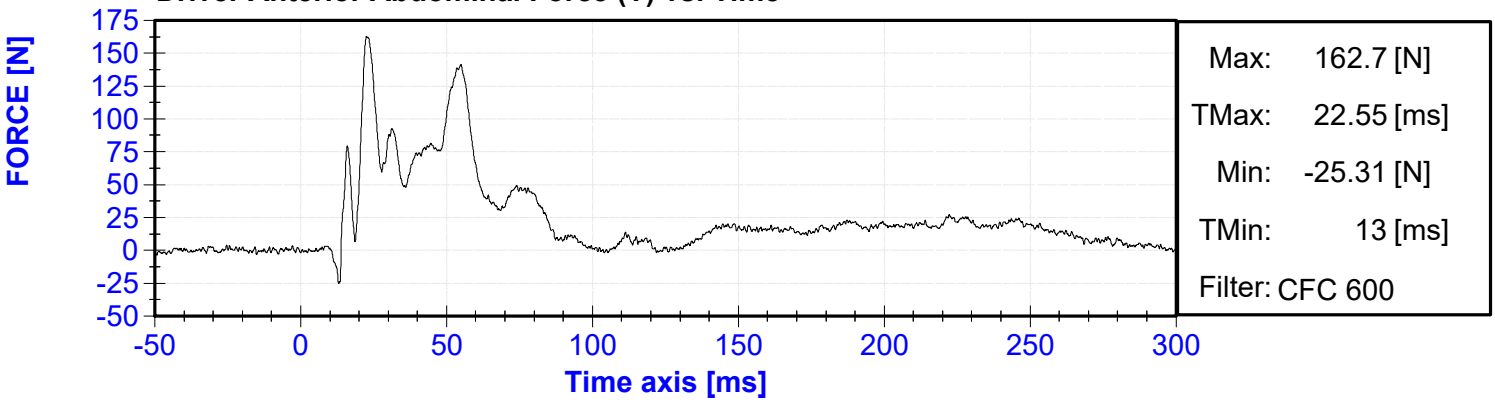

Driver Middle Abdominal Force (Y) vs. Time

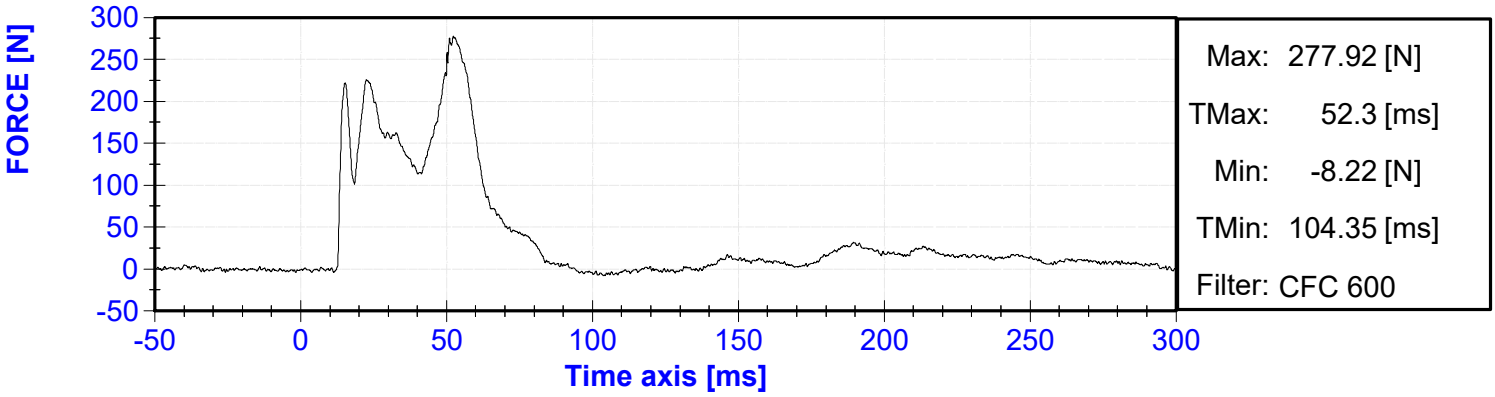

Driver Posterior Abdominal Force (Y) vs. Time

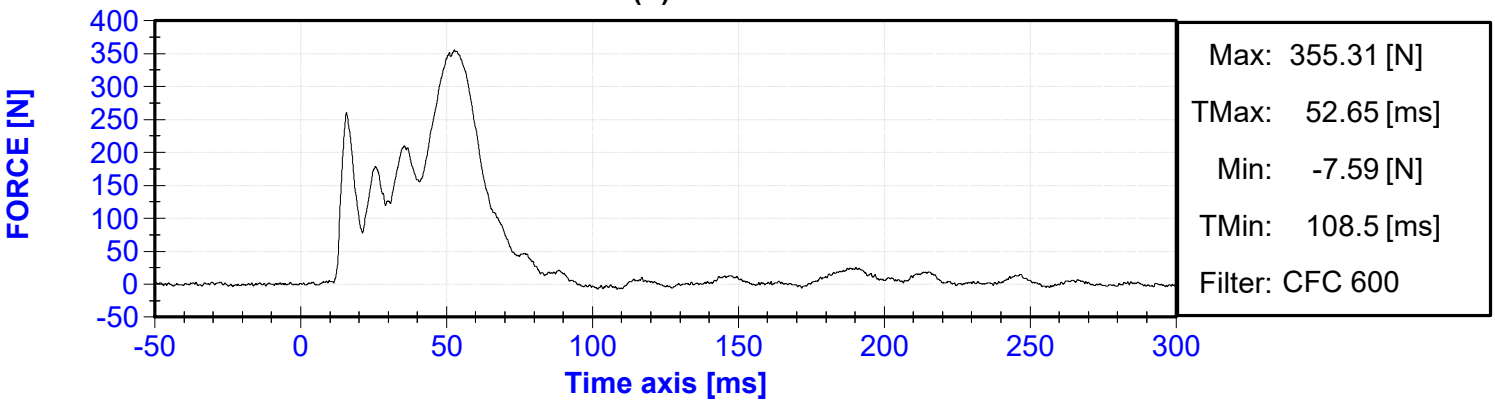

Driver Total Abdominal Force (Y) vs. Time

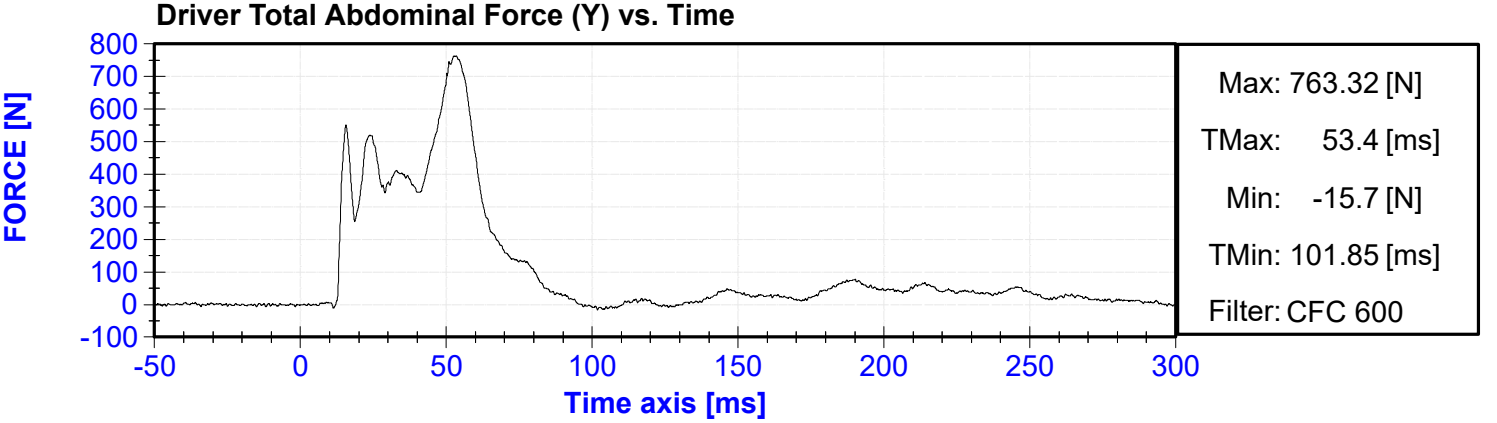

Driver Pubic Symphysis Force (Y) vs. Time

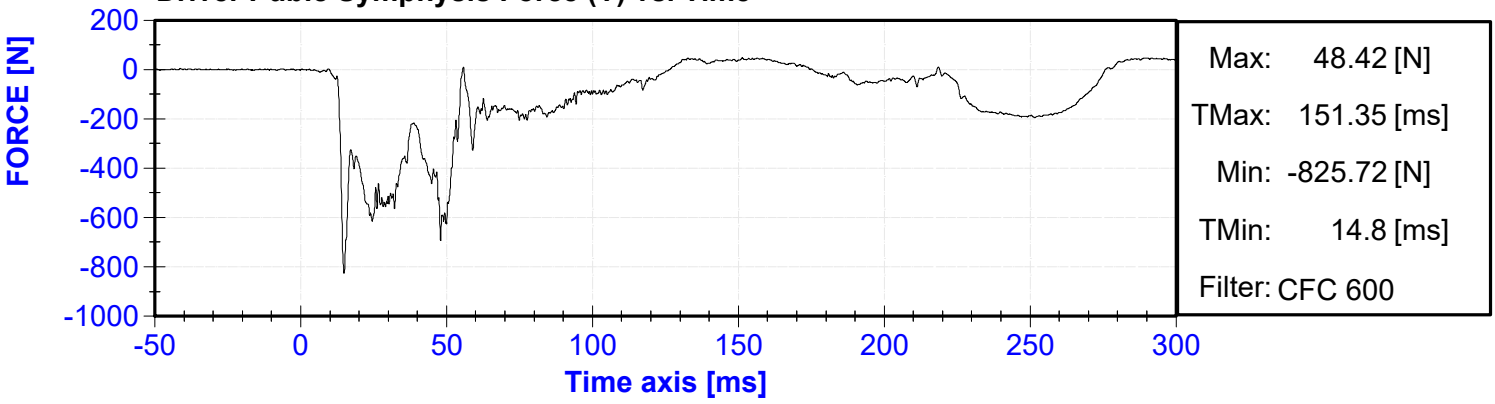

Passenger Head Acceleration (X) vs. Time Primary

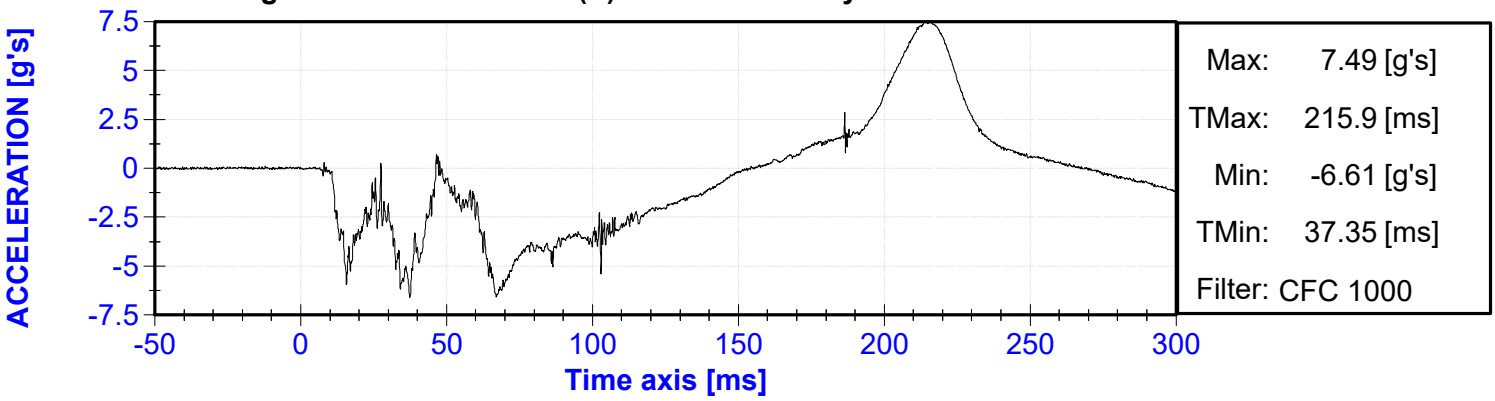

Passenger Head Acceleration (Y) vs. Time Primary

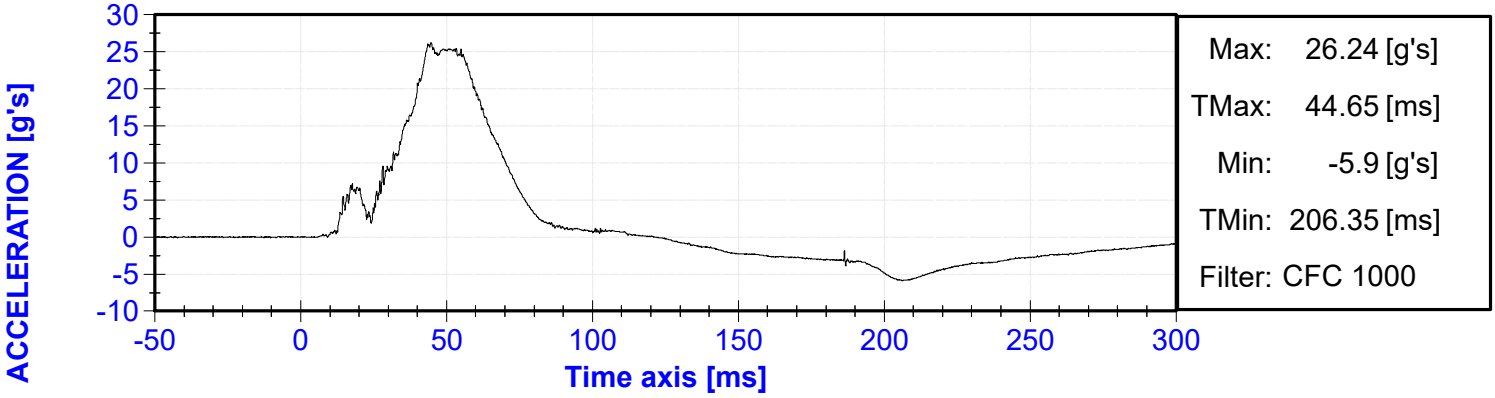

Passenger Head Acceleration (Z) vs. Time Primary

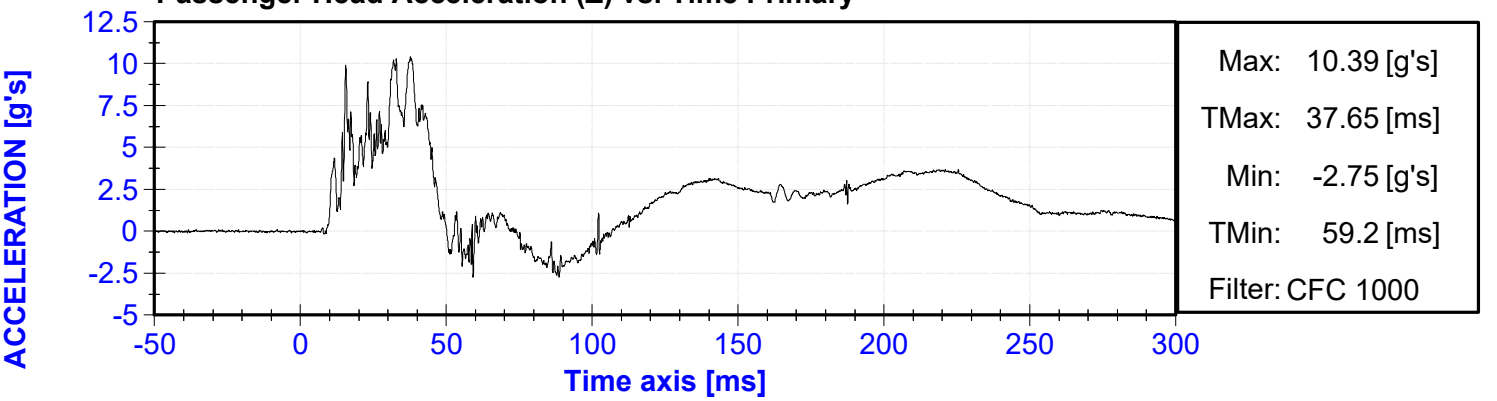

Passenger Head Resultant Acceleration Primary vs. Time

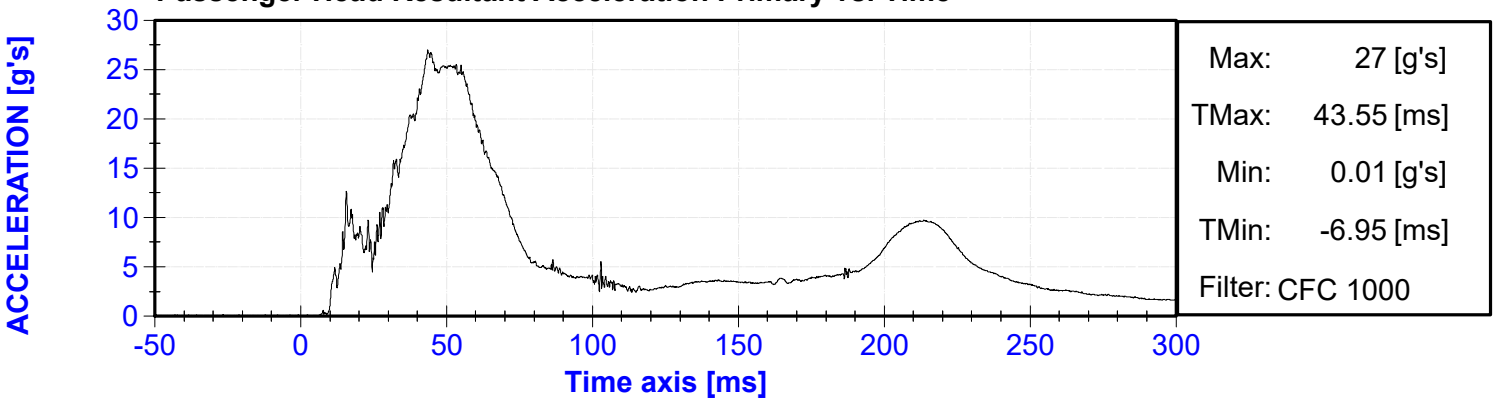

Passenger Lower Spine T12 Acceleration (X) vs. Time

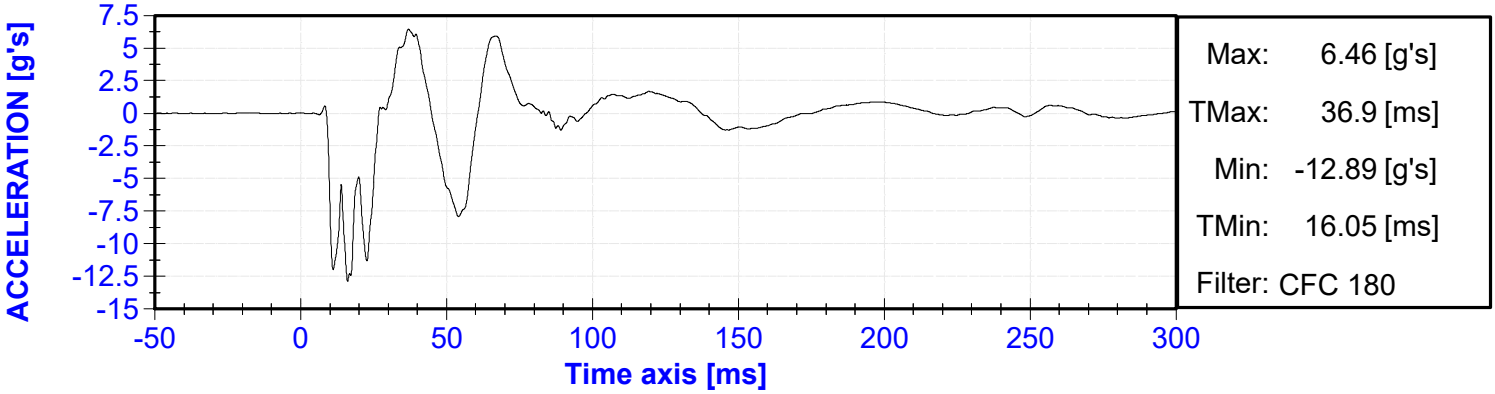

Passenger Lower Spine T12 Acceleration (Y) vs. Time

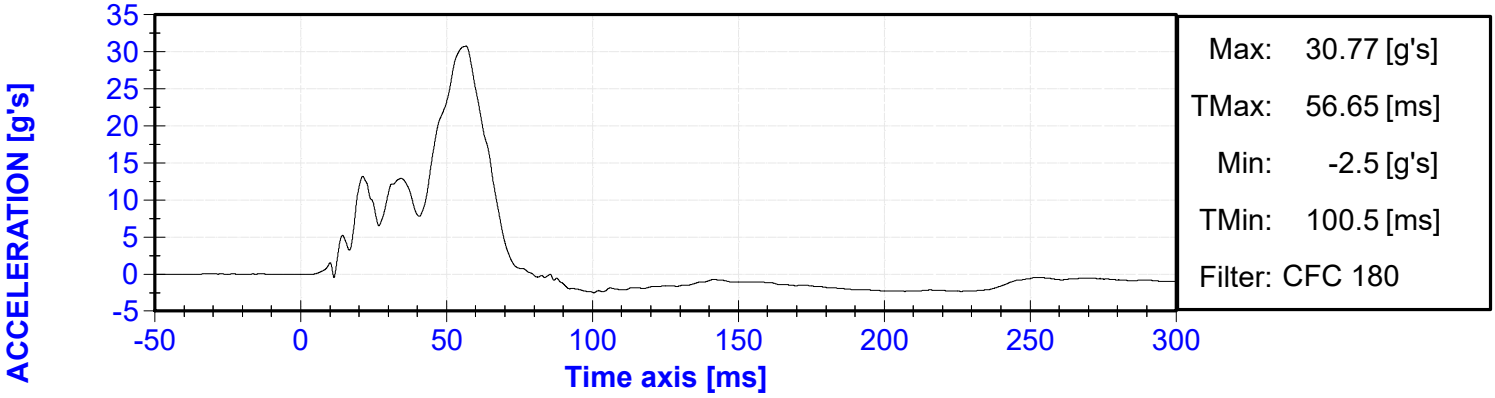

Passenger Lower Spine T12 Acceleration (Z) vs. Time

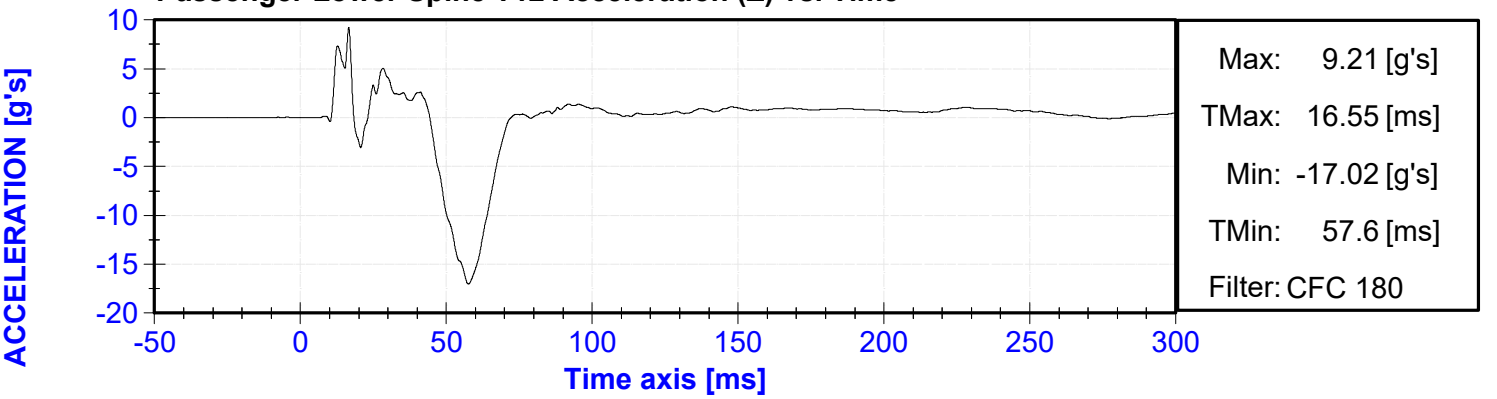

Passenger Lower Spine T12 Resultant Acceleration vs. Time

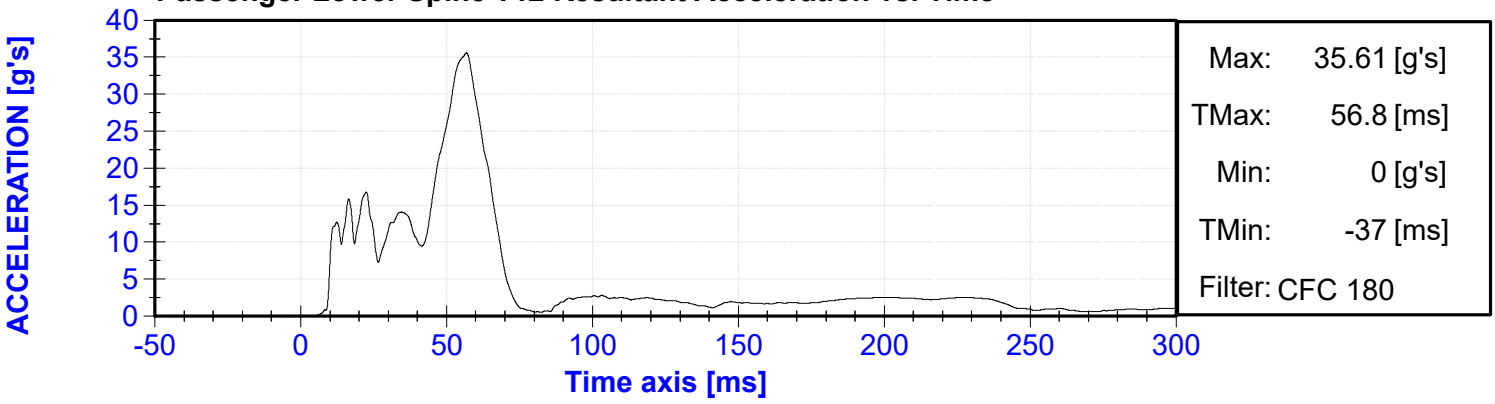

Passenger Iliac Force on Impact Side (Y) vs. Time

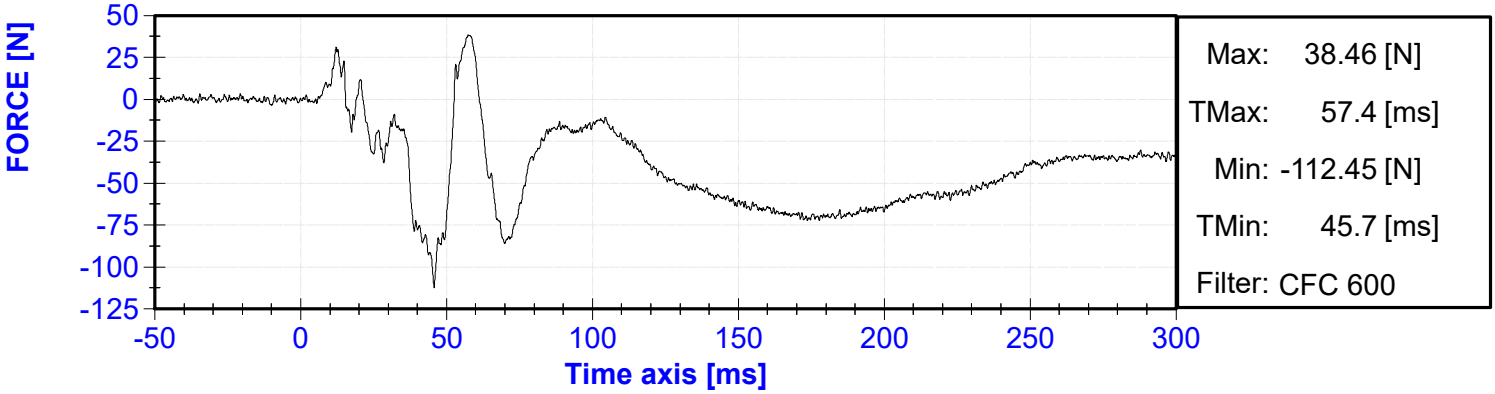

Passenger Acetabulum Force on Impact Side (Y) vs. Time

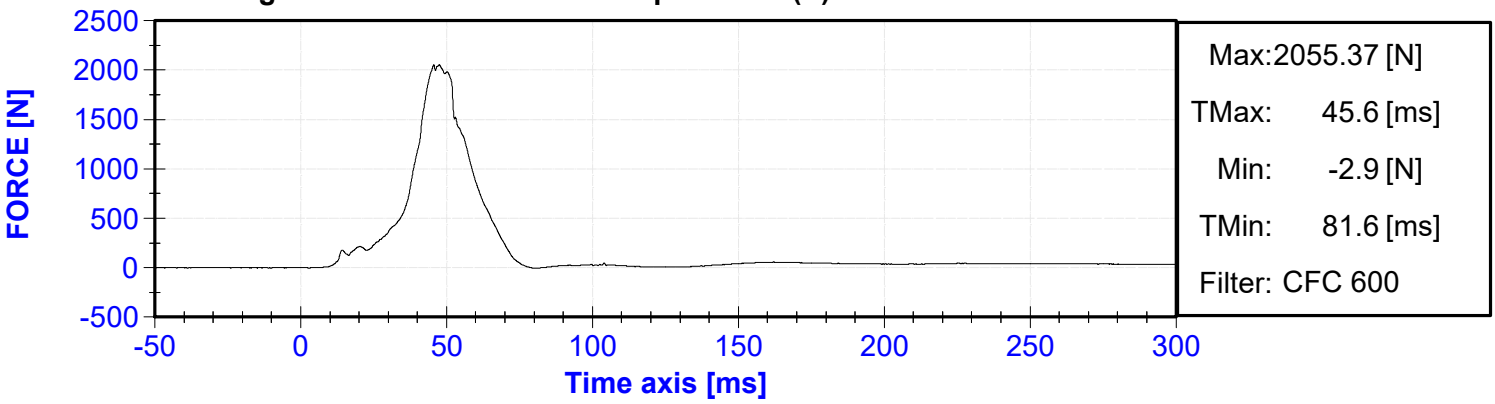

Passenger Total Pelvic Force on Impact Side (Y) vs. Time

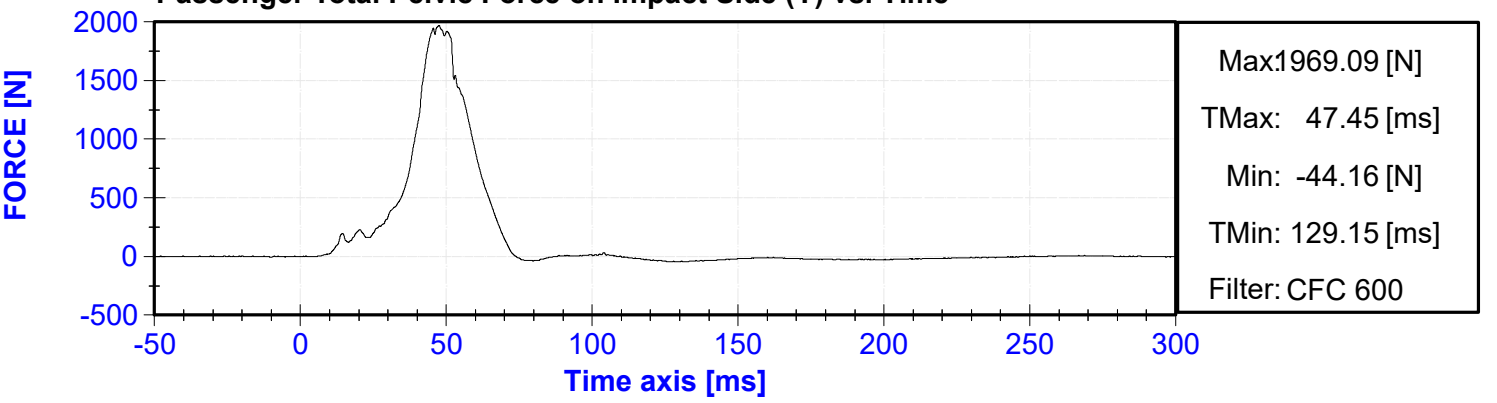

APPENDIX C

DUMMY CONFIGURATION AND PERFORMANCE VERIFICATION DATA

CALIBRATION TEST RESULTS

PRE-TEST

EUROSID 2 (ES-2RE) MALE – DRIVER ATD

SERIAL NO:F033

(CONFIGURED FOR LEFT SIDE IMPACT)

External Measurements - EuroSID-2re

Technician: K. Brogan Date: 12/06/2023

Dummy Serial Number: F033

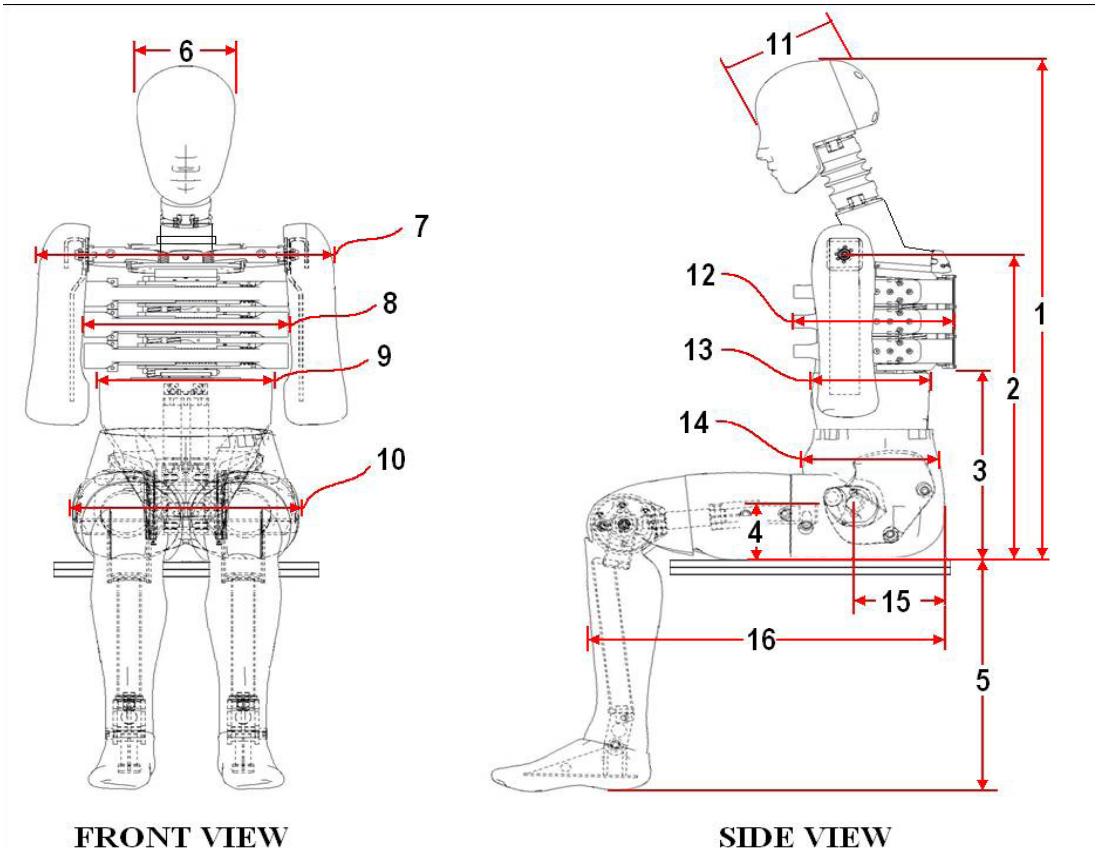

FRONT VIEW SIDE VIEW

Dim. No.	Description	Specification (mm)		Result (mm)	Pass/Fail
1	Sitting Height	900	918	915	Pass
2	Seat to Shoulder Joint	558	572	567	Pass
3	Seat to Lower Face of Thoracic Spine Box	346	356	352	Pass
4	Seat to Hip Joint (center of bolt)	97	103	99	Pass
5	Sole to Seat, Sitting	333	451	425	Pass
6	Head Width	152	158	156	Pass
7	Shoulder/Arm Width	461	479	471	Pass
8	Thorax Width	322	332	329	Pass
9	Abdomen Width	273	287	281	Pass
10	Pelvis Lap Width	359	373	369	Pass
11	Head Depth	196	206	200	Pass
12	Thorax Depth	262	272	266	Pass
13	Abdomen Depth	194	204	201	Pass
14	Pelvis Depth	235	245	240	Pass
15	Back of Buttocks to Hip Joint (center of bolt)	150	160	155	Pass
16	Back of Buttocks to Front Knee	597	615	609	Pass

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.5	Pass
Humidity	10	70	%	48	Pass
Resultant Acceleration	125	155	g's	151.5	Pass
Oscillation	0	15	%	6.98	Pass
Fore-Aft Acceleration	-15	15	g's	10.2	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
X Accelerometer	Measurement Specialties	MS26716	8/29/2023	2/25/2024
Y Accelerometer	Measurement Specialties	MS26106	10/10/2023	4/7/2024
Z Accelerometer	Measurement Specialties	A255567	8/29/2023	2/25/2024

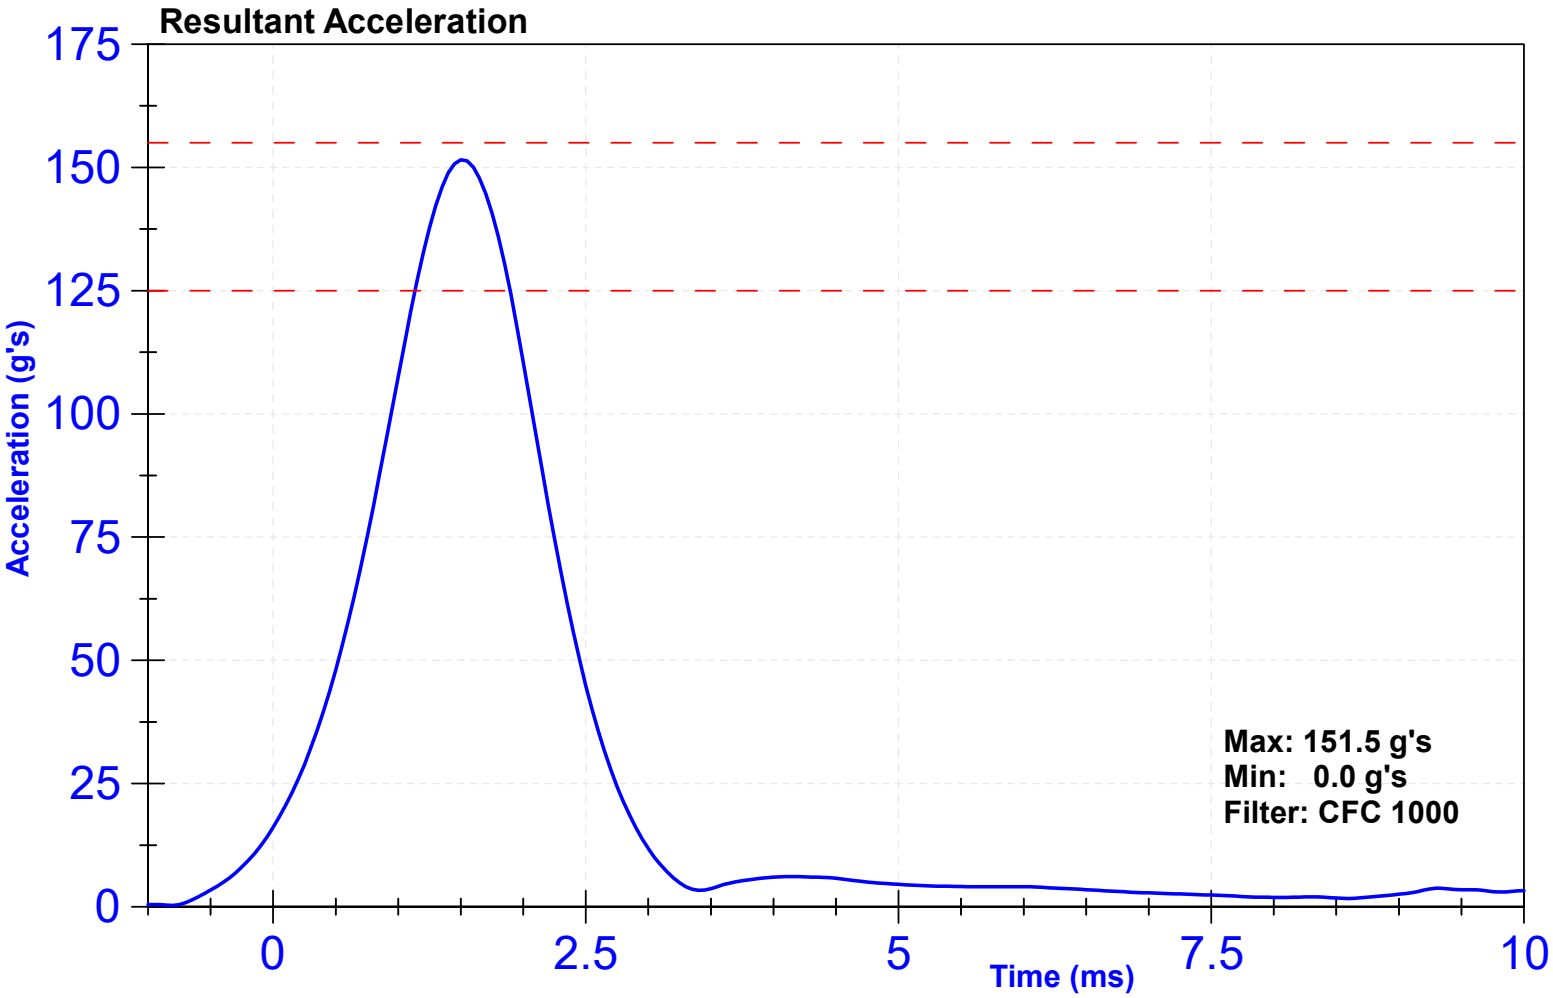

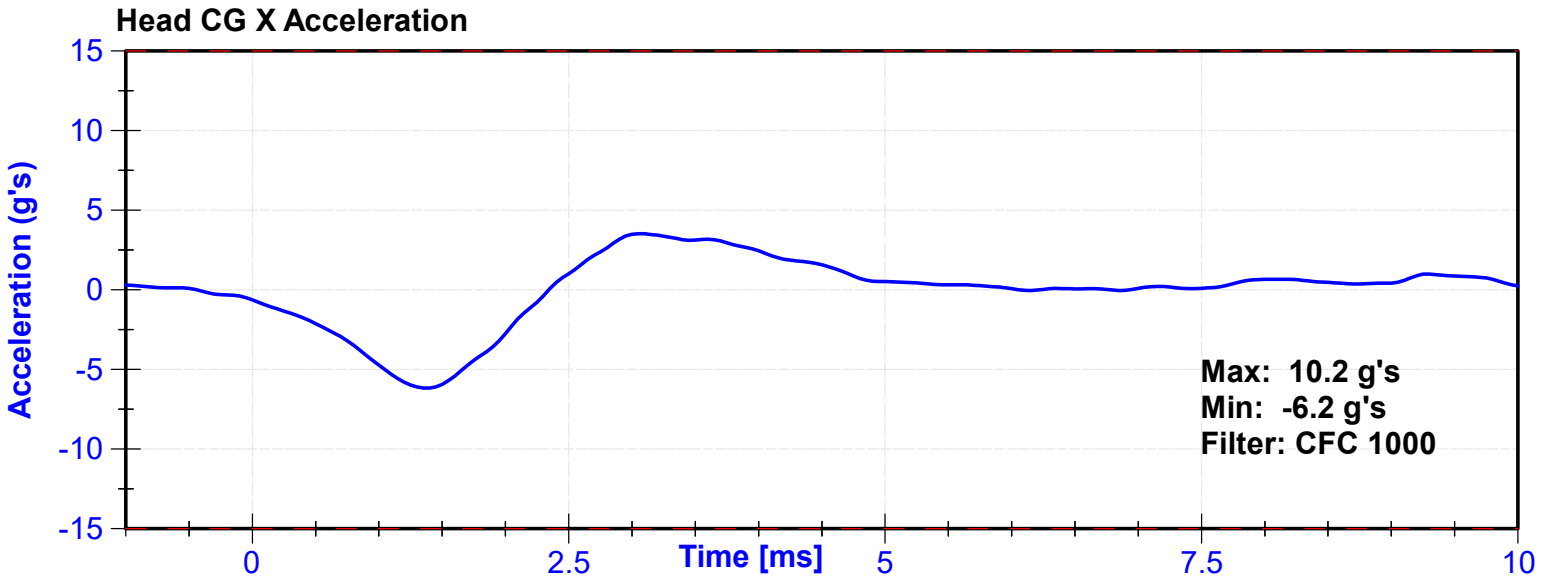
Head CG X Acceleration
Acceleration (g's)
15
10
5
0
-5
-10
-15
0
2.5
Time [ms]
5
7.5
10
Max: 10.2 g's
Min: -6.2 g's
Filter: CFC 1000

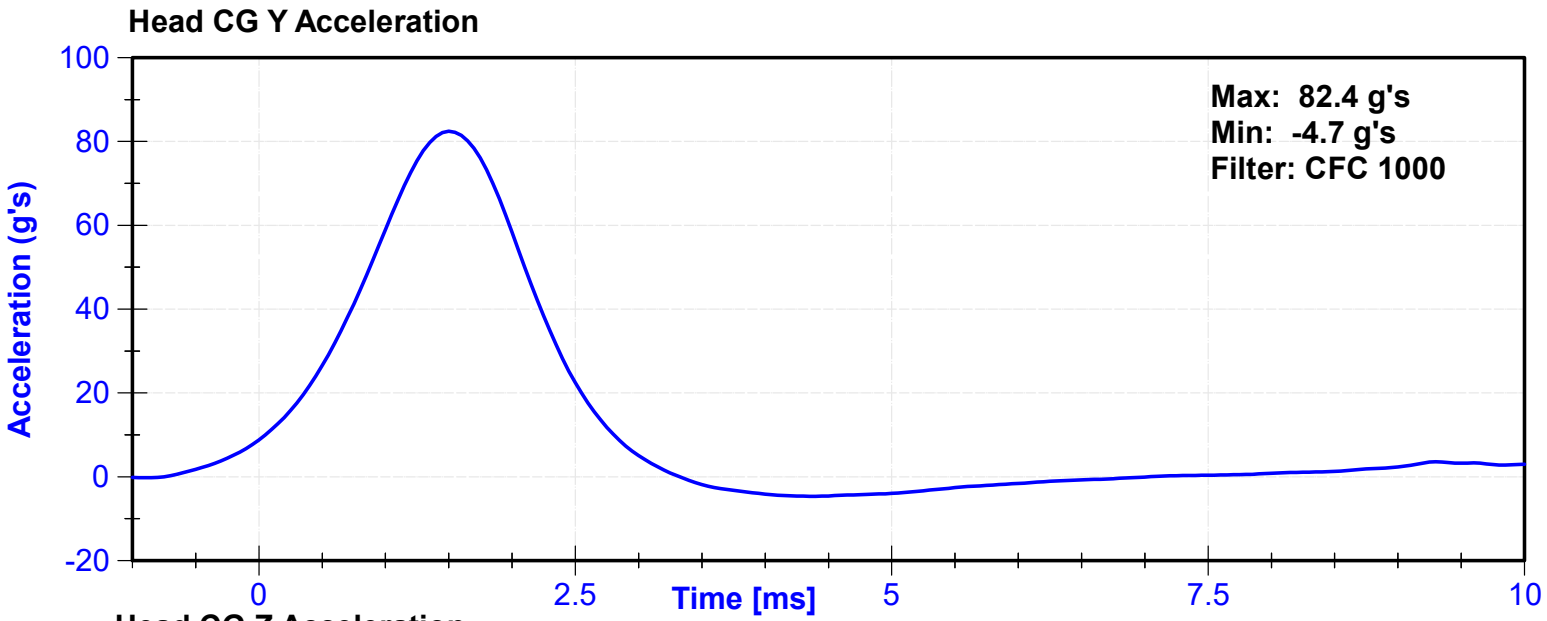
Head CG Y Acceleration
Acceleration (g's)
100
80
60
40
20
0
-20
0
2.5
Time [ms]
5
7.5
10
Max: 82.4 g's
Min: -4.7 g's
Filter: CFC 1000

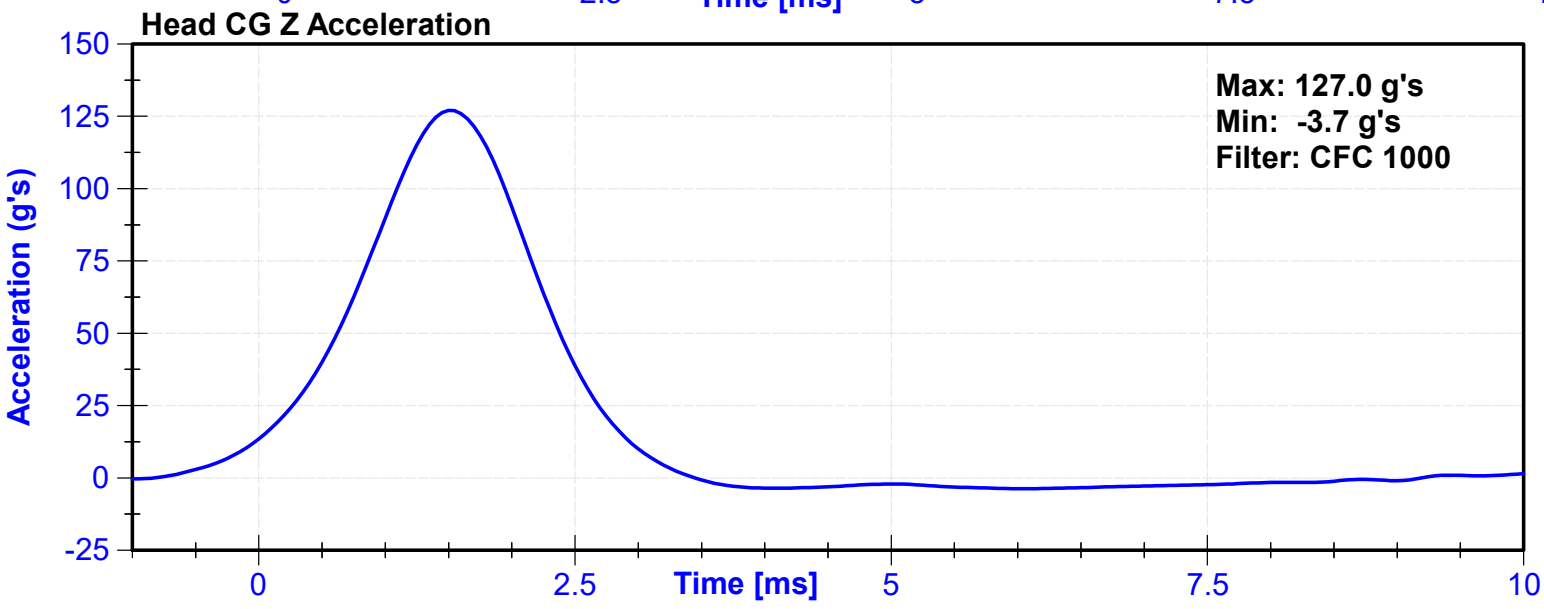
Head CG Z Acceleration
Acceleration (g's)
150
125
100
75
50
25
0
-25
0
2.5
Time [ms]
5
7.5
10
Max: 127.0 g's
Min: -3.7 g's
Filter: CFC 1000

ATD Manufacturer	FTSS	Test Technician	C. Mantell
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	34	Pass
Velocity	3.3	3.5	m/s	3.33	Pass
Lateral Neck Rotation	49	59	deg	53.0	Pass
Time at Maximum Rotation	54	66	ms	55.3	Pass
Time of Rotation Decay from Maximum	53	88	ms	56.8	Pass
Pendulum Velocity Overall Corridor	Lower Boundary[1]	Upper Boundary[2]	m/s	See Plot[3]	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	C16503	10/31/2023	4/28/2024
Front Pendulum Potentiometer	Sfernice	2247	12/5/2023	12/4/2024
Headform Potentiometer	Sfernice	095	9/29/2023	9/28/2024

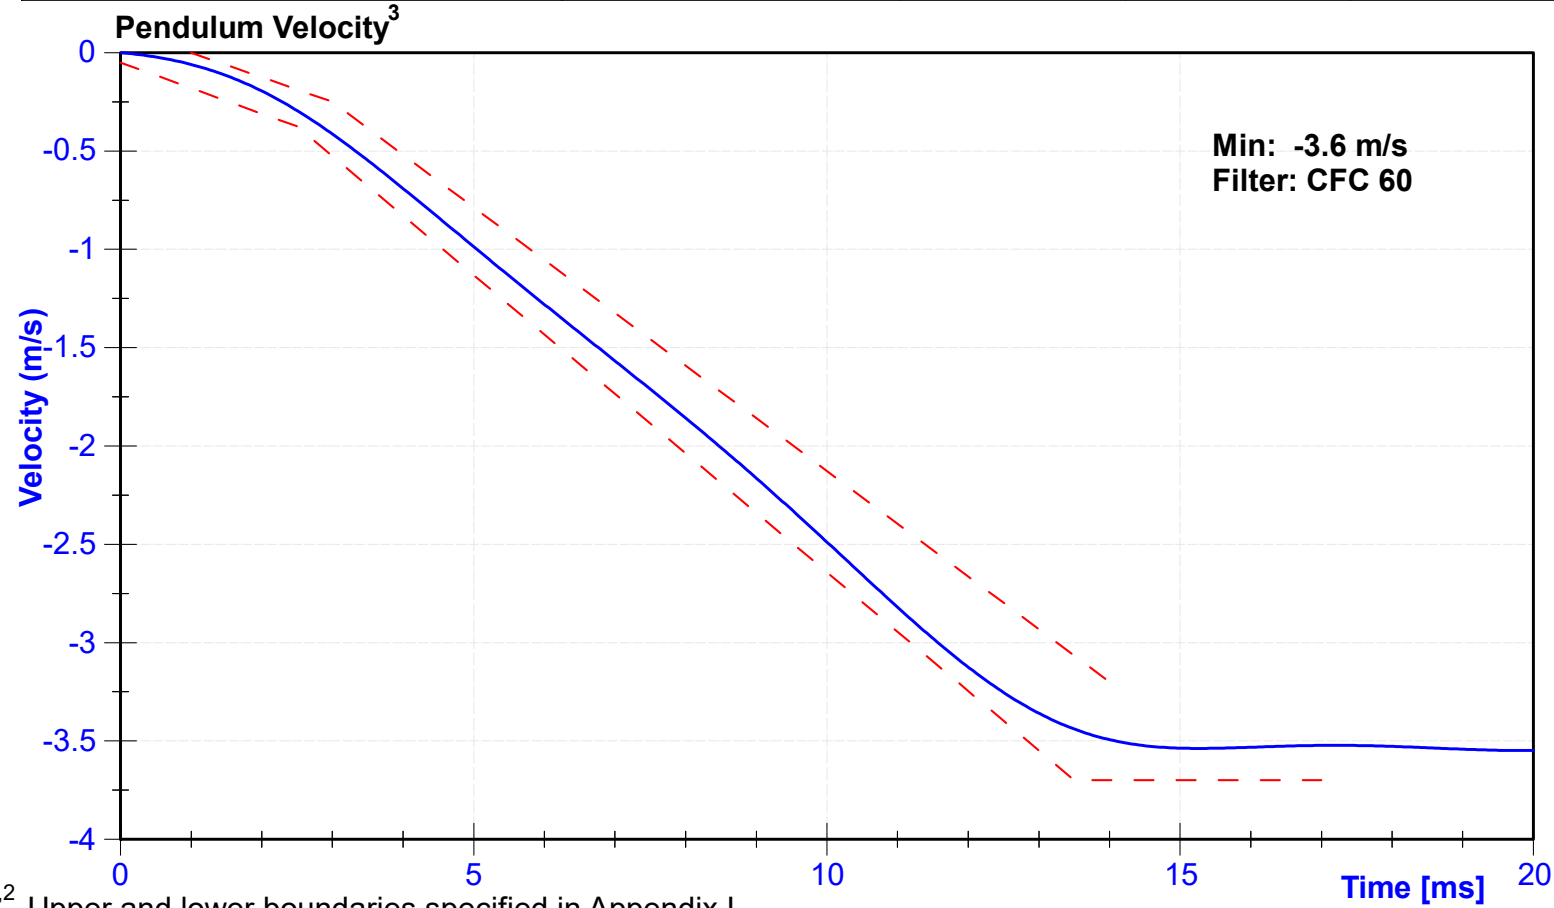

[1,2] Upper and lower boundaries specified in Appendix I

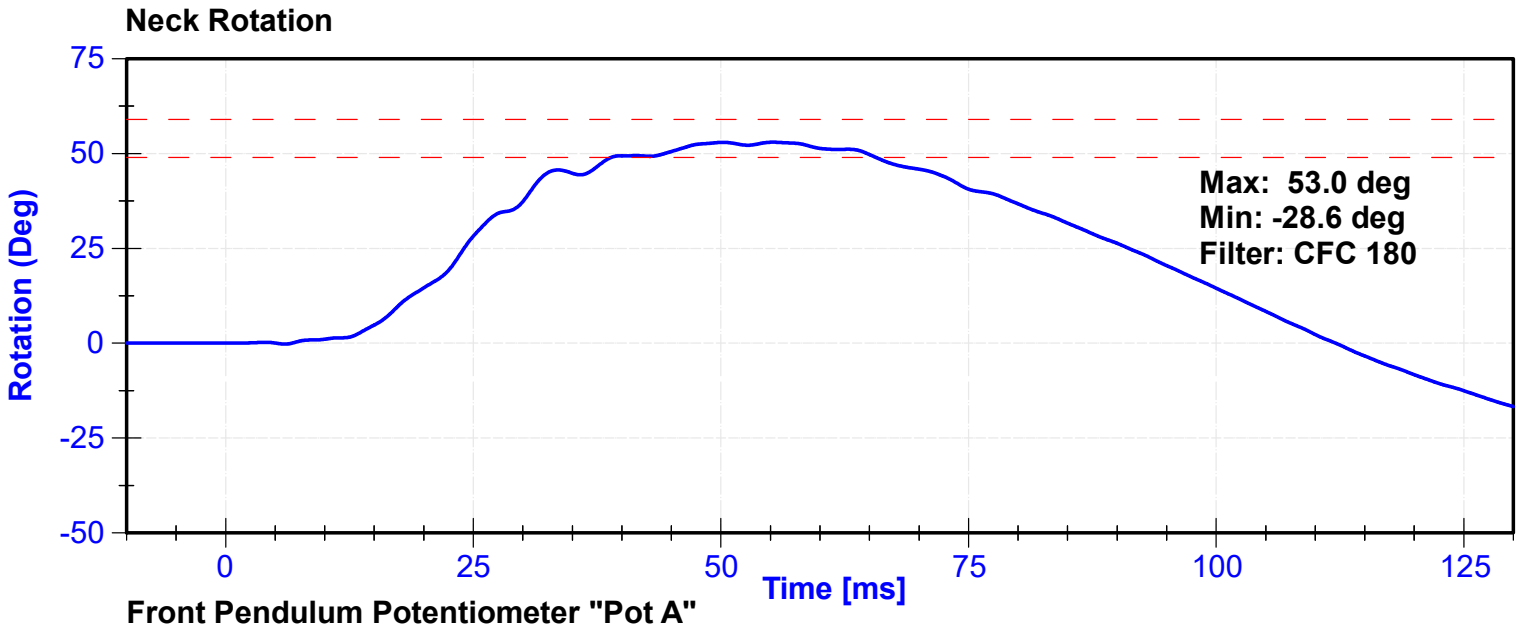
Neck Rotation
Rotation (Deg)
75
50
25
0
-25
-50
0
25
50
75
100
125
Time [ms]
Max: 53.0 deg
Min: -28.6 deg
Filter: CFC 180

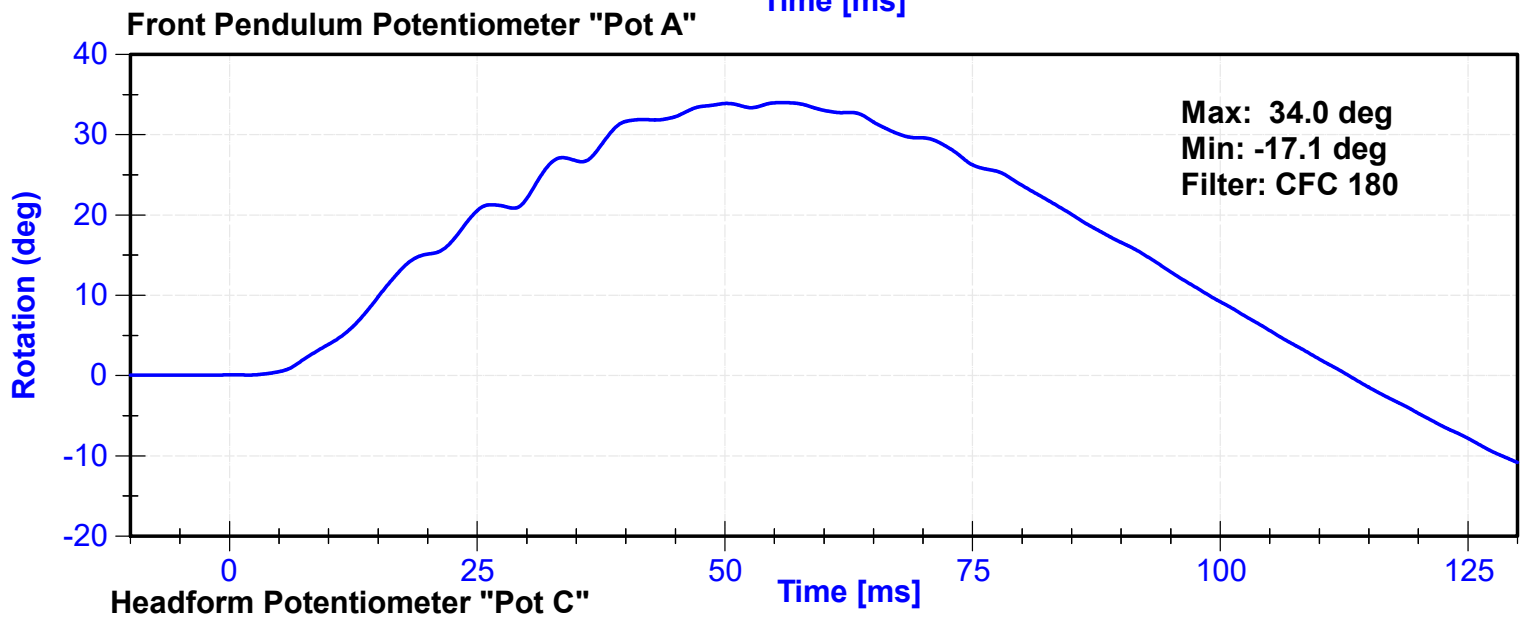
Front Pendulum Potentiometer "Pot A"
Rotation (deg)
40
30
20
10
0
-10
-20
0
25
50
75
100
125
Time [ms]
Max: 34.0 deg
Min: -17.1 deg
Filter: CFC 180

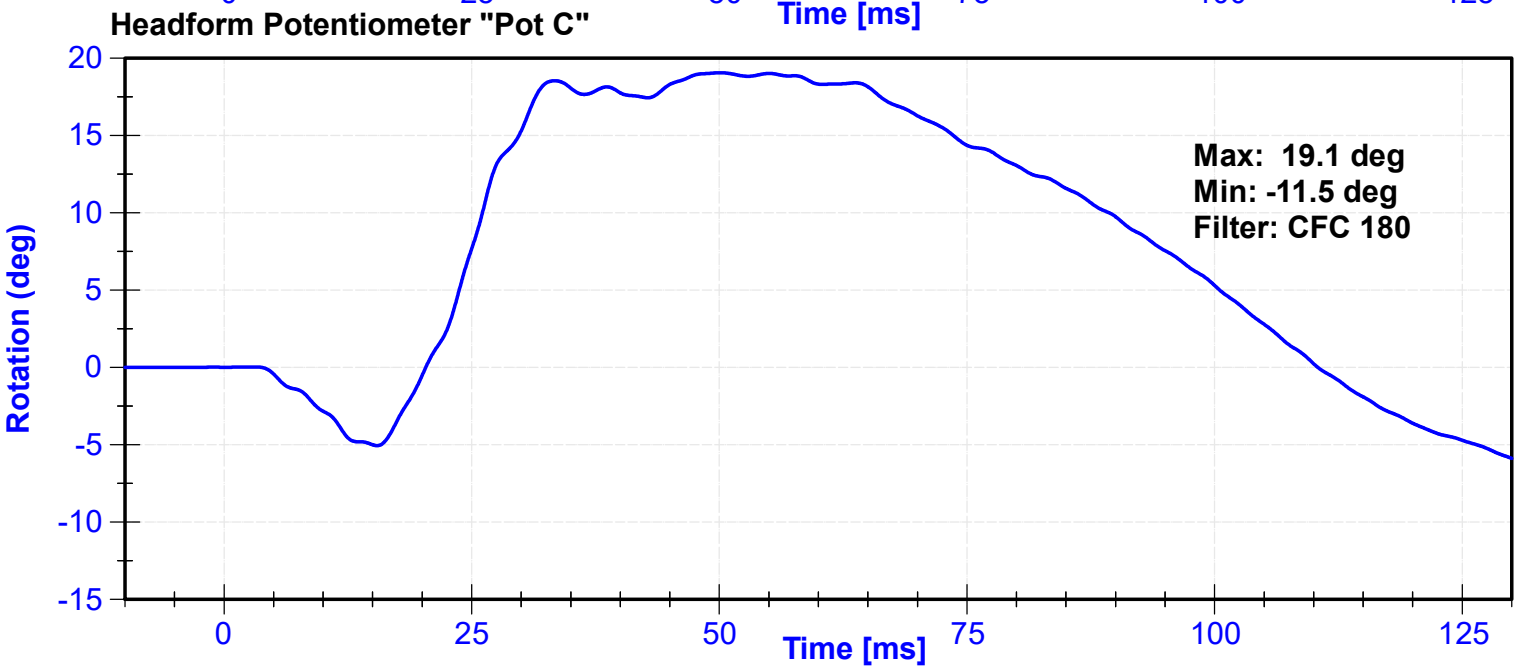
Headform Potentiometer "Pot C"
Rotation (deg)
20
15
10
5
0
-5
-10
-15
0
25
50
75
100
125
Time [ms]
Max: 19.1 deg
Min: -11.5 deg
Filter: CFC 180

Appendix I

[2] Upper Boundary Corridor		[1] Lower Boundary Corridor	
Time (ms)	Velocity (m/s)	Time (ms)	Velocity (m/s)
1.0	0.00	0.0	-0.05
3.0	-0.25	2.5	-0.375
14.0	-3.20	13.5	-3.7
		17.0	-3.7

ATD Manufacturer	FTSS	Test Technician	J.Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.2	Pass
Humidity	10	70	%	59.4	Pass
Velocity	4.2	4.4	m/s	4.30	Pass
Probe Acceleration	7.5	10.5	g's	10.21	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18587	11/20/2023	5/18/2024

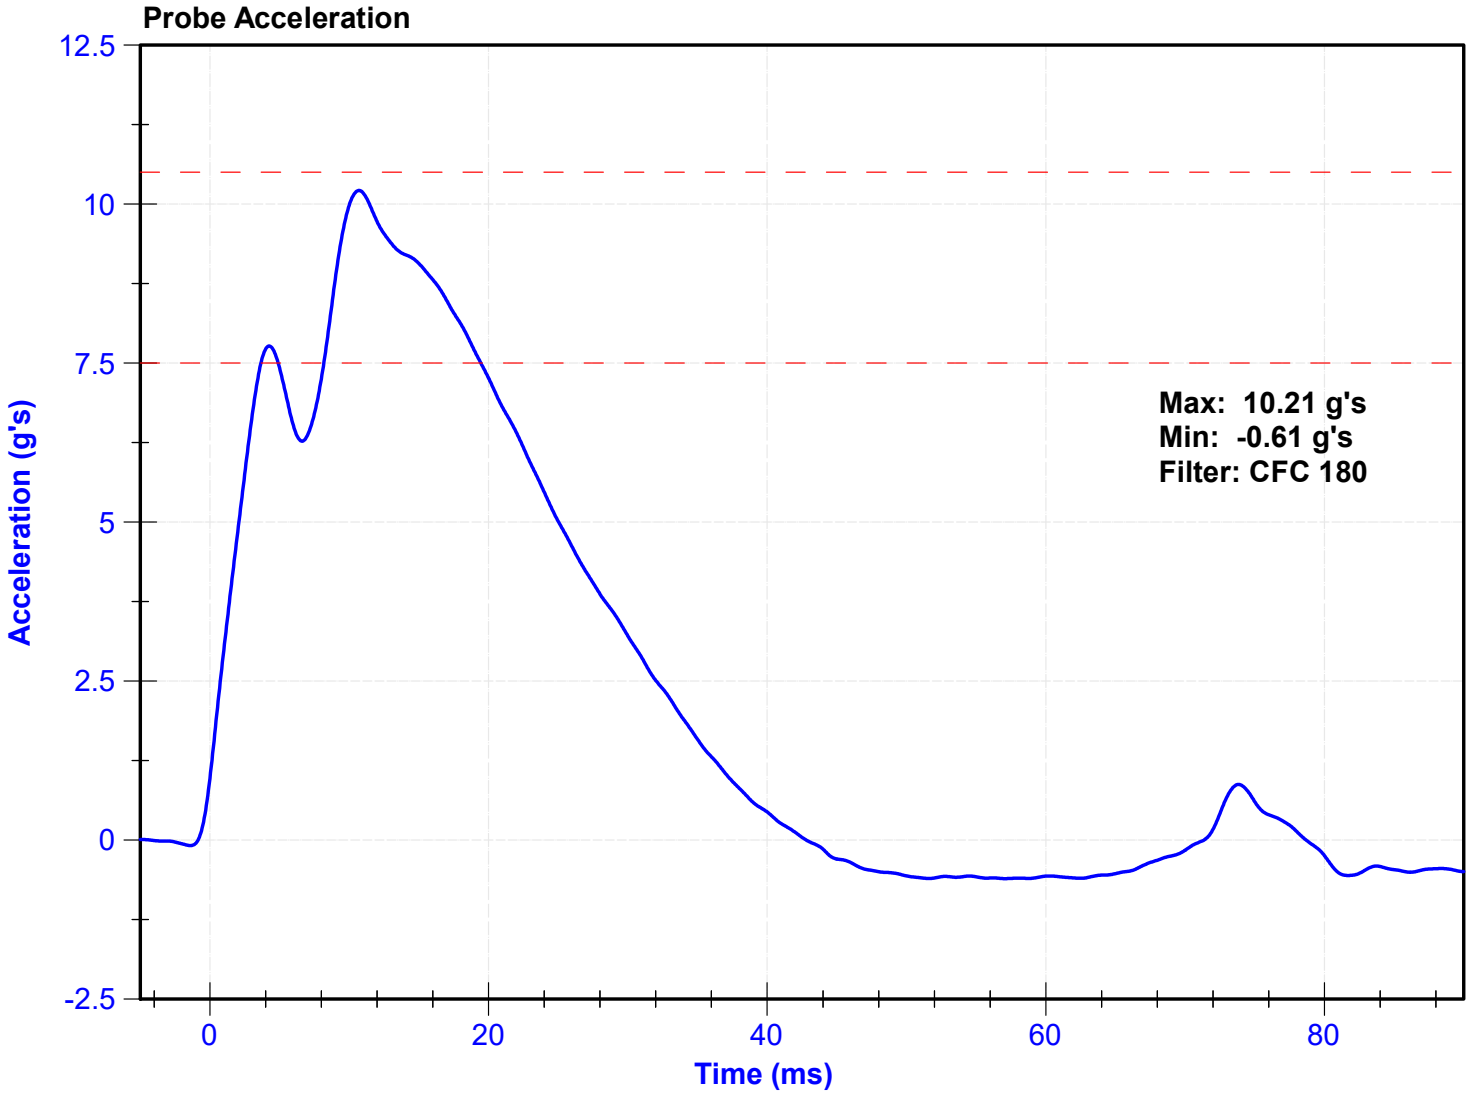

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	46	51	mm	48.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024

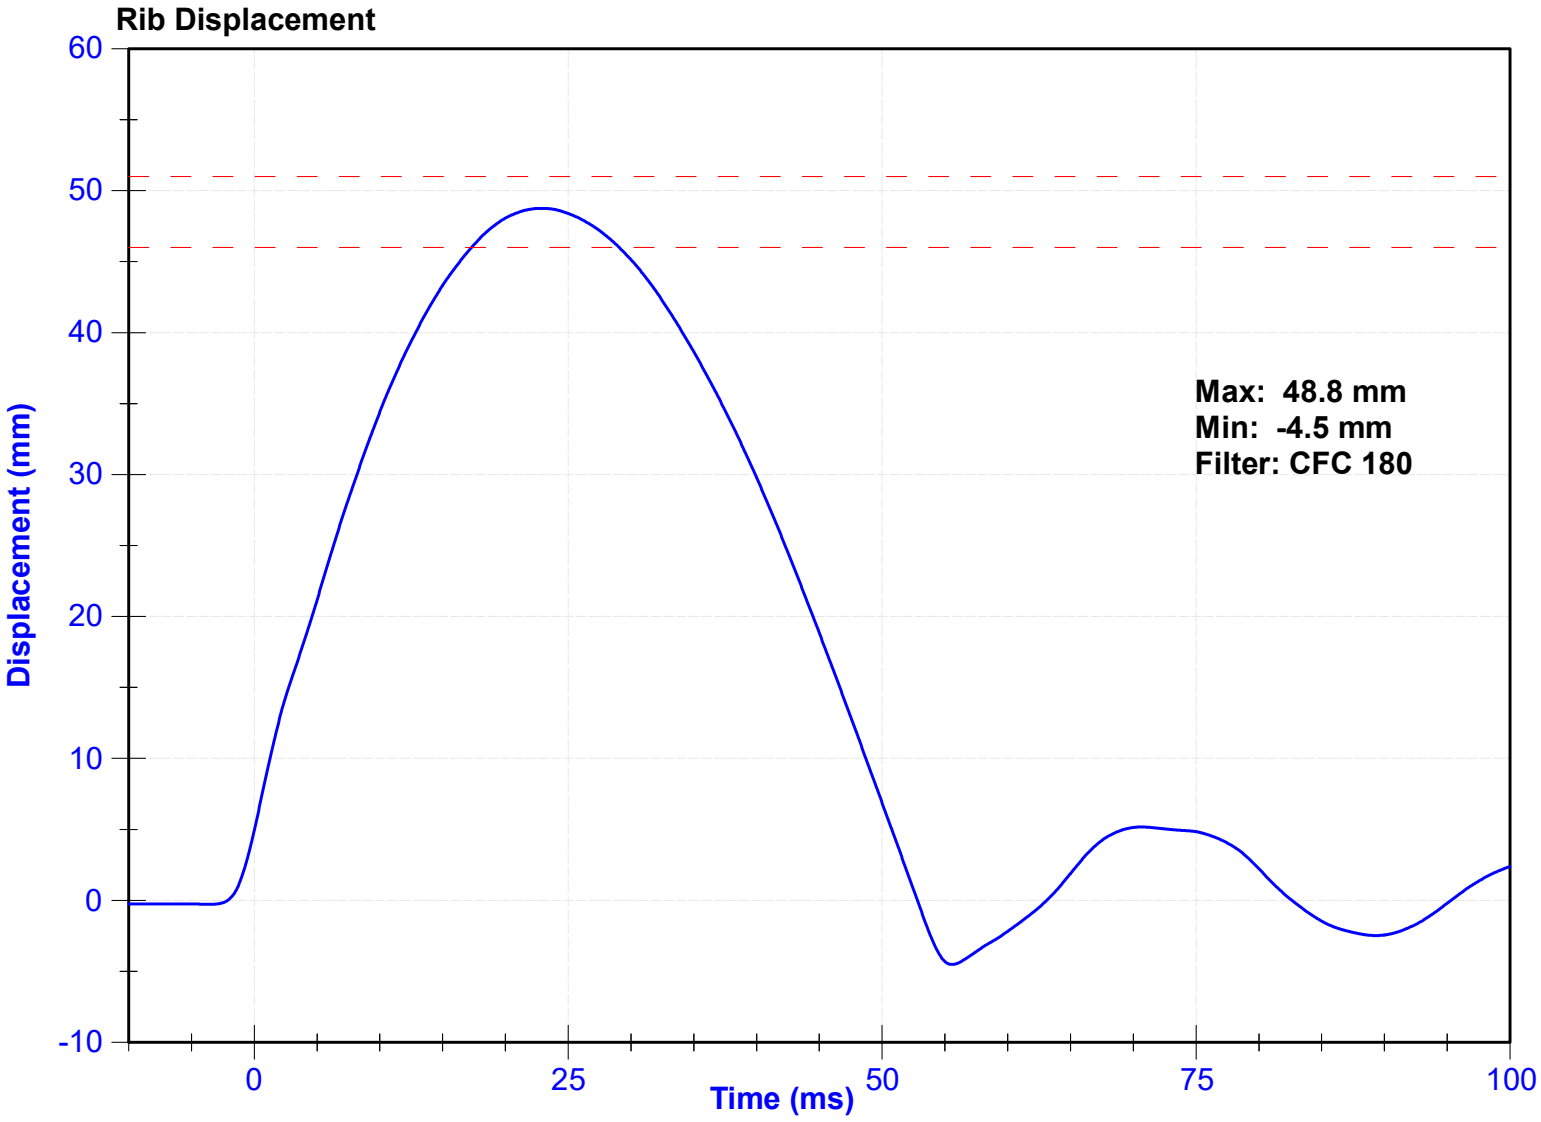

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	36	40	mm	37.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024

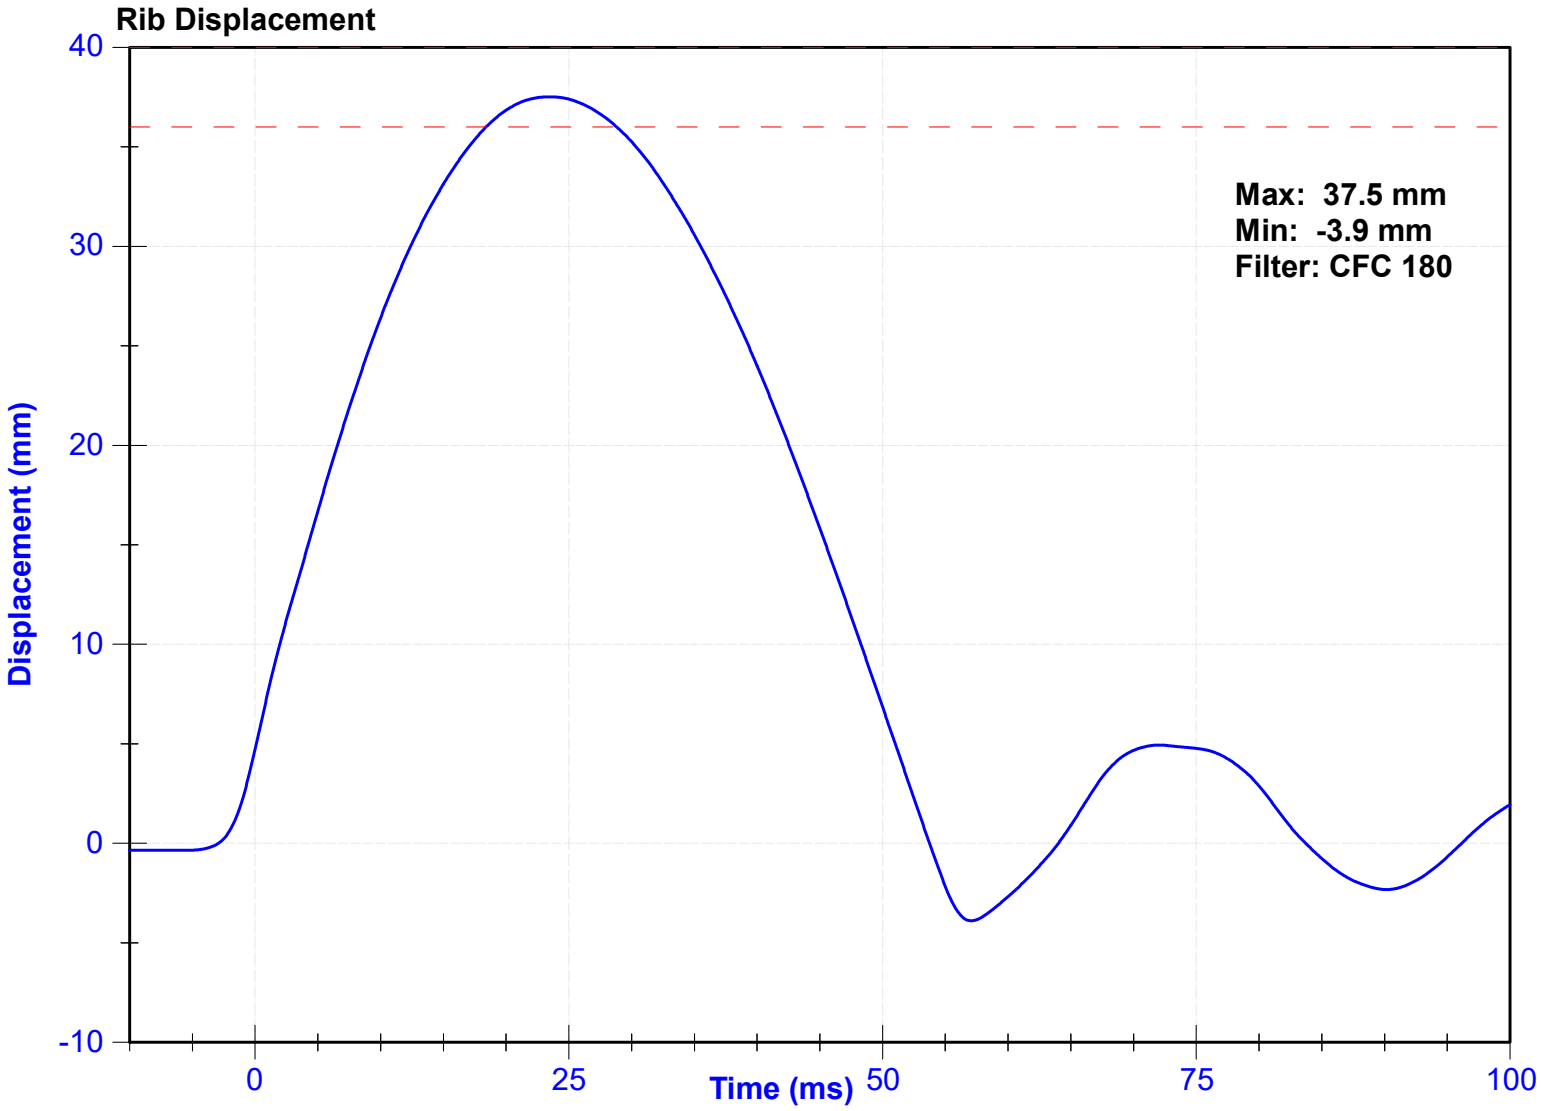

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	46	51	mm	48.6	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024

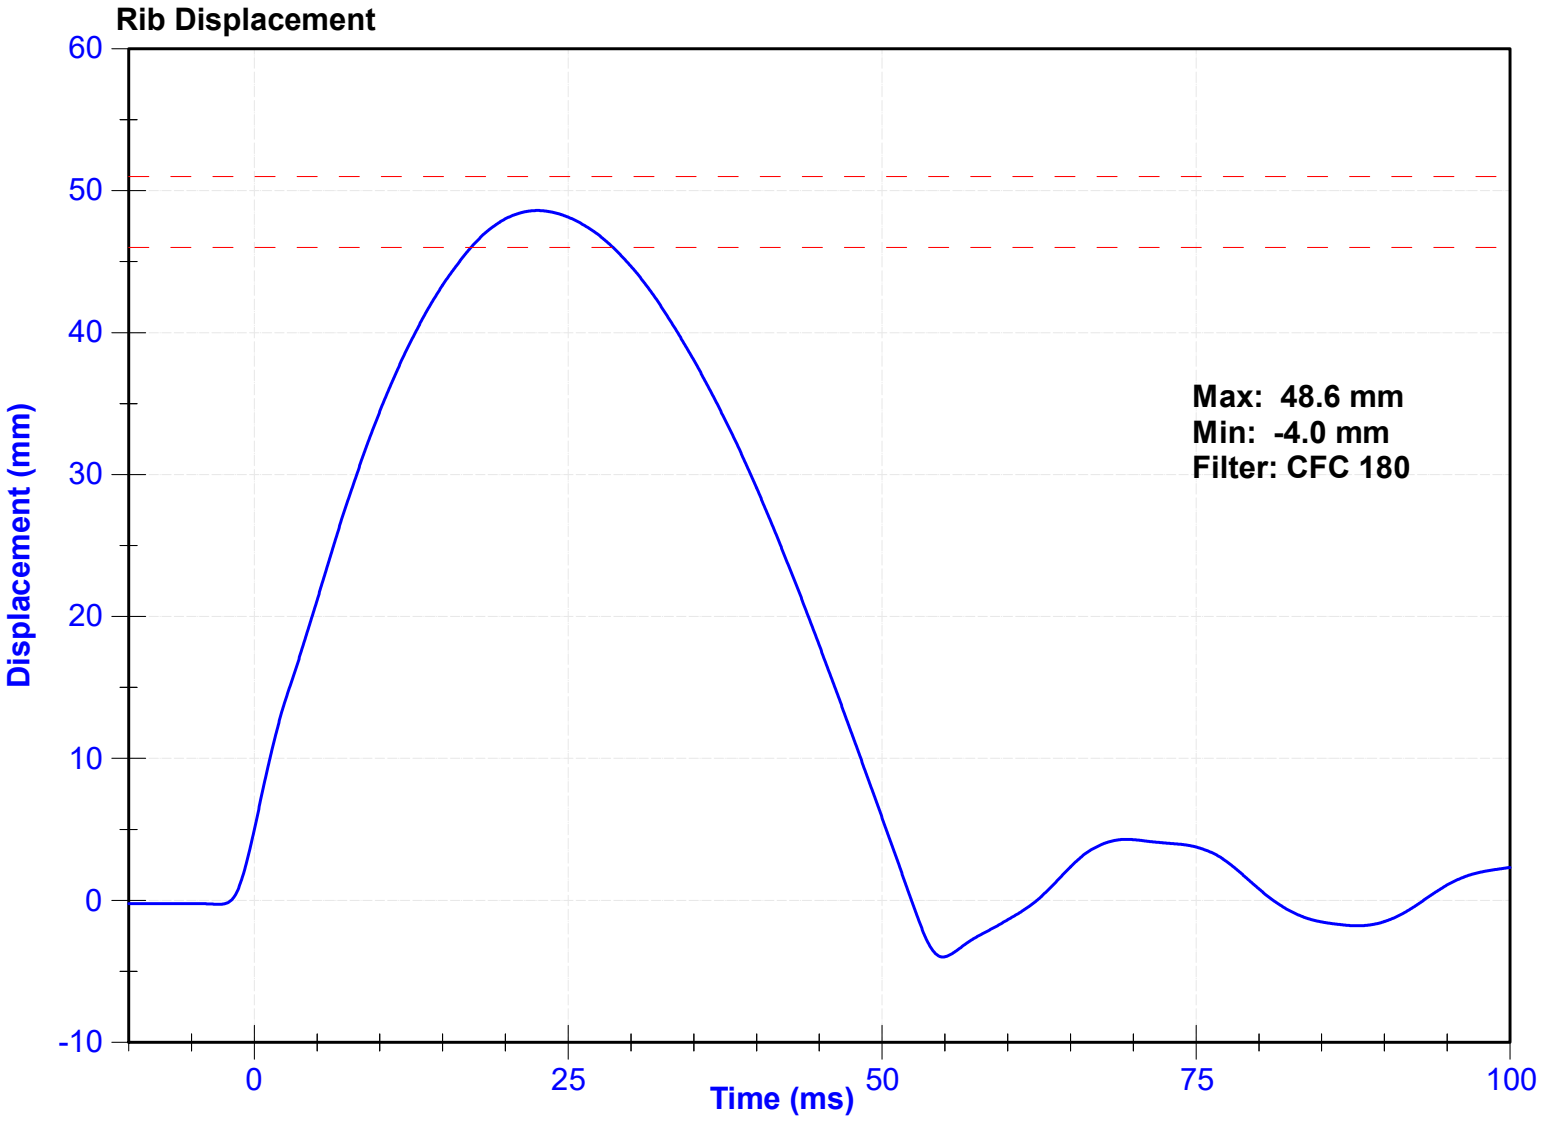

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	36	40	mm	37.7	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024

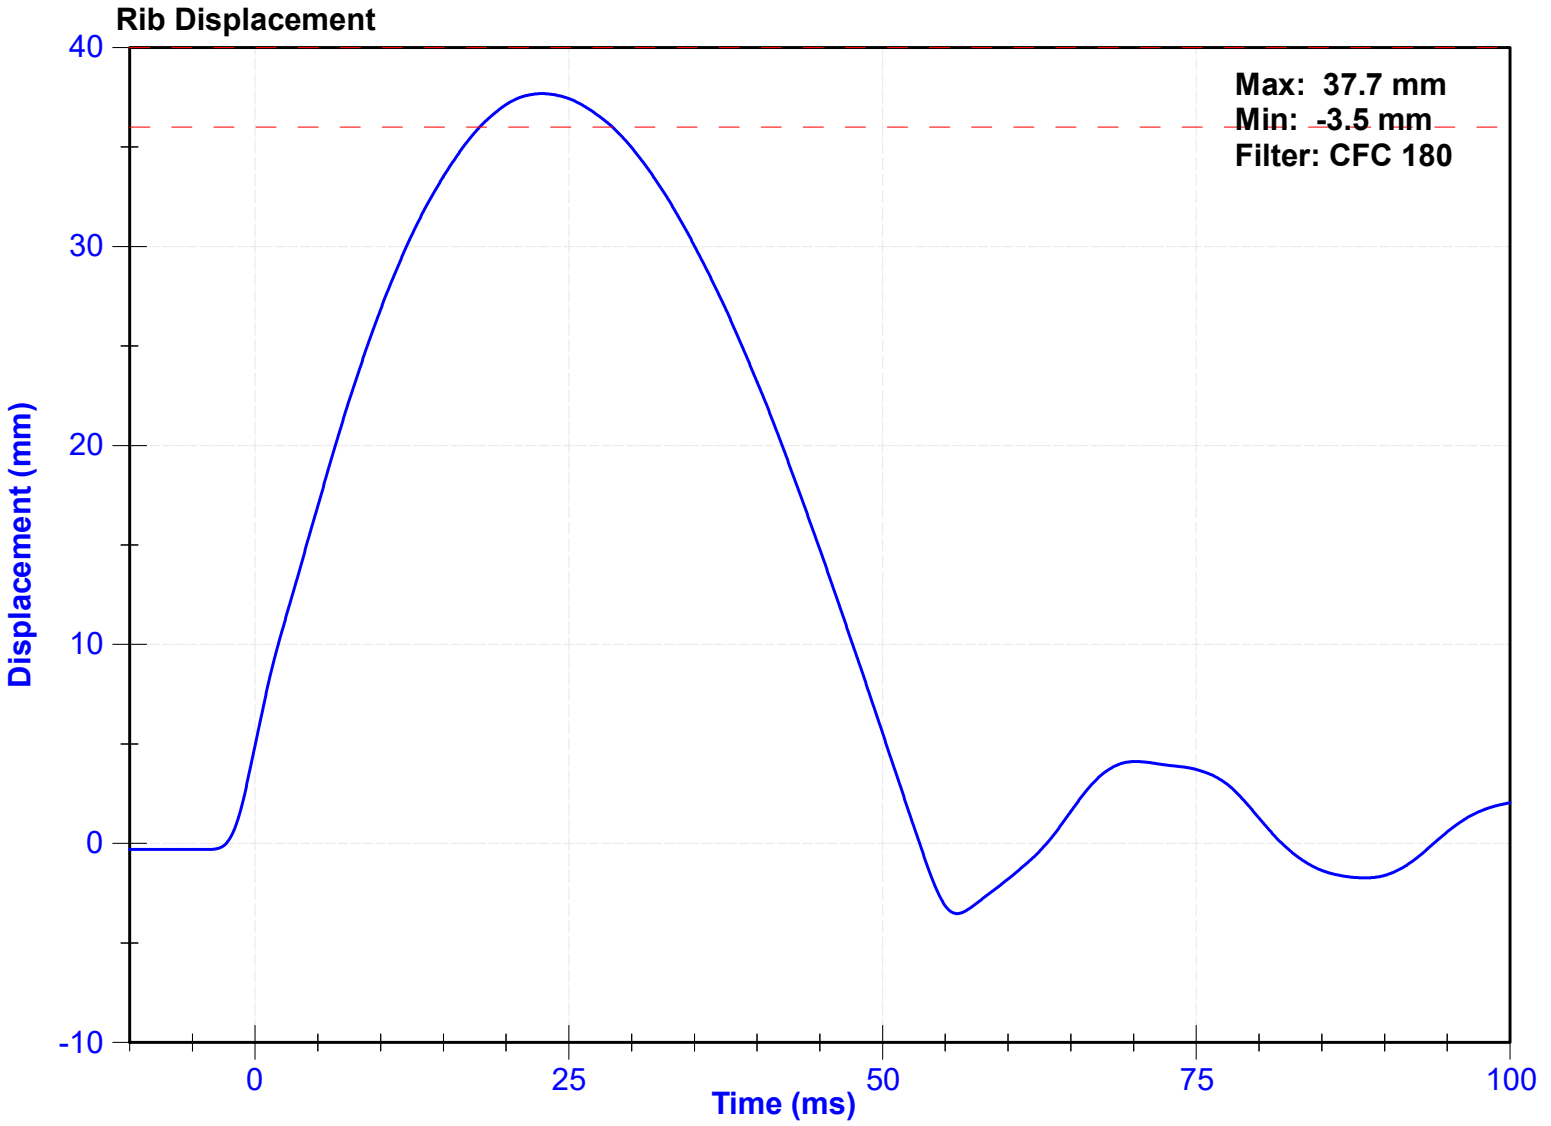

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	46	51	mm	48.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

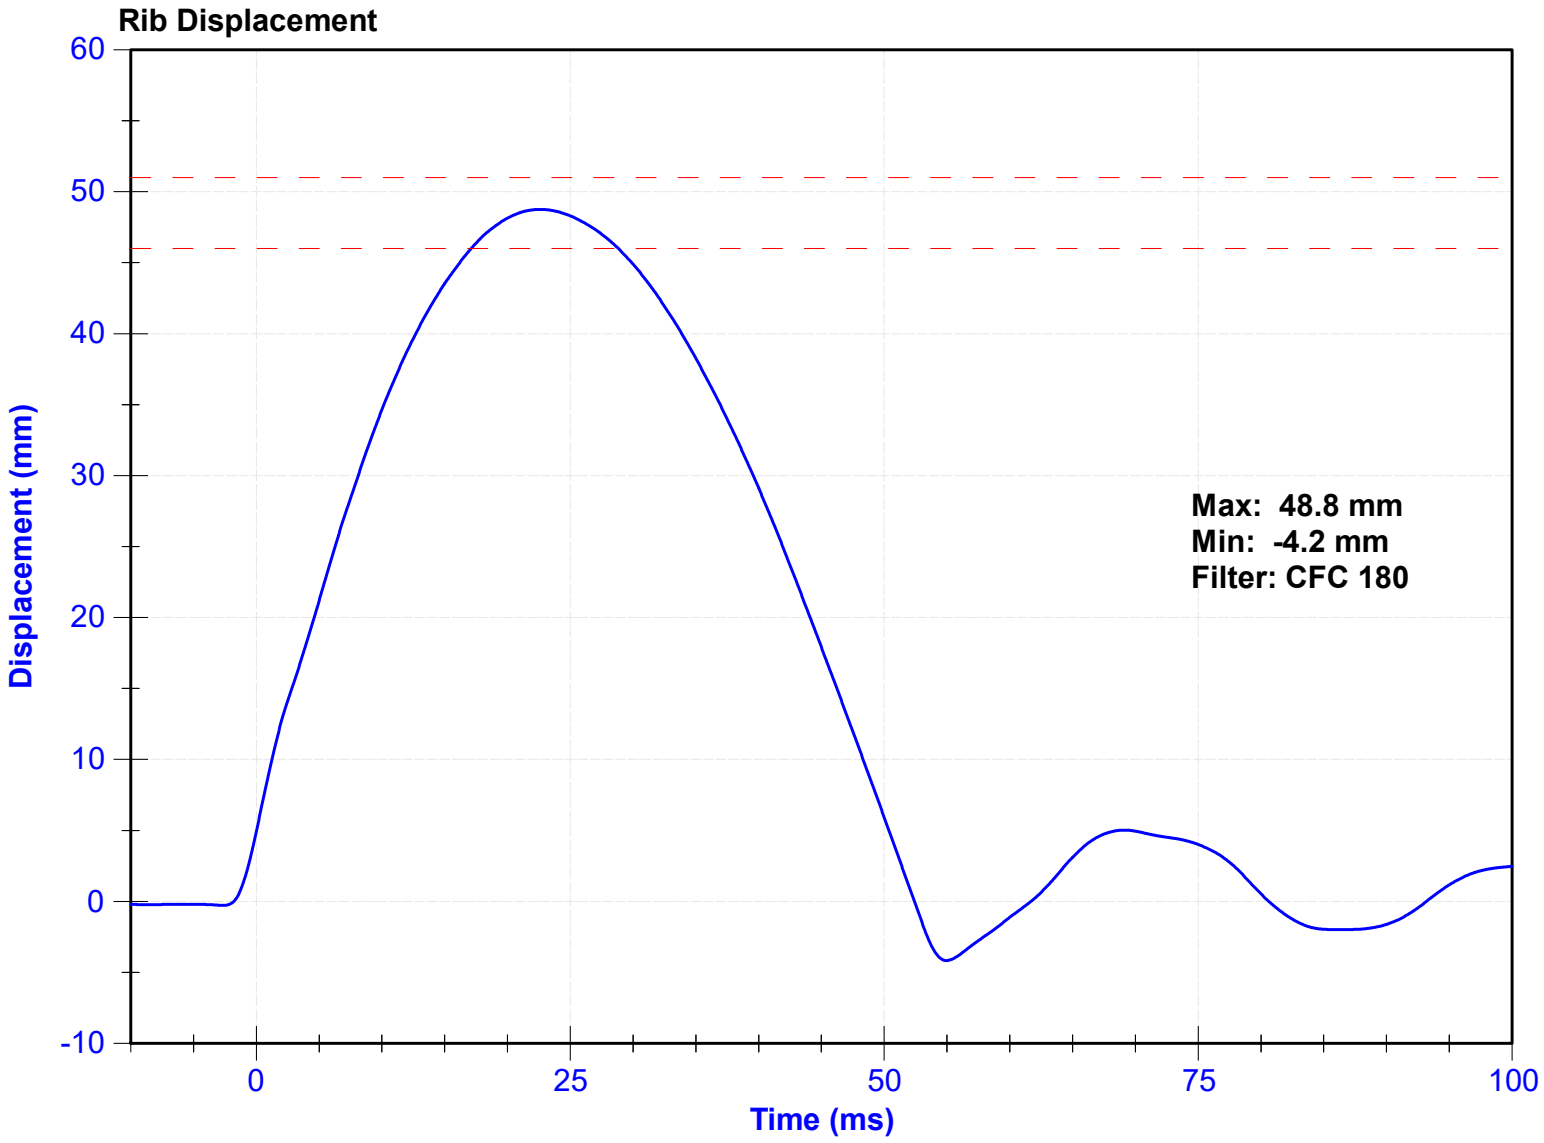

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	22.1	Pass
Humidity	10	70	%	48.3	Pass
Rib Displacement	36	40	mm	37.3	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

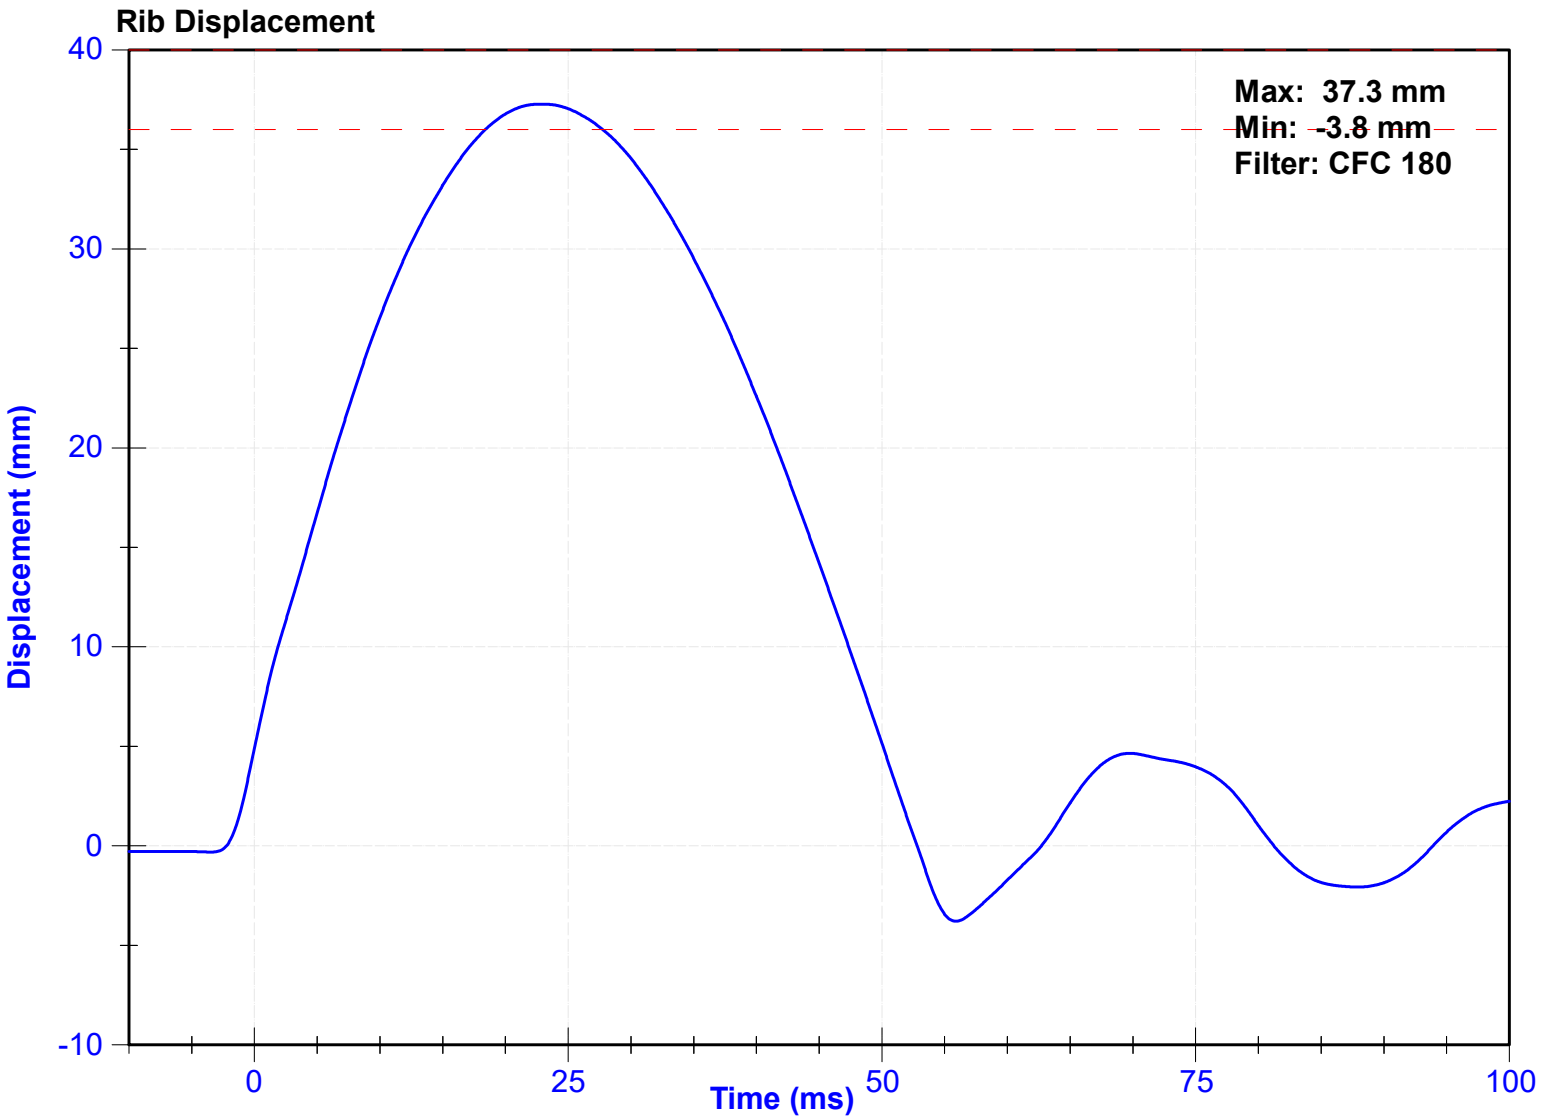

ATD Manufacturer	FTSS	Test Technician	J. Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.2	Pass
Humidity	10	70	%	59.4	Pass
Velocity	5.4	5.6	m/s	5.53	Pass
Resistive Force after 6ms	5100	6200	N	5613.8	Pass
Upper Thorax Rib Deflection	34	41	mm	40.7	Pass
Mid Thorax Rib Deflection	37	45	mm	42.9	Pass
Lower Thorax Rib Deflection	37	44	mm	40.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Upper Thorax Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

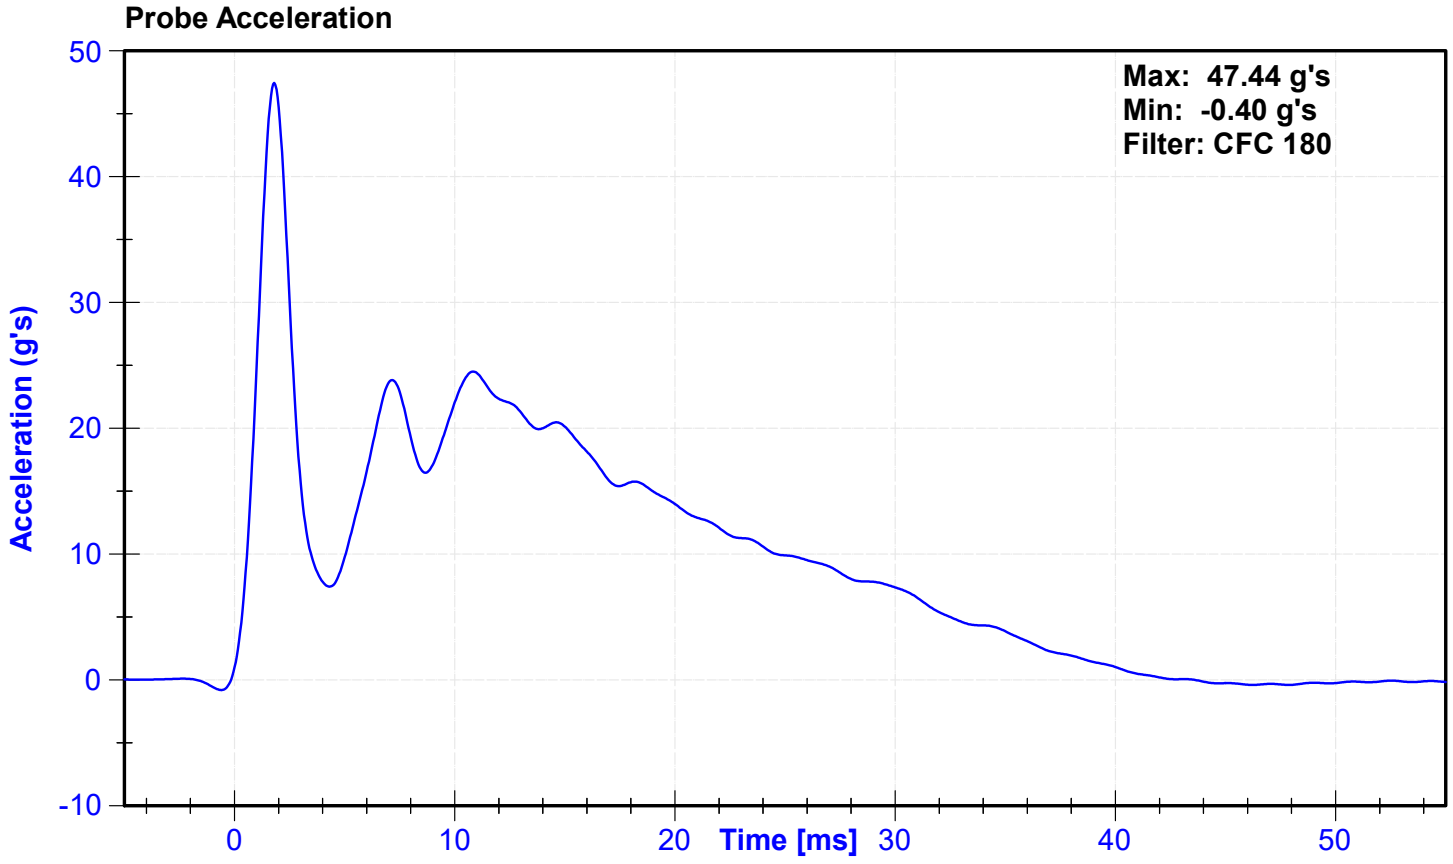

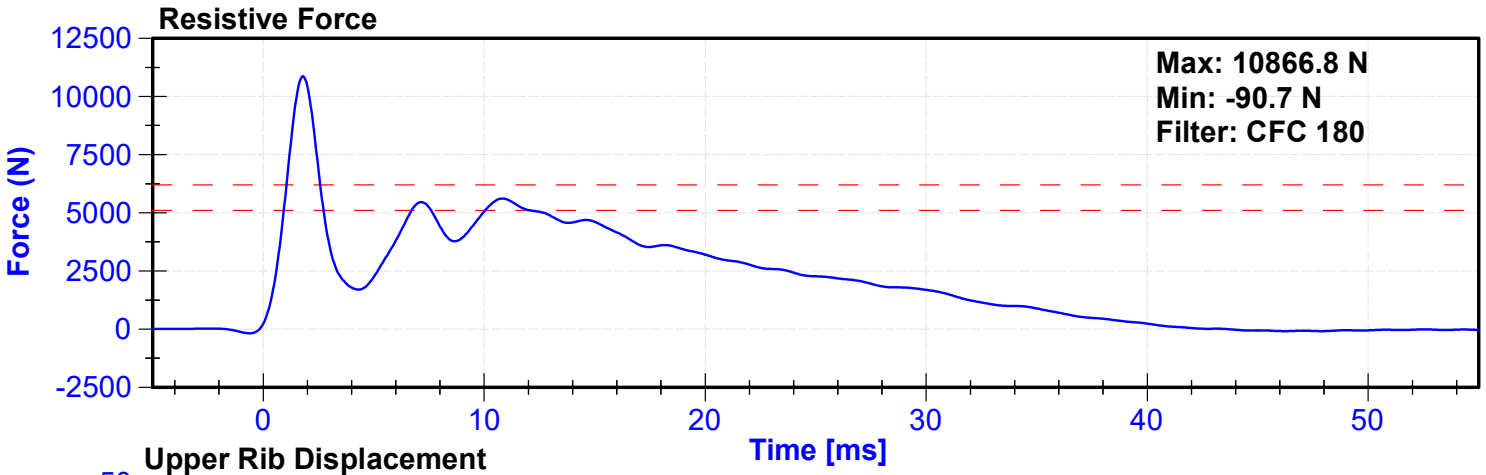
Resistive Force
Max: 10866.8 N
Min: -90.7 N
Filter: CFC 180
Force (N)
12500
10000
7500
5000
2500
0
-2500
0
10
20
30
40
50
Time [ms]

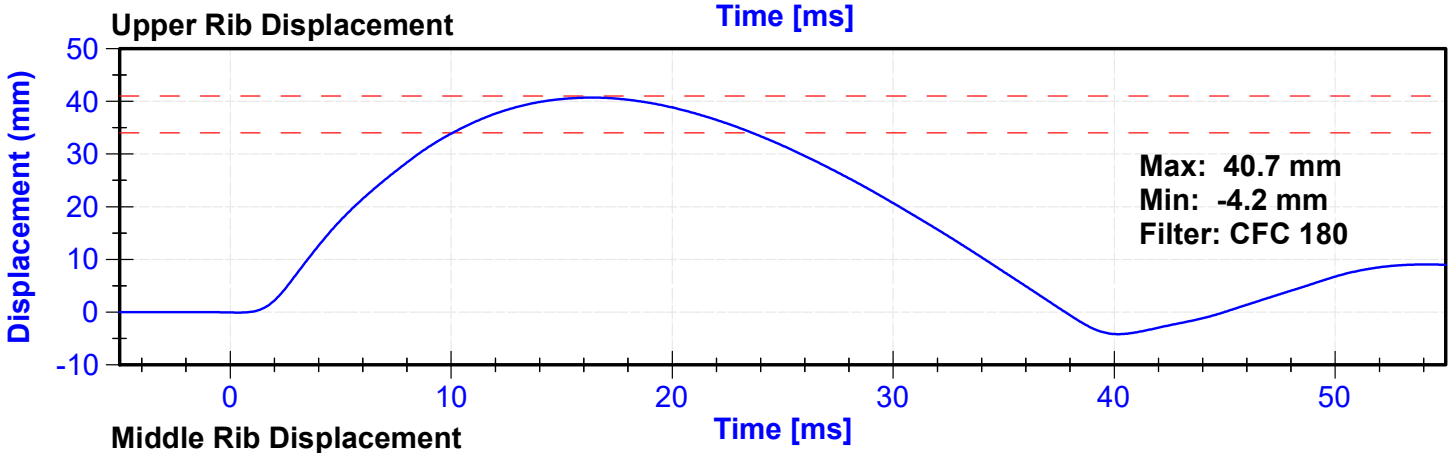
Upper Rib Displacement
Max: 40.7 mm
Min: -4.2 mm
Filter: CFC 180
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]

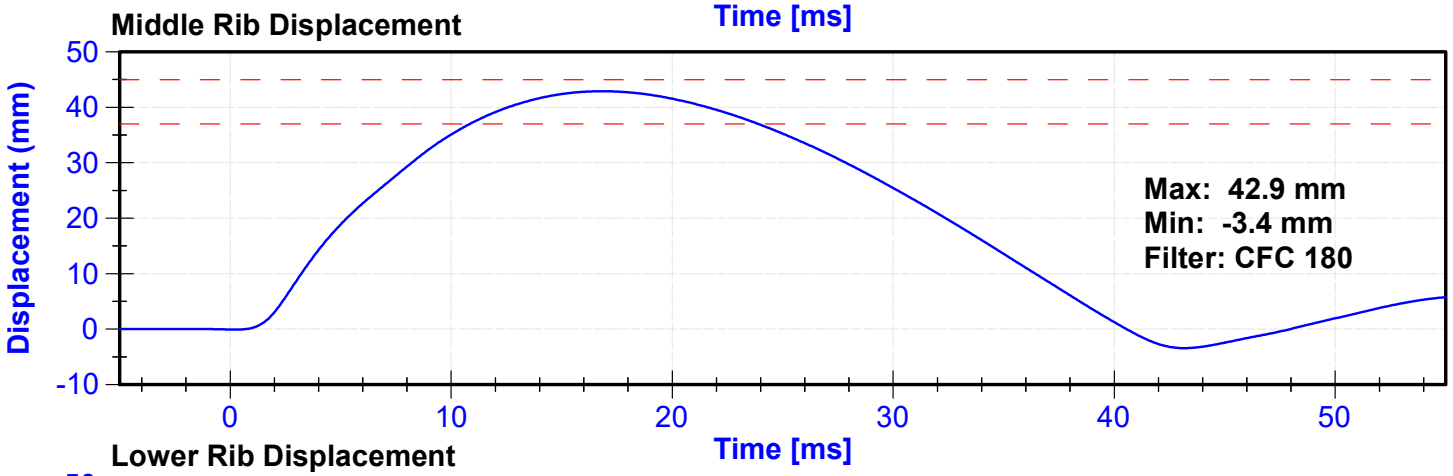
Middle Rib Displacement
Max: 42.9 mm
Min: -3.4 mm
Filter: CFC 180
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]

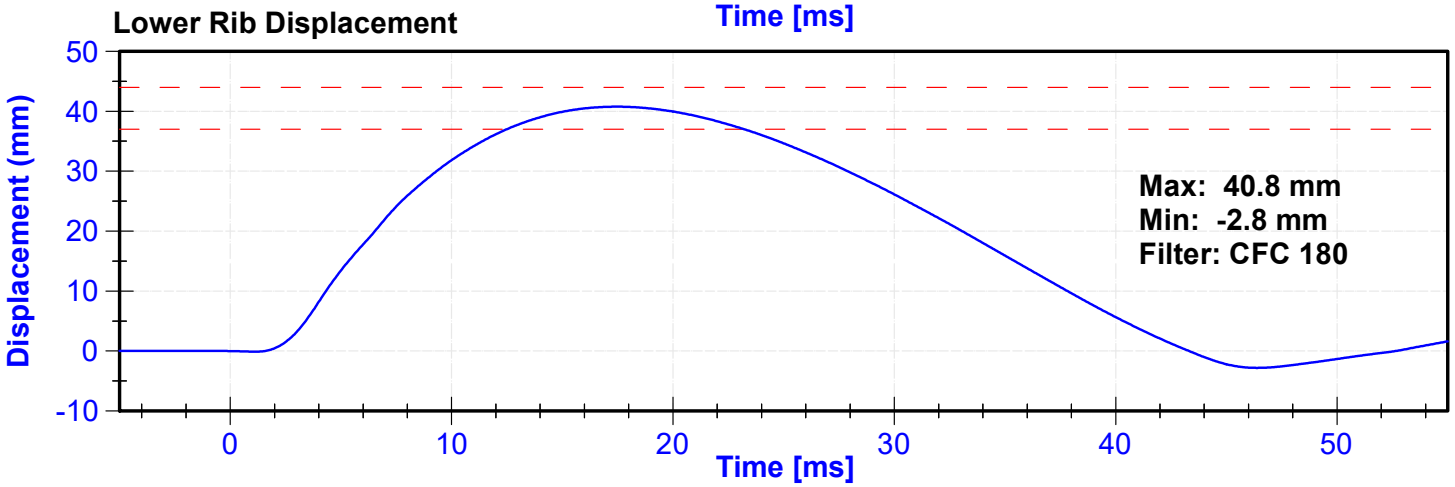
Lower Rib Displacement
Max: 40.8 mm
Min: -2.8 mm
Filter: CFC 180
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]

ATD Manufacturer	FTSS	Test Technician	J.Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.2	Pass
Humidity	10	70	%	59.4	Pass
Velocity	3.9	4.1	m/s	4.04	Pass
Combined Abdomen Force	2200	2700	N	2319.0	Pass
Time at Peak Abdomen Force	10.0	12.3	ms	10.85	Pass
Resistive Probe Force	4000	4800	N	4596.6	Pass
Time at Peak Resistive Force	10.6	13.0	ms	11.00	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Front Abdomen Load Cell	Denton	DM5846	5/18/2023	5/17/2024
Middle Abdomen Load Cell	Denton	1529	5/18/2023	5/17/2024
Rear Abdomen Load Cell	Denton	1533	5/18/2023	5/17/2024

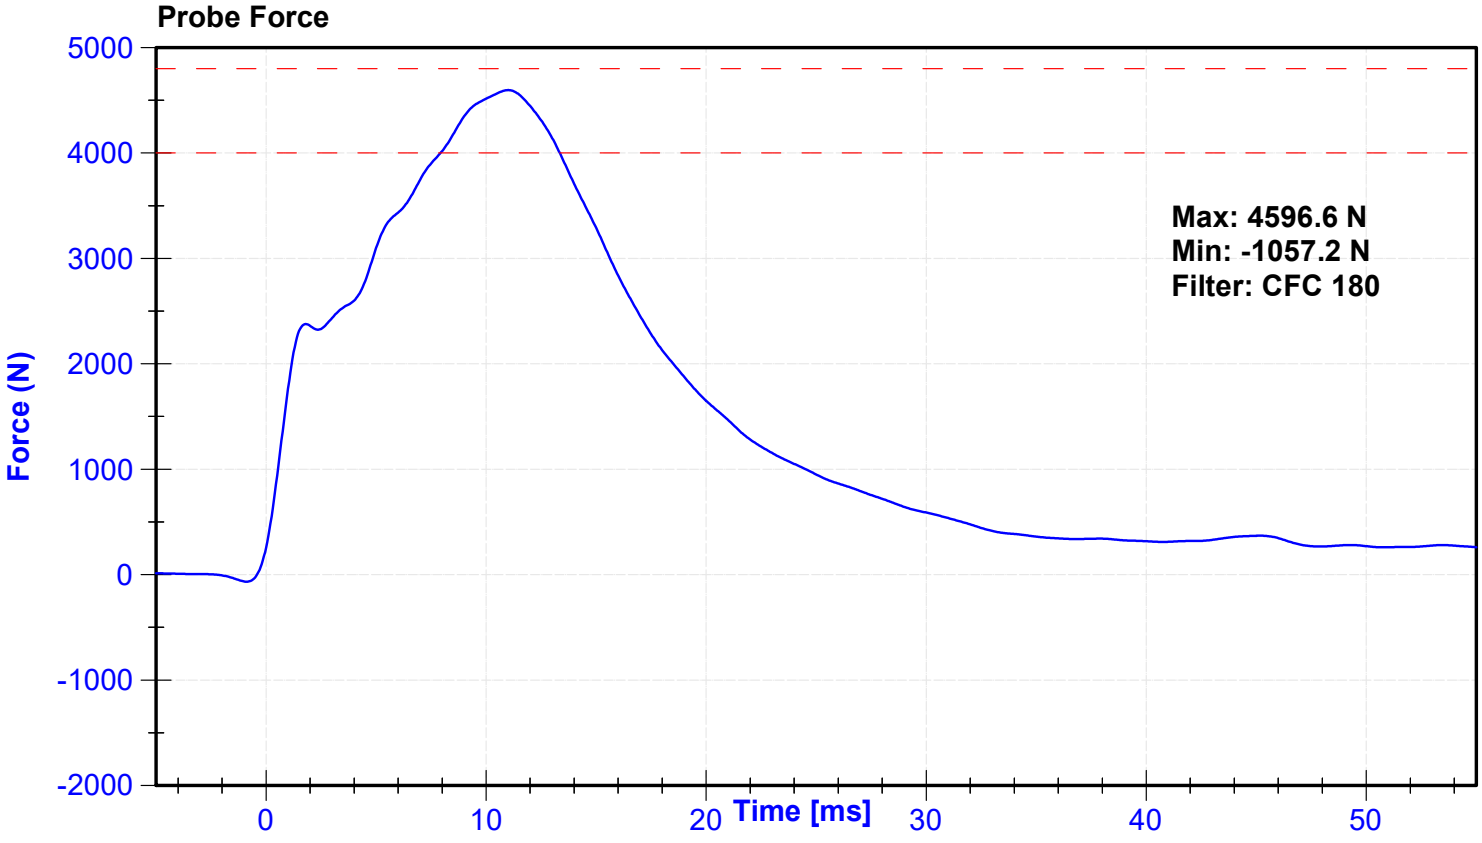

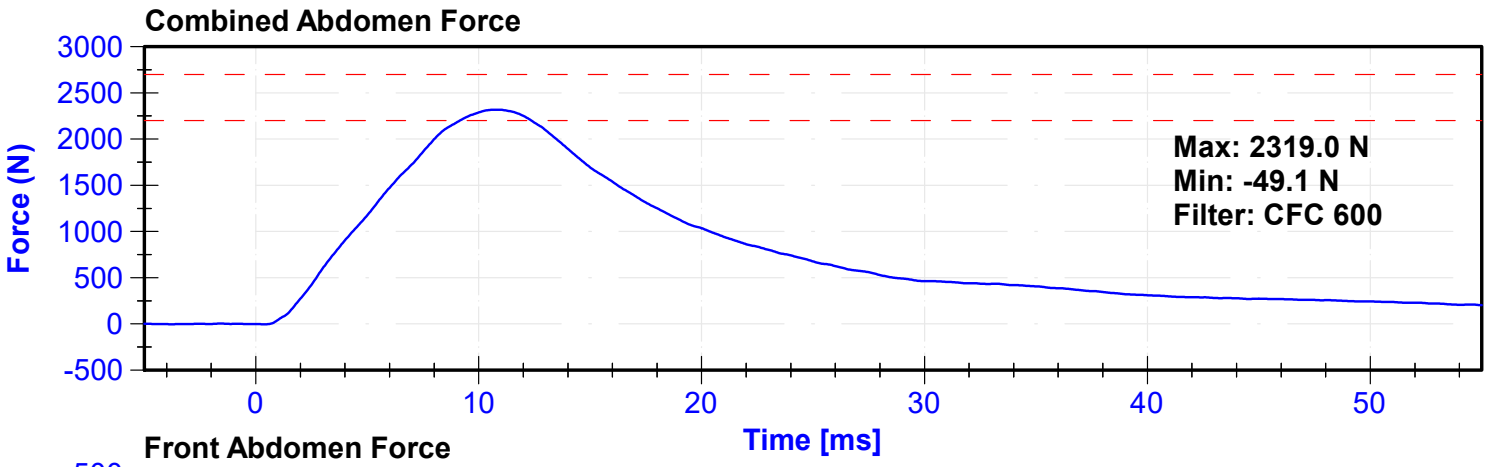
Combined Abdomen Force
Force (N)
Time [ms]
Max: 2319.0 N
Min: -49.1 N
Filter: CFC 600

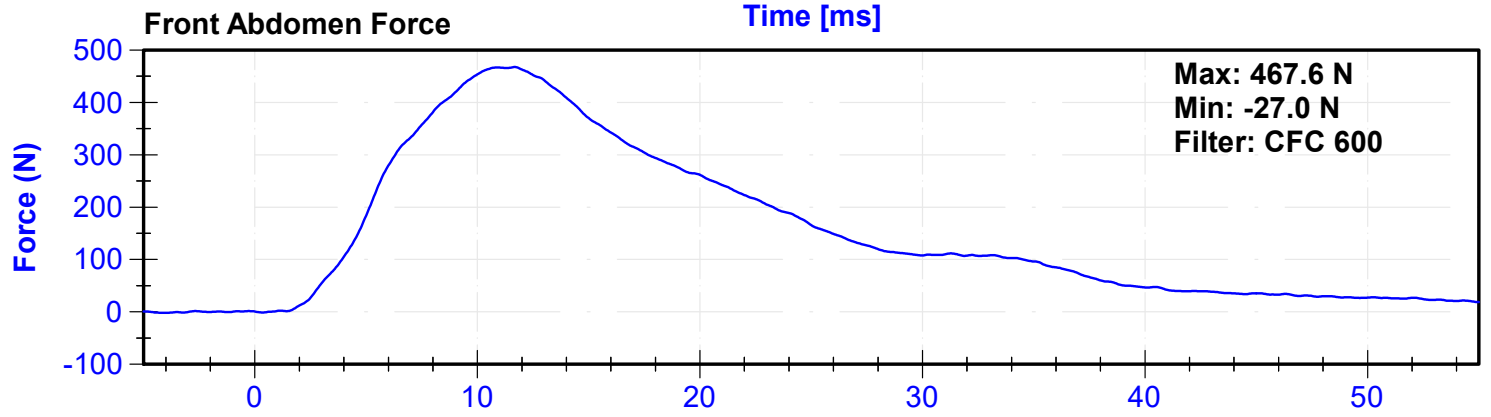
Front Abdomen Force
Force (N)
Time [ms]
Max: 467.6 N
Min: -27.0 N
Filter: CFC 600

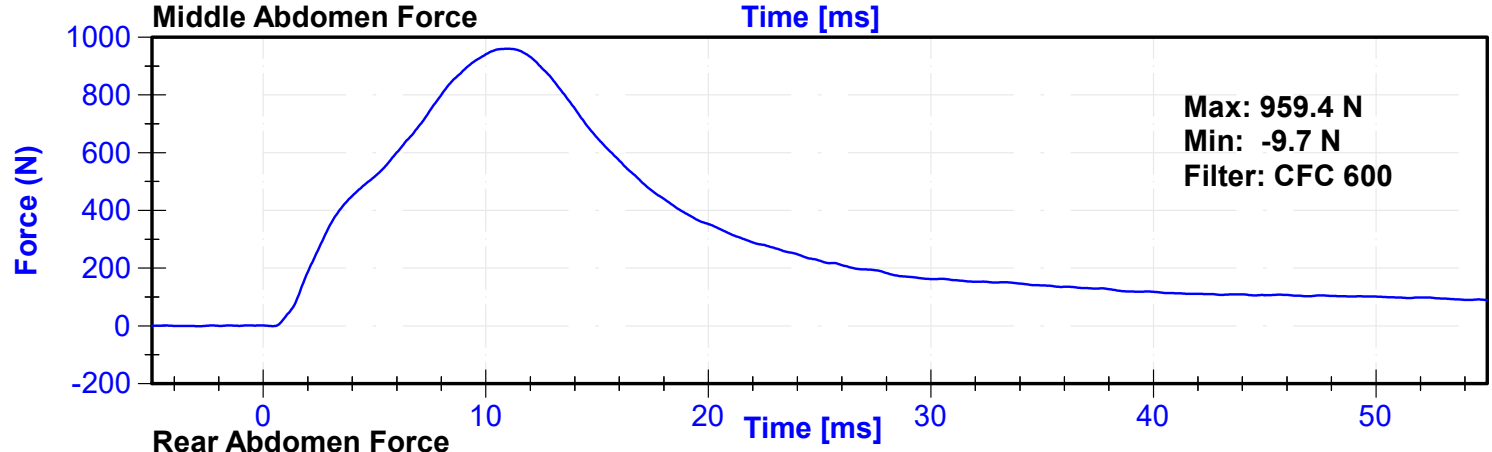
Middle Abdomen Force
Force (N)
Time [ms]
Max: 959.4 N
Min: -9.7 N
Filter: CFC 600

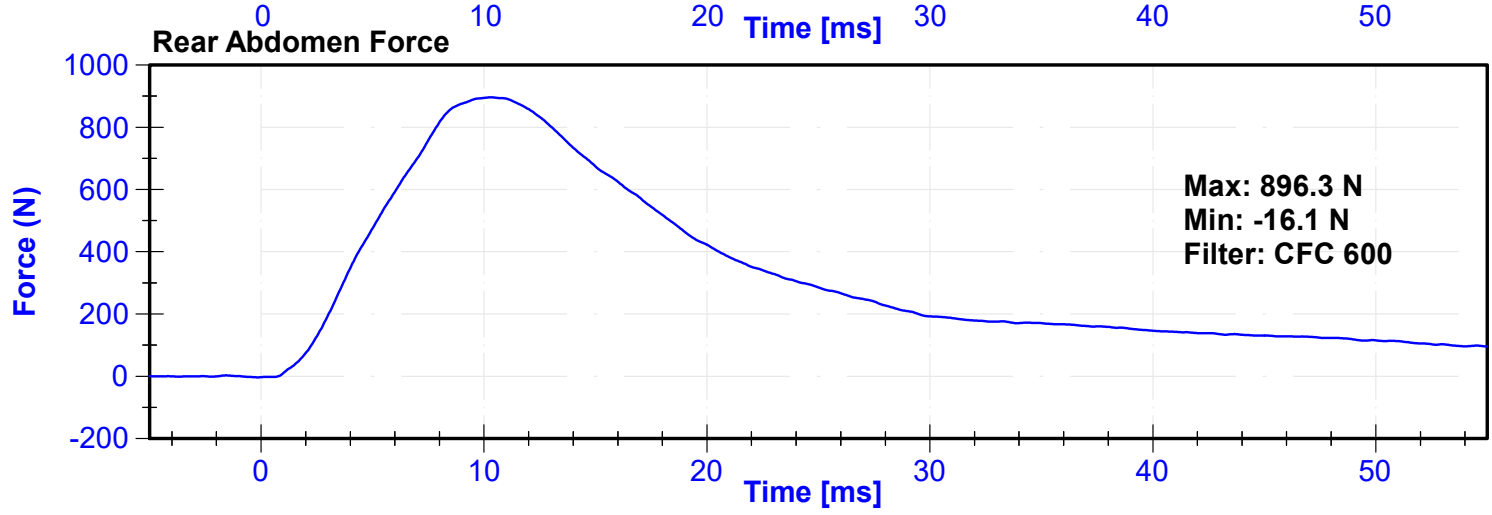
Rear Abdomen Force
Force (N)
Time [ms]
Max: 896.3 N
Min: -16.1 N
Filter: CFC 600

ATD Manufacturer	FTSS	Test Technician	C. Mantell
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	34	Pass
Velocity	5.95	6.15	m/s	5.997	Pass
Lateral Spine Rotation	45	55	deg	46.0	Pass
Time at Maximum Rotation	39	53	ms	39.8	Pass
Time of Decay to Zero Degrees	37	57	ms	39.0	Pass
Pendulum Velocity Overall Corridor	Lower Boundary[1]	Upper Boundary[2]	m/s	See Plot[3]	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	C16503	10/31/2023	4/28/2024
Pendulum "A" Potentiometer	Sfernice	094	9/29/2023	9/28/2024
Condyle "B" Potentiometer	Sfernice	095	9/29/2023	9/28/2024

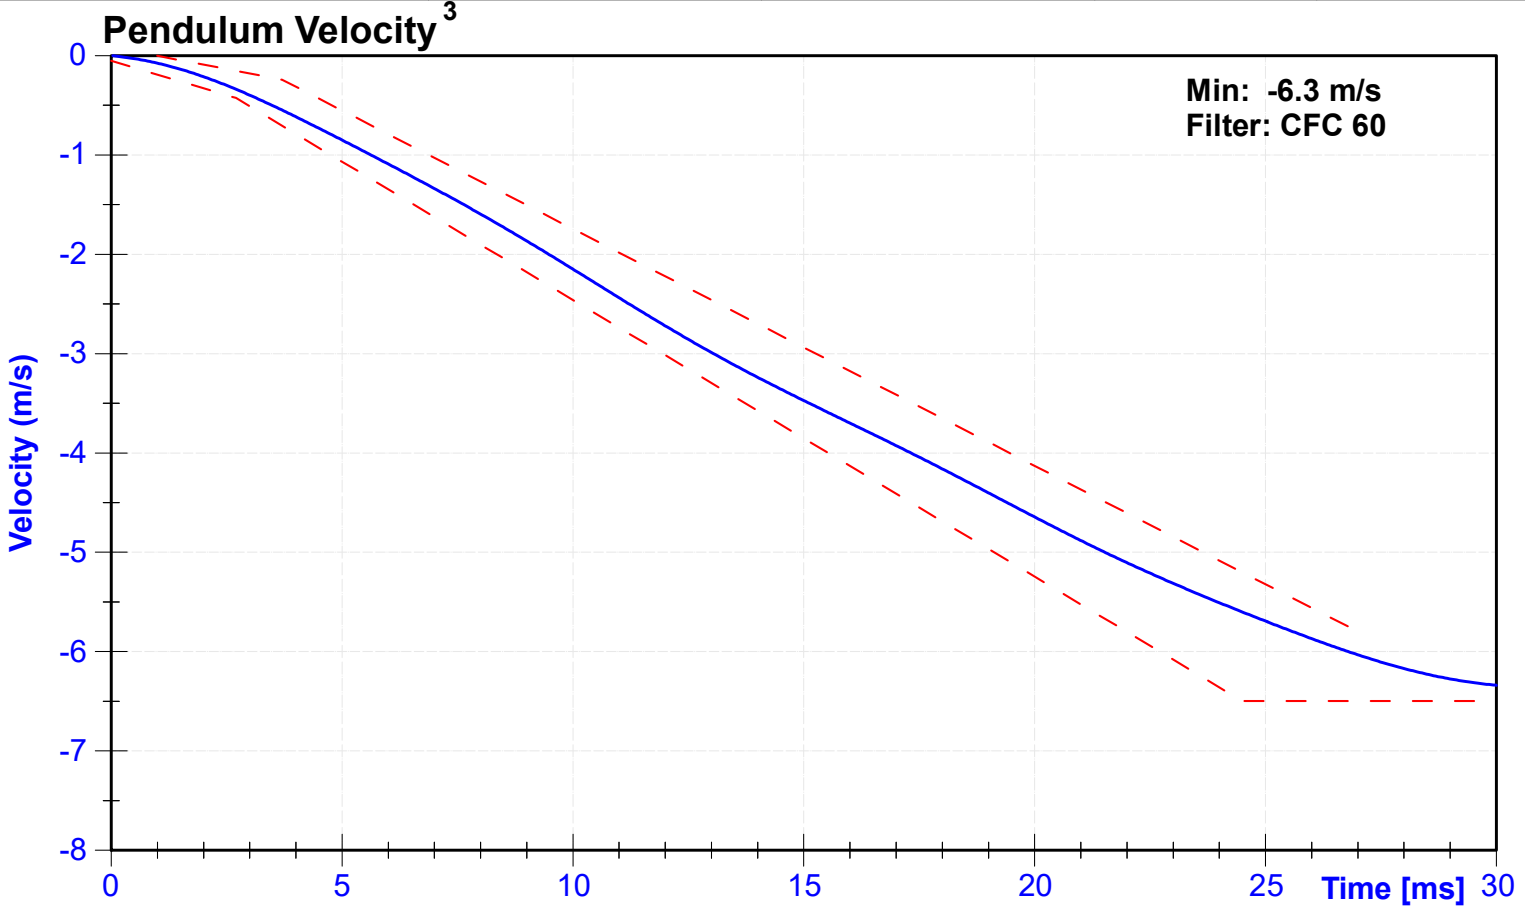

[1,2] Upper and lower boundaries specified in Appendix I

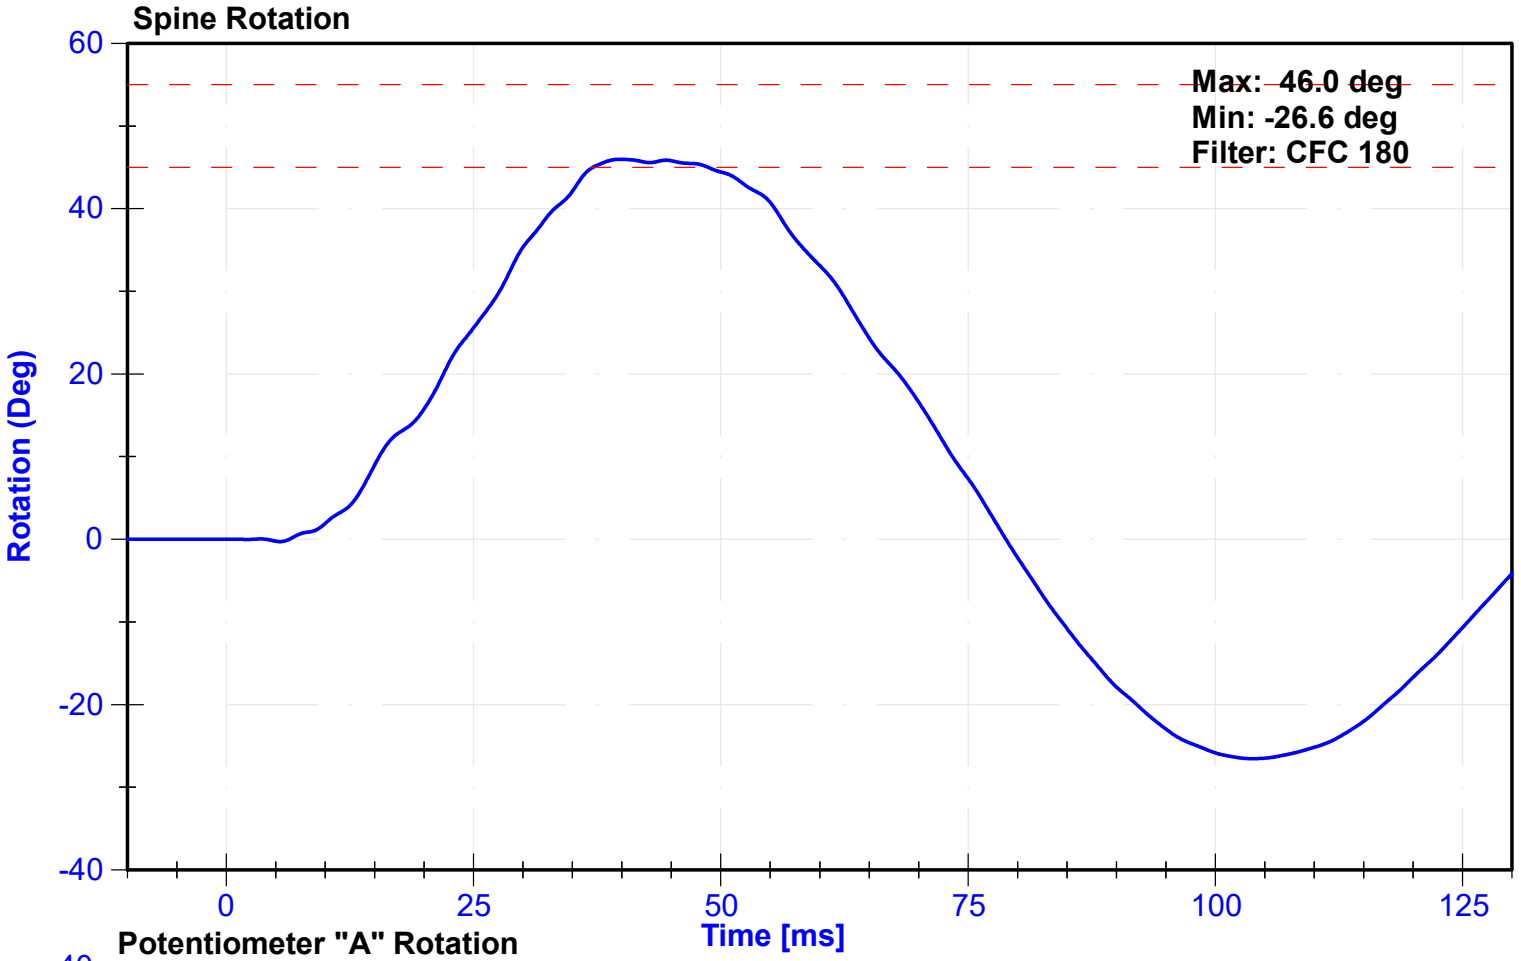
Spine Rotation
Max: 46.0 deg
Min: -26.6 deg
Filter: CFC 180
Rotation (Deg)
60
40
20
0
-20
-40
0
25
50
75
100
125
Time [ms]

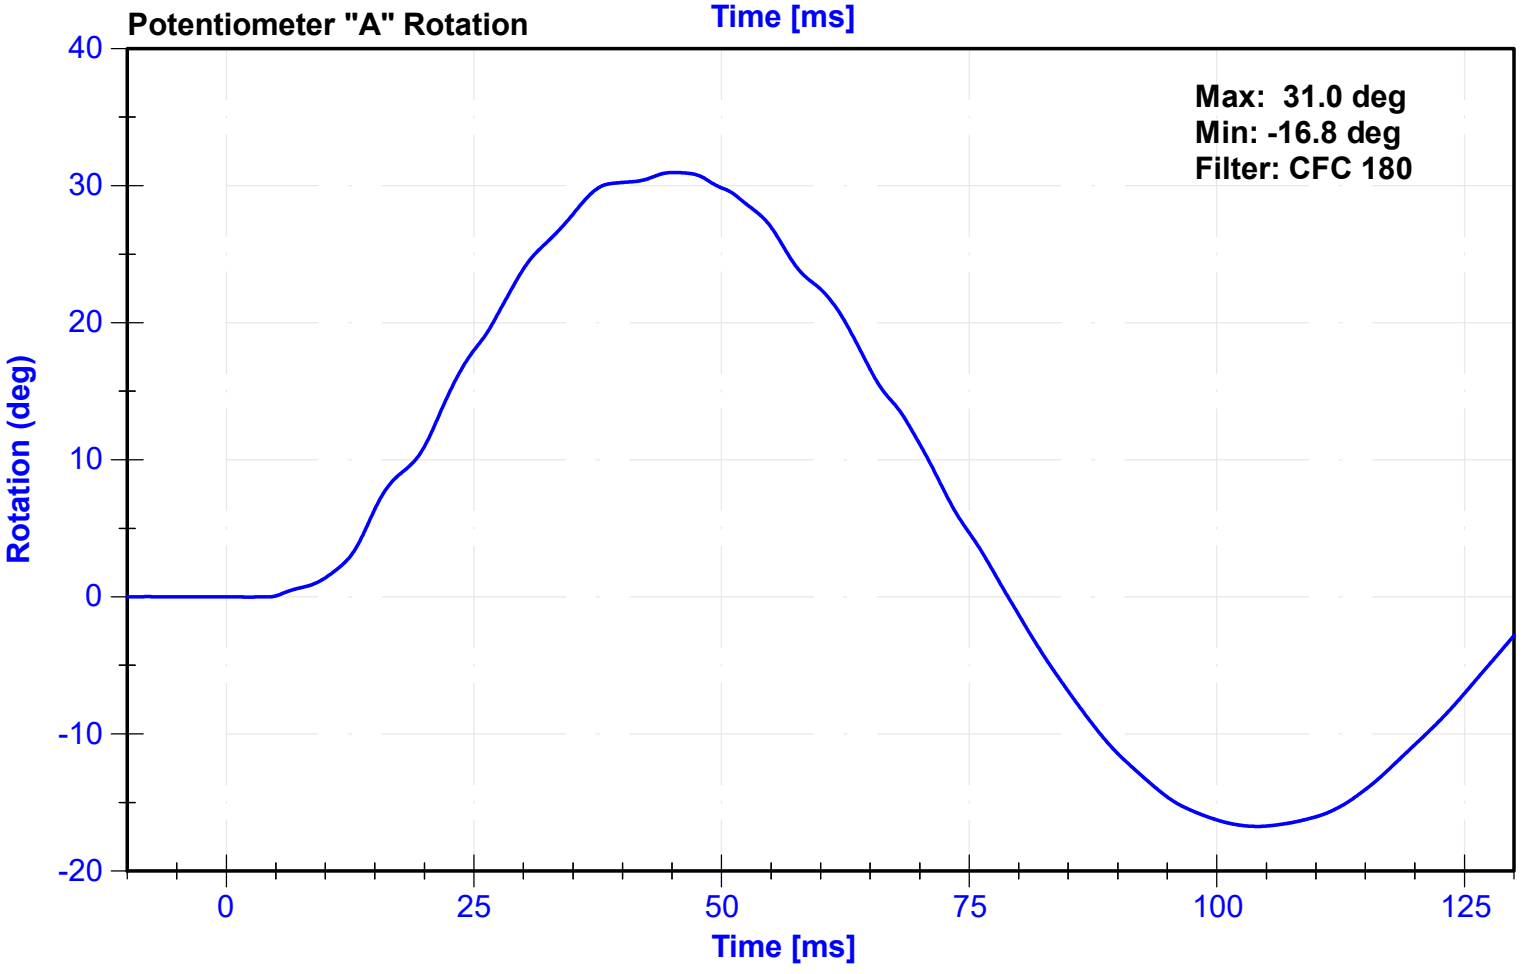
Potentiometer "A" Rotation
Max: 31.0 deg
Min: -16.8 deg
Filter: CFC 180
Rotation (deg)
40
30
20
10
0
-10
-20
0
25
50
75
100
125
Time [ms]

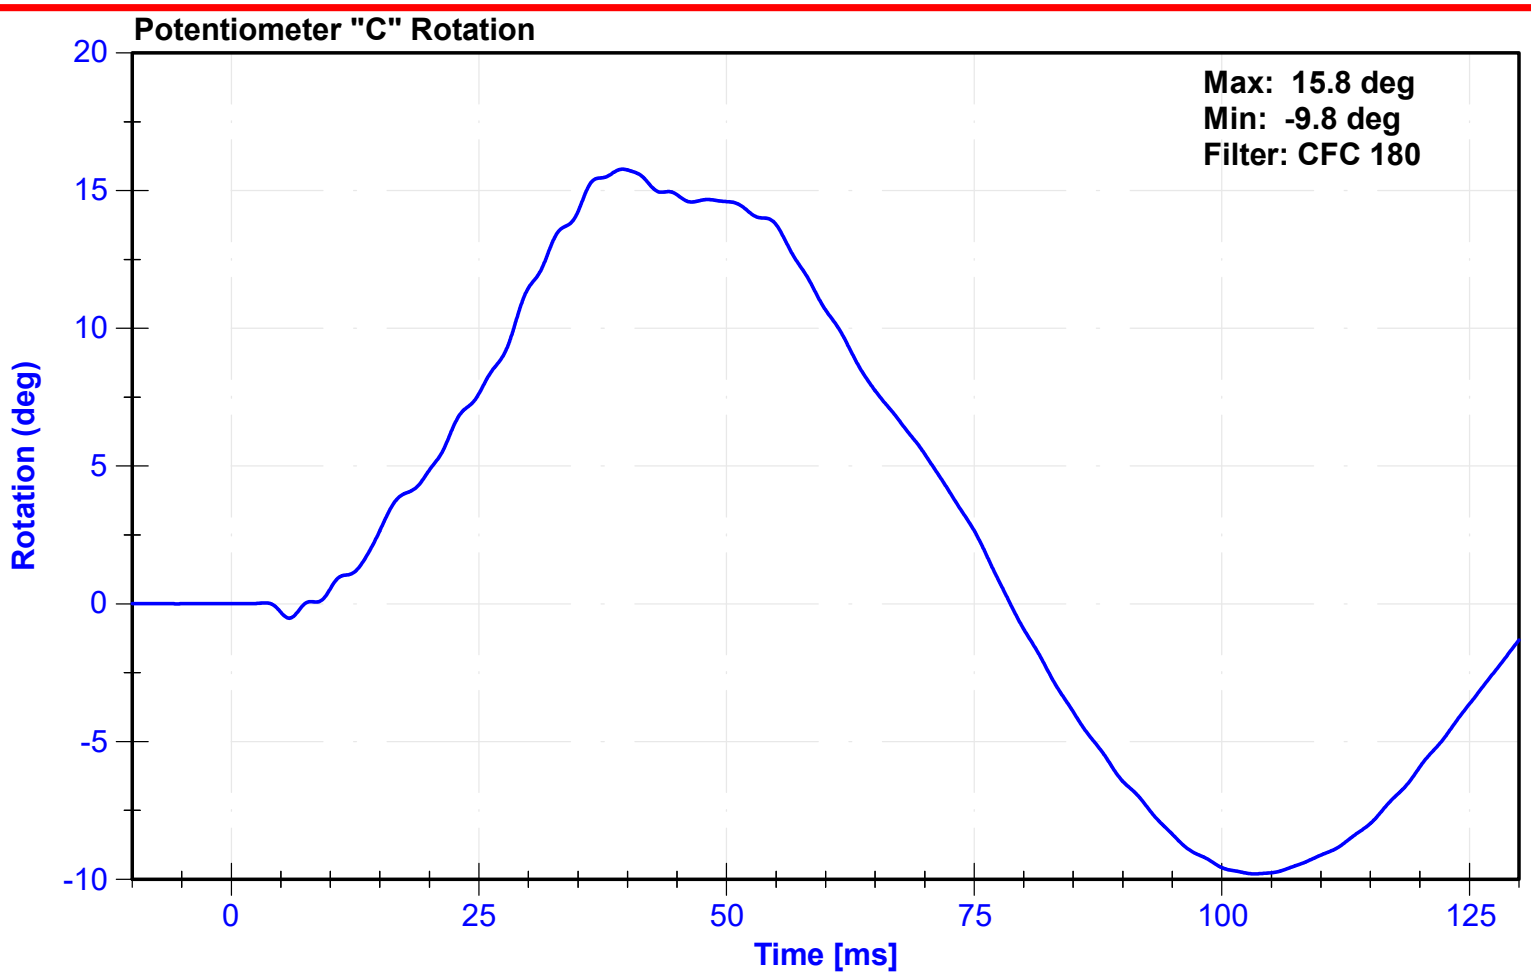

Appendix I

[2] Upper Boundary Corridor		[1] Lower Boundary Corridor	
Time (ms)	Velocity (m/s)	Time (ms)	Velocity (m/s)
1.0	0.00	0.0	-0.05
3.7	-0.24	2.7	-0.425
27.0	-5.80	24.5	-6.5
		30.0	-6.5

ATD Manufacturer	FTSS	Test Technician	J.Kinderman
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.2	Pass
Humidity	10	70	%	59.4	Pass
Velocity	4.2	4.4	m/s	4.30	Pass
Resistive Force	4700	5400	N	5129.5	Pass
Time at Peak Resistive Force	11.8	16.1	ms	12.60	Pass
Pubic Force	-1590	-1230	N	-1319.3	Pass
Time at Peak Pubic Force	12.2	17.0	ms	13.25	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Pubic Load Cell	Denton	459-FY	6/20/2023	6/19/2024

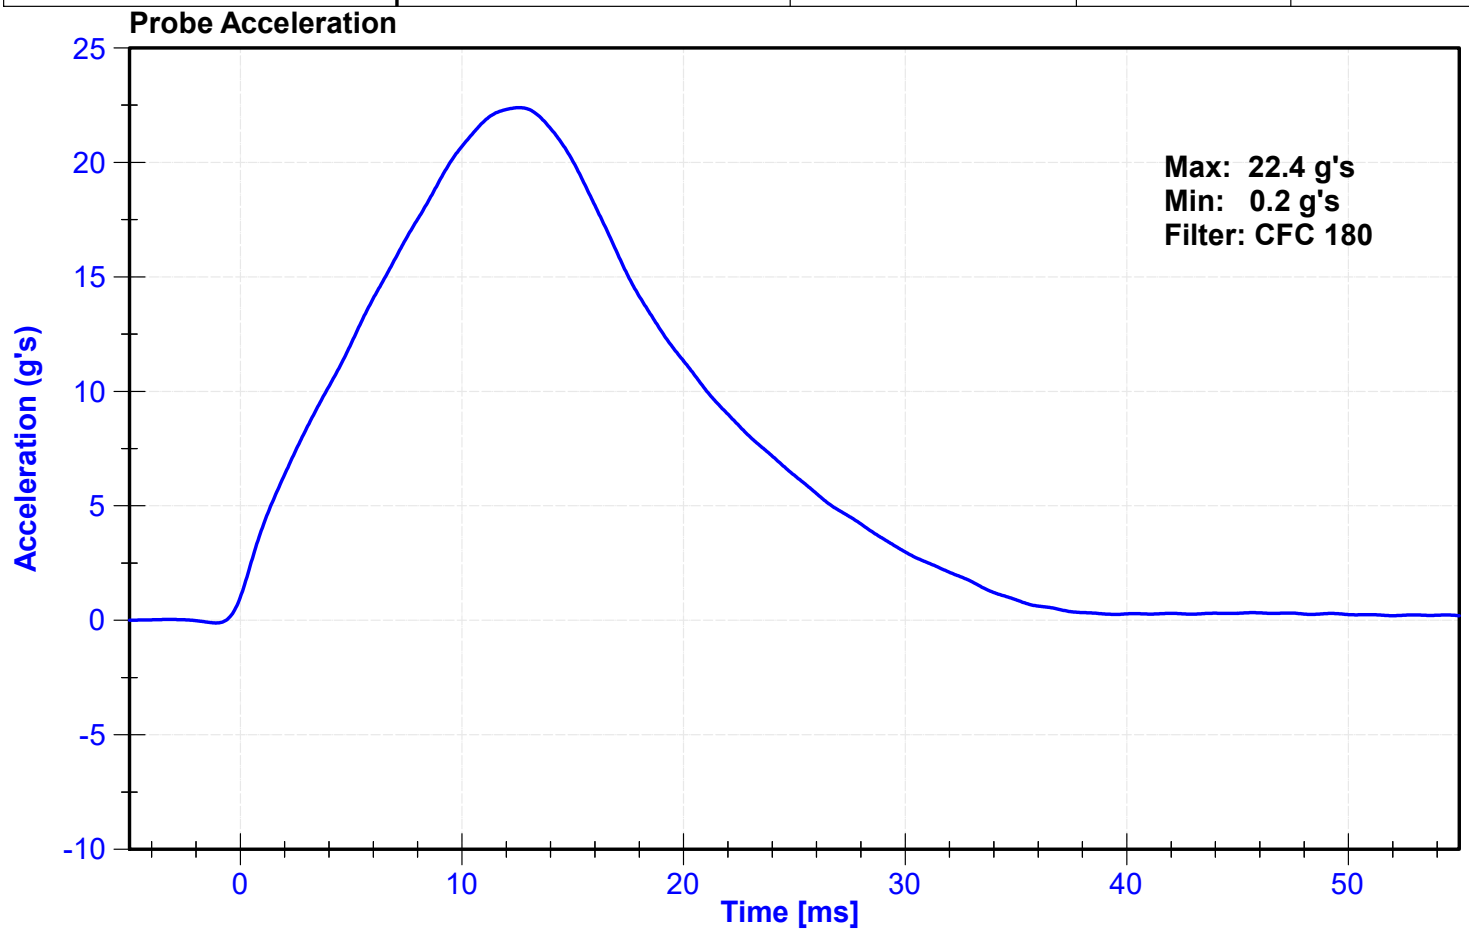

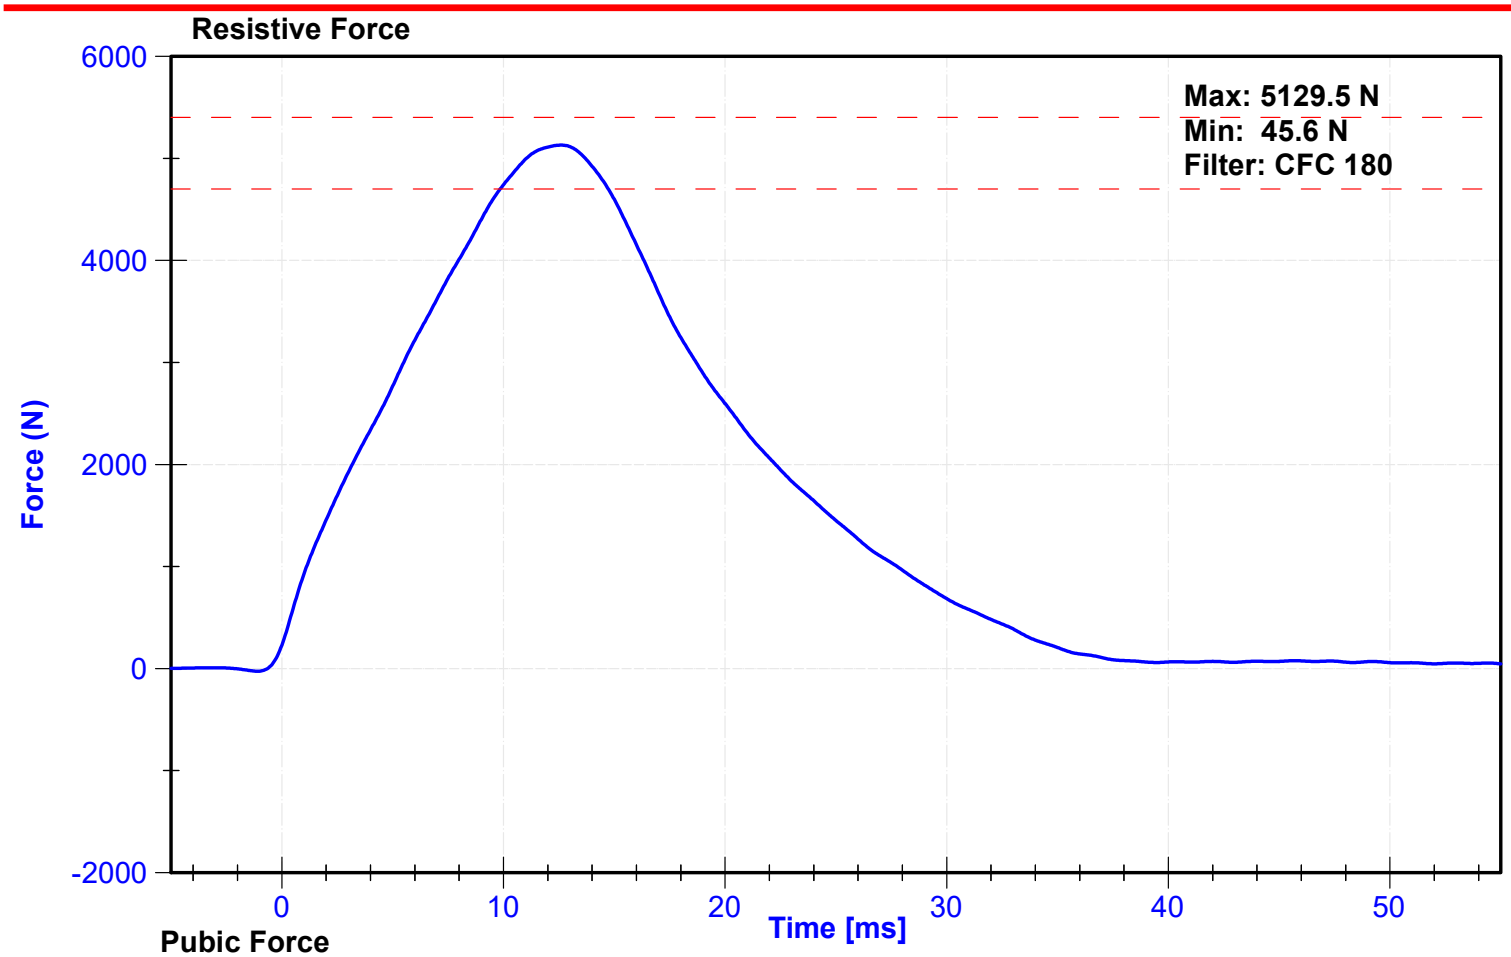
Resistive Force
Max: 5129.5 N
Min: 45.6 N
Filter: CFC 180
Force (N)
6000
4000
2000
0
-2000
0
10
20
30
40
50
Time [ms]

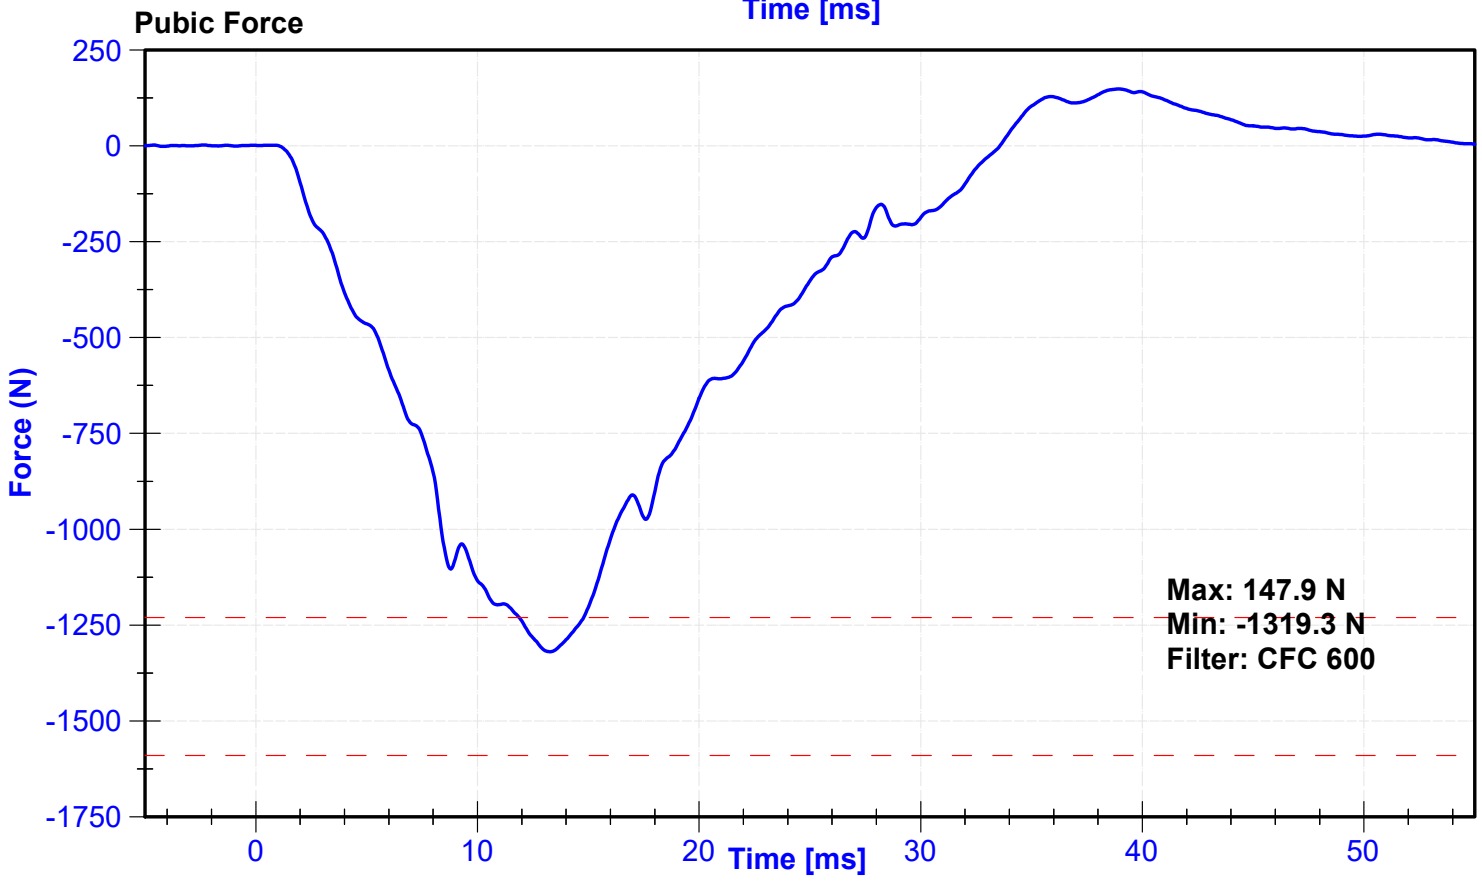
Pubic Force
Max: 147.9 N
Min: -1319.3 N
Filter: CFC 600
Force (N)
250
0
-250
-500
-750
-1000
-1250
-1500
-1750
0
10
20
30
40
50
Time [ms]

CALIBRATION TEST RESULTS

PRE-TEST

SID-IIS 5TH PERCENTILE FEMALE – PASSENGER ATD

SERIAL NO:300

(CONFIGURED FOR LEFT SIDE IMPACT)

External Measurements - SID-IIs

Technician: K. Brogan Date: 12/05/2023

Dummy Serial Number: 300

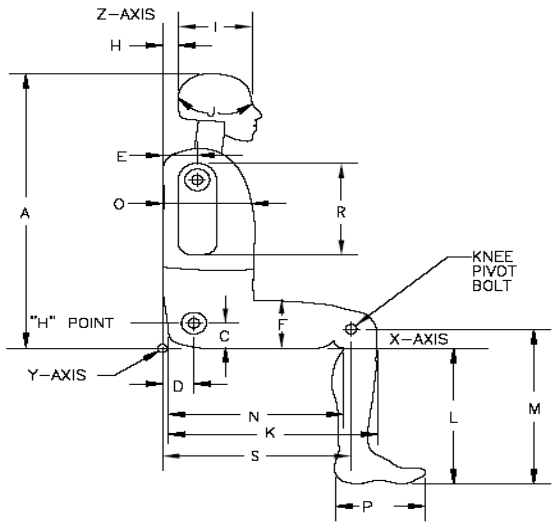

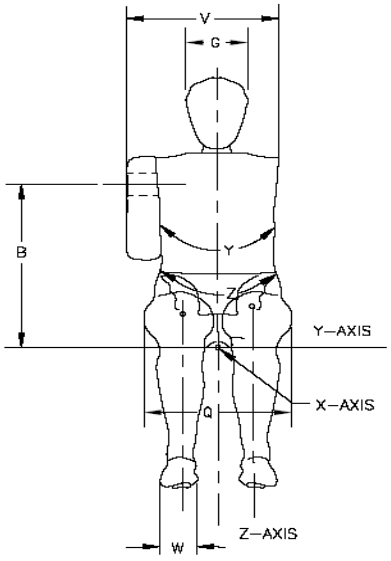

Symbol	Description	Specification (mm)		Result (mm)	Pass/Fail
A	Sitting Height	772	788	782	Pass
B	Shoulder Pivot Height	437	453	444	Pass
C	H-point Height	79	89	83	Pass
D	H-point from seatback	141	151	144	Pass
E	Shoulder Pivot from Backline	97	107	98	Pass
F	Thigh Clearance	119	135	124	Pass
G	Head Breadth	140	148	143	Pass
H	Head Back from Backline	40	46	43	Pass
I	Head Depth	178	188	181	Pass
J	Head Circumference	541	551	546	Pass
K	Buttock to Knee Length	514	540	530	Pass
L	Popliteal Height	343	369	357	Pass
M	Knee Pivot to floor height	392	409	402	Pass
N	Buttock Popliteal Length	416	442	433	Pass
O	Chest Depth w/o jacket	195	211	199	Pass
P	Foot Length	216	232	221	Pass
Q	Hip Breadth (w/pelvic plugs)	313	323	319	Pass
R	Arm Length	249	259	253	Pass
S	Knee Joint to seatback	477	493	483	Pass
V	Shoulder Width	341	357	350	Pass
W	Foot Width	78	94	86	Pass
Y	Chest Circumference w/jacket	851	881	876	Pass
Z	Waist Circumference	761	791	778	Pass

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	18	Pass
Resultant Acceleration	115	137	g's	127.6	Pass
Oscillation	0	15	%	1.1	Pass
Fore-Aft Acceleration	-15	15	g's	-11.2	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibratio Date	Calibratio Due Date
X Accelerometer	Endevco	P59018	11/15/2023	5/13/2024
Y Accelerometer	Endevco	P79189	11/15/2023	5/13/2024
Z Accelerometer	Endevco	P79587	11/15/2023	5/13/2024

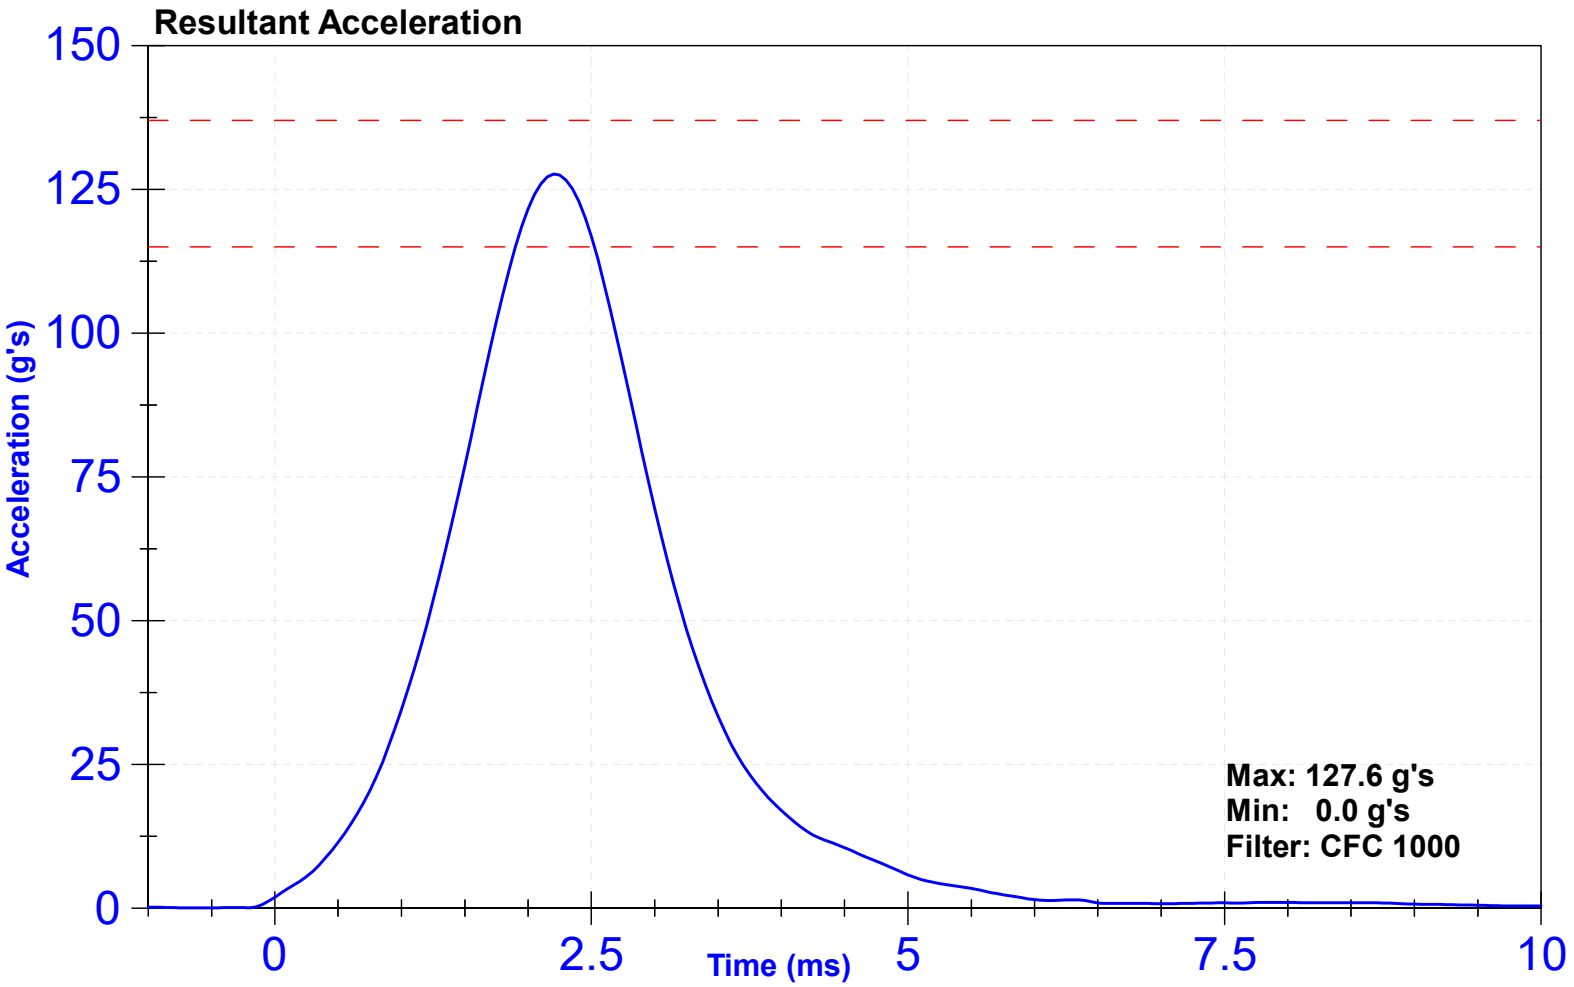

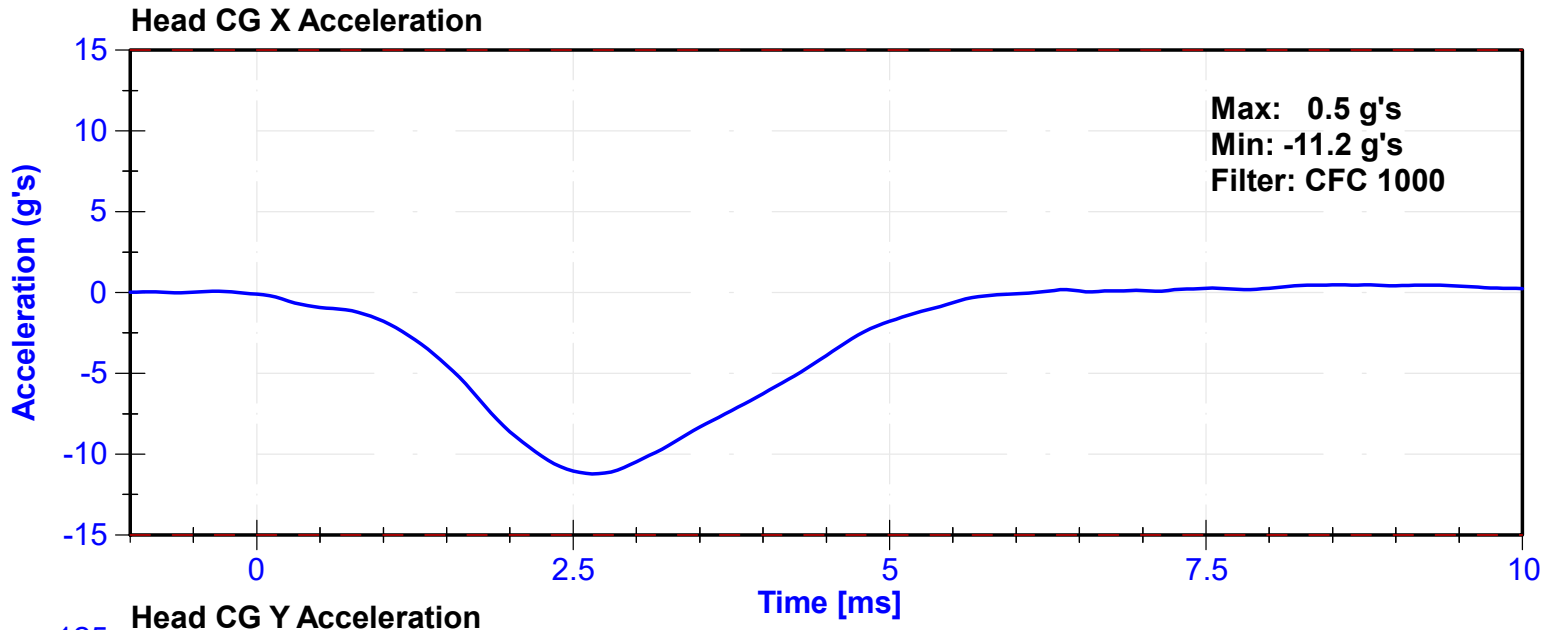
Head CG X Acceleration
Max: 0.5 g's
Min: -11.2 g's
Filter: CFC 1000
Acceleration (g's)
15
10
5
0
-5
-10
-15
0
2.5
5
7.5
10
Time [ms]

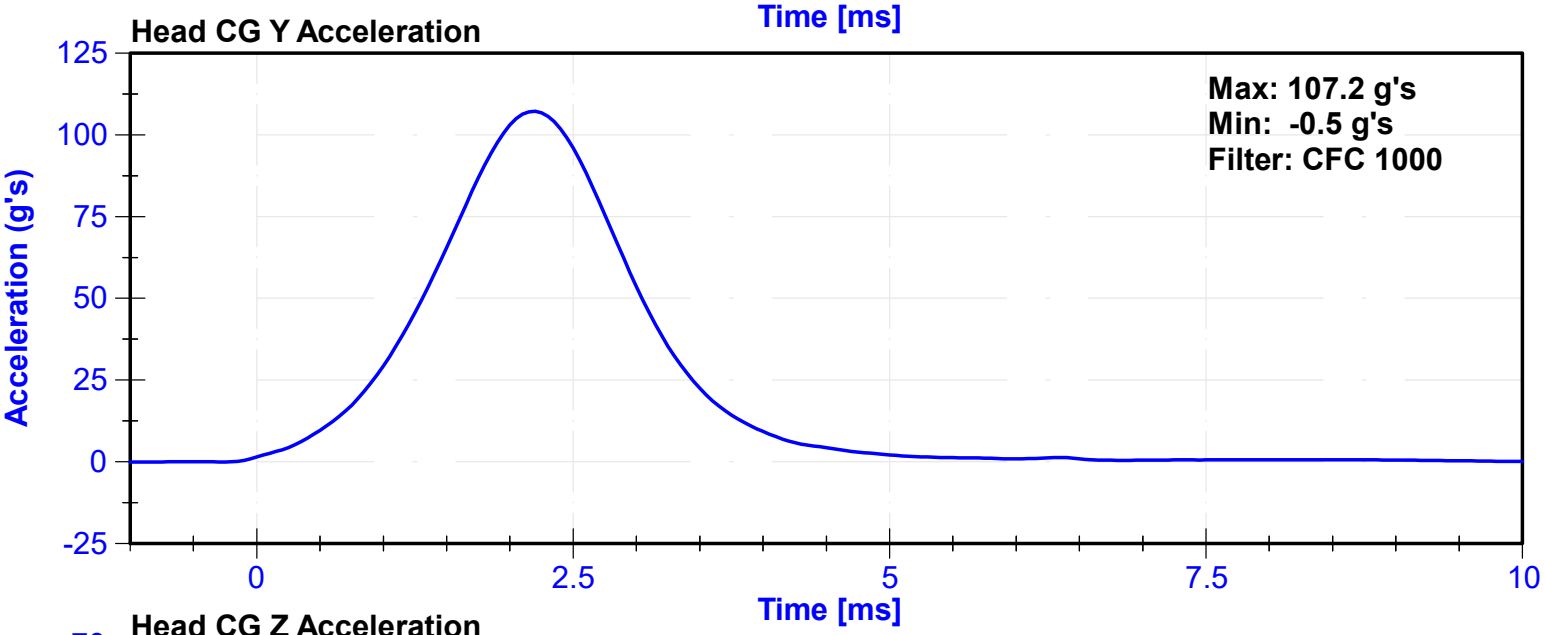
Head CG Y Acceleration
Max: 107.2 g's
Min: -0.5 g's
Filter: CFC 1000
Acceleration (g's)
125
100
75
50
25
0
-25
0
2.5
5
7.5
10
Time [ms]

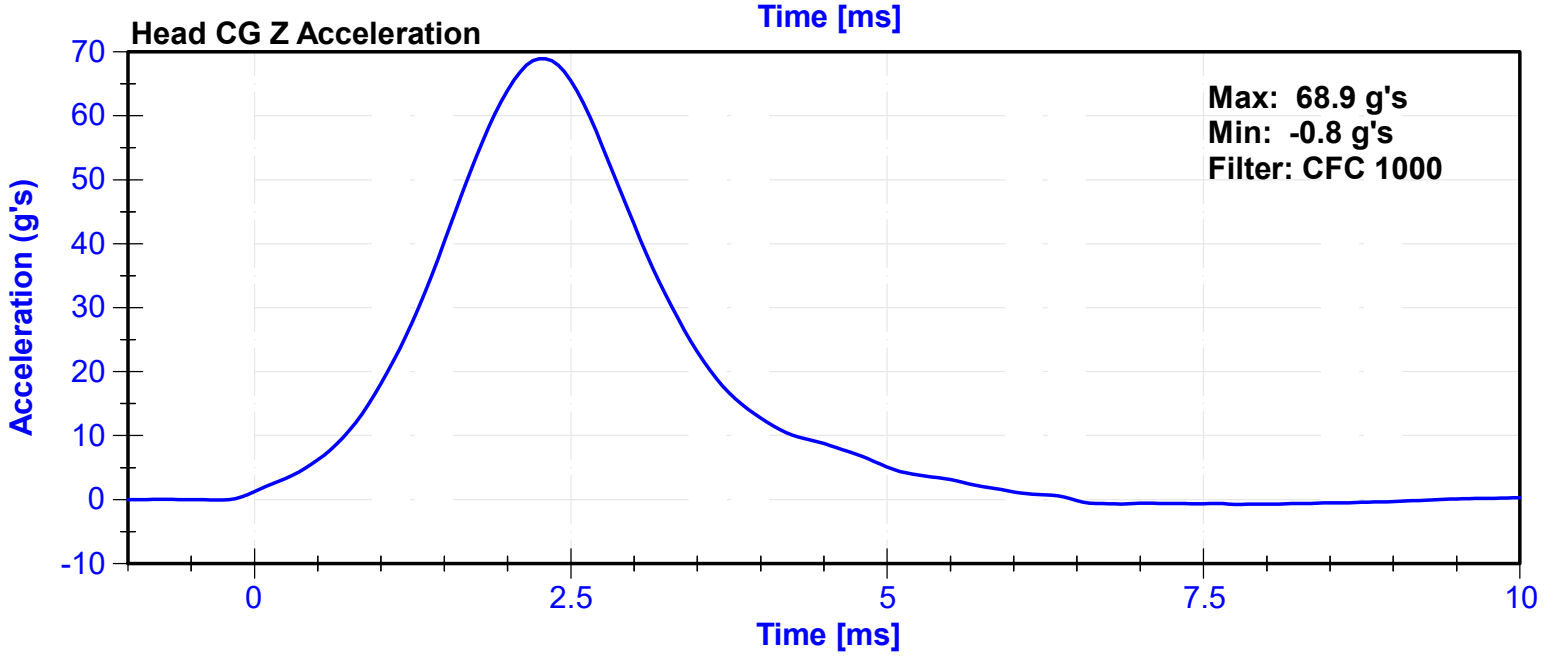
Head CG Z Acceleration
Max: 68.9 g's
Min: -0.8 g's
Filter: CFC 1000
Acceleration (g's)
70
60
50
40
30
20
10
0
-10
0
2.5
5
7.5
10
Time [ms]

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.8	Pass
Humidity	10	70	%	29	Pass
Velocity	5.51	5.63	m/s	5.538	Pass
Pendulum Impulse at 10ms	2.2	2.8	m/s	2.28	Pass
Pendulum Impulse at 15ms	3.3	4.1	m/s	3.48	Pass
Pendulum Impulse at 20ms	4.4	5.4	m/s	4.78	Pass
Pendulum Impulse at 25ms	5.4	6.1	m/s	5.76	Pass
Pendulum Impulse from 25 to 100ms	5.5	6.2	m/s	5.93	Pass
Neck Rotation	71	81	deg	72.0	Pass
Time at Maximum Rotation	50	70	ms	60.3	Pass
Moment about the OC	36	44	Nm	43.5	Pass
Moment Decay to 0 Nm	102	126	ms	111.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	7231C-750	10/31/2023	4/28/2024
Pendulum Potentiometer	Servo	4961	10/2/2023	10/1/2024
Condyle Potentiometer	Servo	DS185	10/2/2023	10/1/2024
Upper Neck Load Cell	Denton	1716ATF_2184-FY	5/18/2023	5/17/2024

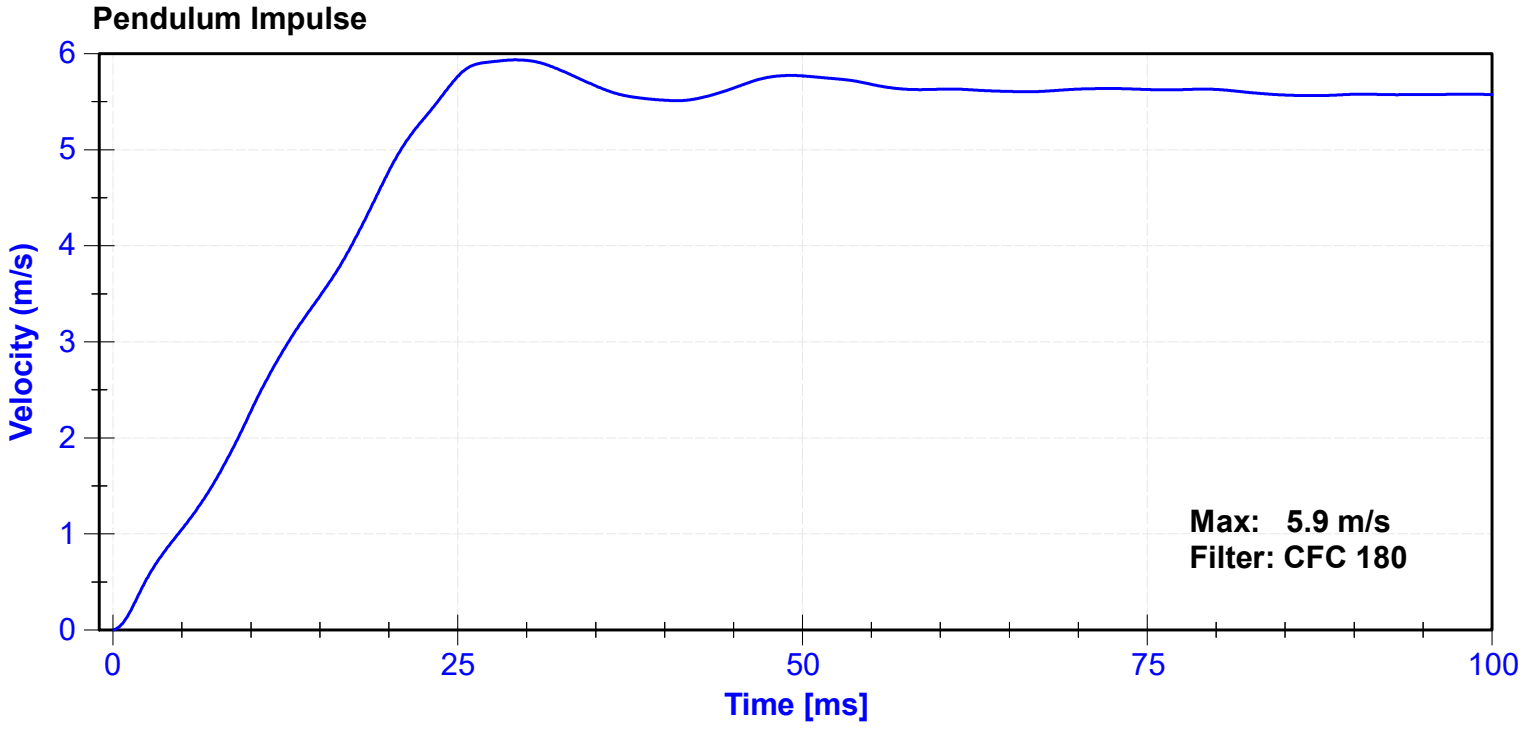

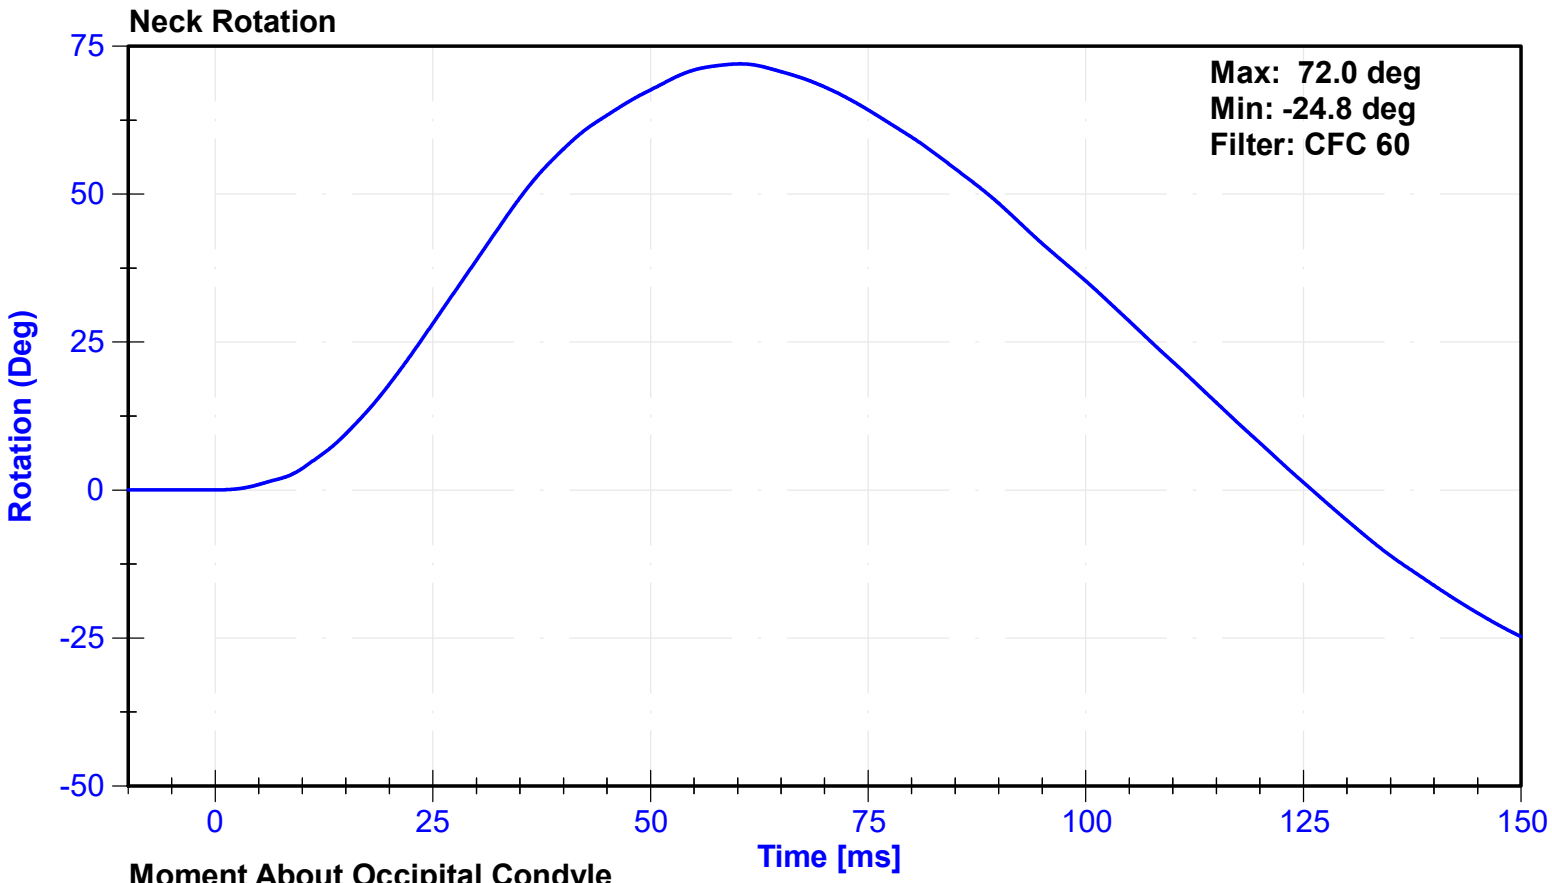
Neck Rotation
Max: 72.0 deg
Min: -24.8 deg
Filter: CFC 60
Rotation (Deg)
75
50
25
0
-25
-50
0
25
50
75
100
125
150
Time [ms]

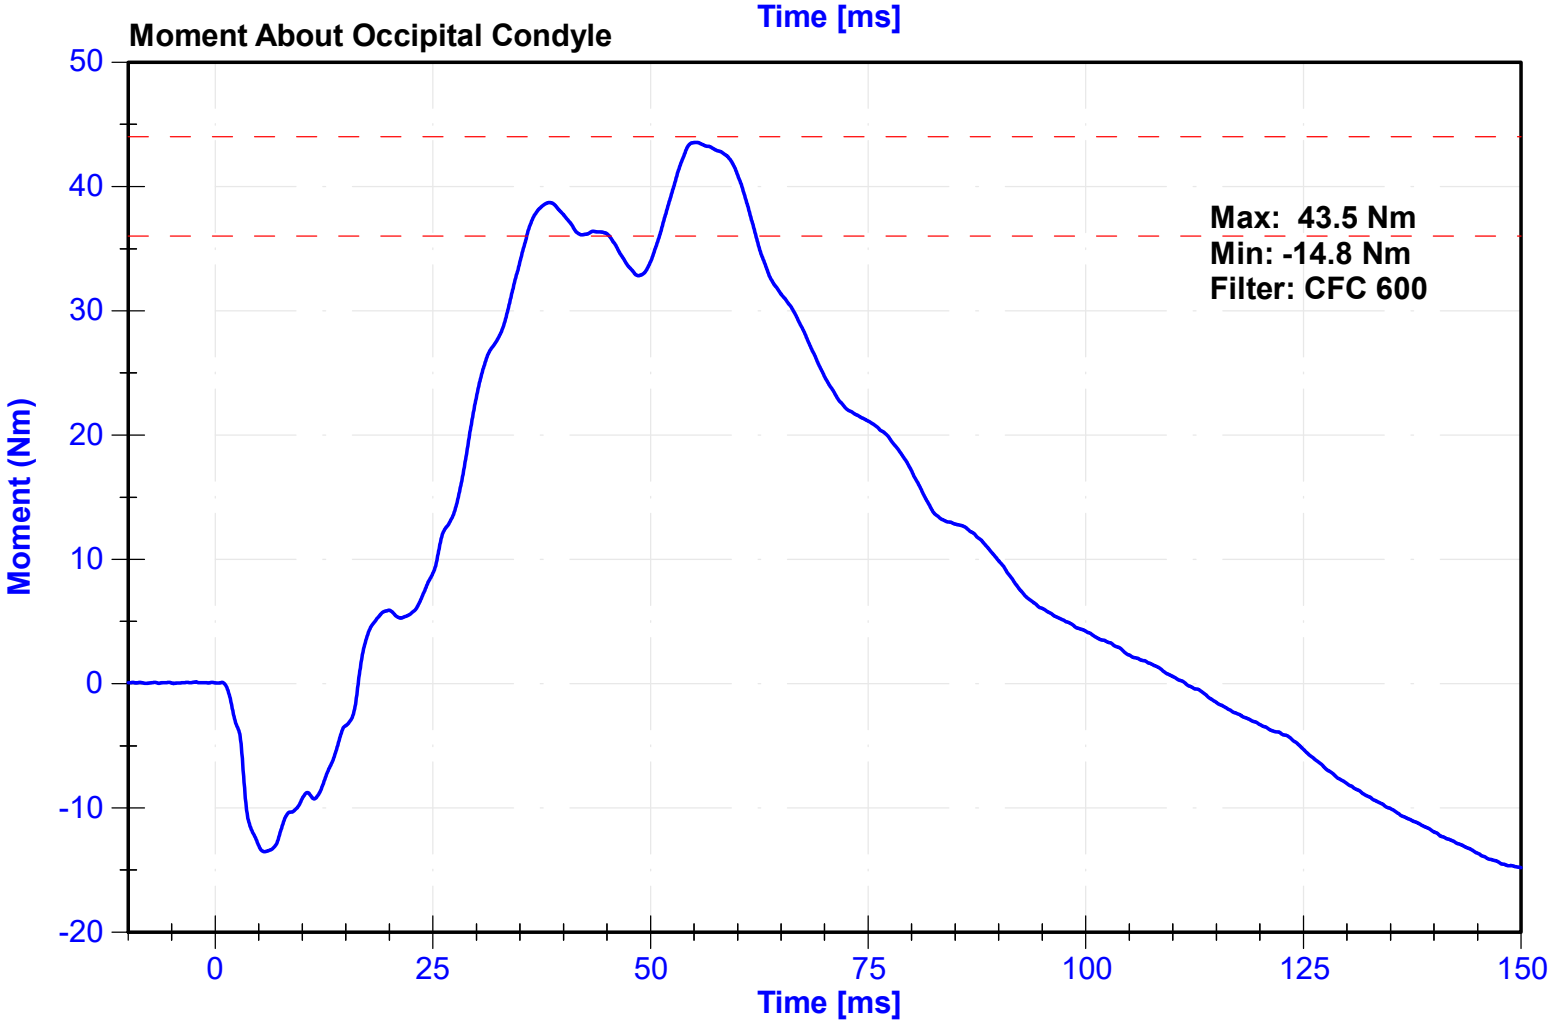
Moment About Occipital Condyle
Max: 43.5 Nm
Min: -14.8 Nm
Filter: CFC 600
Moment (Nm)
50
40
30
20
10
0
-10
-20
0
25
50
75
100
125
150
Time [ms]

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.8	Pass
Humidity	10	70	%	29	Pass
Velocity	4.2	4.4	m/s	4.28	Pass
Probe Acceleration	13	18	g's	16.5	Pass
Shoulder Deflection	28	37	mm	28.7	Pass
Lateral Upper Spine Acceleration	17	22	g's	19.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Shoulder Potentiometer	Servo	053GFE	11/17/2023	5/17/2024
Upper Spine Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024

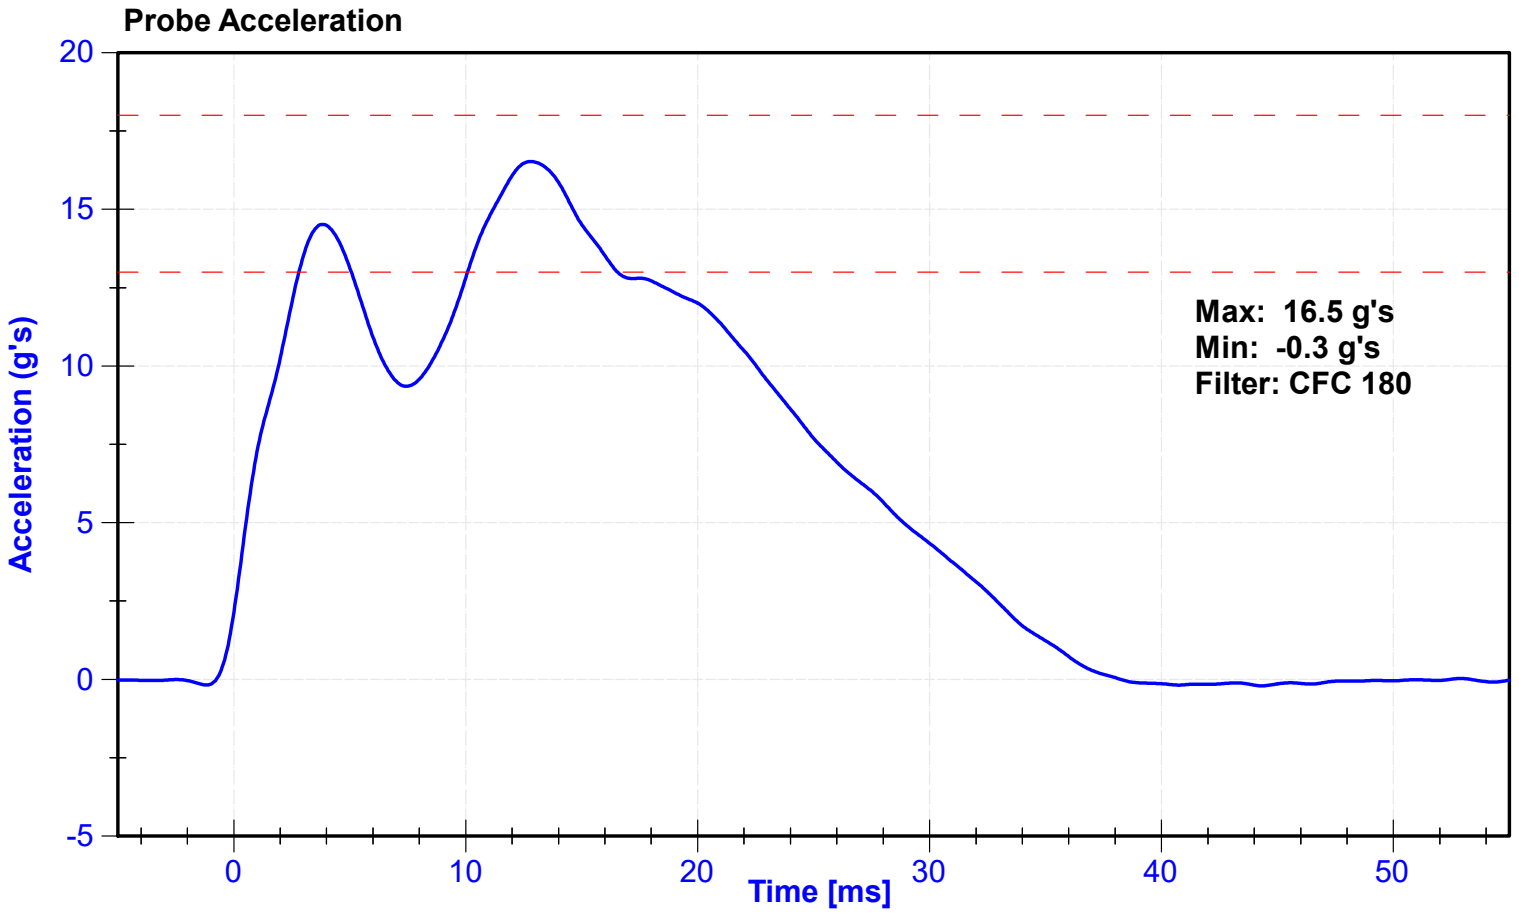

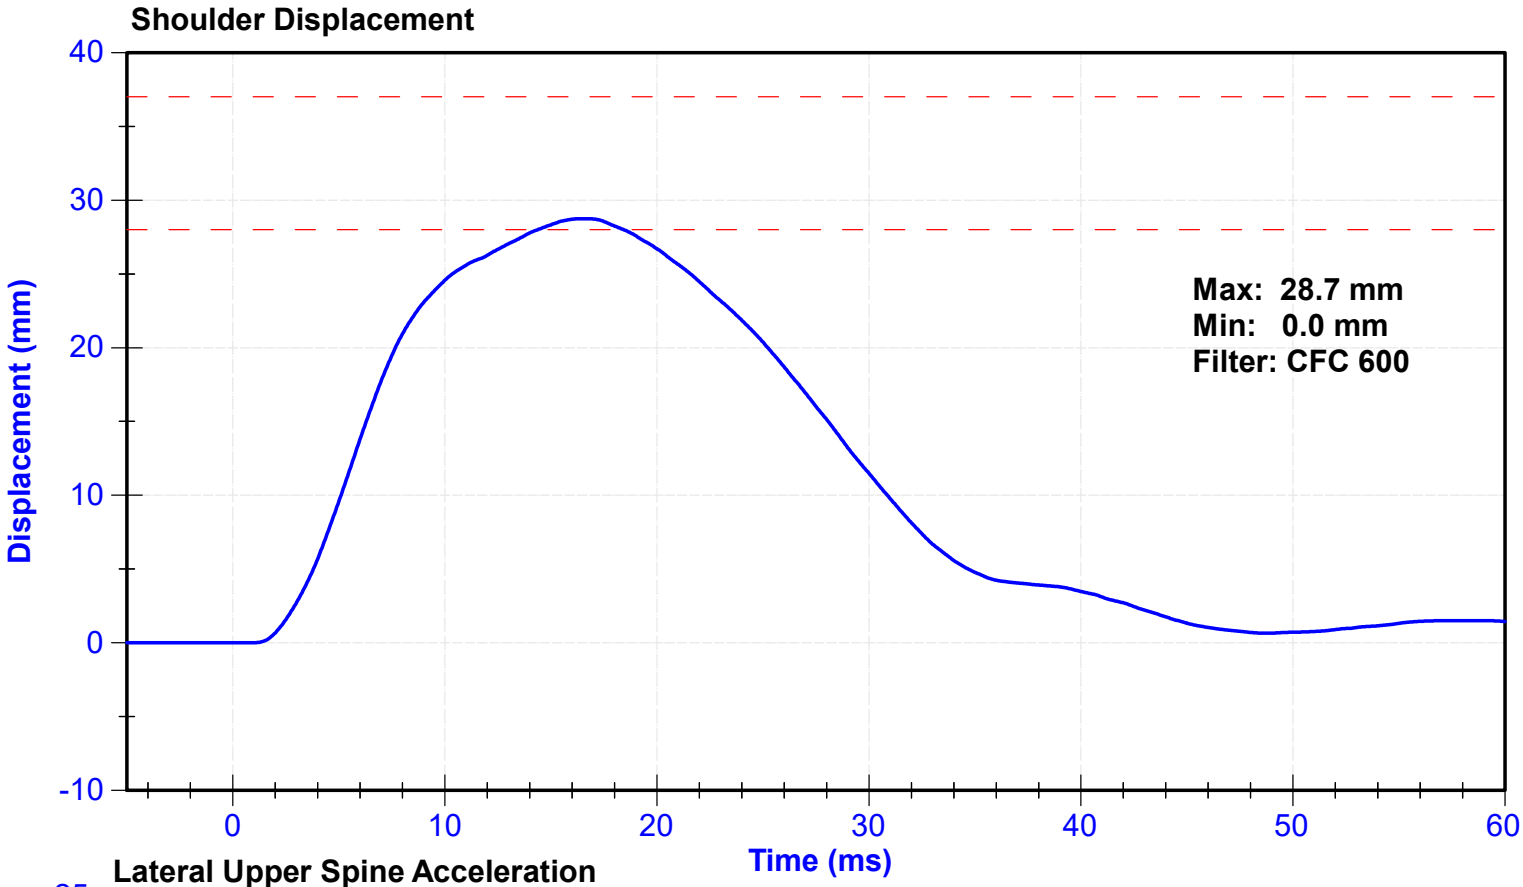
Shoulder Displacement
Displacement (mm)
Time (ms)
Max: 28.7 mm
Min: 0.0 mm
Filter: CFC 600

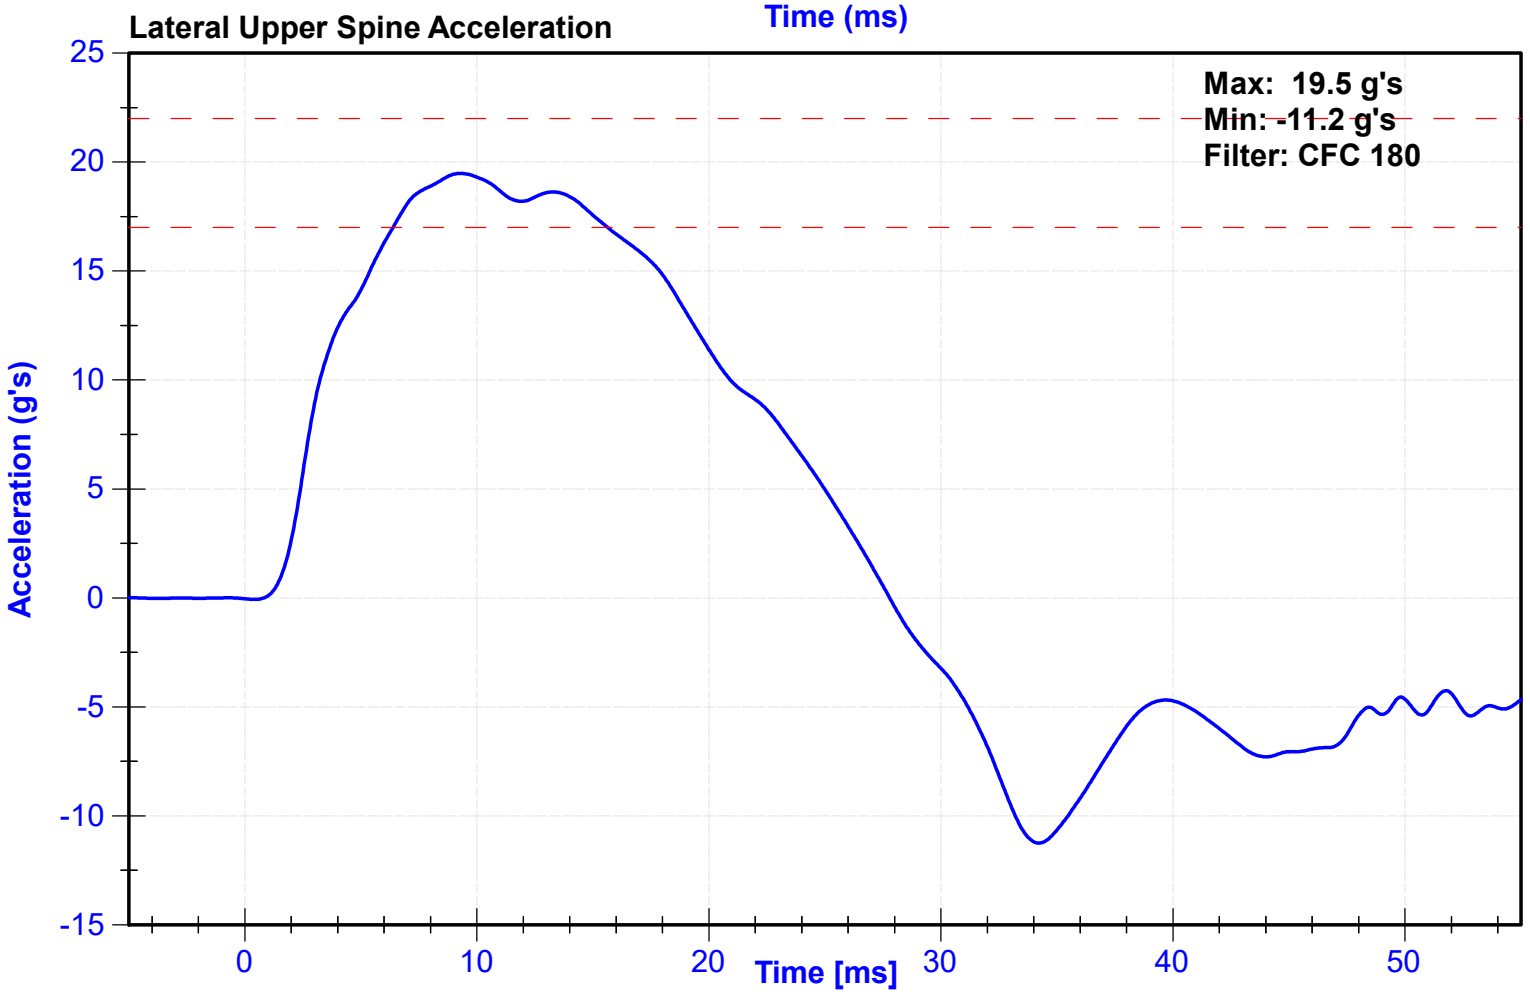
Lateral Upper Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 19.5 g's
Min: -11.2 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	24	Pass
Velocity	6.6	6.8	m/s	6.63	Pass
Probe Acceleration after 5 ms	30	36	g's	35.6	Pass
Lateral Upper Spine Acceleration	34	43	g's	34.8	Pass
Lateral Lower Spine Acceleration	29	37	g's	29.5	Pass
Shoulder Deflection	31	40	mm	31.1	Pass
Upper Thorax Rib Deflection	25	32	mm	25.5	Pass
Mid Thorax Rib Deflection	30	36	mm	30.0	Pass
Lower Thorax Rib Deflection	32	38	mm	32.7	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Upper Spine T1 Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024
Upper Spine T12 Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Shoulder Potentiometer	Servo	053GFE	11/17/2023	5/17/2024
Upper Thorax Rib Potentiometer	Servo	2316GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Servo	307GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Servo	1156GFE	11/17/2023	5/17/2024

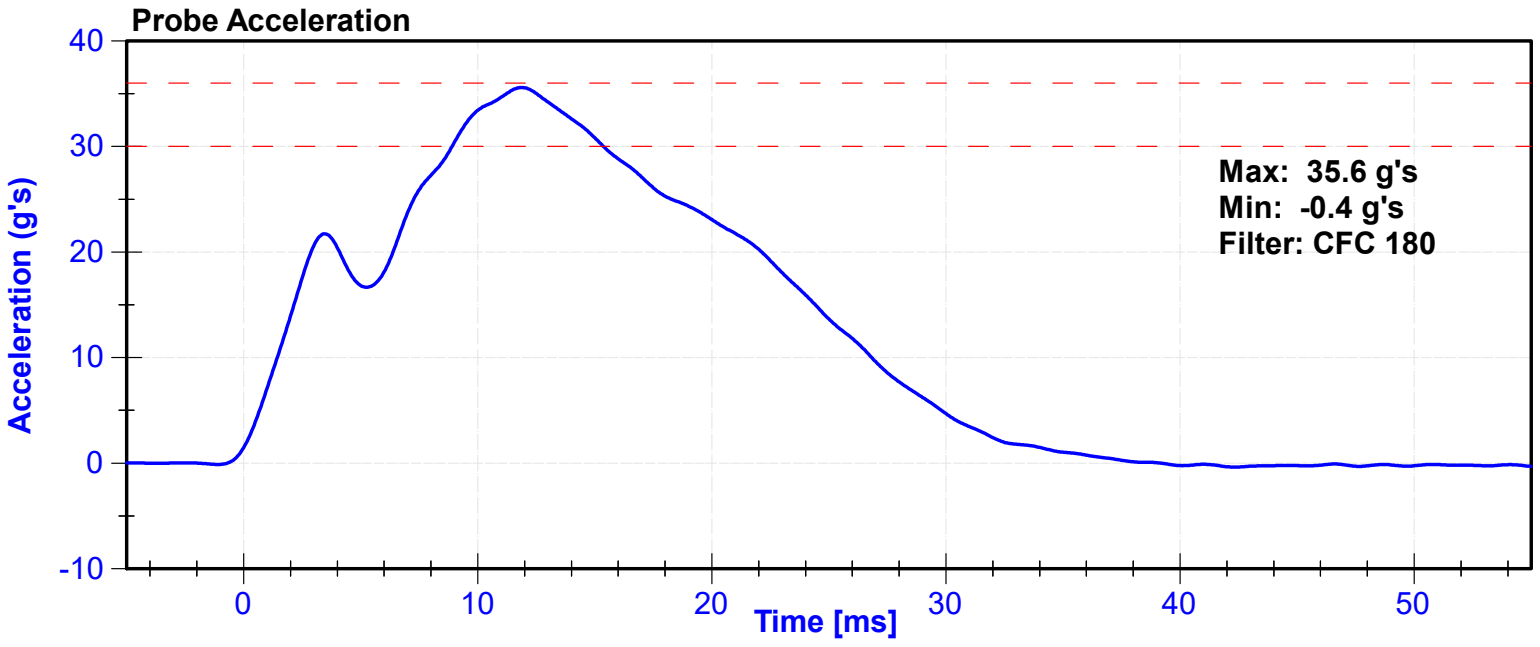

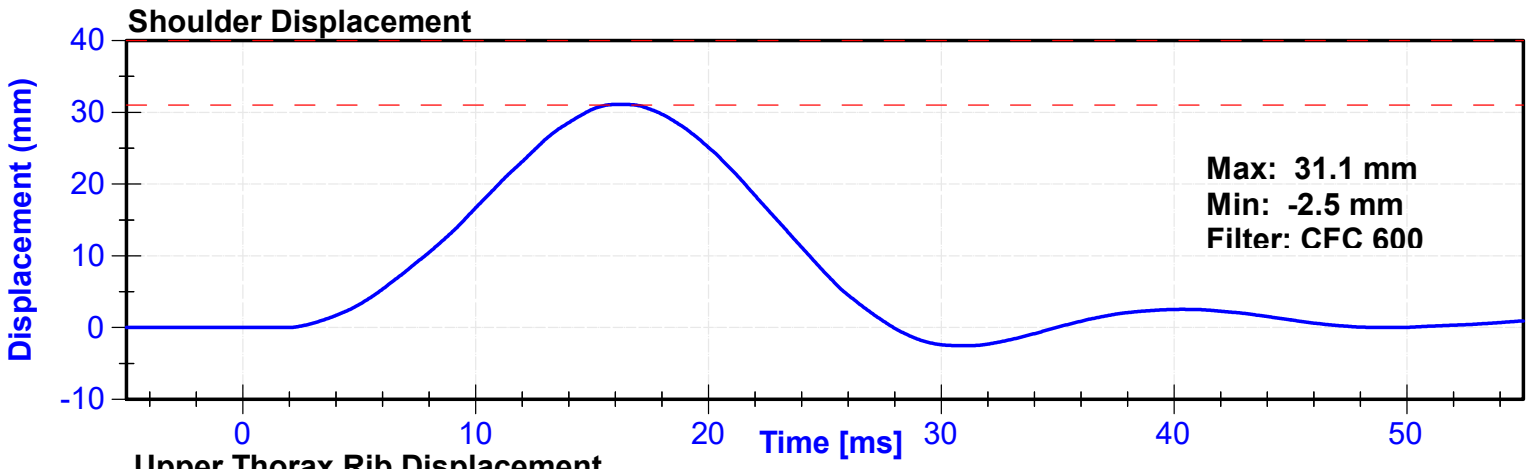
Shoulder Displacement
Displacement (mm)
Time [ms]
Max: 31.1 mm
Min: -2.5 mm
Filter: CFC 600

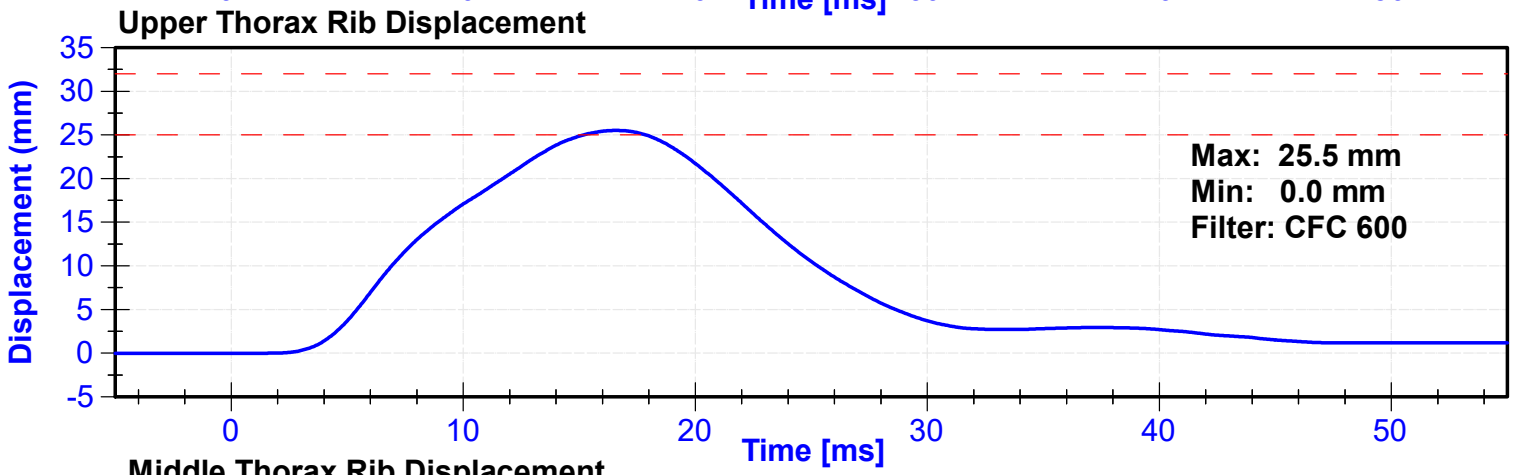
Upper Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 25.5 mm
Min: 0.0 mm
Filter: CFC 600

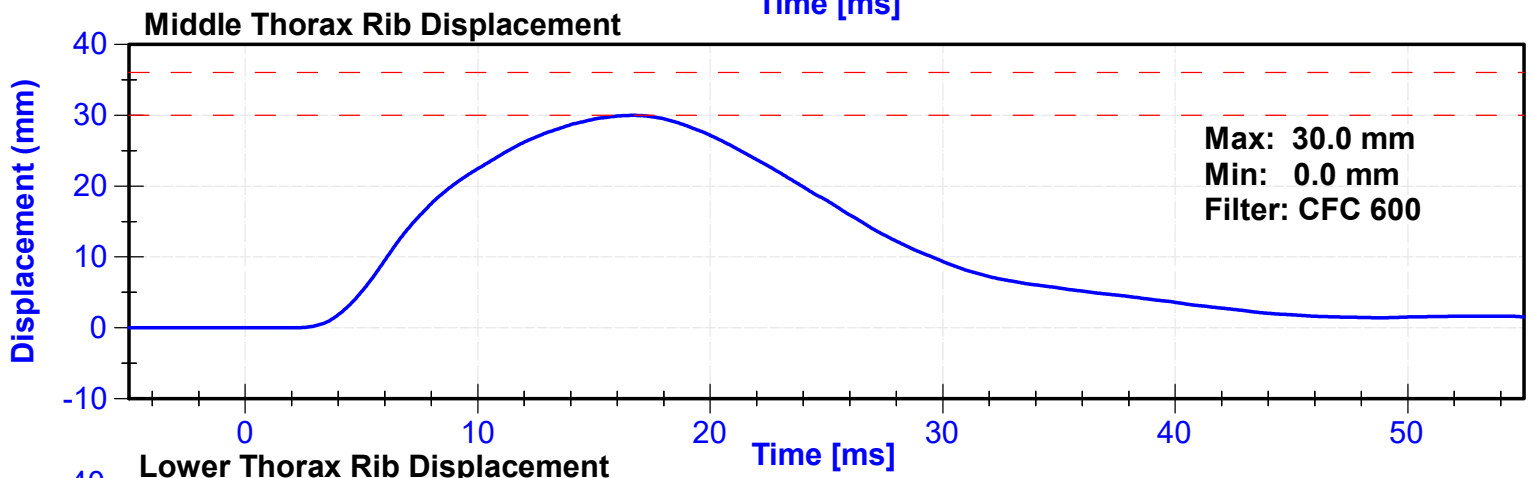
Middle Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 30.0 mm
Min: 0.0 mm
Filter: CFC 600

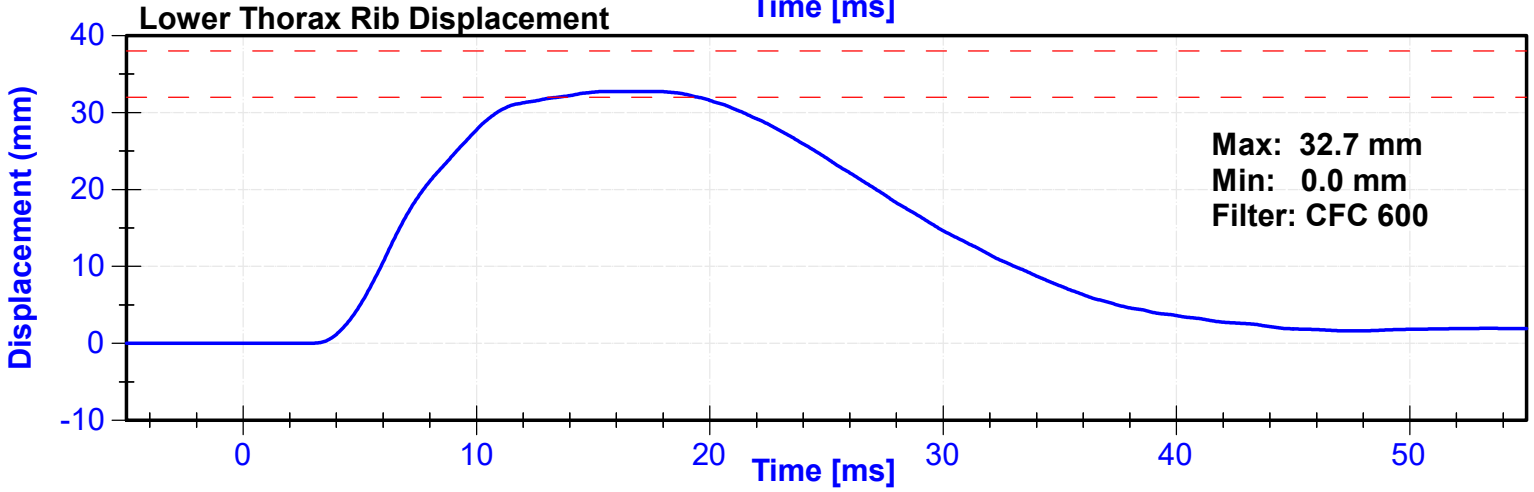
Lower Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 32.7 mm
Min: 0.0 mm
Filter: CFC 600

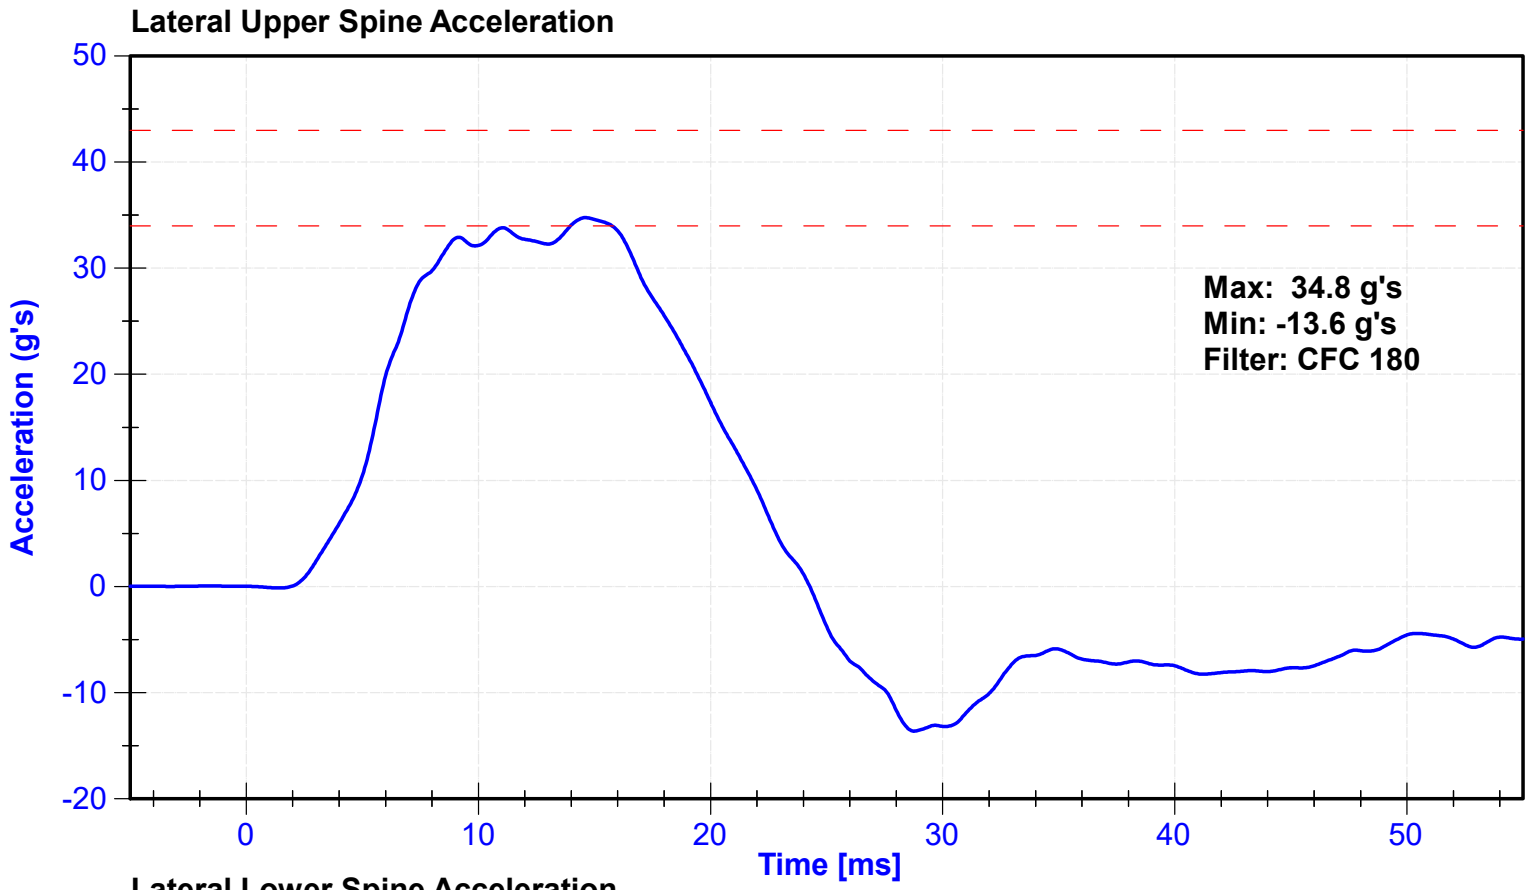
Lateral Upper Spine Acceleration
Acceleration (g's)
50
40
30
20
10
0
-10
-20
0
10
20
30
40
50
Time [ms]
Max: 34.8 g's
Min: -13.6 g's
Filter: CFC 180

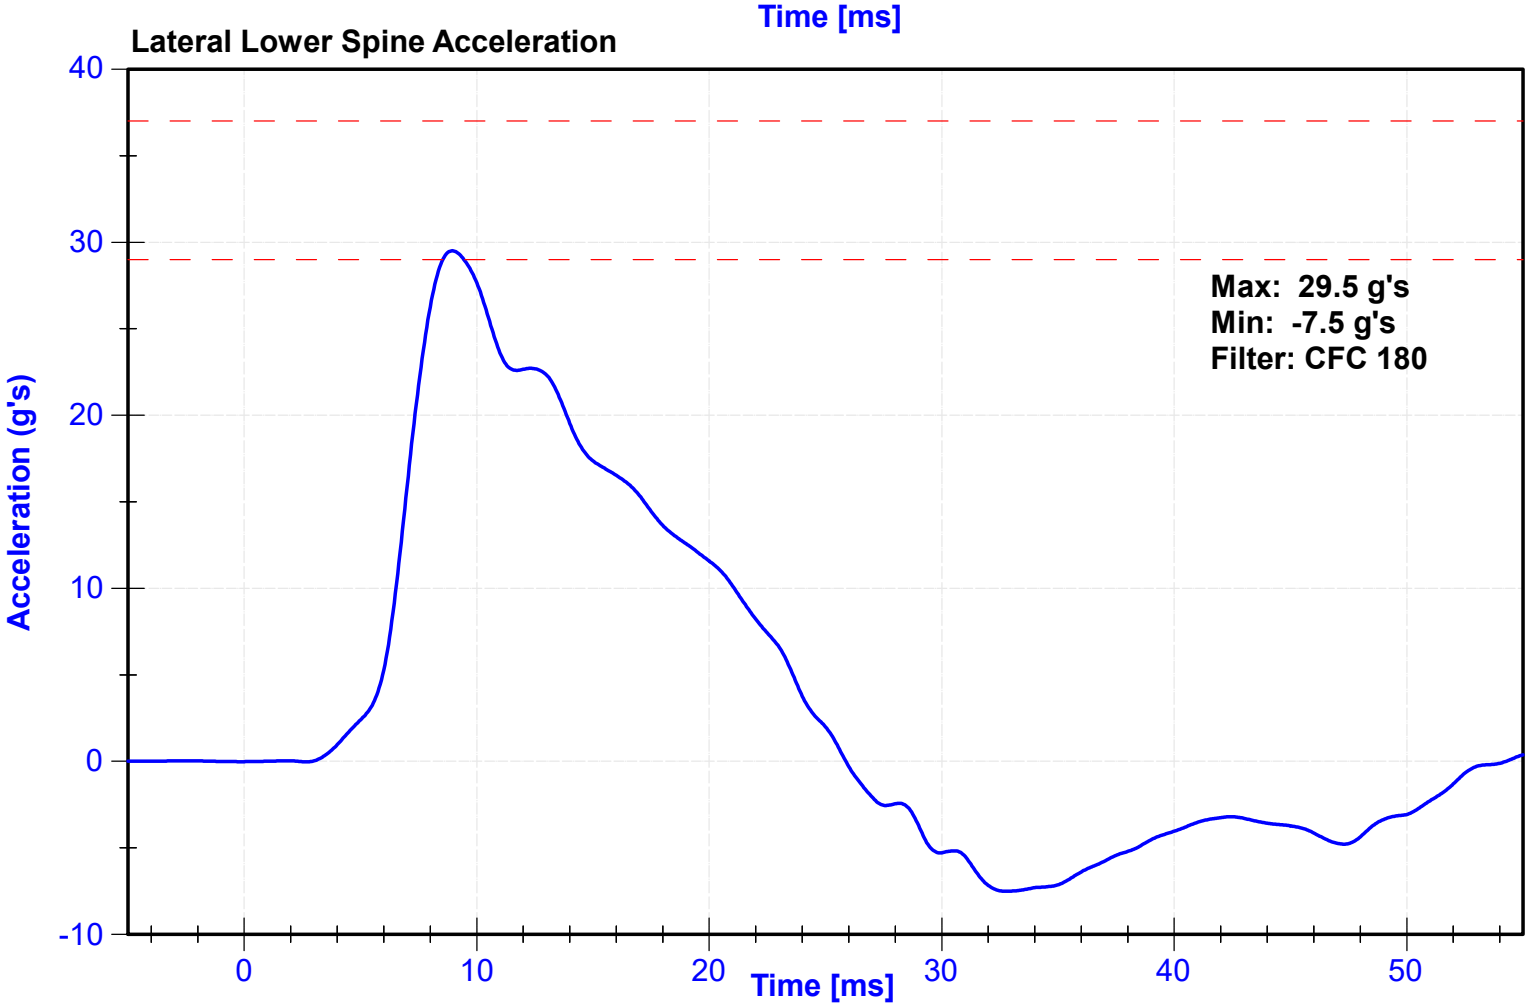
Lateral Lower Spine Acceleration
Acceleration (g's)
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 29.5 g's
Min: -7.5 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	24	Pass
Velocity	4.2	4.4	m/s	4.28	Pass
Probe Acceleration	14	18	g's	16.8	Pass
Lateral Upper Spine Acceleration	13	17	g's	14.9	Pass
Lateral Lower Spine Acceleration	7	11	g's	9.2	Pass
Upper Thorax Rib Deflection	32	40	mm	34.7	Pass
Middle Thorax Rib Deflection	39	45	mm	39.4	Pass
Lower Thorax Rib Deflection	35	43	mm	37.3	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Upper Spine Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024
Lower Spine Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Upper Thorax Rib Potentiometer	Servo	2316GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Servo	307GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Servo	1156GFE	11/17/2023	5/17/2024

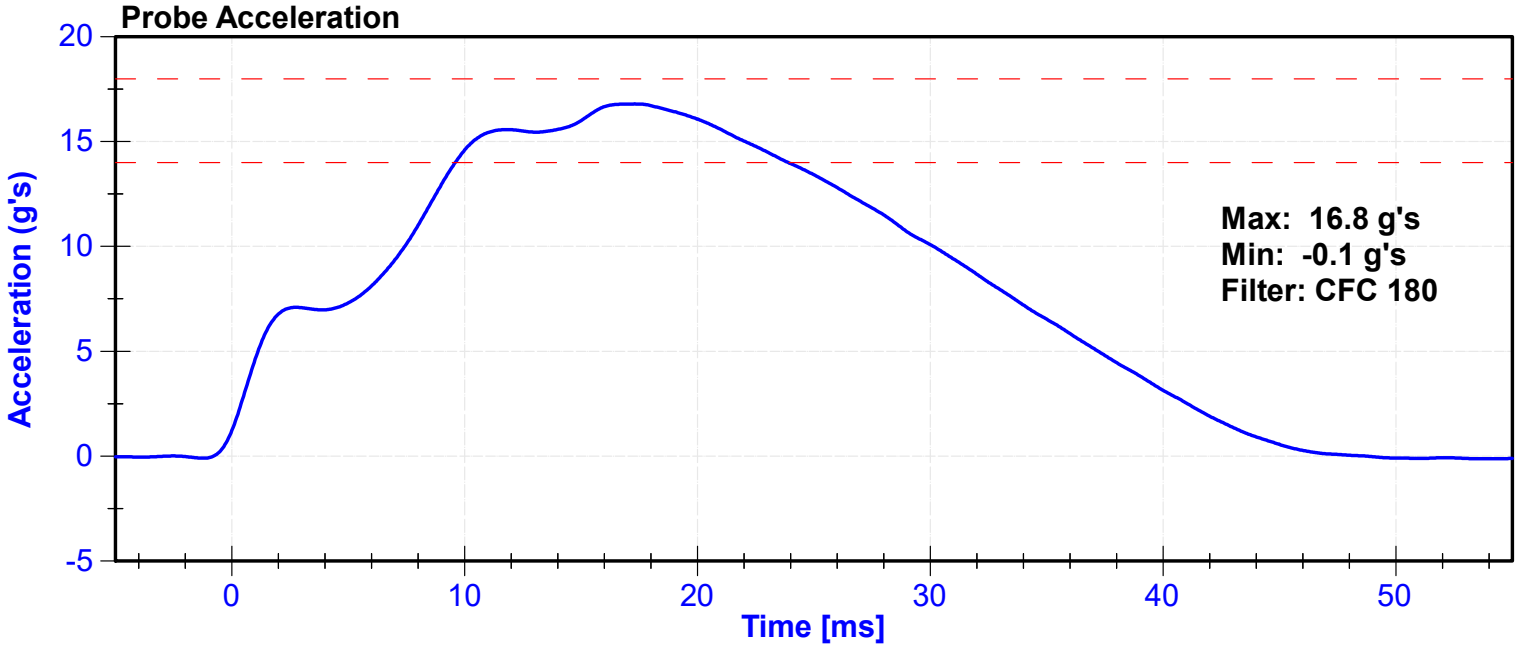

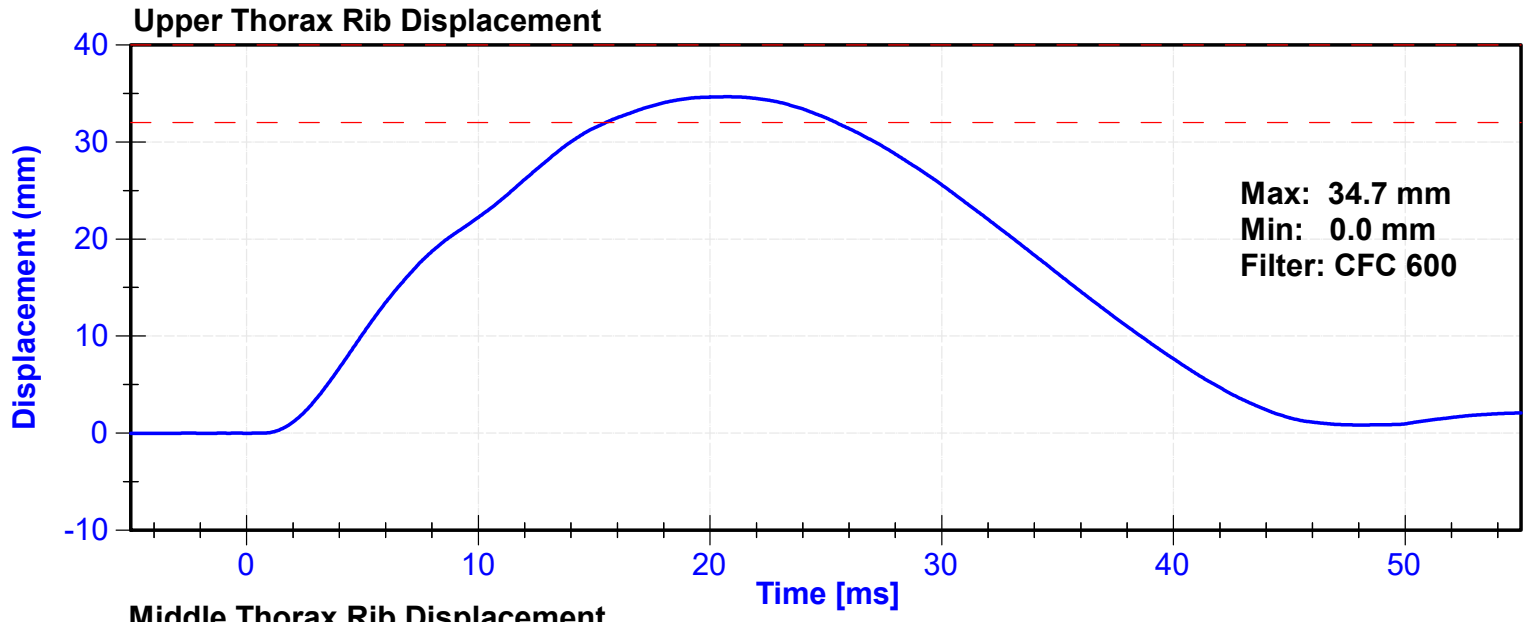
Upper Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 34.7 mm
Min: 0.0 mm
Filter: CFC 600

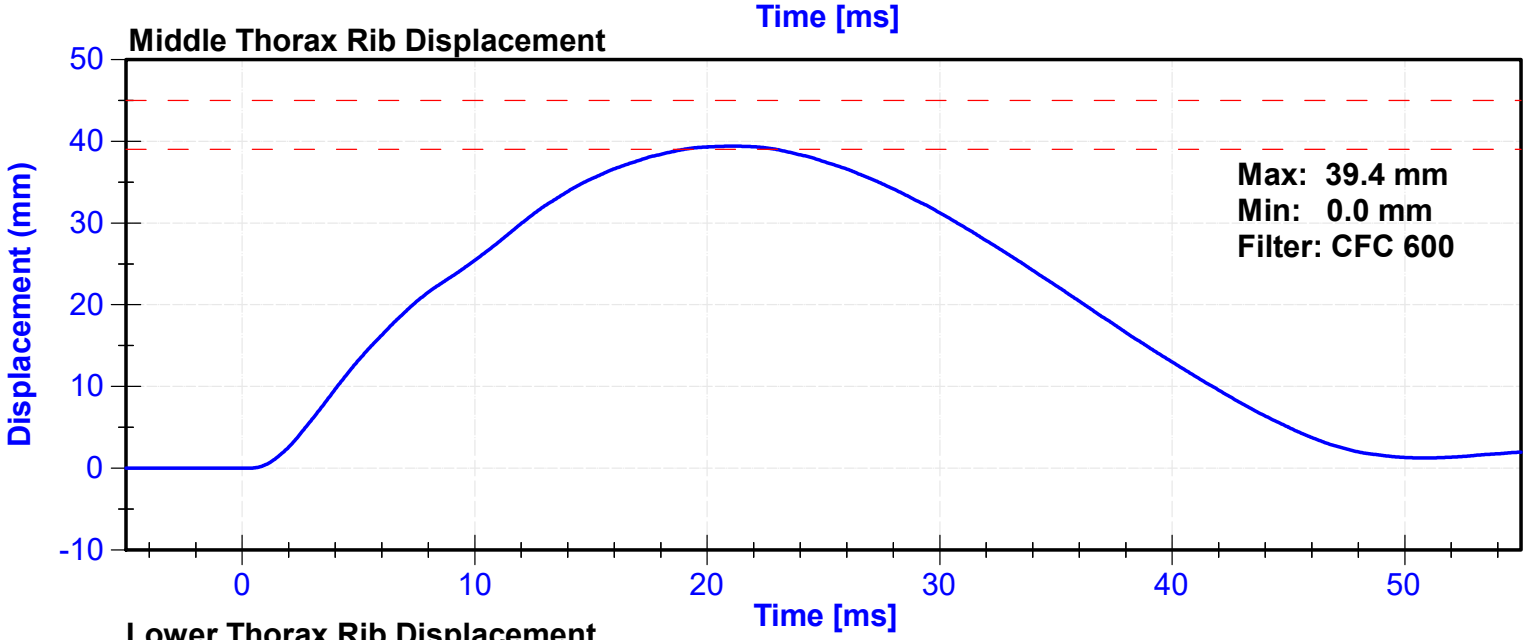
Middle Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 39.4 mm
Min: 0.0 mm
Filter: CFC 600

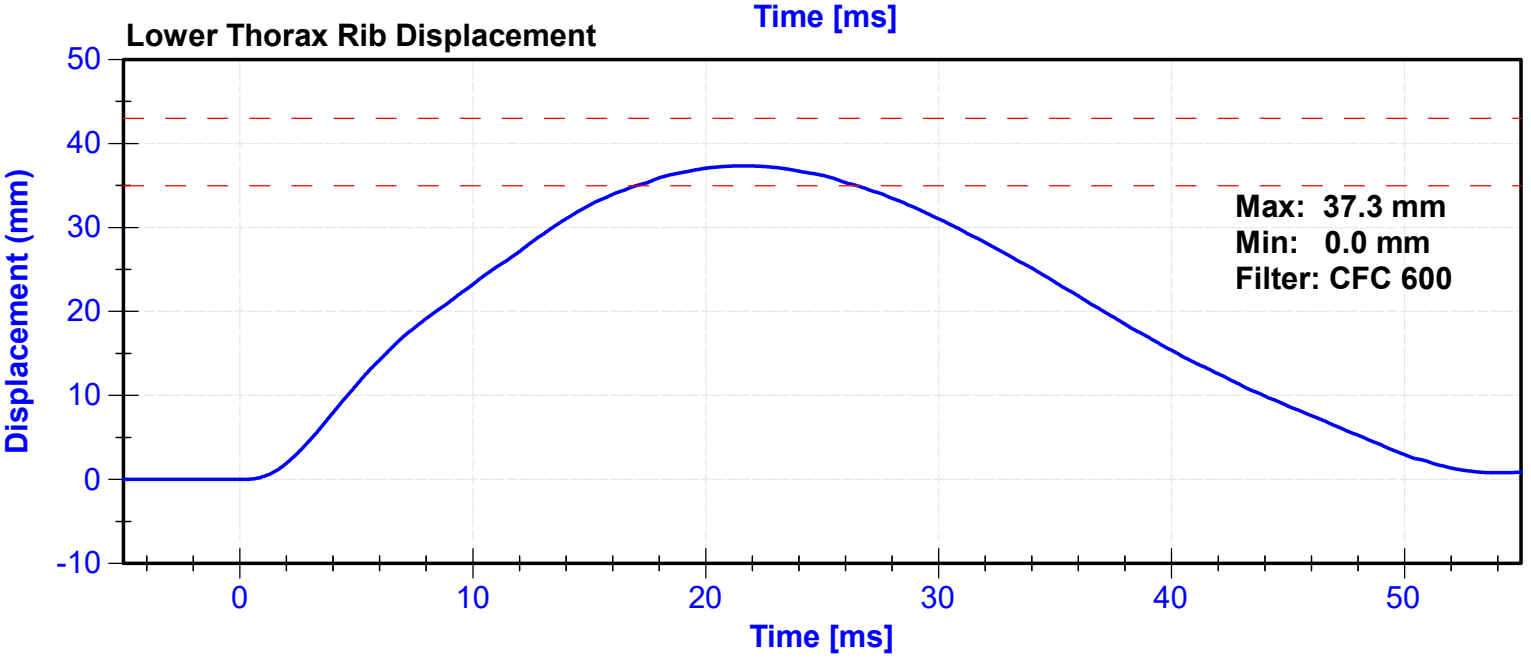
Lower Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 37.3 mm
Min: 0.0 mm
Filter: CFC 600

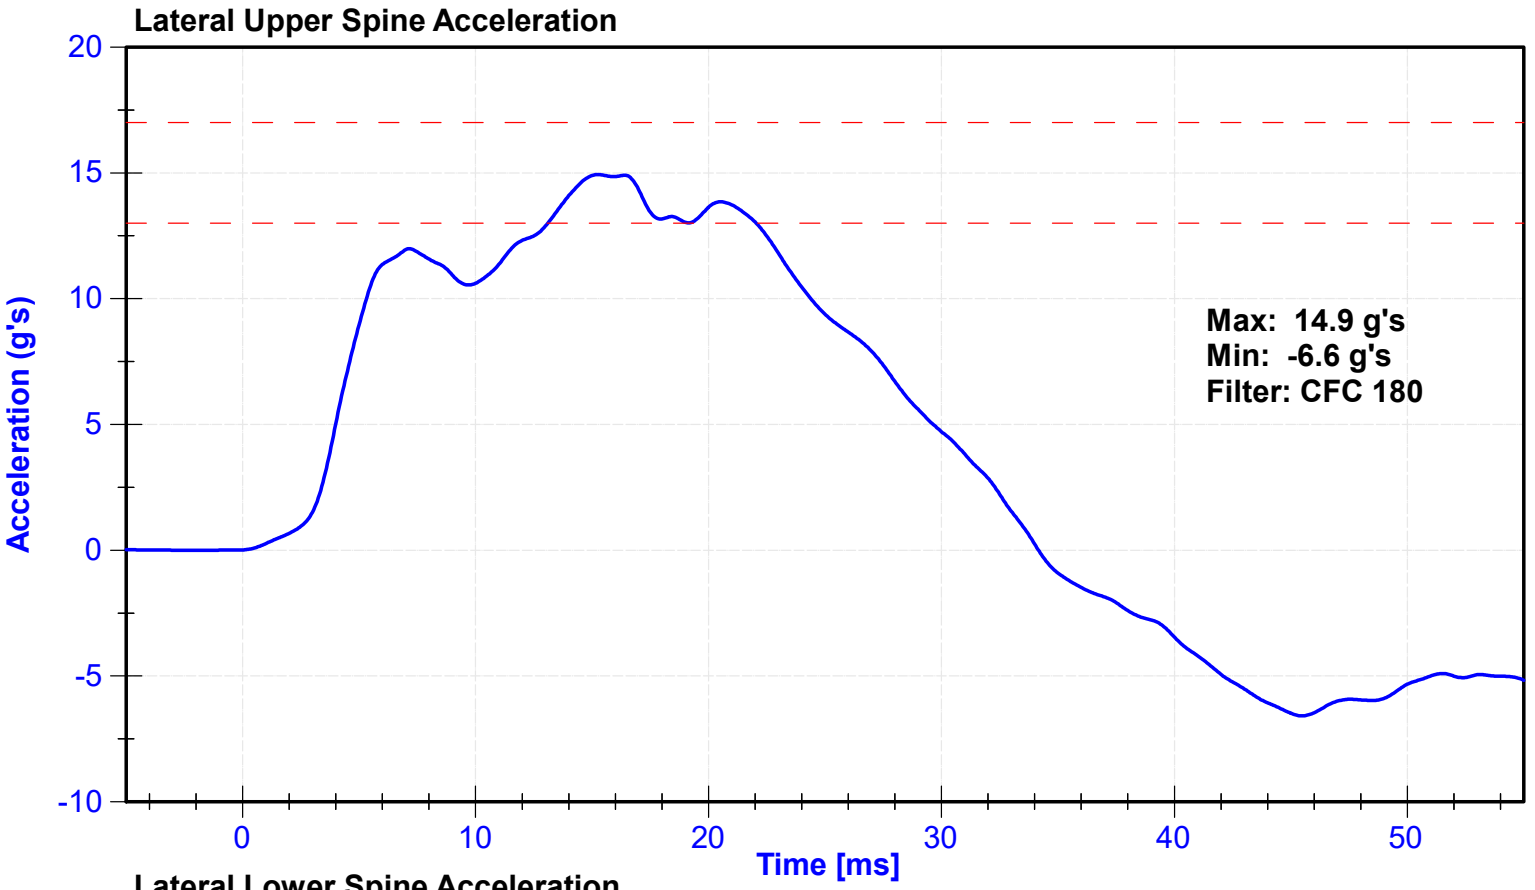
Lateral Upper Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 14.9 g's
Min: -6.6 g's
Filter: CFC 180

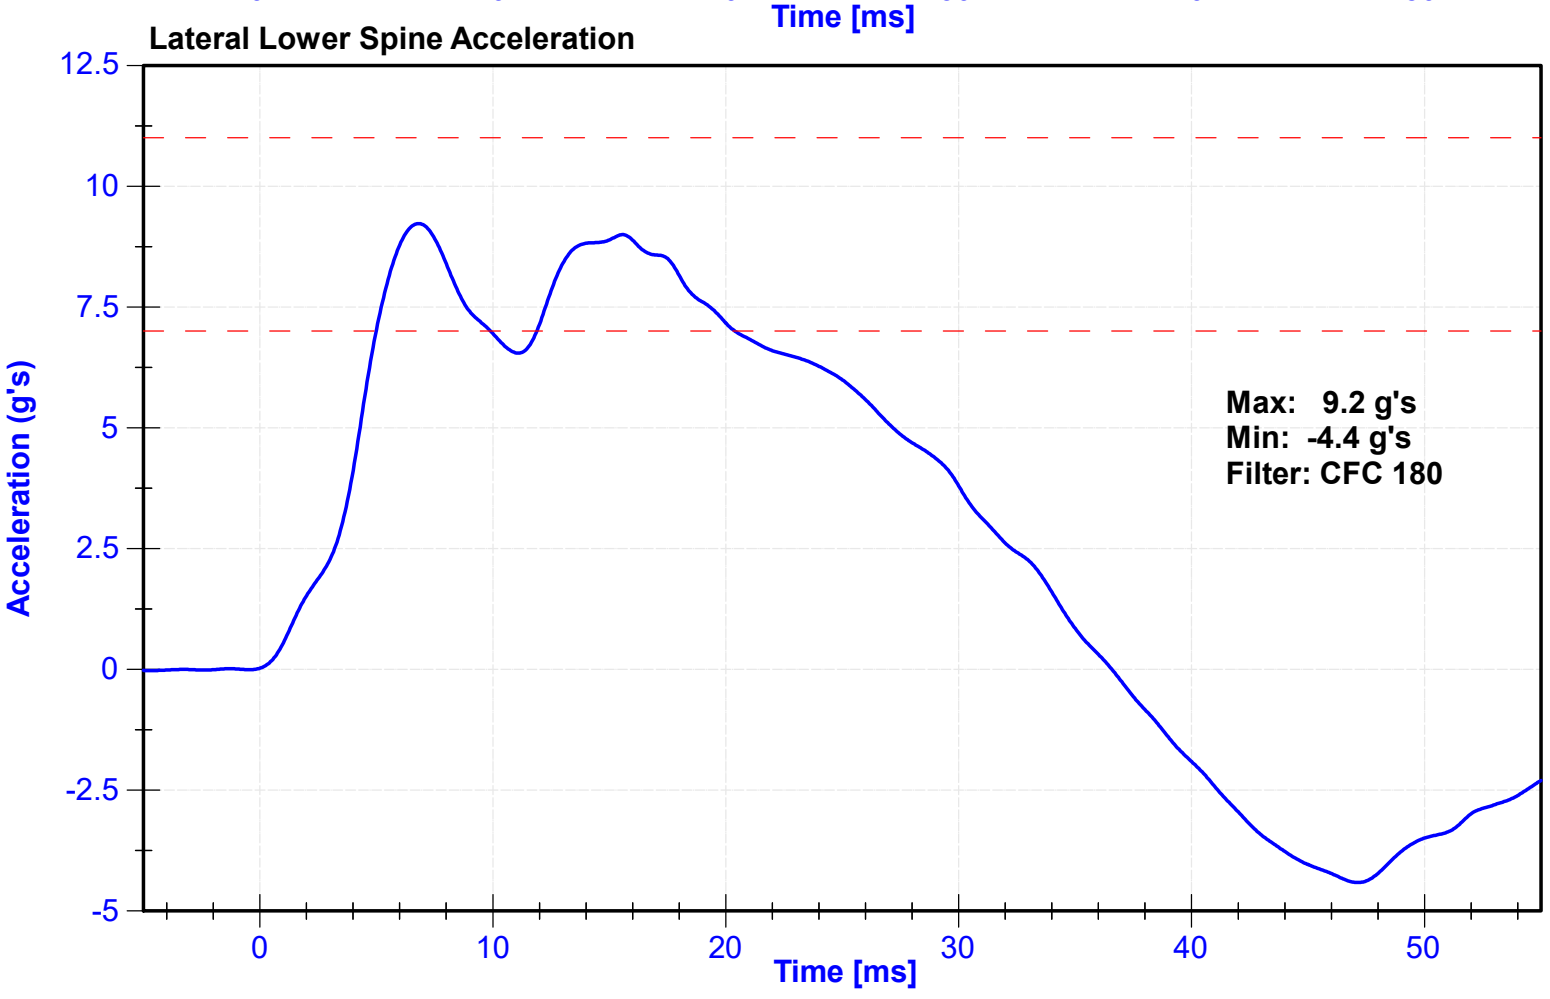
Lateral Lower Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 9.2 g's
Min: -4.4 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	24	Pass
Velocity	4.2	4.4	m/s	4.28	Pass
Probe Acceleration	12	16	g's	15.6	Pass
Lateral Lower Spine Acceleration	9	14	g's	11.5	Pass
Upper Abdomen Rib Deflection	36	47	mm	38.0	Pass
Lower Abdomen Rib Deflection	33	44	mm	36.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Lower Spine Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Upper Abdomen Rib Potentiometer	Servo	060GFE	11/21/2023	5/21/2024
Lower Abdomen Rib Potentiometer	Servo	308GFE	11/17/2023	5/17/2024

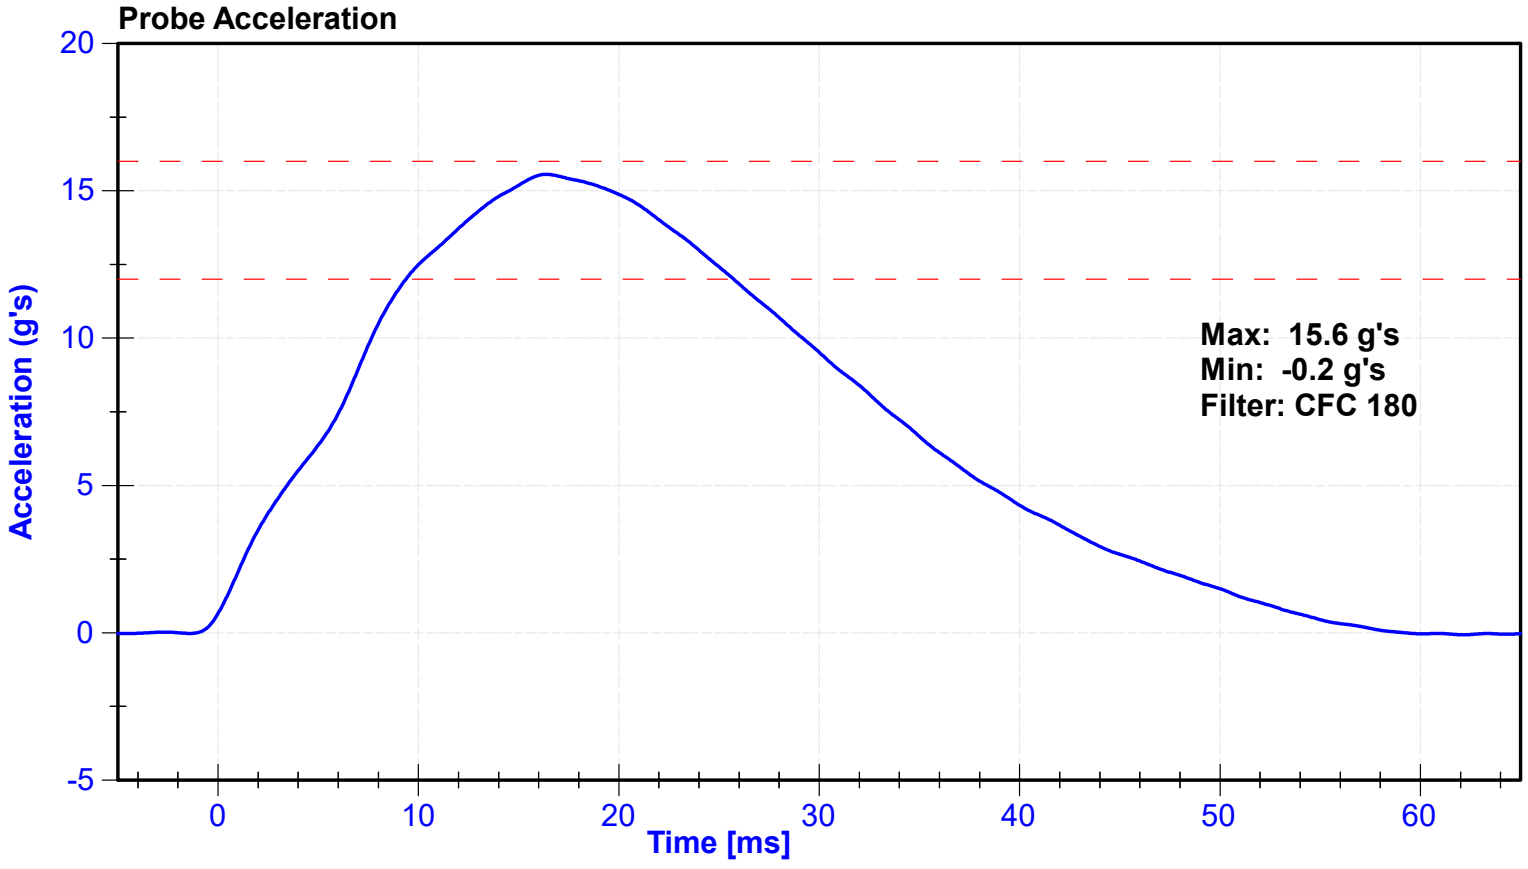

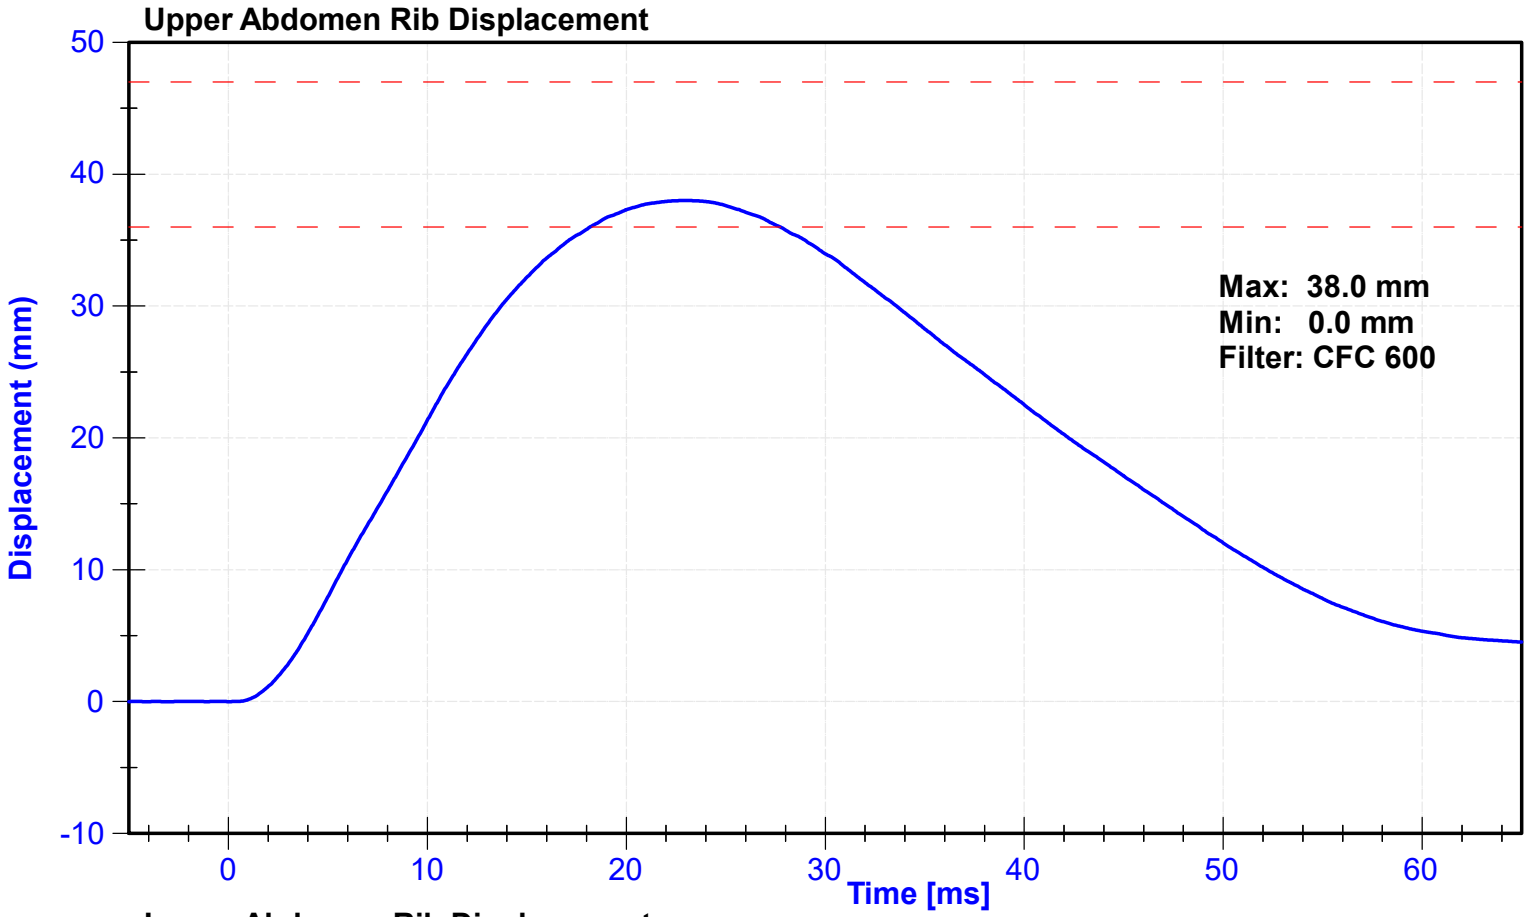
Upper Abdomen Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
60
Time [ms]
Max: 38.0 mm
Min: 0.0 mm
Filter: CFC 600

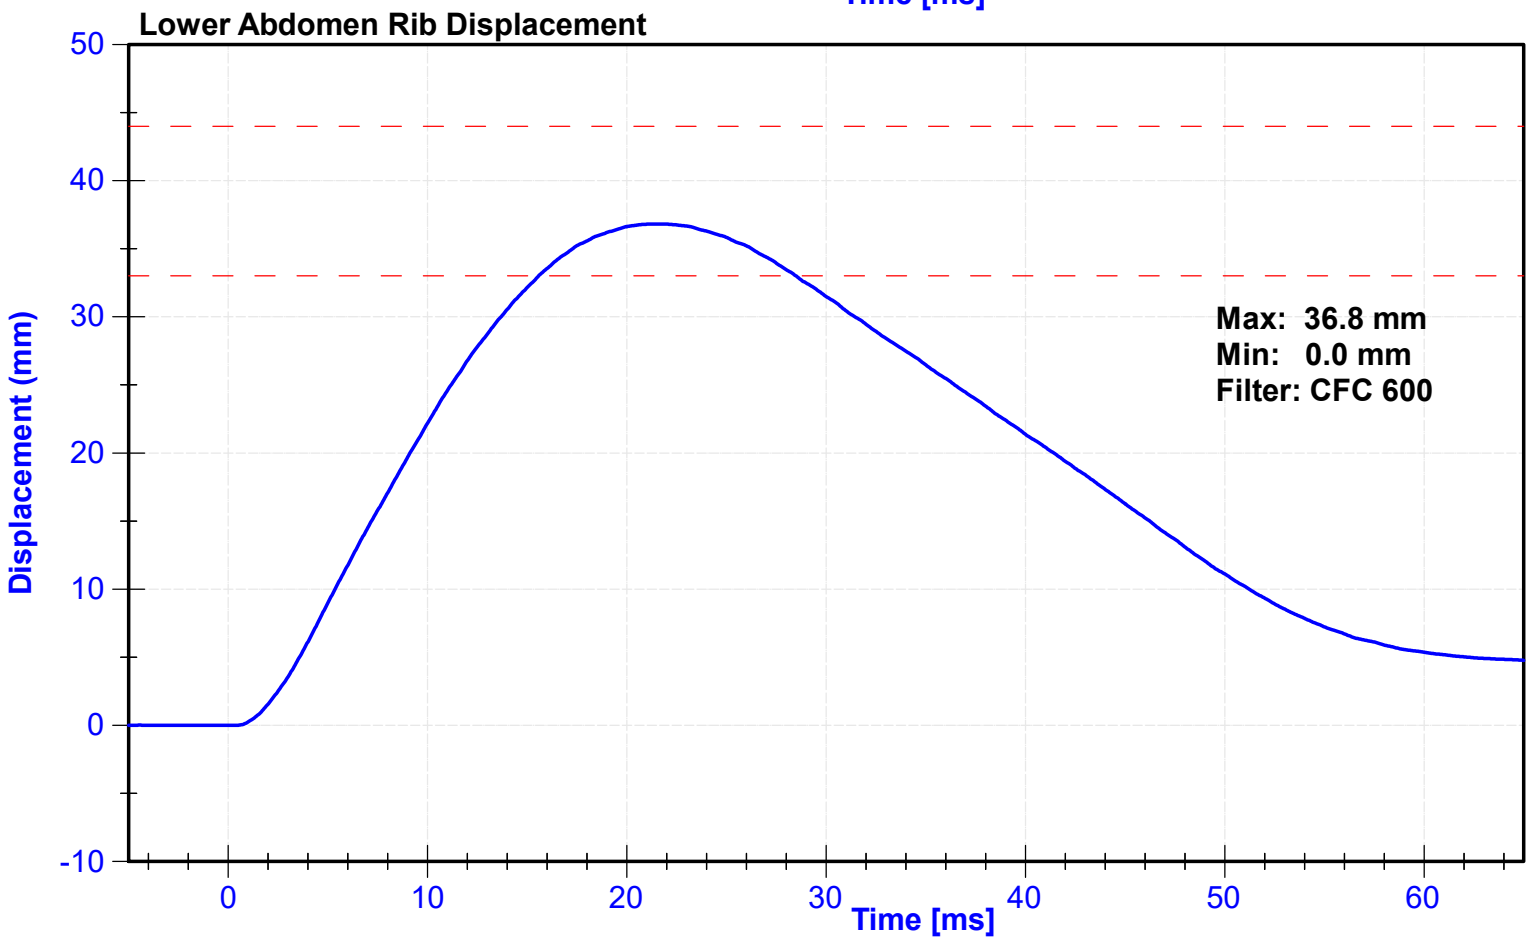
Lower Abdomen Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
60
Time [ms]
Max: 36.8 mm
Min: 0.0 mm
Filter: CFC 600

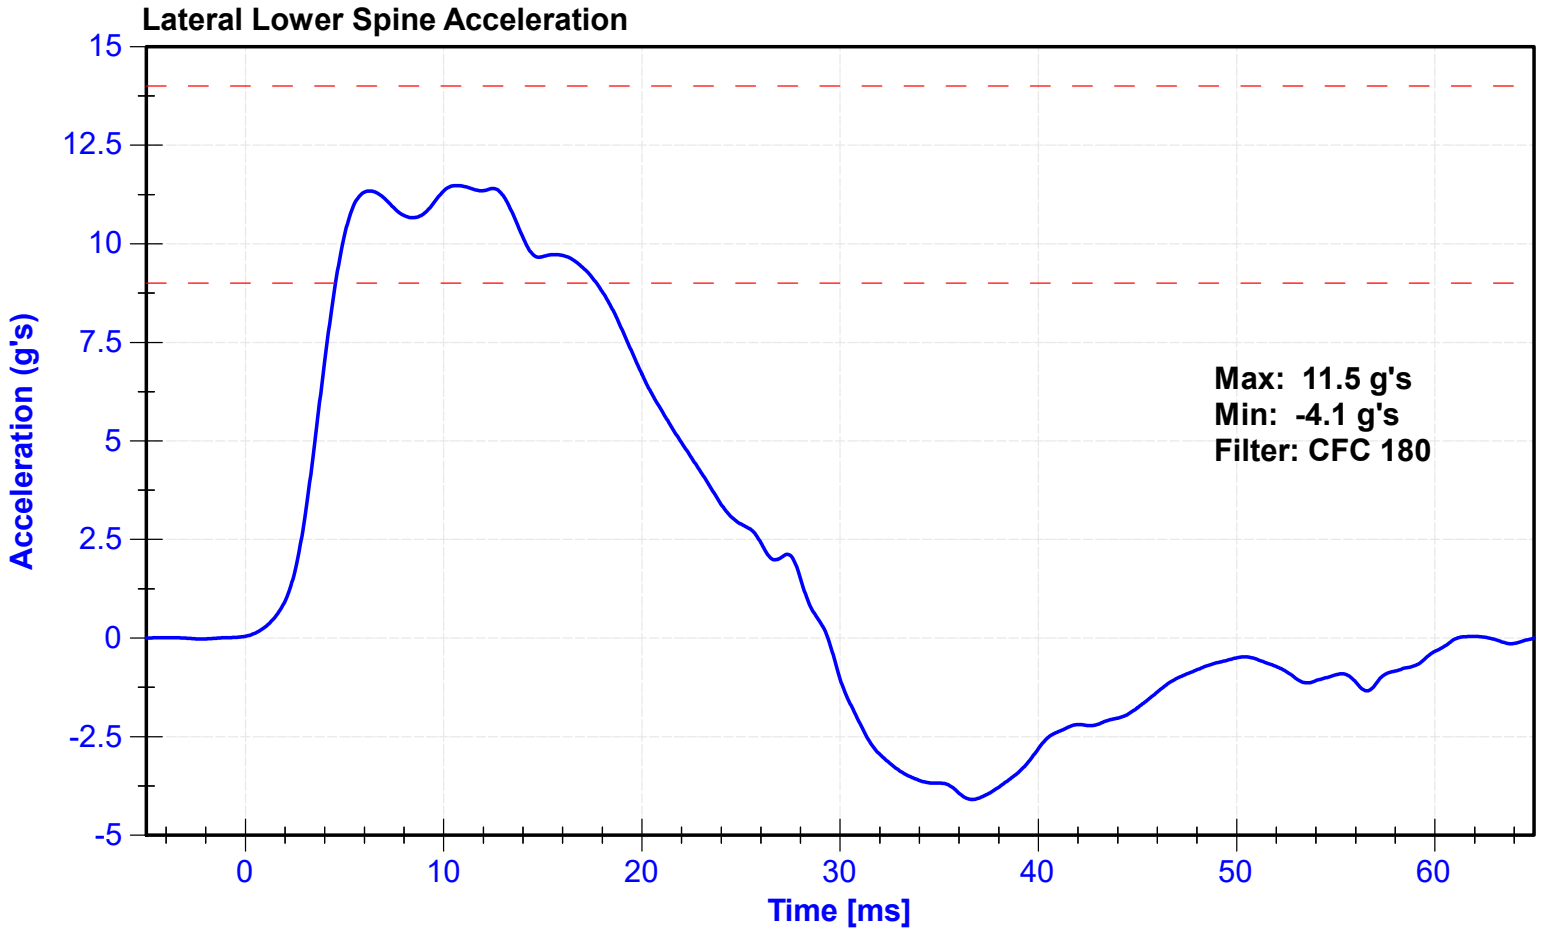
Lateral Lower Spine Acceleration
Acceleration (g's)
15
12.5
10
7.5
5
2.5
0
-2.5
-5
0
10
20
30
40
50
60
Time [ms]
Max: 11.5 g's
Min: -4.1 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	24	Pass
Velocity	6.6	6.8	m/s	6.64	Pass
Probe Acceleration	38	47	g's	46.8	Pass
Lateral Pelvis Acceleration after 6ms	34	42	g's	41.6	Pass
Acetabulum Force	3600	4300	N	4110.4	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Pelvis Y Accelerometer	Endevco	P51731	11/15/2023	5/13/2024
Acetabulum Load Cell	Denton	267-FY	9/11/2023	9/10/2024
Certification Plug	SACO			N/A
Crash Test Plug	SACO			N/A

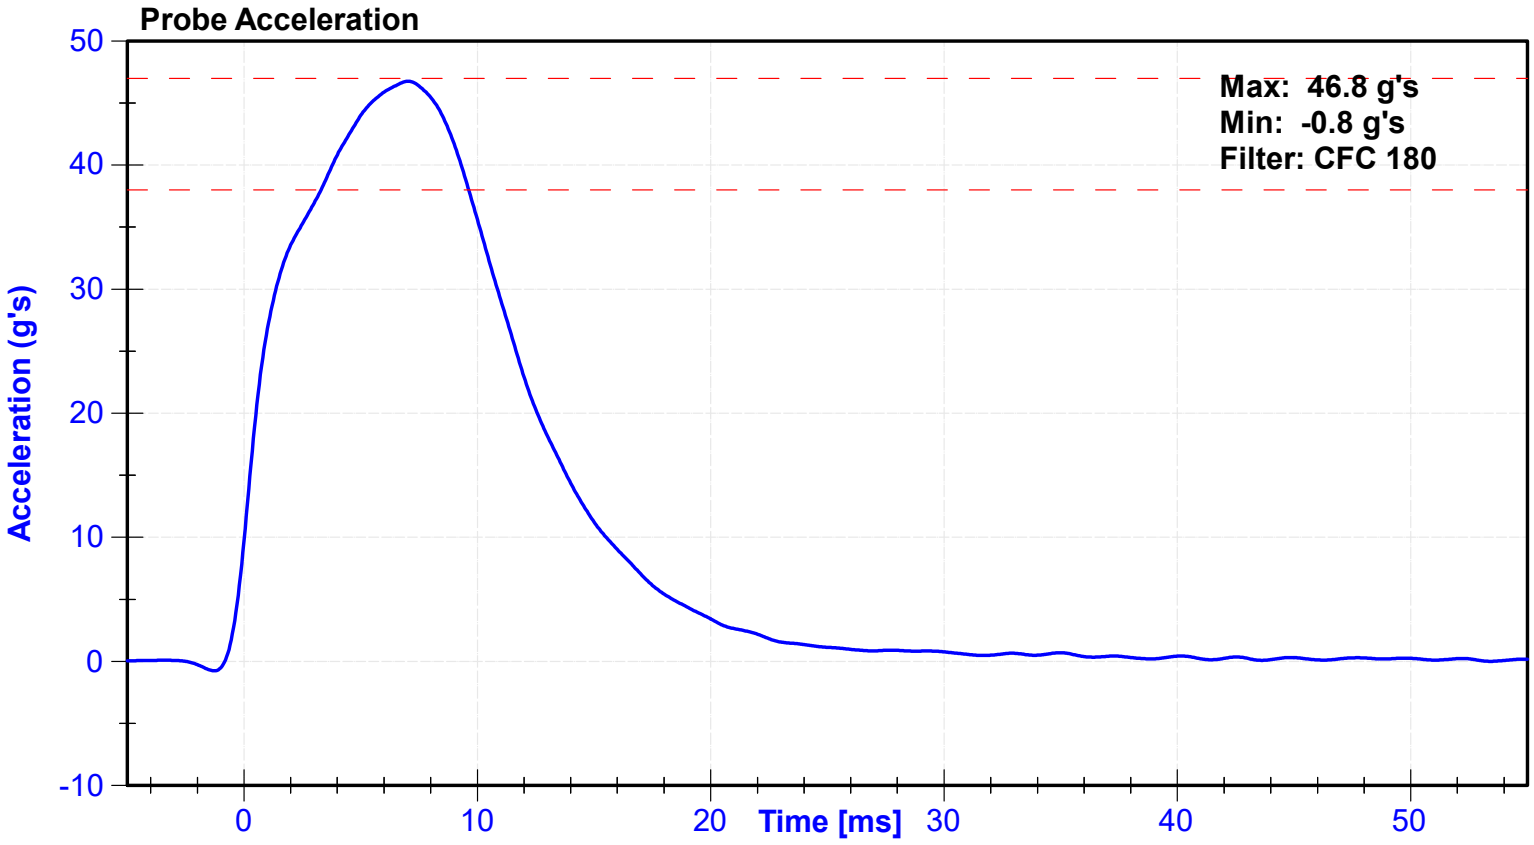

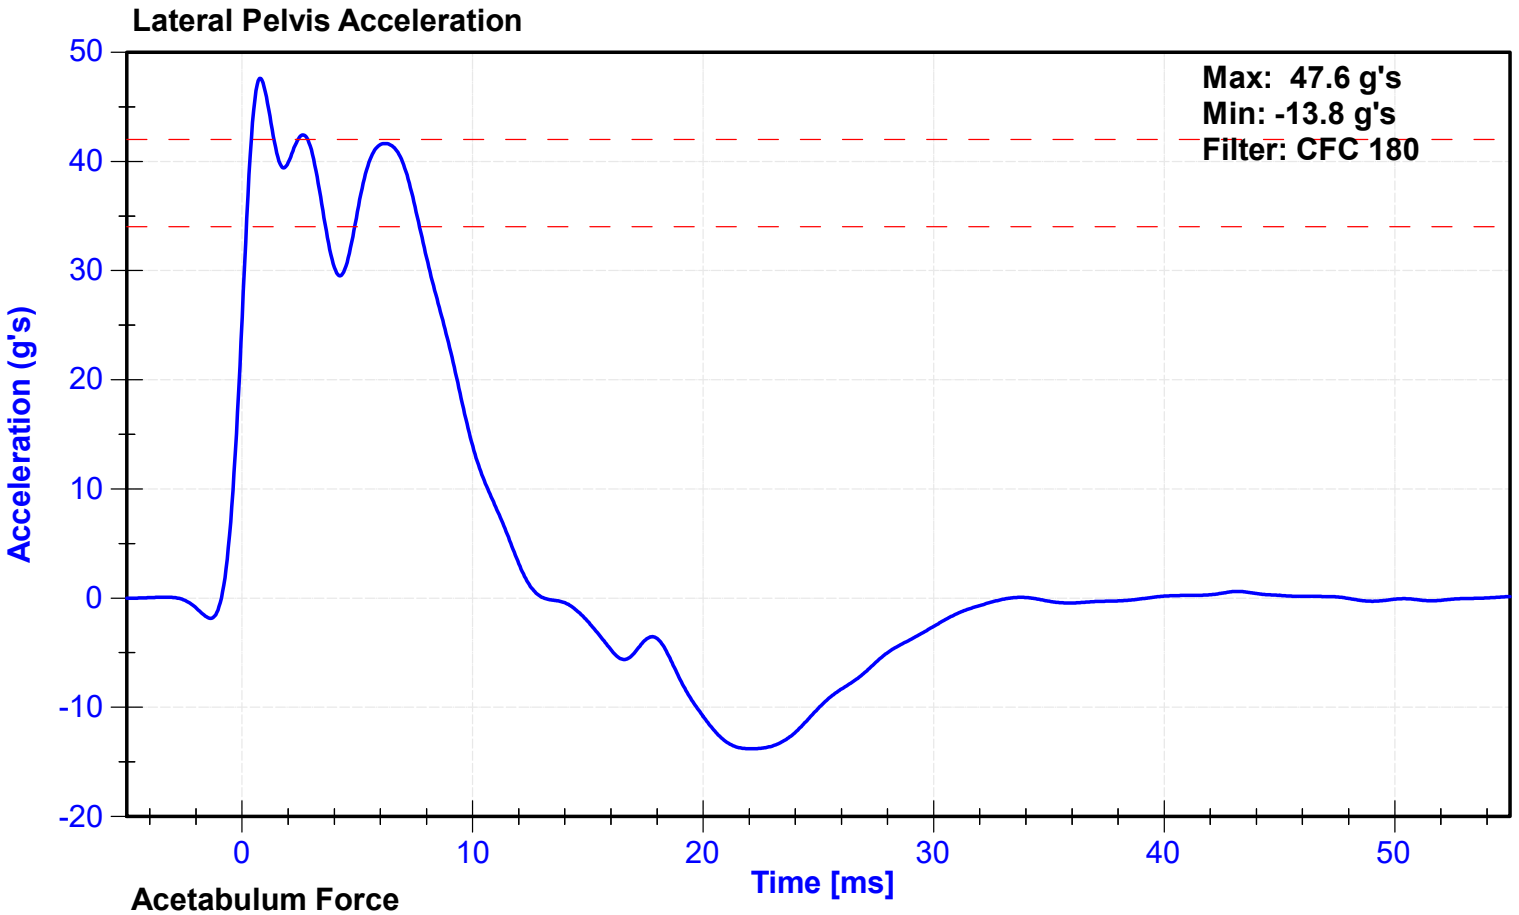
Lateral Pelvis Acceleration
Max: 47.6 g's
Min: -13.8 g's
Filter: CFC 180
Acceleration (g's)
50
40
30
20
10
0
-10
-20
0
10
20
30
40
50
Time [ms]

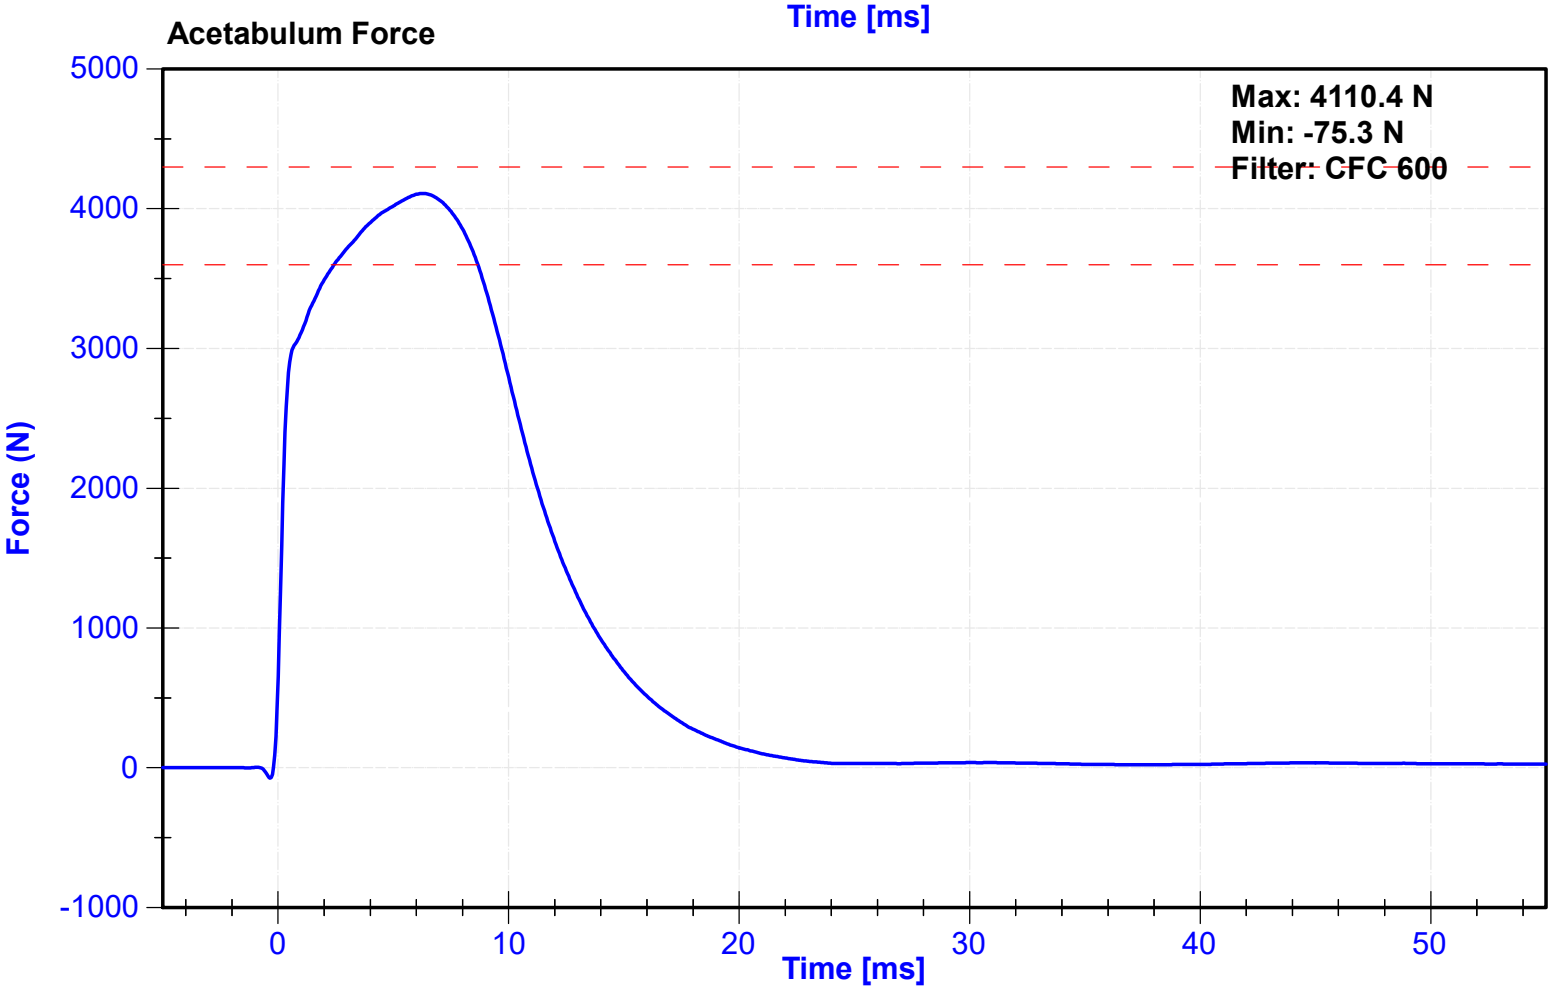
Acetabulum Force
Max: 4110.4 N
Min: -75.3 N
Filter: CFC 600
Force (N)
5000
4000
3000
2000
1000
0
-1000
0
10
20
30
40
50
Time [ms]

SACO RESEARCH

certification
12/5/23

SID-IIs Pelvis Plug Certification Test

Plug S/N 16372
Test Number 22939
Report Number 22996
Test Date 5/20/2022 2:03:36 PM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	325	50	600
Force @ 1.5 mm (N)	1,187	850	1,400
Force @ 2.5 mm (N)	1,458	1,306	1,618
Force @ 3.0 mm (N)	1,504	1,361	1,673

Force (-N) vs Extension (-mm)

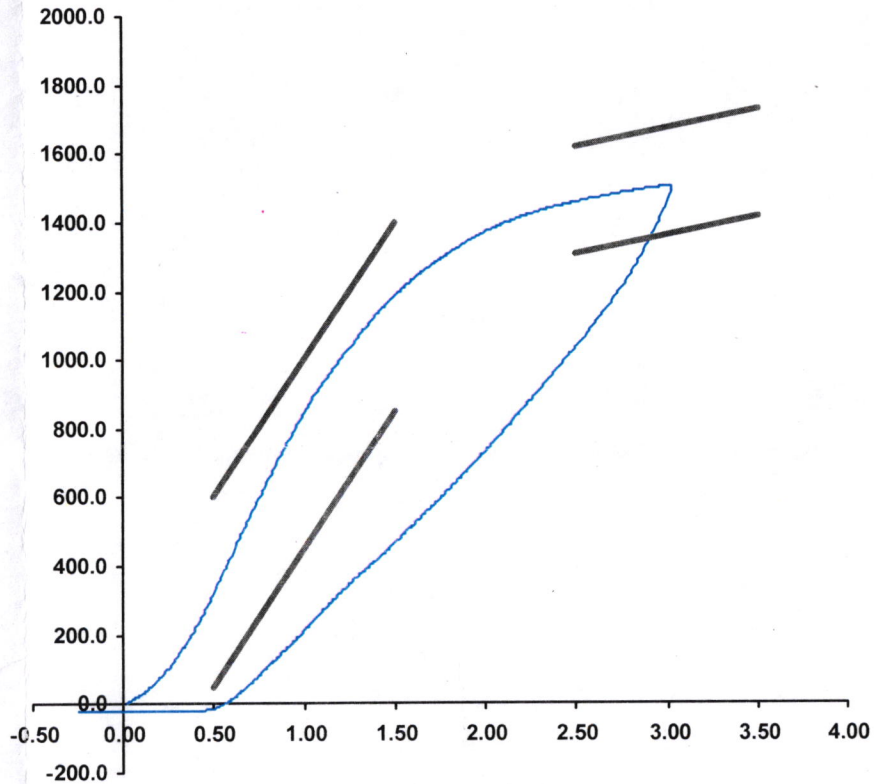

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Operator

Part Number 180-4450

Template No 107 20-May-22
SACO Research

By : DC Date : 5/20/2022

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

SACO RESEARCH

300 CRASH IMPACT

SID-IIs Pelvis Plug Certification Test

Plug S/N 16335
Test Number 22902
Report Number 22959
Test Date 5/20/2022 11:44:17 AM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	318	50	600
Force @ 1.5 mm (N)	1,203	850	1,400
Force @ 2.5 mm (N)	1,506	1,306	1,618
Force @ 3.0 mm (N)	1,561	1,361	1,673

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Force (-N) vs Extension (-mm)

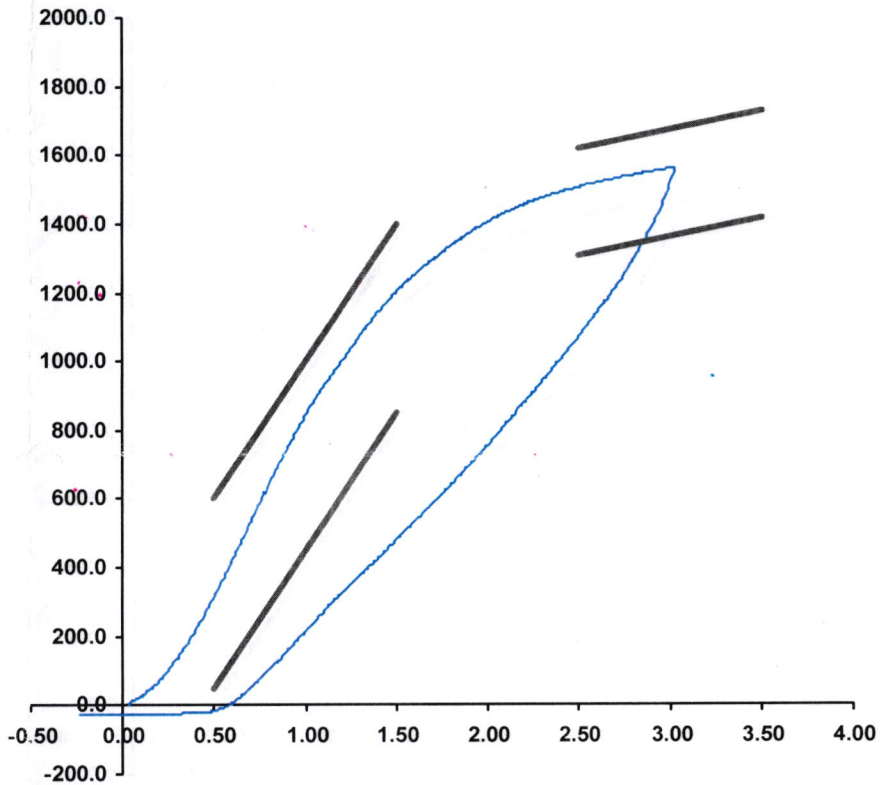

Operator

Part Number 180-4450

Template No 107 20-May-22
SACO Research

By : DC Date : 5/20/2022

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

SACO RESEARCH

300 NON-IMPACT

SID-IIs Pelvis Plug Certification Test

Plug S/N 16448
Test Number 23017
Report Number 23075
Test Date 5/23/2022 12:21:08 PM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	340	50	600
Force @ 1.5 mm (N)	1,175	850	1,400
Force @ 2.5 mm (N)	1,428	1,306	1,618
Force @ 3.0 mm (N)	1,477	1,361	1,673

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Force (-N) vs Extension (-mm)

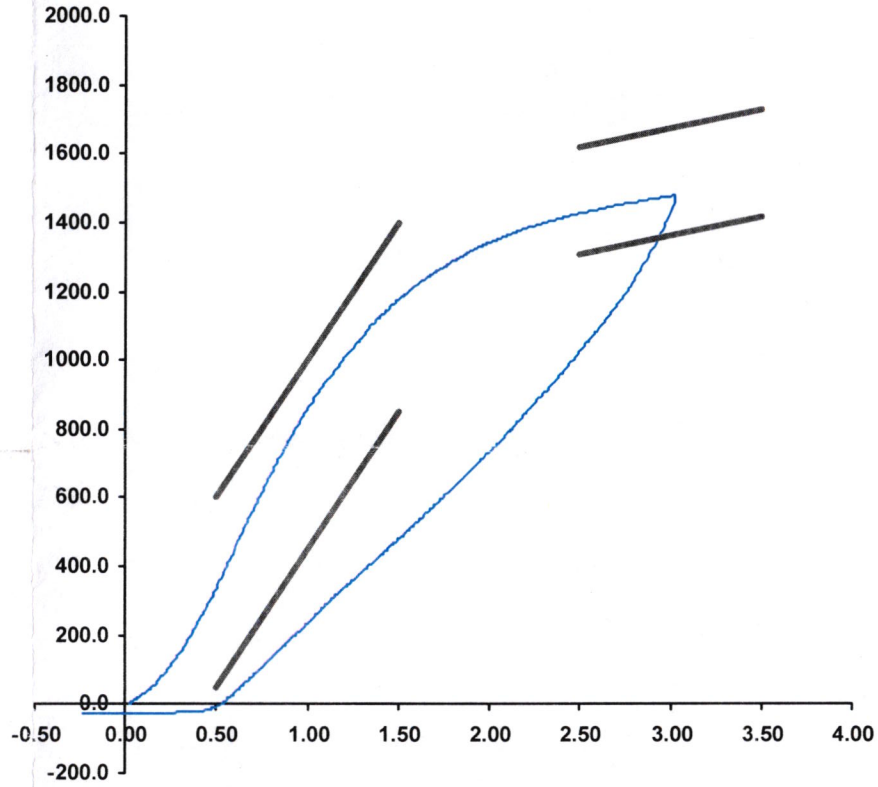

Operator

Part Number 180-4450

Template No 107 23-May-22
SACO Research

By : DC Date : 5/23/2022

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	24	Pass
Velocity	4.2	4.4	m/s	4.28	Pass
Probe Acceleration	36	45	g's	44.6	Pass
Lateral Pelvis Acceleration	28	39	g's	38.2	Pass
Iliac Force	4100	5100	N	5082.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	5/18/2024
Pelvis Y Accelerometer	Endevco	P51731	11/15/2023	5/13/2024
Iliac Load Cell	Denton	321	9/11/2023	9/10/2024

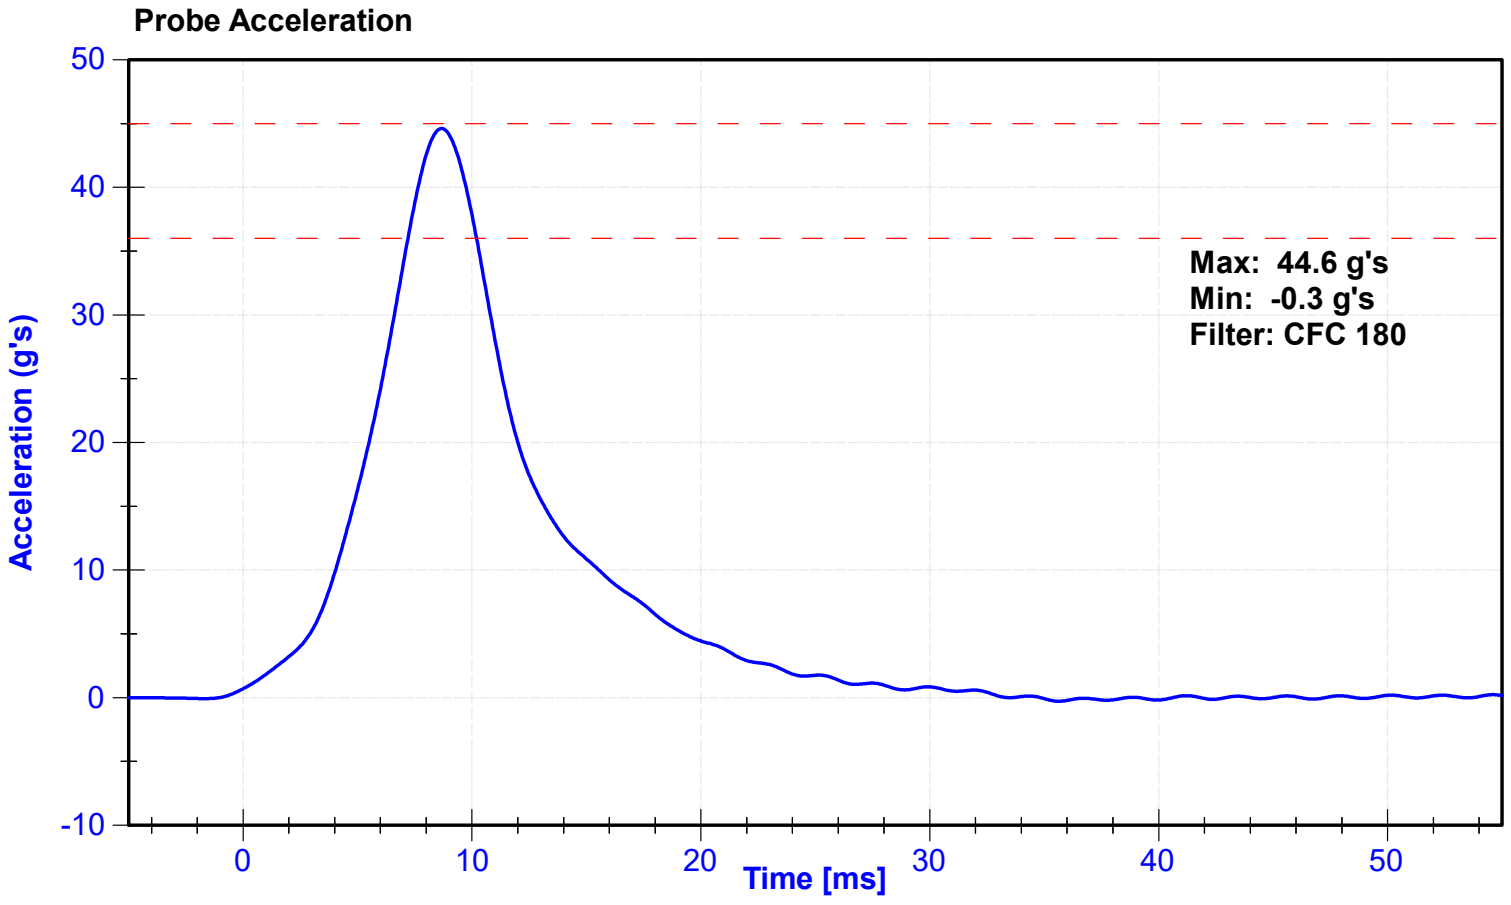

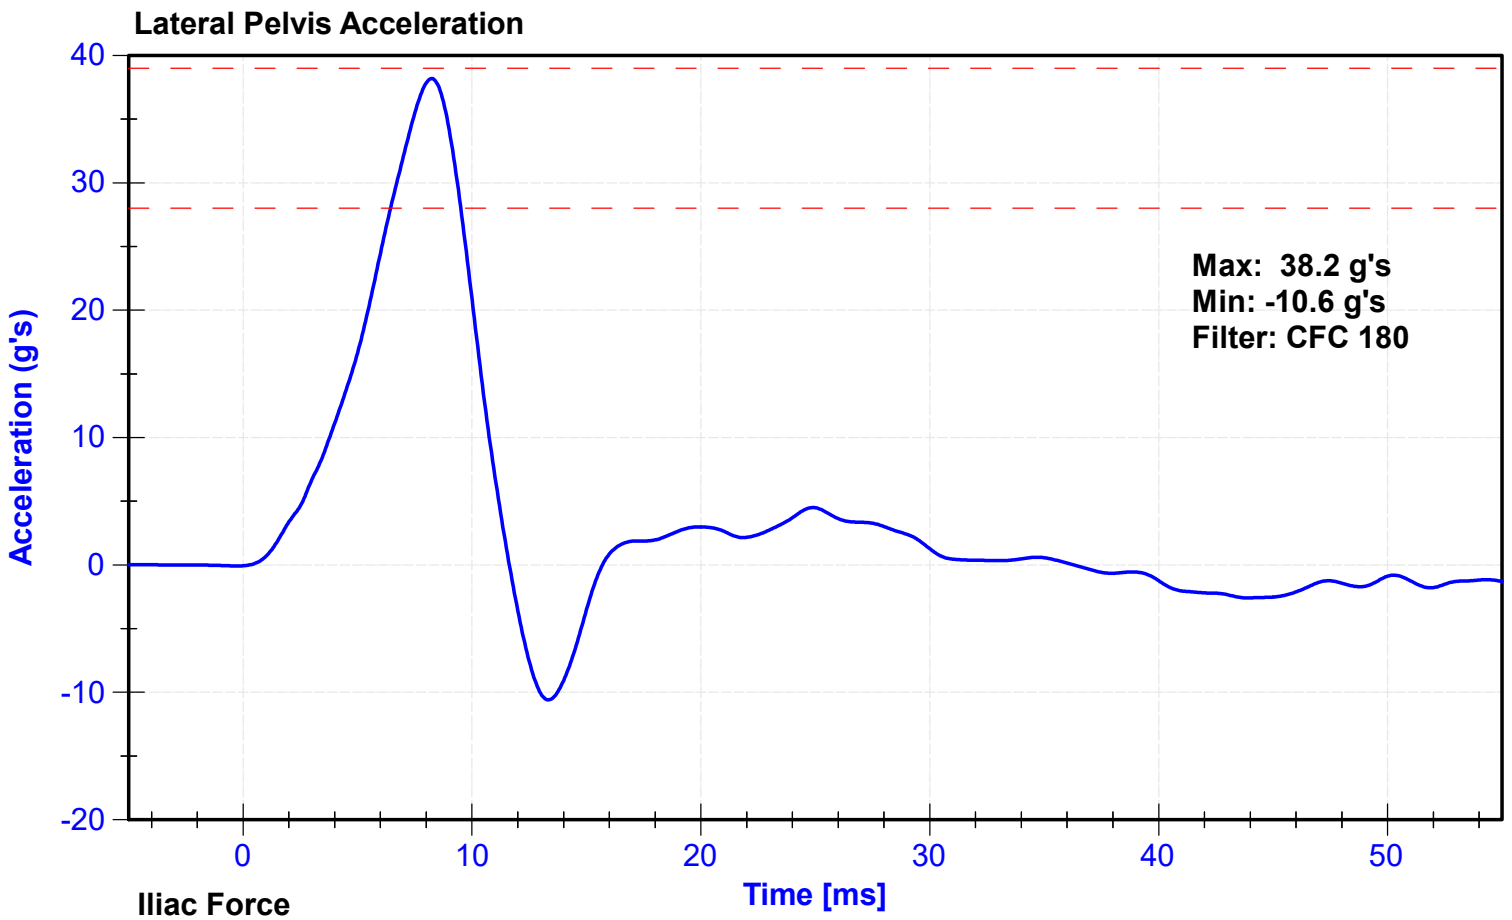
Lateral Pelvis Acceleration
Acceleration (g's)
40
30
20
10
0
-10
-20
0
10
20
30
40
50
Time [ms]
Max: 38.2 g's
Min: -10.6 g's
Filter: CFC 180

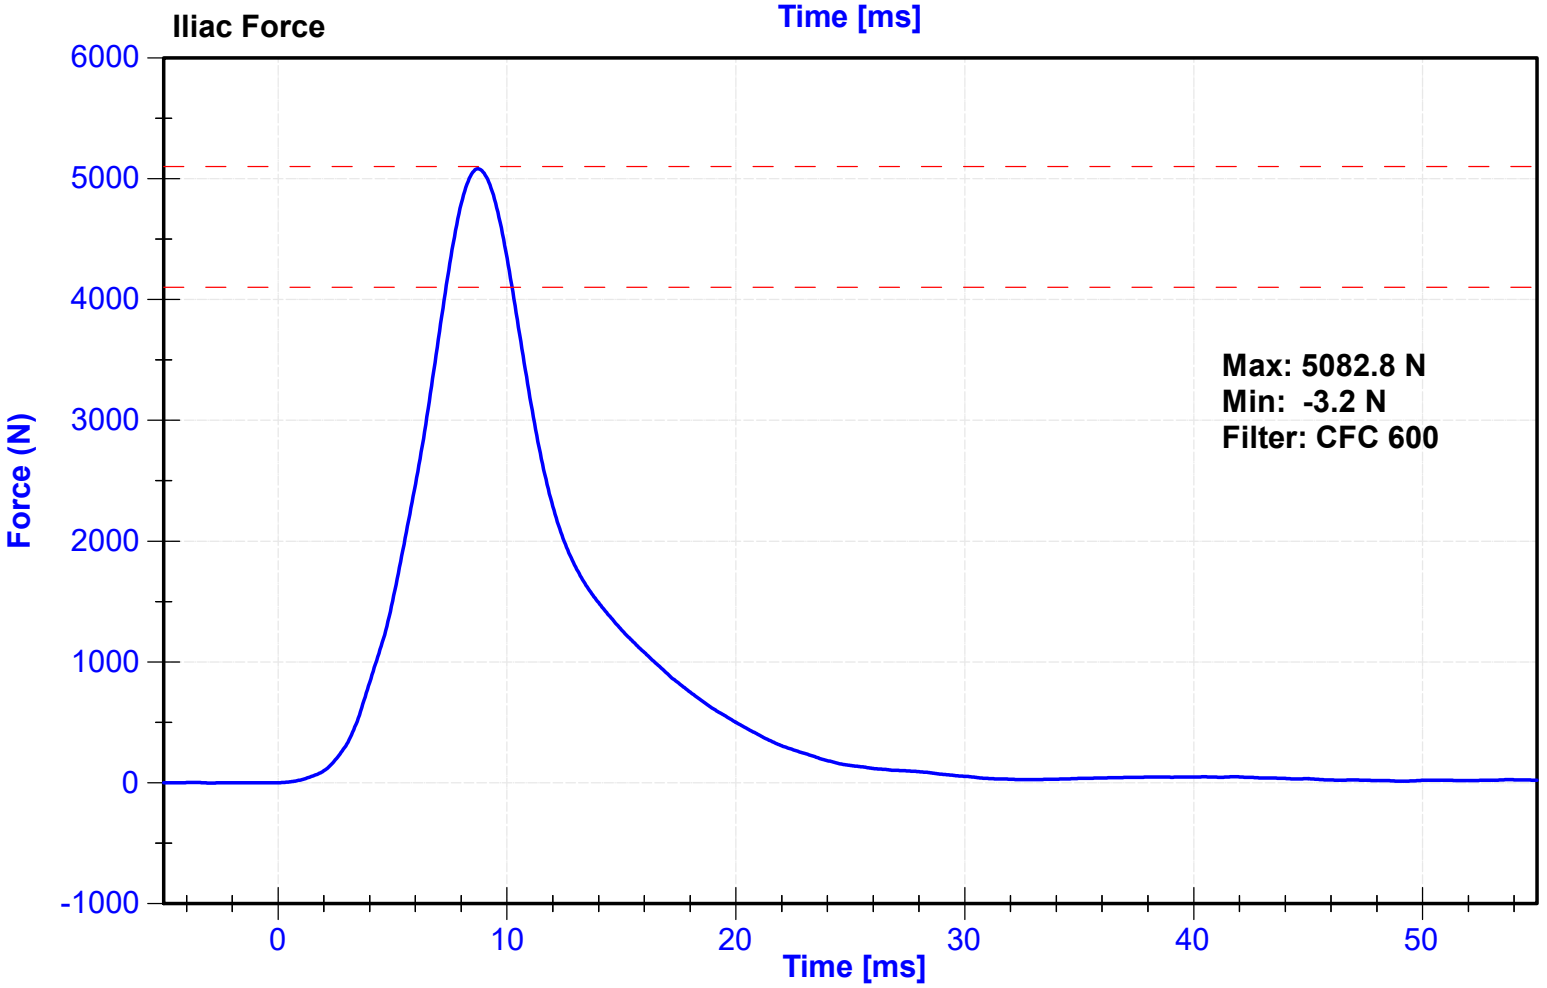
Iliac Force
Force (N)
6000
5000
4000
3000
2000
1000
0
-1000
0
10
20
30
40
50
Time [ms]
Max: 5082.8 N
Min: -3.2 N
Filter: CFC 600

CALIBRATION TEST RESULTS

POST-TEST

EUROSID 2 (ES-2RE) MALE – DRIVER ATD

SERIAL NO:F033

(CONFIGURED FOR LEFT SIDE IMPACT)

External Measurements - EuroSID-2re

Technician: K. Brogan Date: 1/16/2024

Dummy Serial Number: F033

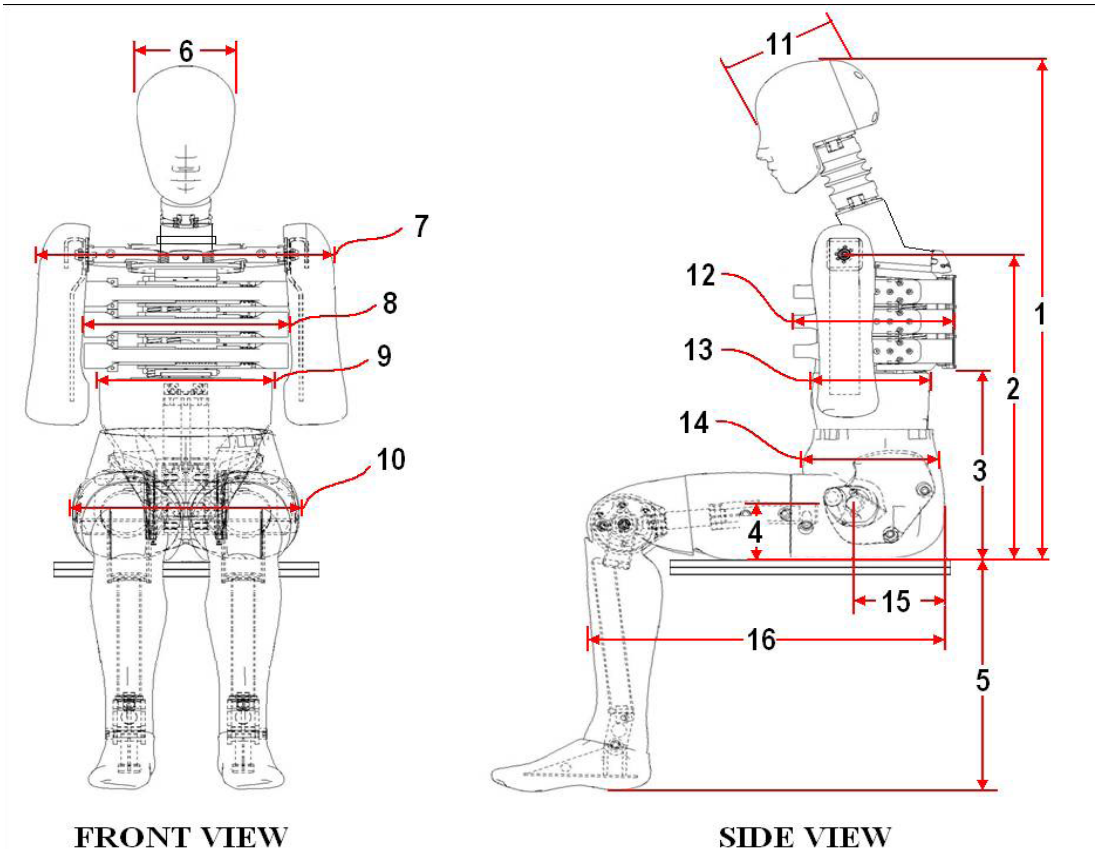

FRONT VIEW SIDE VIEW

Dim. No.	Description	Specification (mm)		Result (mm)	Pass/Fail
1	Sitting Height	900	918	916	Pass
2	Seat to Shoulder Joint	558	572	567	Pass
3	Seat to Lower Face of Thoracic Spine Box	346	356	353	Pass
4	Seat to Hip Joint (center of bolt)	97	103	99	Pass
5	Sole to Seat, Sitting	333	451	427	Pass
6	Head Width	152	158	156	Pass
7	Shoulder/Arm Width	461	479	471	Pass
8	Thorax Width	322	332	330	Pass
9	Abdomen Width	273	287	281	Pass
10	Pelvis Lap Width	359	373	370	Pass
11	Head Depth	196	206	200	Pass
12	Thorax Depth	262	272	268	Pass
13	Abdomen Depth	194	204	201	Pass
14	Pelvis Depth	235	245	242	Pass
15	Back of Buttocks to Hip Joint (center of bolt)	150	160	155	Pass
16	Back of Buttocks to Front Knee	597	615	610	Pass

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Resultant Acceleration	125	155	g's	131.9	Pass
Oscillation	0	15	%	3.45	Pass
Fore-Aft Acceleration	-15	15	g's	4.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
X Accelerometer	Endevco	P63861	11/16/2023	5/14/2024
Y Accelerometer	Endevco	P49216	11/16/2023	5/14/2024
Z Accelerometer	Endevco	P51303	11/16/2023	5/14/2024

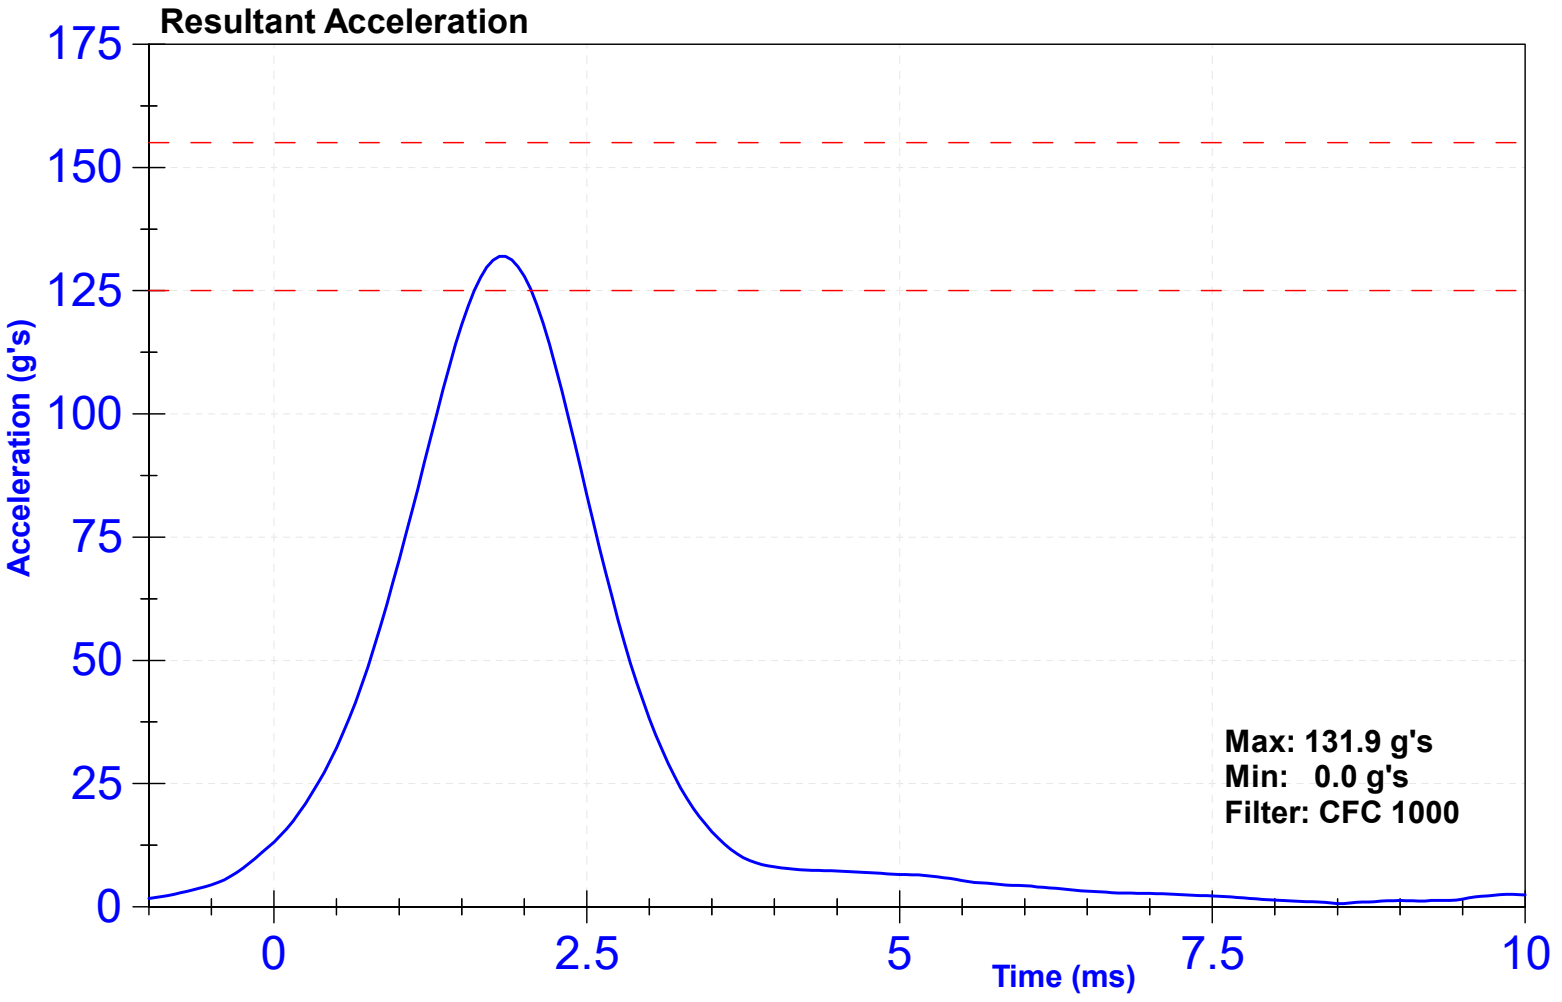

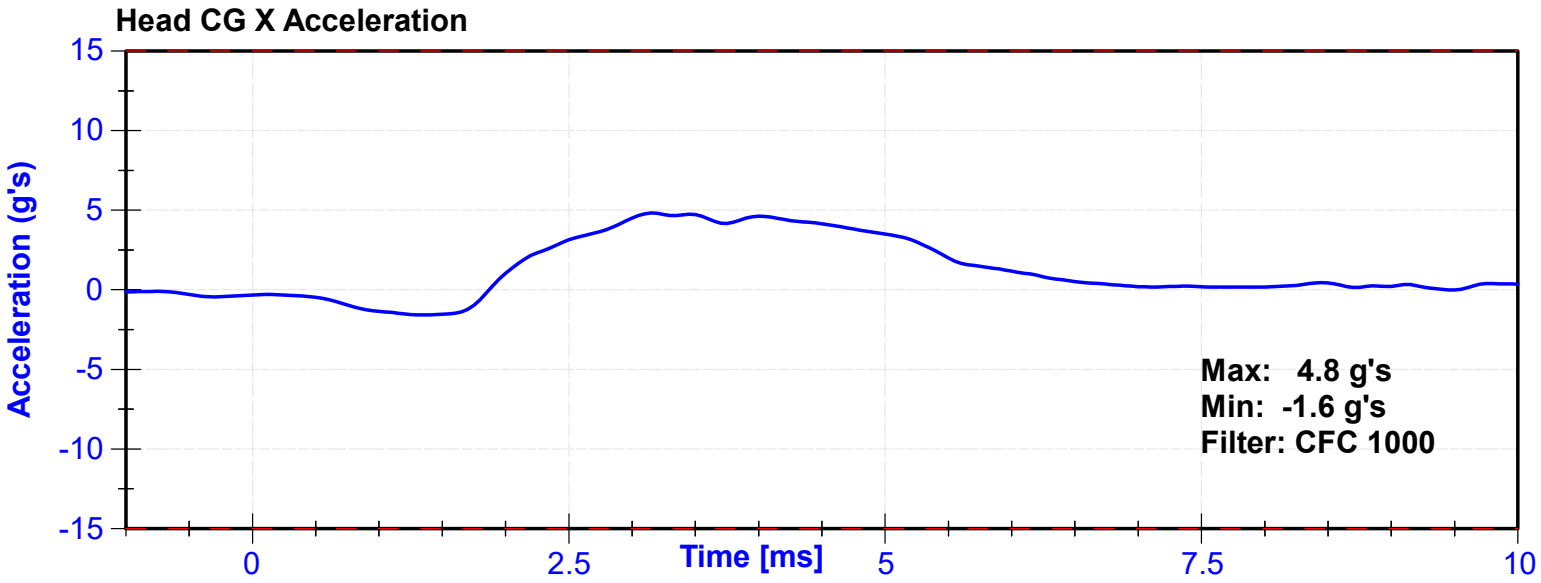
Head CG X Acceleration
Acceleration (g's)
15
10
5
0
-5
-10
-15
0
2.5
5
7.5
10
Time [ms]
Max: 4.8 g's
Min: -1.6 g's
Filter: CFC 1000

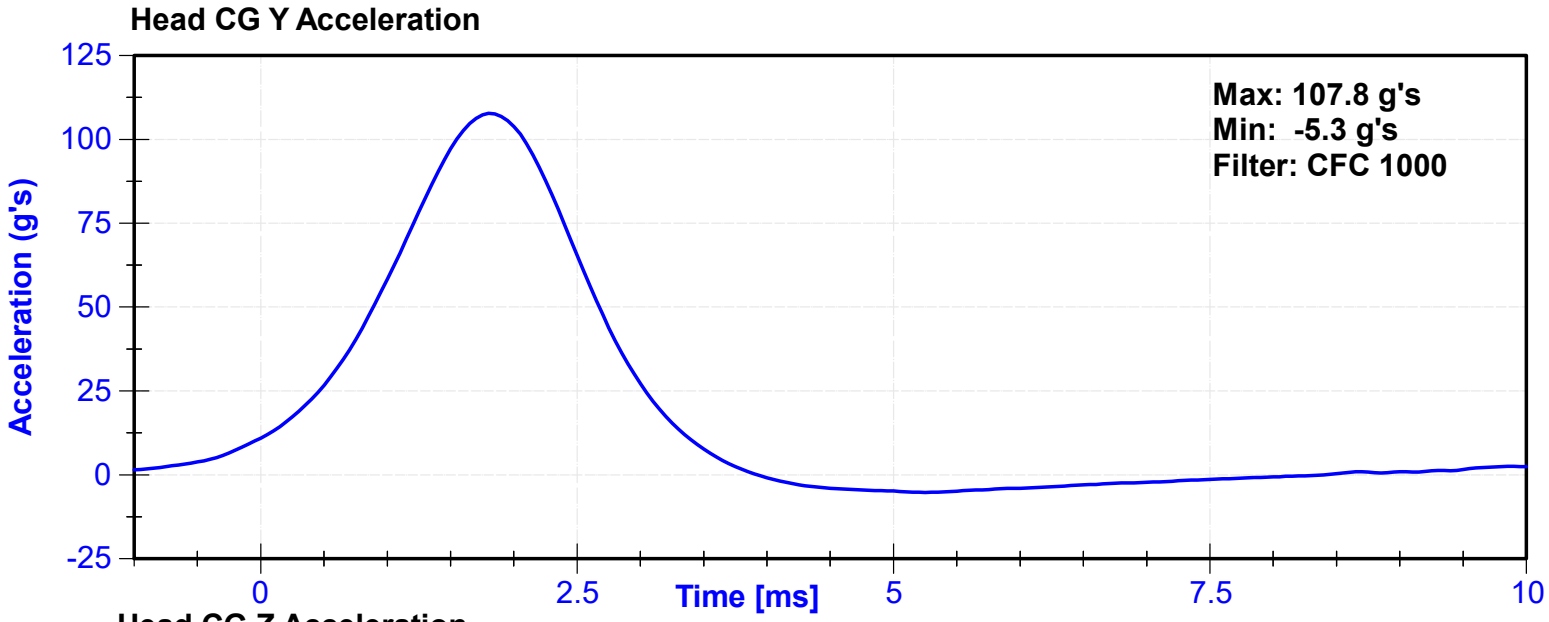
Head CG Y Acceleration
Acceleration (g's)
125
100
75
50
25
0
-25
0
2.5
5
7.5
10
Time [ms]
Max: 107.8 g's
Min: -5.3 g's
Filter: CFC 1000

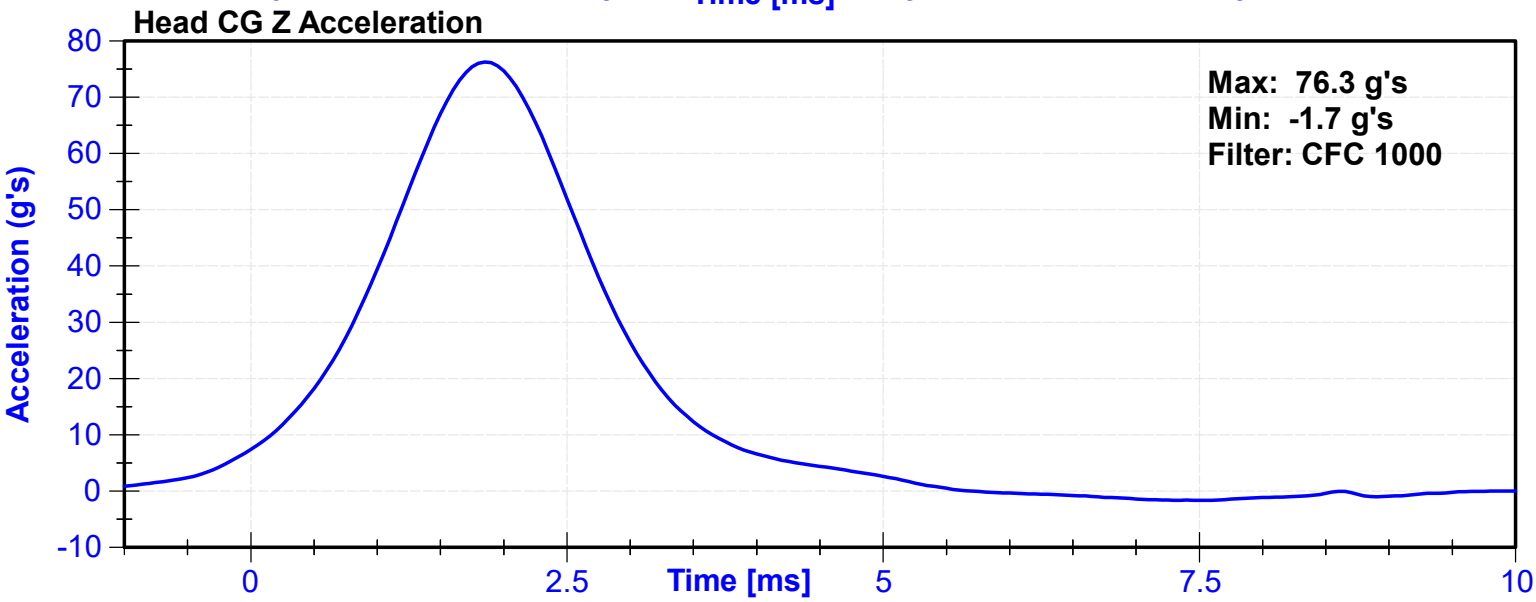
Head CG Z Acceleration
Acceleration (g's)
80
70
60
50
40
30
20
10
0
-10
0
2.5
5
7.5
10
Time [ms]
Max: 76.3 g's
Min: -1.7 g's
Filter: CFC 1000

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Velocity	3.3	3.5	m/s	3.42	Pass
Lateral Neck Rotation	49	59	deg	49.3	Pass
Time at Maximum Rotation	54	66	ms	55.9	Pass
Time of Rotation Decay from Maximum	53	88	ms	56.3	Pass
Pendulum Velocity Overall Corridor	Lower Boundary[1]	Upper Boundary[2]	m/s	See Plot[3]	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	C16503	10/31/2023	4/28/2024
Front Pendulum Potentiometer	Sfernice	2247	12/5/2023	12/4/2024
Headform Potentiometer	Sfernice	095	9/29/2023	9/28/2024

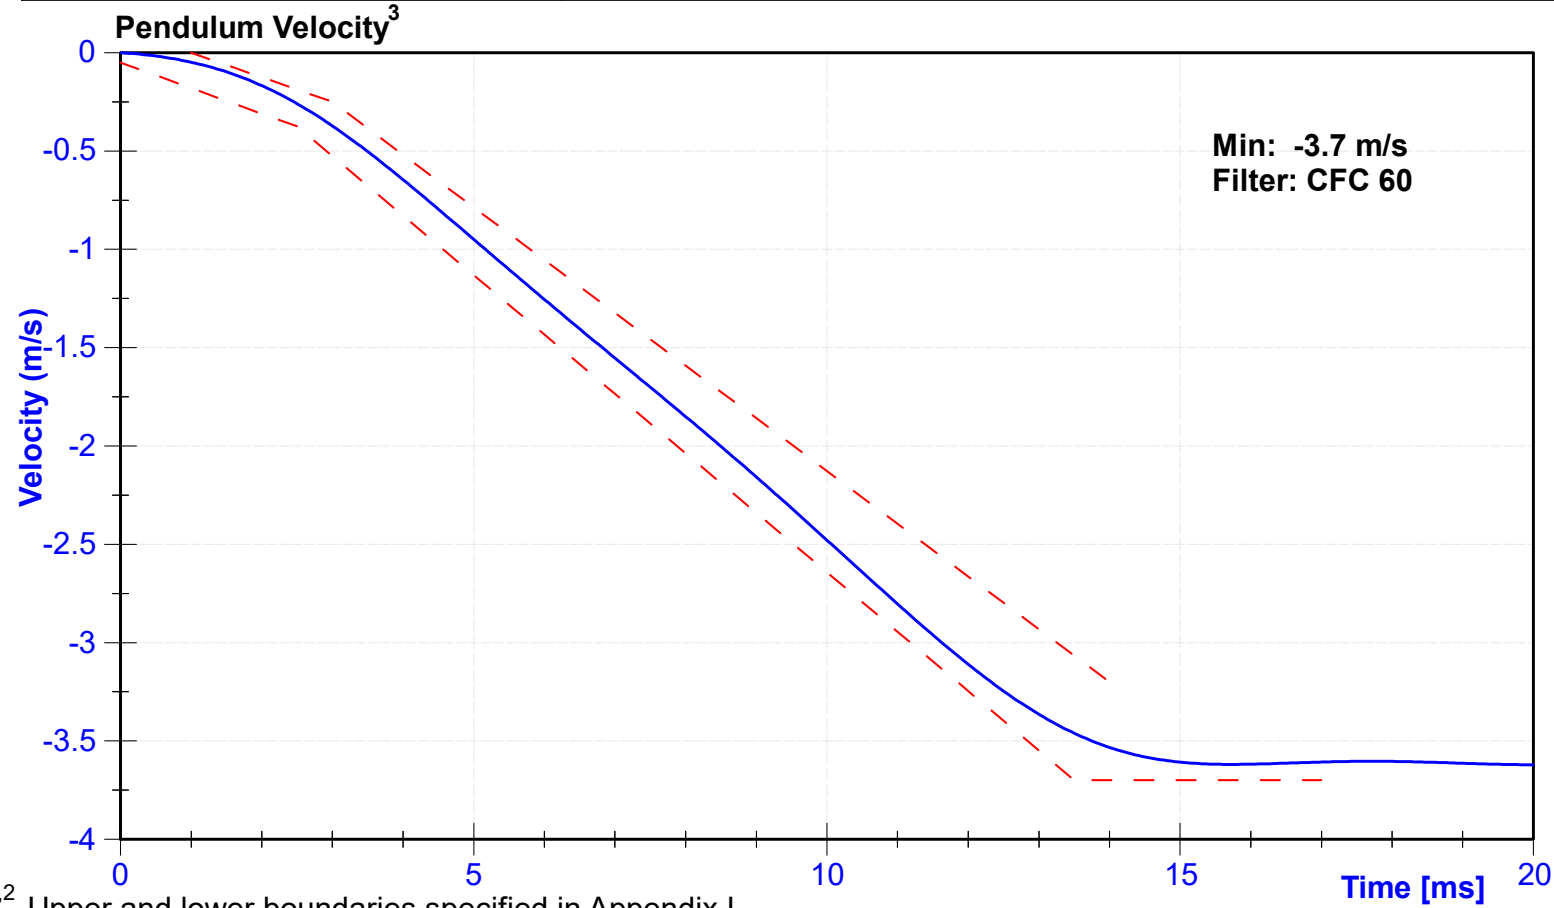

[1,2] Upper and lower boundaries specified in Appendix I

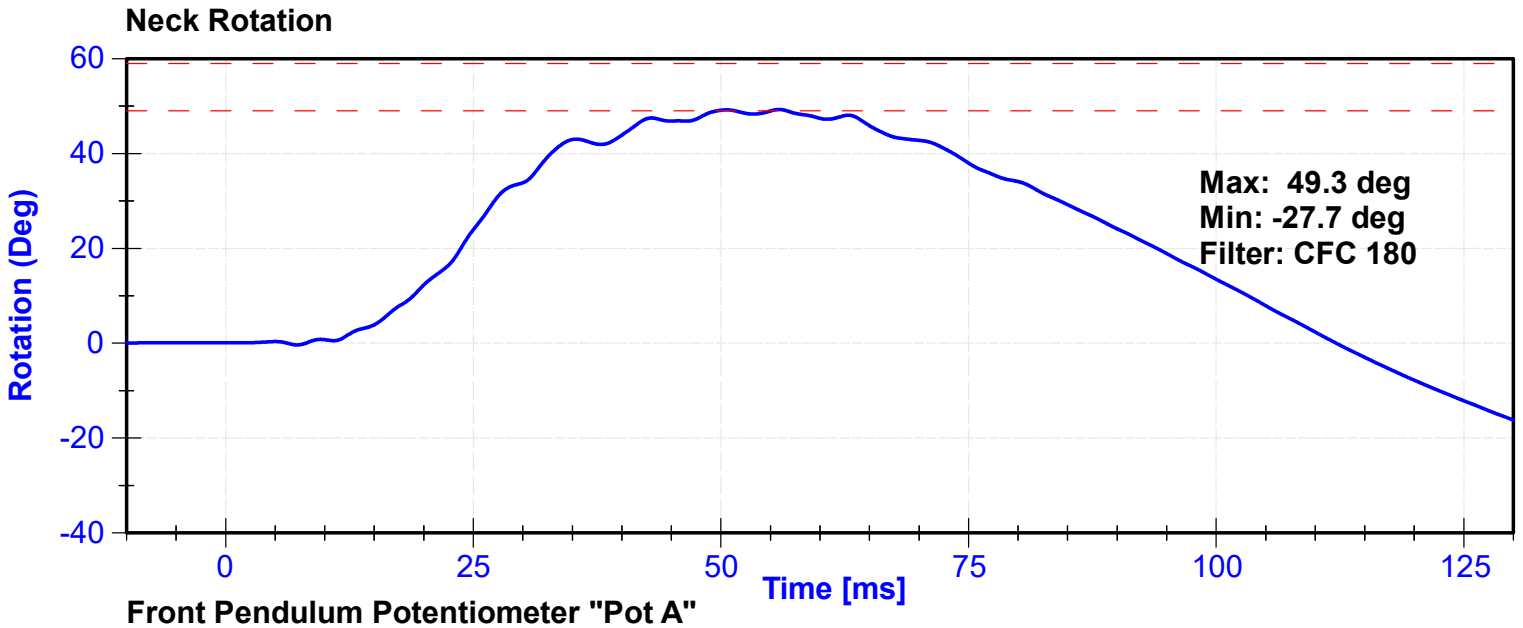
Neck Rotation
Rotation (Deg)
Time [ms]
Max: 49.3 deg
Min: -27.7 deg
Filter: CFC 180

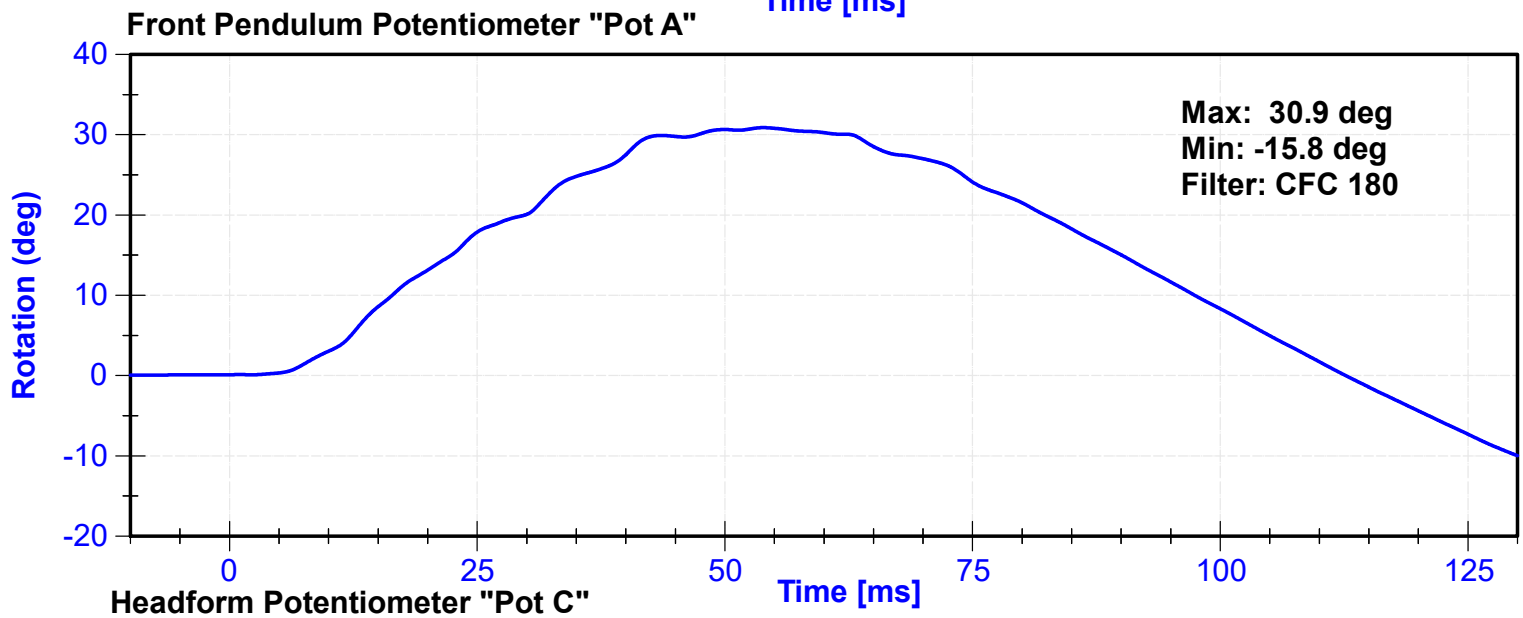
Front Pendulum Potentiometer "Pot A"
Rotation (deg)
Time [ms]
Max: 30.9 deg
Min: -15.8 deg
Filter: CFC 180

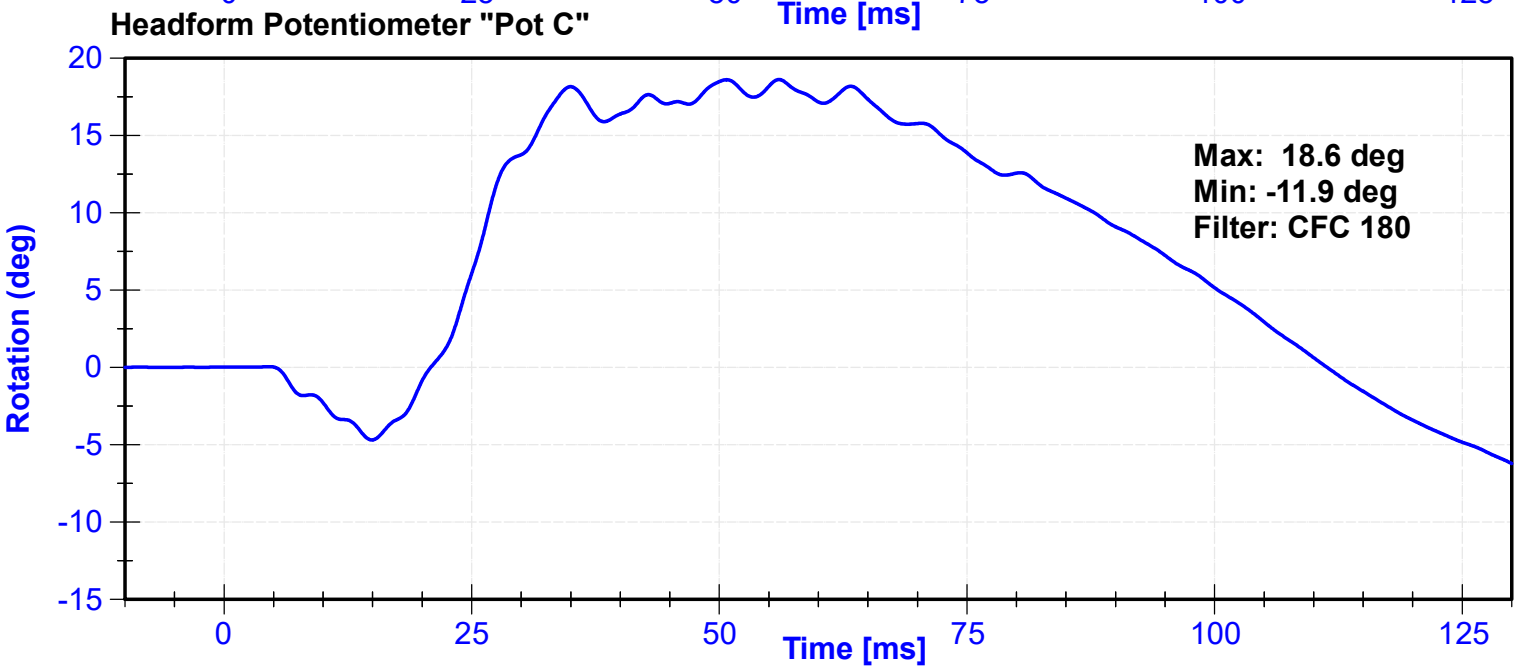
Headform Potentiometer "Pot C"
Rotation (deg)
Time [ms]
Max: 18.6 deg
Min: -11.9 deg
Filter: CFC 180

Appendix I

[2] Upper Boundary Corridor		[1] Lower Boundary Corridor	
Time (ms)	Velocity (m/s)	Time (ms)	Velocity (m/s)
1.0	0.00	0.0	-0.05
3.0	-0.25	2.5	-0.375
14.0	-3.20	13.5	-3.7
		17.0	-3.7

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.29	Pass
Probe Acceleration	7.5	10.5	g's	10.06	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18619	9/29/2023	3/27/2024

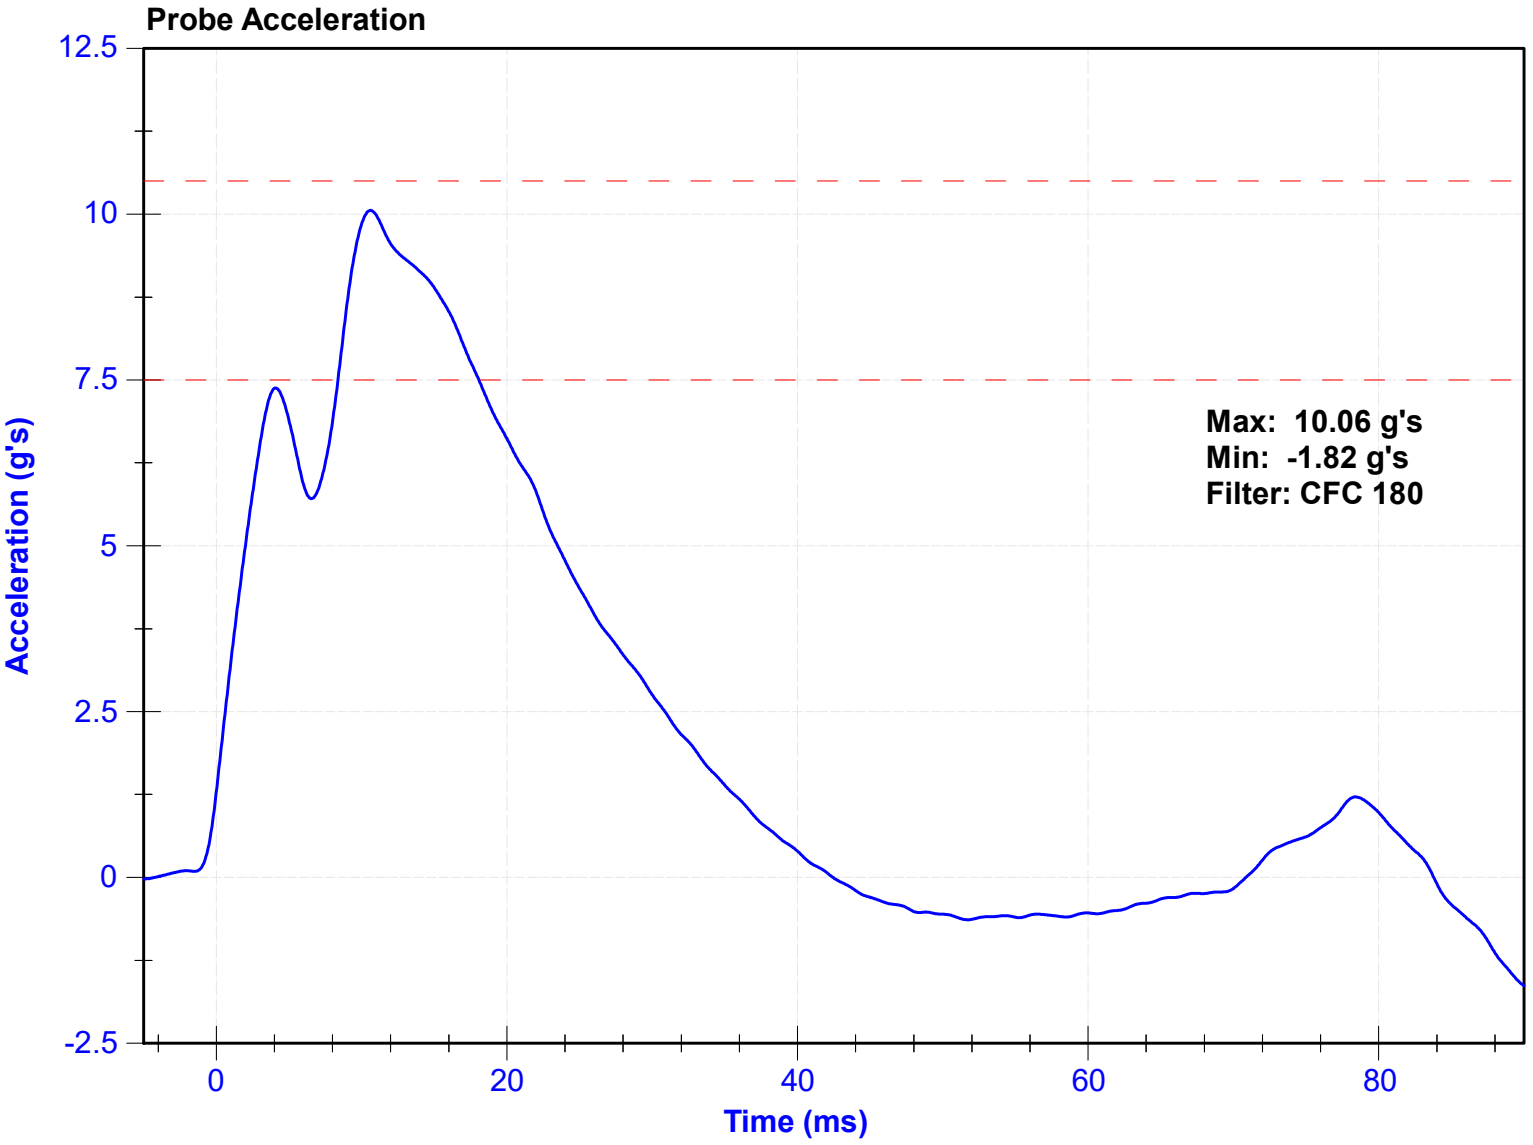

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	46	51	mm	48.7	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024

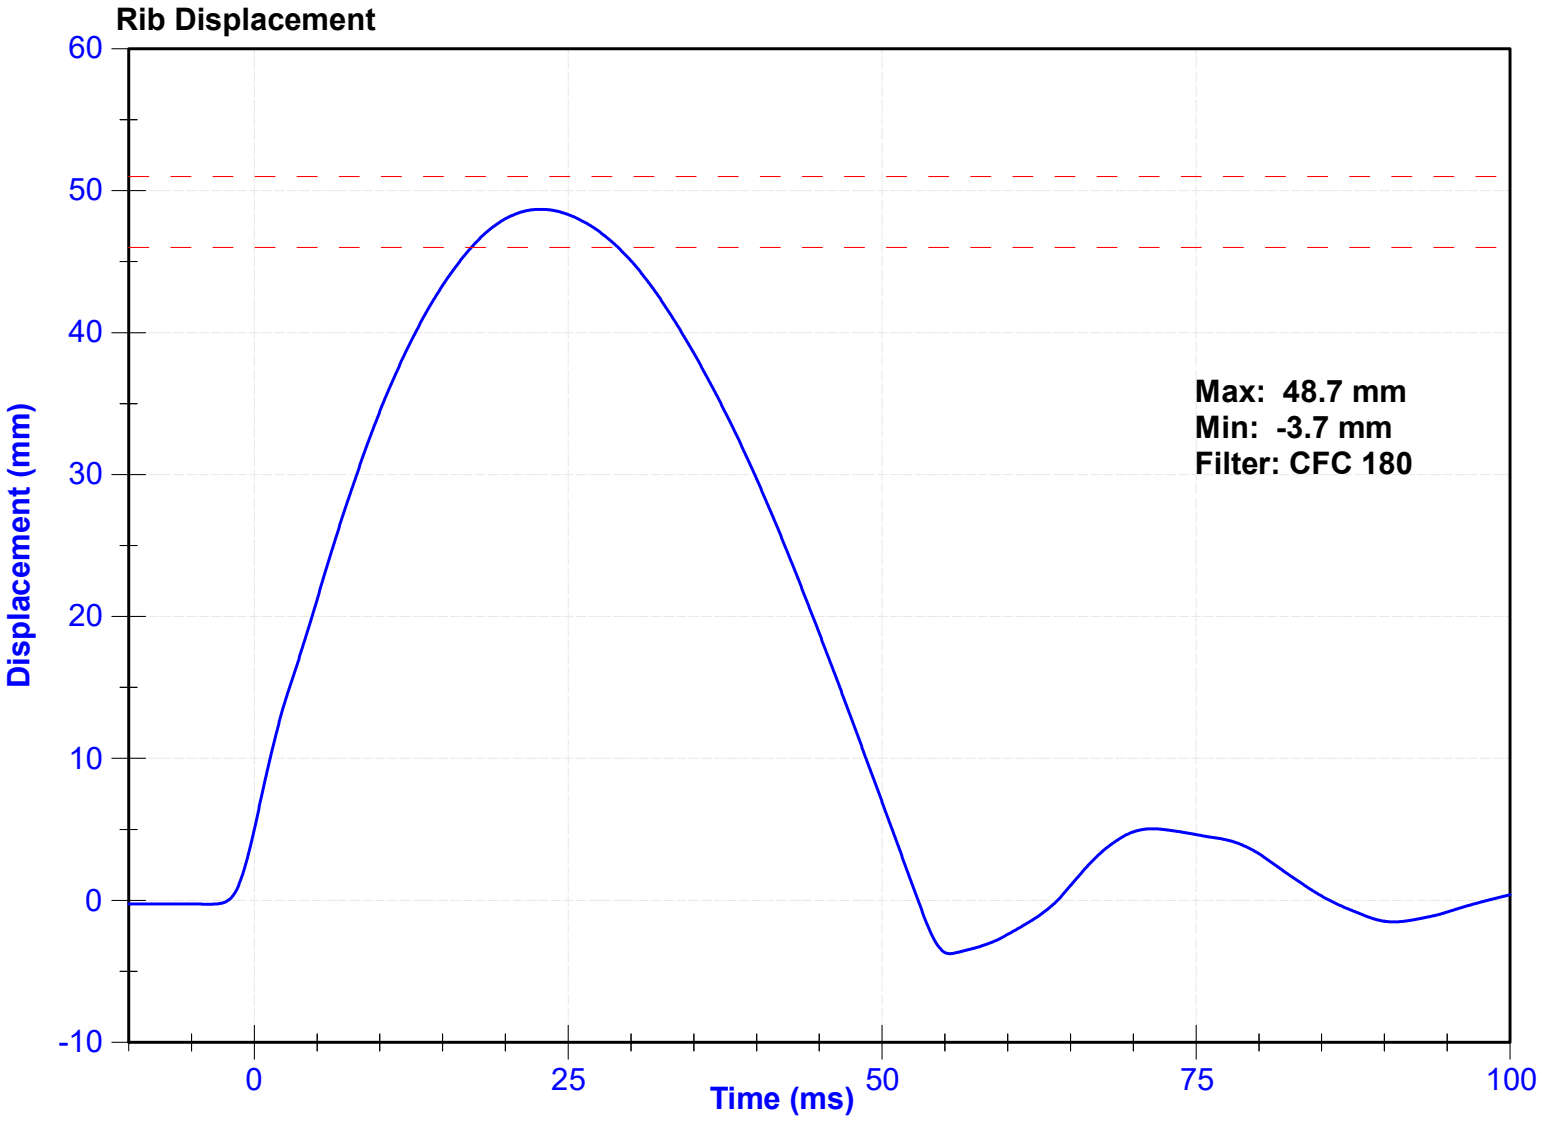

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	36	40	mm	37.3	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024

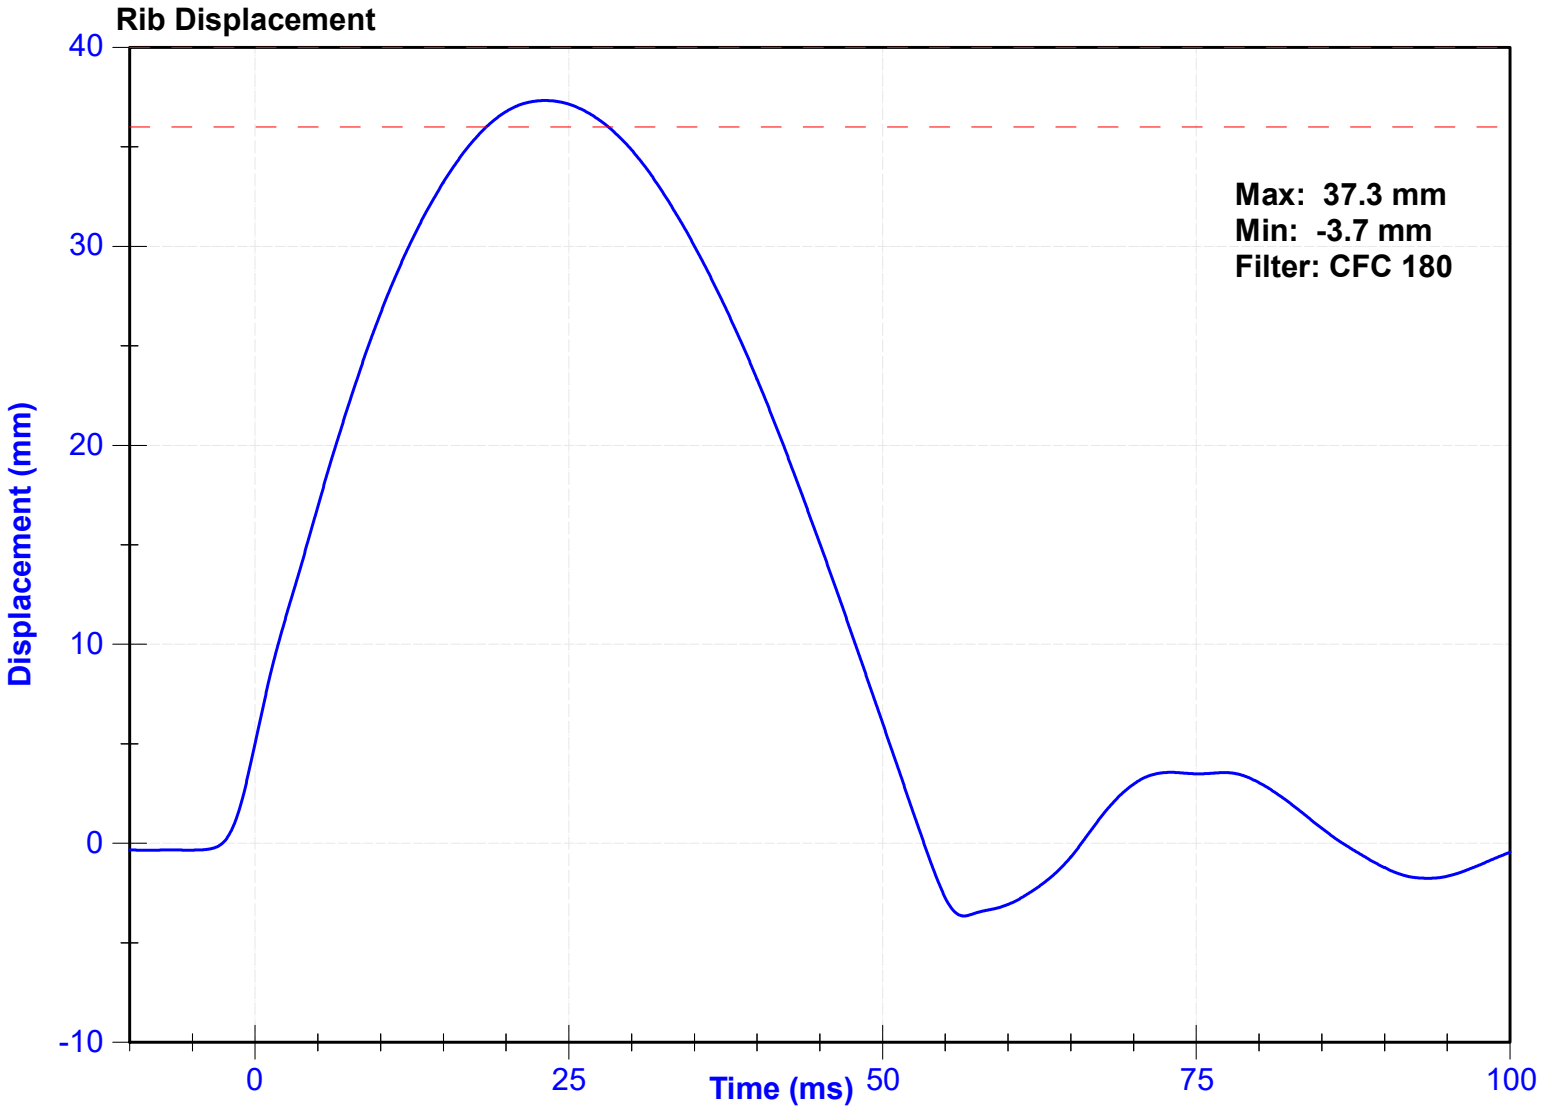

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	46	51	mm	48.8	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024

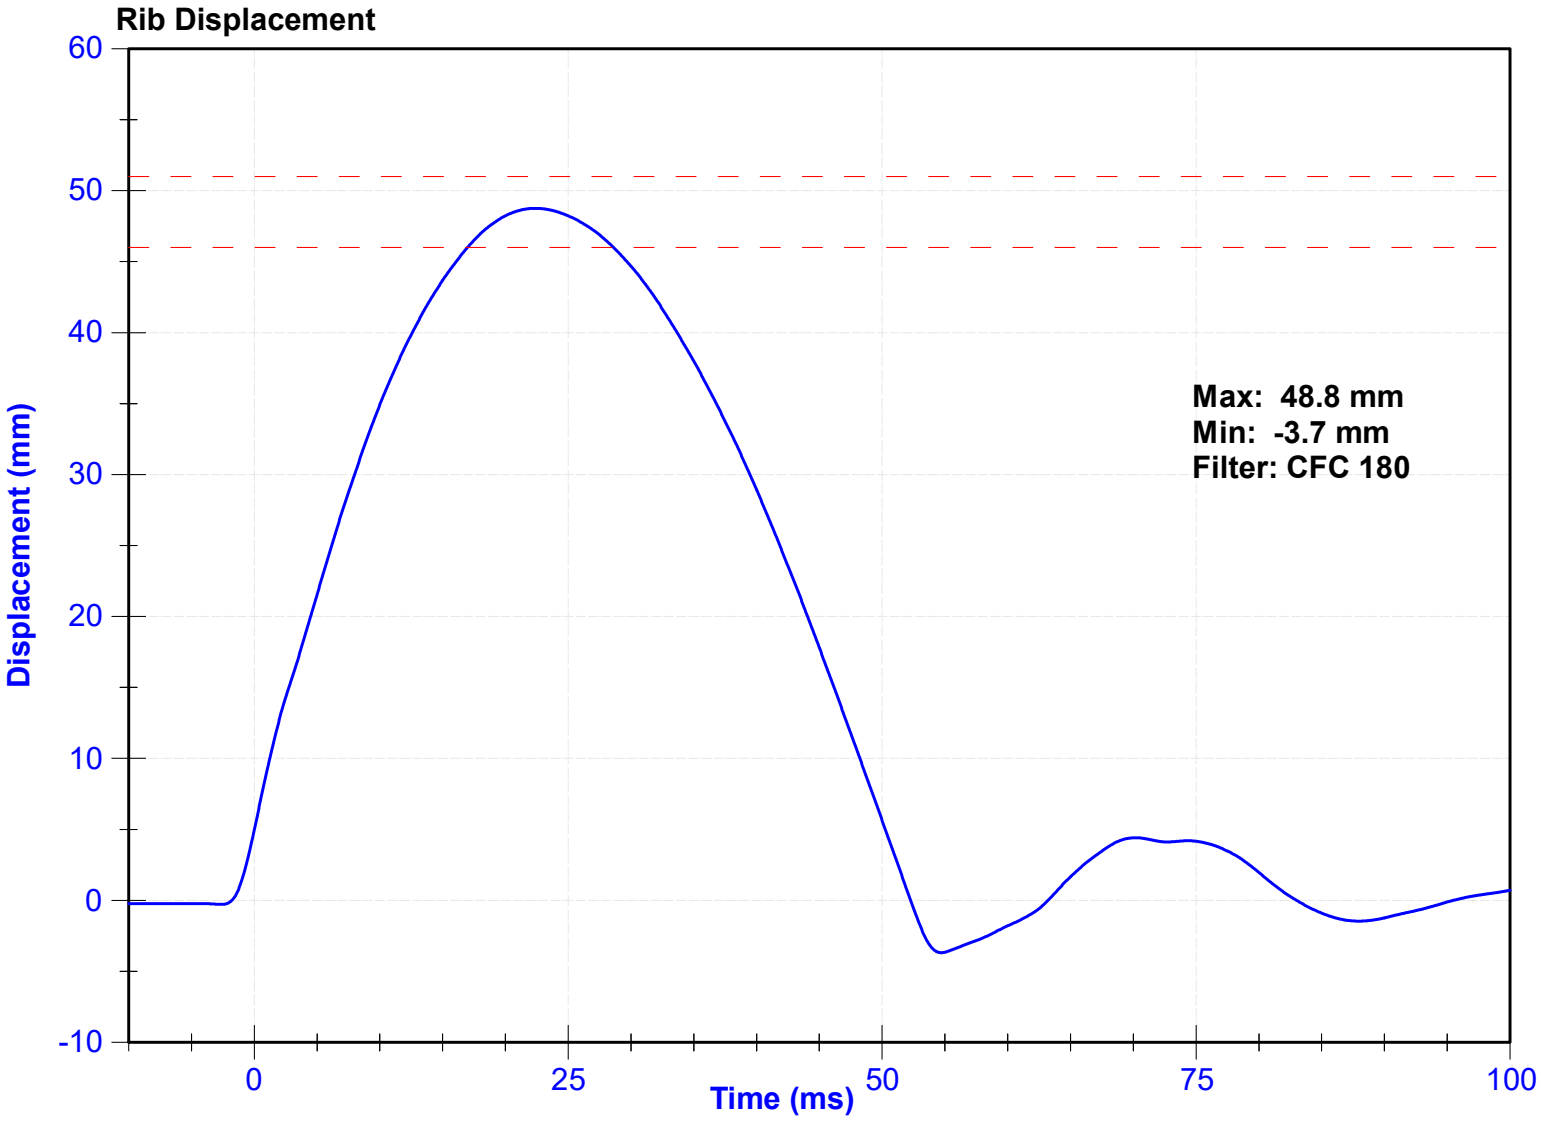

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	36	40	mm	37.2	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024

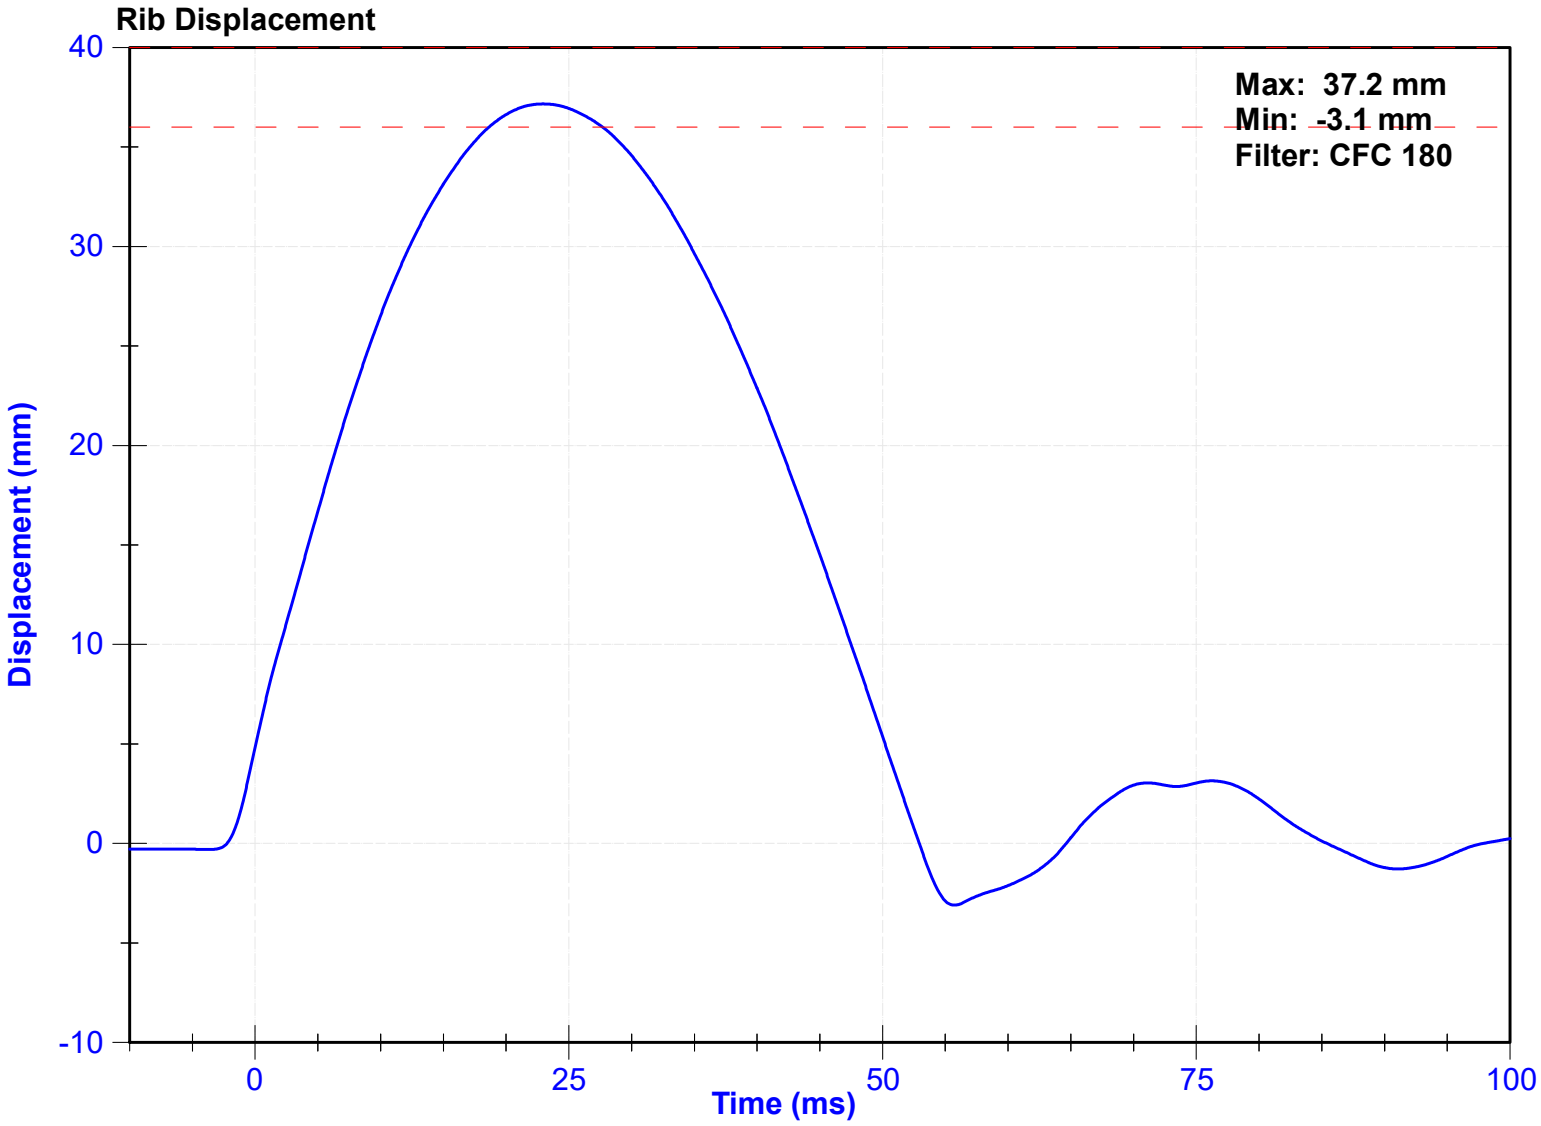

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	46	51	mm	48.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

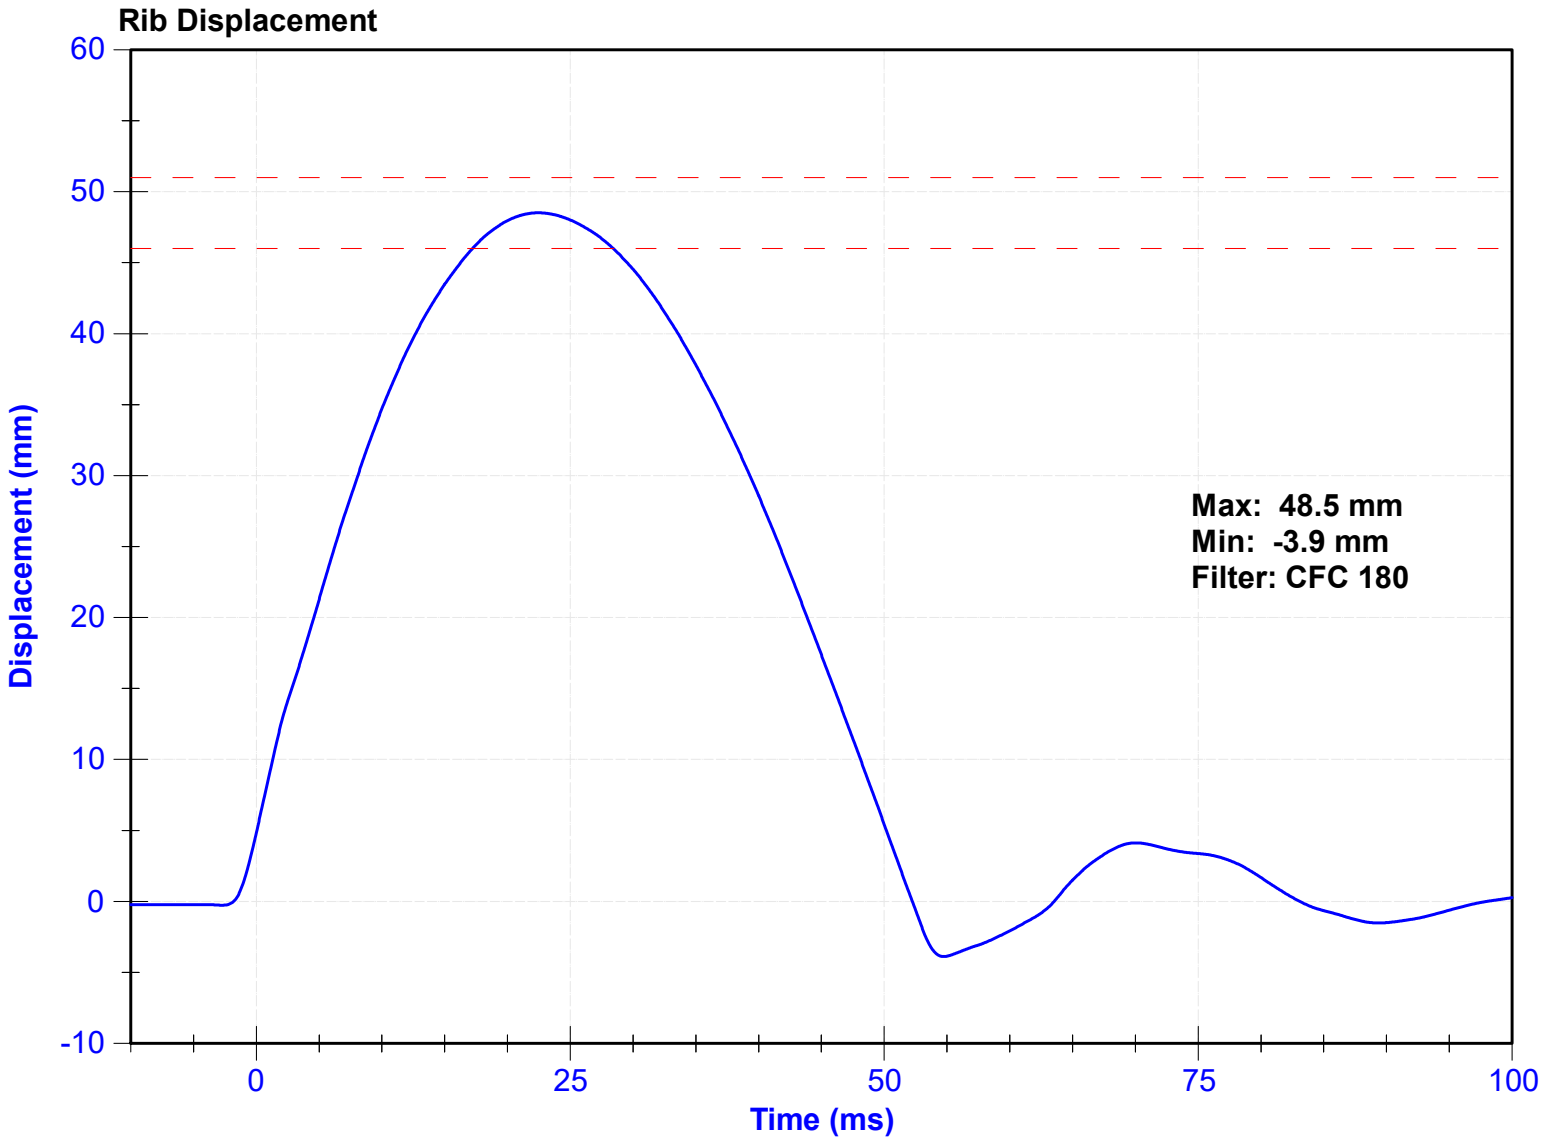

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C.Mantel

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Rib Displacement	36	40	mm	37.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

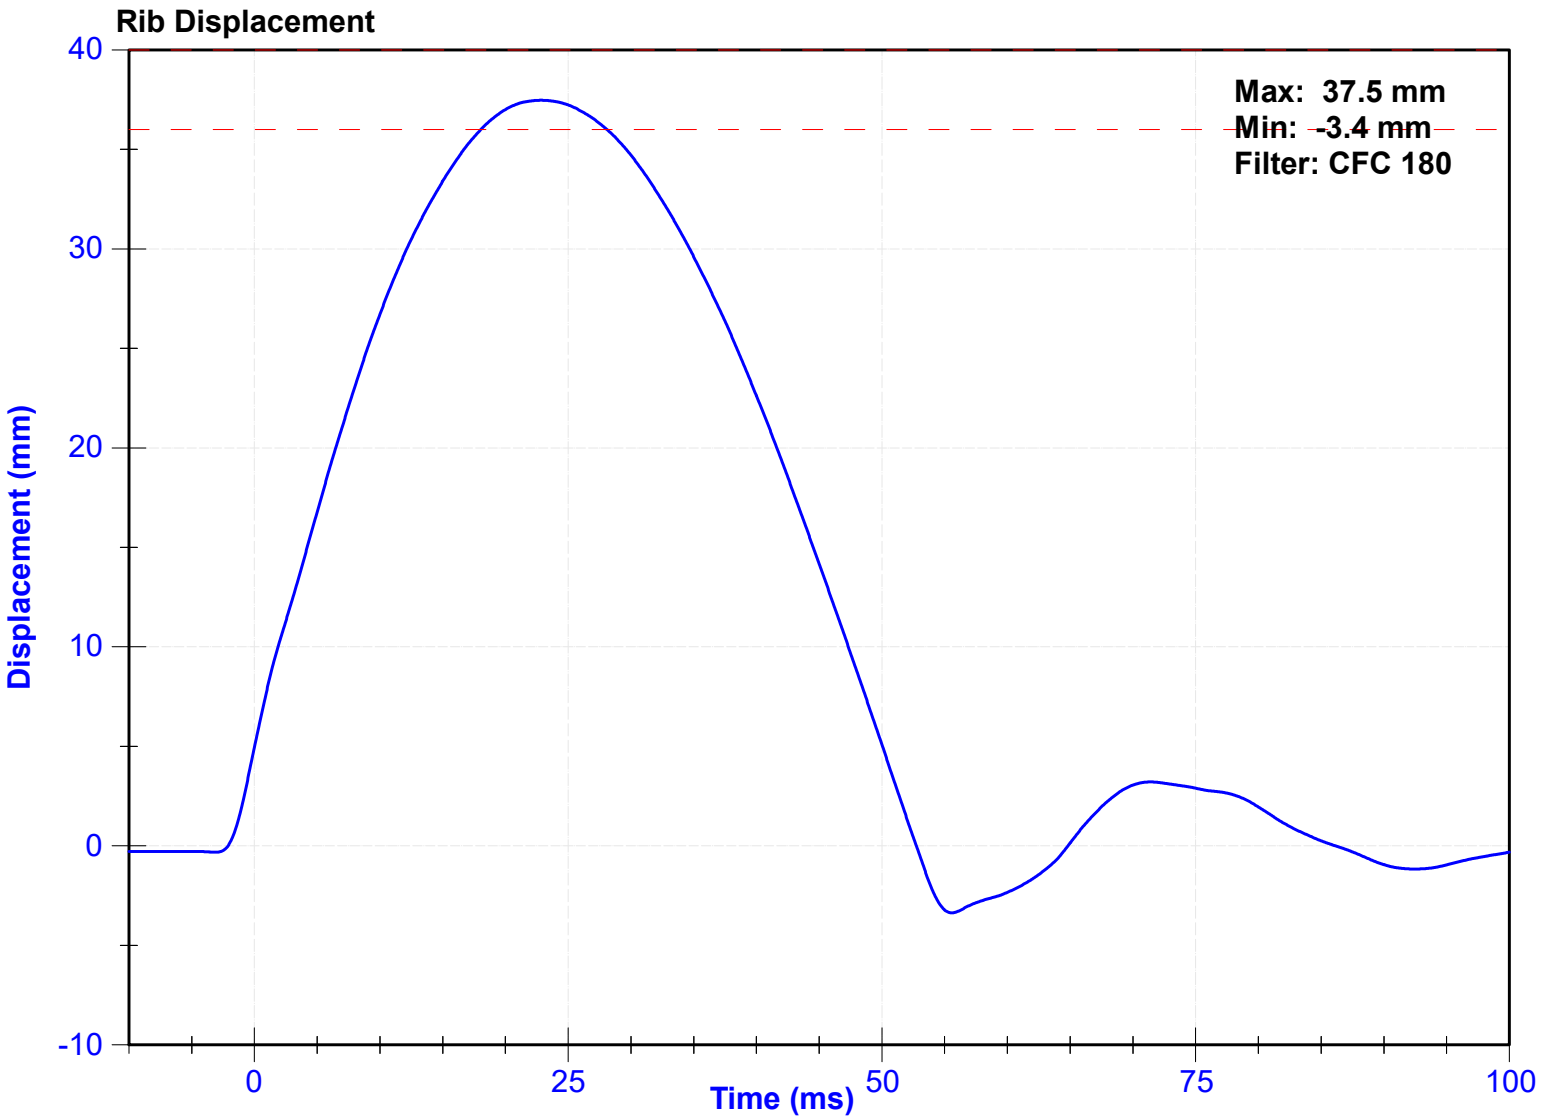

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	17	Pass
Velocity	5.4	5.6	m/s	5.54	Pass
Resistive Force after 6ms	5100	6200	N	6139.1	Pass
Upper Thorax Rib Deflection	34	41	mm	37.6	Pass
Mid Thorax Rib Deflection	37	45	mm	41.0	Pass
Lower Thorax Rib Deflection	37	44	mm	40.0	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18619	9/29/2023	3/27/2024
Upper Thorax Rib Potentiometer	Honeywell	179GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Honeywell	185GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Honeywell	178GFE	11/17/2023	5/17/2024

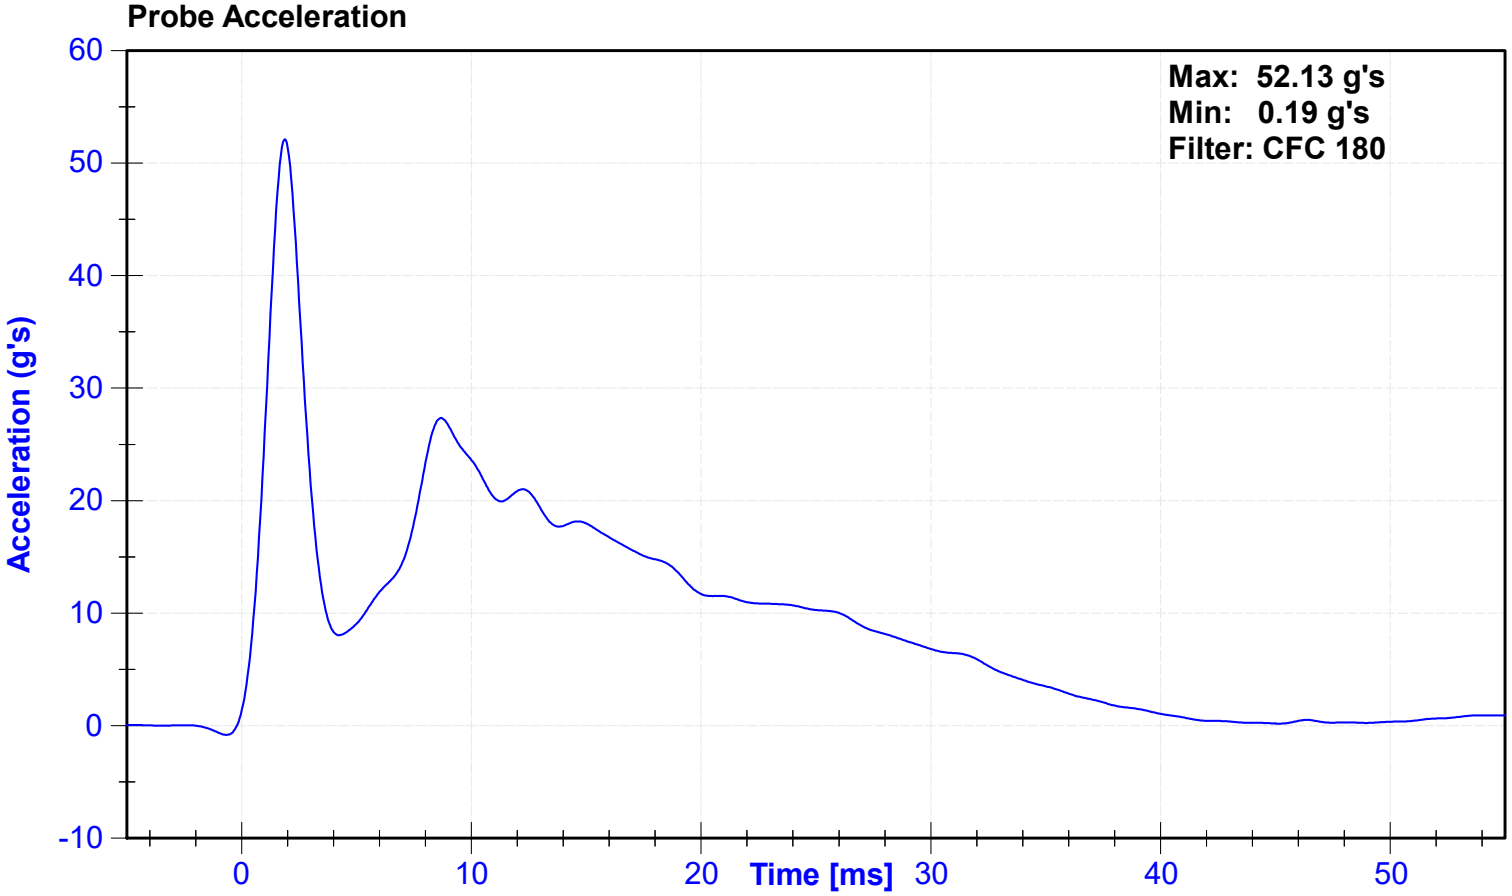

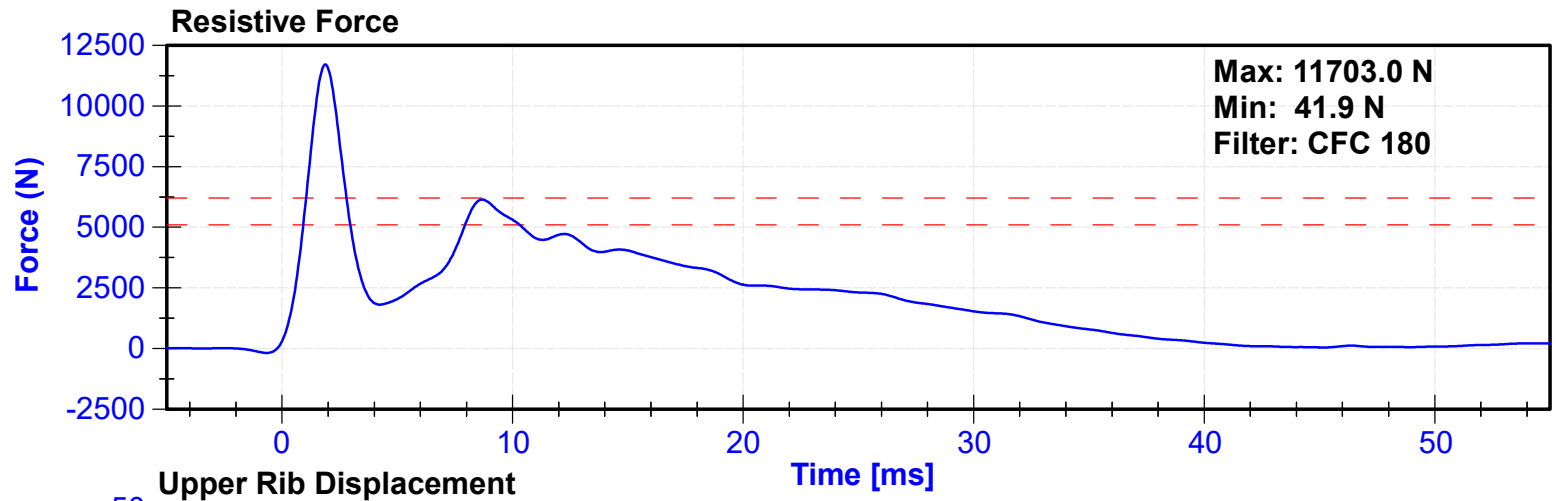
Resistive Force
Force (N)
12500
10000
7500
5000
2500
0
-2500
0
10
20
30
40
50
Time [ms]
Max: 11703.0 N
Min: 41.9 N
Filter: CFC 180

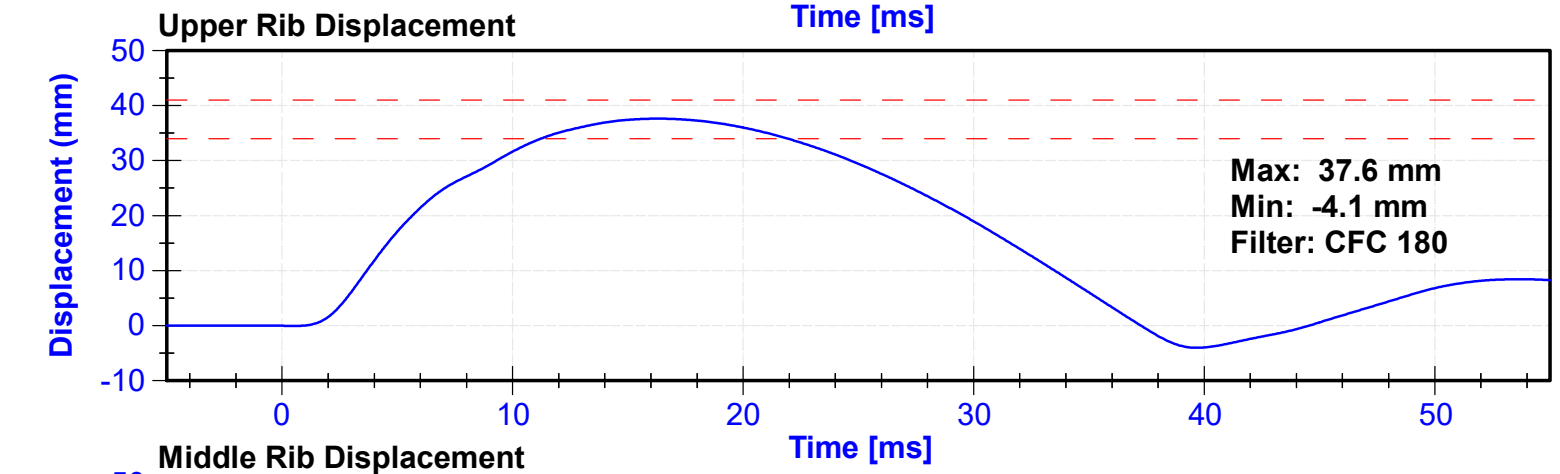
Upper Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 37.6 mm
Min: -4.1 mm
Filter: CFC 180

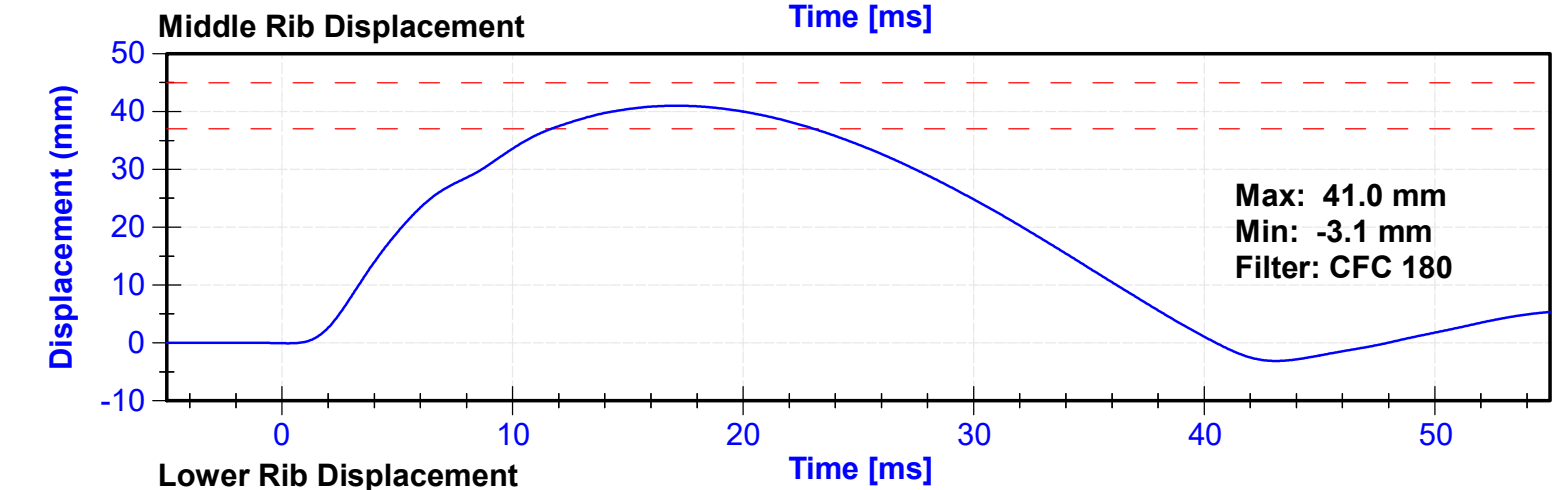
Middle Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 41.0 mm
Min: -3.1 mm
Filter: CFC 180

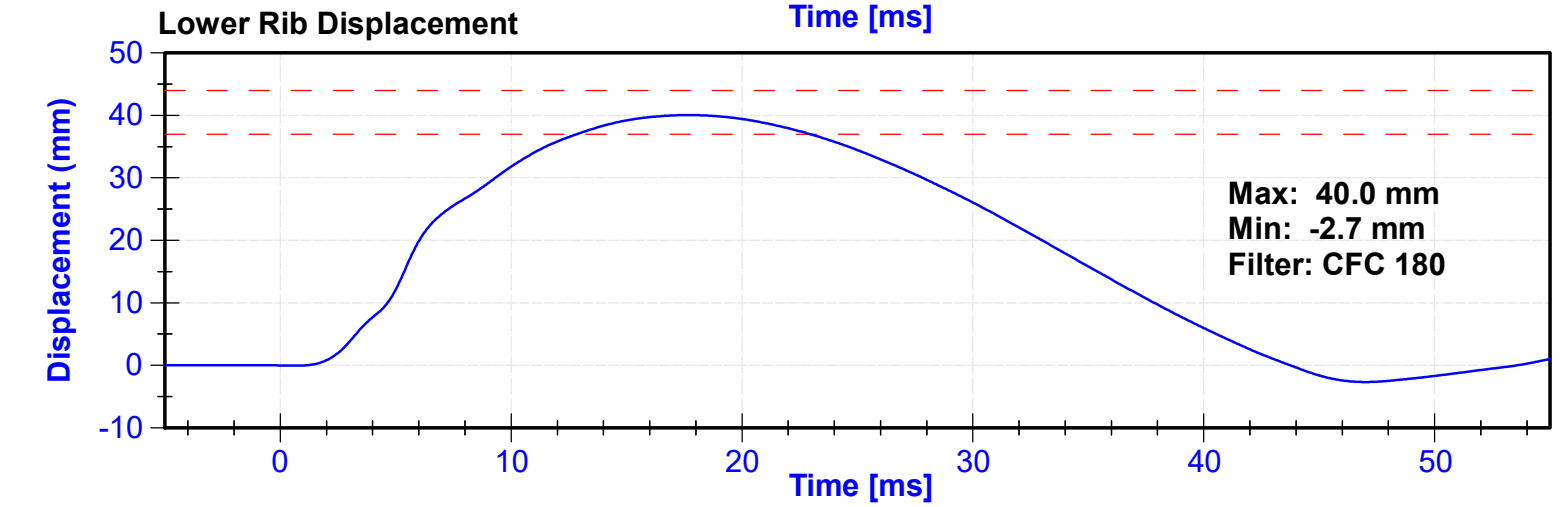
Lower Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 40.0 mm
Min: -2.7 mm
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	17	Pass
Velocity	3.9	4.1	m/s	4.04	Pass
Combined Abdomen Force	2200	2700	N	2518.9	Pass
Time at Peak Abdomen Force	10.0	12.3	ms	10.45	Pass
Resistive Probe Force	4000	4800	N	4523.5	Pass
Time at Peak Resistive Force	10.6	13.0	ms	10.70	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18619	9/29/2023	3/27/2024
Front Abdomen Load Cell	Denton	DM5846	5/18/2023	5/17/2024
Middle Abdomen Load Cell	Denton	1529	5/18/2023	5/17/2024
Rear Abdomen Load Cell	Denton	1533	5/18/2023	5/17/2024

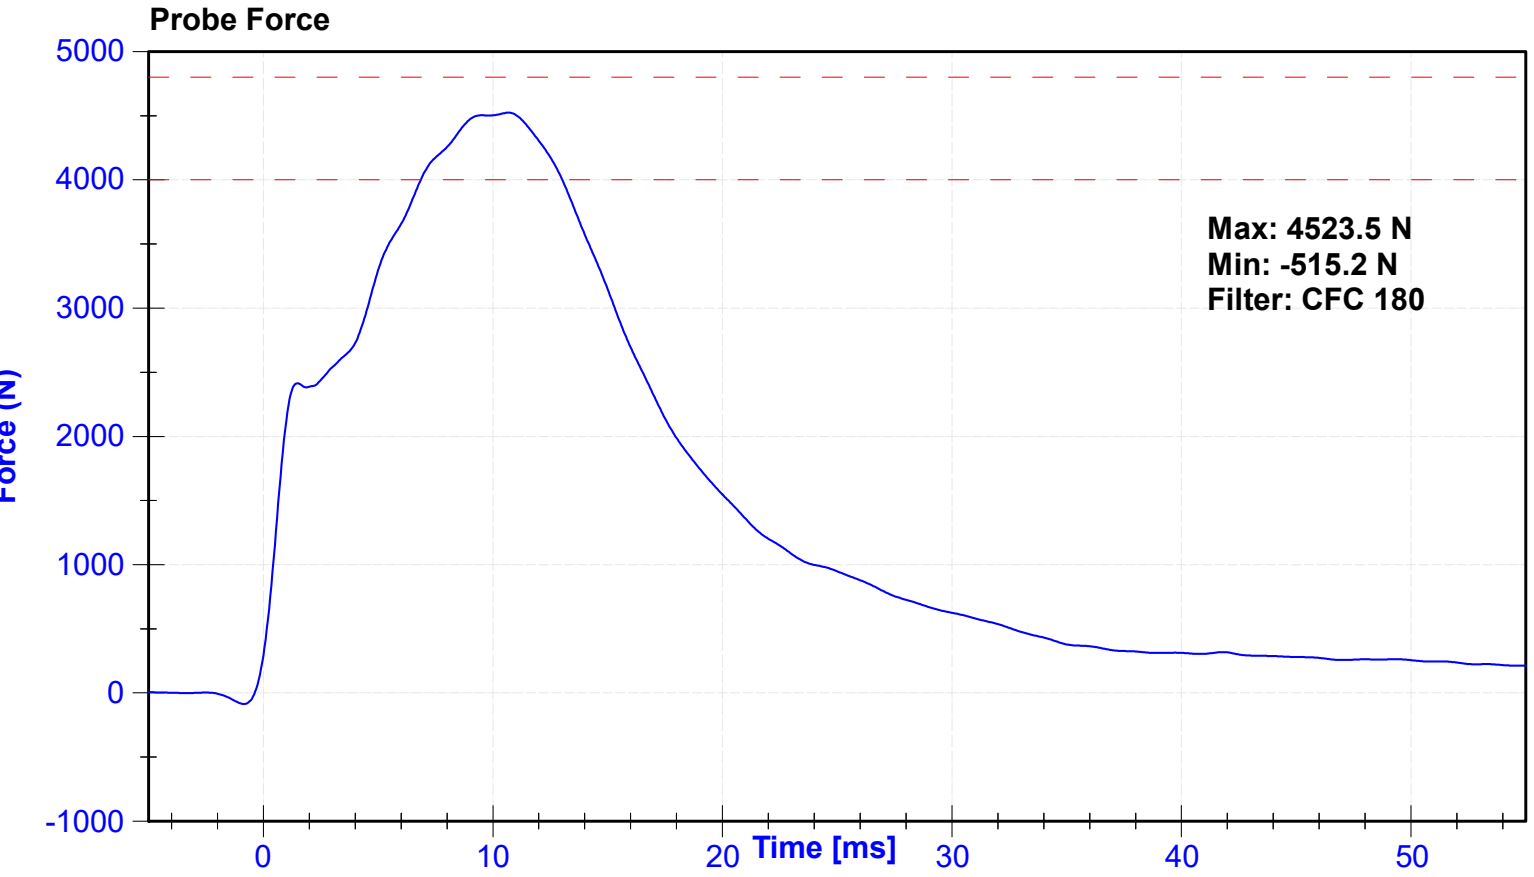

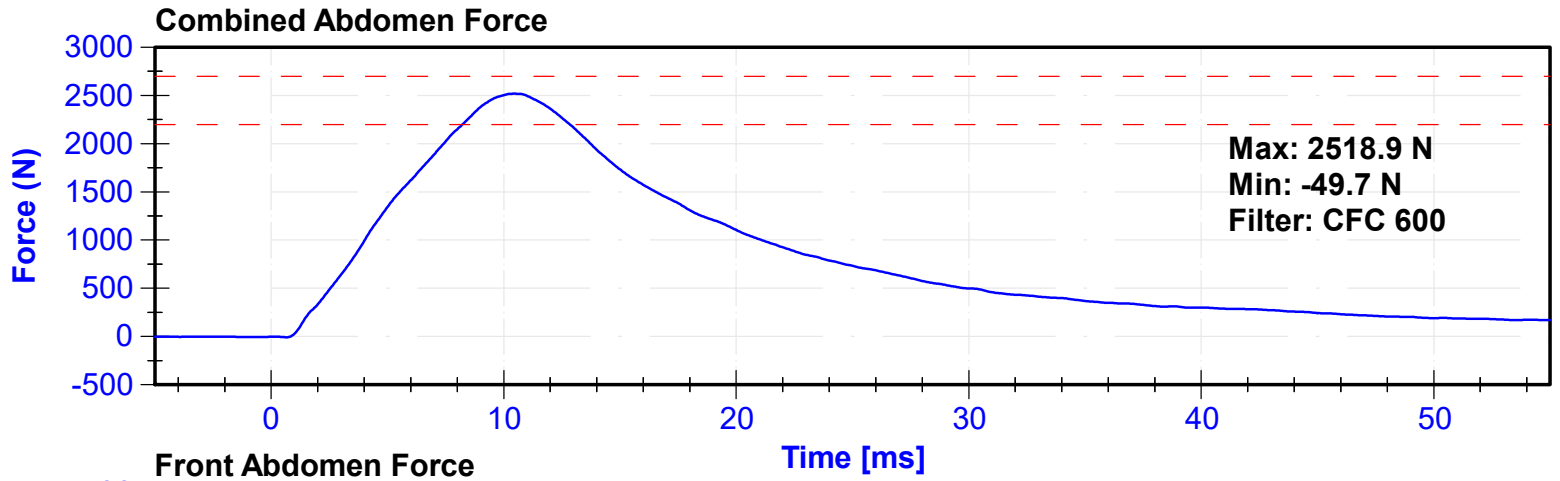
Combined Abdomen Force
Force (N)
Time [ms]
Max: 2518.9 N
Min: -49.7 N
Filter: CFC 600

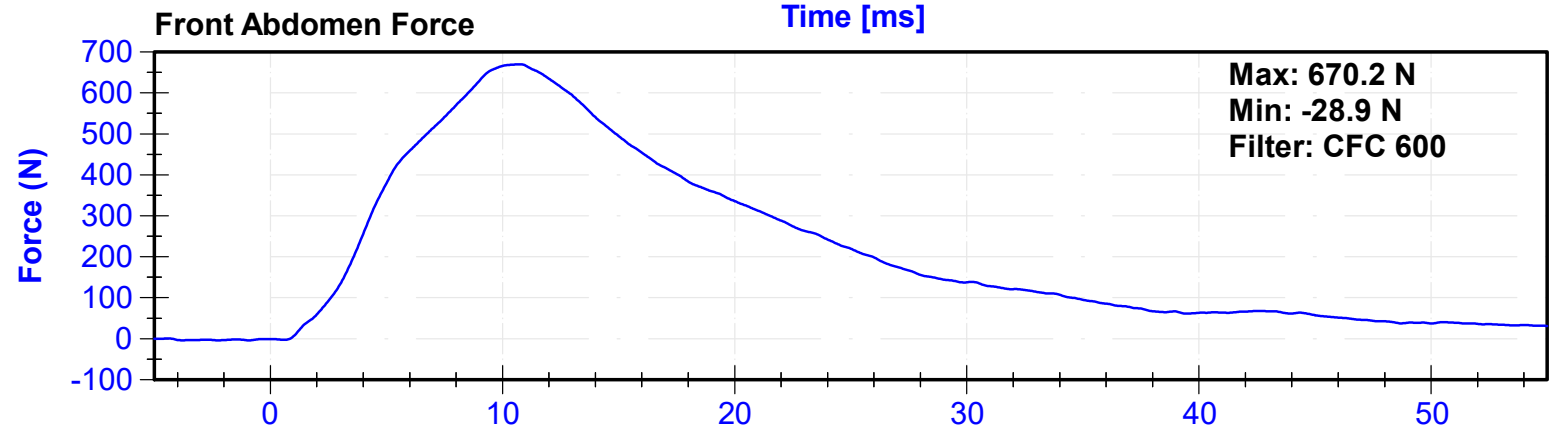
Front Abdomen Force
Force (N)
Time [ms]
Max: 670.2 N
Min: -28.9 N
Filter: CFC 600

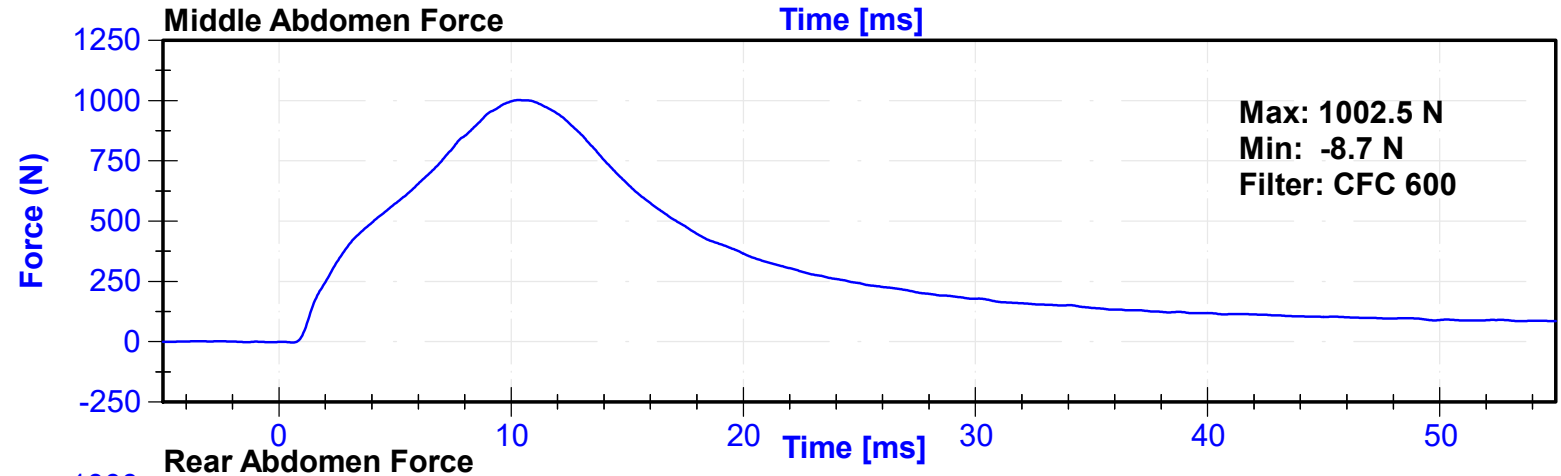
Middle Abdomen Force
Force (N)
Time [ms]
Max: 1002.5 N
Min: -8.7 N
Filter: CFC 600

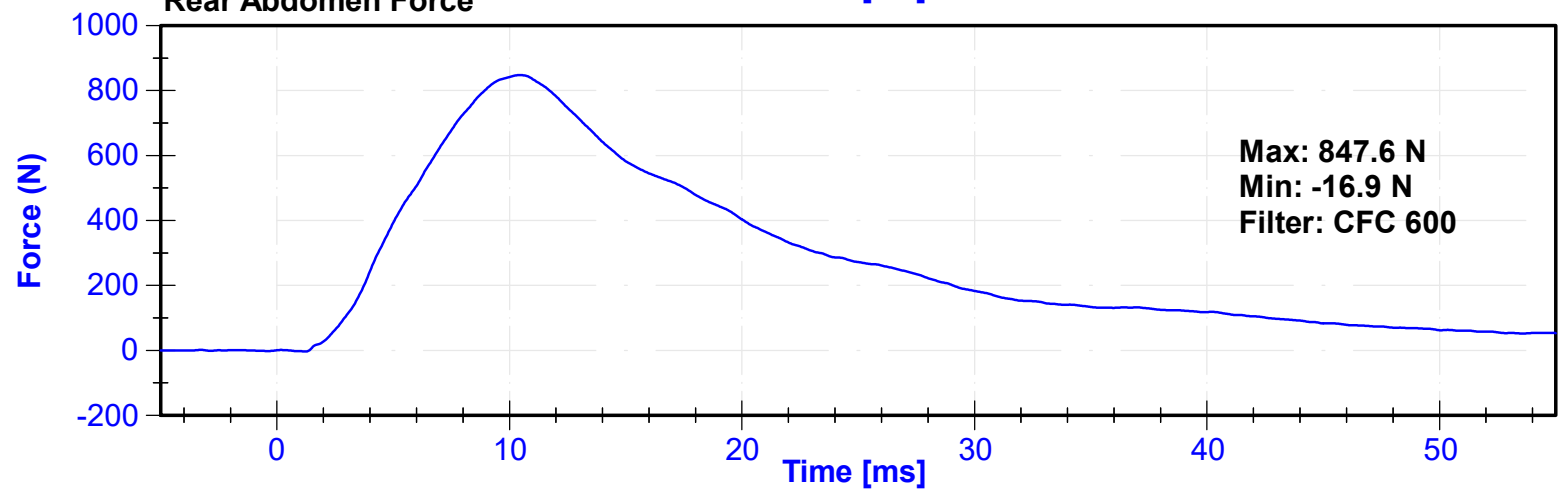
Rear Abdomen Force
Force (N)
Time [ms]
Max: 847.6 N
Min: -16.9 N
Filter: CFC 600

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.7	Pass
Humidity	10	70	%	18	Pass
Velocity	5.95	6.15	m/s	6.000	Pass
Lateral Spine Rotation	45	55	deg	46.8	Pass
Time at Maximum Rotation	39	53	ms	41.3	Pass
Time of Decay to Zero Degrees	37	57	ms	37.5	Pass
Pendulum Velocity Overall Corridor	Lower Boundary[1]	Upper Boundary[2]	m/s	See Plot[3]	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	C16503	10/31/2023	4/28/2024
Pendulum "A" Potentiometer	Sfernice	2247	12/5/2023	12/4/2024
Condyle "B" Potentiometer	Sfernice	095	9/29/2023	9/28/2024

Pendulum Velocity[3]

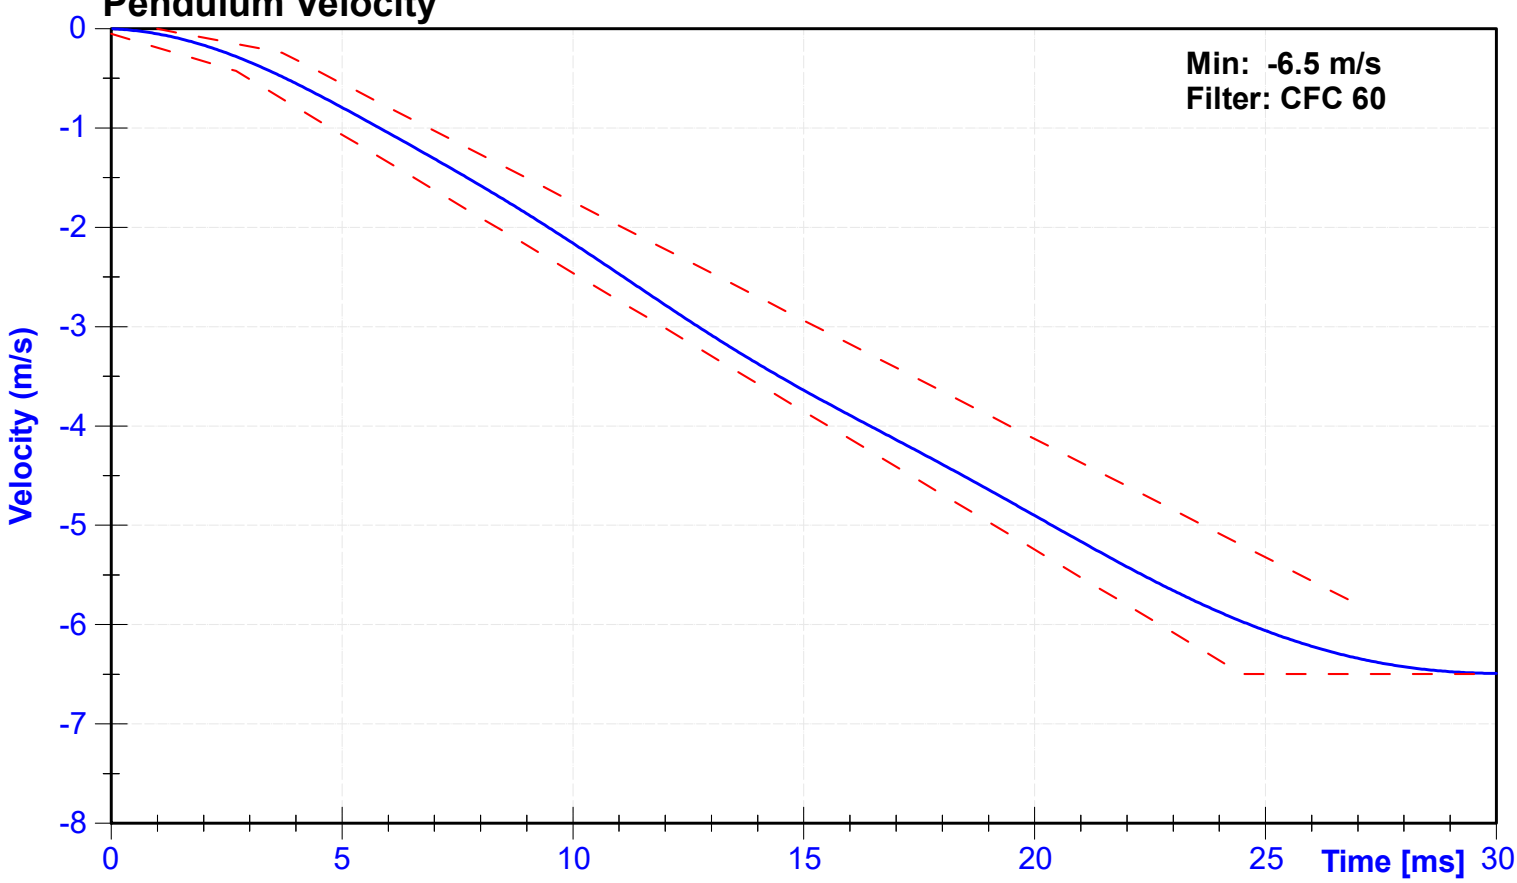

[1,2] Upper and lower boundaries specified in Appendix I

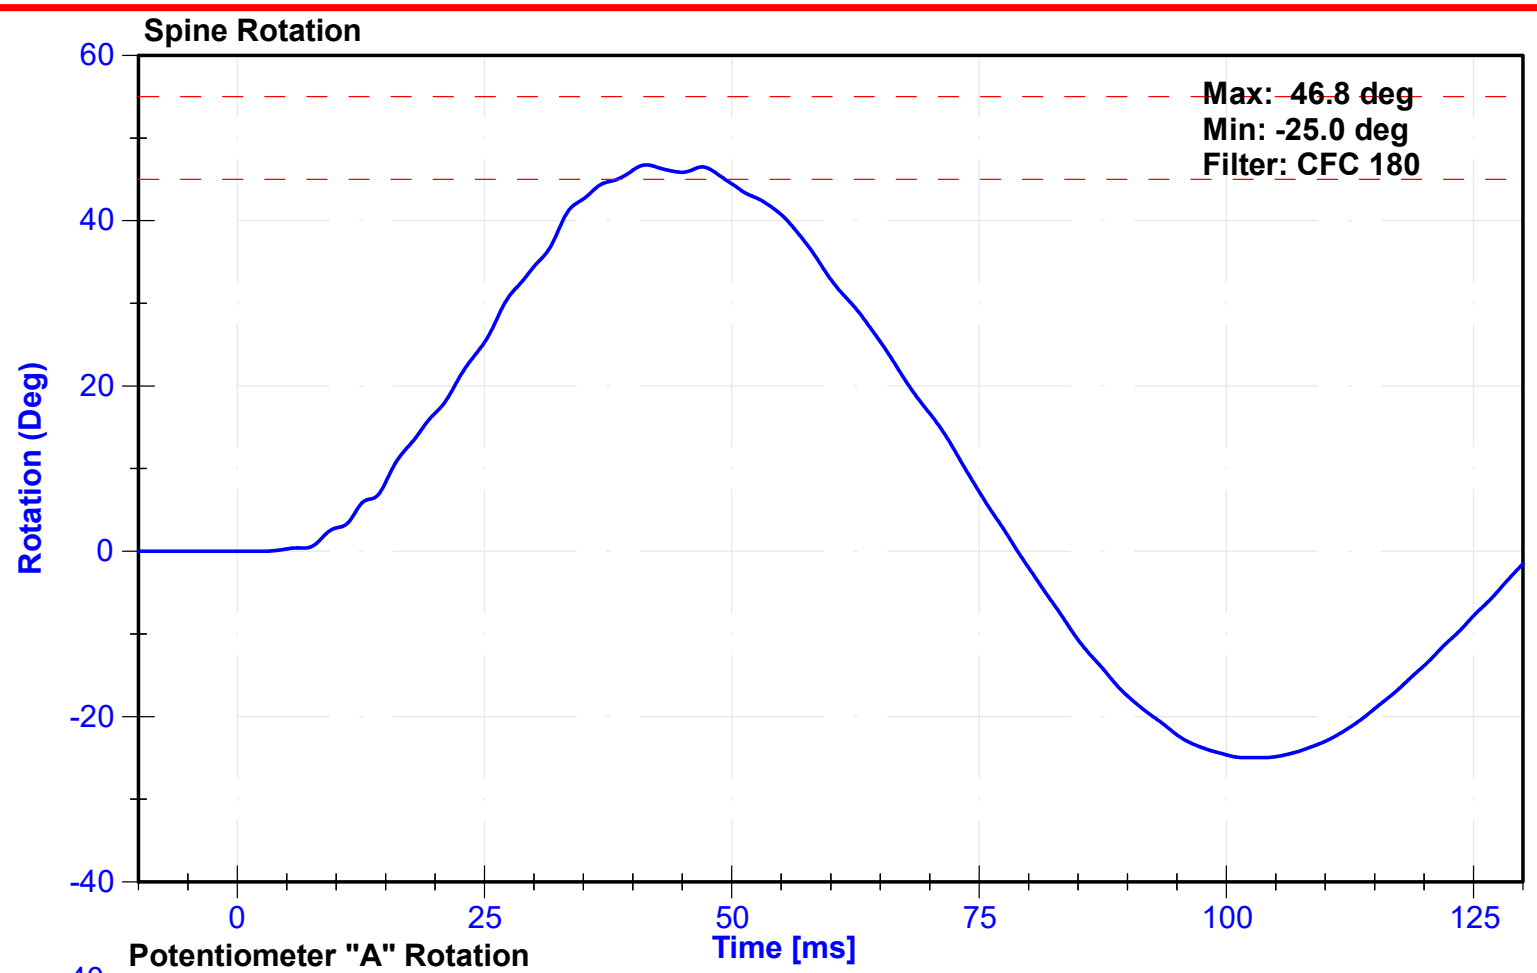
Spine Rotation
Max: 46.8 deg
Min: -25.0 deg
Filter: CFC 180
Rotation (Deg)
60
40
20
0
-20
-40
0
25
50
75
100
125
Time [ms]

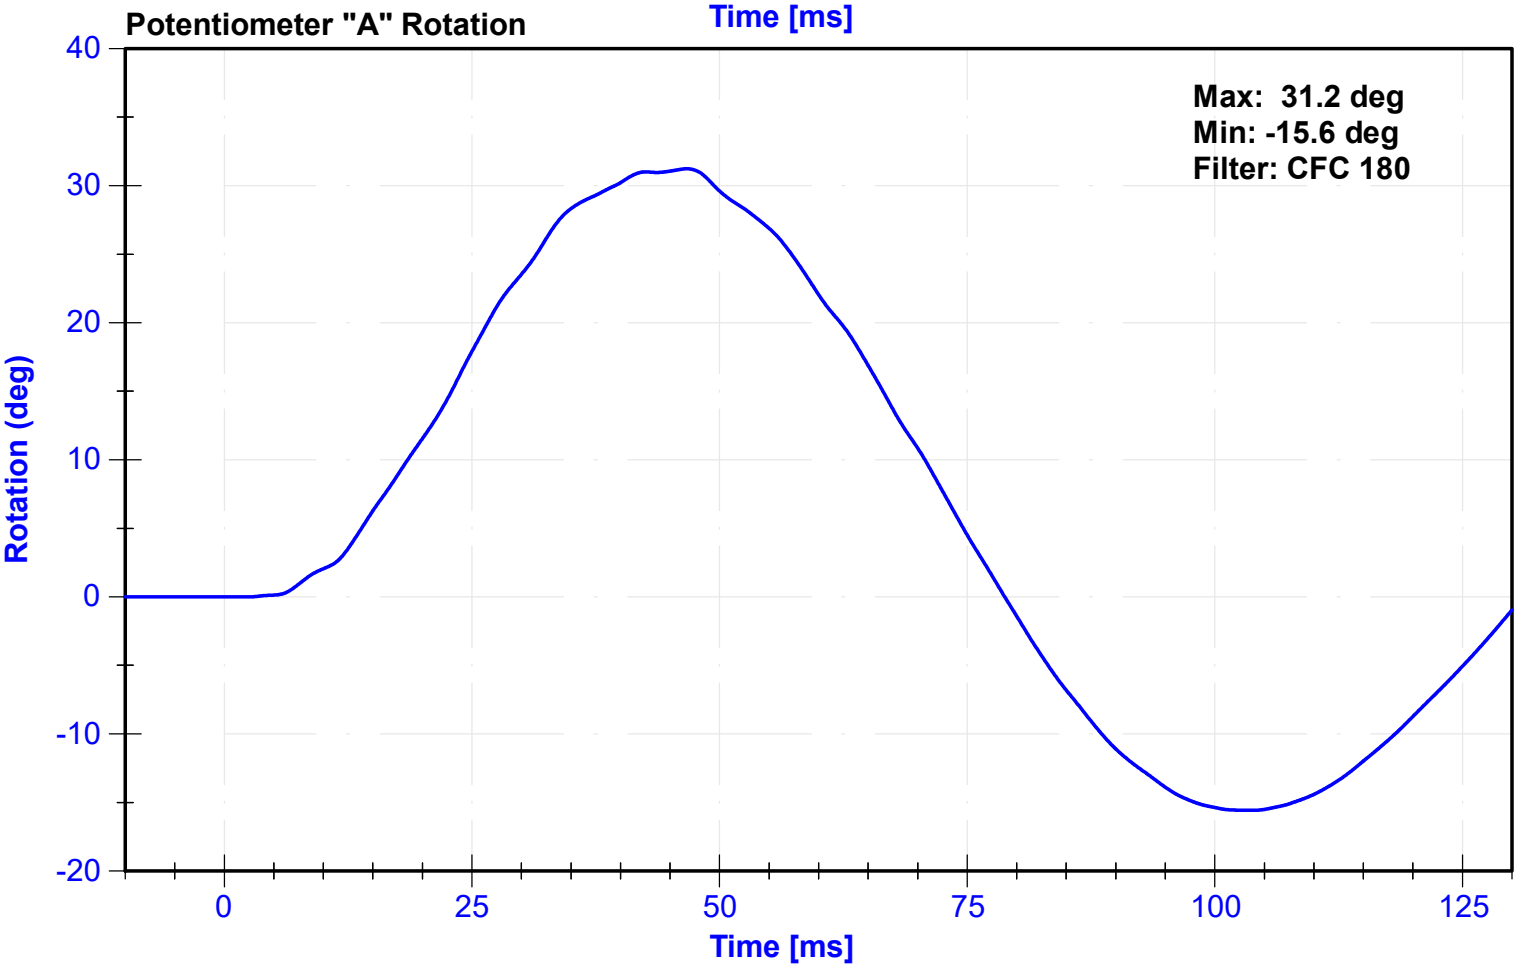
Potentiometer "A" Rotation
Max: 31.2 deg
Min: -15.6 deg
Filter: CFC 180
Rotation (deg)
40
30
20
10
0
-10
-20
0
25
50
75
100
125
Time [ms]

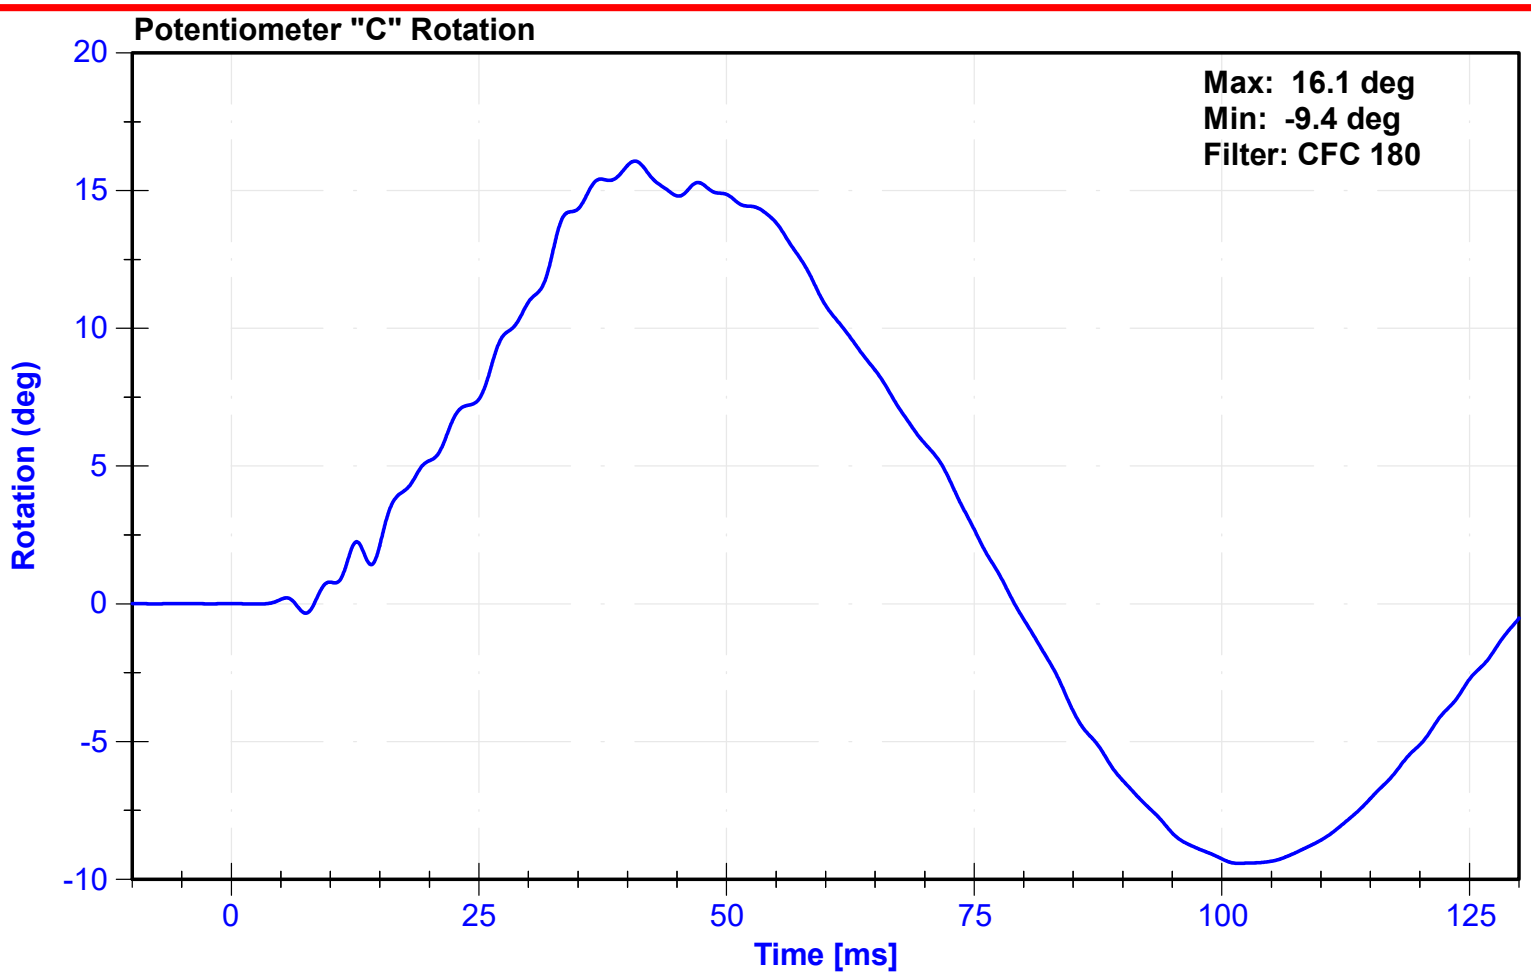

Appendix I

[2] Upper Boundary Corridor		[1] Lower Boundary Corridor	
Time (ms)	Velocity (m/s)	Time (ms)	Velocity (m/s)
1.0	0.00	0.0	-0.05
3.7	-0.24	2.7	-0.425
27.0	-5.80	24.5	-6.5
		30.0	-6.5

ATD Manufacturer	FTSS	Test Technician	D. Sakona
ATD Serial Number	F033	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.29	Pass
Resistive Force	4700	5400	N	4957.9	Pass
Time at Peak Resistive Force	11.8	16.1	ms	12.35	Pass
Pubic Force	-1590	-1230	N	-1237.7	Pass
Time at Peak Pubic Force	12.2	17.0	ms	12.95	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18619	9/29/2023	3/27/2024
Pubic Load Cell	Denton	459-FY	6/20/2023	6/19/2024

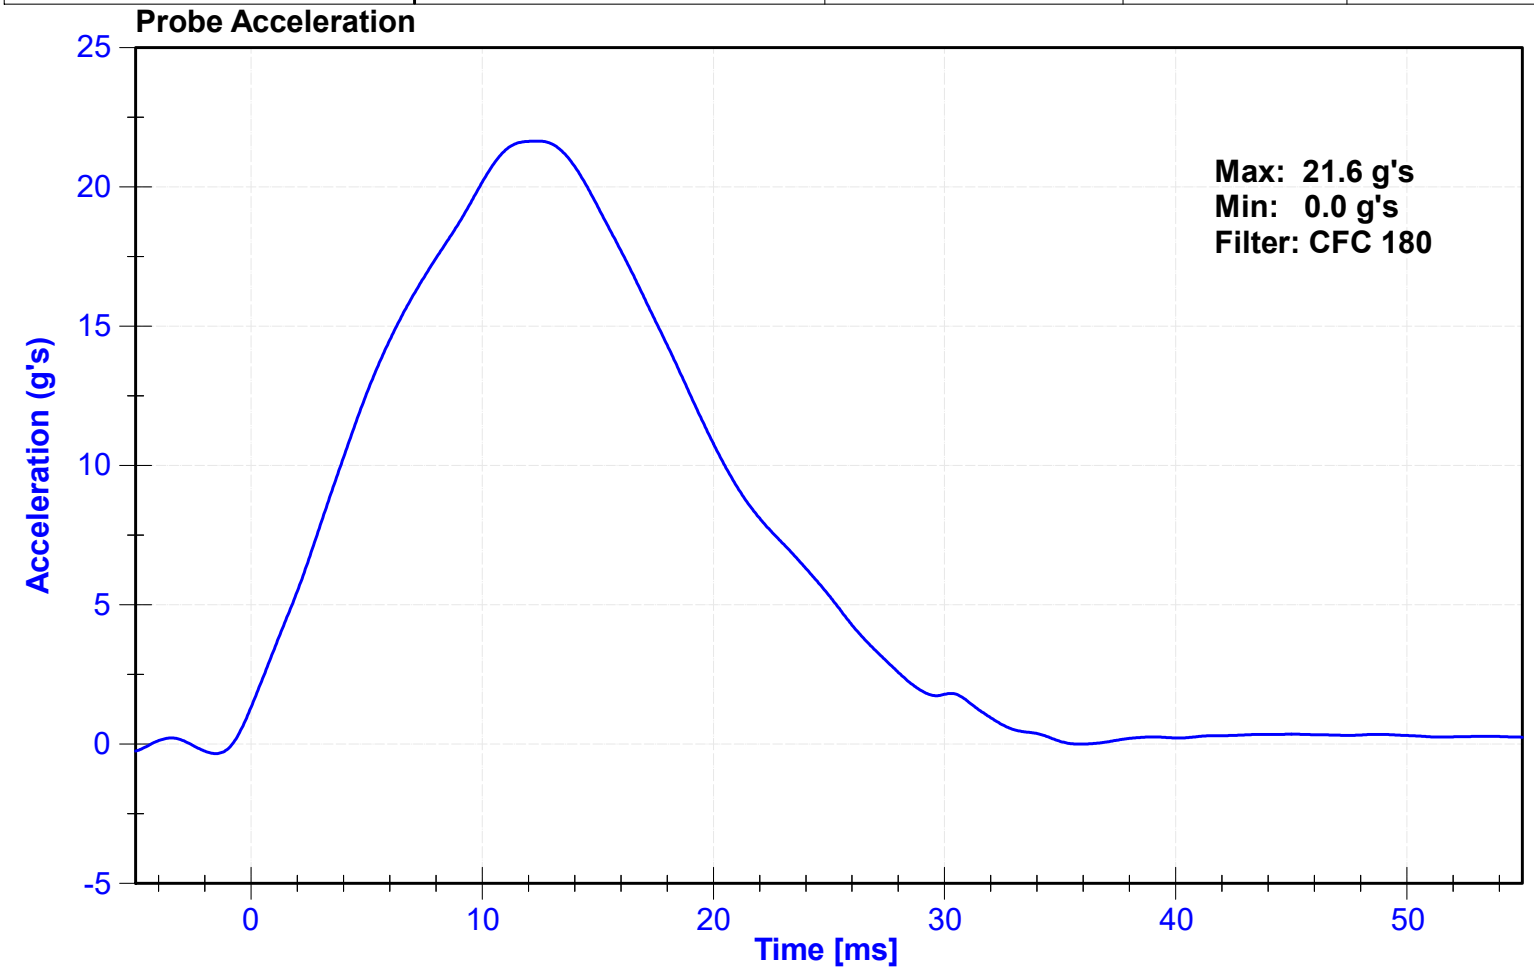

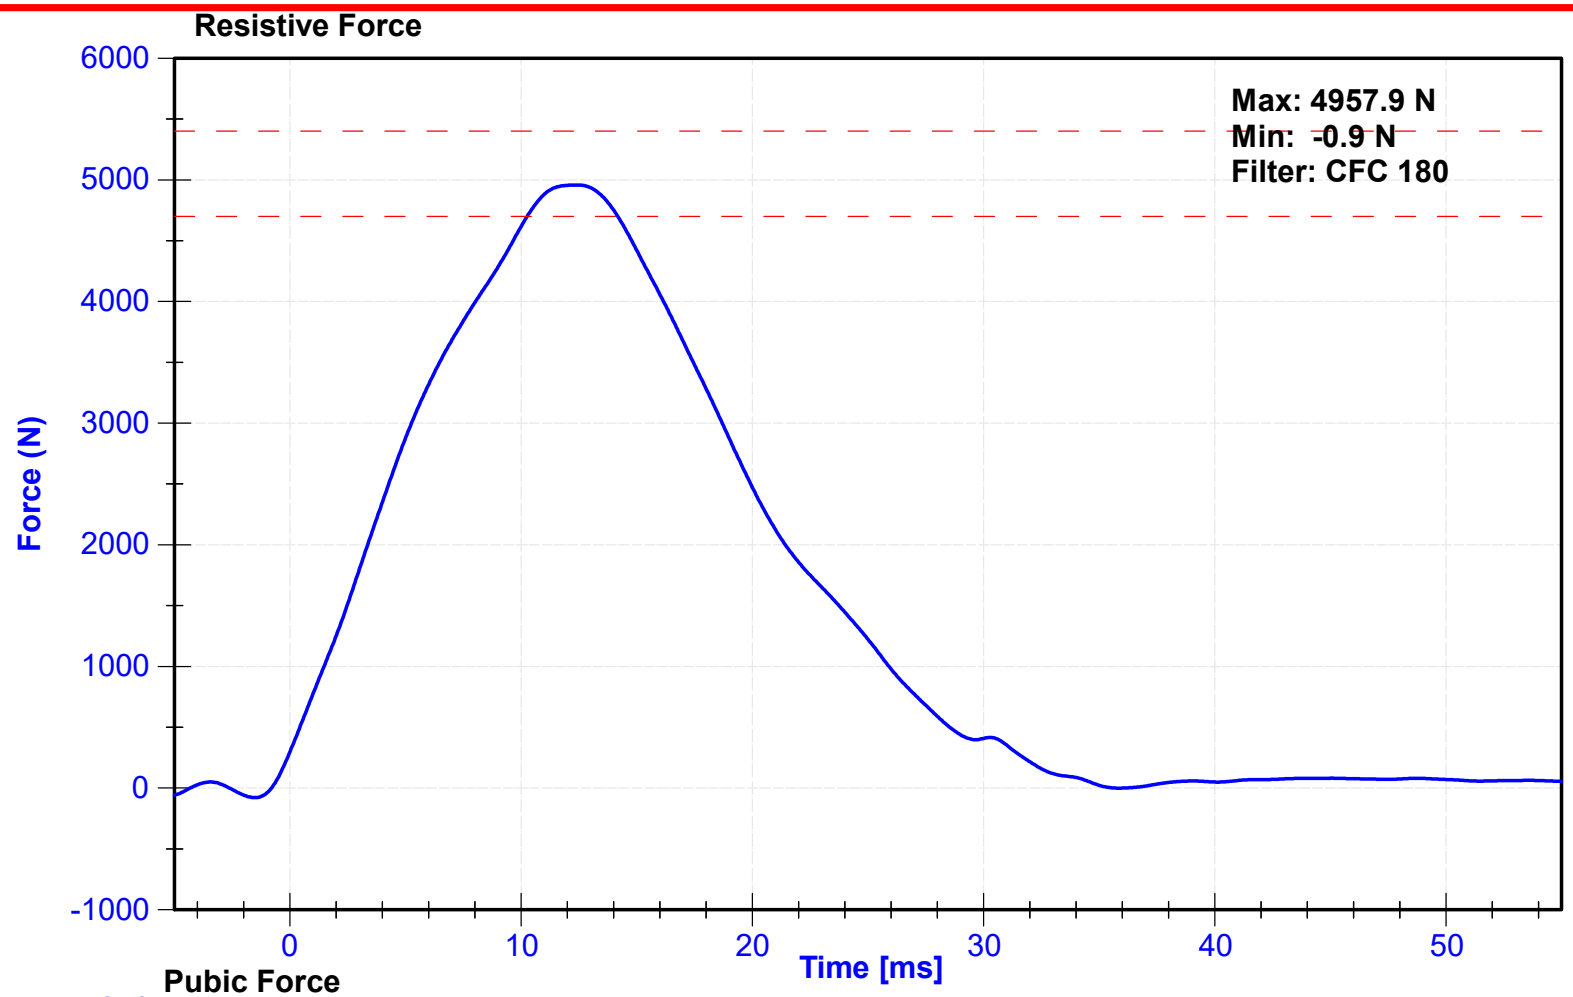
Resistive Force
Max: 4957.9 N
Min: -0.9 N
Filter: CFC 180
Force (N)
6000
5000
4000
3000
2000
1000
0
-1000
0
10
20
30
40
50
Time [ms]

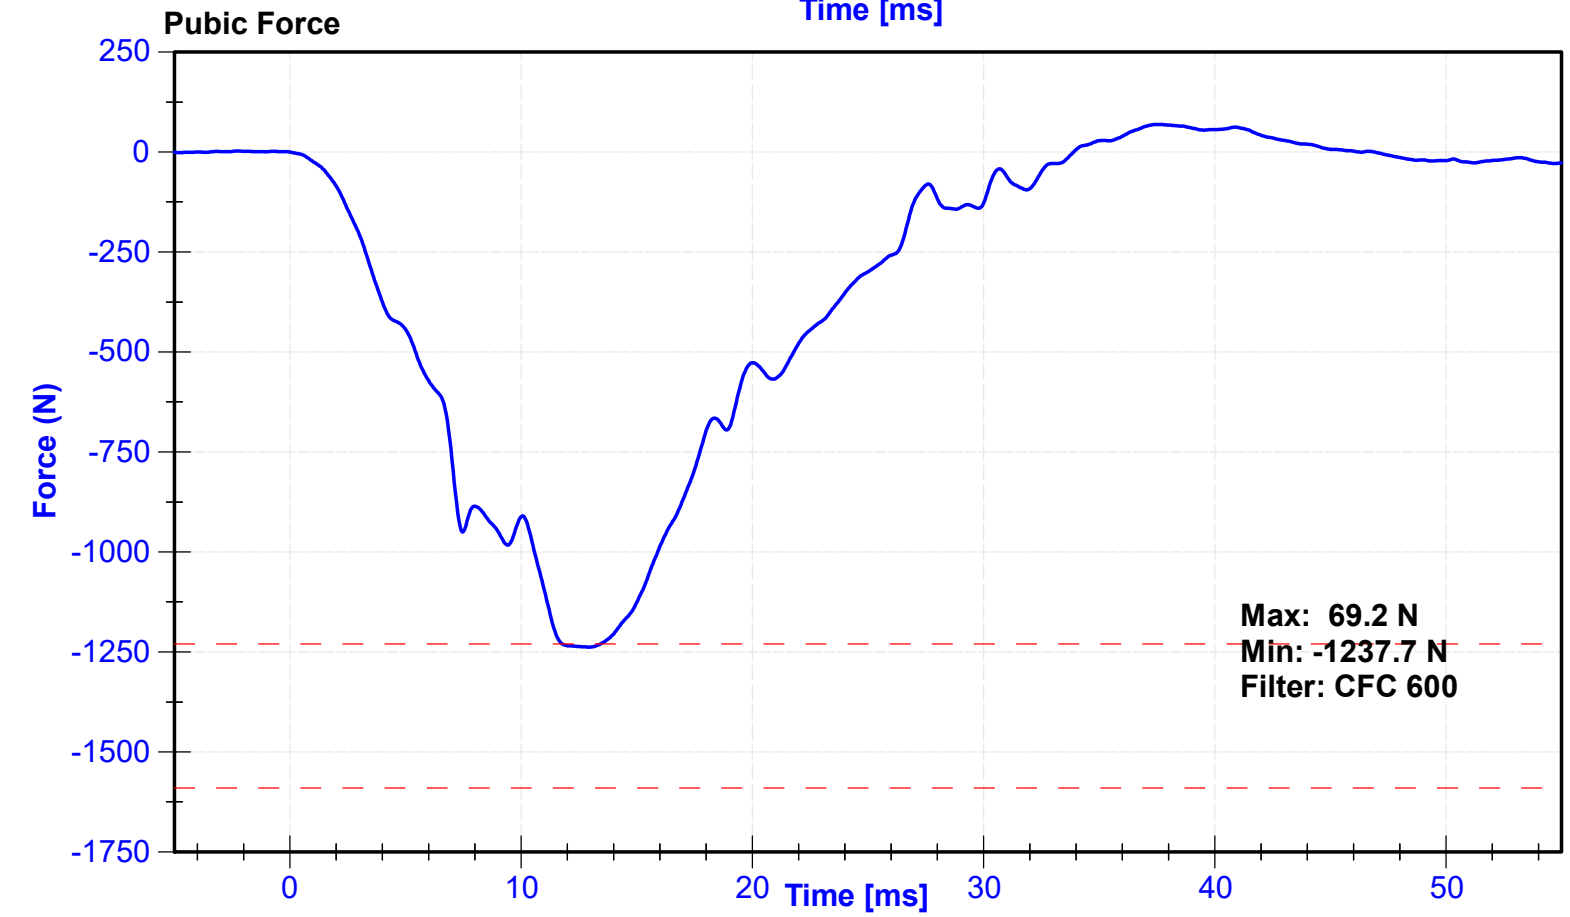
Pubic Force
Max: 69.2 N
Min: -1237.7 N
Filter: CFC 600
Force (N)
250
0
-250
-500
-750
-1000
-1250
-1500
-1750
0
10
20
30
40
50
Time [ms]

CALIBRATION TEST RESULTS

POST-TEST

SID-IIS 5TH PERCENTILE FEMALE – PASSENGER ATD

SERIAL NO:300

(CONFIGURED FOR LEFT SIDE IMPACT)

External Measurements - SID-IIs

Technician: K. Brogan Date: 1/18/2024

Dummy Serial Number: 300

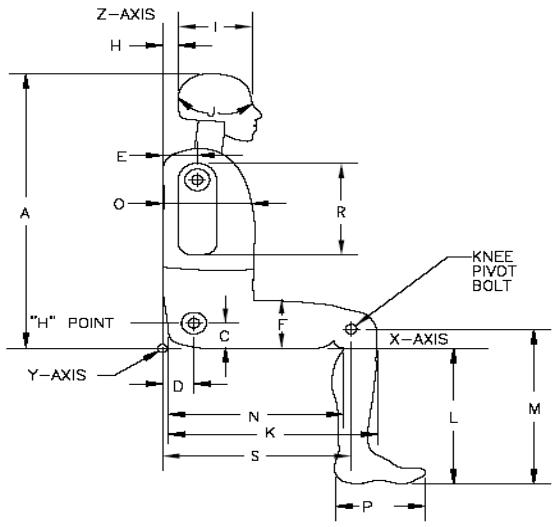

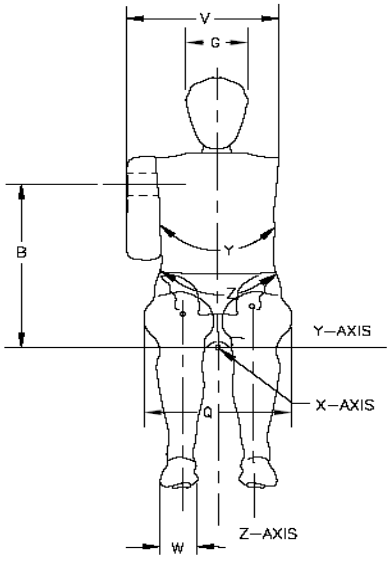

Symbol	Description	Specification (mm)		Result (mm)	Pass/Fail
A	Sitting Height	772	788	781	Pass
B	Shoulder Pivot Height	437	453	444	Pass
C	H-point Height	79	89	84	Pass
D	H-point from seatback	141	151	144	Pass
E	Shoulder Pivot from Backline	97	107	99	Pass
F	Thigh Clearance	119	135	124	Pass
G	Head Breadth	140	148	144	Pass
H	Head Back from Backline	40	46	43	Pass
I	Head Depth	178	188	181	Pass
J	Head Circumference	541	551	548	Pass
K	Buttock to Knee Length	514	540	530	Pass
L	Popliteal Height	343	369	357	Pass
M	Knee Pivot to floor height	392	409	402	Pass
N	Buttock Popliteal Length	416	442	434	Pass
O	Chest Depth w/o jacket	195	211	199	Pass
P	Foot Length	216	232	221	Pass
Q	Hip Breadth (w/pelvic plugs)	313	323	319	Pass
R	Arm Length	249	259	253	Pass
S	Knee Joint to seatback	477	493	488	Pass
V	Shoulder Width	341	357	350	Pass
W	Foot Width	78	94	86	Pass
Y	Chest Circumference w/jacket	851	881	876	Pass
Z	Waist Circumference	761	791	779	Pass

ATD Manufacturer	FTSS	Test Technician	T. Roseman
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.0	Pass
Humidity	10	70	%	18	Pass
Resultant Acceleration	115	137	g's	119.8	Pass
Oscillation	0	15	%	1.8	Pass
Fore-Aft Acceleration	-15	15	g's	2.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibratio Date	Calibratio Due Date
X Accelerometer	Endevco	P59018	11/15/2023	5/13/2024
Y Accelerometer	Endevco	P79189	11/15/2023	5/13/2024
Z Accelerometer	Endevco	P79587	11/15/2023	5/13/2024

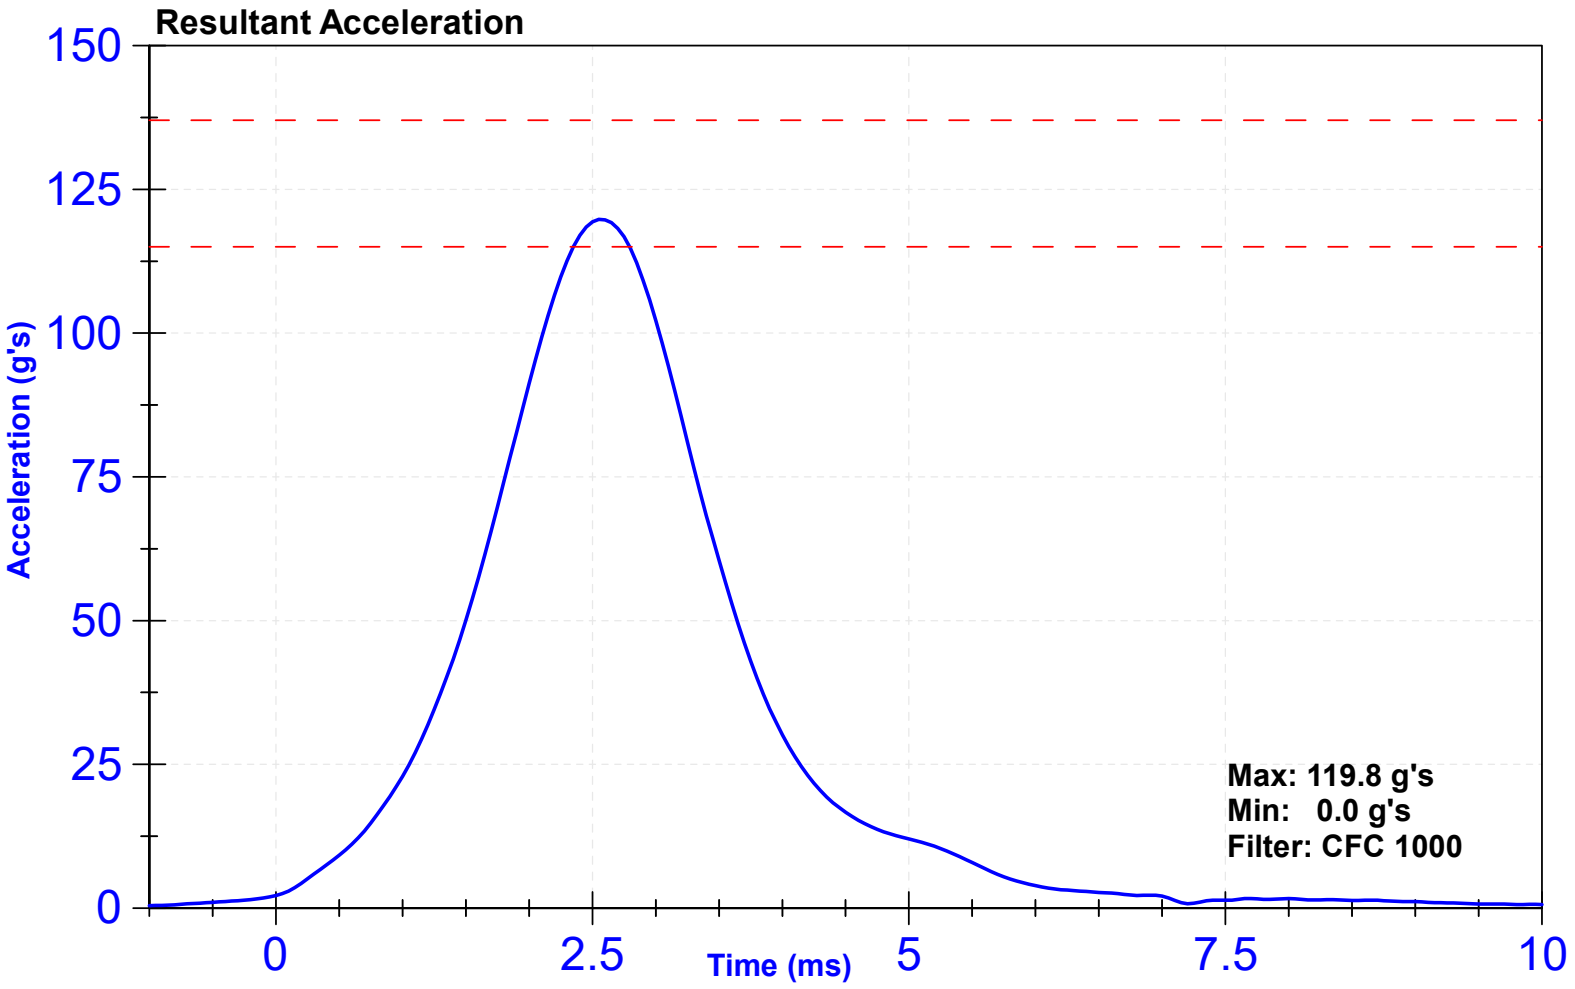

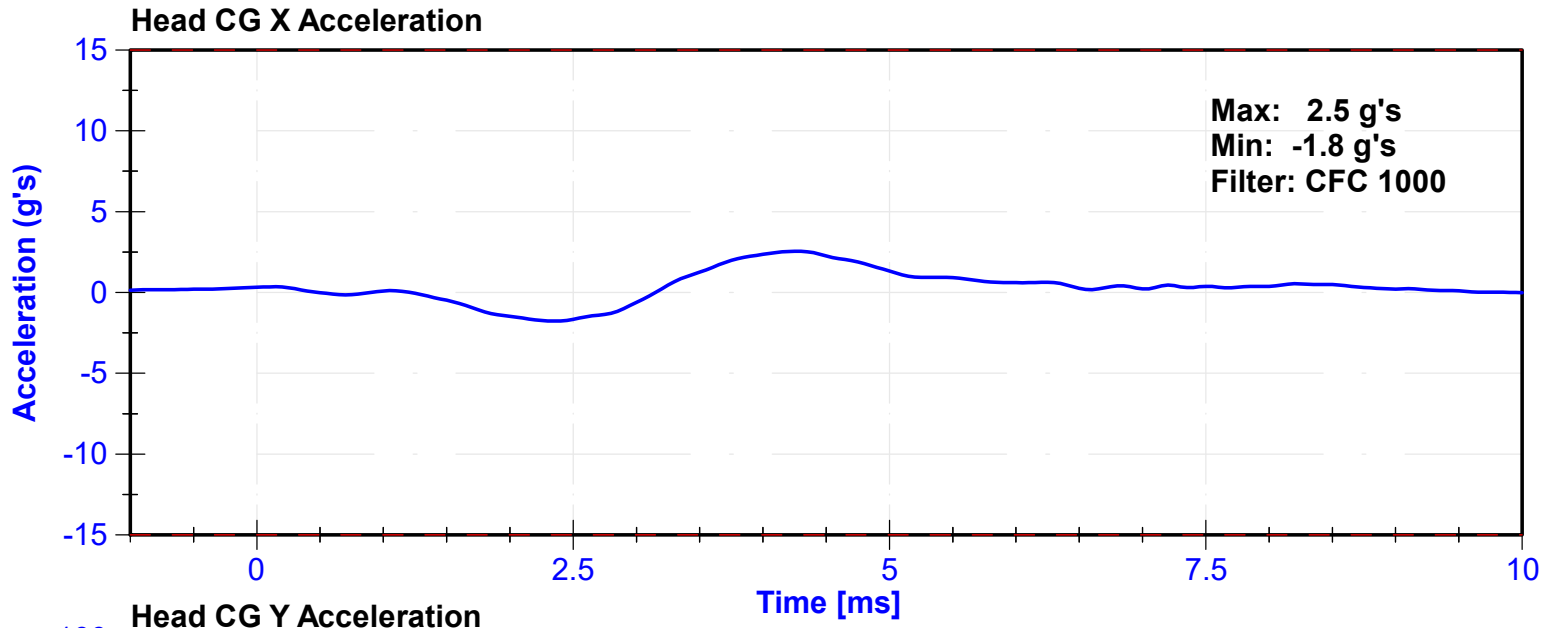
Head CG X Acceleration
Max: 2.5 g's
Min: -1.8 g's
Filter: CFC 1000
Acceleration (g's)
15
10
5
0
-5
-10
-15
0
2.5
5
7.5
10
Time [ms]

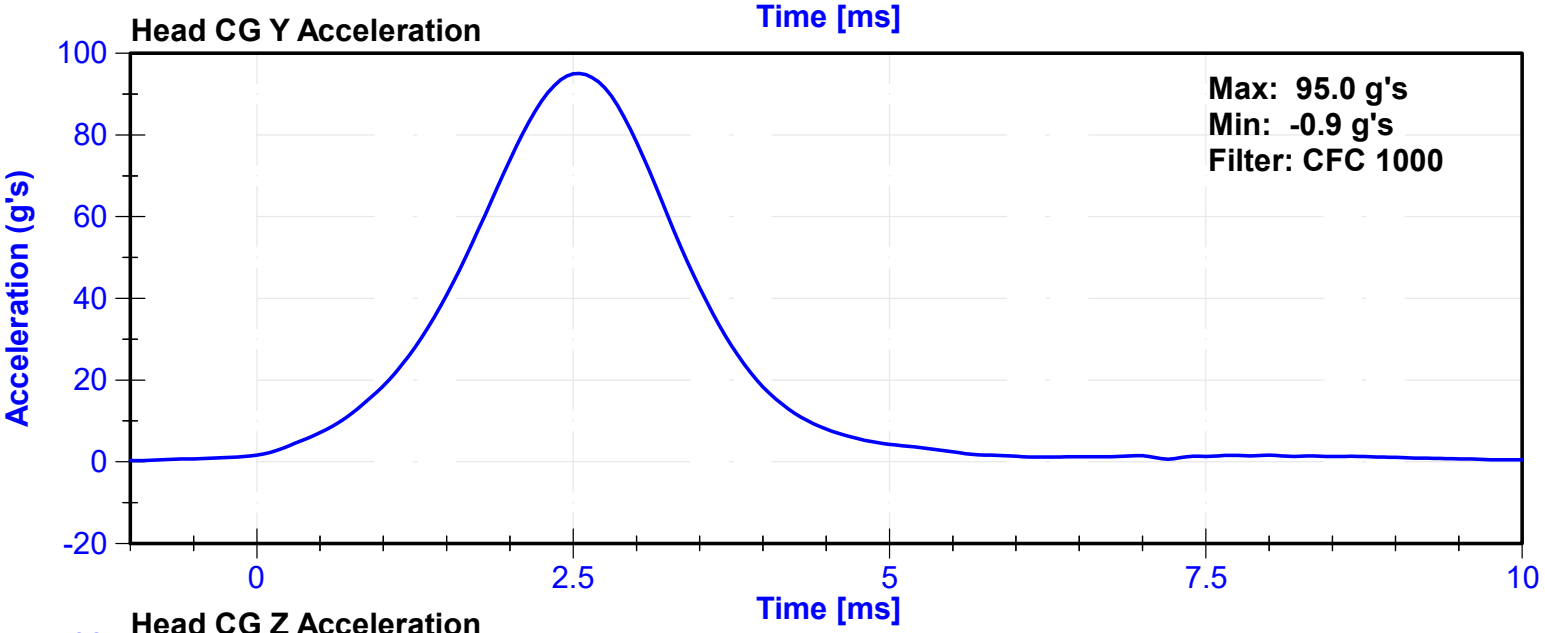
Head CG Y Acceleration
Max: 95.0 g's
Min: -0.9 g's
Filter: CFC 1000
Acceleration (g's)
100
80
60
40
20
0
-20
0
2.5
5
7.5
10
Time [ms]

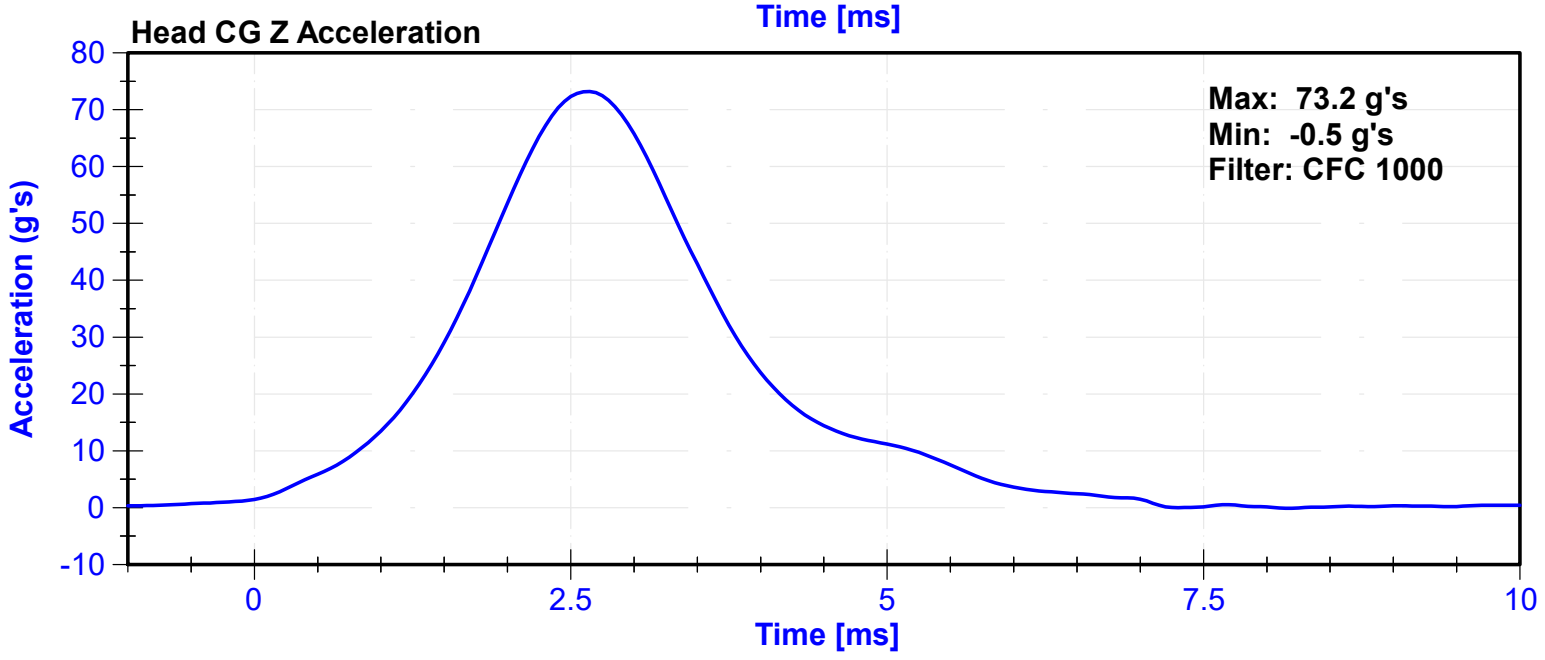
Head CG Z Acceleration
Max: 73.2 g's
Min: -0.5 g's
Filter: CFC 1000
Acceleration (g's)
80
70
60
50
40
30
20
10
0
-10
0
2.5
5
7.5
10
Time [ms]

ATD Manufacturer	FTSS	Test Technician	T. Roseman
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	20.9	Pass
Humidity	10	70	%	17.5	Pass
Velocity	5.51	5.63	m/s	5.539	Pass
Pendulum Impulse at 10ms	2.2	2.8	m/s	2.41	Pass
Pendulum Impulse at 15ms	3.3	4.1	m/s	3.64	Pass
Pendulum Impulse at 20ms	4.4	5.4	m/s	4.92	Pass
Pendulum Impulse at 25ms	5.4	6.1	m/s	5.86	Pass
Pendulum Impulse from 25 to 100ms	5.5	6.2	m/s	5.94	Pass
Neck Rotation	71	81	deg	72.7	Pass
Time at Maximum Rotation	50	70	ms	60.5	Pass
Moment about the OC	36	44	Nm	42.2	Pass
Moment Decay to 0 Nm	102	126	ms	111.2	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	7231C-750	10/31/2023	4/28/2024
Pendulum Potentiometer	Servo	4961	10/2/2023	10/1/2024
Condyle Potentiometer	Servo	DS185	10/2/2023	10/1/2024
Upper Neck Load Cell	Denton	1716ATF_2184-FY	5/18/2023	5/17/2024

Pendulum Impulse

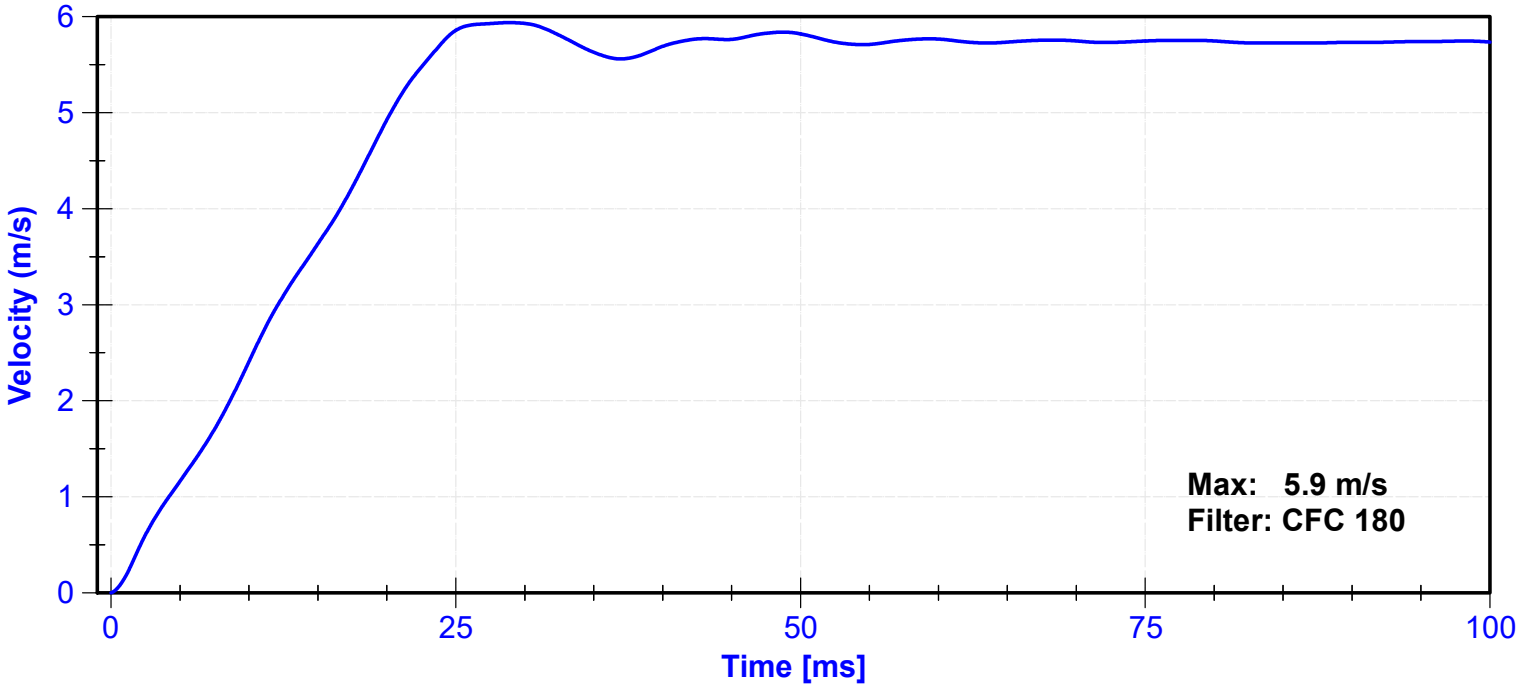

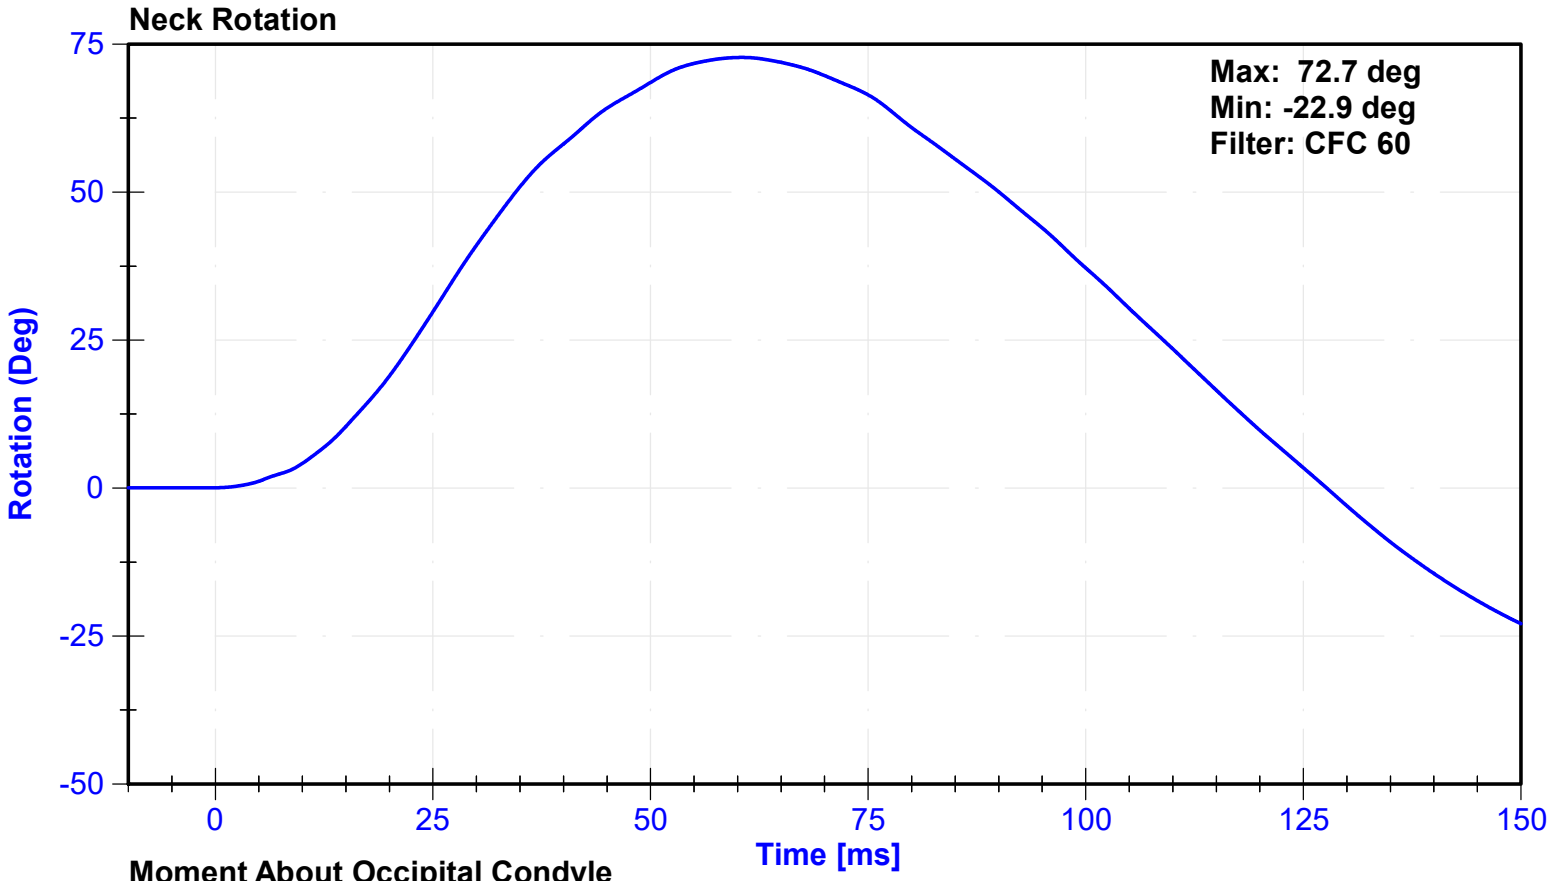
Neck Rotation
Max: 72.7 deg
Min: -22.9 deg
Filter: CFC 60
Rotation (Deg)
75
50
25
0
-25
-50
0
25
50
75
100
125
150
Time [ms]

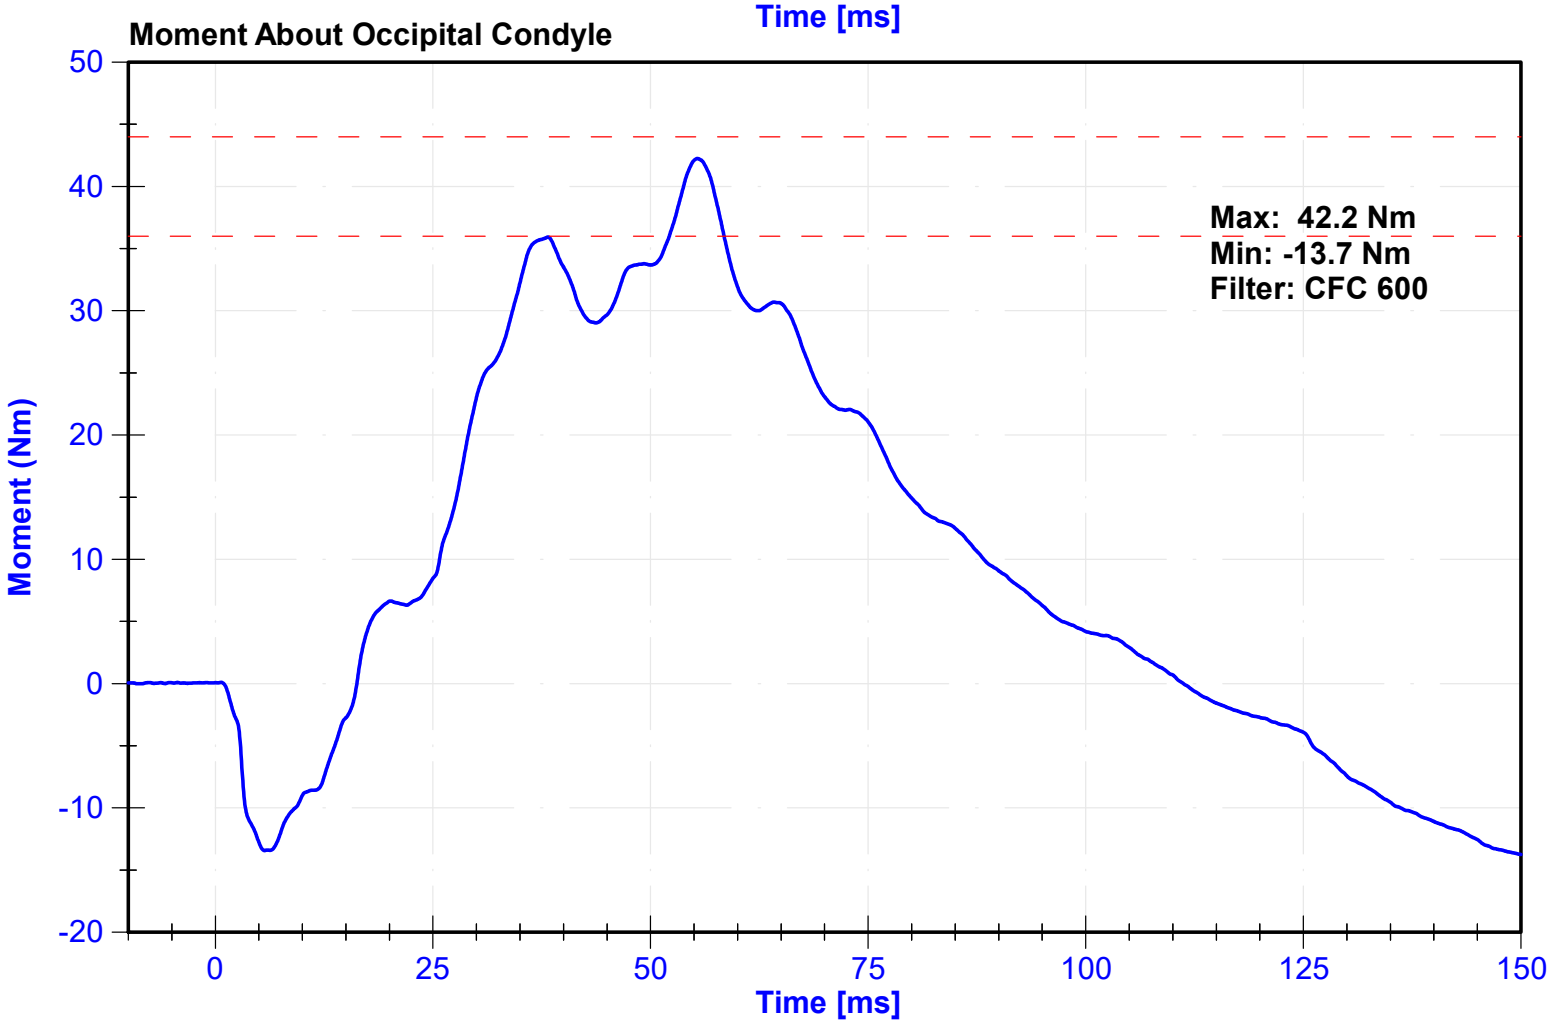
Moment About Occipital Condyle
Max: 42.2 Nm
Min: -13.7 Nm
Filter: CFC 600
Moment (Nm)
50
40
30
20
10
0
-10
-20
0
25
50
75
100
125
150
Time [ms]

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.29	Pass
Probe Acceleration	13	18	g's	17.0	Pass
Shoulder Deflection	28	37	mm	28.0	Pass
Lateral Upper Spine Acceleration	17	22	g's	18.7	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Shoulder Potentiometer	Servo	053GFE	11/17/2023	5/17/2024
Upper Spine Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024

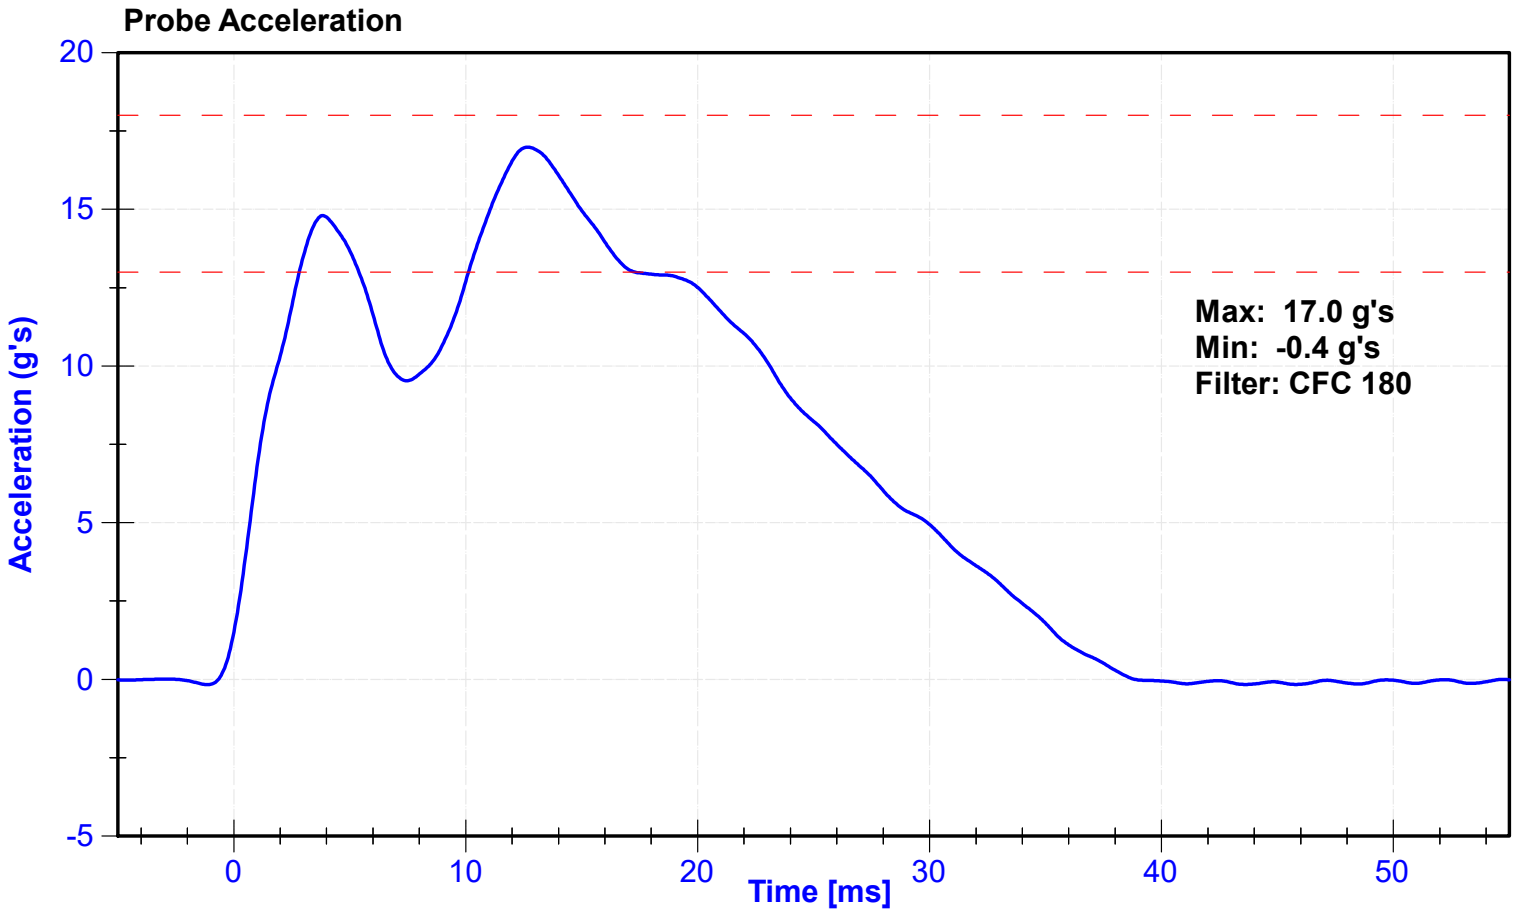

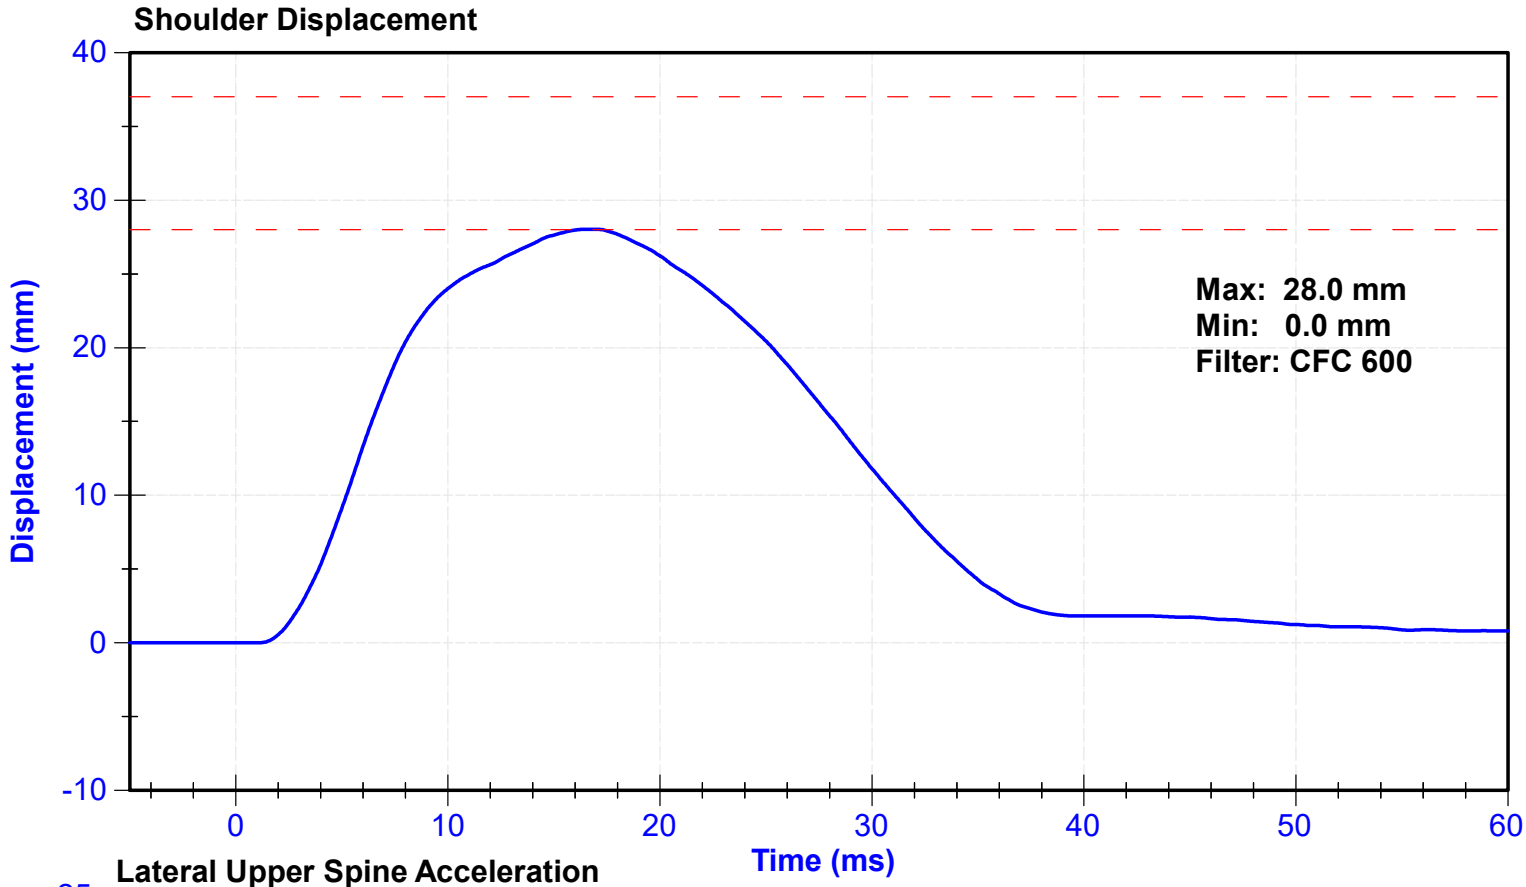
Shoulder Displacement
Displacement (mm)
Time (ms)
Max: 28.0 mm
Min: 0.0 mm
Filter: CFC 600

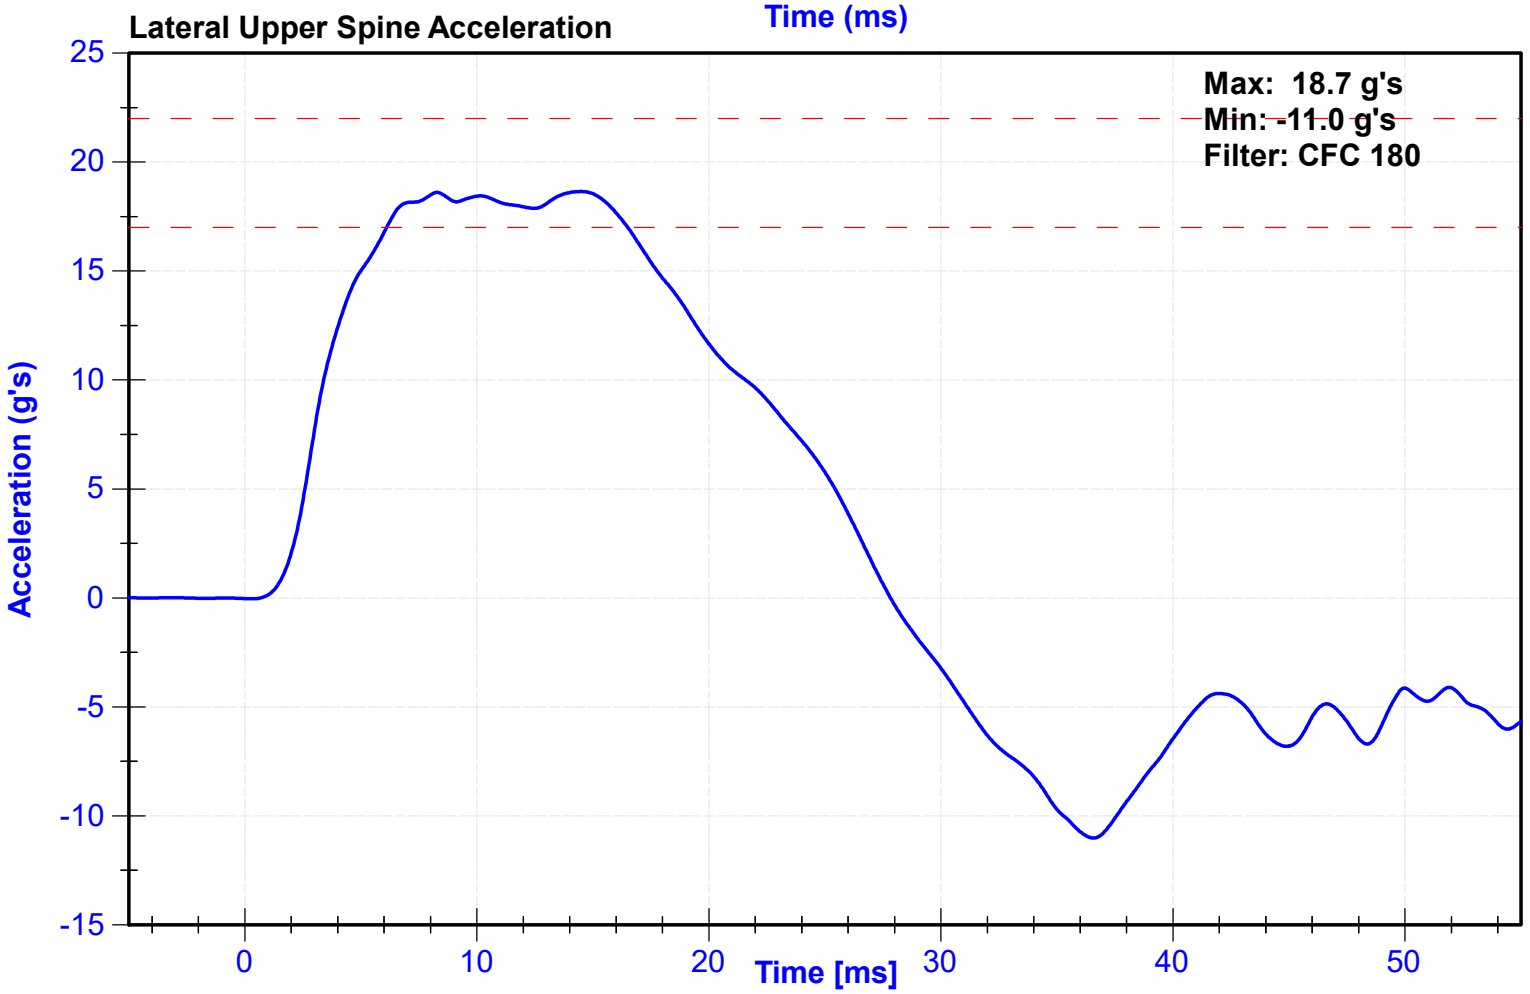
Lateral Upper Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 18.7 g's
Min: -11.0 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	6.6	6.8	m/s	6.63	Pass
Probe Acceleration after 5 ms	30	36	g's	35.6	Pass
Lateral Upper Spine Acceleration	34	43	g's	36.3	Pass
Lateral Lower Spine Acceleration	29	37	g's	30.9	Pass
Shoulder Deflection	31	40	mm	31.6	Pass
Upper Thorax Rib Deflection	25	32	mm	26.1	Pass
Mid Thorax Rib Deflection	30	36	mm	30.2	Pass
Lower Thorax Rib Deflection	32	38	mm	32.2	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Upper Spine T1 Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024
Upper Spine T12 Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Shoulder Potentiometer	Servo	053GFE	11/17/2023	5/17/2024
Upper Thorax Rib Potentiometer	Servo	2316GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Servo	307GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Servo	1156GFE	11/17/2023	5/17/2024

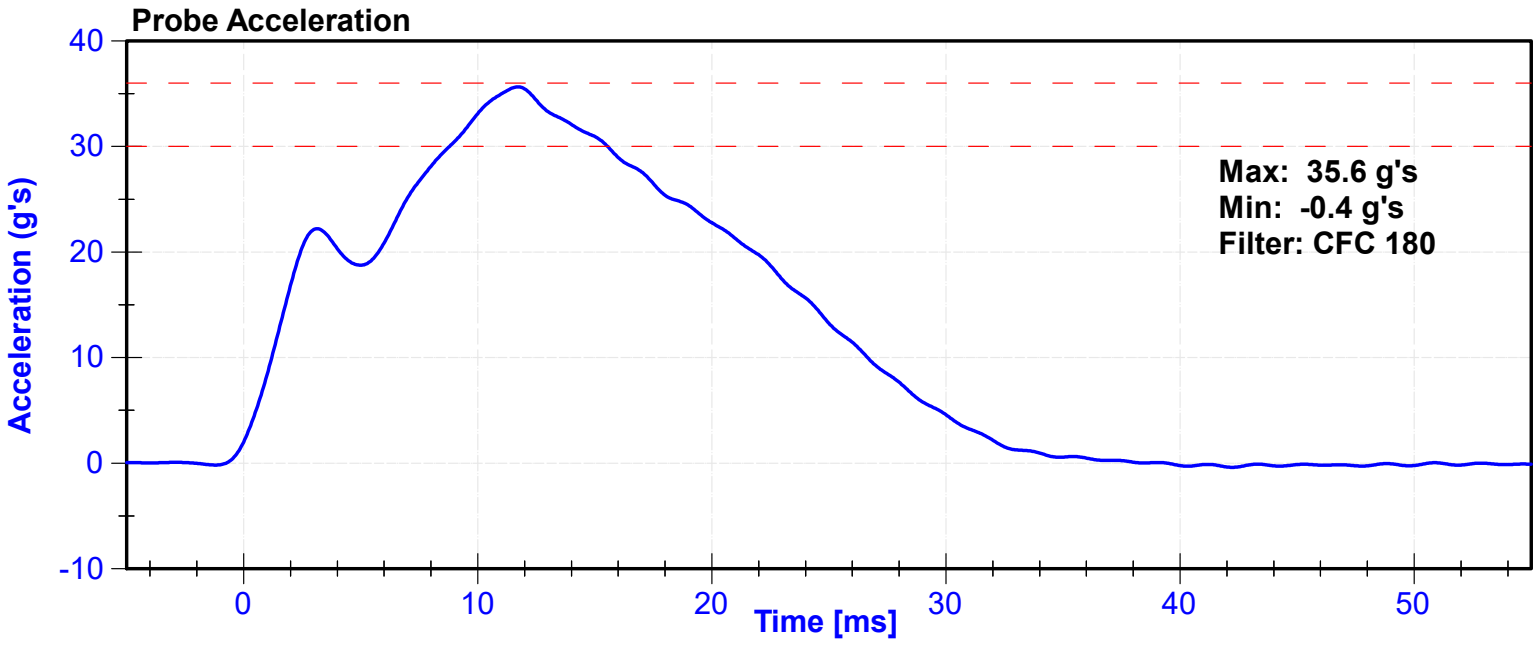

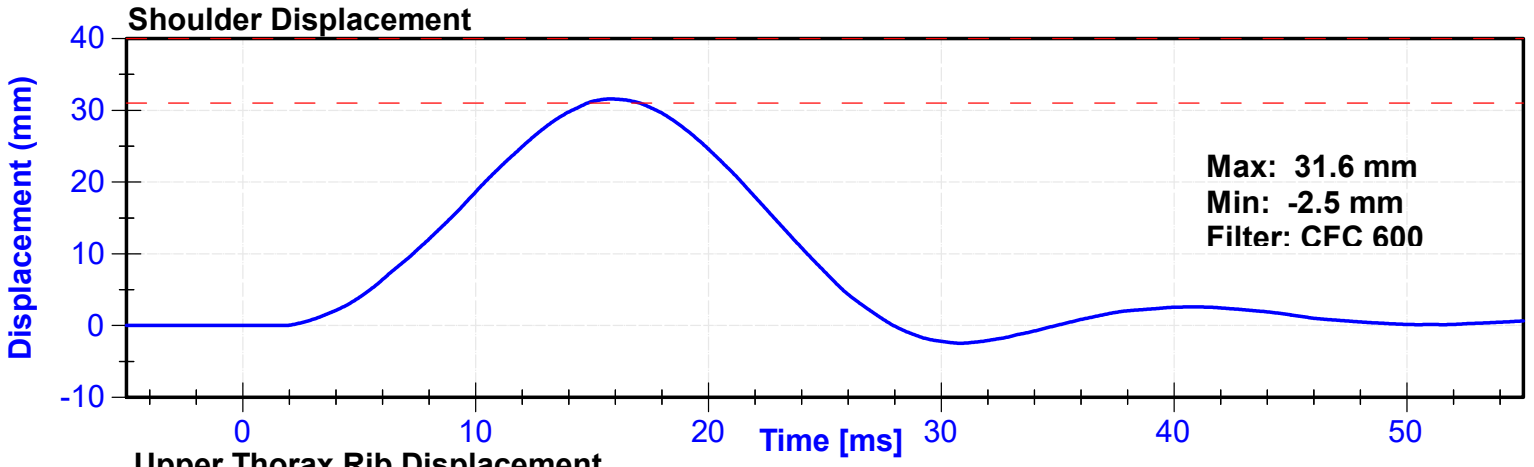
Shoulder Displacement
Displacement (mm)
Time [ms]
Max: 31.6 mm
Min: -2.5 mm
Filter: CFC 600

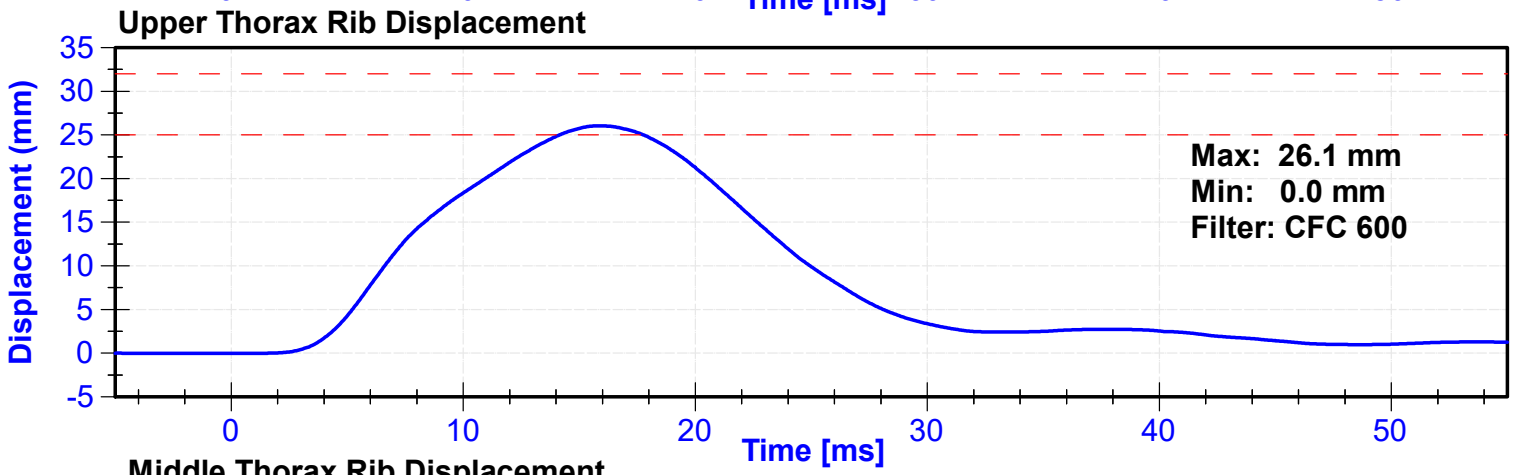
Upper Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 26.1 mm
Min: 0.0 mm
Filter: CFC 600

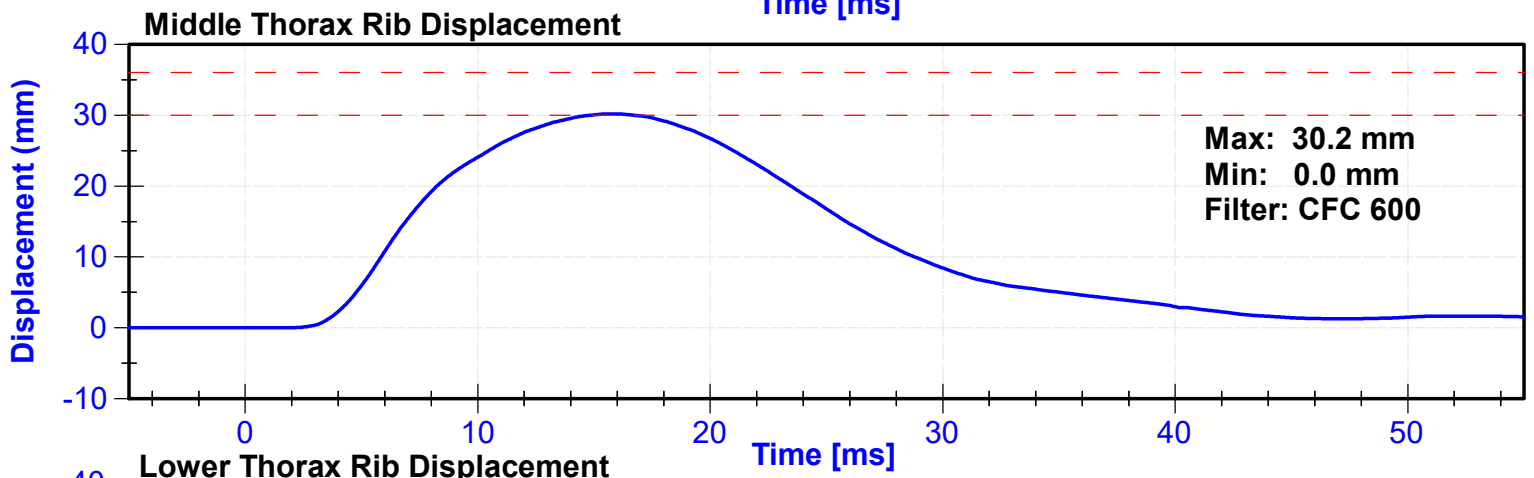
Middle Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 30.2 mm
Min: 0.0 mm
Filter: CFC 600

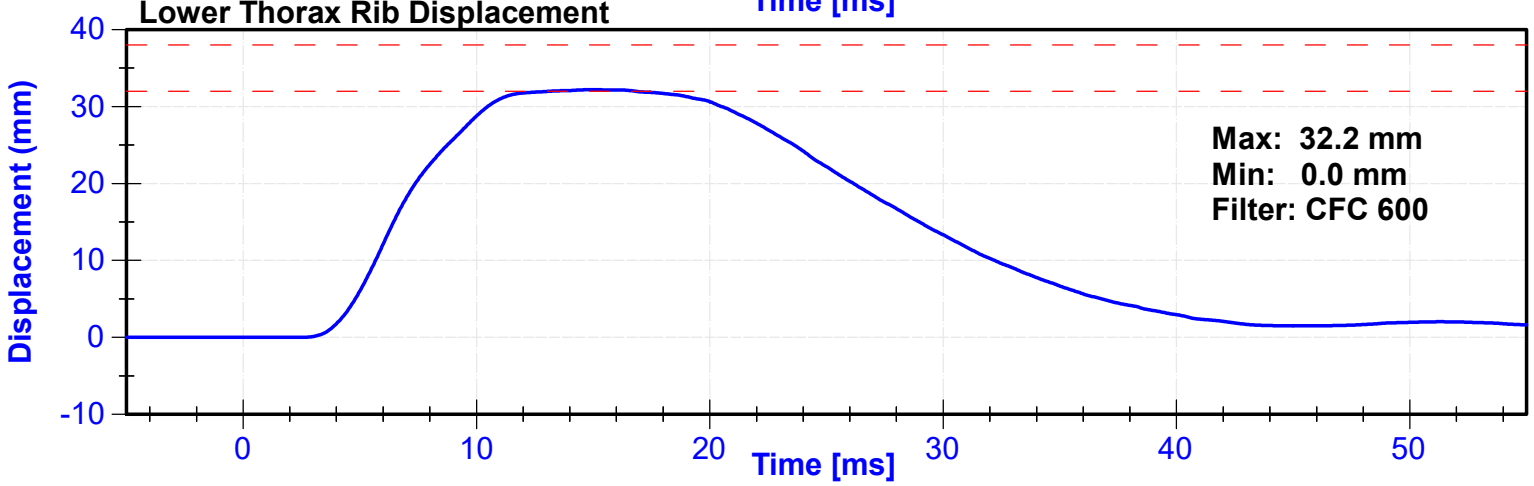
Lower Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 32.2 mm
Min: 0.0 mm
Filter: CFC 600

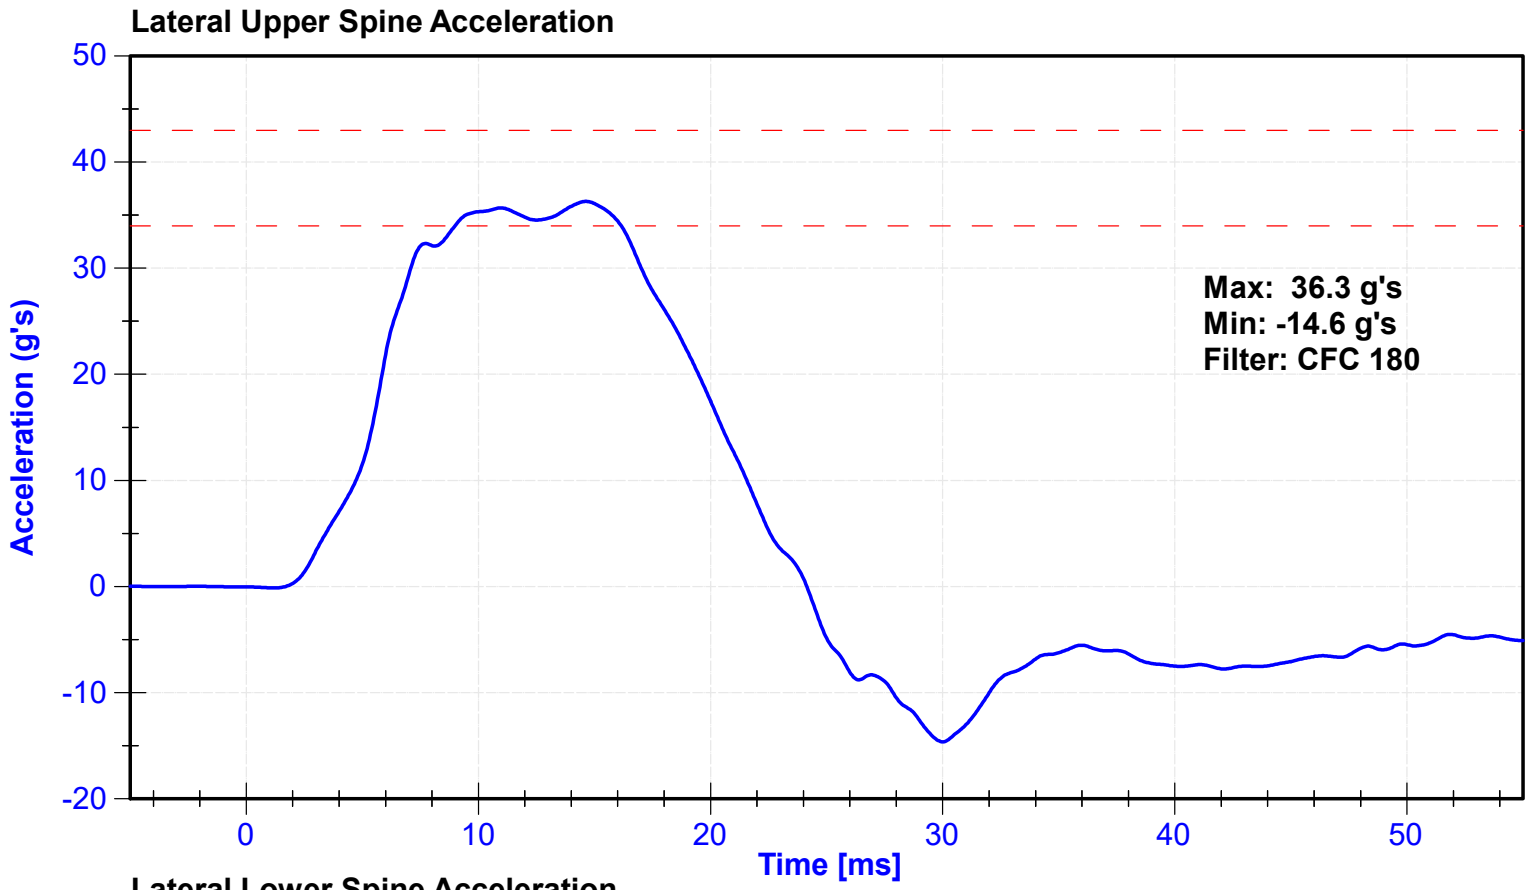
Lateral Upper Spine Acceleration
Acceleration (g's)
50
40
30
20
10
0
-10
-20
0
10
20
30
40
50
Time [ms]
Max: 36.3 g's
Min: -14.6 g's
Filter: CFC 180

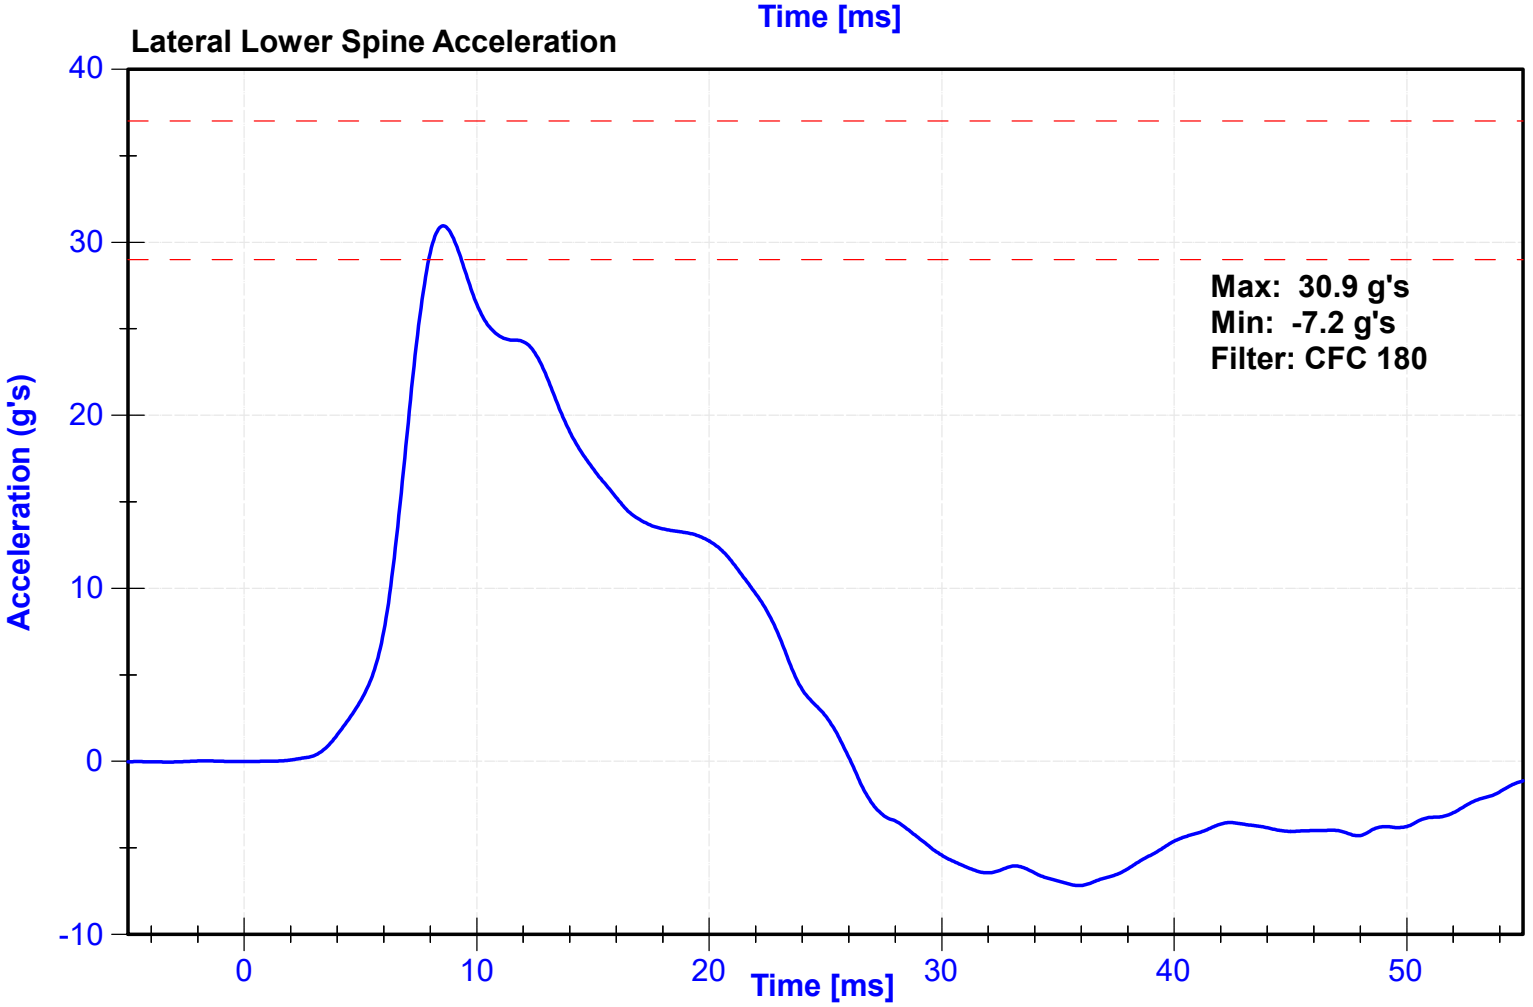
Lateral Lower Spine Acceleration
Acceleration (g's)
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 30.9 g's
Min: -7.2 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.24	Pass
Probe Acceleration	14	18	g's	17.2	Pass
Lateral Upper Spine Acceleration	13	17	g's	14.9	Pass
Lateral Lower Spine Acceleration	7	11	g's	10.4	Pass
Upper Thorax Rib Deflection	32	40	mm	32.2	Pass
Middle Thorax Rib Deflection	39	45	mm	39.3	Pass
Lower Thorax Rib Deflection	35	43	mm	38.6	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Upper Spine Y Accelerometer	Endevco	T20880	11/16/2023	5/14/2024
Lower Spine Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Upper Thorax Rib Potentiometer	Servo	2316GFE	11/17/2023	5/17/2024
Middle Thorax Rib Potentiometer	Servo	307GFE	11/17/2023	5/17/2024
Lower Thorax Rib Potentiometer	Servo	1156GFE	11/17/2023	5/17/2024

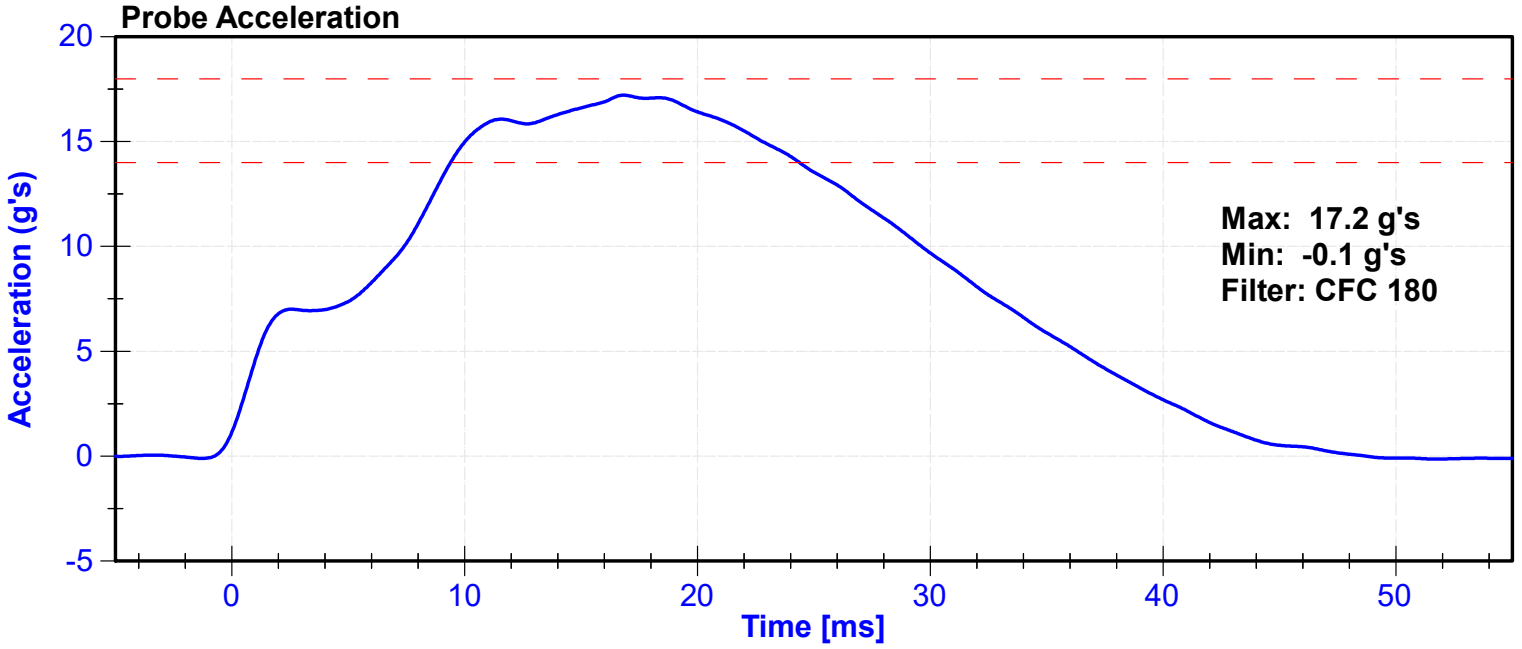

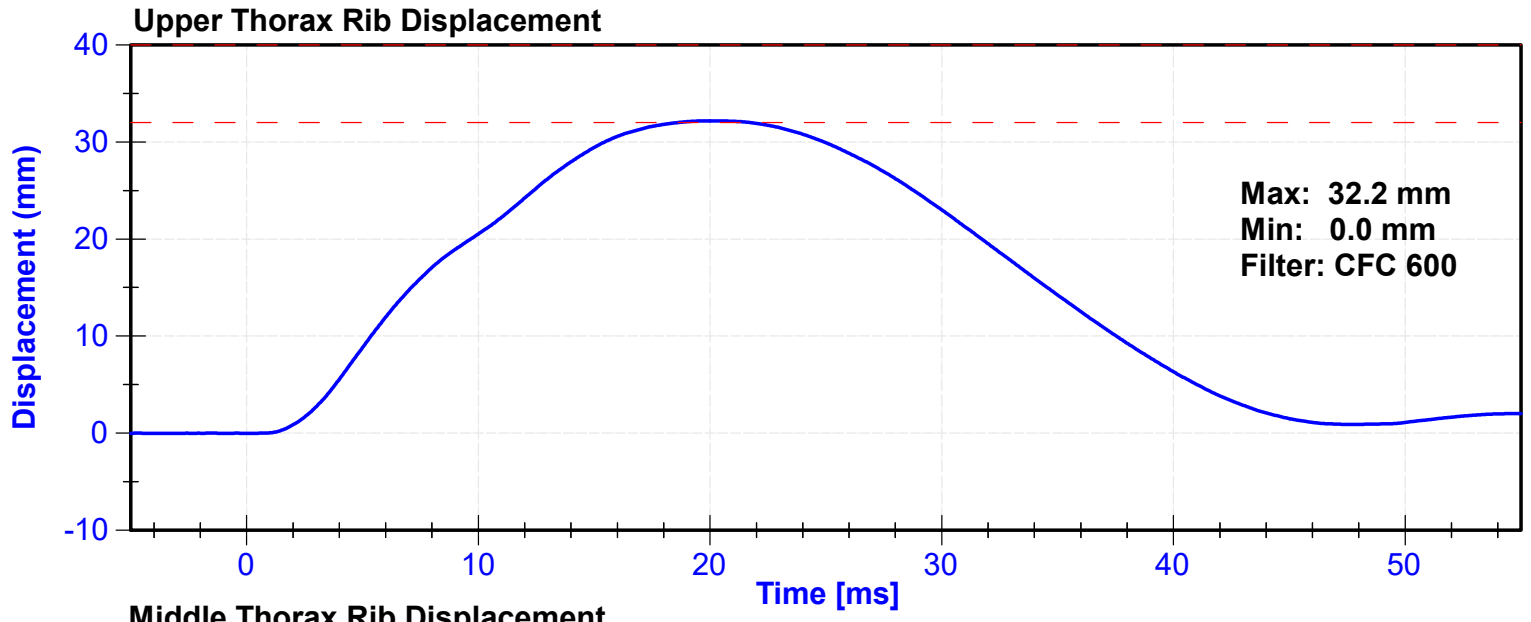
Upper Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 32.2 mm
Min: 0.0 mm
Filter: CFC 600

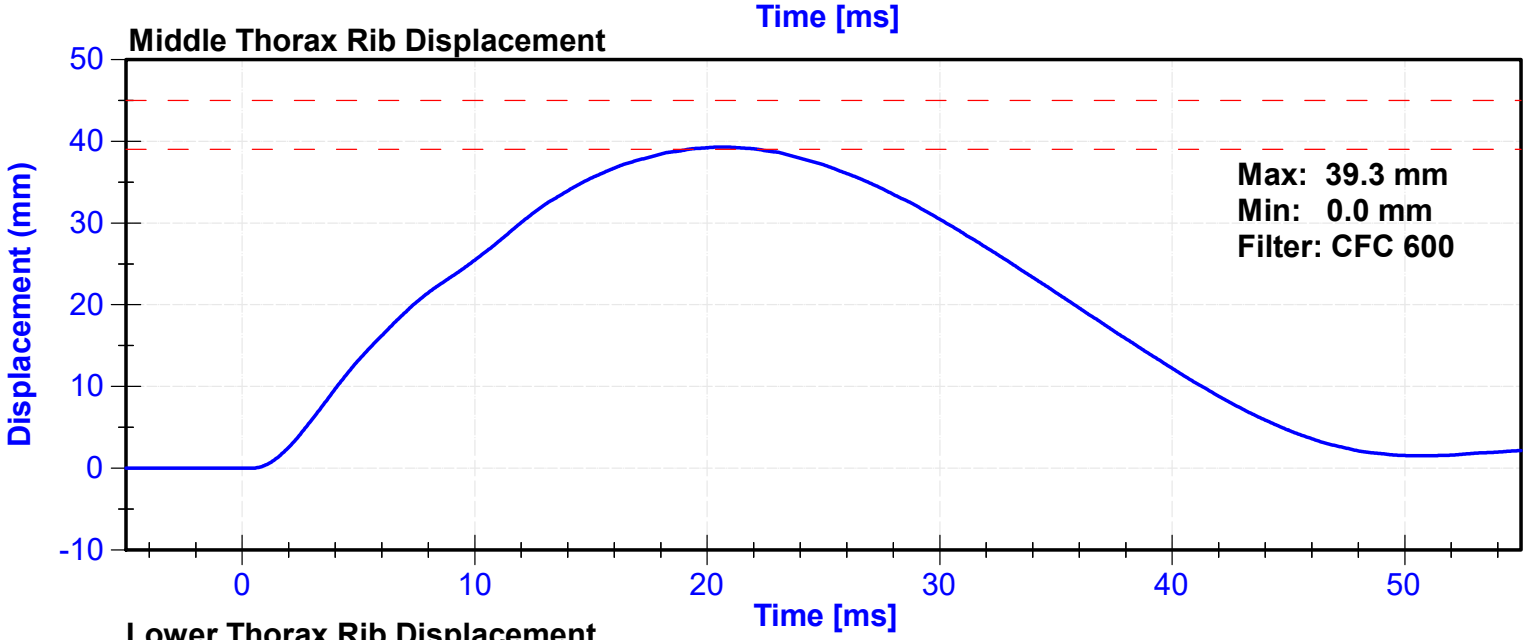
Middle Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 39.3 mm
Min: 0.0 mm
Filter: CFC 600

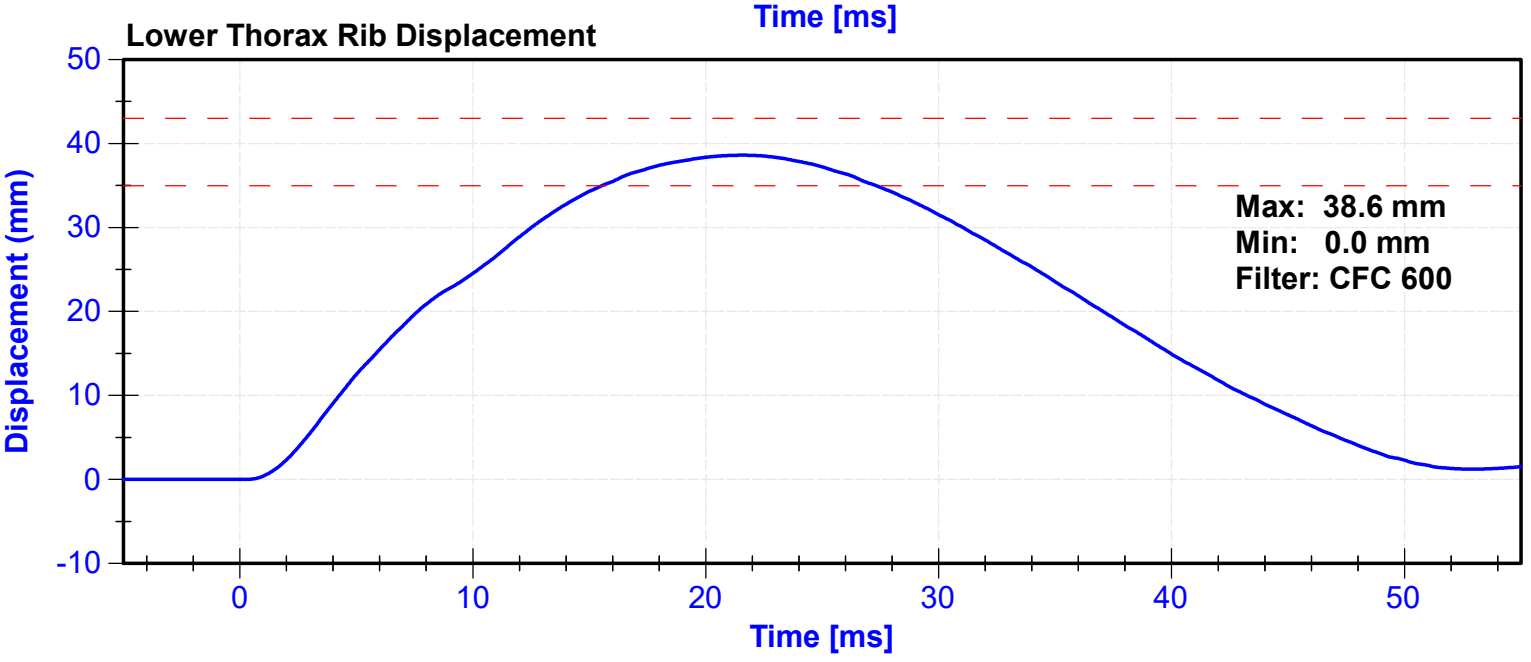
Lower Thorax Rib Displacement
Displacement (mm)
Time [ms]
Max: 38.6 mm
Min: 0.0 mm
Filter: CFC 600

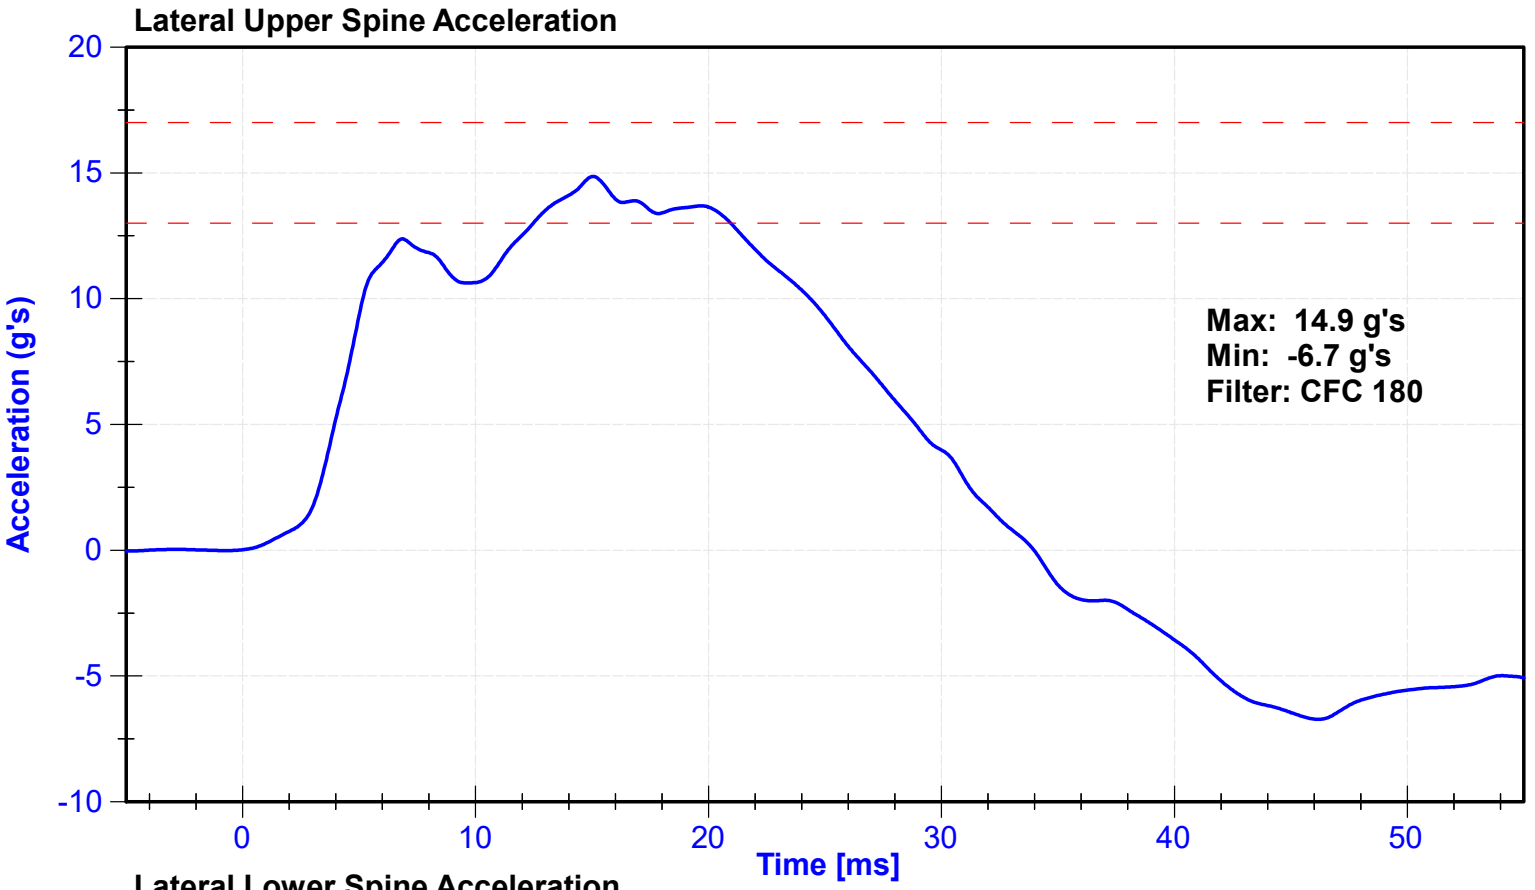
Lateral Upper Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 14.9 g's
Min: -6.7 g's
Filter: CFC 180

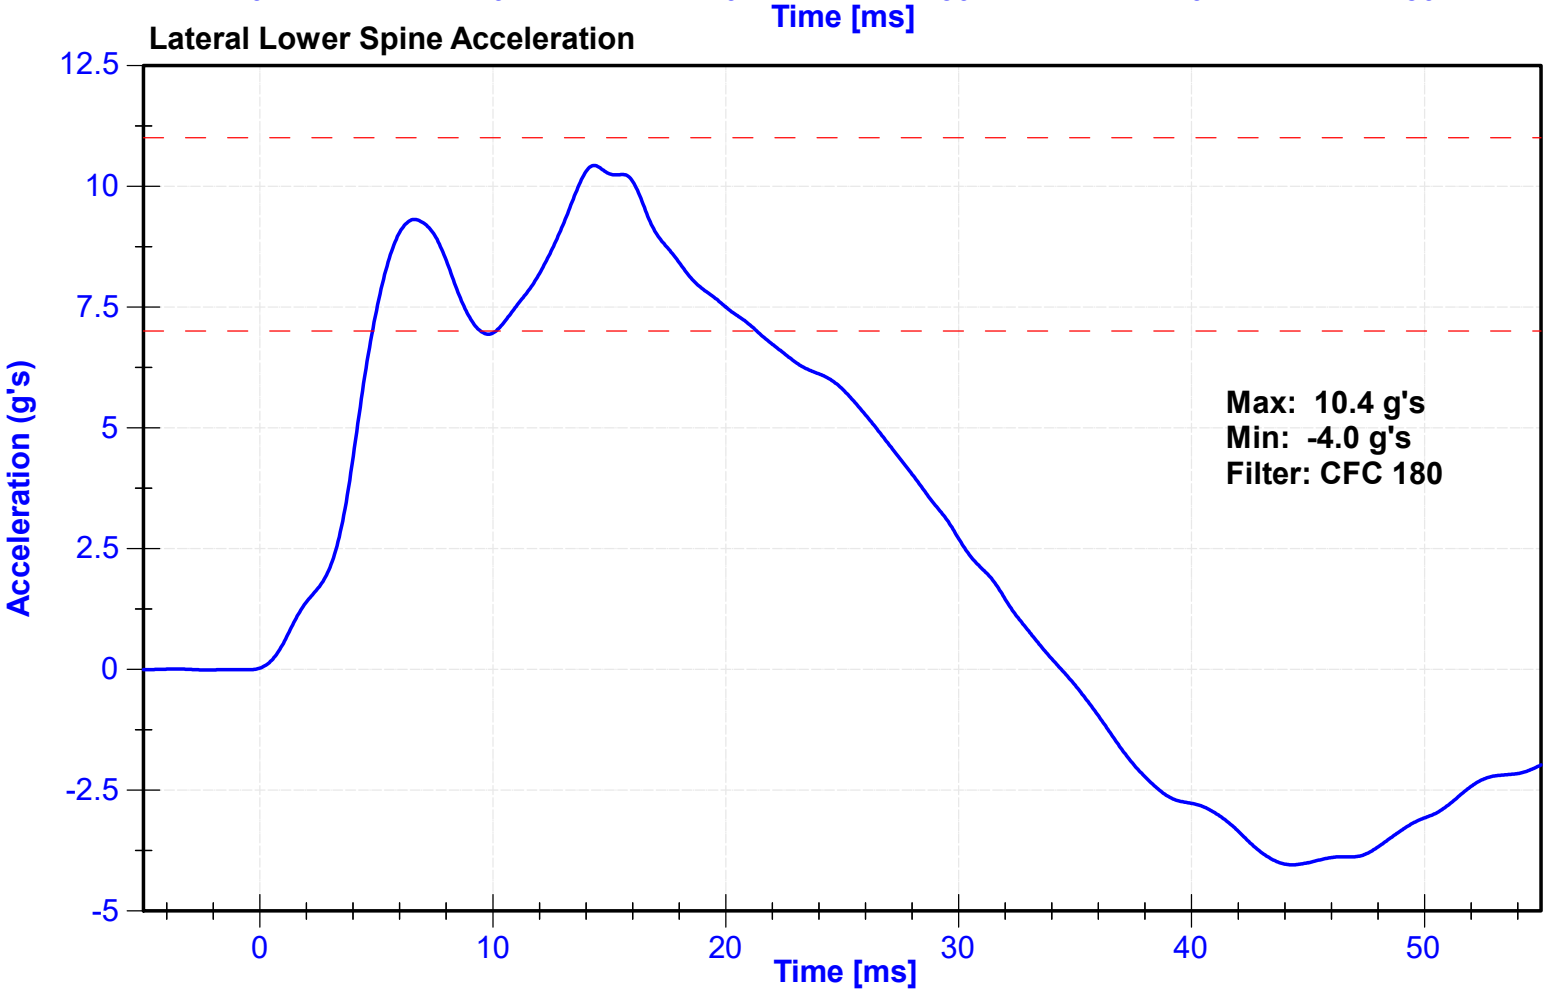
Lateral Lower Spine Acceleration
Acceleration (g's)
Time [ms]
Max: 10.4 g's
Min: -4.0 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.28	Pass
Probe Acceleration	12	16	g's	15.0	Pass
Lateral Lower Spine Acceleration	9	14	g's	12.2	Pass
Upper Abdomen Rib Deflection	36	47	mm	37.8	Pass
Lower Abdomen Rib Deflection	33	44	mm	36.5	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Probe Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Lower Spine Y Accelerometer	Endevco	P52071	11/16/2023	5/14/2024
Upper Abdomen Rib Potentiometer	Servo	060GFE	11/21/2023	5/21/2024
Lower Abdomen Rib Potentiometer	Servo	308GFE	11/17/2023	5/17/2024

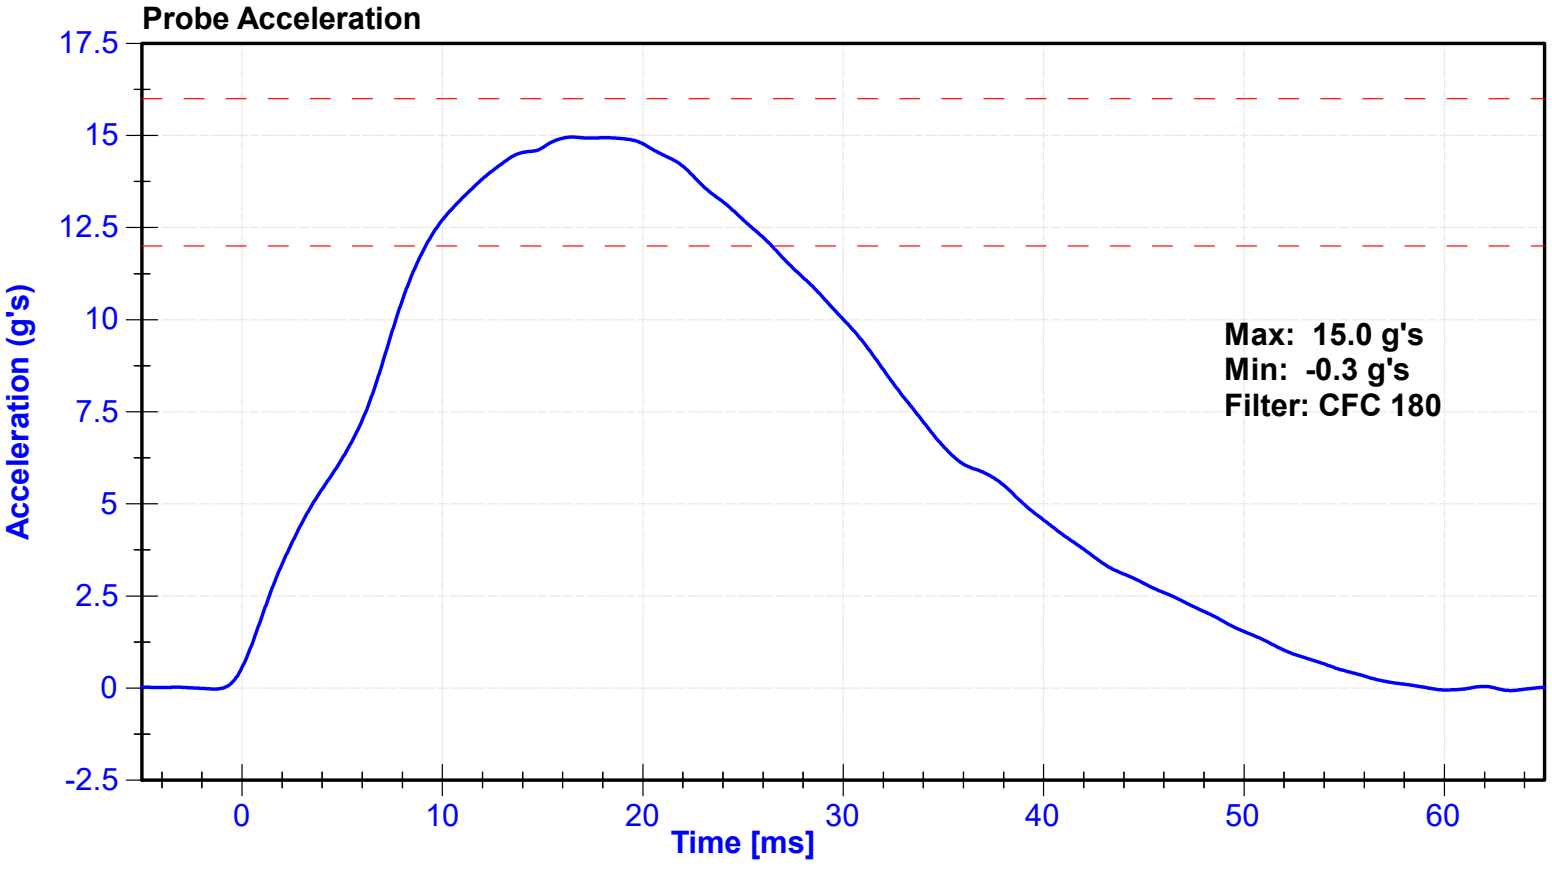

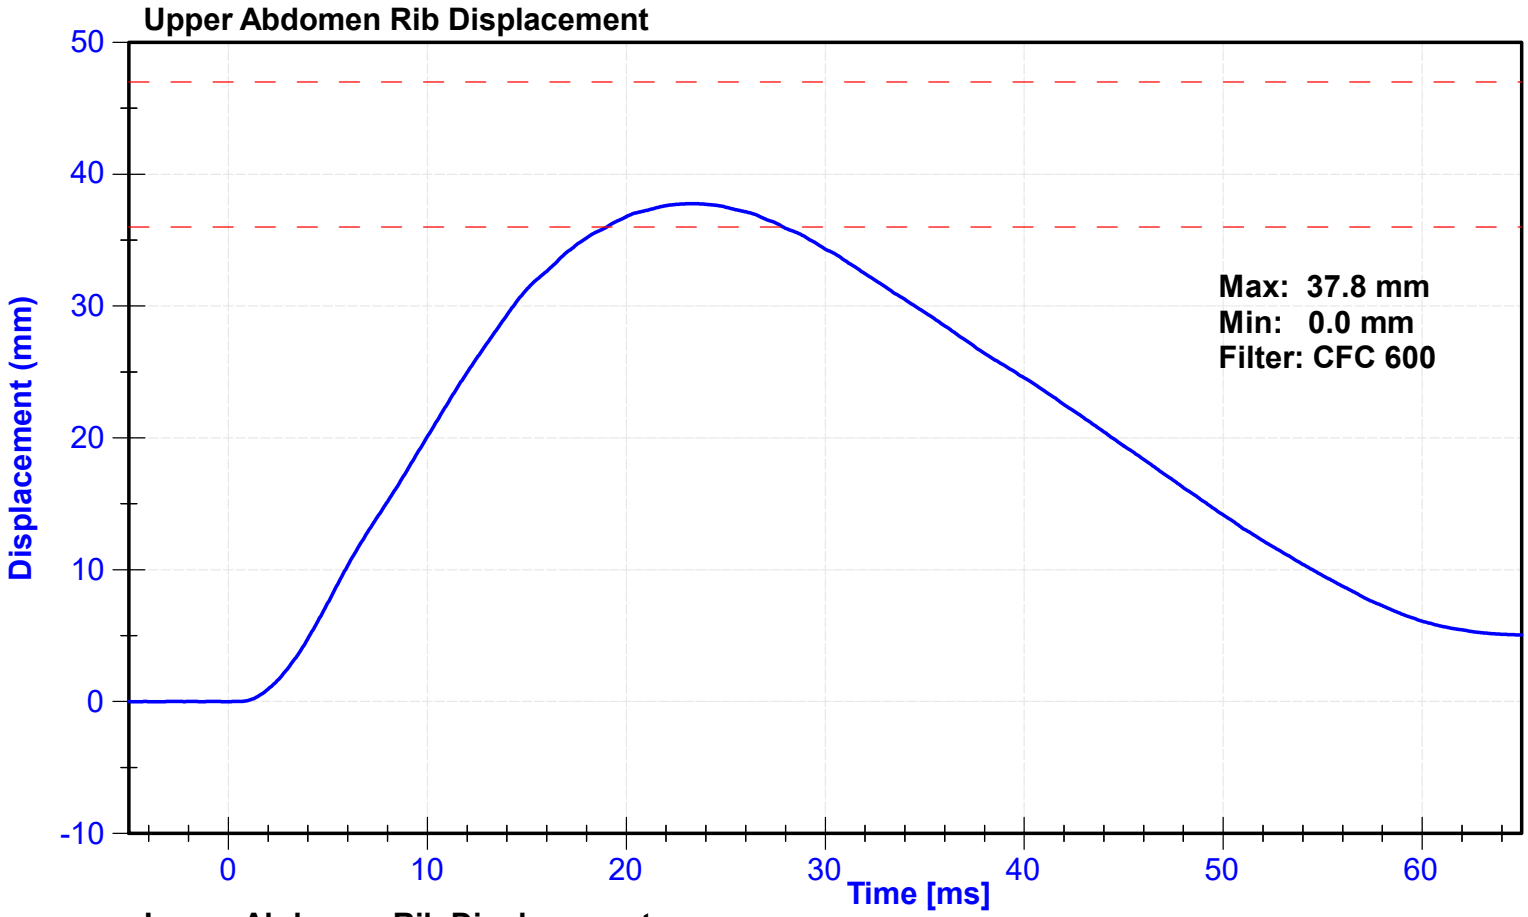
Upper Abdomen Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
60
Time [ms]
Max: 37.8 mm
Min: 0.0 mm
Filter: CFC 600

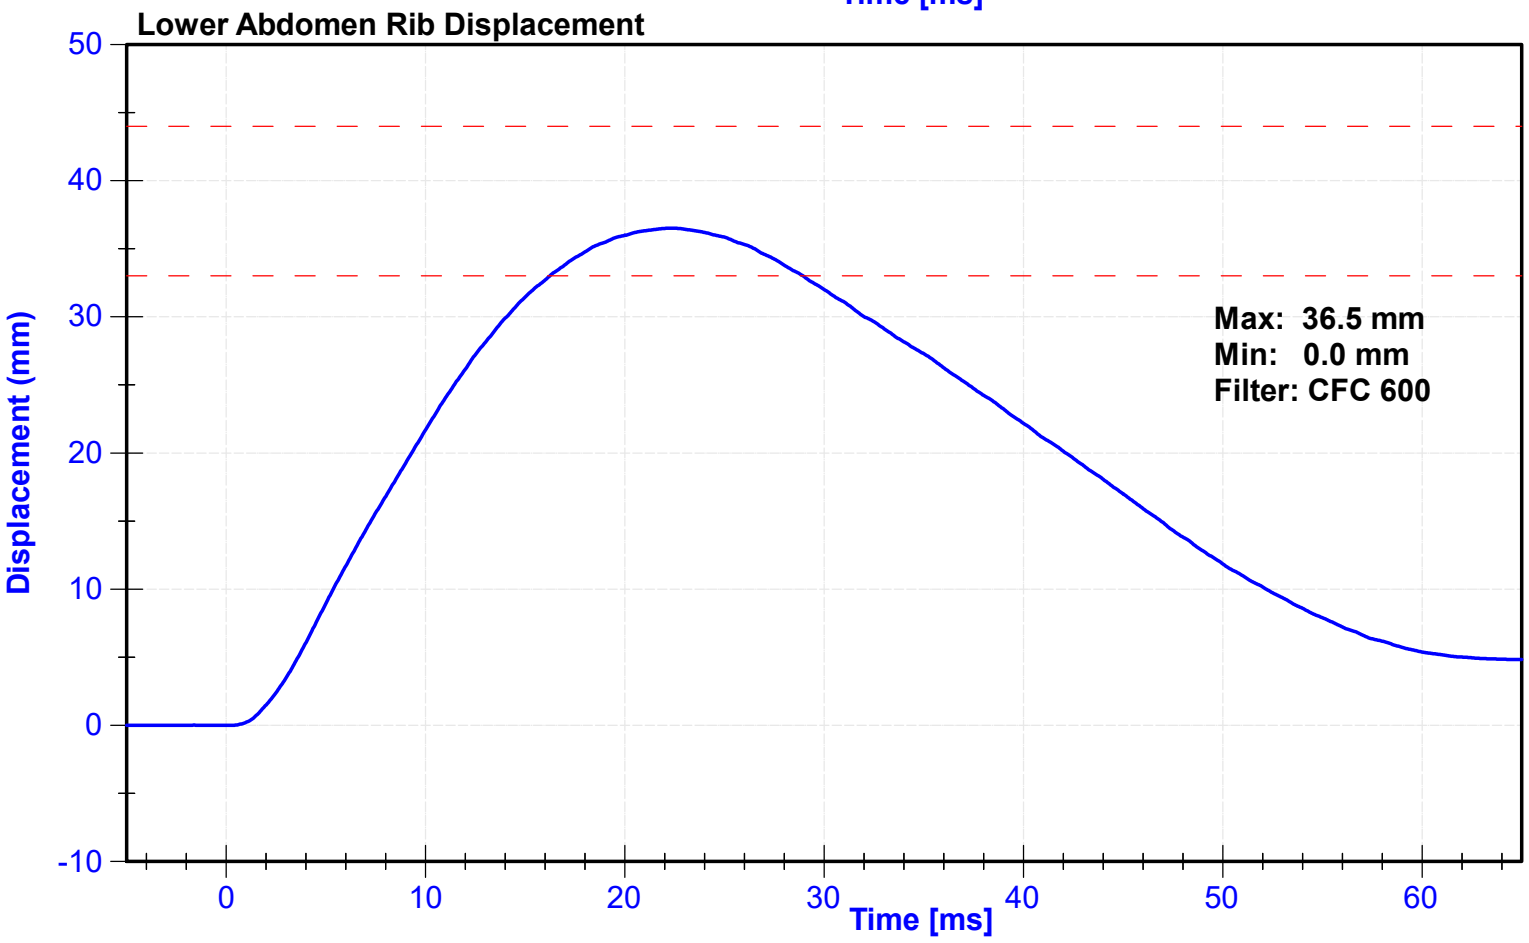
Lower Abdomen Rib Displacement
Displacement (mm)
50
40
30
20
10
0
-10
0
10
20
30
40
50
60
Time [ms]
Max: 36.5 mm
Min: 0.0 mm
Filter: CFC 600

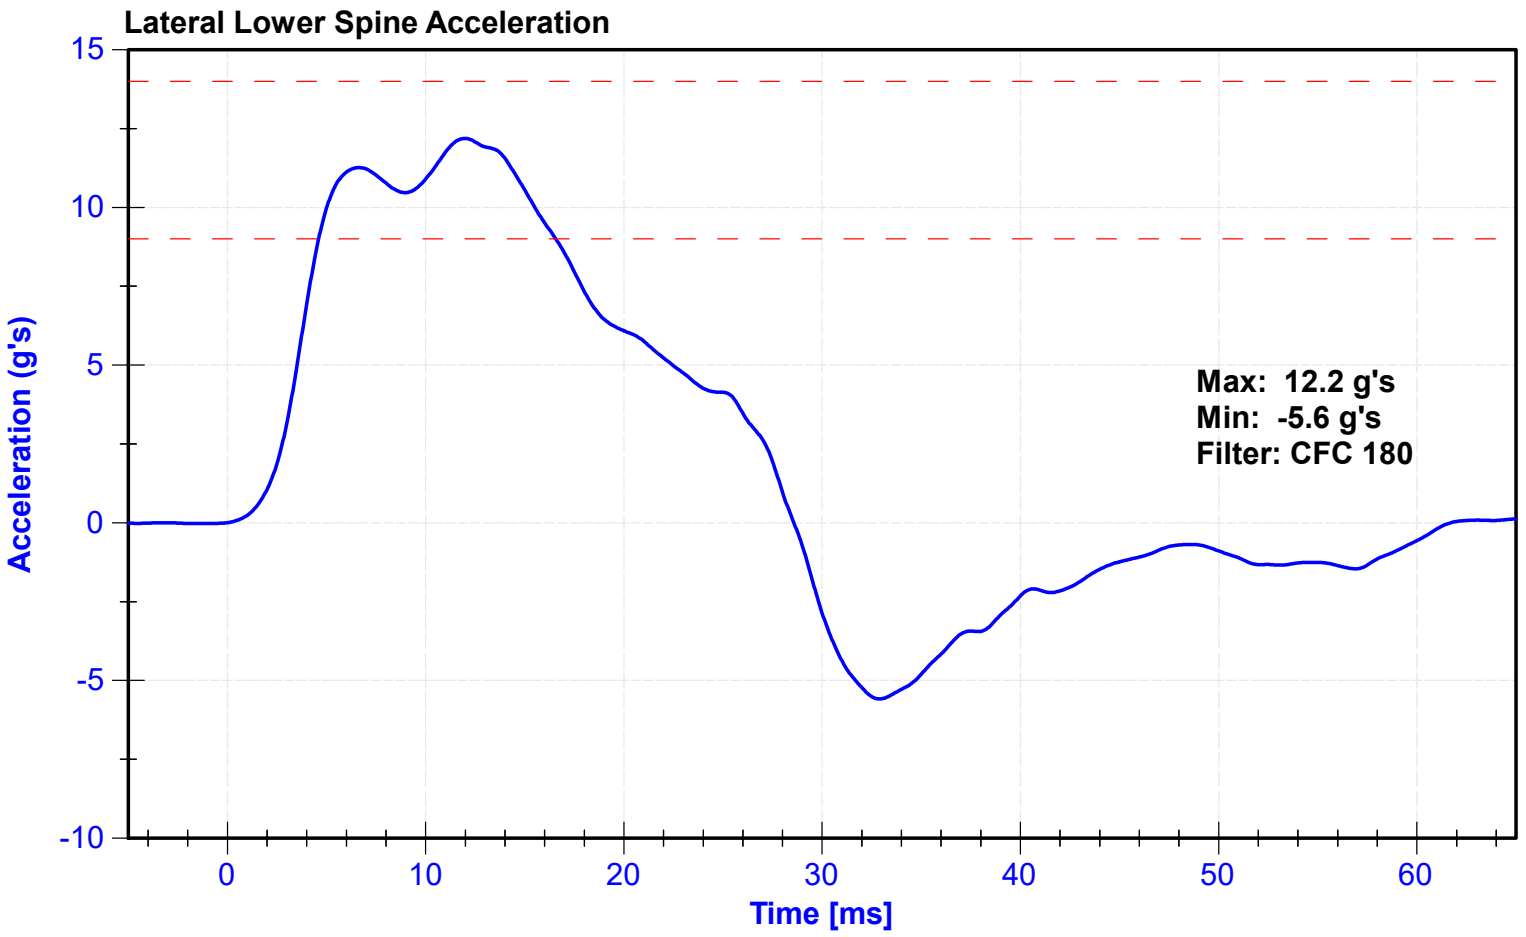
Lateral Lower Spine Acceleration
Acceleration (g's)
15
10
5
0
-5
-10
0
10
20
30
40
50
60
Time [ms]
Max: 12.2 g's
Min: -5.6 g's
Filter: CFC 180

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	6.6	6.8	m/s	6.69	Pass
Probe Acceleration	38	47	g's	46.2	Pass
Lateral Pelvis Acceleration after 6ms	34	42	g's	41.6	Pass
Acetabulum Force	3600	4300	N	4007.6	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Pelvis Y Accelerometer	Endevco	P51731	11/15/2023	5/13/2024
Acetabulum Load Cell	Denton	267-FY	9/11/2023	9/10/2024
Certification Plug	SACO			N/A
Crash Test Plug	SACO			N/A

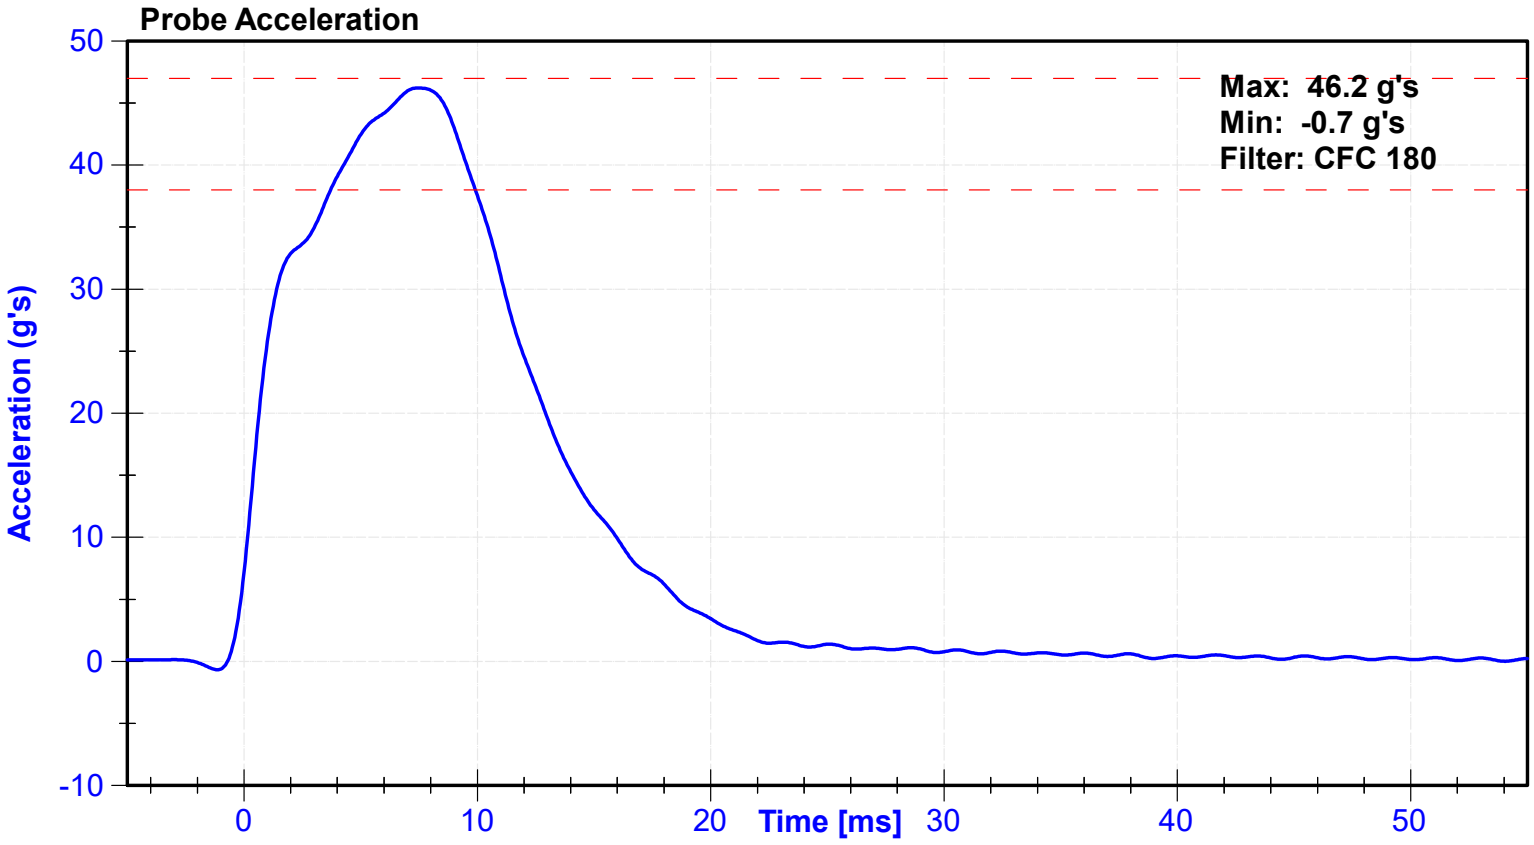

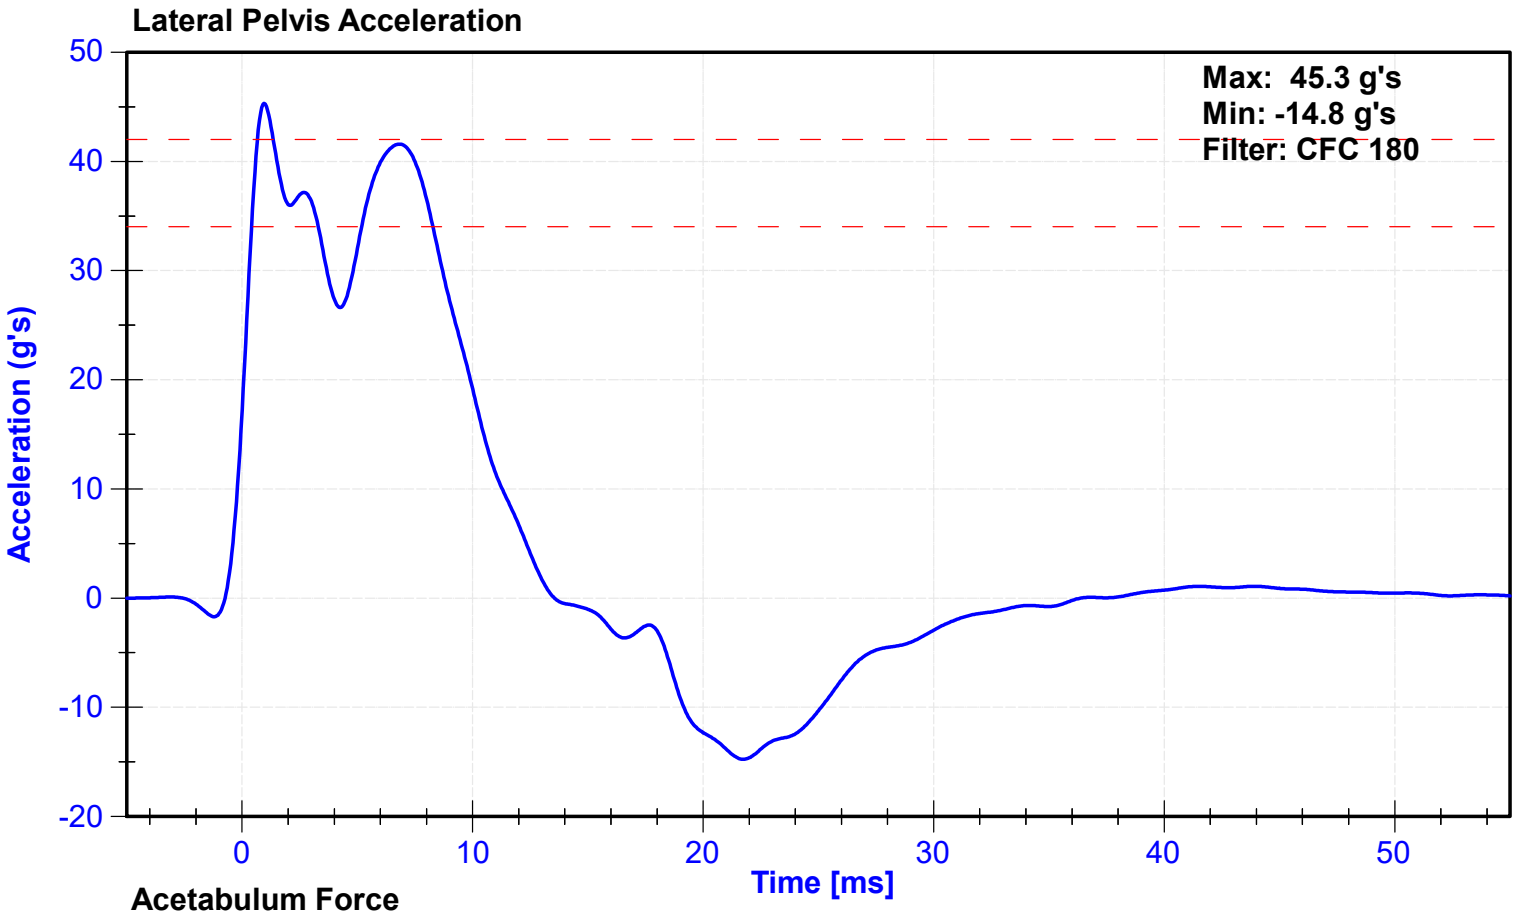
Lateral Pelvis Acceleration
Max: 45.3 g's
Min: -14.8 g's
Filter: CFC 180
Acceleration (g's)
50
40
30
20
10
0
-10
-20
0
10
20
30
40
50
Time [ms]

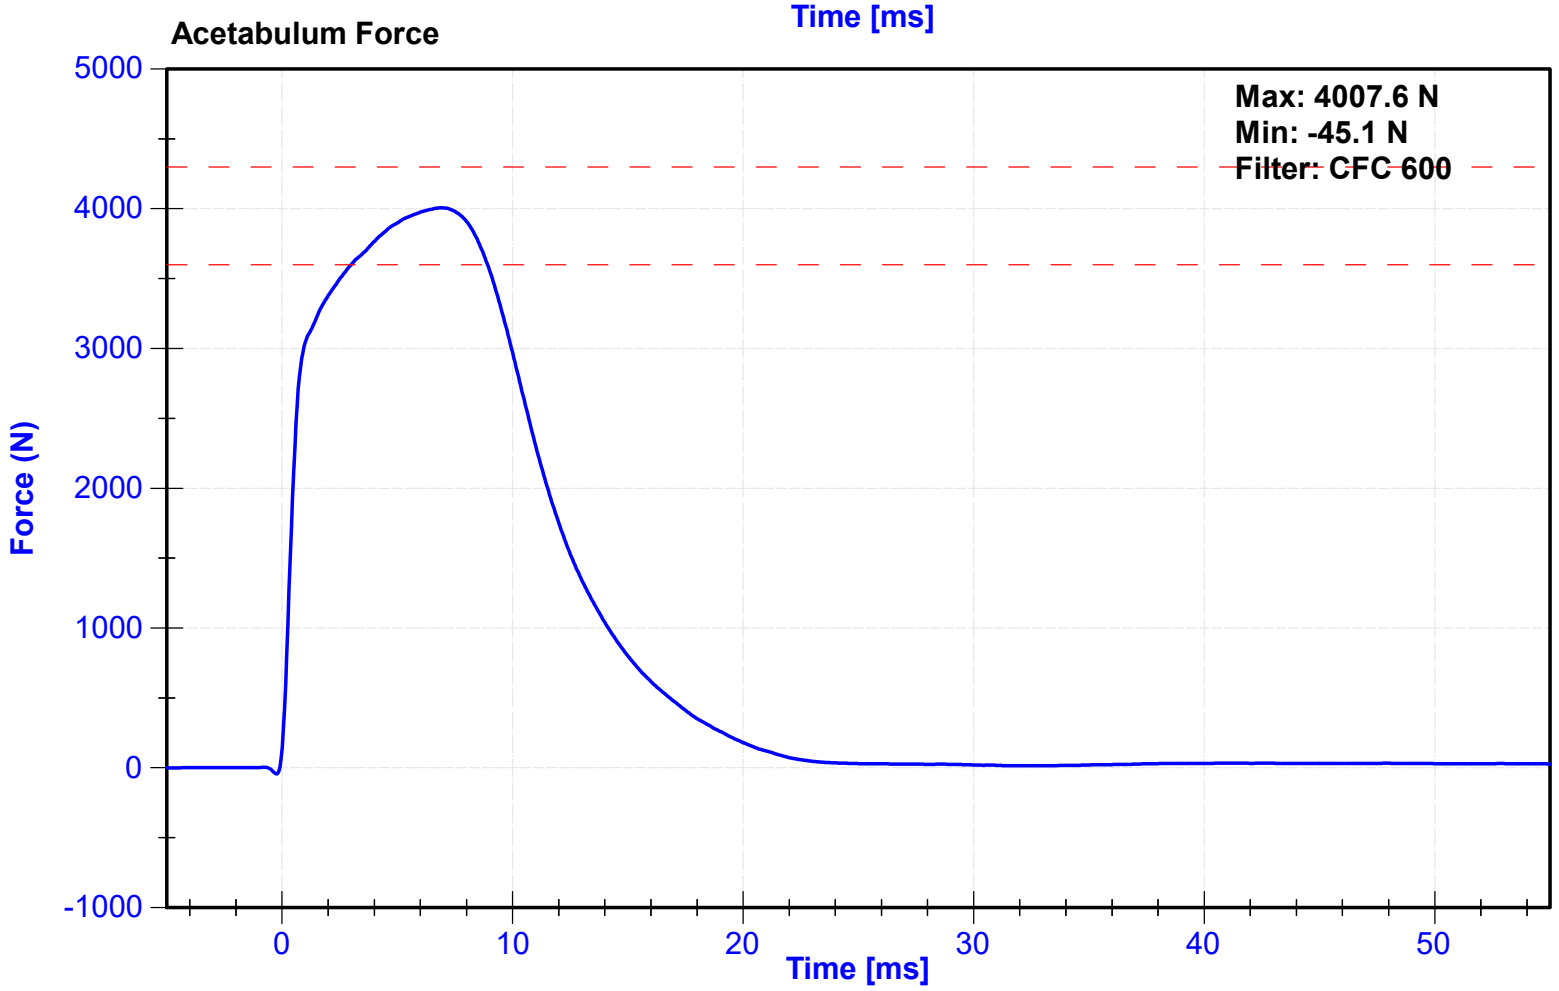
Acetabulum Force
Max: 4007.6 N
Min: -45.1 N
Filter: CFC 600
Force (N)
5000
4000
3000
2000
1000
0
-1000
0
10
20
30
40
50
Time [ms]

SACO RESEARCH

1-19-2024
Certification kit
(4)

SID-IIs Pelvis Plug Certification Test

Plug S/N 16364
Test Number 22931
Report Number 22988
Test Date 5/20/2022 1:40:10 PM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	324	50	600
Force @ 1.5 mm (N)	1,205	850	1,400
Force @ 2.5 mm (N)	1,497	1,306	1,618
Force @ 3.0 mm (N)	1,549	1,361	1,673

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Force (-N) vs Extension (-mm)

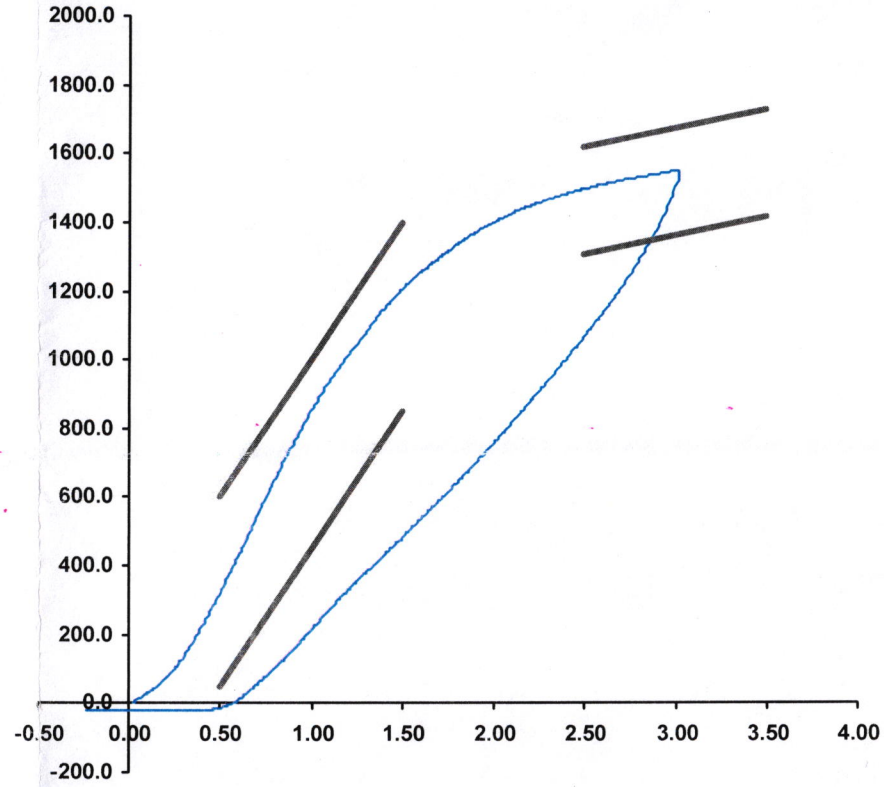

Operator

Part Number 180-4450

Template No 107 20-May-22
SACO Research

By : DC Date : 5/20/2022

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

SACO RESEARCH

Crash Impact

SID-IIs Pelvis Plug Certification Test

Plug S/N 16553
Test Number 23337
Report Number 23394
Test Date 7/15/2022 9:35:24 AM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	244	50	600
Force @ 1.5 mm (N)	1,058	850	1,400
Force @ 2.5 mm (N)	1,408	1,306	1,618
Force @ 3.0 mm (N)	1,486	1,361	1,673

Force (-N) vs Extension (-mm)

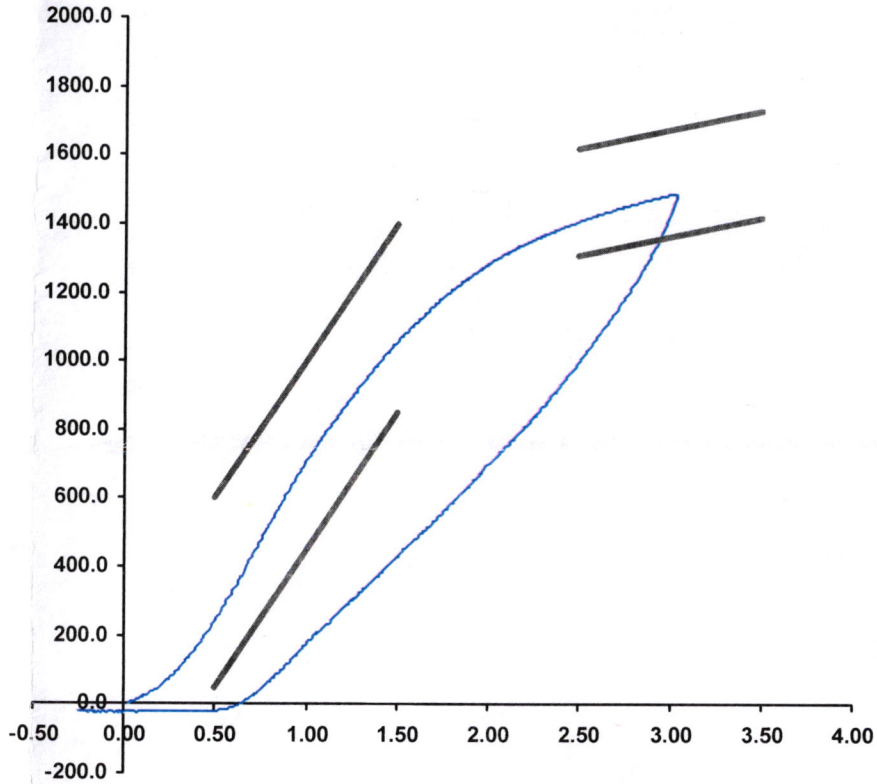

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Operator

Part Number 180-4450

Template No 107 15-Jul-22
SACO Research

By : DC Date : 7/15/22

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

SACO RESEARCH

SID-IIs Pelvis Plug Certification Test

Plug S/N 16315
Test Number 22881 NON IMPACT
Report Number 22938
Test Date 5/20/2022 11:01:09 AM

	Test Results	Spec Min	Spec Max
Force @ 0.5 mm (N)	320	50	600
Force @ 1.5 mm (N)	1,166	850	1,400
Force @ 2.5 mm (N)	1,449	1,306	1,618
Force @ 3.0 mm (N)	1,503	1,361	1,673

Testing Machine STM-20 5965542
Load Cell S/N (FI360947), Units (LBS) 1000

Crosshead Speed (mm / min) or Rate 12.7
Extension or Position Measured by XHD_100 (XHD100)

Notes:

Force (-N) vs Extension (-mm)

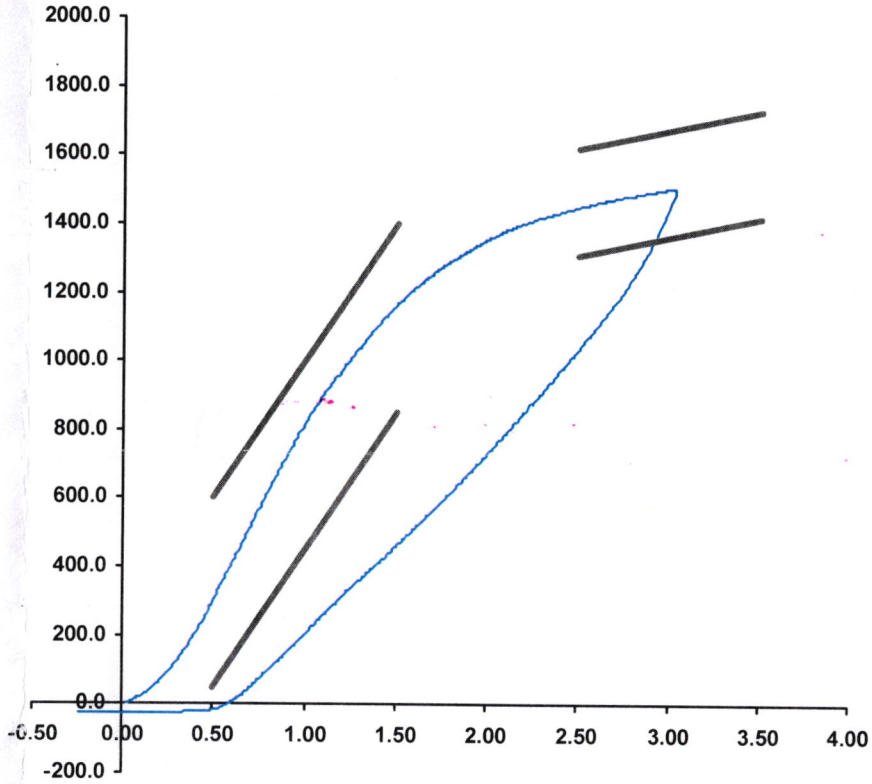

Operator

Part Number 180-4450

Template No 107 20-May-22
SACO Research

By : DC Date : 5/20/2022

SACO Research 41735 Elm St, #401 Murrieta, CA 92562 Tel 310-694-2082 FAX

ATD Manufacturer	FTSS	Test Technician	J. Rios
ATD Serial Number	300	Laboratory Supervisor	C. Mantell

Results

Test Parameter	Minimum Specification	Maximum Specification	Unit	Result	Pass/Fail
Temperature	20.6	22.2	ºC	21.1	Pass
Humidity	10	70	%	17	Pass
Velocity	4.2	4.4	m/s	4.25	Pass
Probe Acceleration	36	45	g's	44.5	Pass
Lateral Pelvis Acceleration	28	39	g's	33.0	Pass
Iliac Force	4100	5100	N	5062.1	Pass

Transducer Calibrations

Channel	Manufacturer	Serial Number	Calibration Date	Calibration Due Date
Pendulum Accelerometer	Endevco	18587	11/20/2023	11/19/2024
Pelvis Y Accelerometer	Endevco	P51731	11/15/2023	5/13/2024
Iliac Load Cell	Denton	321	9/11/2023	9/10/2024

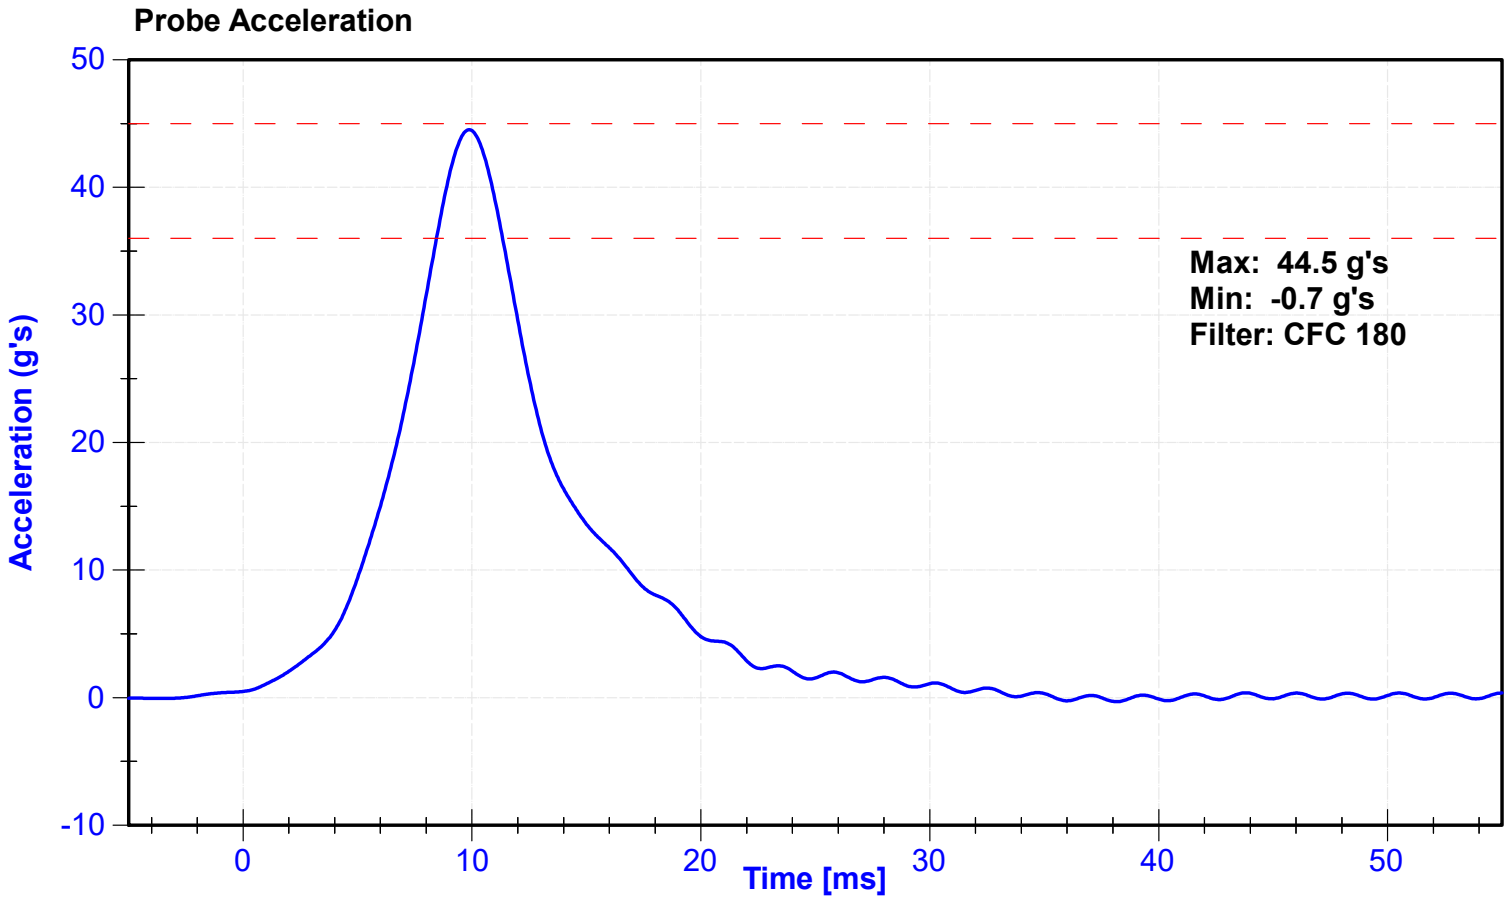

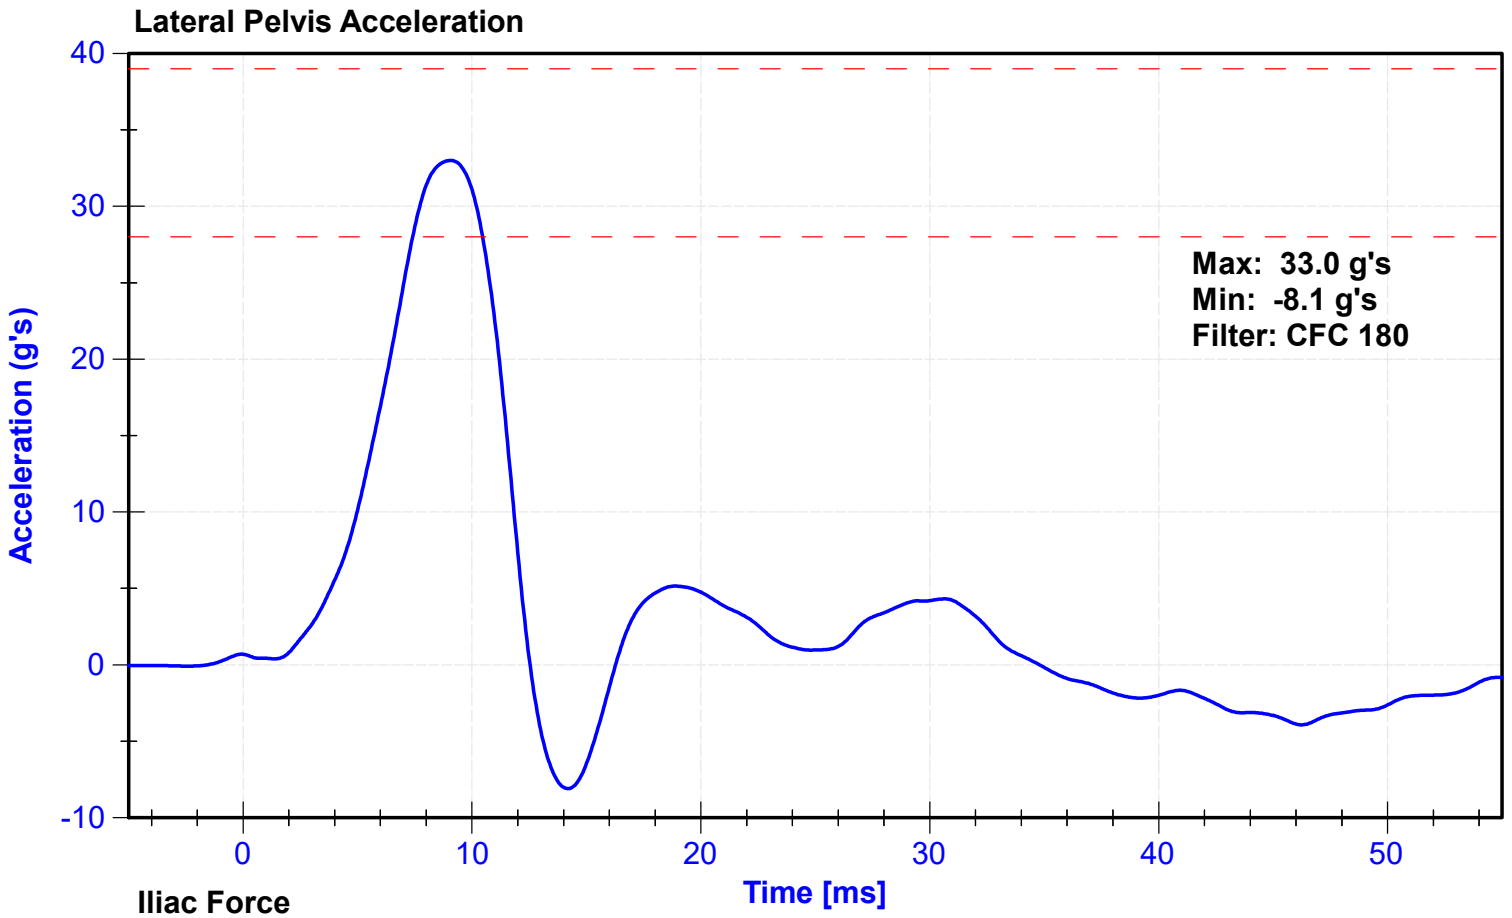
Lateral Pelvis Acceleration
Acceleration (g's)
40
30
20
10
0
-10
0
10
20
30
40
50
Time [ms]
Max: 33.0 g's
Min: -8.1 g's
Filter: CFC 180

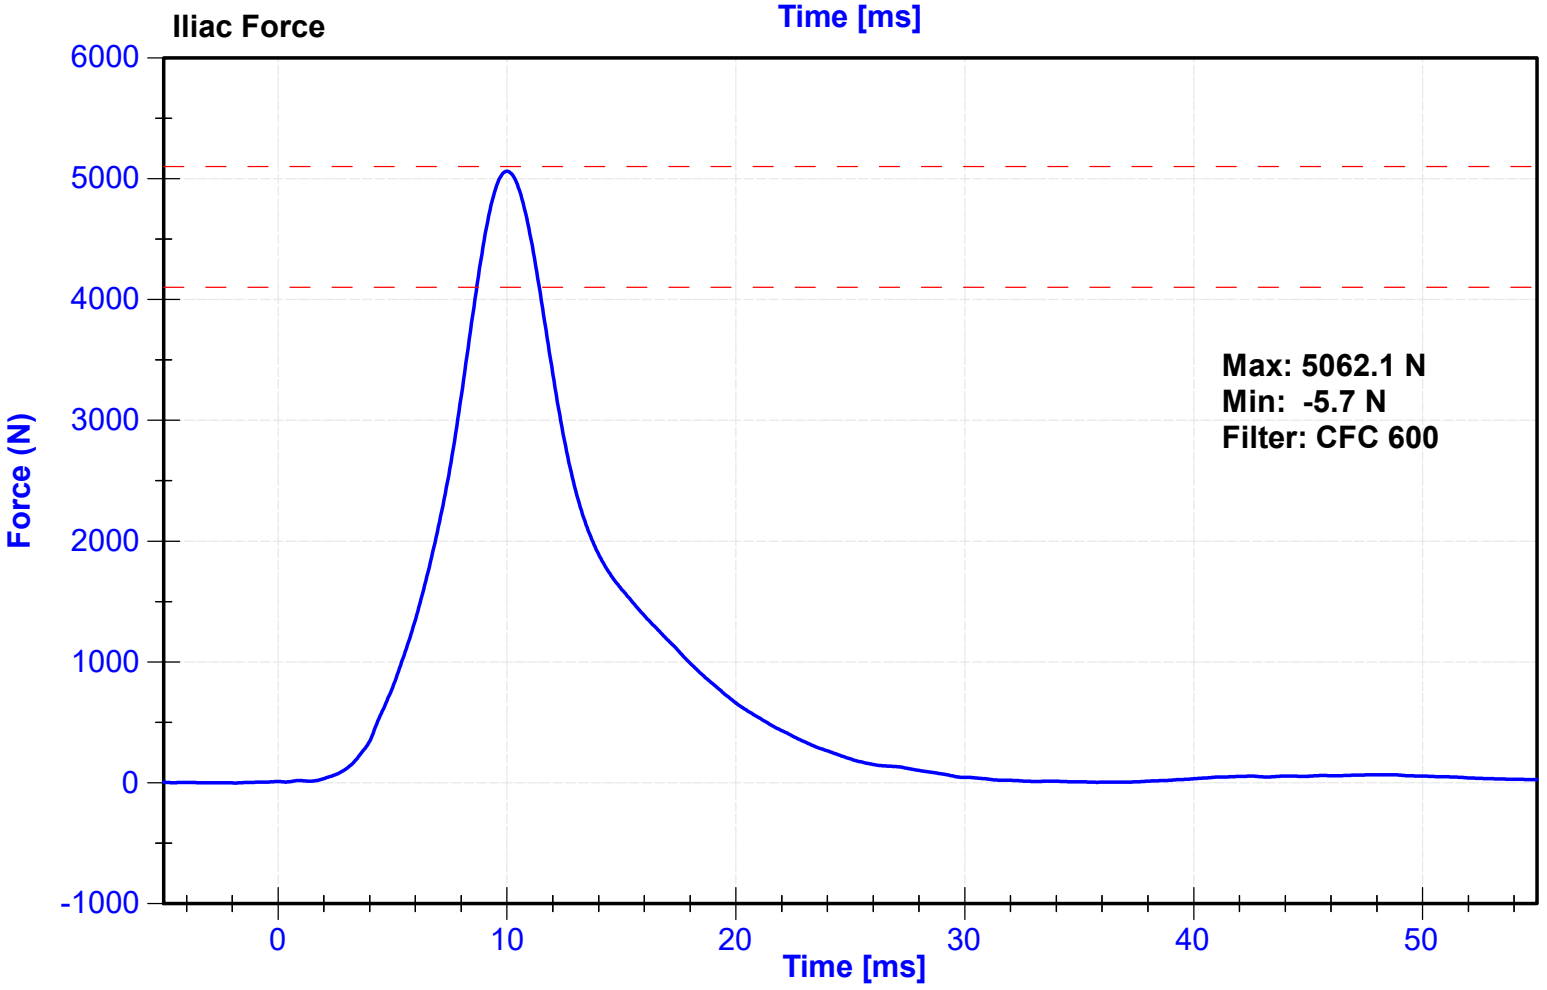
Iliac Force
Force (N)
6000
5000
4000
3000
2000
1000
0
-1000
0
10
20
30
40
50
Time [ms]
Max: 5062.1 N
Min: -5.7 N
Filter: CFC 600

APPENDIX D

TEST EQUIPMENT AND INSTRUMENTATION CALIBRATION DATA

TABLE 1 – Dummy Instrumentation (ES-2re)

			ES-2re S/N _F033__		
			Serial Number	**Manufacturer**	**Calibration Date**
Head Accelerometers	Primary	X	P63861	Endevco	11/16/2023
		Y	P49216	Endevco	11/16/2023
		Z	P51303	Endevco	11/16/2023
	Redundant	X	P58868	Endevco	11/16/2023
		Y	P59020	Endevco	11/16/2023
		Z	P52132	Endevco	11/16/2023
Thorax Rib Displacement Potentiometers	Upper	Y	179GFE	Honeywell	11/17/2023
	Middle	Y	185GFE	Honeywell	11/17/2023
	Lower	Y	178GFE	Honeywell	11/17/2023
Abdomen Load Cells	Forward	Y	DM5846	Denton	05/18/2023
	Middle	Y	1529	Denton	05/18/2023
	Rear	Y	1533	Denton	05/24/2023
Lower Spine Accelerometers (T12)		X	P58997	Endevco	11/16/2023
		Y	T21243	Endevco	11/16/2023
		Z	P52033	Endevco	11/16/2023
Pubic Symphysis Load Cell		Y	459-FY	Denton	06/20/2023

TABLE 2 – Dummy Instrumentation (SID-IIs)

				SID-IIs S/N __300__		
				Serial Number	**Manufacturer**	**Calibration Date**
Head Accelerometers		Primary	X	P59018	Endevco	11/15/2023
			Y	P79189	Endevco	11/15/2023
			Z	P79587	Endevco	11/15/2023
		Redundant	X	P68057	Endevco	11/15/2023
			Y	P58986	Endevco	11/15/2023
			Z	P52025	Endevco	11/15/2023
Displacement Potentiometers	Thoracic Rib	Upper	Y	2316GFE	Servo	11/17/2023
		Middle	Y	307GFE	Servo	11/17/2023
		Lower	Y	1156GFE	Servo	11/17/2023
	Abdominal Rib	Upper	Y	060GFE	Servo	11/21/2023
		Lower	Y	308GFE	Servo	11/17/2023
Lower Spine Accelerometers (T12)			X	P64003	Endevco	11/16/2023
			Y	P52071	Endevco	11/16/2023
			Z	P17283	Endevco	11/16/2023
Acetabulum Load Cell			Y	267-FY	Denton	09/11/2023
Iliac Wing Load Cell			Y	321	Denton	09/11/2023
Pelvis Plug (struck side)				16335	SACO	05/20/2022
Pelvis Plug (non-struck side)				16372	SACO	05/20/2022

TABLE 3 – Vehicle Instrumentation

Vehicle Instrumentation			Serial Number	Manufacturer	Calibration Date
1	Vehicle Center of Gravity	X	A400765	Measurement Specialties	10/04/2023
	Vehicle Center of Gravity	Y	A405613	Measurement Specialties	10/04/2023
	Vehicle Center of Gravity	Z	A405630	Measurement Specialties	10/04/2023
2	Right Sill at Front Seat	X	G23687	Endevco	10/25/2023
	Right Sill at Front Seat	Y	G24021	Endevco	08/08/2023
	Right Sill at Front Seat	Z	G24050	Endevco	08/09/2023
3	Right Sill at Rear Seat	X	A405546	Measurement Specialties	09/14/2023
	Right Sill at Rear Seat	Y	G22924	Endevco	08/09/2023
	Right Sill at Rear Seat	Z	A413602	Measurement Specialties	09/14/2023
4	Left Sill at Front Door	Y	G24185	Endevco	09/05/2023
5	Left Sill at Rear Door	Y	G24034	Endevco	08/08/2023
6	Left A-Post Lower	Y	G22797	Endevco	09/27/2023
7	Left A-Post Middle	Y	G22736	Endevco	09/13/2023
8	Left B-Post Lower	Y	G22671	Endevco	10/04/2023
9	Left B-Post Middle	Y	G23446	Endevco	11/29/2023
10	Front Seat Track	Y	A400035	Measurement Specialties	12/08/2023
11	Rear Seat Track or Structure	Y	G22417	Endevco	07/26/2023
12	Right Rear Occ. Compartment	Y	A290898	Measurement Specialties	12/11/2023
13	Engine Block	X	A405532	Measurement Specialties	10/11/2023
	Engine Block	Y	A405535	Measurement Specialties	10/11/2023
14	Rear Floorpan Above Axle	X	A372843	Measurement Specialties	11/01/2023
	Rear Floorpan Above Axle	Y	A373210	Measurement Specialties	11/01/2023
	Rear Floorpan Above Axle	Z	A396639	Measurement Specialties	11/01/2023

TABLE 4 – MDB Instrumentation

MDB Instrumentation		Serial Number	Manufacturer	Calibration Date
MDB Center of Gravity	X	G22717	Endevco	08/15/2023
MDB Center of Gravity	Y	G22737	Endevco	08/15/2023
MDB Center of Gravity	Z	G22738	Endevco	08/15/2023
Left Frame at Rear Axle Centerline	X	A284318	Measurement Specialties	10/12/2023
Left Frame at Rear Axle Centerline	Y	A374216	Measurement Specialties	10/12/2023