

**Vehicle Research and Test Center
2004 Chevrolet Avalanche
into Flat Frontal Barrier
TRC Inc. Test Number: 040812**

**Prepared By:
Transportation Research Center Inc.
10820 State Route 347
East Liberty, OH 43319**

**Final Report
August - September 2004**

**Prepared For:
Vehicle Research and Test Center
P. O. Box 37
East Liberty, OH 43319**

Notice

Transportation Research Center Inc. does not endorse or certify products of manufacturers. The manufacturer's name appears solely to identify the test article. Transportation Research Center Inc. assumes no liability for the report or use thereof. It is responsible for the facts and the accuracy of the data presented herein. This report does not constitute a standard, specification, or regulation.

This publication is distributed by the U. S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned, it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United State Government does not endorse products or manufacturers.

Table of Contents

<u>Section</u>	<u>Description</u>	<u>Page</u>
1.0	Purpose and Test Procedure	1-1
2.0	Impact Test Summary	2-1
3.0	Vehicle, Occupant, and Camera Measurements	3-1
Appendix A	Photographs	A-1
Appendix B	Data Plots	B-1
Appendix C	Dummy Certification Data	C-1
Appendix D	Miscellaneous Test Information	D-1
Appendix E	INSIA Report on Structural Measurements	E-1

List of Tables

<u>Number</u>	<u>Title</u>	<u>Page</u>
1	Crash Test Summary	2-4
2	Test Vehicle Information	2-5
3	Vehicle Accelerometer Locations and Data Summary	2-12
4	Post-Impact Test Data	2-14
5	Dummy Data Summary	2-15
6	Load Cell Barrier Data Summary	2-19
7	Fuel System Data	3-2
8	Impacted Vehicle Measurements	3-4
9	Vehicle Structural Measurements	3-5
10	Vehicle Intrusion of Upper Instrument Panel	3-11
11	Frontal Profile Measurements	3-12
12	Additional Required Measurements	3-13
13	Dummy Measurement Data for Front Seat Occupants	3-14
14	Camera Information	3-19

List of Figures

<u>Number</u>	<u>Title</u>	<u>Page</u>
1	Impact Velocity Measurement System	2-8
2	Vehicle Crush	2-9
3	Vehicle Accelerometer Placement	2-11
4	Load Cell Barrier Mnemonics	2-17
5	Load Cell Barrier Instrumentation	2-18
6	Pre-Test and Post-Test Measurement Points	3-3
7	Vehicle Intrusion Measurements, Door Opening Width	3-6
8	Vehicle Intrusion Measurements, Static Footwell Deformation	3-7
9	Vehicle Intrusion Measurements, Static Passenger Compartment Intrusion	3-8
10	Vehicle Floorboard Deformation	3-9
11	Vehicle Toeboard Measurements	3-10
12	Seat Belt Positioning Data	3-16
13	Camera Positions	3-18

List of Photographs

<u>Description</u>	<u>Figure</u>
Pre-Test Front View	A-1
Post-Test Front View	A-2
Pre-Test Left Front View	A-3
Post-Test Left Front View	A-4
Pre-Test Left Side View	A-5
Post-Test Left Side View	A-6
Pre-Test Right Rear View	A-7
Post-Test Right Rear View	A-8
Pre-Test Right Side View	A-9
Post-Test Right Side View	A-10
Pre-Test Overhead View	A-11
Post-Test Overhead View	A-12
Post-Test Overhead Close-up View	A-13
Pre-Test Front Underbody View	A-14
Post-Test Front Underbody View	A-15
Pre-Test Front Mid Underbody View	A-16
Post-Test Front Mid Underbody View	A-17
Pre-Test Mid Underbody View	A-18
Post-Test Mid Underbody View	A-19
Pre-Test Rear Mid Underbody View	A-20
Post-Test Rear Mid Underbody View	A-21
Pre-Test Rear Underbody View	A-22
Post-Test Rear Underbody View	A-23
Pre-Test Fuel Tank View	A-24
Post-Test Fuel Tank View	A-25
Pre-Test Fuel Filler Neck View	A-26
Post-Test Fuel Filler Neck - View 1	A-27
Post-Test Fuel Filler Neck - View 2	A-28

List of Photographs, Cont'd.

<u>Description</u>	<u>Figure</u>
Post-Test Fuel Filler Neck - View 3	A-29
Pre-Test Fuel Filler Cap View	A-30
Post-Test Fuel Filler Cap View	A-31
Pre-Test Engine Compartment View	A-32
Post-Test Engine Compartment View	A-33
Pre-Test Windshield View	A-34
Post-Test Windshield View	A-35
Pre-Test Driver and Passenger Dummies Front View	A-36
Post-Test Driver and Passenger Dummies Front View	A-37
Pre-Test Driver Dummy Position - View 1	A-38
Post-Test Driver Dummy Position - View 1	A-39
Pre-Test Driver Dummy Position - View 2	A-40
Post-Test Driver Dummy Position - View 2	A-41
Pre-Test Driver Dummy Position - View 3	A-42
Pre-Test Driver Dummy Position - View 4	A-43
Post-Test Driver Dummy Head Contact View	A-44
Post-Test Driver Dummy Knee Contact View	A-45
Pre-Test Front Passenger Dummy Position - View 1	A-46
Post-Test Front Passenger Dummy Position - View 1	A-47
Pre-Test Front Passenger Dummy Position - View 2	A-48
Post-Test Front Passenger Dummy Position - View 2	A-49
Pre-Test Front Passenger Dummy Position - View 3	A-50
Post-Test Front Passenger Dummy Position - View 3	A-51
Pre-Test Front Passenger Dummy Position - View 4	A-52
Post-Test Front Passenger Dummy Position - View 4	A-53
Post-Test Front Passenger Dummy Overall View	A-54
Post-Test Front Passenger Dummy Head Contact - View 1	A-55
Post-Test Front Passenger Dummy Head Contact - View 2	A-56

List of Photographs, Cont'd.

<u>Description</u>	<u>Figure</u>
Post-Test Front Passenger Dummy Knee Contact - View 1	A-57
Post-Test Front Passenger Dummy Knee Contact - View 2	A-58
Pre-Test Rear Passenger Dummy - View 1	A-59
Post-Test Rear Passenger Dummy - View 1	A-60
Pre-Test Rear Passenger Dummy - View 2	A-61
Post-Test Rear Passenger Dummy - View 2	A-62
Pre-Test Rear Passenger Dummy - View 3	A-63
Post-Test Rear Passenger Dummy - View 3	A-64
Post-Test Rear Passenger Dummy Overall View	A-65
Post-Test Rear Passenger Dummy Head Contact - View 1	A-66
Post-Test Rear Passenger Dummy Head Contact - View 2	A-67
Post-Test Rear Passenger Dummy Knee Contact View	A-68
Vehicle Certification and Tire Load Label View	A-69
Pre-Test Barrier View	A-70
Post-Test Barrier View	A-71

Section 1.0

Purpose and Test Procedure

Purpose

This test was conducted for National Highway Traffic Safety Administration (NHTSA) and Vehicle Research and Test Center (VRTC) by Transportation Research Center Inc. (TRC Inc). The purpose of this test was to determine the vehicle and occupant response of the subject vehicle, a 2004 Chevrolet Avalanche 4-door MPV.

Test Procedure

This test was conducted per VRTC instructions. Data was obtained relative to FMVSS 208, “Occupant Crash Protection”.

The test vehicle was instrumented with nine (9) accelerometers to measure longitudinal axis accelerations; two (2) accelerometers to measure lateral axis accelerations; two (2) accelerometers to measure vertical axis accelerations, and two (2) airbag event data channels. The vehicle's specified impact velocity range was 55.5 to 57.1 km/h. The vehicle impacted a flat frontal barrier equipped with one hundred thirty-four (134) load cells.

The test vehicle contained three (3) Part 572O small adult female anthropomorphic test devices (dummies). The dummies were positioned in the left front, right front, and right rear outboard designated seating positions according to the dummy placement procedure specified in NHTSA Laboratory Test Procedure TP-208-12. The right rear dummy was positioned using the draft TP-208-12 procedure dated February 15, 2004

The driver dummy was instrumented with head (primary and redundant), chest (primary and redundant), pelvis, left foot, and right foot accelerometers to measure longitudinal, lateral, and vertical accelerations; upper and lower neck load cells to measure forces and moments; a chest displacement potentiometer to measure chest deflection; left and right femur load cells to measure axial forces, knee potentiometers to measure displacements, and upper and lower tibia load cells to measure forces and moments.

The right front passenger dummy was instrumented with head (primary and redundant) chest (primary and redundant) and pelvis accelerometers to measure longitudinal, lateral, and vertical accelerations; upper and lower neck load cells to measure forces and moments; a chest displacement potentiometer to measure chest deflection; and left and right femur load cells to measure axial forces.

The right rear passenger dummy was instrumented with head, chest, and pelvis accelerometers to measure longitudinal, lateral, and vertical accelerations; upper and lower neck

load cells to measure forces and moments; a chest displacement potentiometer to measure chest deflection; and left and right femur load cells to measure axial forces.

The 267 data channels were digitally sampled and recorded at 12,500 samples per second and processed per the NHTSA Laboratory Test Procedure.

The crash event was recorded by one (1) real-time panning motion picture camera, ten (10) high-speed digital motion picture cameras operating at 1000 frames per second.

The vehicle and occupant data are summarized in Section 2.0. The vehicle, occupant, and camera measurements are presented in Section 3.0. Appendix A contains the still photographic prints. Appendix B contains the dummy and vehicle data plots. Appendix C contains the dummy certification data. Appendix D contains miscellaneous test information. Appendix E contains an INSIA report that was the basis for the Structural Measurements presented in Table 9 of this report.

Section 2.0

Load Cell Barrier Impact Test Summary

Test Results Summary

This 35 mph frontal load cell barrier impact test was conducted by TRC Inc. on August 12, 2004.

The test vehicle, a 2004 Chevrolet Avalanche 4-door MPV, was equipped with a 5.3-liter inline engine, automatic transmission, power steering, power brakes and dual stage front airbags. The vehicle's test weight was 2741.1 kg. The vehicle's fuel system contained 109.1 liters of Stoddard for the test. The vehicle's impact speed was 56.1 km/h. The vehicle sustained 674 mm of static crush during the impact.

The driver's 36 millisecond Head Injury Criteria (HIC) was 793. The driver's 15 millisecond HIC was 581. The driver's chest maximum resultant acceleration with three (3) milliseconds minimum duration was 58.6 g. The driver's maximum chest deflection was 44 mm. The driver's left and right femur maximum axial compressive forces were 5201 N and 5522 N, respectively. The driver dummy's neck injury calculations were as follows: NTF, 0.27; NTE, 0.74; NCF, 0.23; NCE, 0.15.

The right front passenger's 36 millisecond HIC was 555. The right front passenger's 15 millisecond HIC was 485. The right front passenger's chest maximum resultant acceleration with three (3) milliseconds minimum duration was 53.6 g. The right front passenger's maximum chest deflection was 15 mm. The right front passenger's left and right femur maximum axial compressive forces were 4208 N and 3314 N, respectively. The right front passenger's neck injury calculations were as follows: NTF, 0.66; NTE, 1.03; NCF, 0.01; NCE, 0.24.

The right rear passenger's 26 milliseconds HIC was 901. The right rear passenger's 15 millisecond HIC was 542. The right rear passenger's chest maximum resultant acceleration with three (3) milliseconds minimum duration was 41.5 g. The right rear passenger's maximum chest deflection was 42 mm. The right rear passenger's left and right femur maximum axial compressive forces were 216 N and 126 N, respectively. The left and right femur maximum axial tensal forces were 2593 N and 2701 N, respectively. The right rear passenger's neck injury calculations were as follows: NTF, 0.82; NTE, 0.63; NCF, 0.00; NCE, 1.32.

Data Acquisition Explanations

The vehicle's X-, Y-, and Z-axis center of gravity acceleration channels, VCGXG, VCGYG, and VCGZG, recorded questionable data between approximately 50 and 56 milliseconds. The calculated resultant was also affected.

The vehicle's secondary air bag fire channels, DABETB and PABETB, did not record an event signal during the test.

Table 1 Crash Test Summary

Test mode:	Flat frontal barrier
Test date:	08/12/04
Test time:	11:57
Ambient temperature:	21° C
Vehicle year/make/ model/body style:	2004/Chevrolet/Avalanche/4-door MPV
Vehicle test weight:	2741.1 kg
Impact angle ¹ :	0°
Impact velocity ² :	56.1 km/h
Maximum static crush:	674 mm
Average rebound:	987 mm

<u>Dummies:</u>	<u>Driver #416</u>	<u>Passenger #048</u>
Type:	Hybrid III 5 th	Hybrid III 5 th
Location:	Left front	Right front
Restraint:	Airbag, 3-point seat belt	Airbag, 3-point seat belt
Number of data channels:	60	30

Dummies:	<u>Passenger #070</u>
Type:	Hybrid III 5 th
Location:	Right rear
Restraint:	3-point seat belt
Number of data channels:	24

Number of cameras:	
High-speed	10
Real-time	1

¹ With respect to tow track centerline.

² Speed trap measurement ($\pm .08$ km/h accuracy)

Table 2 Test Vehicle Information

Vehicle year/make/ model/body style:	2004/Chevrolet/Avalanche/4-door MPV
VIN:	3GNEC12T04G124367
Model year:	Avalanche
Body style:	4-door MPV
Color:	Red
Engine data:	
Type:	V
Cylinders:	8
Displacement	5.3 liters
Transmission data:	<u>4</u> speed, <u> </u> manual, <u> X </u> automatic, <u> X </u> overdrive <u> </u> FWD, <u> X </u> RWD, <u> </u> 4WD
Date vehicle received:	08/09/2004
Odometer reading:	30 miles
Dealer's name and address:	Supplied by VRTC

Accessories:

Power steering	Yes	Automatic transmission	Yes
Power brakes	Yes	Automatic speed control	Yes
Power seats	Driver only	Tilting steering wheel	Yes
Power windows	Yes	Telescoping steering wheel	No
Tinted glass	Yes	Air conditioning	Yes
Radio	Yes	Anti-skid brake	Yes
Clock	Yes	Rear window defroster	Yes
Other	No	Power door locks	Yes

Certification data from vehicle's label:

Vehicle manufactured by:	General Motors Corporation		
Date of manufacture:	09/2003		
VIN:	3GNEC12T04G124367		
GVWR:	3085 kg	(6800 lbs.)	
GAWR: Front:	1542 kg	(3400 lbs.)	
Rear:	1814 kg	(4000 lbs.)	

Table 2 Test Vehicle Information, Cont'd.

Tires on vehicle (mfr., line, size): Firestone, Wilderness LE, P265/70R16

Tire pressure with maximum capacity vehicle load:

Front: 300 kPa

Rear: 300 kPa

Spare tire (mfr., line, size): Firestone, Wilderness LE, P265/70R16

Type of seats:

Front Bucket

Rear Split bench

Maximum width: 2010 mm

Wheelbase: 3310 mm

Location of "Recommended Tire Pressure" label:

The label was located on the left front door.

Data from vehicle's "Recommended Tire Pressure" label:

Recommended tire size: P265/70R16

Recommended cold tire pressure:

Front: 35 psi (240 kPa)

Rear: 35 psi (240 kPa)

Vehicle Capacity Data:

Number of Occupants (Designated seating capacity):

Front 3

Rear 3

Total 6

Vehicle capacity weight:¹ 618 kg

Test vehicle attitude:

Delivered attitude: LF 886 mm; RF 899 mm; LR 962 mm; RR 973 mm

Fully loaded attitude: LF 901 mm; RF 902 mm; LR 941 mm; RR 937 mm

Pre-test attitude: LF 886 mm; RF 895 mm; LR 915 mm; RR 935 mm

Post-test attitude: LF 1005 mm; RF 969 mm; LR 905 mm; RR 918 mm

¹ VCW = Gross Vehicle Weight Rating -Unloaded Vehicle Weight

Table 2 Test Vehicle Information, Cont'd.

Weight of test vehicle as received (with maximum fluids):

Right front	604.5 kg	Right rear	588.0 kg
Left front	659.0 kg	Left rear	615.5 kg
Total front weight	1263.5 kg	(51.2 % of total vehicle weight)	
Total rear weight	1203.5 kg	(48.8 % of total vehicle weight)	
Total delivered weight	2467.0 kg		

Calculation of test vehicle's target test weight:

GVWR = Gross Vehicle Weight Rating = 3085.0 kg

UDW = Unloaded Delivered Weight = 2467.0 kg

VCW = Vehicle Capacity Weight = 618.0 kg

DSC = Designated Seating Capacity = 6

RCLW¹ = Rated Cargo and Luggage Weight = 136 kg

Target test weight = UDW + RCLW + (No. of Part 572O dummies X 49 kg)

Target test weight = 2467 + 136 + (3) 49 = 2750.0 kg

Weight of test vehicle with required dummies and 127.1 kg of cargo weight:

Right front	619.8 kg	Right rear	708.2 kg
Left front	693.6 kg	Left rear	719.5 kg
Total front weight	1313.4 kg	(47.9% of total vehicle weight)	
Total rear weight	1427.7 kg	(52.1% of total vehicle weight)	
Total test weight	2741.1 kg		


Distance of the CG behind front axle: 1724 mm

Weight of ballast secured in vehicle: 3.6 kg shot in rear bed

Components removed to meet target test weight: None

¹ Cargo weight for multipurpose passenger vehicles, trucks, and buses is the vehicle's rated cargo and luggage weight from the vehicle's label or 136 kilograms, whichever is less.


Figure 1 Impact Velocity Measurement System

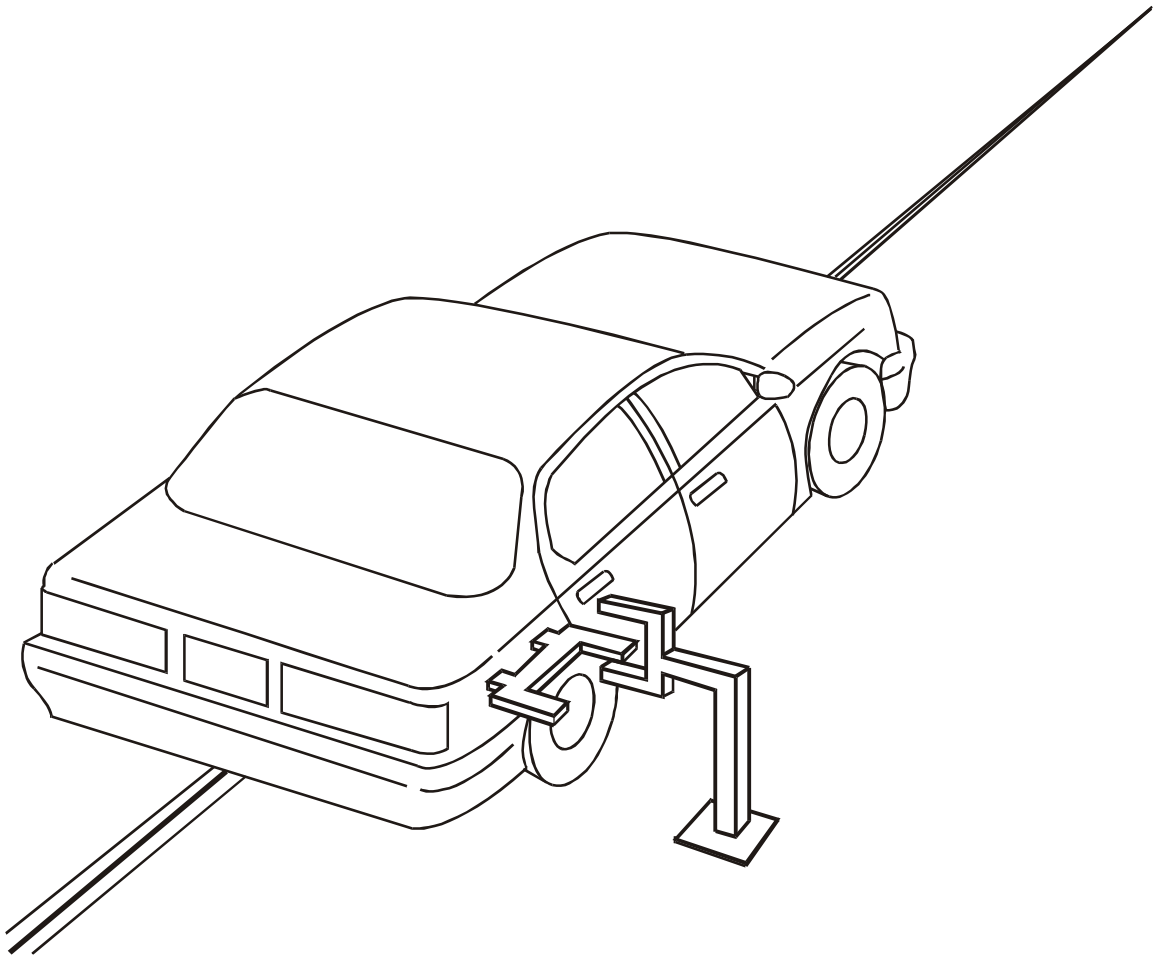

The final vane clears the final emitter/receiver pair 51 millimeters before impact.

The vanes have 305-millimeter spacing.

Figure 2 Vehicle Crush

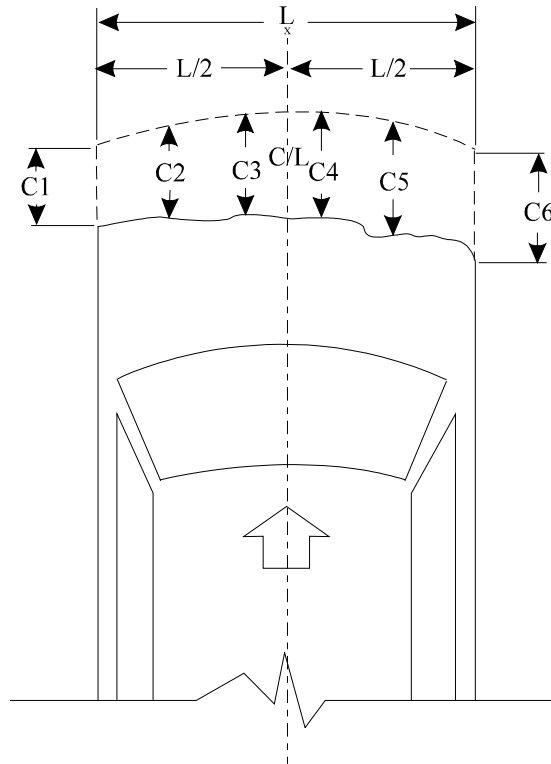


Notes: L is pre-test length of contact surface.
C1 through C6 are spaced equally apart.
CL is vehicle centerline.

Vehicle: 2004 Chevrolet Avalanche 4-door MPV

Location	Pre-test	Post-test	Difference
L	1524 mm		
C1	5527 mm	5082 mm	445 mm
C2	5596 mm	5115 mm	481 mm
C3	5625 mm	5205 mm	420 mm
C4	5625 mm	5231 mm	394 mm
C5	5604 mm	5226 mm	378 mm
C6	5531 mm	5182 mm	349 mm
CL	5635 mm	5223 mm	412 mm

Figure 2 Vehicle Crush, Cont'd.

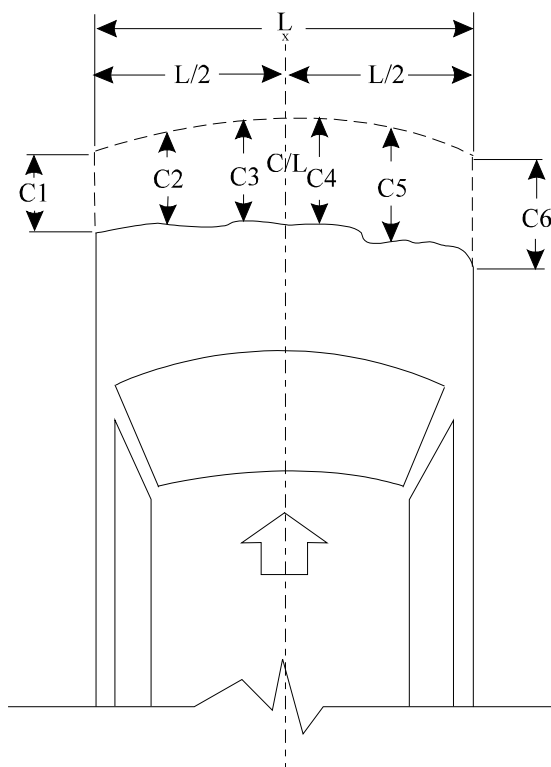

Notes: L is pre-test length of contact surface.
 $C1$ through $C6$ are spaced equally apart.
 CL is vehicle centerline.
 Measured without bumper fascia.

Vehicle: 2004 Chevrolet Avalanche 4-door MPV

	Pre-test	Post-test	Crush ¹
L	1524 mm		
$C1$	5502 mm	4909 mm	593 mm
$C2$	5553 mm	4926 mm	627 mm
$C3$	5589 mm	4921 mm	668 mm
$C4$	5590 mm	4916 mm	674 mm
$C5$	5564 mm	4915 mm	649 mm
$C6$	5507 mm	4895 mm	612 mm
CL	5594 mm	4916 mm	678 mm

¹ The difference for points $C1$ -5, measured without the bumper fascia, are included in the NHTSA Database Submission as Damage Profile Distance 1-5.

Figure 3 Vehicle Accelerometer Placement

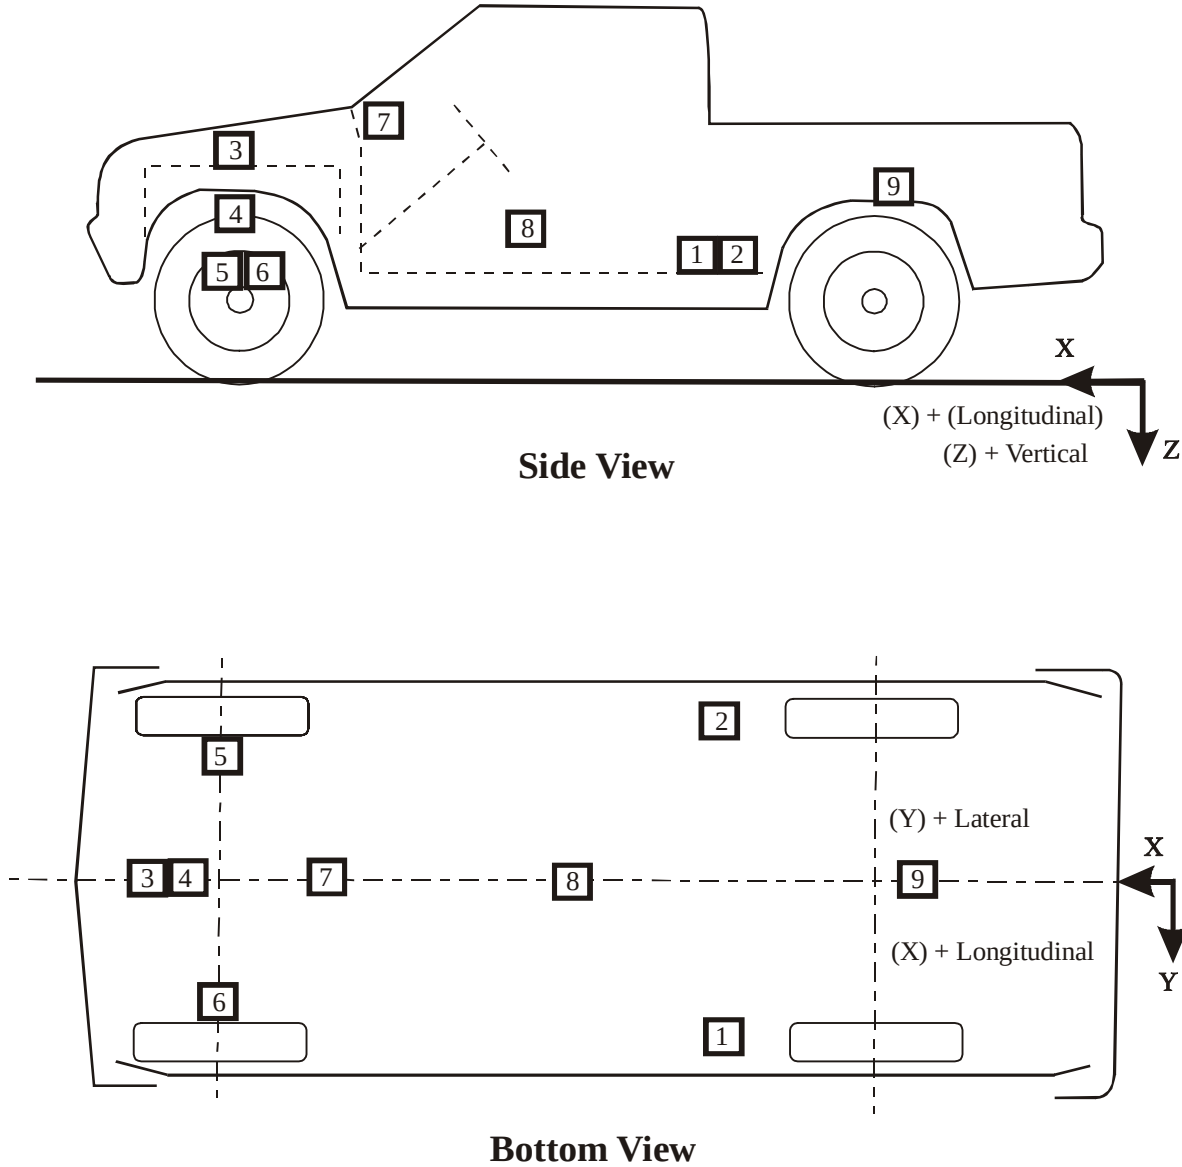


Table 3 Vehicle Accelerometer Locations and Data Summary

Accel. No.	Location	Coordinates (millimeters)			Positive Direction		Negative Direction	
		X*	Y*	Z*	Max. (g)	Time (ms)	Max. (g)	Time (ms)
1	Left Rear Seat Crossmember	2160	-705	-570				
	Longitudinal X				2.6	162.8	33.7	65.9
2	Right Rear Seat Crossmember	2360	672	-570				
	Longitudinal X				2.4	176.9	36.1	66.2
3	Top of Engine	4693	25	-1160				
	Longitudinal X				25.0	57.7	80.1	45.7
4	Bottom of Engine	4315	45	-340				
	Longitudinal X				2.8	66.3	50.1	41.4
5	Right Front Brake Caliper	4506	690	-373				
	Longitudinal X				81.5	38.6	139.7	30.2
6	Left Front Brake Caliper	4502	-690	-360				
	Longitudinal X				87.8	38.6	139.7	30.2
7	Instrument Panel Top Center	3837	0	-1365				
	Longitudinal X				22.6	110.9	68.7	67.2

Table 3 Vehicle Accelerometer Locations and Data Summary, Cont'd.

Accel. No.	Location	Coordinates (millimeters)			Positive Direction		Negative Direction	
		X*	Y*	Z*	Max. (g)	Time (ms)	Max. (g)	Time (ms)
8	Vehicle Center of Gravity	3672	0	-783				
	Longitudinal ¹ X				13.9	99.1	79.7	61.0
	Lateral ¹ Y				35.6	63.4	18.0	58.8
	Vertical ¹ Z				65.5	62.6	41.6	71.7
	Resultant				101.4	61.3		
9	Rear Deck	295	0	-808				
	Longitudinal X				2.7	167.1	36.7	65.6
	Lateral Y				4.2	92.1	2.7	69.3
	Vertical Z				22.6	120.0	17.6	20.1
	Resultant				37.3	65.7		

*Reference: X = Rear Bumper (+ Forward)

Y = Vehicle Centerline (+ To Right)

Z = Ground Level (+ Down)

All measurements accurate to within ± 3 mm.

¹ See Data Acquisition Explanations

Table 4 Post-Impact Data

Visible dummy contact points:

	<u>Driver</u>	<u>Right Front Passenger</u>	<u>Right Rear Passenger</u>
Head	Airbag	Airbag	Rear seat back
Chest	Airbag	Airbag	None
Abdomen	Airbag	None	None
Left knee	Knee bolster	Glove box	None
Right knee	Knee bolster	Glove box	None

Door opening:

	<u>Left</u>	<u>Right</u>
Front	Jammed	Needed tools
Rear	Easy	Easy

Seat back failure:

Left	None
Right	None

Seat track shift:

Left	None
Right	None

Glazing damage: Windshield shattered

Other notable impact effects: None

Table 5 Dummy Injury Criteria Data

	<u>Maximum Acceleration¹</u>							
	Head				Chest			
	X	Y	Z	R	X	Y	Z	R
Driver	-75.2 g	-23.1 g	19.2 g	79.0 g	-58.6 g	-8.0 g	-16.8 g	60.2 g
Front Pass.	-88.7 g	6.4 g	19.3 g	89.4 g	-59.4 g	5.9 g	22.9 g	61.3 g
Rear Pass.	-48.2 g	6.2 g	61.4 g	71.9 g	-42.0 g	5.1 g	-12.4 g	42.1 g

	<u>Maximum Femur Compressive Force</u>	
	Left Femur	Right Femur
Driver	5201 N	5522 N
Front Passenger	4208 N	3314 N
Rear Passenger	216 N	126 N

	<u>Head Injury Criteria²</u>		
	36 millisecond		
	HIC	Time t ₁	Time t ₂
Driver	793	62.96 ms	98.96 ms
Front Passenger	555	70.56 ms	106.56 ms
Rear Passenger	901	82.72 ms	118.72 ms

	15 millisecond		
	HIC	Time t ₁	Time t ₂
Driver	581	78.96 ms	94.00 ms
Front Passenger	485	77.52 ms	92.56 ms
Rear Passenger	542	92.24 ms	107.28 ms

	<u>Chest Maximum Resultant Acceleration³</u>		
	Acceleration	Time t ₁	Time t ₂
Driver	58.6 g	79.15 ms	82.15 ms
Front Passenger	53.6 g	85.38 ms	88.38 ms
Rear Passenger	41.5 g	72.62 ms	76.20 ms

Table 5 Dummy Injury Criteria Data, Cont'd.

Maximum Chest Deflection

Driver	44 mm
Front Passenger	15 mm
Rear Passenger	42 mm

Neck Injury Calculations (Nij)²

	NTF	NTE	NCF	NCE
Driver	0.27	0.74	0.23	0.15
Front Passenger	0.66	1.03	0.01	0.24
Rear Passenger	0.82	0.63	0.00	1.32

¹ See Report Sign Convention in Appendix D.

² As defined in FMVSS No. 208.

³ Defined as equal to or exceeding 0.003 sec. duration.

⁴ See Data Acquisition Explanation in Section 2.0.

Figure 4 Load Cell Barrier Mnemonics

Row	Column															
	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16
9						LC0906	LC0907	LC0908	LC0909	LC0910	LC0911					
8	LC0801	LC0802	LC0803	LC0804	LC0805	LC0806	LC0807	LC0808	LC0809	LC0810	LC0811	LC0812	LC0813	LC0814	LC0815	LC0816
7	LC0701	LC0702	LC0703	LC0704	LC0705	LC0706	LC0707	LC0708	LC0709	LC0710	LC0711	LC0712	LC0713	LC0714	LC0715	LC0716
6	LC0601	LC0602	LC0603	LC0604	LC0605	LC0606	LC0607	LC0608	LC0609	LC0610	LC0611	LC0612	LC0613	LC0614	LC0615	LC0616
5	LC0501	LC0502	LC0503	LC0504	LC0505	LC0506	LC0507	LC0508	LC0509	LC0510	LC0511	LC0512	LC0513	LC0514	LC0515	LC0516
4	LC0401	LC0402	LC0403	LC0404	LC0405	LC0406	LC0407	LC0408	LC0409	LC0410	LC0411	LC0412	LC0413	LC0414	LC0415	LC0416
3	LC0301	LC0302	LC0303	LC0304	LC0305	LC0306	LC0307	LC0308	LC0309	LC0310	LC0311	LC0312	LC0313	LC0314	LC0315	LC0316
2	LC0201	LC0202	LC0203	LC0204	LC0205	LC0206	LC0207	LC0208	LC0209	LC0210	LC0211	LC0212	LC0213	LC0214	LC0215	LC0216
1	LC0101	LC0102	LC0103	LC0104	LC0105	LC0106	LC0107	LC0108	LC0109	LC0110	LC0111	LC0112	LC0113	LC0114	LC0115	LC0116

Figure 5 Load Cell Barrier Configuration

					109	044	134	115	110	064					
133	039	085	059	116	013	119	107	095	103	129	058	126	108	025	070
027	111	072	106	056	114	068	157	049	131	018	084	062	078	127	021
036	052	010	034	026	022	030	016	035	092	043	076	001	087	096	015
090	065	079	055	031	054	050	089	130	082	083	123	032	121	009	037
040	007	071	094	067	086	118	101	073	047	099	080	097	048	061	005
125	004	051	042	011	117	066	045	077	029	100	102	091	012	017	081
120	063	124	093	046	122	002	060	105	020	069	041	112	074	128	075
053	008	028	038	003	014	024	006	132	023	033	019	113	098	104	088

LOAD CELL SERIAL NUMBERS

Track C/L

Table 6 Load Cell Barrier Data Summary

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 1	1	162	6.3	-246	11.2
	2	296	36.3	-272	80.3
	3	517	26.0	-290	11.8
	4	483	25.8	-674	31.3
	5	440	17.0	-1,072	31.3
	6	929	26.2	-1,410	31.2
	7	1,125	26.5	-1,850	31.3
	8	1,389	26.5	-1,527	31.1
	9	1,411	26.6	-2,396	64.8
	10	1,339	26.7	-1,484	31.0
	11	1,241	26.8	-1,332	31.0
	12	1,006	26.9	-1,282	31.1
	13	1,070	27.0	-654	31.1
	14	791	27.2	-514	106.0
	15	364	27.6	-367	31.3
	16	239	28.3	-216	31.4

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 2	1	132	14.1	-301	10.9
	2	185	5.7	-1,955	71.5
	3	306	25.0	-484	11.2
	4	428	25.2	-654	11.5
	5	999	37.7	-13,619	30.6
	6	430	26.2	-1,289	31.4
	7	926	26.2	-1,251	31.0
	8	958	26.2	-1,200	31.0
	9	1,217	26.3	-1,154	31.0
	10	1,107	26.4	-1,113	31.0
	11	332	3.8	-3,124	22.5
	12	236	3.6	-20,347	31.0
	13	705	26.7	-558	31.0
	14	495	26.9	-2,281	99.2
	15	241	26.4	-3,816	98.2
	16	189	16.8	-604	97.9

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 3	1	189	5.4	-545	40.2
	2	233	24.2	-999	39.6
	3	298	24.7	-2,298	83.8
	4	444	24.9	-1,983	10.7
	5	1,302	4.6	-78,826	29.8
	6	173	1.4	-48,151	30.0
	7	986	25.7	-700	11.9
	8	1,079	25.9	-687	12.1
	9	947	26.1	-839	30.7
	10	874	26.1	-1,220	9.6
	11	439	2.5	-77,147	87.3
	12	659	3.3	-32,077	30.6
	13	230	2.9	-2,141	89.3
	14	271	25.9	-4,970	88.9
	15	168	25.5	-1,202	65.0
	16	51	24.7	-568	51.3

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 4	1	216	5.1	-761	18.2
	2	297	4.9	-403	10.7
	3	343	24.0	-482	10.7
	4	271	1.1	-22,201	18.6
	5	412	0.5	-78,434	58.7
	6	678	-2.0	-37,996	60.7
	7	712	25.4	-720	11.6
	8	825	25.7	-628	11.7
	9	858	25.8	-553	11.6
	10	239	-2.6	-6,073	3.3
	11	689	-1.8	-57,035	11.3
	12	383	0.8	-73,713	17.4
	13	184	2.2	-1,479	8.8
	14	140	25.4	-172	30.2
	15	64	3.8	-643	15.0
	16	177	24.2	-633	37.5

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 5	1	289	58.7	-1,957	17.6
	2	333	5.0	-1,521	11.8
	3	635	3.7	-14,531	18.9
	4	286	2.7	-11,544	57.7
	5	119	1.1	-7,153	58.2
	6	78	-0.9	-7,557	58.2
	7	117	-1.7	-7,599	60.3
	8	135	25.5	-5,759	58.9
	9	211	25.7	-5,041	59.5
	10	43	301.0	-13,979	52.3
	11	131	26.0	-3,570	7.4
	12	213	1.4	-22,419	58.9
	13	432	2.6	-9,250	18.4
	14	237	3.2	-5,014	18.2
	15	102	4.4	-1,663	13.9
	16	104	-0.2	-582	17.8

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 6	1	247	5.4	-8,142	26.6
	2	280	5.4	-3,696	19.8
	3	387	5.4	-3,673	19.5
	4	628	5.4	-5,691	11.8
	5	393	24.1	-1,723	76.7
	6	457	4.1	-2,961	59.2
	7	398	25.3	-7,392	59.0
	8	412	3.7	-25,596	52.5
	9	381	3.3	-16,817	47.8
	10	348	26.2	-4,493	46.2
	11	259	3.1	-1,812	47.6
	12	193	3.4	-1,619	11.9
	13	309	4.7	-4,372	11.6
	14	110	3.8	-4,583	19.5
	15	103	13.8	-4,495	33.0
	16	352	23.7	-3,647	37.8

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 7	1	204	5.5	-8,662	75.0
	2	308	5.8	-13,700	39.6
	3	357	5.6	-8,324	37.7
	4	437	5.4	-6,771	58.8
	5	372	5.0	-2,952	57.8
	6	362	4.2	-2,505	59.0
	7	327	3.5	-1,551	66.5
	8	483	2.7	-24,584	57.9
	9	243	2.6	-18,805	58.7
	10	270	3.4	-2,283	58.4
	11	171	3.8	-1,063	10.4
	12	259	3.9	-3,583	10.8
	13	101	0.1	-2,933	21.0
	14	219	3.8	-4,646	15.9
	15	110	4.2	-6,416	47.5
	16	305	22.2	-7,844	60.3

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 8	1	183	14.1	-2,989	69.4
	2	246	6.2	-1,608	41.5
	3	294	6.0	-1,758	21.0
	4	266	5.9	-7,237	16.7
	5	377	5.9	-4,877	14.3
	6	319	5.4	-3,268	13.1
	7	307	5.2	-6,026	14.3
	8	305	4.7	-7,164	49.7
	9	189	4.8	-5,156	58.0
	10	188	4.7	-5,178	14.2
	11	174	4.2	-3,400	13.2
	12	283	23.4	-9,412	15.9
	13	41	4.2	-3,021	17.7
	14	96	23.3	-549	30.1
	15	317	23.4	-5,110	54.7
	16	268	23.4	-11,691	55.0

Table 6 Load Cell Barrier Data Summary, Cont'd.

Location	Column	Positive Direction		Negative Direction	
		Max. (N)	Time (ms)	Max. (N)	Time (ms)
Load Cell Row 9	6	214	5.5	-4,905	39.8
	7	311	4.6	-2,207	28.0
	8	351	35.4	-1,398	20.9
	9	135	35.1	-1,489	21.0
	10	140	4.7	-1,697	50.4
	11	66	4.6	-4,653	40.2

Section 3.0

Vehicle, Occupant, and Camera Measurements

Table 7 Fuel System Data

Vehicle year/make/ model/body style:	2004/Chevrolet/Avalanche/4-door MPV
Fuel system capacity:	117.3 liters (from owner's manual)
Useable capacity:	117.3 liters
Test volume range:	107.9 liters to 110.3 liters (92-94% of usable)
Actual test volume:	109.1 liters (93% of usable)
Test fluid type:	Stoddard
Specific gravity:	0.764
Kinematic viscosity:	0.99 centistoke
Test fluid color:	Purple
Type of fuel pump:	Electric
Did electric fuel pump operate with ignition switch "on" and the engine not operating.	No
Details of fuel system:	Fuel tank is located inside of left frame rail and in front of rear axle. Fuel filler neck runs through left rear wheel well. Fuel filler cap is located on left rear quarter panel. Fuel lines run inside of left frame rails.

Figure 6 Pre-Test And Post-Test Measurement Points

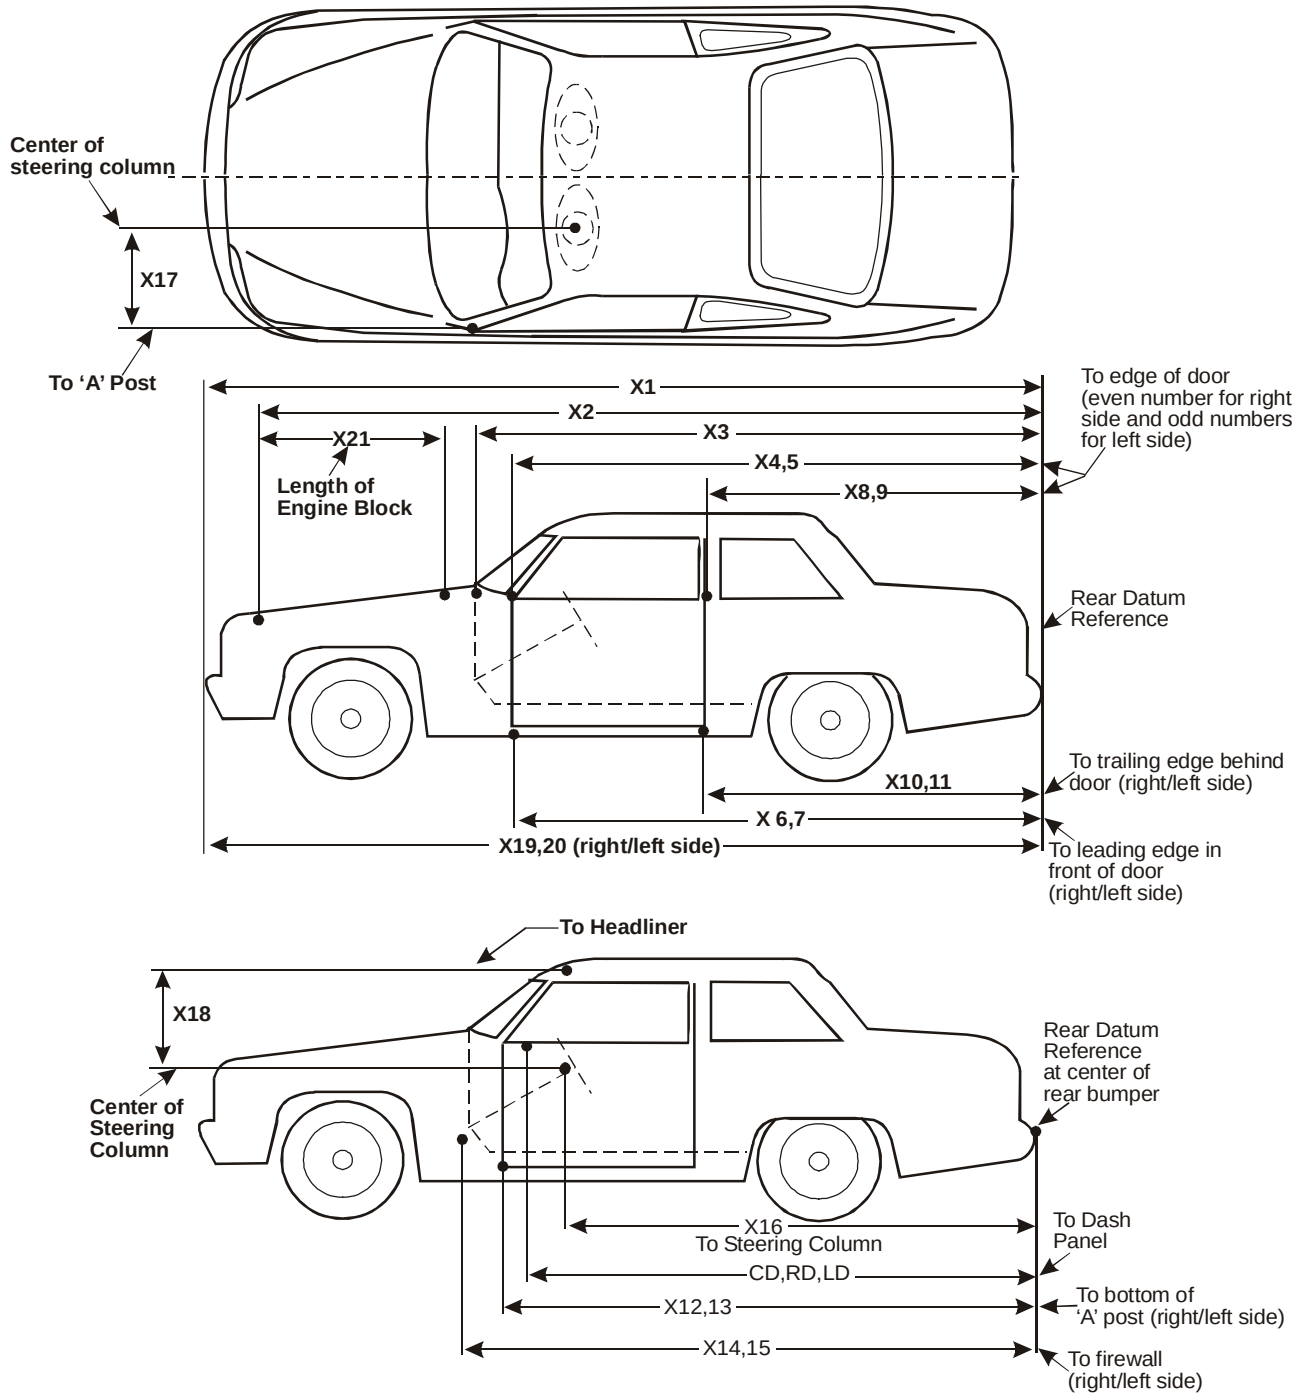


Table 8 Impacted Vehicle Measurements

Test number: 040812

Vehicle year/make/model/body style: 2004/Chevrolet/Avalanche/4-door MPV

No.	Type of measurement	Pre-Test	Post-Test	Difference
X1	Total Length of Vehicle at Centerline	5635	5223	412
X2	Rear Surface of Vehicle to Front of Engine Block	4795	4530	265
X3	Rear Surface of Vehicle to Firewall	4423	4193	230
X4	Rear Surface of Veh. to Upper Leading Edge of Right Door	4071	4046	25
X5	Rear Surface of Veh. to Upper Leading Edge of Left Door	4086	4046	40
X6	Rear Surface of Veh. to Lower Leading Edge of Right Door	4018	3989	29
X7	Rear Surface of Veh. to Lower Leading Edge of Left Door	4015	3985	30
X8	Rear Surface of Veh. to Upper Trailing Edge of Right Door	2945	2917	28
X9	Rear Surface of Veh. to Upper Trailing Edge of Left Door	2947	2911	36
X10	Rear Surface of Veh. to Lower Trailing Edge of Right Door	2917	2888	29
X11	Rear Surface of Veh. to Lower Trailing Edge of Left Door	2925	2892	33
X12	Rear Surface of Veh. to Bottom of " A " Post on Right Side	4083	4048	35
X13	Rear Surface of Veh. to Bottom of " A " Post on Left Side	4081	4042	39
X14	Rear Surface of Vehicle to Firewall--Right Side	4403	4318	85
X15	Rear Surface of Vehicle to Firewall --Left Side	4396	4315	81
X16	Rear Surface of Vehicle to Steering Wheel Center	3643	3538	105
X17	Center of Steering Column to " A " Post	307	304	3
X18	Center of Steering Column to Headliner	428	550	-122
X19	Rear Surface of Vehicle to Right Side of Front Bumper	5531	5182	349
X20	Rear Surface of Vehicle to Left Side of Front Bumper	5527	5082	445
X21	Length of Engine Block	610	610	0
RD	Rear Surface of Vehicle to Right Side of Dash Panel	3787	3745	42
CD	Rear Surface of Vehicle to Center of Dash Panel	3775	3600	175
LD	Rear Surface of Vehicle to Left Side of Dash Panel	3775	3638	137

All distance measurements are in millimeters.

Table 9 Vehicle Structural Measurements¹


	Elements	Pre-Test
1	Total Length	5635
2	Total Width	2010
3	Bumper Top Height	717
4	Bumper Bottom Height	497
5	Longitudinal Member Top Height	565
6	Longitudinal Member Bottom Height	447
7	Distance Between Longitudinal Members	900
7'	Longitudinal Member Width	120
8	Engine Top Height	1161
9	Engine Bottom Height	284
10	Engine and Gearbox Width	560
11	Front Bumper - Engine Distance	723
12	Front Shock Absorber Fixing Height	718
13	Bonnet Leading Edge Height	1051
14	Front Shock Absorber Fixing Width	890
15	Front Bumper - Front Axle Distance	1000
16	Front Axle - A Pillar Distance	590
17	A Pillar - B Pillar Distance	1170
18	B Pillar - Rear Axle Distance	1600
19	B Pillar - C Pillar Distance	940
20	Roof Sill Bottom Height	1684
21	Roof Sill Top Height	1768
22	Floor Sill Bottom Height	422
23	Floor Sill Top Height	514

All distance measurements are in millimeters.

¹ Taken from INSIA report, “Structural Survey of Cars, Methodology of the Main Resistant Elements in the Car Body”, March 1999. This report is included in Appendix E.

Figure 7 Vehicle Intrusion Measurements


Door Opening Width

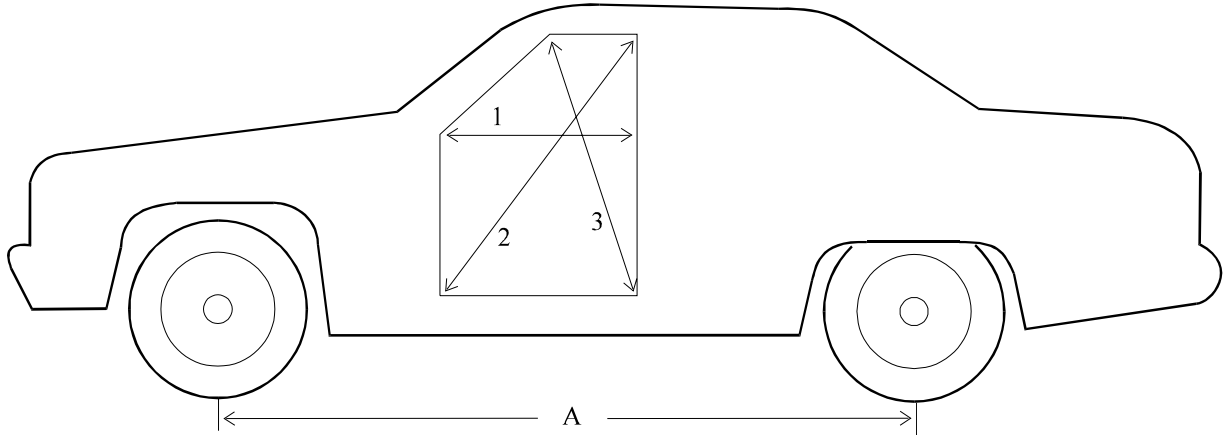

Units (mm)	Left			Right		
Measurement	1	2	3	1	2	3
Pre-Test	1130 mm	1585 mm	1272 mm	1135 mm	1575 mm	1274 mm
Post-Test	1083 mm	1560 mm	1345 mm	1112 mm	1558 mm	1308 mm
Difference	47 mm	25 mm	-73 mm	23 mm	17 mm	-34 mm

Units (mm)	A = Wheelbase Left	A = Wheelbase Right
Pre-Test	3310 mm	3310 mm
Post-Test	3223 mm	3220 mm
Difference	87 mm	90 mm

Figure 8 Vehicle Intrusion Measurements
Static Footwell Deformation

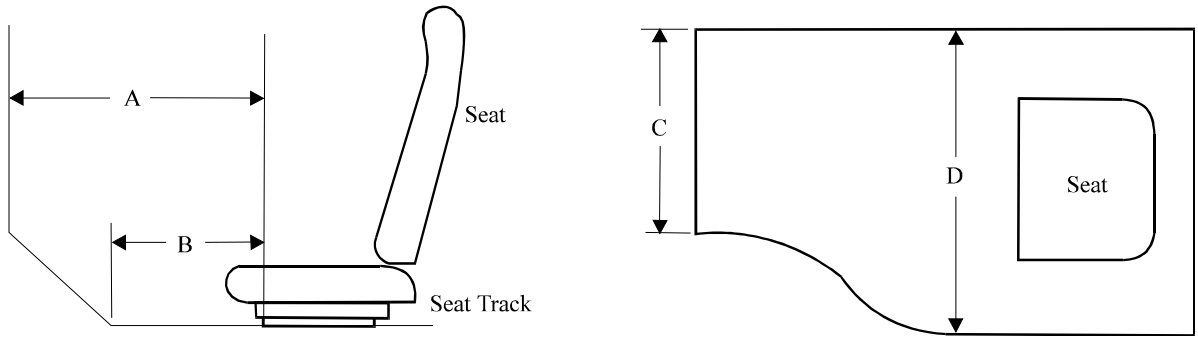


Driver's Side

Measurement	Pre-Test	Post-Test	Difference
A	755 mm	705 mm	50 mm
B	550 mm	550 mm	0 mm
C	355 mm	357 mm	-2 mm
D	445 mm	455 mm	-10 mm

Passenger's Side


Measurement	Pre-Test	Post-Test	Difference
A	710 mm	720 mm	-10 mm
B	527 mm	585 mm	-58 mm
C	358 mm	353 mm	5 mm
D	450 mm	450 mm	0 mm

Figure 9 Vehicle Intrusion Measurements
Static Passenger Compartment Intrusion

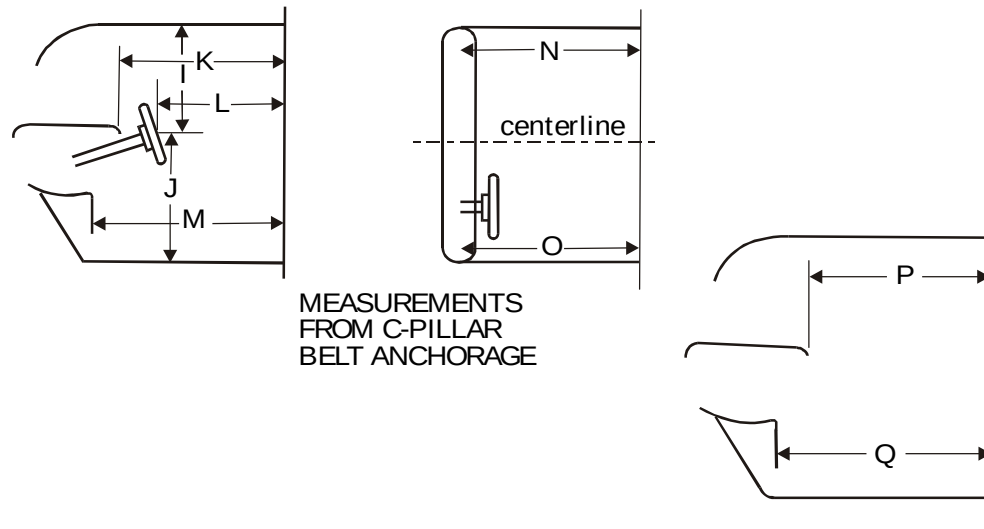

Measurement	Pre-Test	Post-Test	Difference
I	428 mm	550 mm	-122 mm
J	730 mm	760 mm	-30 mm
K (driver's side)	1761 mm	1633 mm	128 mm
L	1620 mm	1548 mm	72 mm
M (driver's side)	1963 mm	1914 mm	49 mm
N	1812 mm	1744 mm	68 mm
O	1835 mm	1667 mm	168 mm
P (passenger's side)	1785 mm	1753 mm	32 mm
Q (passenger's side)	1985 mm	1962 mm	23 mm


Figure 10 Floorboard Deformation

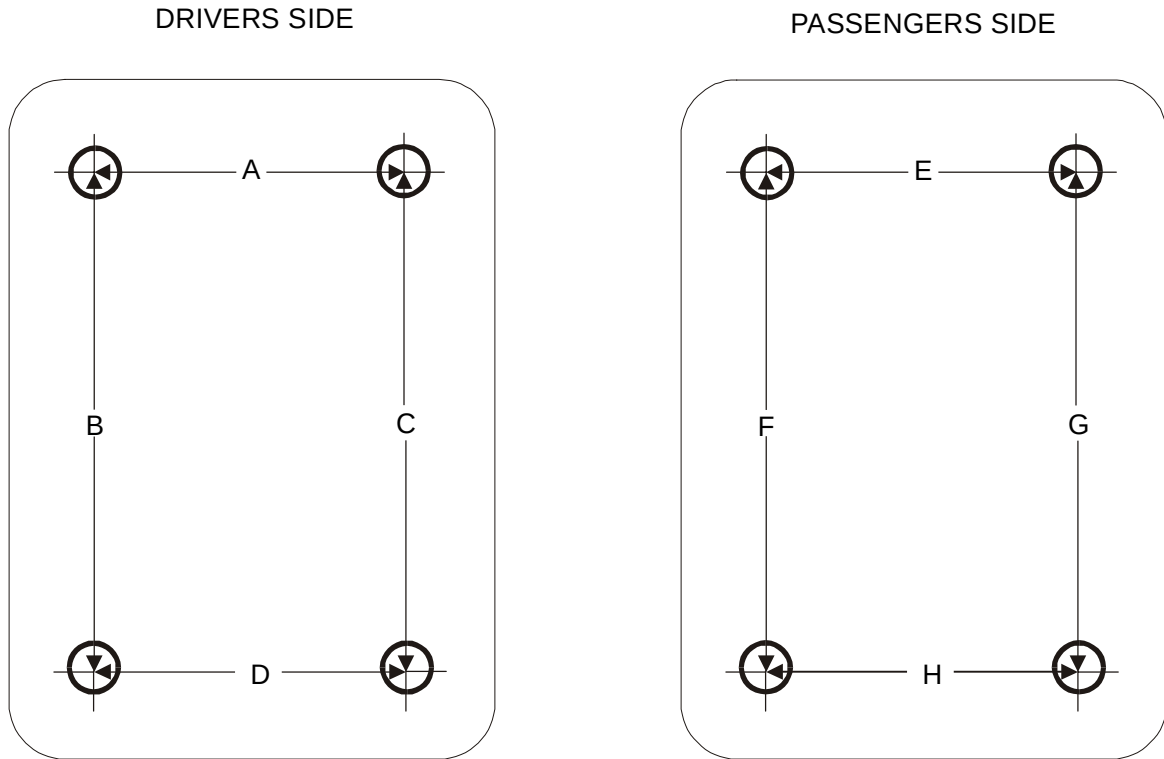


Measurement	Pre-Test	Post-Test	Difference
A	355 mm	357 mm	-2 mm
B	495 mm	499 mm	-4 mm
C	400 mm	403 mm	-3 mm
D	445 mm	455 mm	-10 mm
E	358 mm	353 mm	5 mm
F	490 mm	479 mm	11 mm
G	455 mm	447 mm	8 mm
H	450 mm	450 mm	0 mm

Figure 11 Toeboard Measurements

DRIVERS SIDE

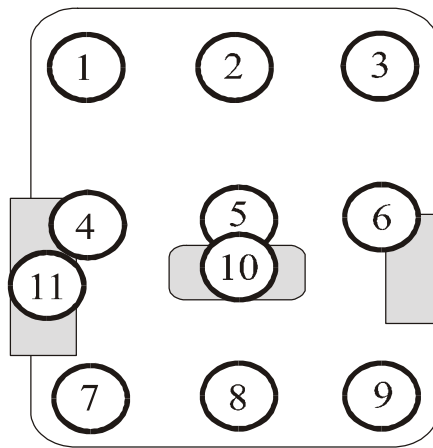

PASSENGERS SIDE

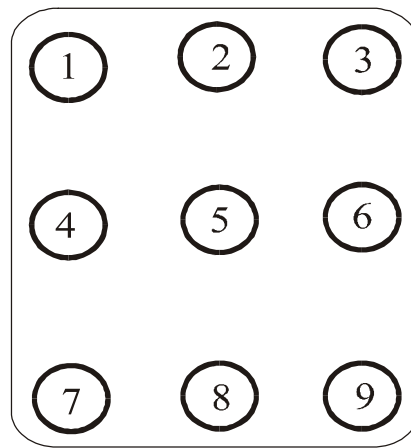

Pre-Test

Index	Xmm	Ymm	Zmm
1	4284	-569	-166
2	4334	-444	-144
3	4265	-309	-151
4	4228	-590	-78
5	4240	-448	-70
6	4190	-287	-90
7	4082	-617	7
8	4082	-443	5
9	4065	-264	5
10	4039	-459	-183
11	4128	-682	-60

Driver Toe Pan

Post-Test

Xmm	Ymm	Zmm
4163	-533	-235
4112	-429	-249
4092	-308	-223
4130	-564	-138
4090	-433	-129
4035	-284	-144
4052	-606	-14
4041	-431	-21
4016	-253	-33
3983	-429	-203
4071	-670	-102

Difference

Xmm	Ymm	Zmm
121	-36	69
222	-15	105
173	-1	72
98	-26	60
150	-15	59
155	-3	54
30	-11	21
41	-12	26
49	-11	38
56	-30	20
57	-12	42

Pre-Test

Index	Xmm	Ymm	Zmm
1	4230	384	-169
2	4243	538	-171
3	4227	736	-198
4	4156	391	-102
5	4159	545	-98
6	4160	740	-99
7	4044	396	-3
8	4043	556	-3
9	4042	752	1

Passenger Toe Pan

Post-Test

Xmm	Ymm	Zmm
4046	392	-240
4140	516	-216
4175	711	-241
4022	395	-142
4068	544	-136
4129	730	-131
4019	393	-40
4033	552	-24
4036	749	-27

Difference

Xmm	Ymm	Zmm
184	-8	71
103	22	45
52	25	43
134	-4	40
91	1	38
31	10	32
25	3	37
10	4	21
6	3	28

Reference: +X forward from rear bumper; +Y rightward from vehicle centerline; +Z downward from vehicle reference point

Table 10 Vehicle Intrusion of Upper Instrument Panel

Driver Instrument Panel - Lower

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
Left	3818	-582	-472	3741	-590	-481	77	8	9
Right	3811	-273	-481	3689	-286	-481	122	13	0

Driver Knees

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
Left	3803	-578	-495	3722	-589	-502	81	11	7
Right	3807	-305	-489	3688	-317	-490	119	12	1

Passenger Knees

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
Left	3789	389	-510	3729	411	-536	60	-22	26
Right	3795	562	-502	3755	581	-529	40	-19	27

Steering Column

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	3573	-446	-721	3509	-459	-697	64	13	-24

Driver Front Outboard Seat Attachment Bolt

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	3472	-695	-69	3466	-694	-55	6	-1	-14

Passenger Front Outboard Seat Attachment Bolt

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	3472	666	-76	3470	662	-80	2	4	4

Knee intrusions are points measured pre and post, which are located just above where the four knees would be expected to contact the instrument panel.

+X: Forward from rear bumper

+Y: Rightward from centerline

+Z: Downward from vehicle reference point

Table 11 Frontal Profile Measurements

Bottom of Front Bumper

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	5517	-760	-585	5085	-770	-681	432	10	96
2	5606	-460	-604	5179	-473	-689	427	13	85
3	5596	-160	-575	5195	-165	-635	401	5	60
4	5595	-160	-575	5215	-147	-615	380	-13	40
5	5593	-467	-603	5240	-454	-621	353	-13	18
6	5521	-768	-592	5196	-753	-582	325	-15	-10

Top of Front Bumper

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	5527	-767	-700	5082	-760	-800	445	-7	100
2	5596	-465	-694	5115	-460	-780	481	-5	86
3	5625	-153	-695	5205	-150	-759	420	-3	64
4	5625	-152	-690	5231	-153	-732	394	1	42
5	5604	-459	-697	5226	-460	-715	378	1	18
6	5531	-762	-700	5182	-763	-690	349	1	-10

Center of Grill

Pre-Test				Post-Test			Difference		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	5432	-730	-940	4890	-738	-1054	542	8	114
2	5508	-450	-927	4923	-450	-1035	585	0	108
3	5540	-150	-932	4940	-152	-1043	600	2	111
4	5537	-150	-935	4945	-147	-1045	592	-3	110
5	5518	-467	-940	4925	-465	-1050	593	-2	110
6	5428	-775	-949	4876	-773	-1085	552	-2	136

Front of Hood

Pre-Test				Post-Test			Difference ¹		
Index	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm	Xmm	Ymm	Zmm
1	5337	-722	-1069	4921	-710	-1285	416	-12	216
2	5456	-445	-1054	4850	-450	-1199	606	5	145
3	5485	-144	-1061	4870	-150	-1165	615	6	104
4	5485	-150	-1065	4865	-150	-1165	620	0	100
5	5466	-469	-1051	4845	-462	-1180	621	-7	129
6	5319	-774	-1090	4961	-739	-1318	358	-35	228

¹ The difference for point 6, measured to the Top of Hood, is included in the NHTSA Database Submission as Damage Profile Distance 6.

Table 12 Additional Requested Measurements

Type of measurement	
Height of the lowest edge of the bottom row of load cells	130 mm
Height of lowest structure on test vehicle	315 mm
Mid-hood height of test vehicle	1220 mm
Height of test vehicle hood 2 feet rearward of front bumper	1228 mm

Vertical impact point deviation - Vehicle 2 mm low at impact

Table 13 Dummy Measurement Data For Front Seat Occupants

Designation	Type of Measurement	Driver (Serial # 416)	Passenger (Serial # 048)
WA	Windshield angle	39.2°	N/A
SWA	Steering wheel angle	21.1°	N/A
SCA	Steering column angle	68.9°	N/A
SA ¹	Seat back angle	6.8°	4.8°
HZ	Head to roof	350 mm	330 mm
HH	Head to header	472 mm	435 mm
HW	Head to windshield	710 mm	705 mm
HR	Head to side header	330 mm	320 mm
NR	Nose to rim	275 mm	N/A
NA	Nose to rim angle	0.4°	N/A
CD	Chest to dash	480 mm	350 mm
CS	Steering wheel to chest	210 mm	N/A
RA	Rim to abdomen	95 mm	N/A
KDL	Left knee to dash	100 mm	100 mm
KDR	Right knee to dash	90 mm	105 mm
KDA	Outboard knee to dash angle	26.1°	38.3°
PA	Pelvic angle	21.9°	20.0°
TA	Tibia angle	61.6°	58.8°
KK	Knee to knee	200 mm	170 mm
ST ²	Striker to head	610 mm	617 mm
	Striker to head angle	-57.2°	-58.2°
SK ²	Striker to knee	780 mm	780 mm
	Striker to knee angle	2.0°	2.9°
SH ²	Striker to H-point	460 mm	455 mm
	Striker to H-point angle	6.0°	2.9°
SHY	Striker to H-point (Y dir.)	280 mm	285 mm
HS	Head to side window	365 mm	350 mm
HD	H-point to door	220 mm	190 mm
AD	Arm to door	170 mm	130 mm

The seat back angle (SA°) is measured relative to vertical, all other angles are measured relative to horizontal.

¹ Measured at the head restraint support post.

² A negative angle indicates the measurement point was above the striker.


Table 13 Dummy Measurement Data for Front Seat Occupants, Cont'd.

Designation	Type of Measurement	Rear Passenger (Serial #070)
WA	Windshield angle	N/A
SWA	Steering wheel angle	N/A
SCA	Steering column angle	N/A
SA	Seat back angle	9.9°
HZ	Head to roof	305 mm
HH	Head to header	N/A
HW	Head to windshield	N/A
HR	Head to side header	335 mm
NR	Nose to rim	N/A
NA	Nose to rim angle	N/A
CD	Chest to dash	N/A
CS	Steering wheel to chest	N/A
RA	Rim to abdomen	N/A
KDL	Left knee to seat back	380 mm
KDR	Right knee to seat back	400 mm
KDA	Outboard knee to dash angle	19.5°
PA	Pelvic angle	21.5°
TA	Tibia angle	81.7°
KK	Knee to knee	170 mm
ST	Striker to head	605 mm
	Striker to head angle ¹	-74.5°
SK	Striker to knee	665 mm
	Striker to knee angle ¹	9.1°
SH	Striker to H-point	330 mm
	Striker to H-point angle ¹	6.3°
SHY	Striker to H-point (Y dir.)	310 mm
HS	Head to side window	360 mm
HD	H-point to door	210 mm
AD	Arm to door	145 mm

The seat back angle (SA°) is measured relative to vertical, all other angles are measured relative to horizontal.


¹ A negative angle indicates that the measurement point was located above the striker.

Figure 12 Seat Belt Positioning Data

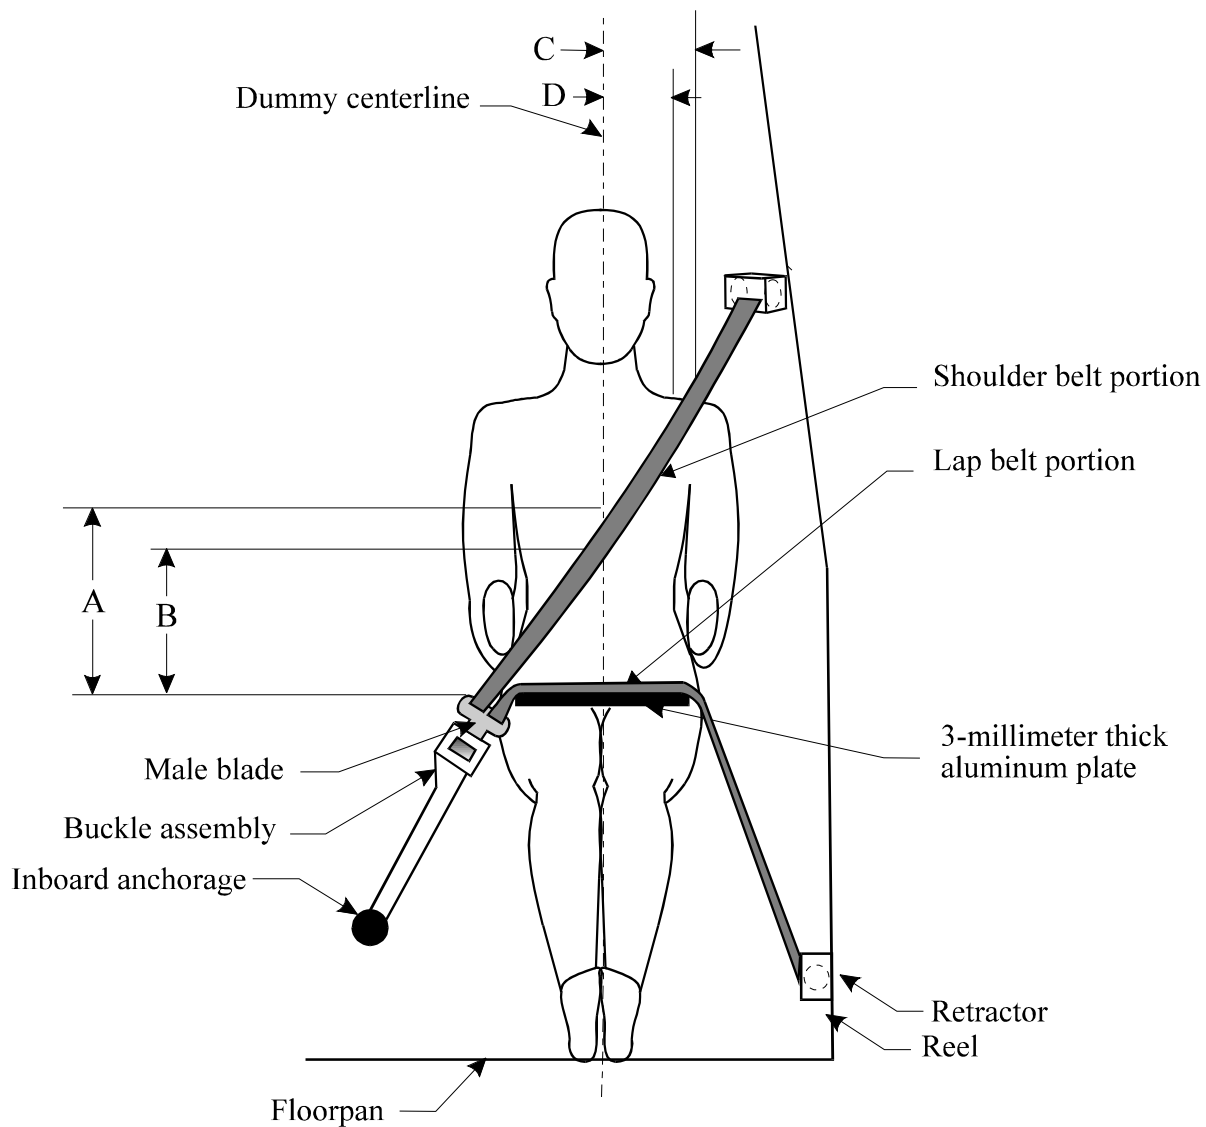

	Driver Dummy	Front Passenger Dummy
A - Top surface of aluminum plate to belt upper edge	270 mm	280 mm
B - Top surface of aluminum plate to belt lower edge	195 mm	200 mm
C - Dummy centerline to outer edge of belt at chest flesh top	130 mm	150 mm
D - Dummy centerline to inner edge of belt at chest flesh top	70 mm	90 mm

Figure 12 Seat Belt Positioning Data, Cont'd.

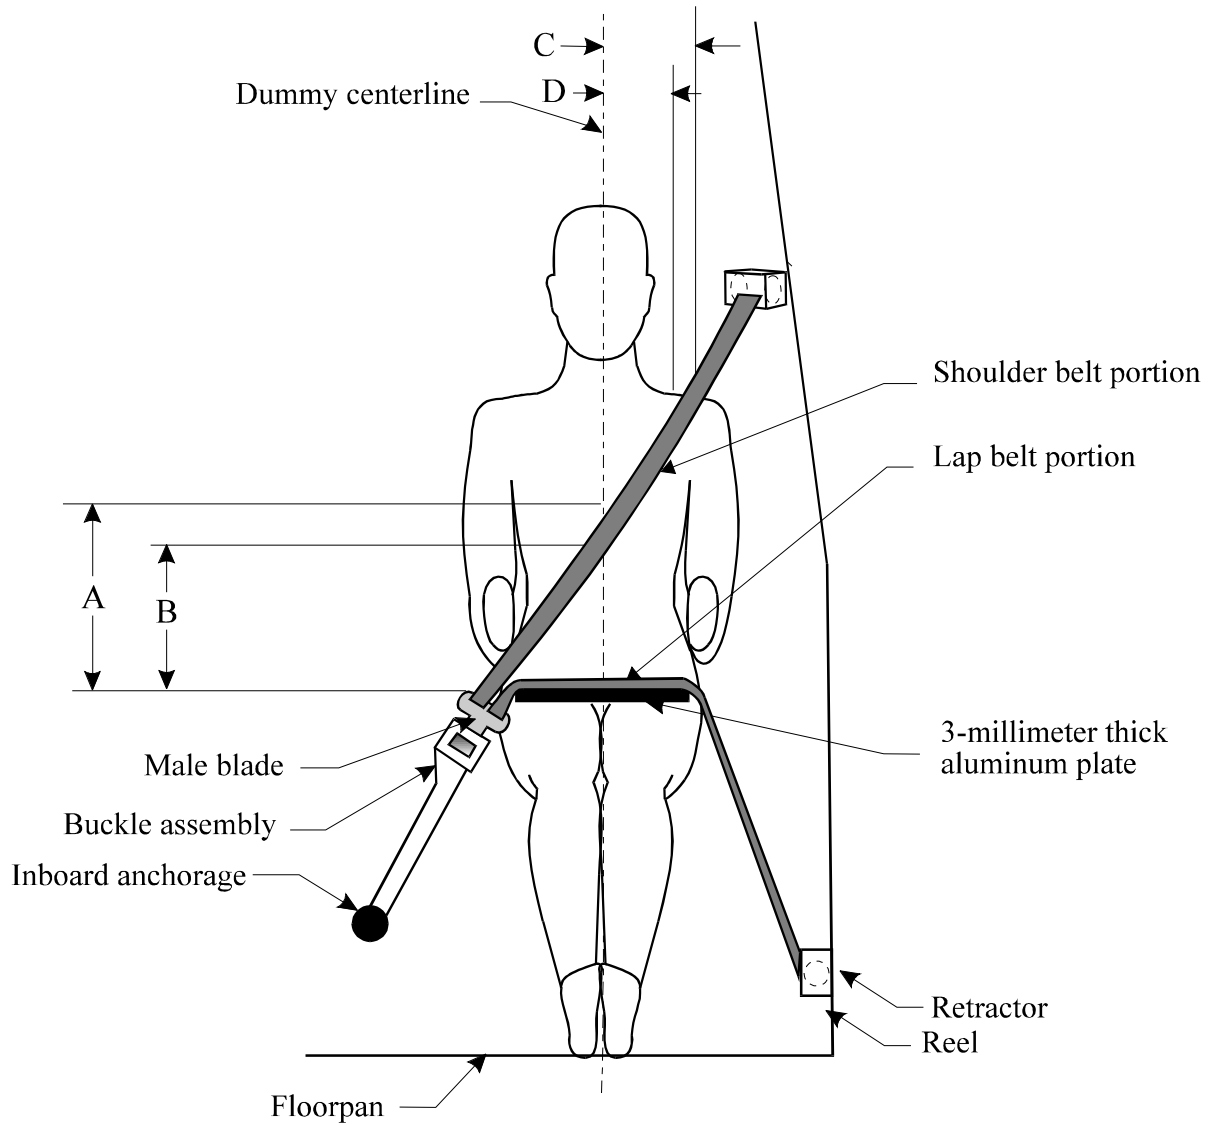

	Rear Passenger Dummy
A - Top surface of aluminum plate to belt upper edge	270 mm
B - Top surface of aluminum plate to belt lower edge	200 mm
C - Dummy centerline to outer edge of belt at chest flesh top	160 mm
D - Dummy centerline to inner edge of belt at chest flesh top	100 mm

Figure 13 Camera Positions

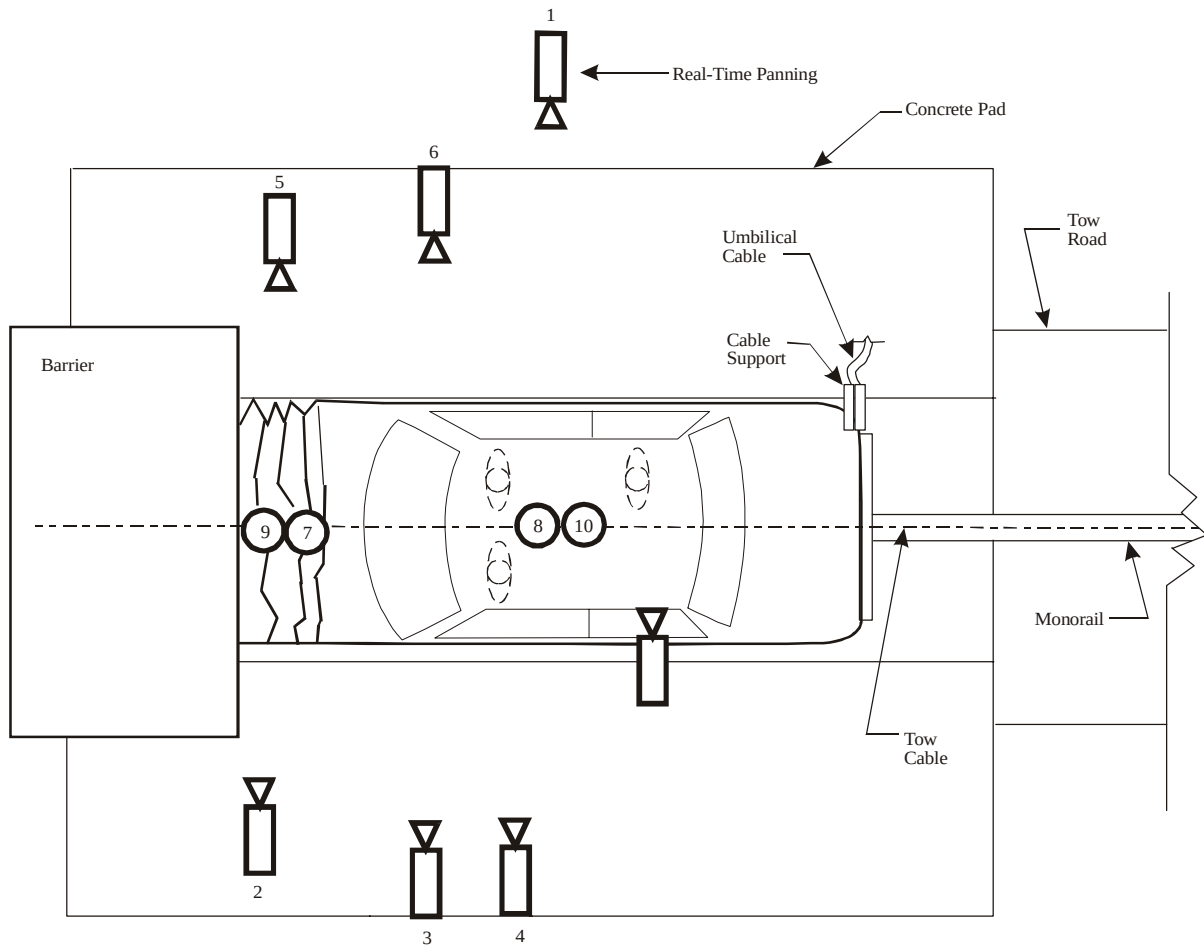


Table 14 Camera Information

Camera Number	Location	Type	Lens (mm)	Speed (frames/s)	Purpose of Camera Data
1	Panning			30	Vehicle dynamics
2	Left side barrier face	Visario	50	1000	Vehicle crush
3	Left side perpendicular	Visario	25	1000	Vehicle dynamics
4	Left side	Redlake	Zoom	1000	Dummy kinematics
5	Right side barrier face	Visario	50	1000	Vehicle crush
6	Right side perpendicular	Visario	20	1000	Vehicle dynamics
7	Overhead tight	Visario	50	1000	Vehicle crush
8	Overhead wide	Visario	12.5	1000	Vehicle crush
9	Underbody tight	Redlake	17	1000	Vehicle crush
10	Underbody wide	Redlake	7.5	1000	Vehicle crush
11	Left view of rear passenger	Redlake	8	1000	Dummy kinematics

Appendix A

Photographs



Figure A-1 Pre-Test Front View



Figure A-2 Post-Test Front View



Figure A-3 Pre-Test Left Front View



Figure A-4 Post-Test Left Front View



Figure A-5 Pre-Test Left Side View



Figure A-6 Post-Test Left Side View



Figure A-7 Pre-Test Right Rear View



Figure A-8 Post-Test Right Rear View



Figure A-9 Pre-Test Right Side View



Figure A-10 Post-Test Right Side View



Figure A-11 Pre-Test Overhead View



Figure A-12 Post-Test Overhead View



Figure A-13 Post-Test Overhead Close-up View

Intentionally Left Blank



Figure A-14 Pre-Test Front Underbody View

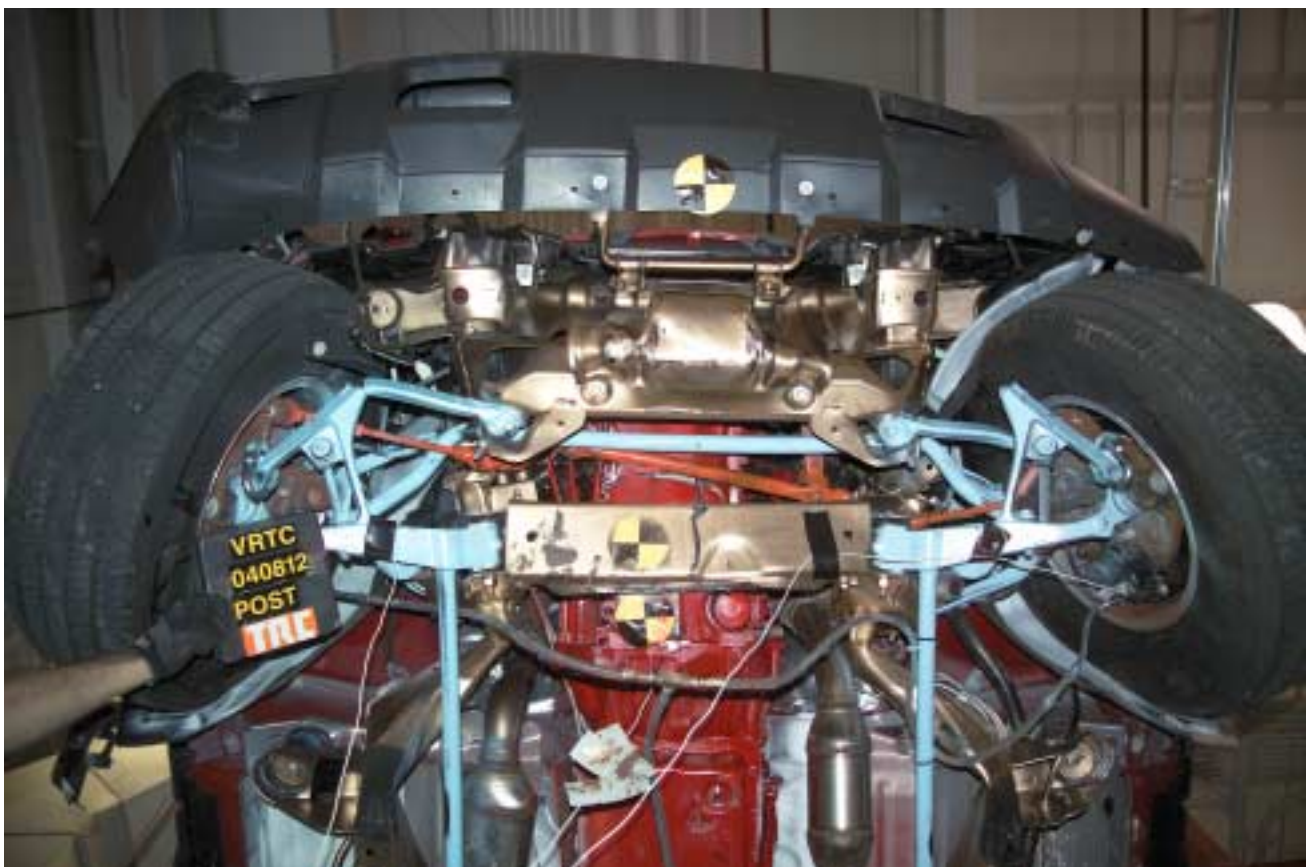


Figure A-15 Post-Test Front Underbody View



Figure A-16 Pre-Test Front Mid Underbody View



Figure A-17 Post-Test Front Mid Underbody View



Figure A-18 Pre-Test Mid Underbody View



Figure A-19 Post-Test Mid Underbody View



Figure A-20 Pre-Test Rear Mid Underbody View



Figure A-21 Post-Test Rear Mid Underbody View



Figure A-22 Pre-Test Rear Underbody View



Figure A-23 Post-Test Rear Underbody View



Figure A-24 Pre-Test Fuel Tank View



Figure A-25 Post-Test Fuel Tank View



Figure A-26 Pre-Test Fuel Filler Neck View



Figure A-27 Post-Test Fuel Filler Neck - View 1



Figure A-28 Post-Test Fuel Filler Neck - View 2



Figure A-29 Post-Test Fuel Filler Neck - View 3



Figure A-30 Pre-Test Fuel Filler Cap View



Figure A-31 Post-Test Fuel Filler Cap View



Figure A-32 Pre-Test Engine Compartment View



Figure A-33 Post-Test Engine Compartment View



Figure A-34 Pre-Test Windshield View



Figure A-35 Post-Test Windshield View



Figure A-36 Pre-Test Driver and Passenger Dummies Front View



Figure A-37 Post-Test Driver and Passenger Dummies Front View



Figure A-38 Pre-Test Driver Dummy Position - View 1



Figure A-39 Post-Test Driver Dummy Position - View 1



Figure A-40 Pre-Test Driver Dummy Position - View 2



Figure A-41 Post-Test Driver Dummy Position - View 2



Figure A-42 Pre-Test Driver Dummy Position - View 3



Figure A-43 Pre-Test Driver Dummy Position - View 4



Figure A-44 Post-Test Driver Dummy Head Contact View



Figure A-45 Post-Test Driver Dummy Knee Contact View

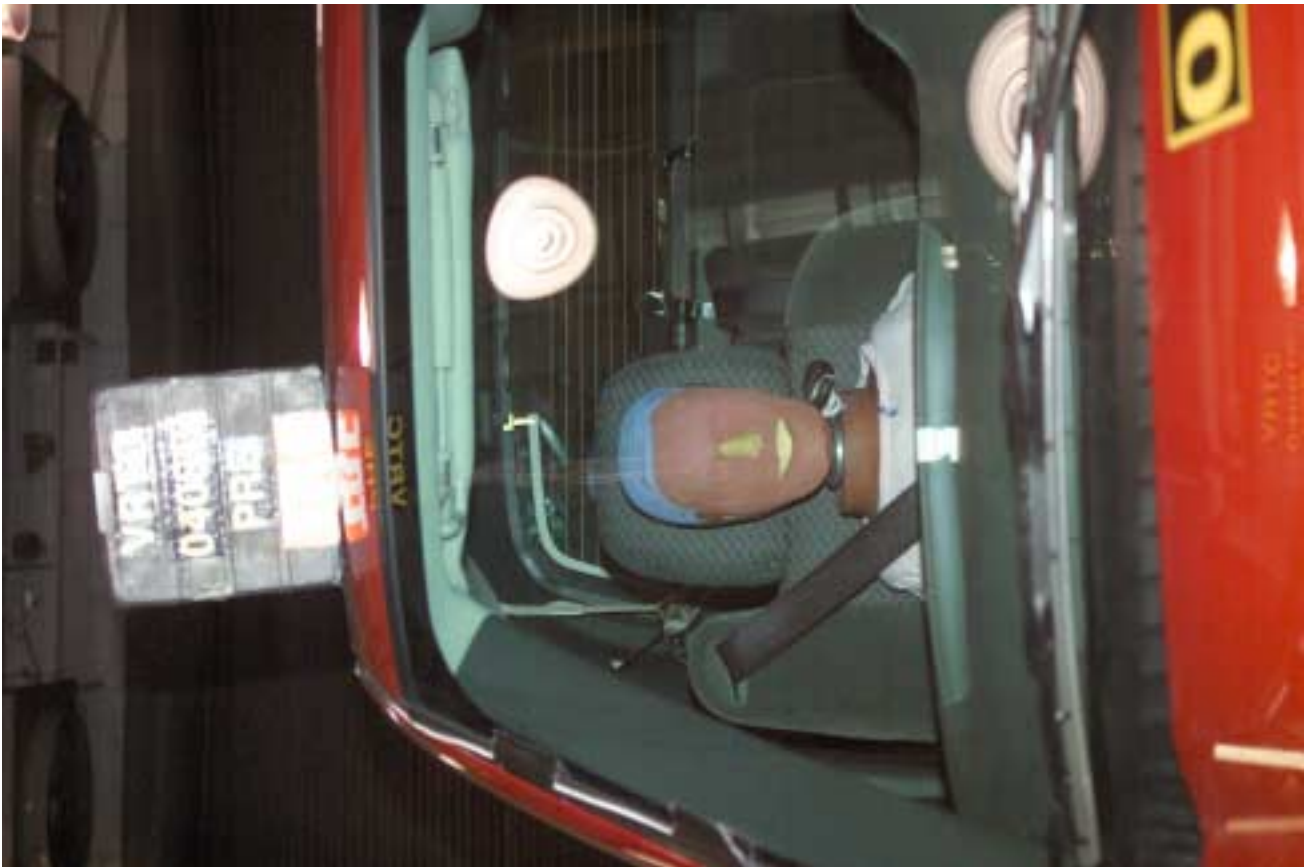


Figure A-46 Pre-Test Front Passenger Dummy Position - View 1



Figure A-47 Post-Test Front Passenger Dummy Position - View 1



Figure A-48 Pre-Test Front Passenger Dummy Position - View 2



Figure A-49 Post-Test Front Passenger Dummy Position - View 2



Figure A-50 Pre-Test Front Passenger Dummy Position - View 3



Figure A-51 Post-Test Front Passenger Dummy Position - View 3



Figure A-52 Pre-Test Front Passenger Dummy Position - View 4



Figure A-53 Post-Test Front Passenger Dummy Position - View 4

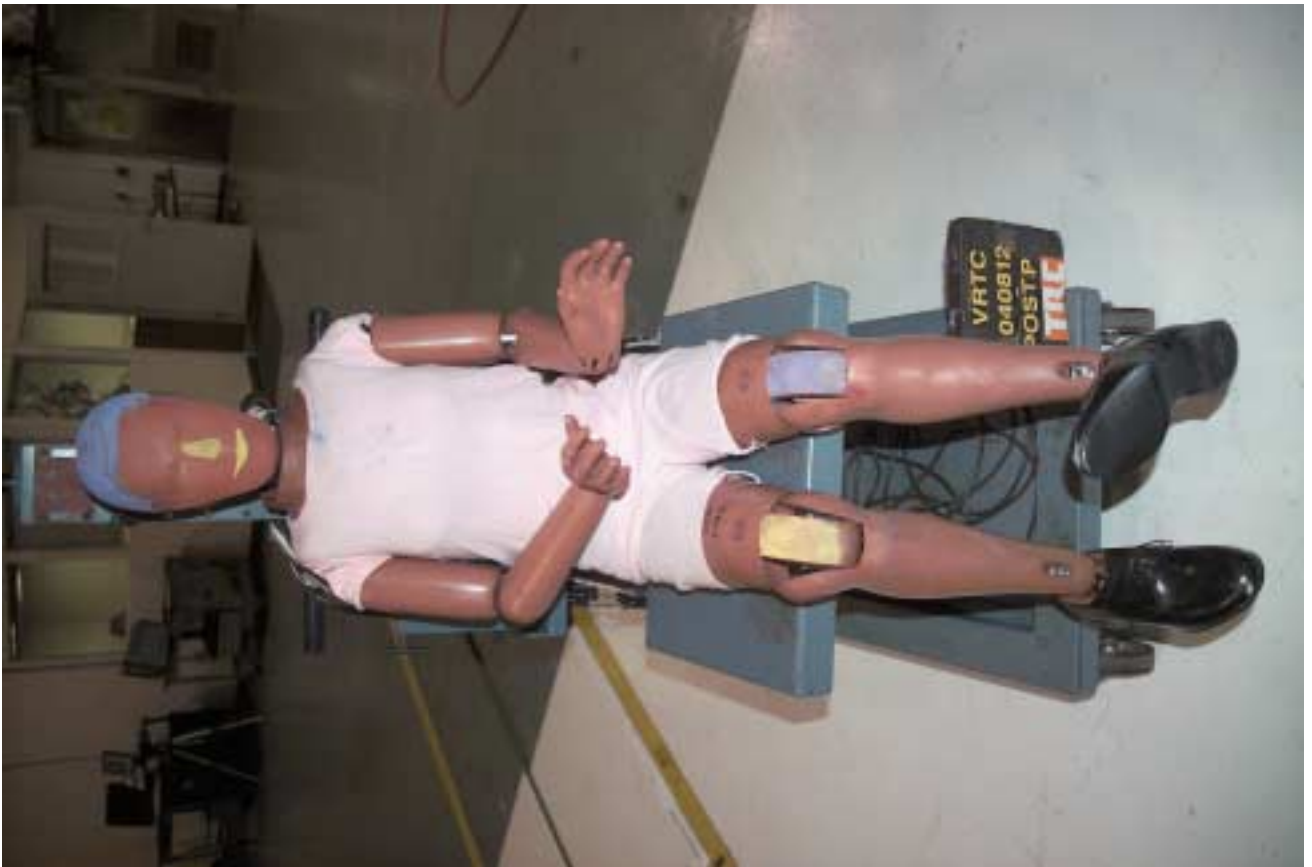


Figure A-54 Post-Test Front Passenger Dummy Overall View



Figure A-55 Post-Test Front Passenger Dummy Head Contact - View 1



Figure A-56 Post-Test Front Passenger Dummy Head Contact - View 2

Intentionally Left Blank



Figure A-57 Post-Test Front Passenger Dummy Knee Contact - View 1



Figure A-58 Post-Test Front Passenger Dummy Knee Contact - View 2



Figure A-59 Pre-Test Rear Passenger Dummy - View 1



Figure A-60 Post-Test Rear Passenger Dummy - View 1



Figure A-61 Pre-Test Rear Passenger Dummy - View 2



Figure A-62 Post-Test Rear Passenger Dummy - View 2



Figure A-63 Pre-Test Rear Passenger Dummy - View 3



Figure A-64 Post-Test Rear Passenger Dummy - View 3



Figure A-65 Post-Test Rear Passenger Dummy Overall View



Figure A-66 Post-Test Rear Passenger Dummy Head Contact - View 1



Figure A-67 Post-Test Rear Passenger Dummy Head Contact - View 2



Figure A-68 Post-Test Rear Passenger Dummy Knee Contact View



Figure A-69 Vehicle Certification and Tire Load Label View

Intentionally Left Blank



Figure A-70 Pre-Test Barrier View



Figure A-71 Post-Test Barrier View

Appendix B

Data Plots



Transportation Research Center, Inc.

Head Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDXG1

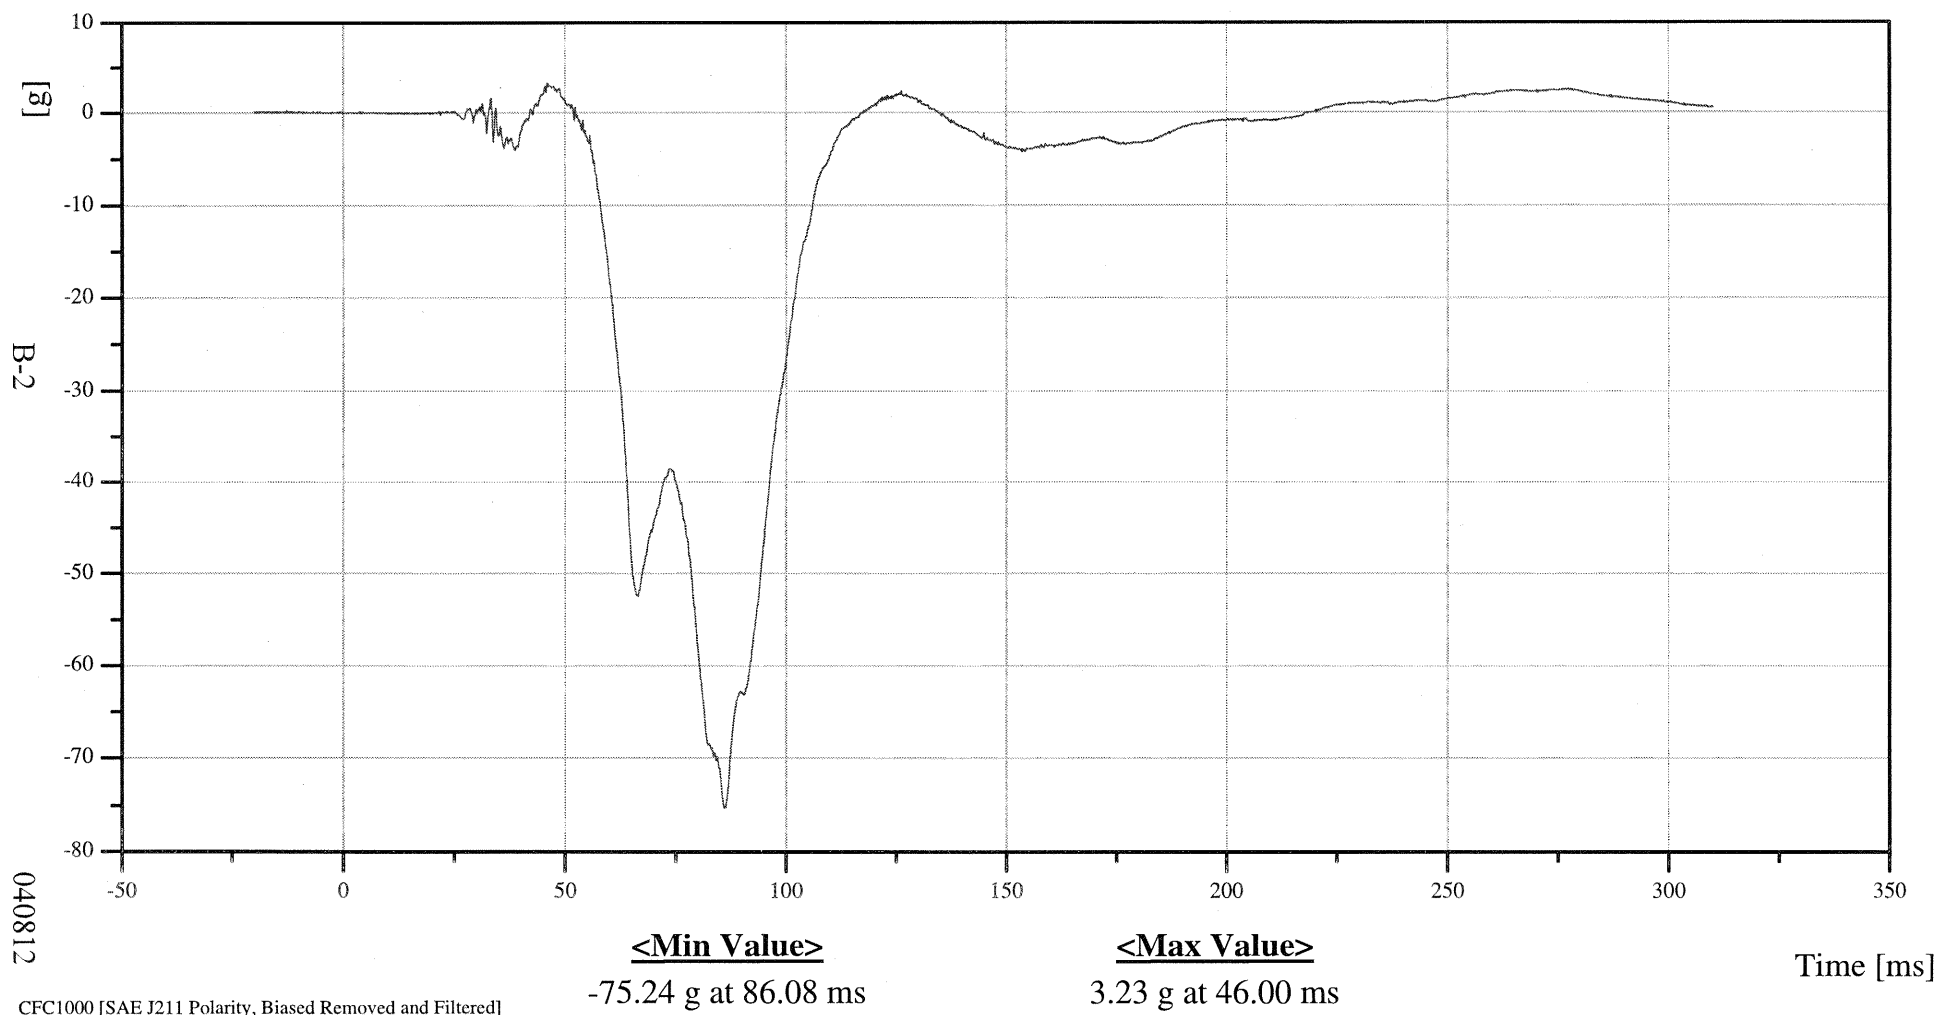



Transportation Research Center, Inc.

Head Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDYG1

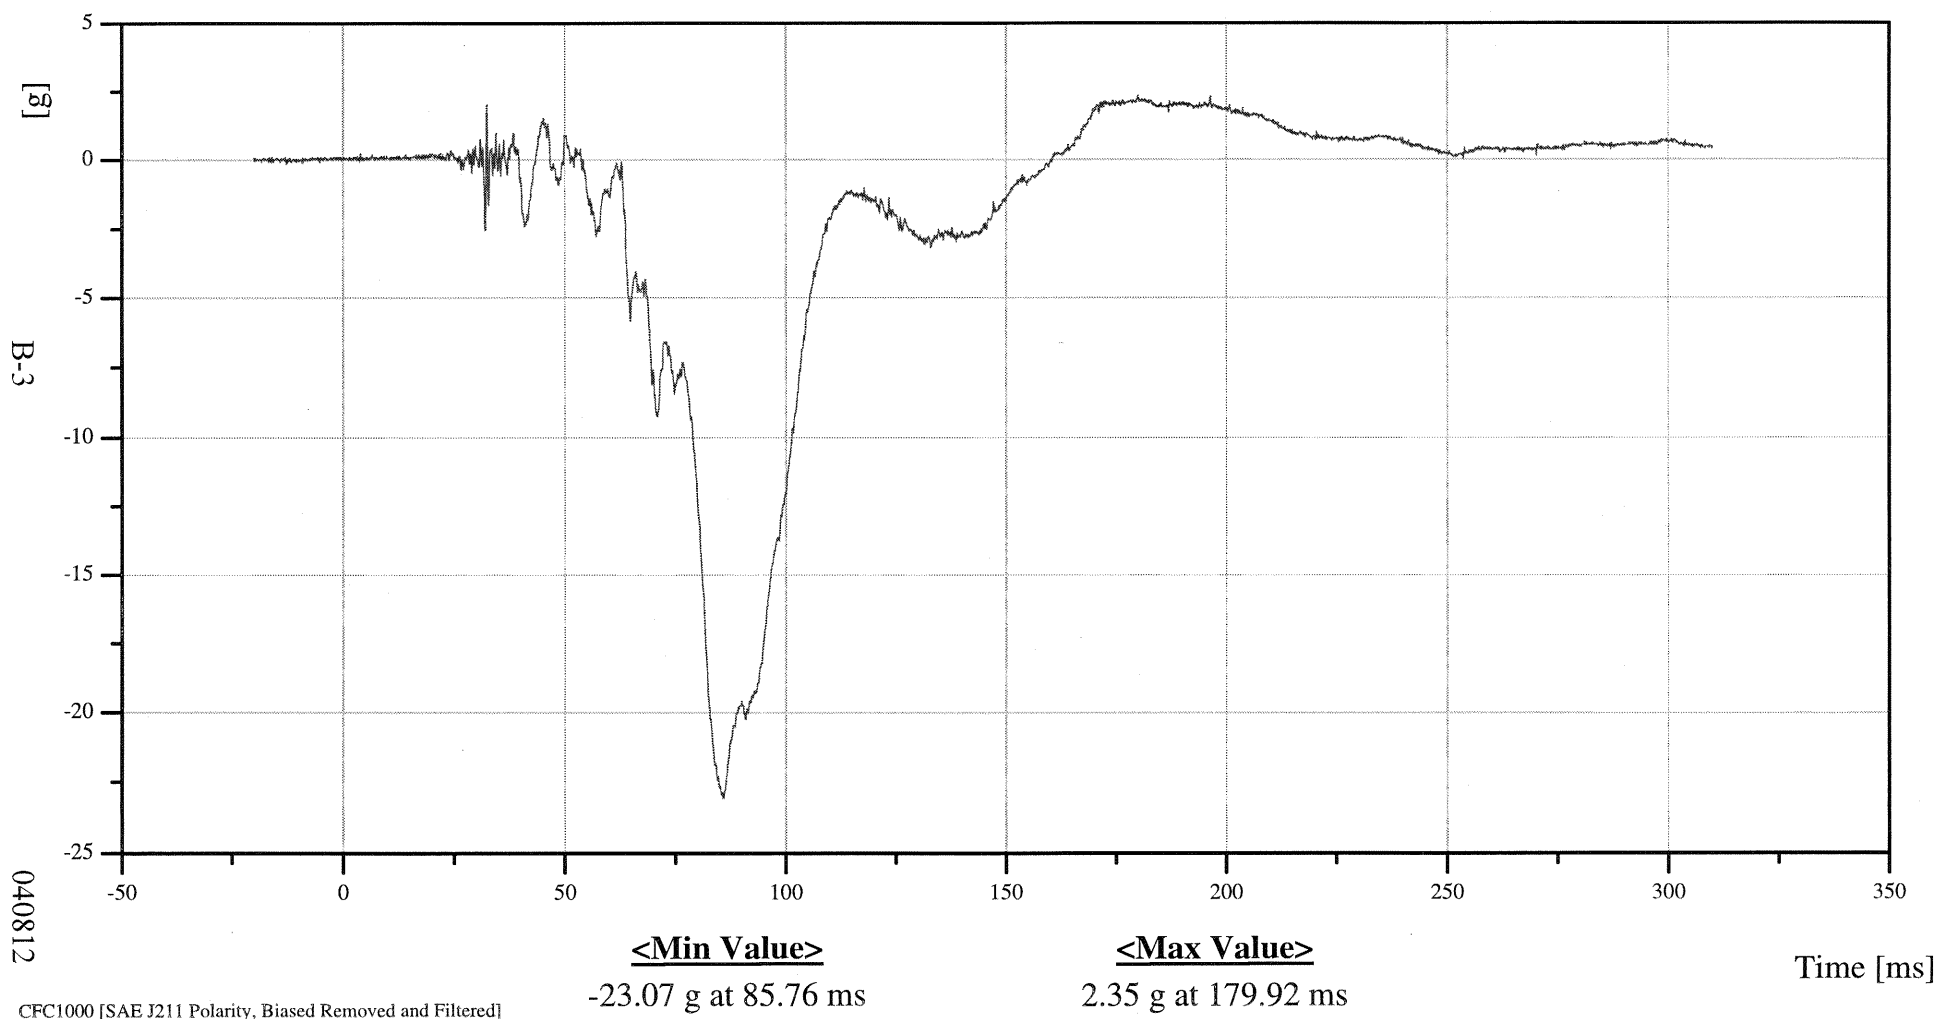



Transportation Research Center, Inc.

Head Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDZG1

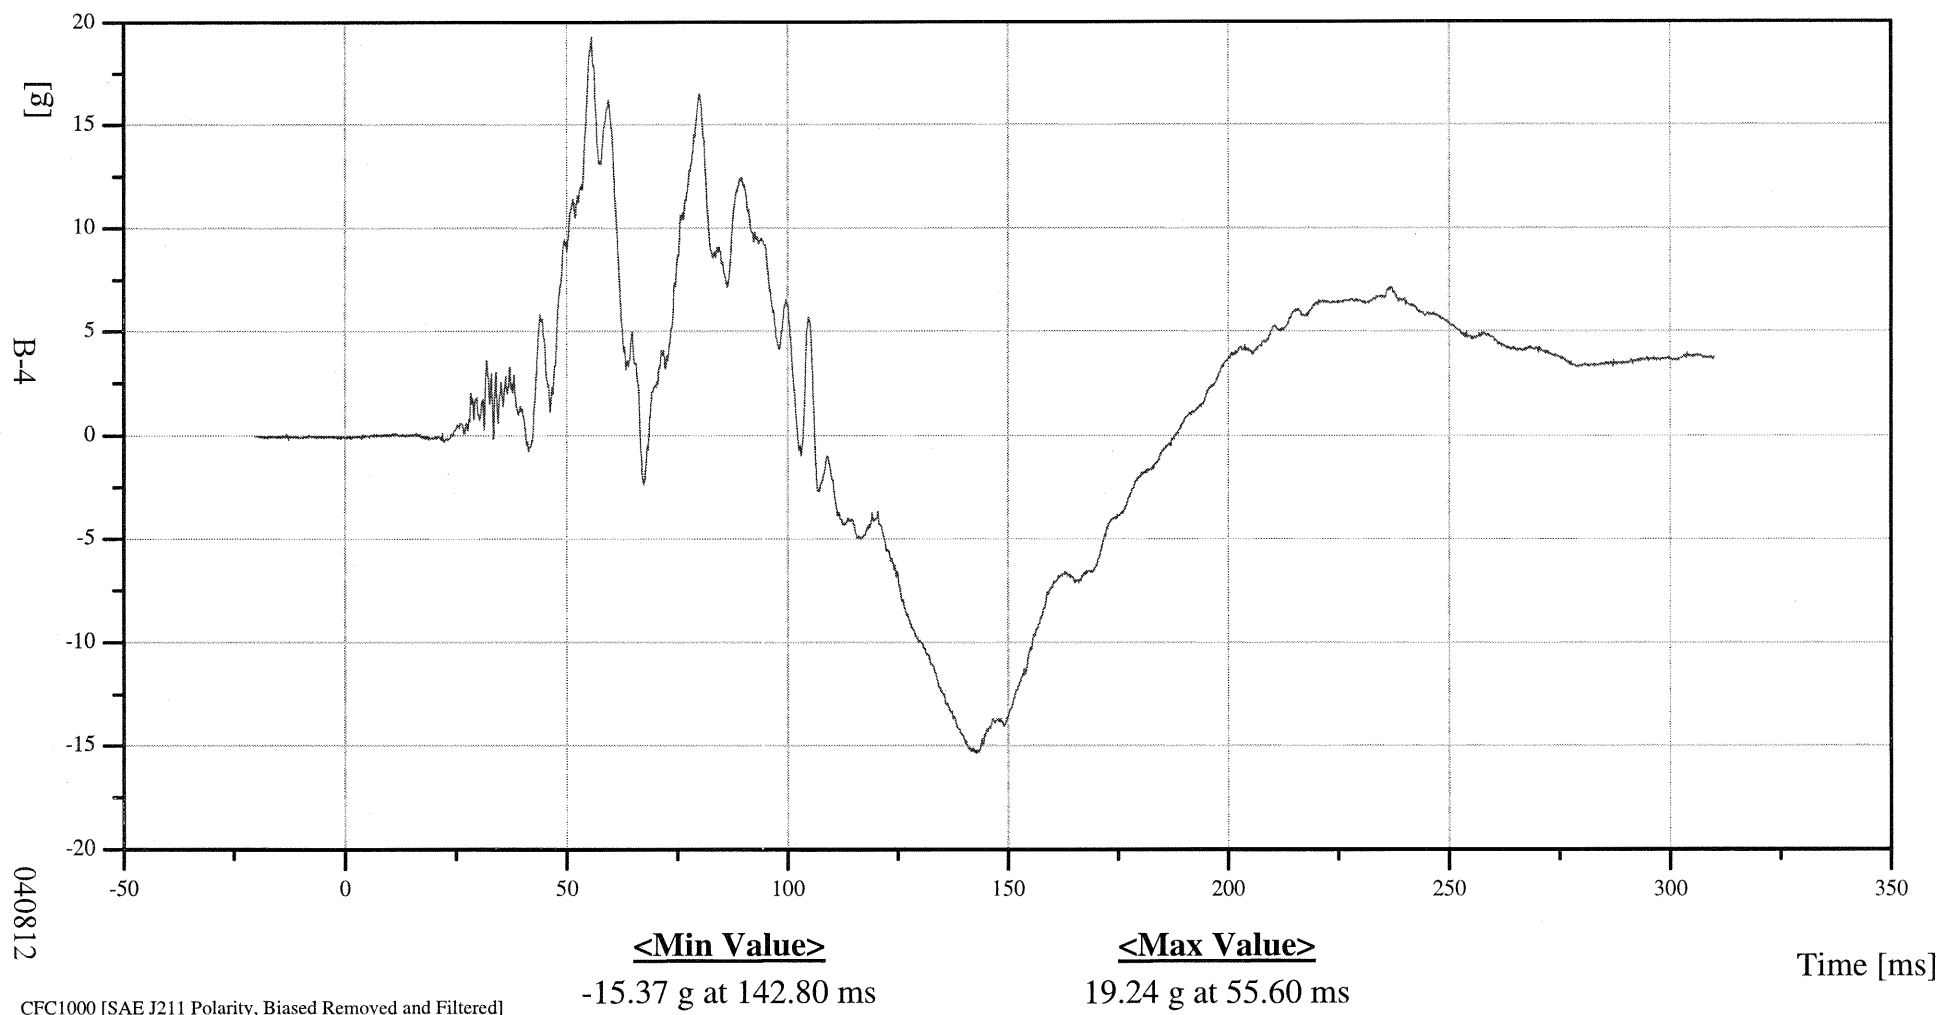



Transportation Research Center, Inc.

Head Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDRG1

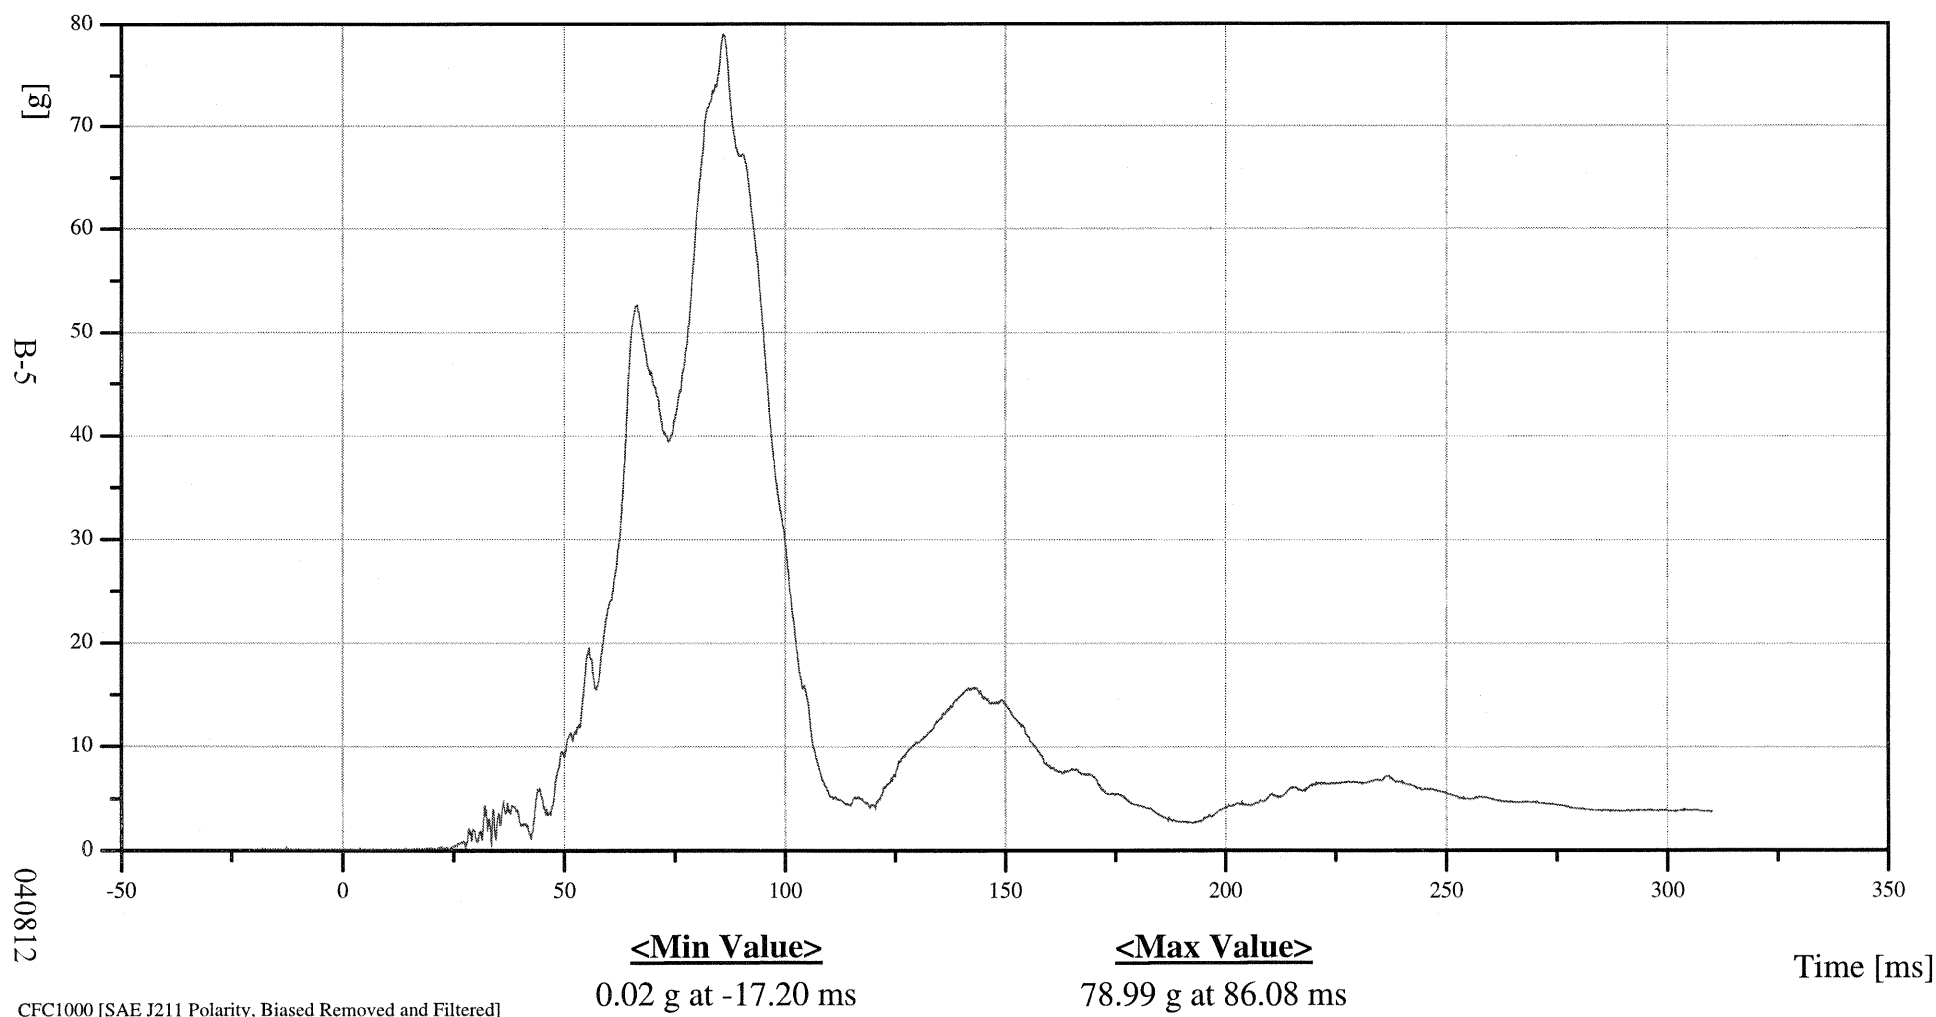



Transportation Research Center, Inc.

Head Accel Red X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDXR1

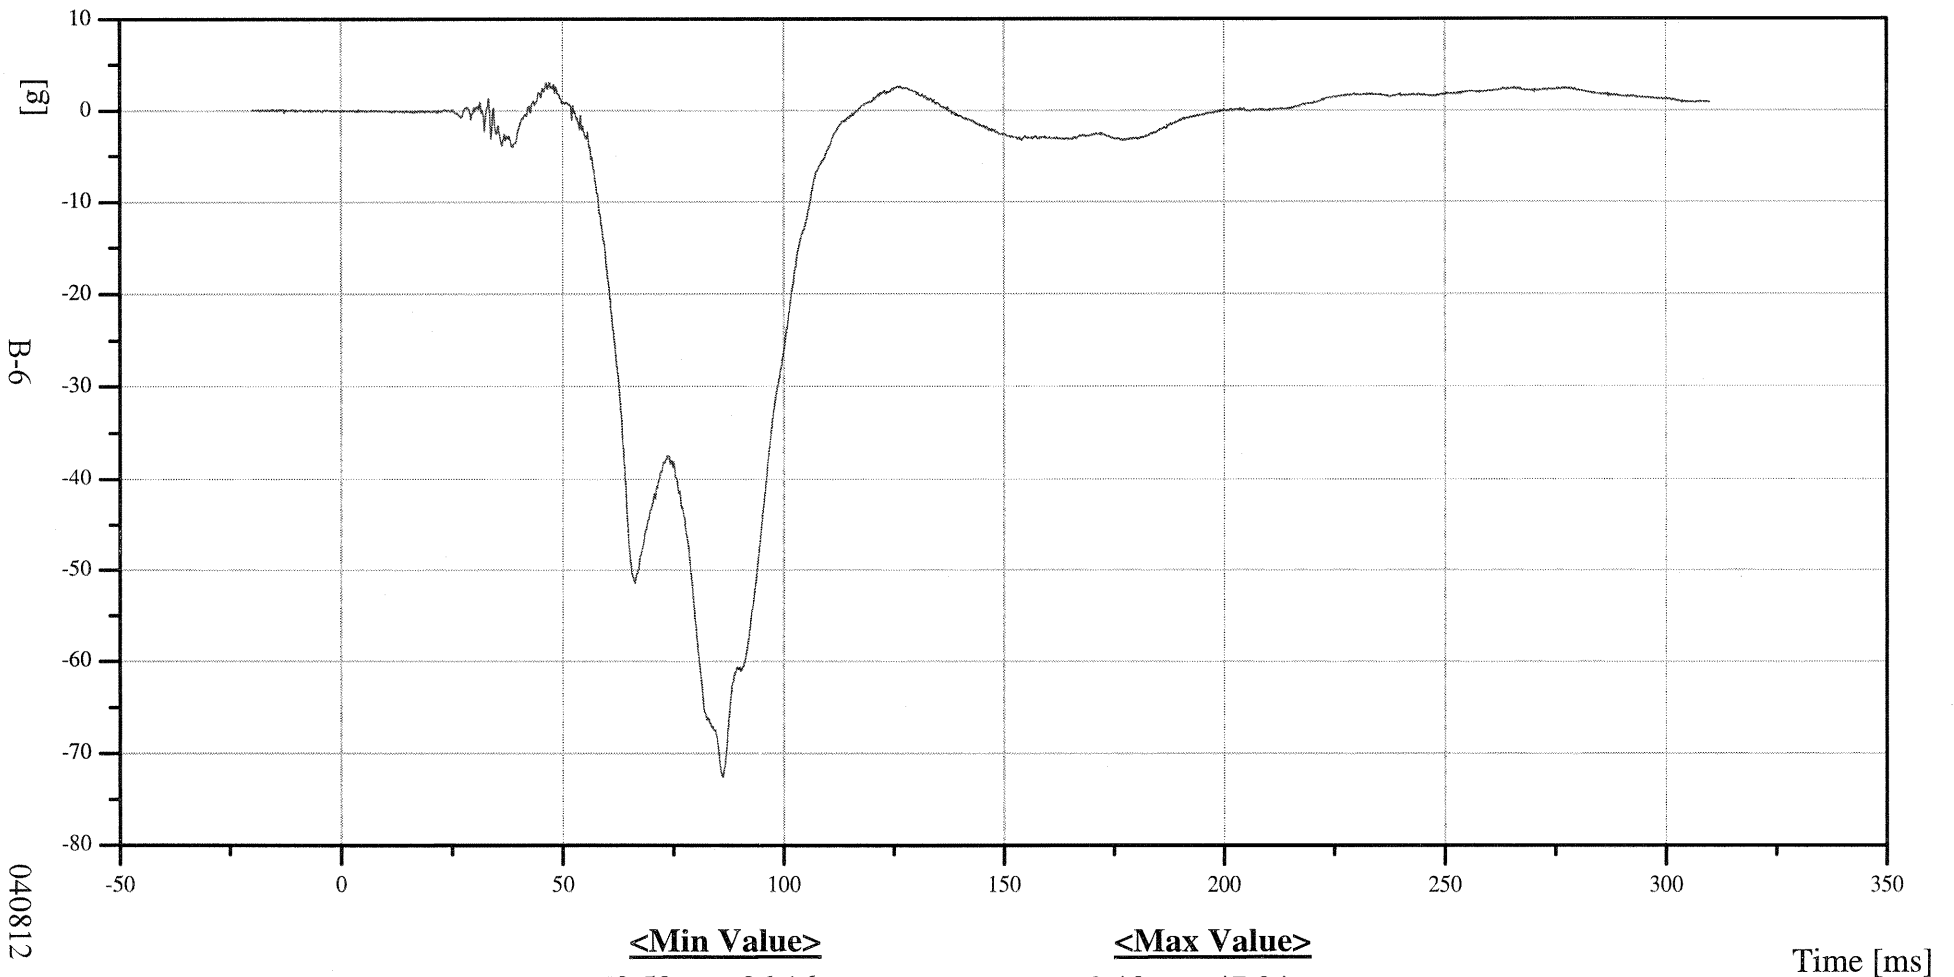

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Head Accel Red Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDYR1

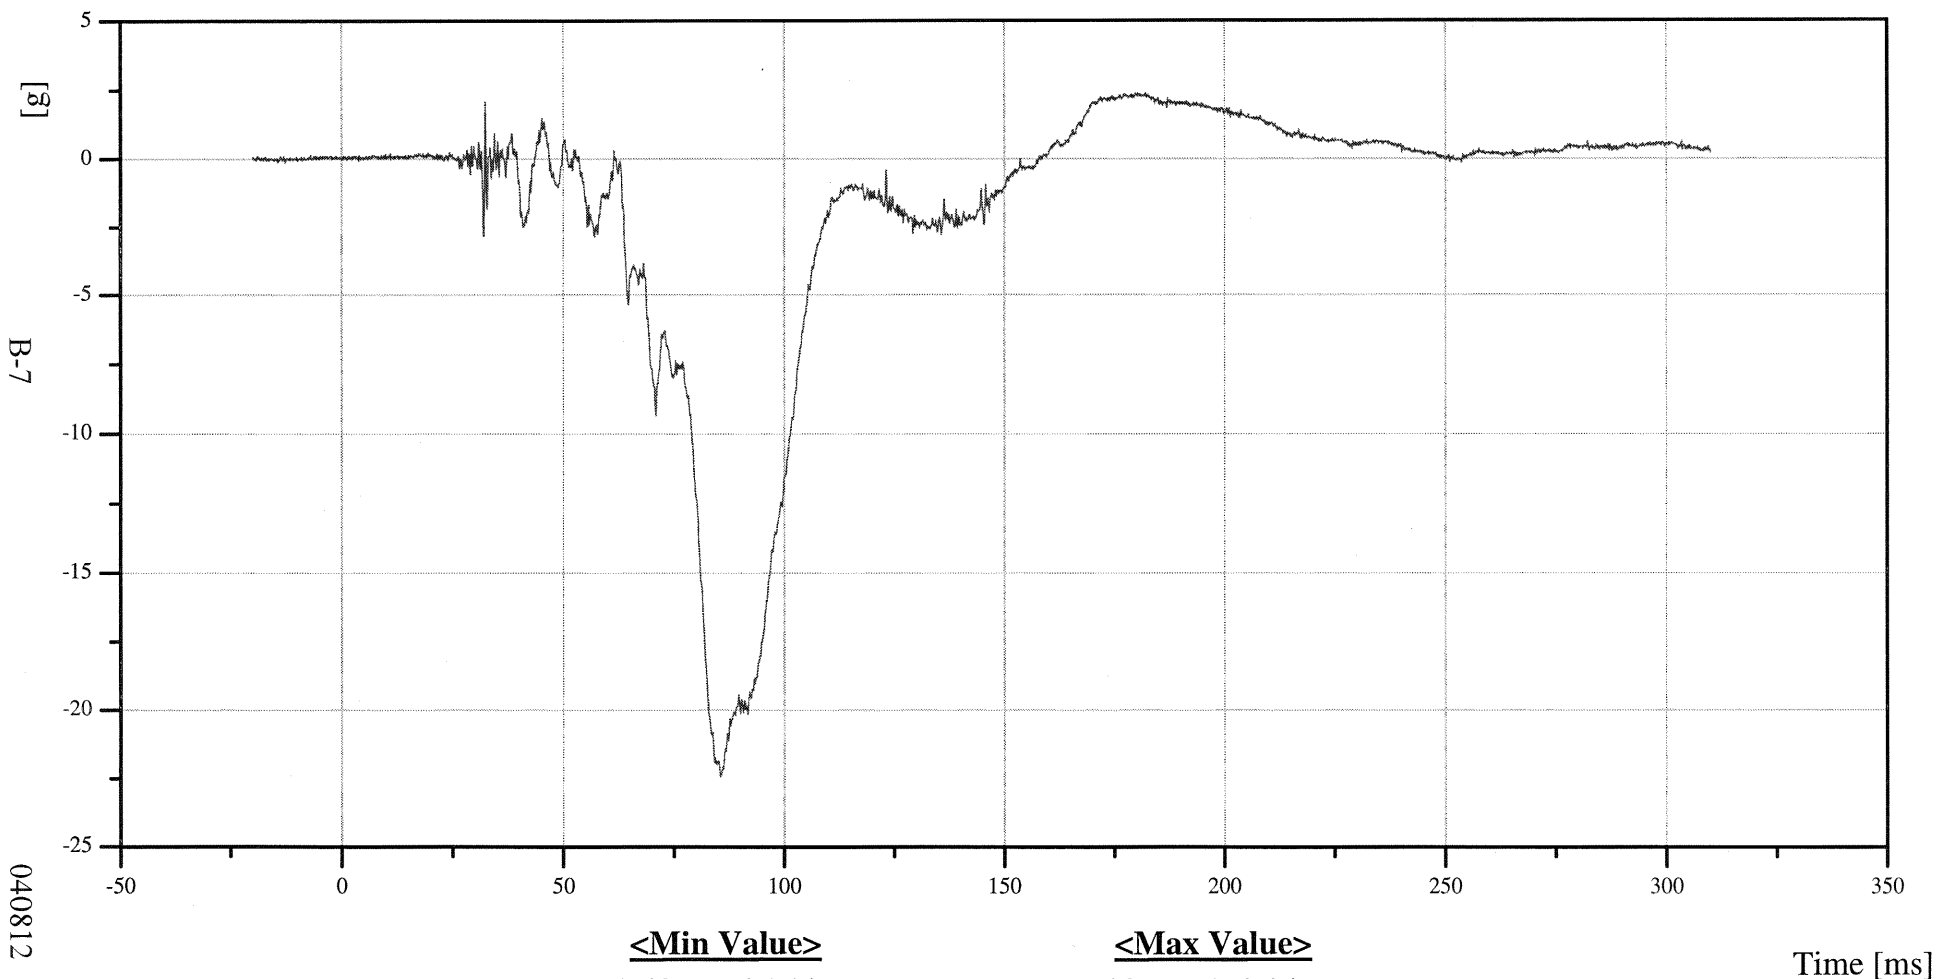

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Head Accel Red Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDZR1

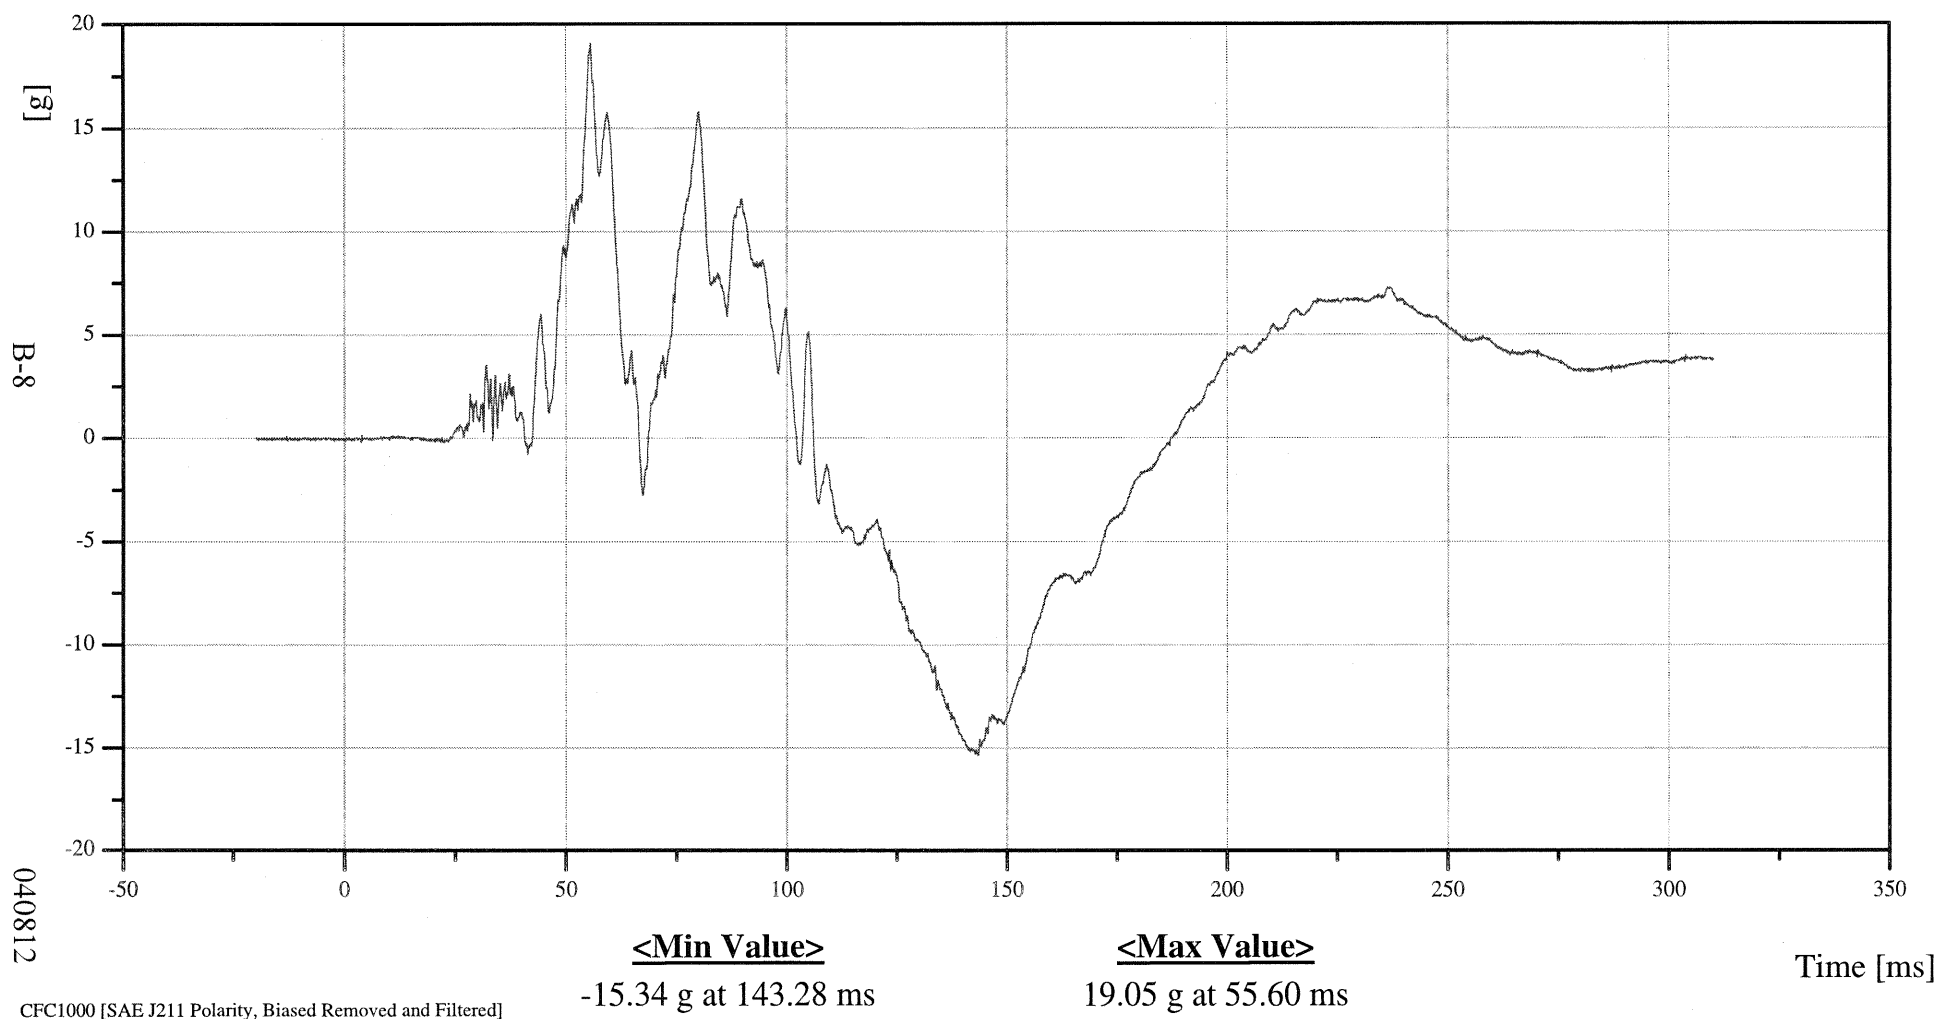



Transportation Research Center, Inc.

Neck Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXF1

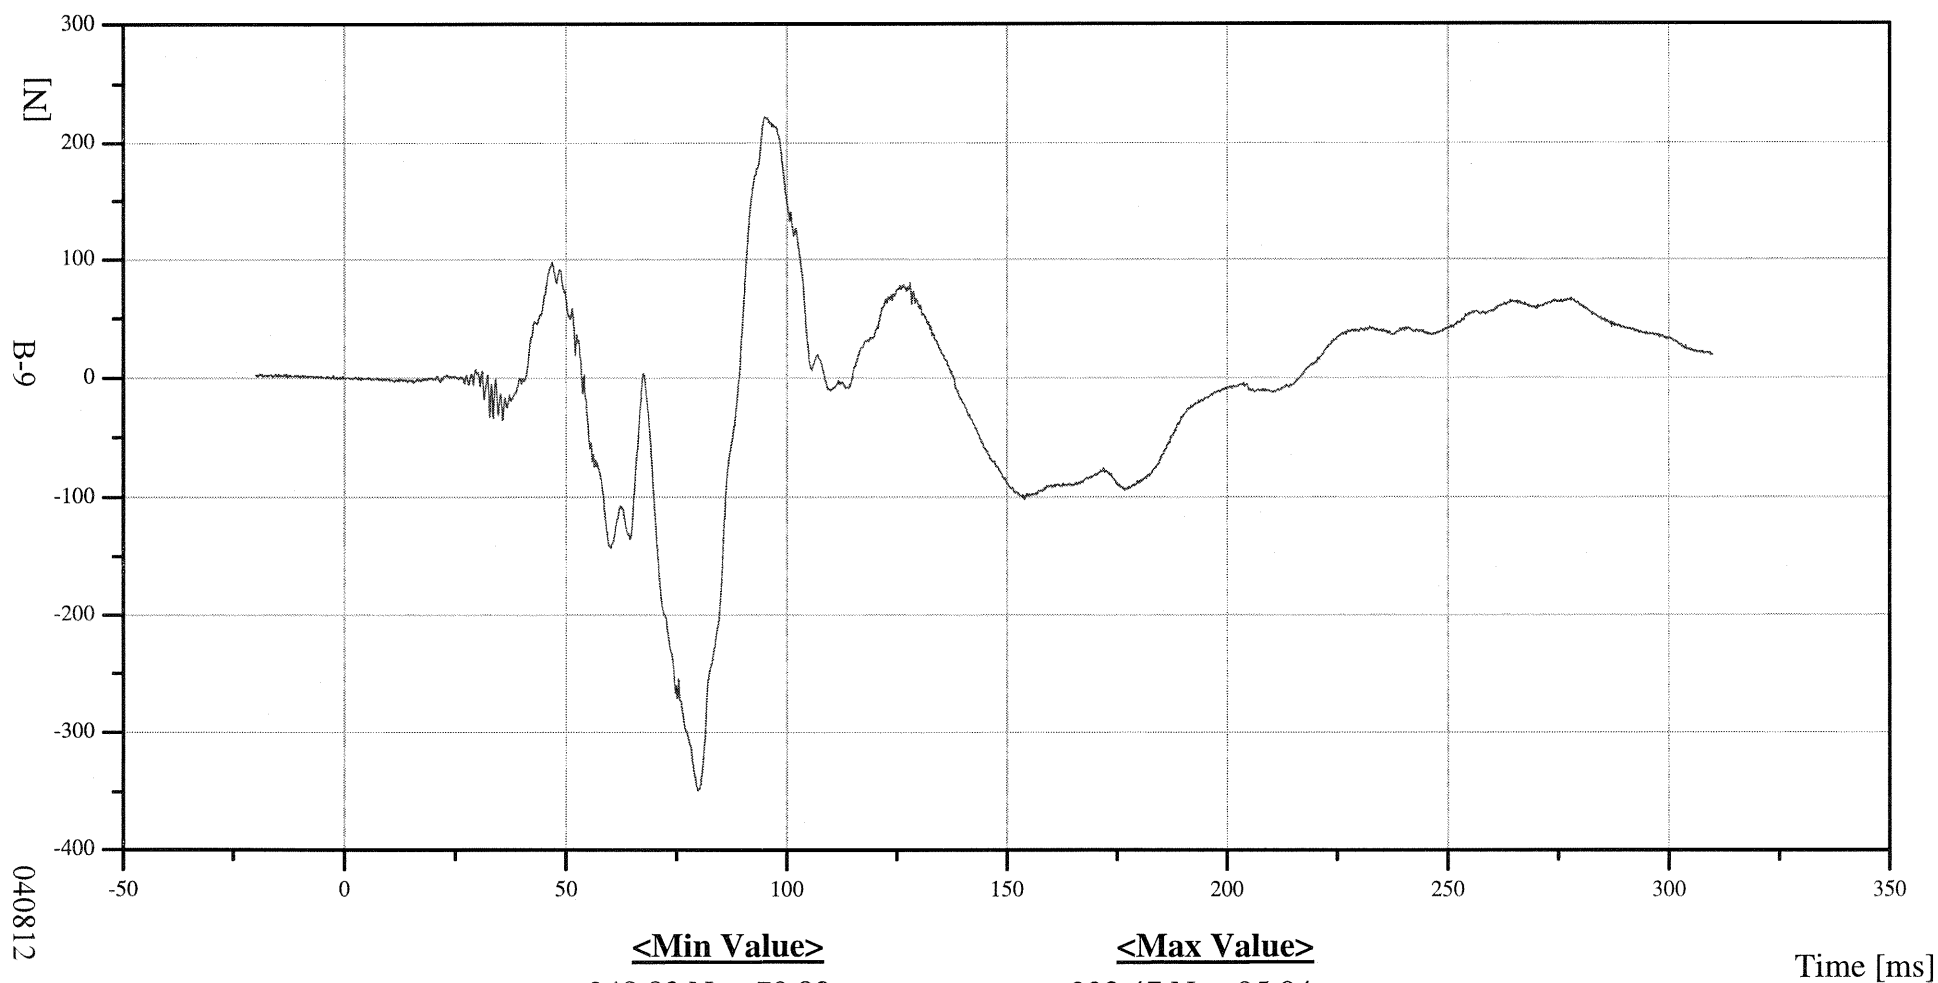



Transportation Research Center, Inc.

Neck Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYF1

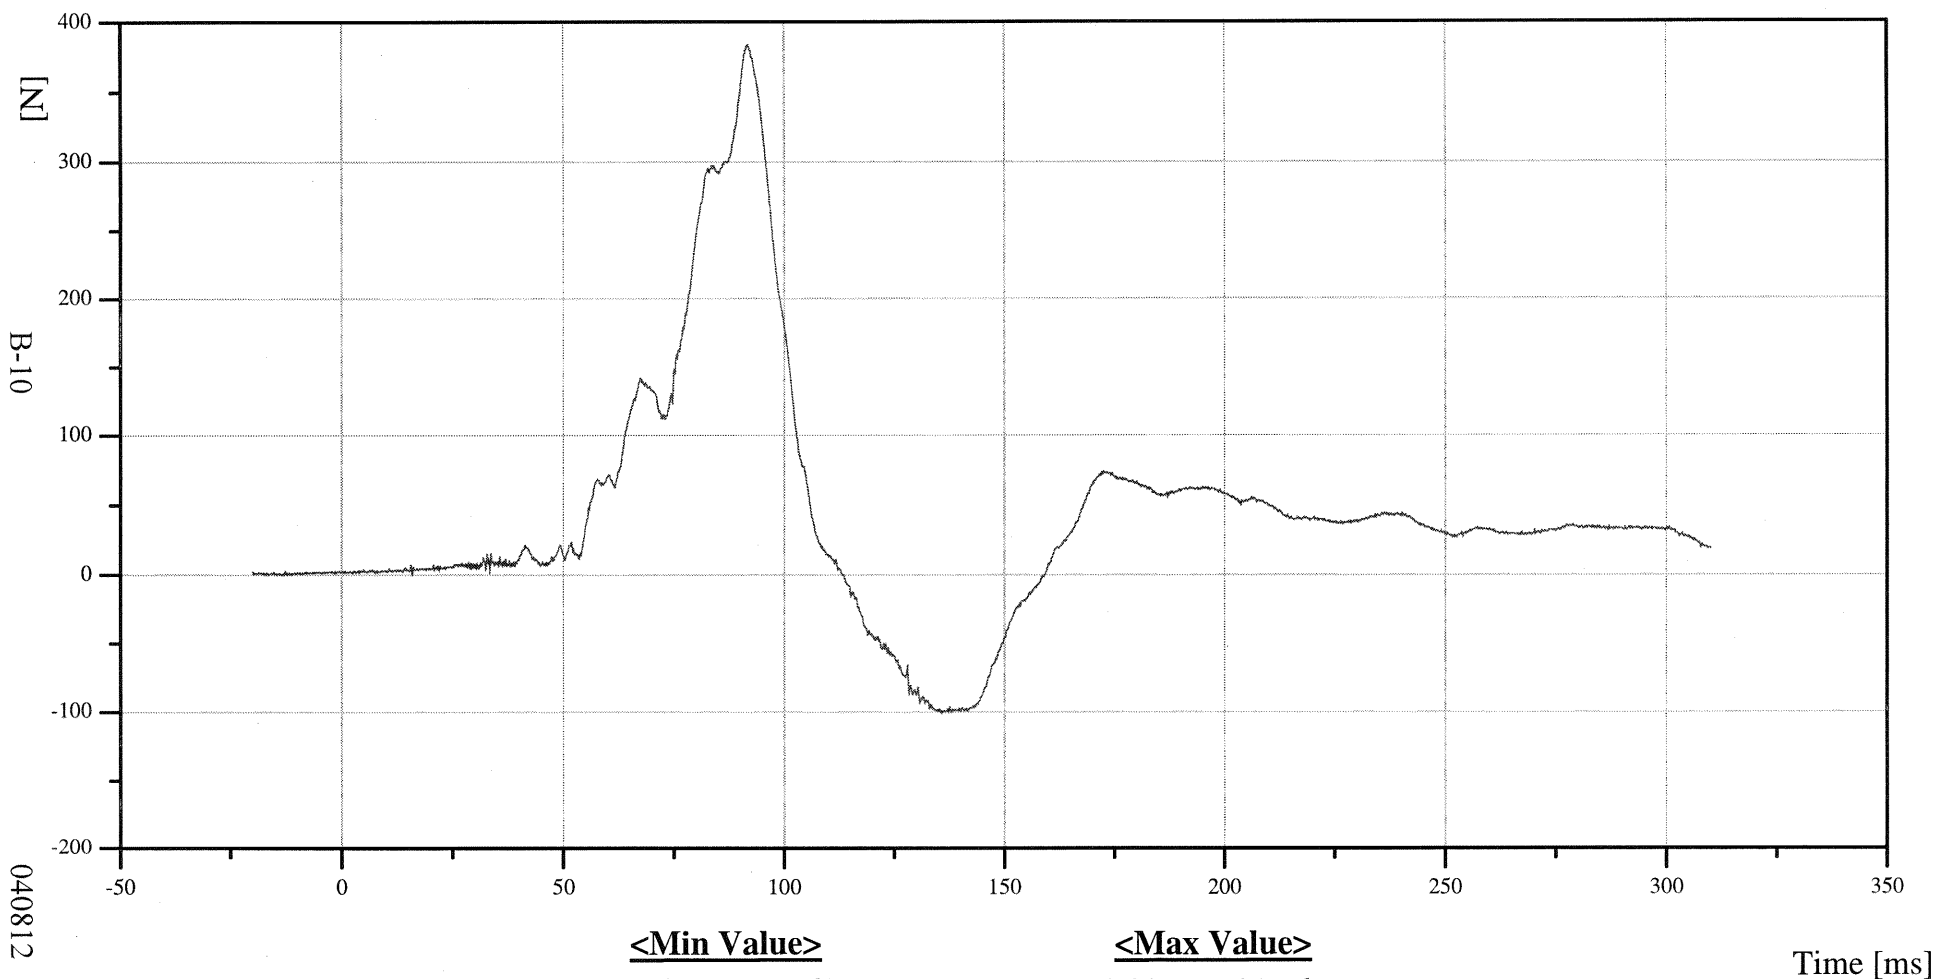

<Min Value>

<Max Value>

-101.26 N at 135.68 ms

383.39 N at 91.76 ms

Time [ms]

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZF1

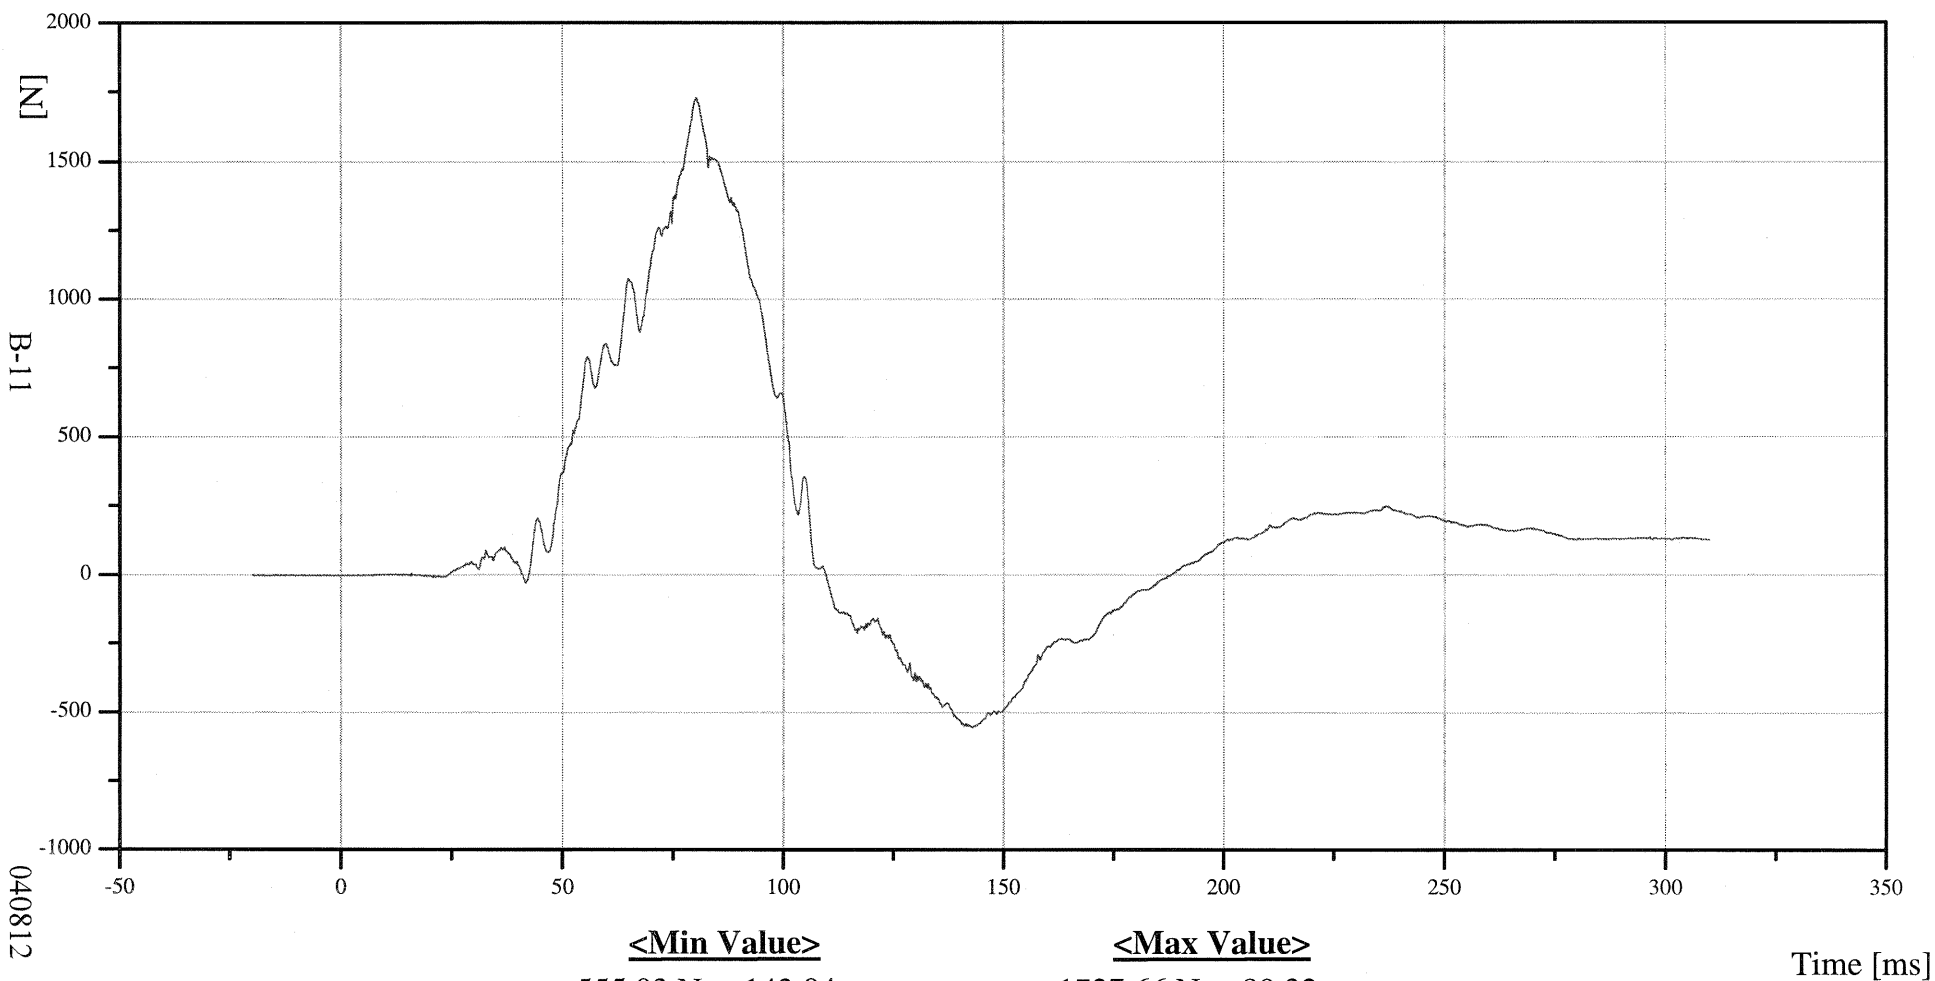

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXM1

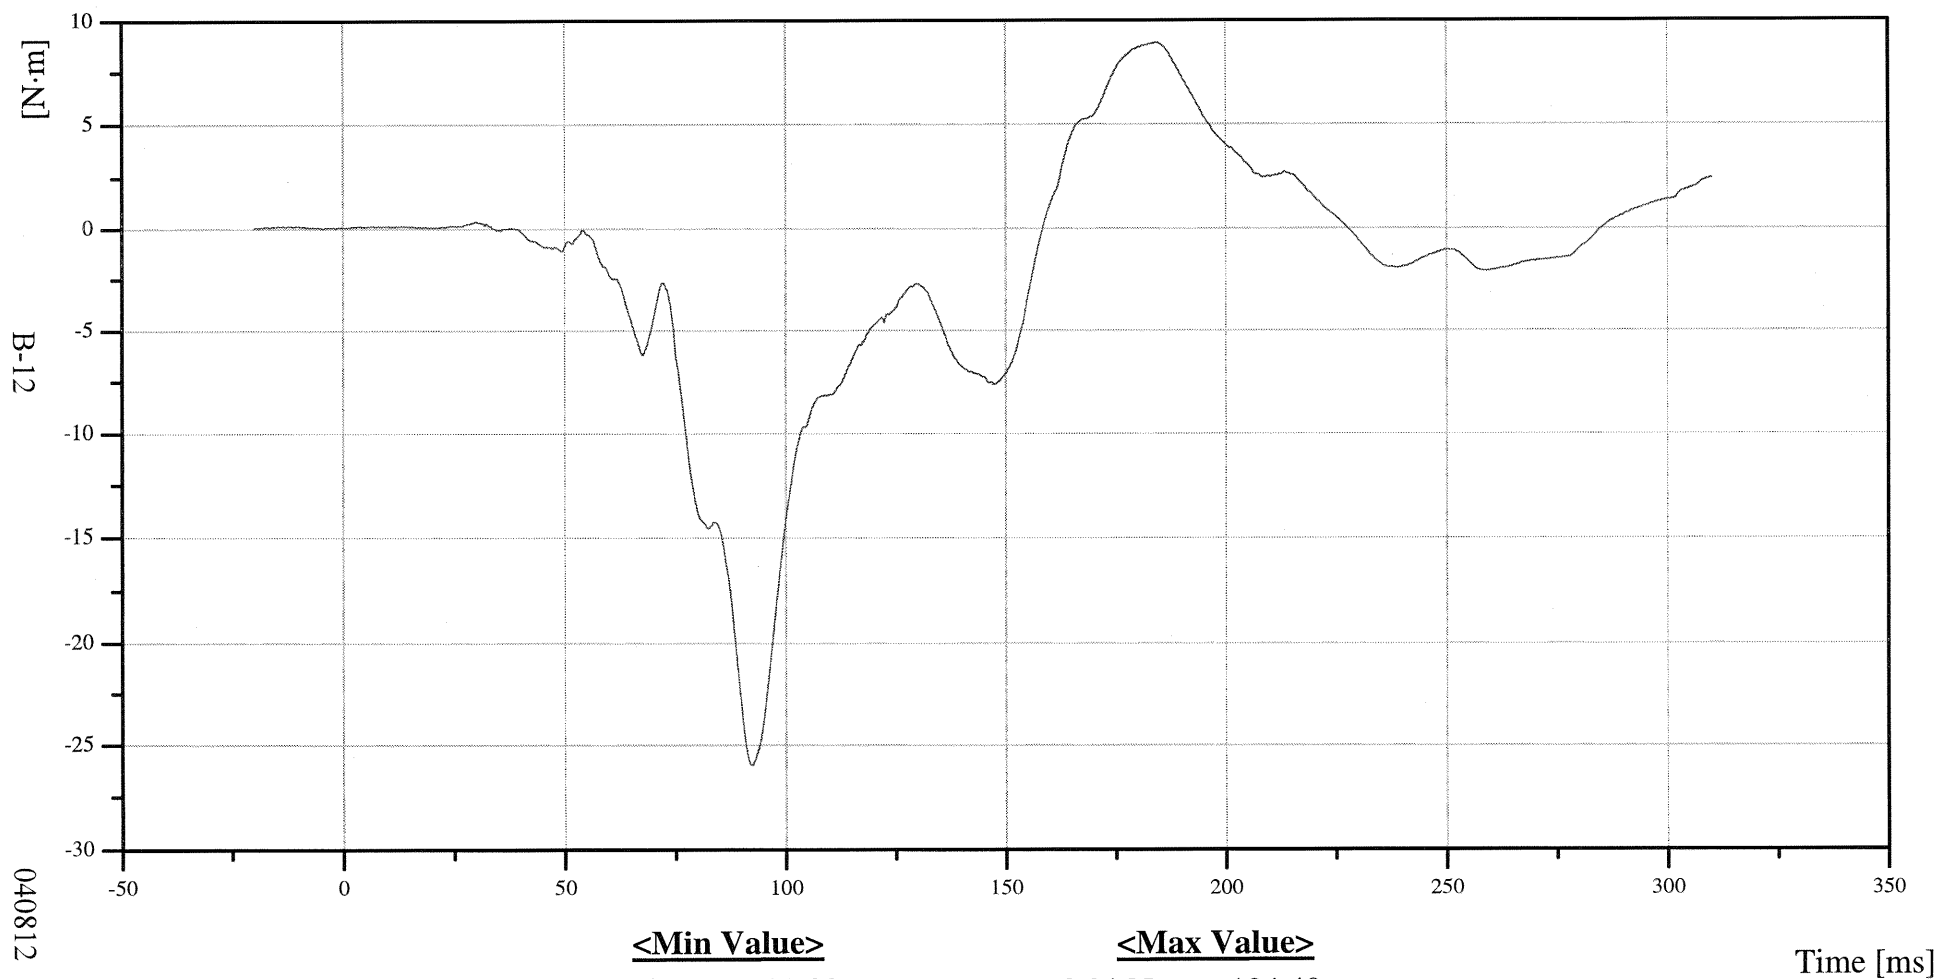

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYM1

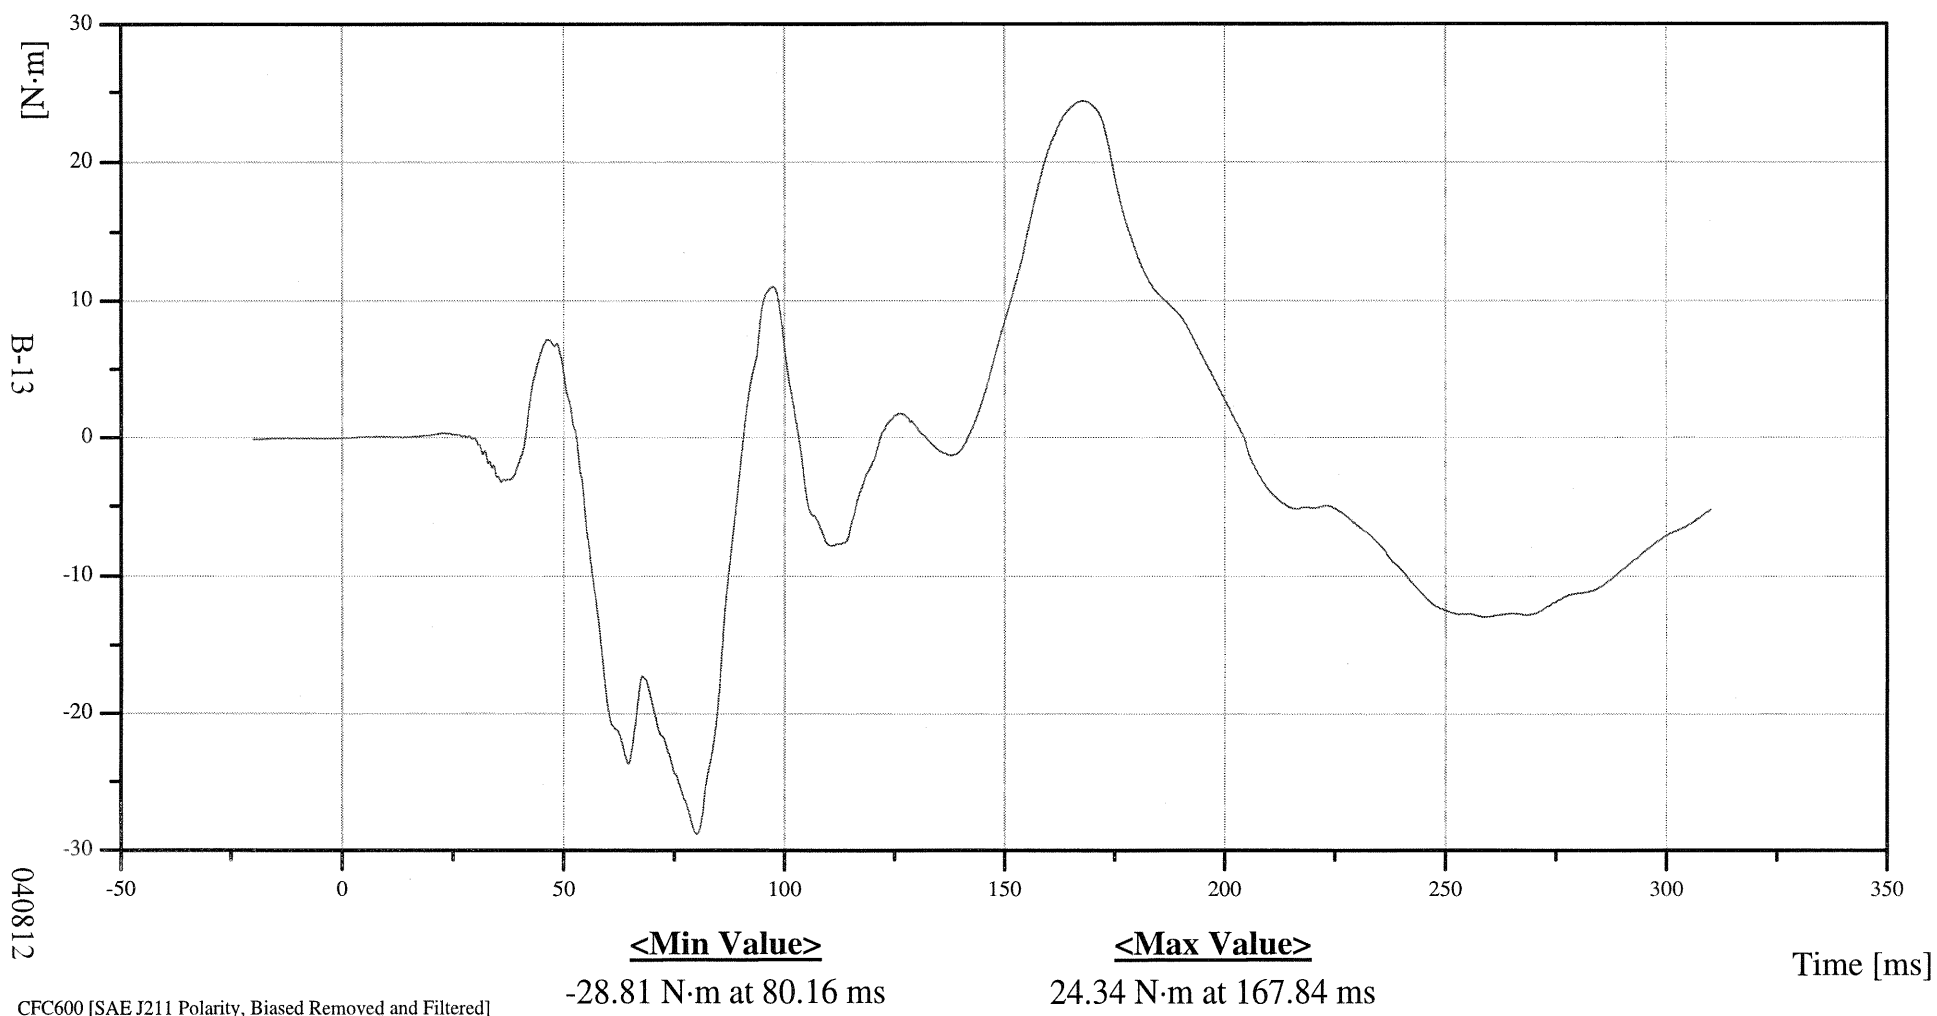



Transportation Research Center, Inc.

Neck Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZM1

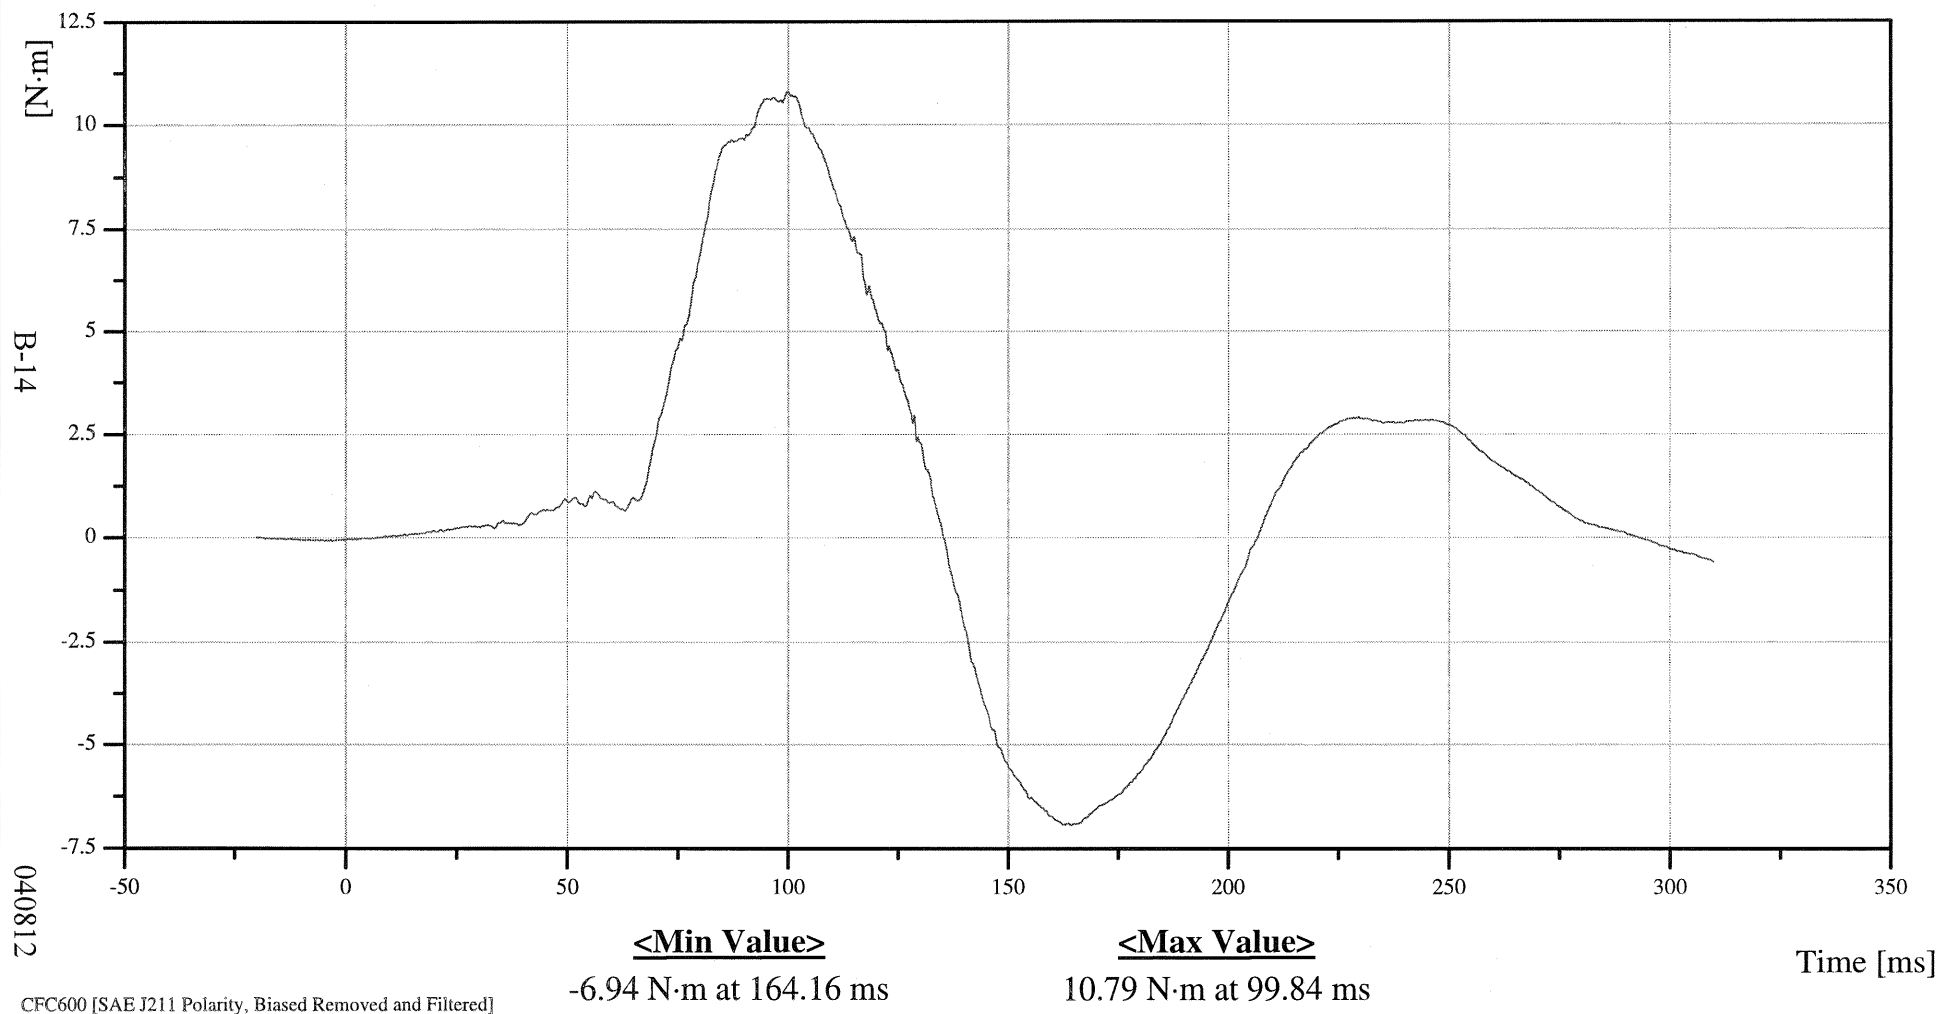



Transportation Research Center, Inc.

Neck Lwr Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXF1

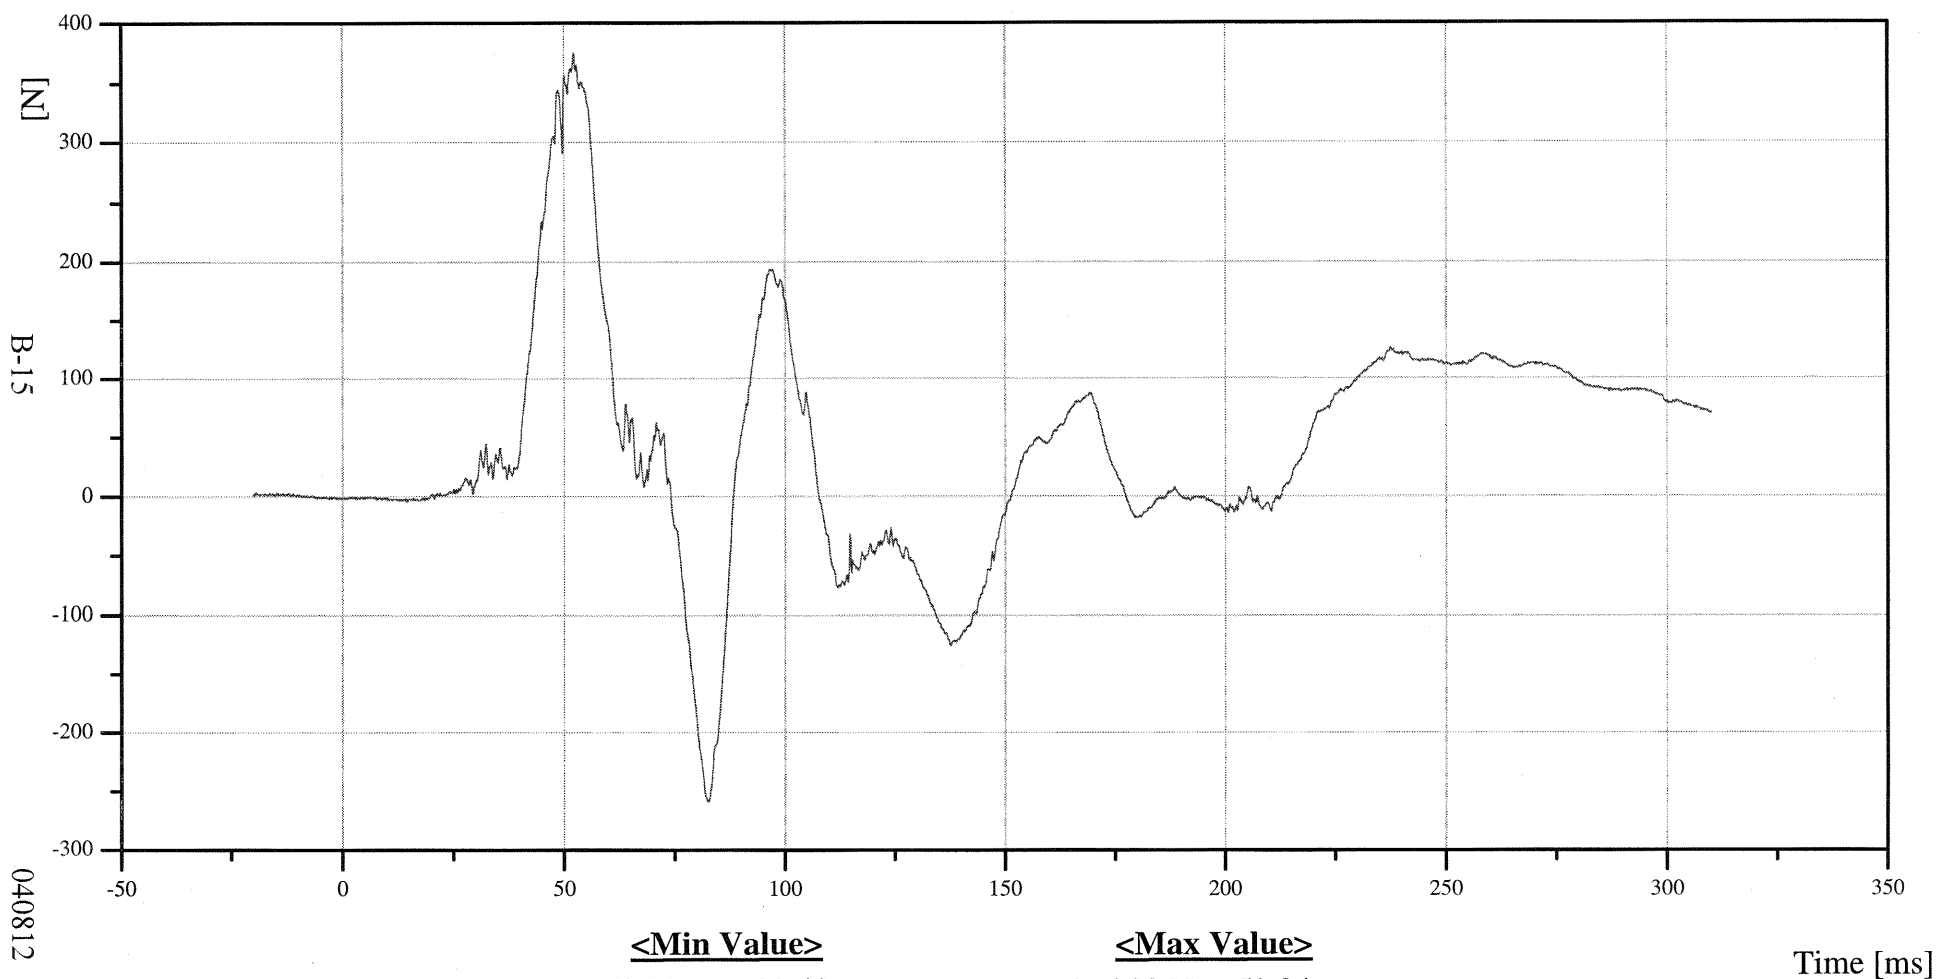

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYF1

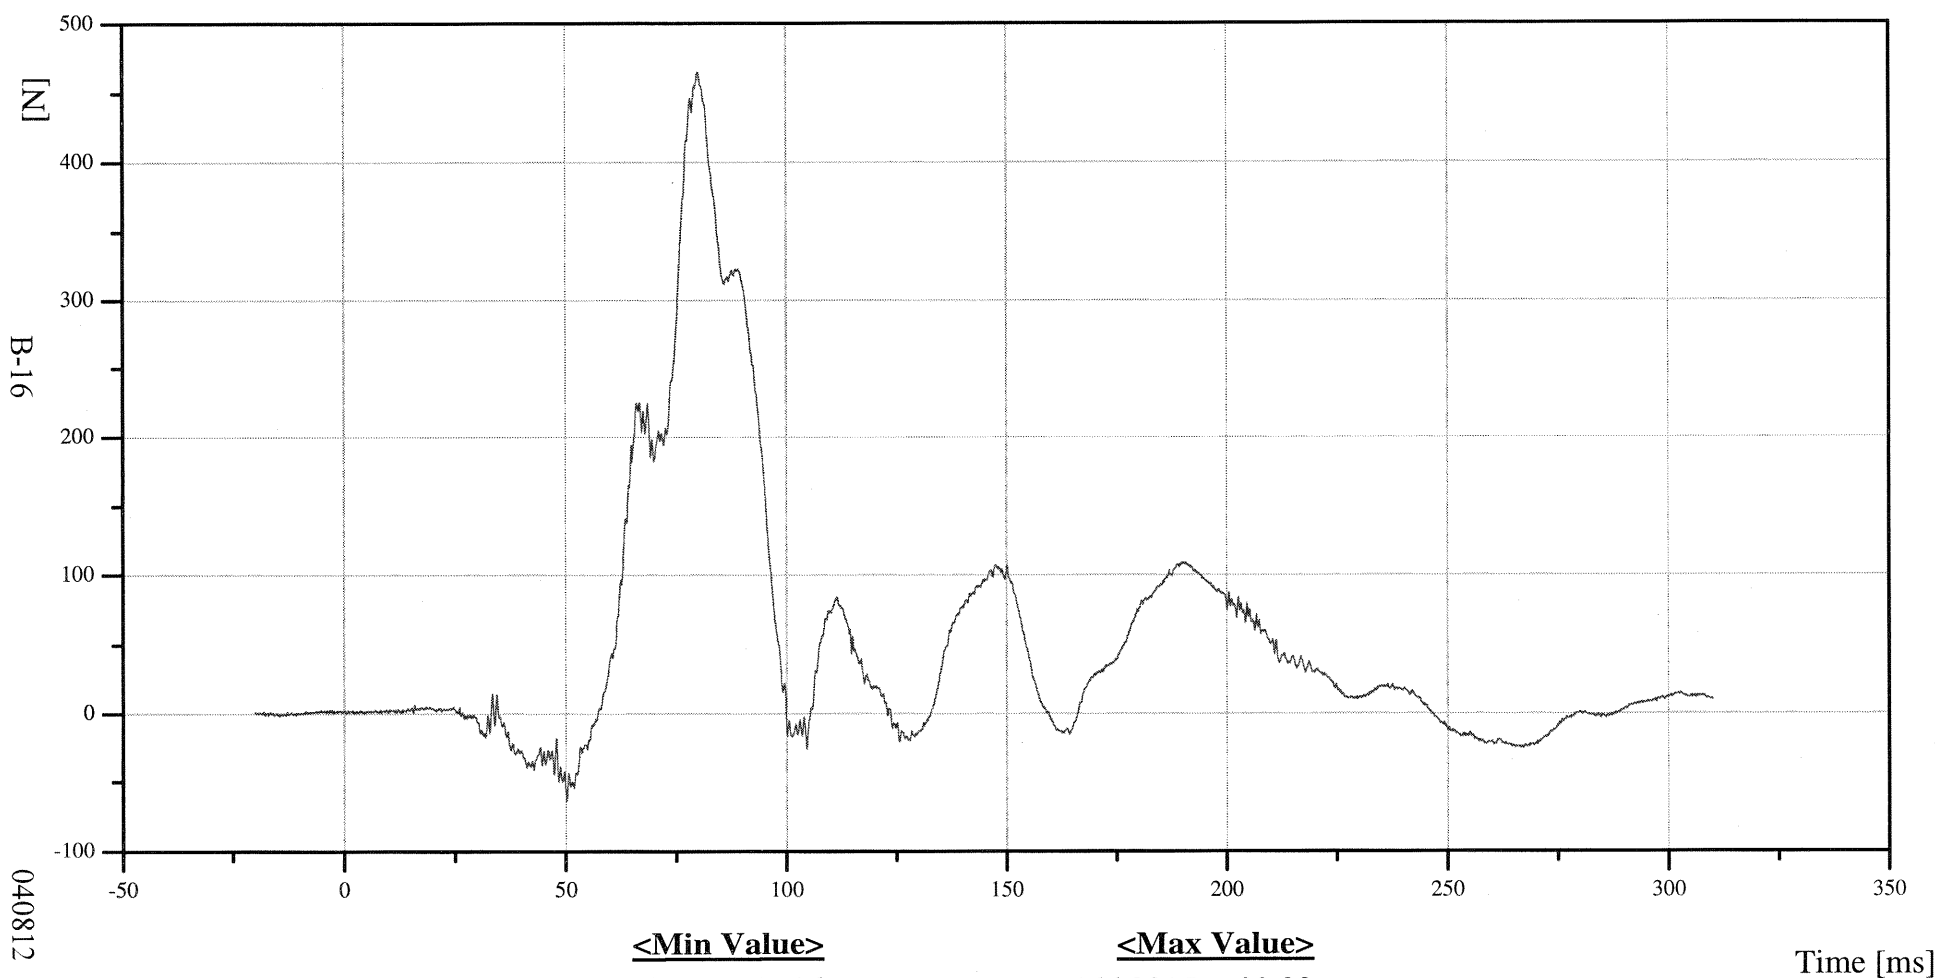

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZF1

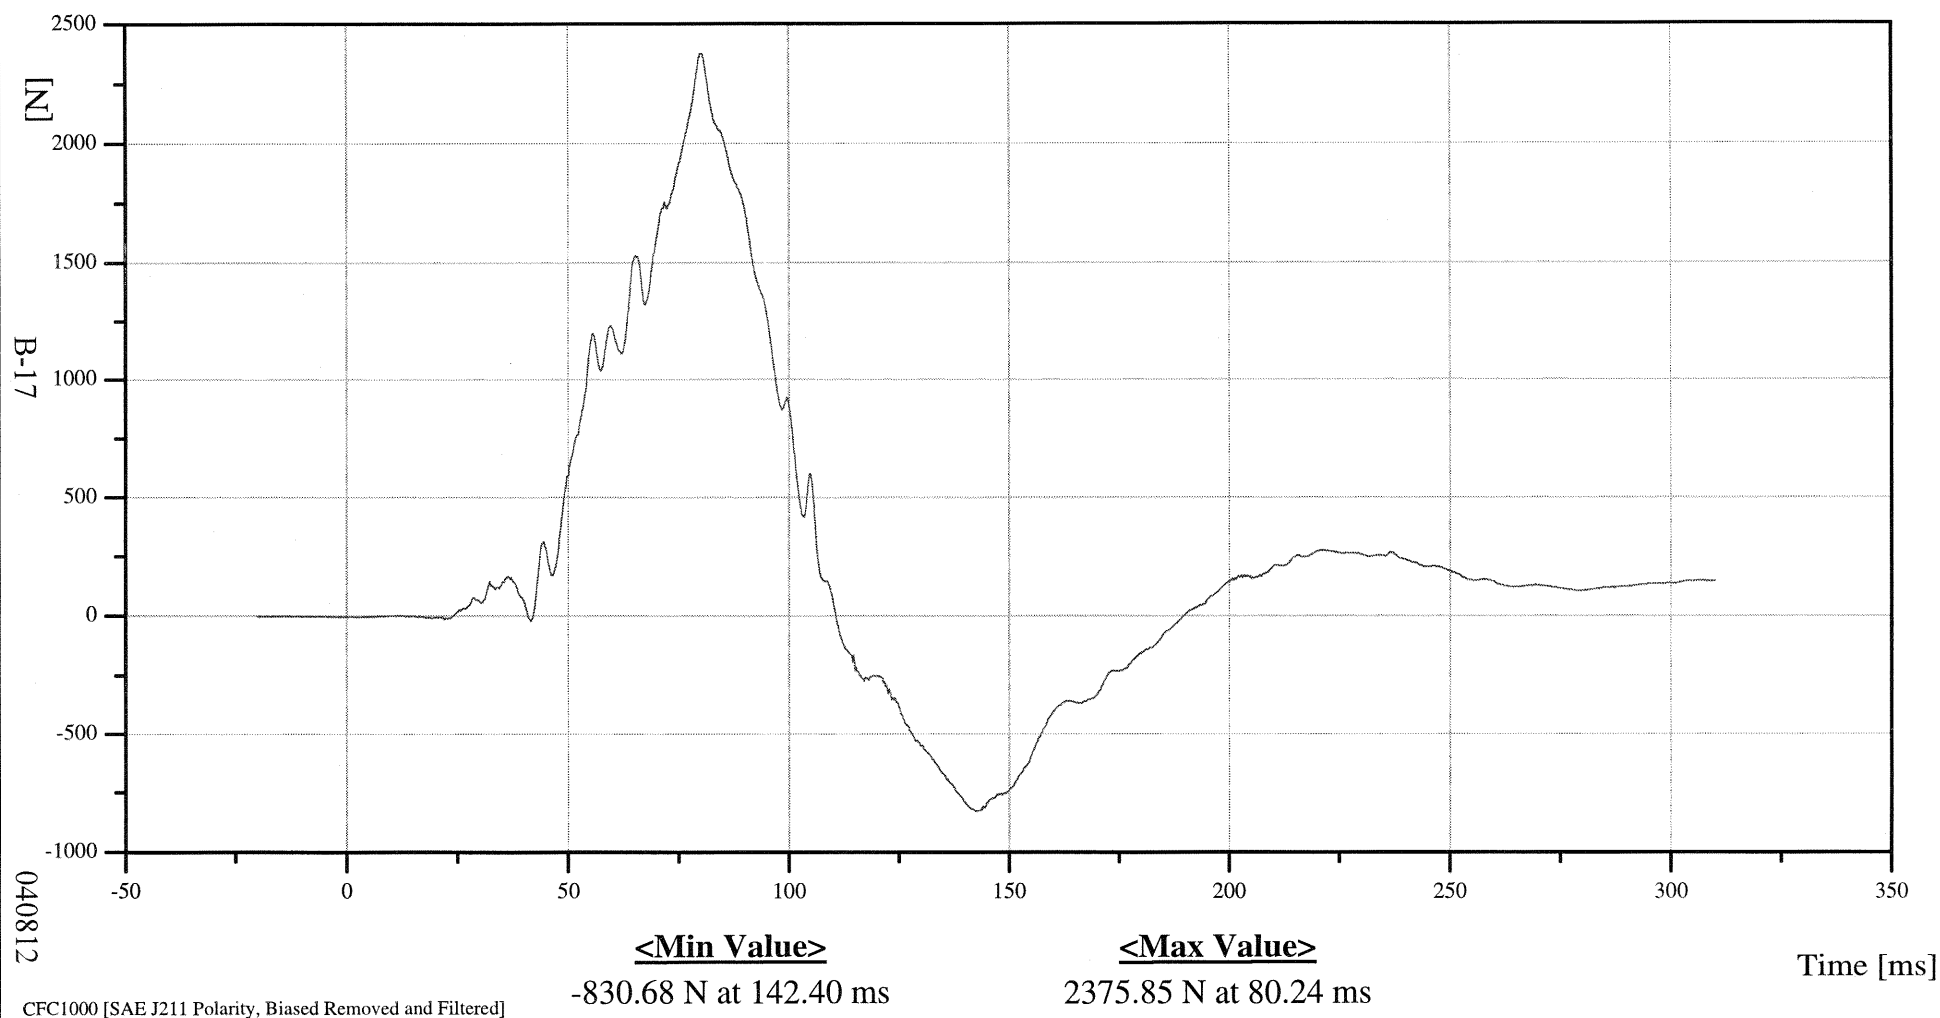



Transportation Research Center, Inc.

Neck Lwr Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXM1

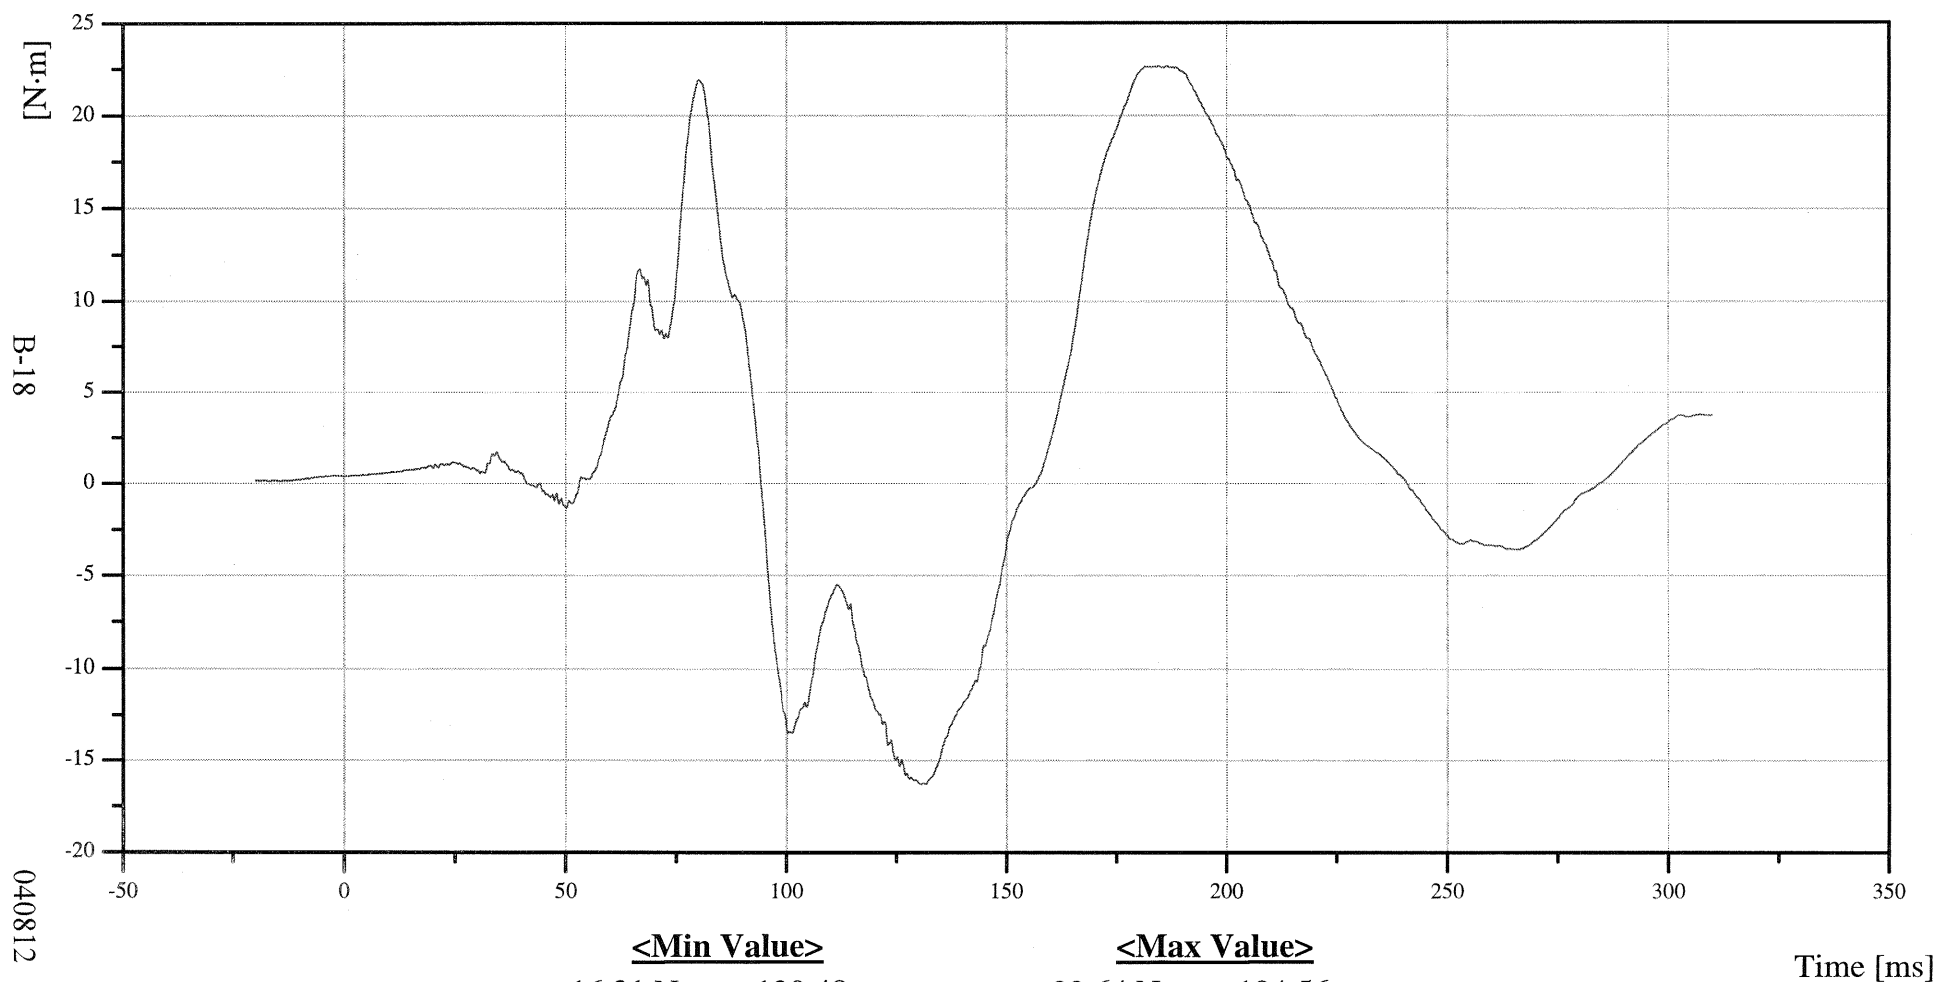

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYM1

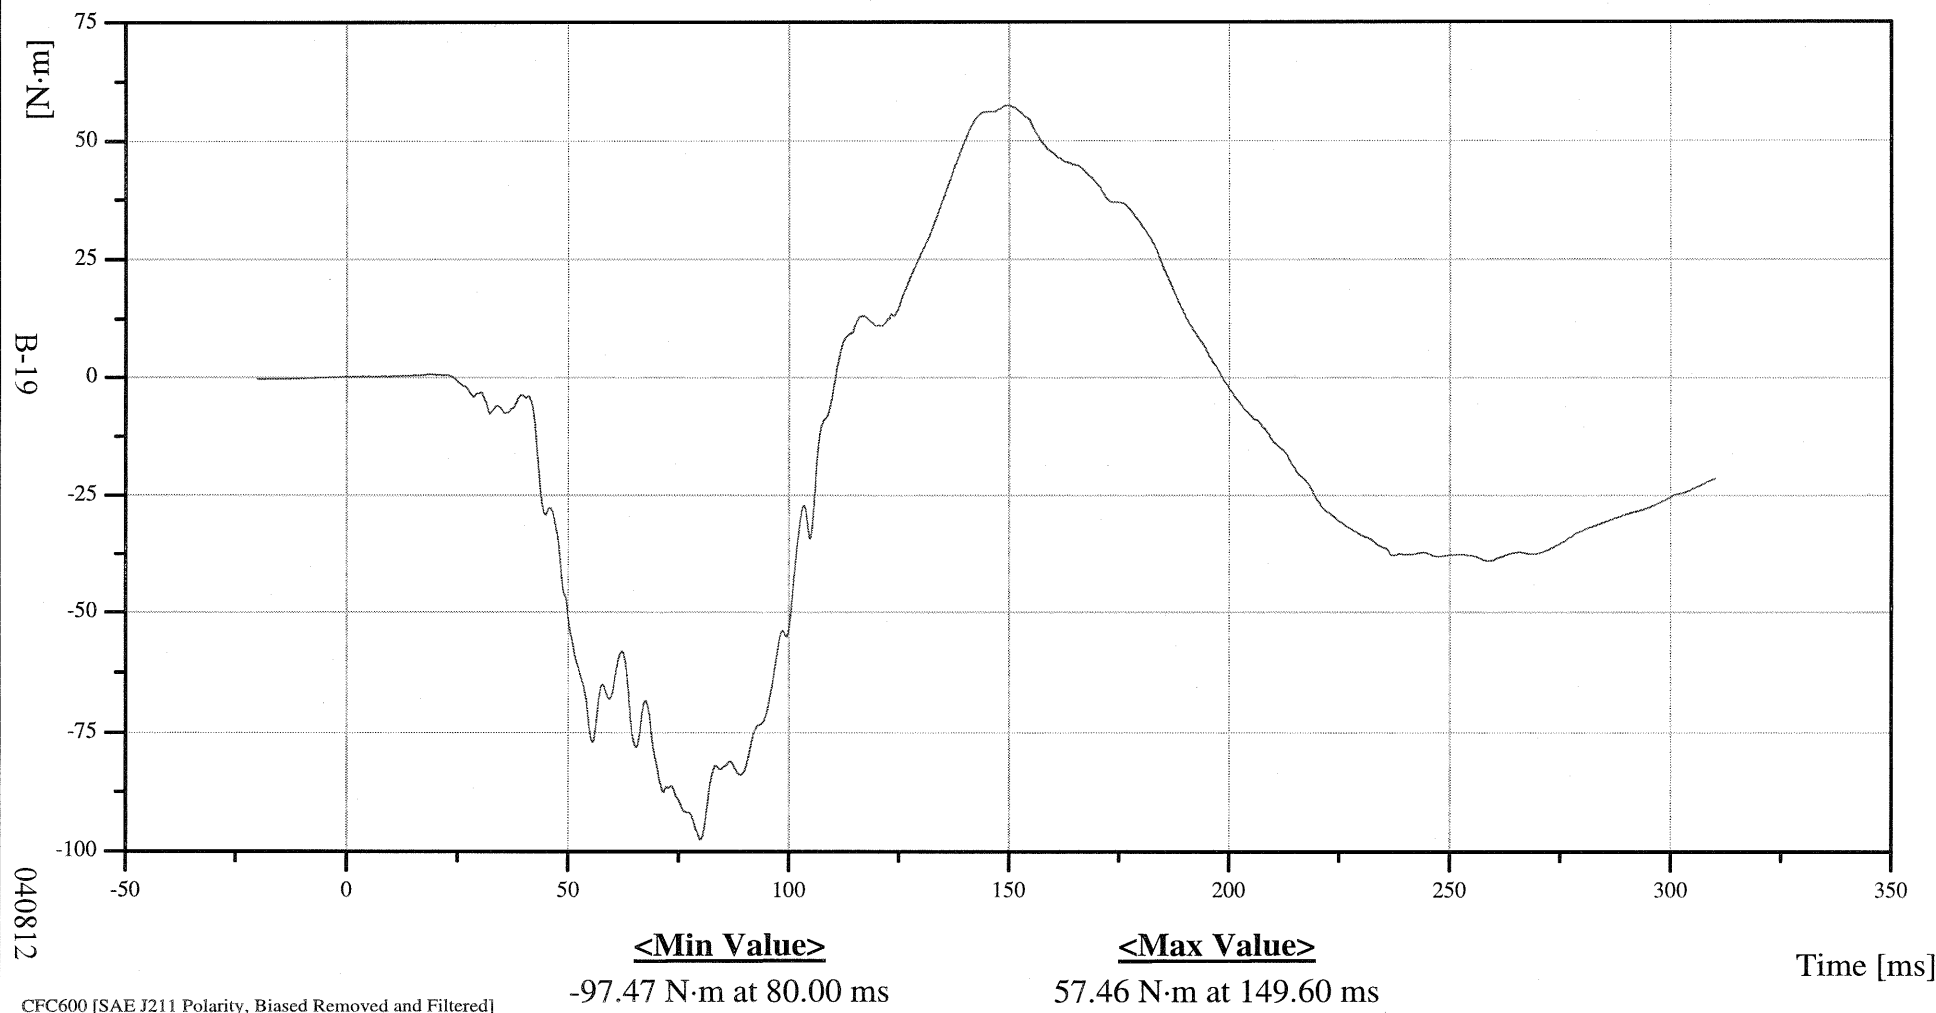



Transportation Research Center, Inc.

Neck Lwr Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZM1

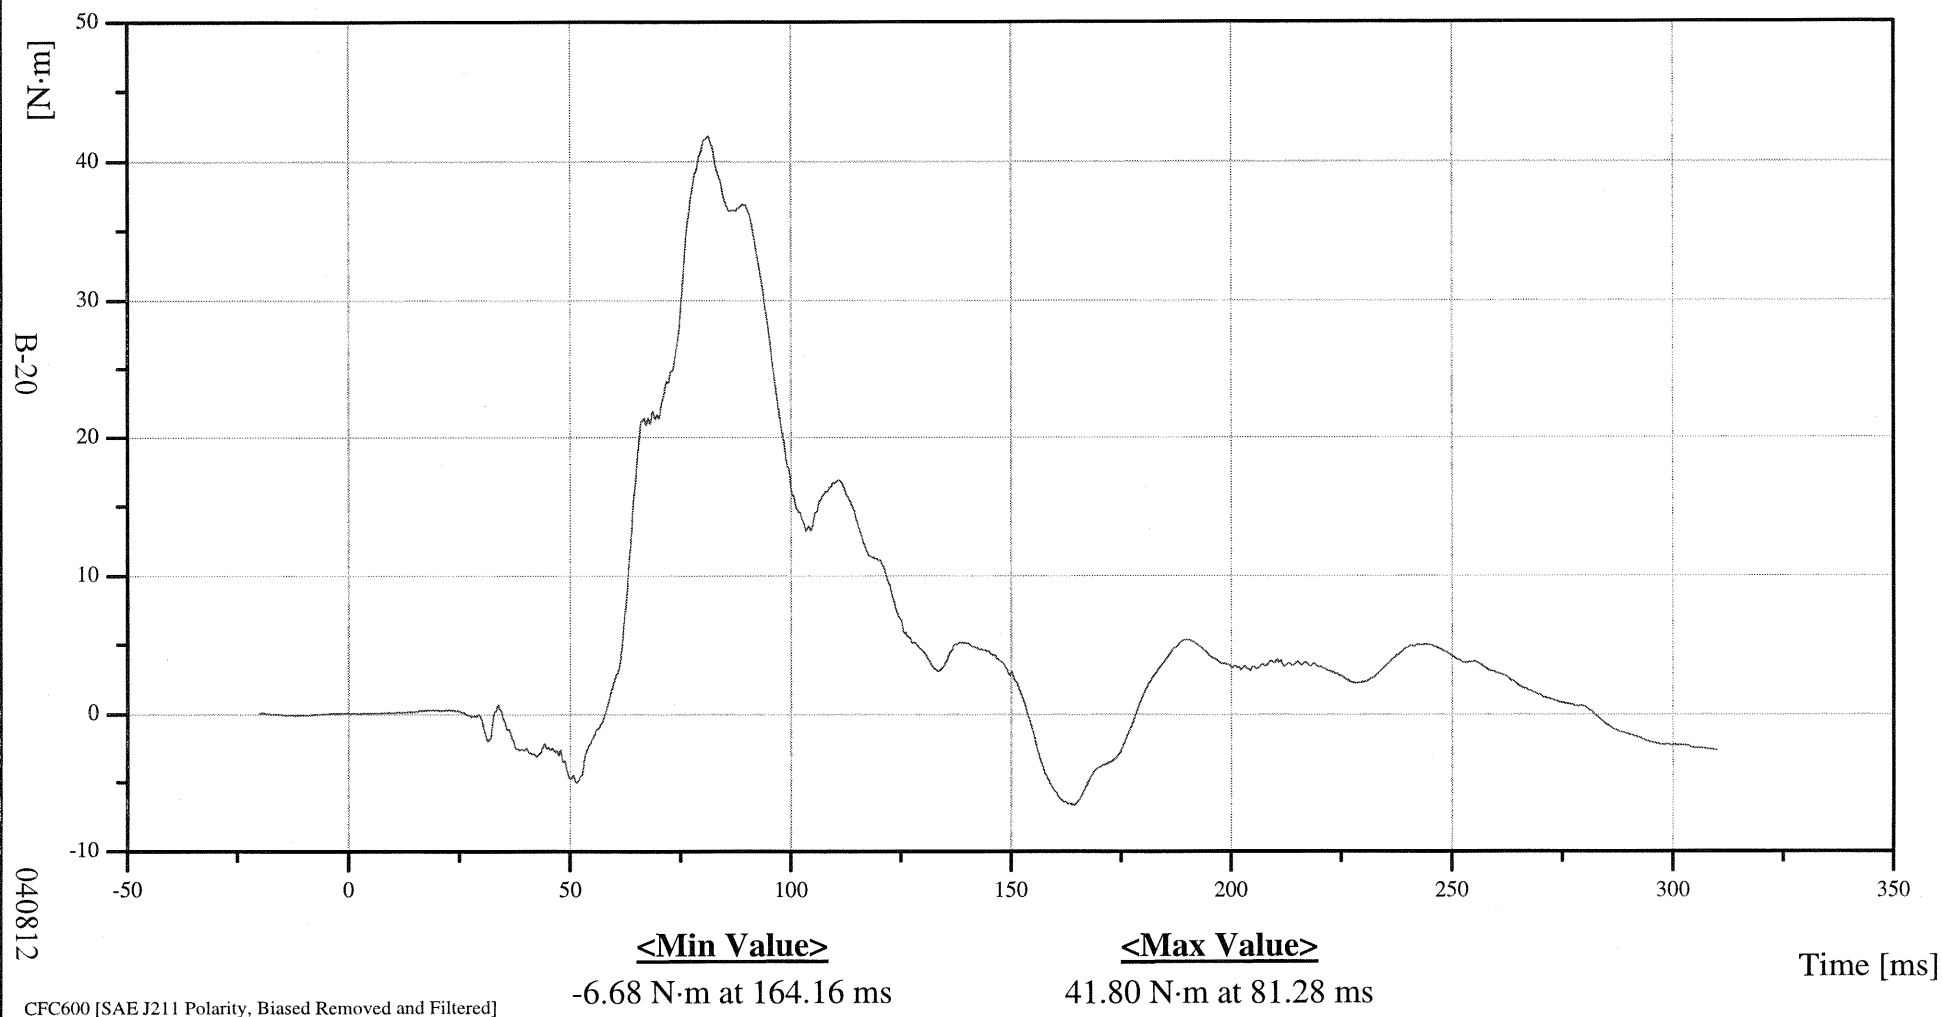



Transportation Research Center, Inc.

Chest Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXG1

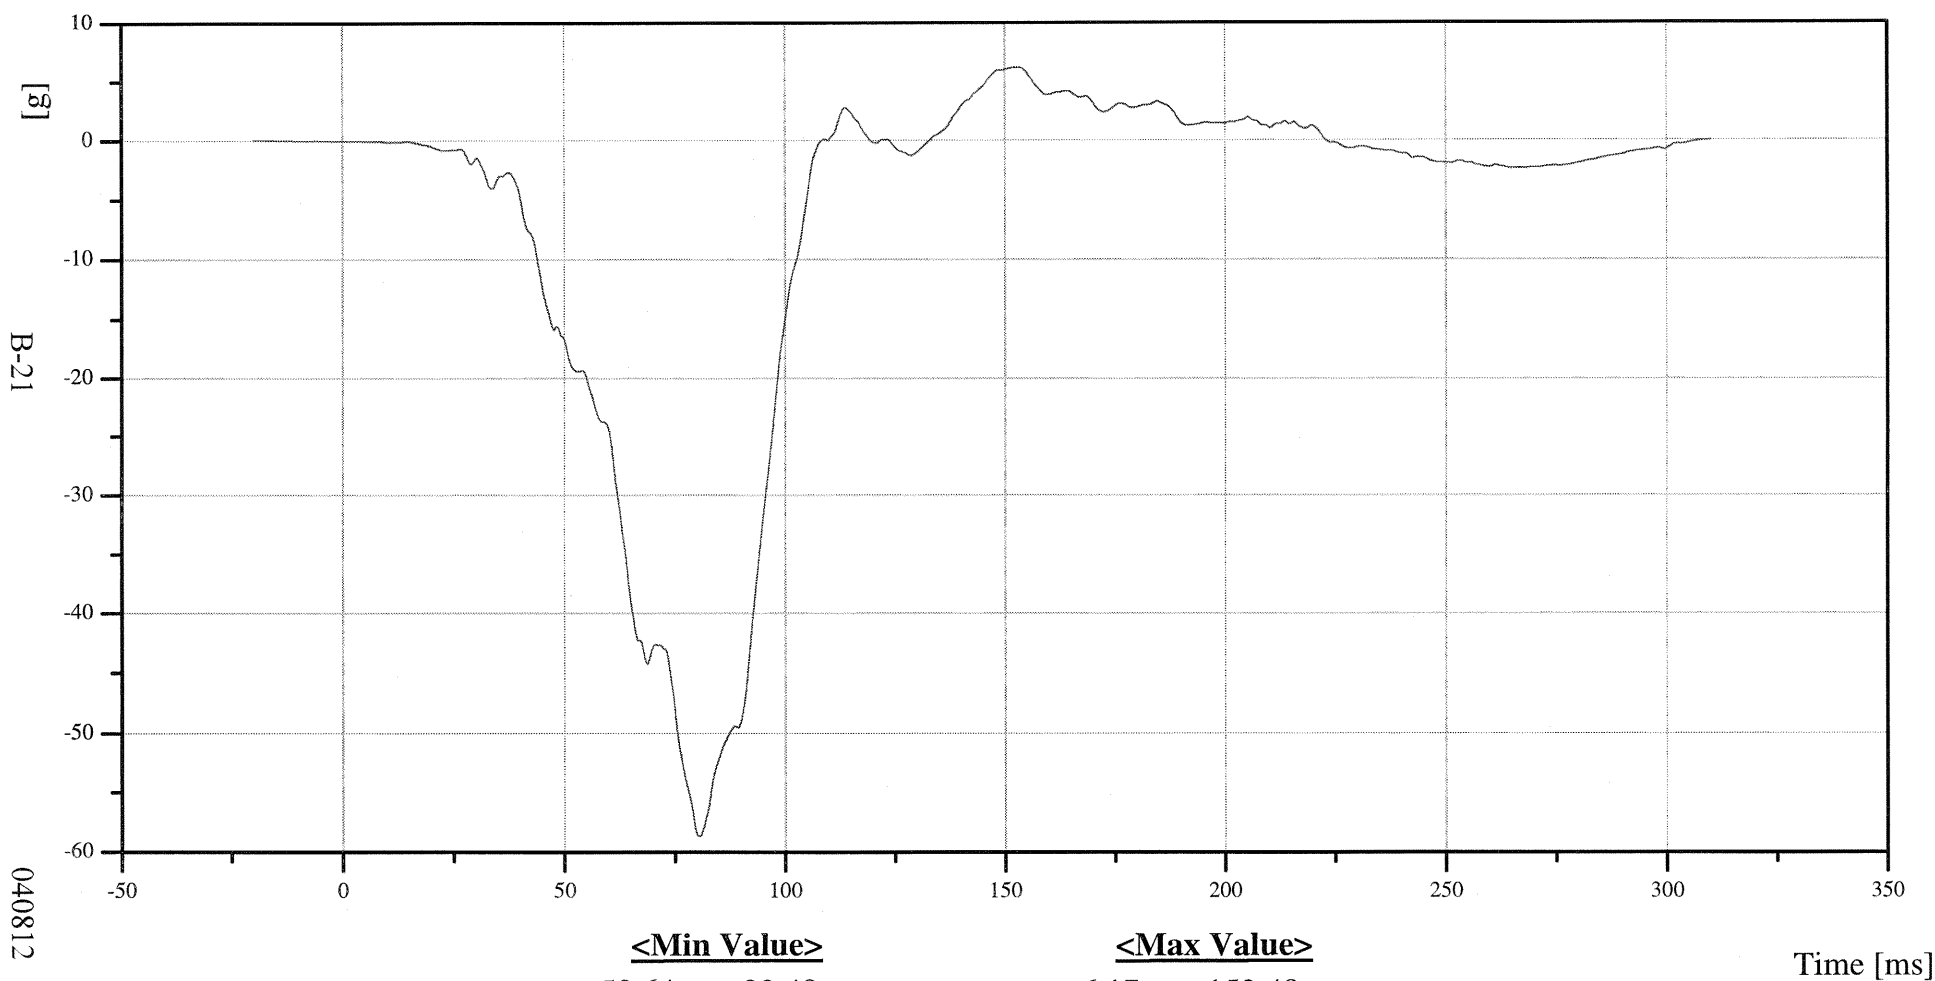

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTYG1

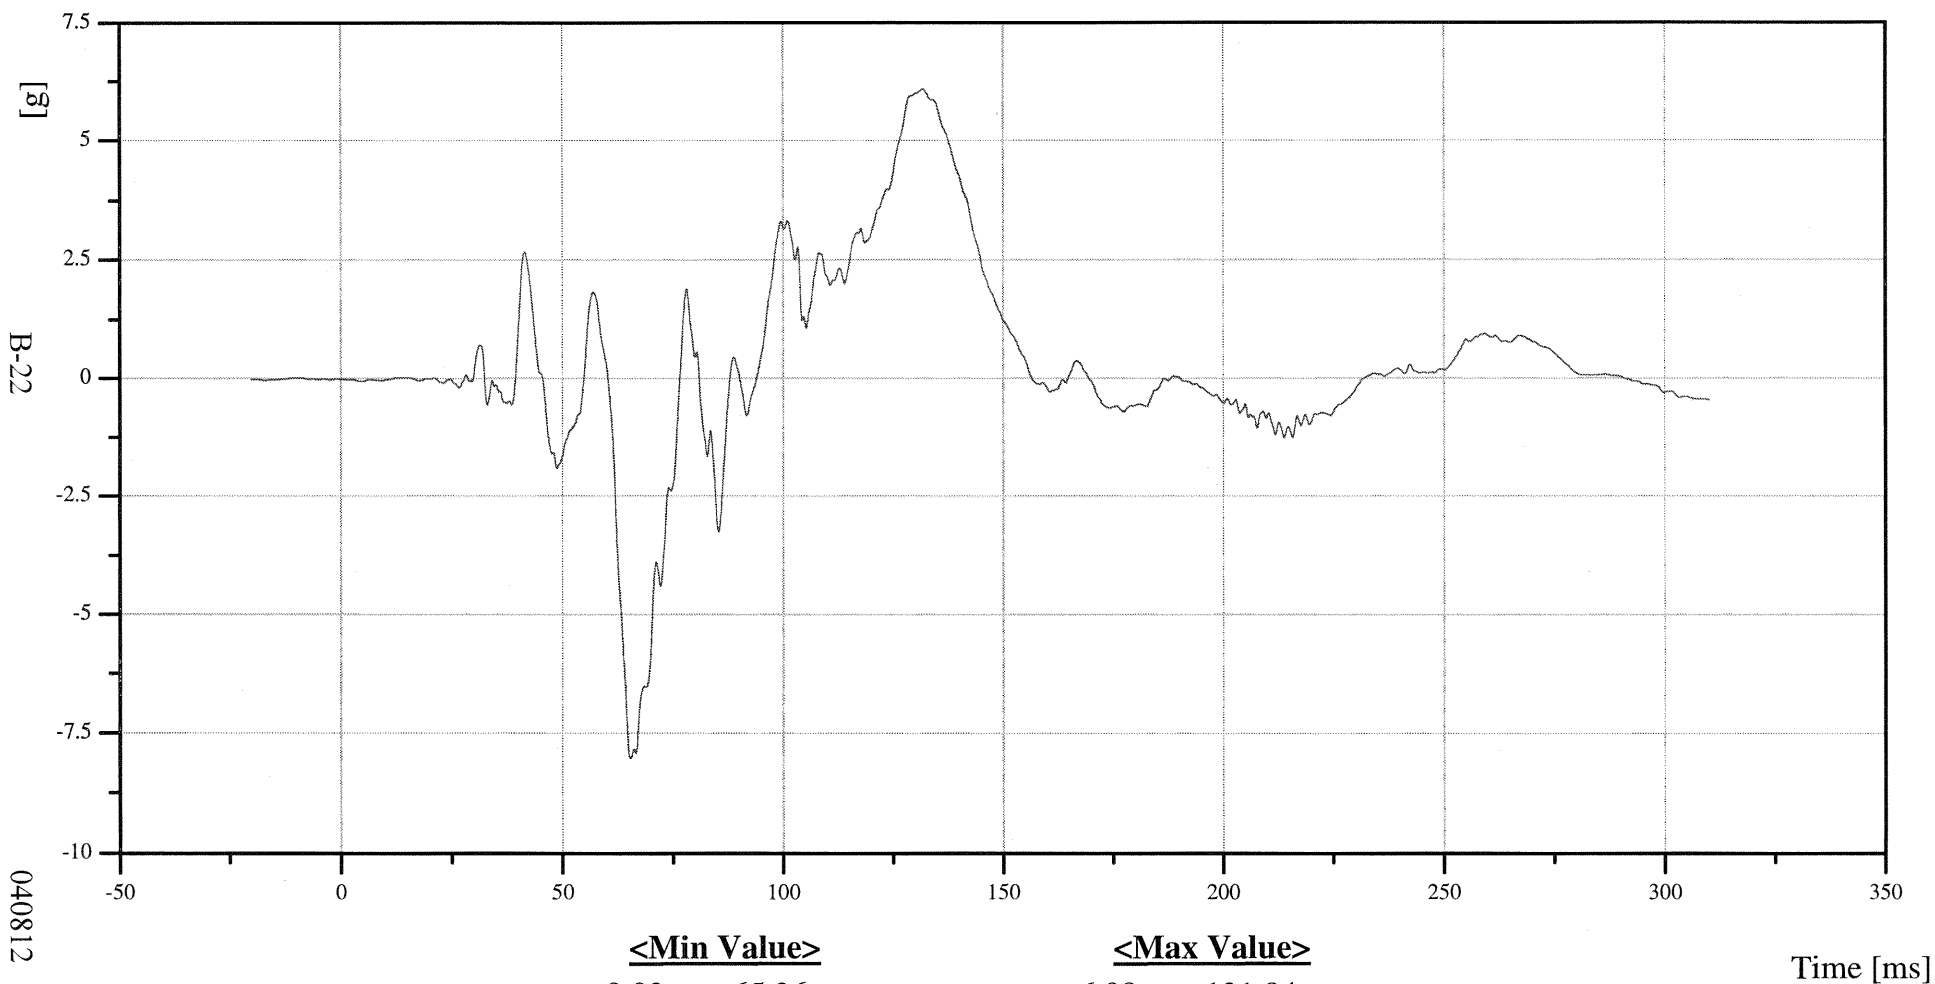

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTZG1

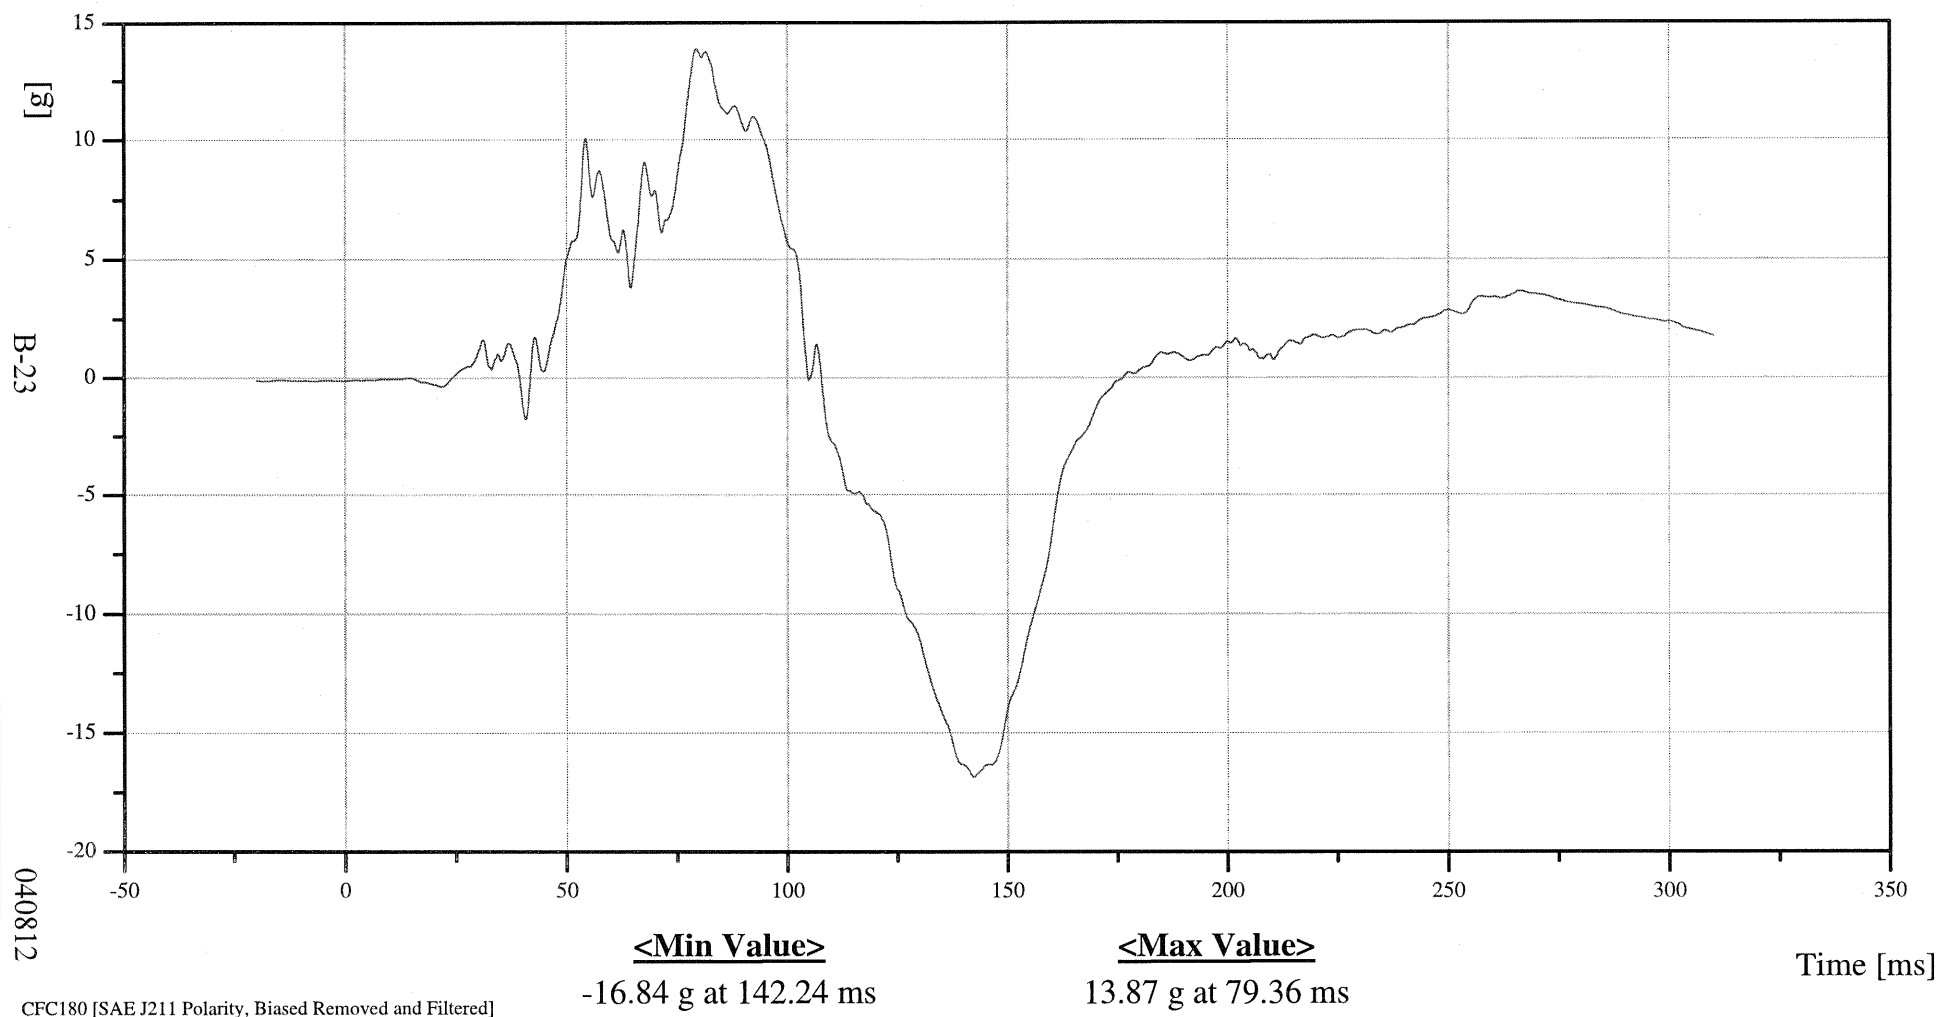



Transportation Research Center, Inc.

Chest Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTRG1

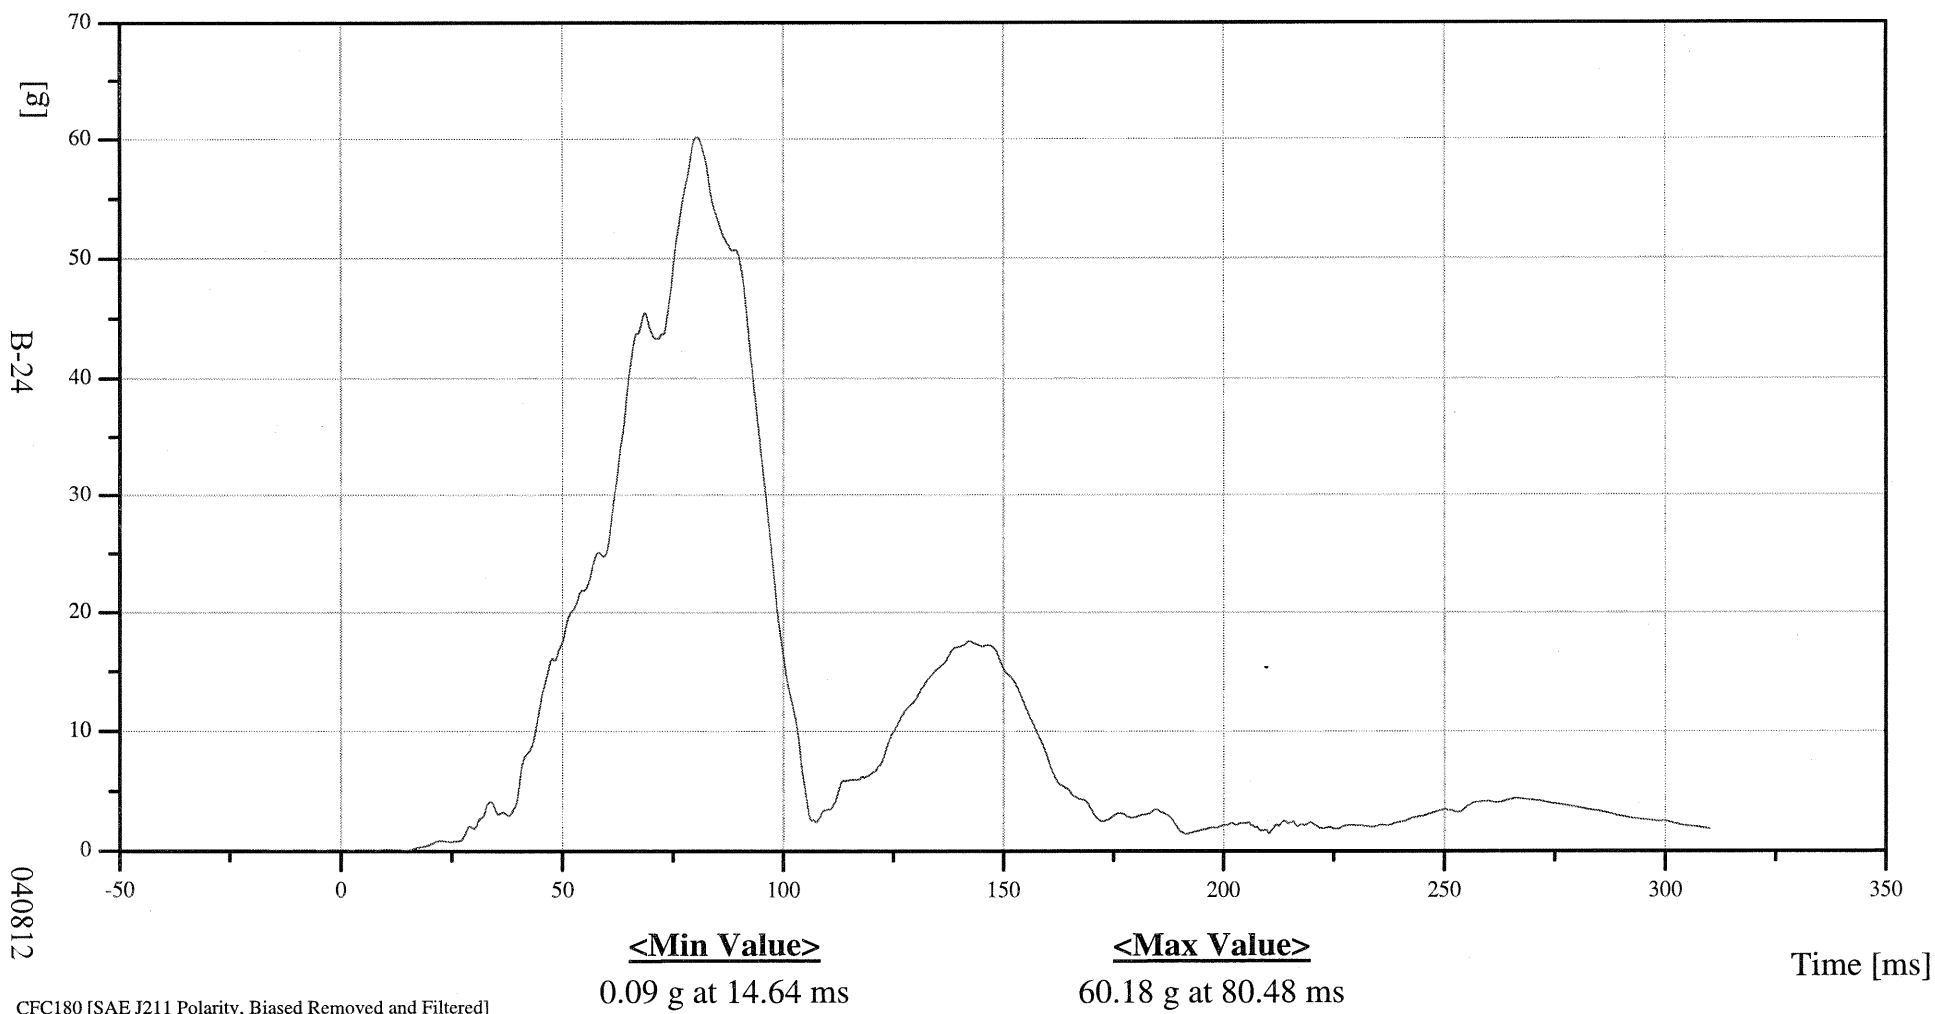



Transportation Research Center, Inc.

Chest Accel Red X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXR1

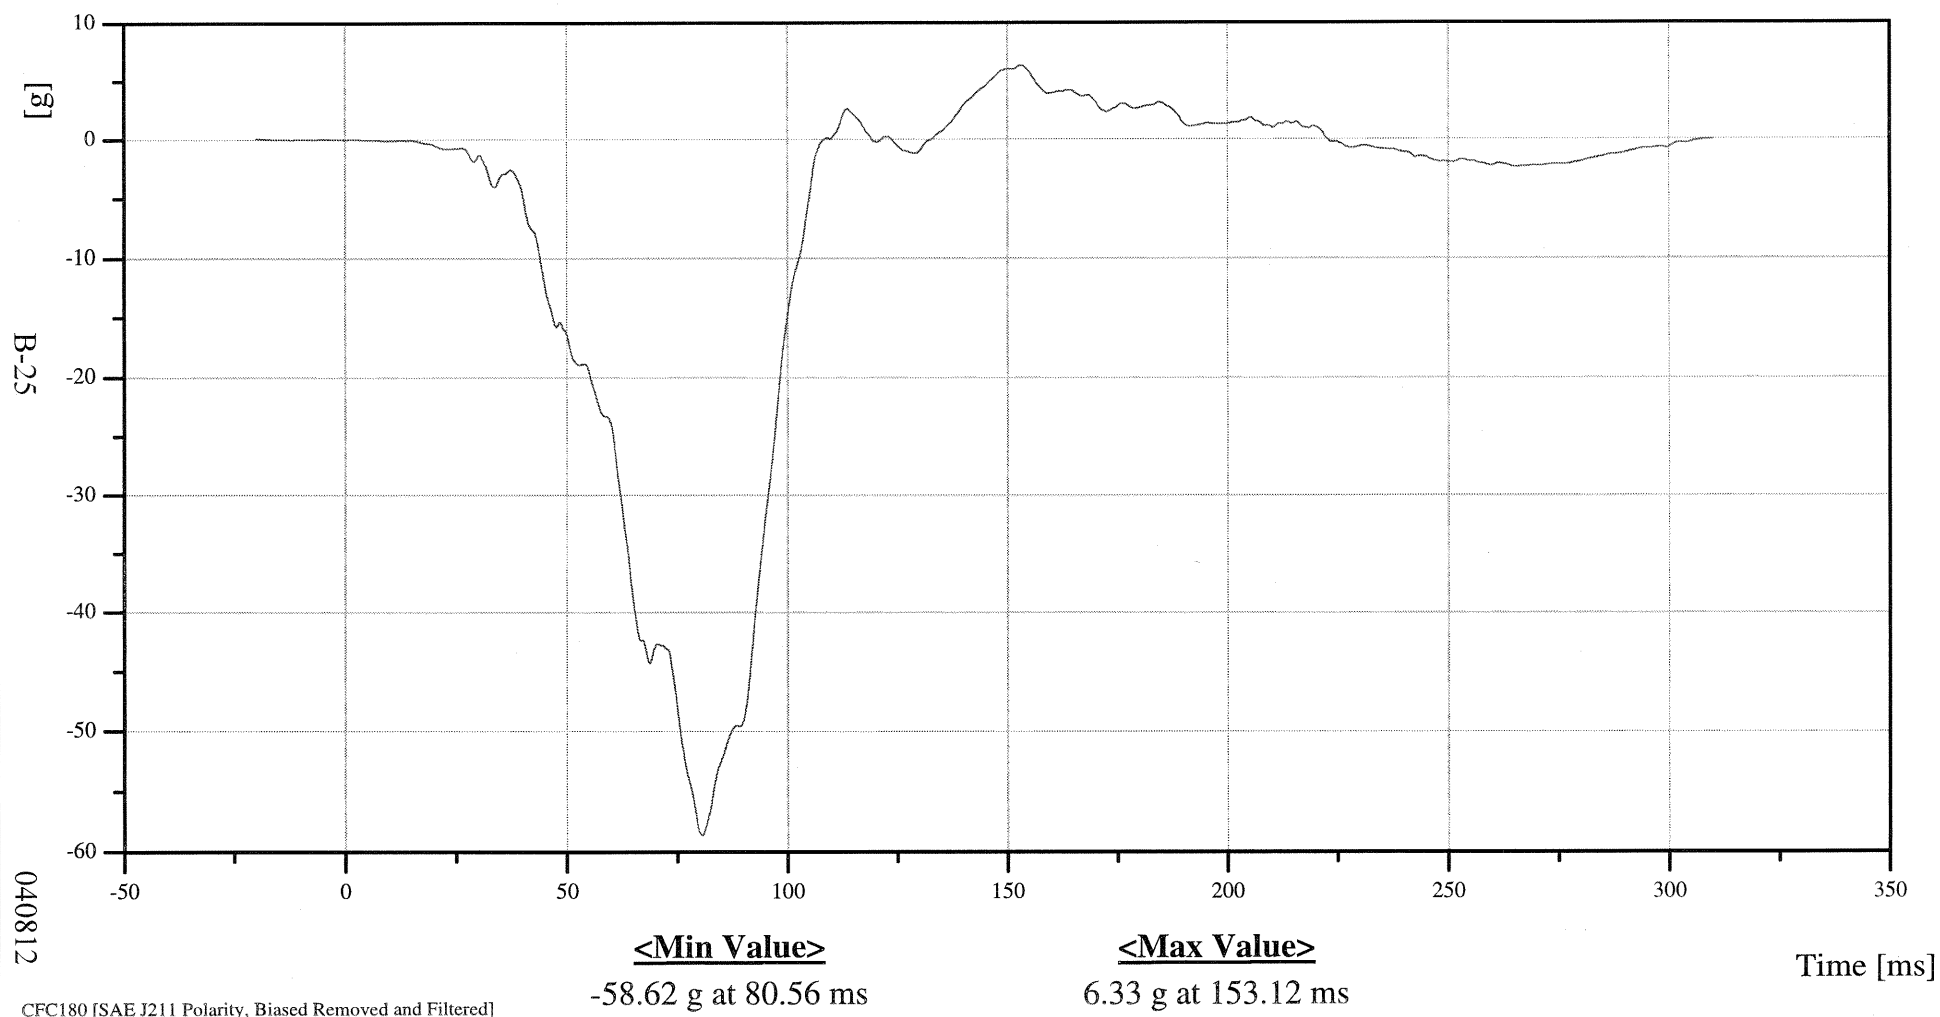



Transportation Research Center, Inc.

Chest Accel Red Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTYR1

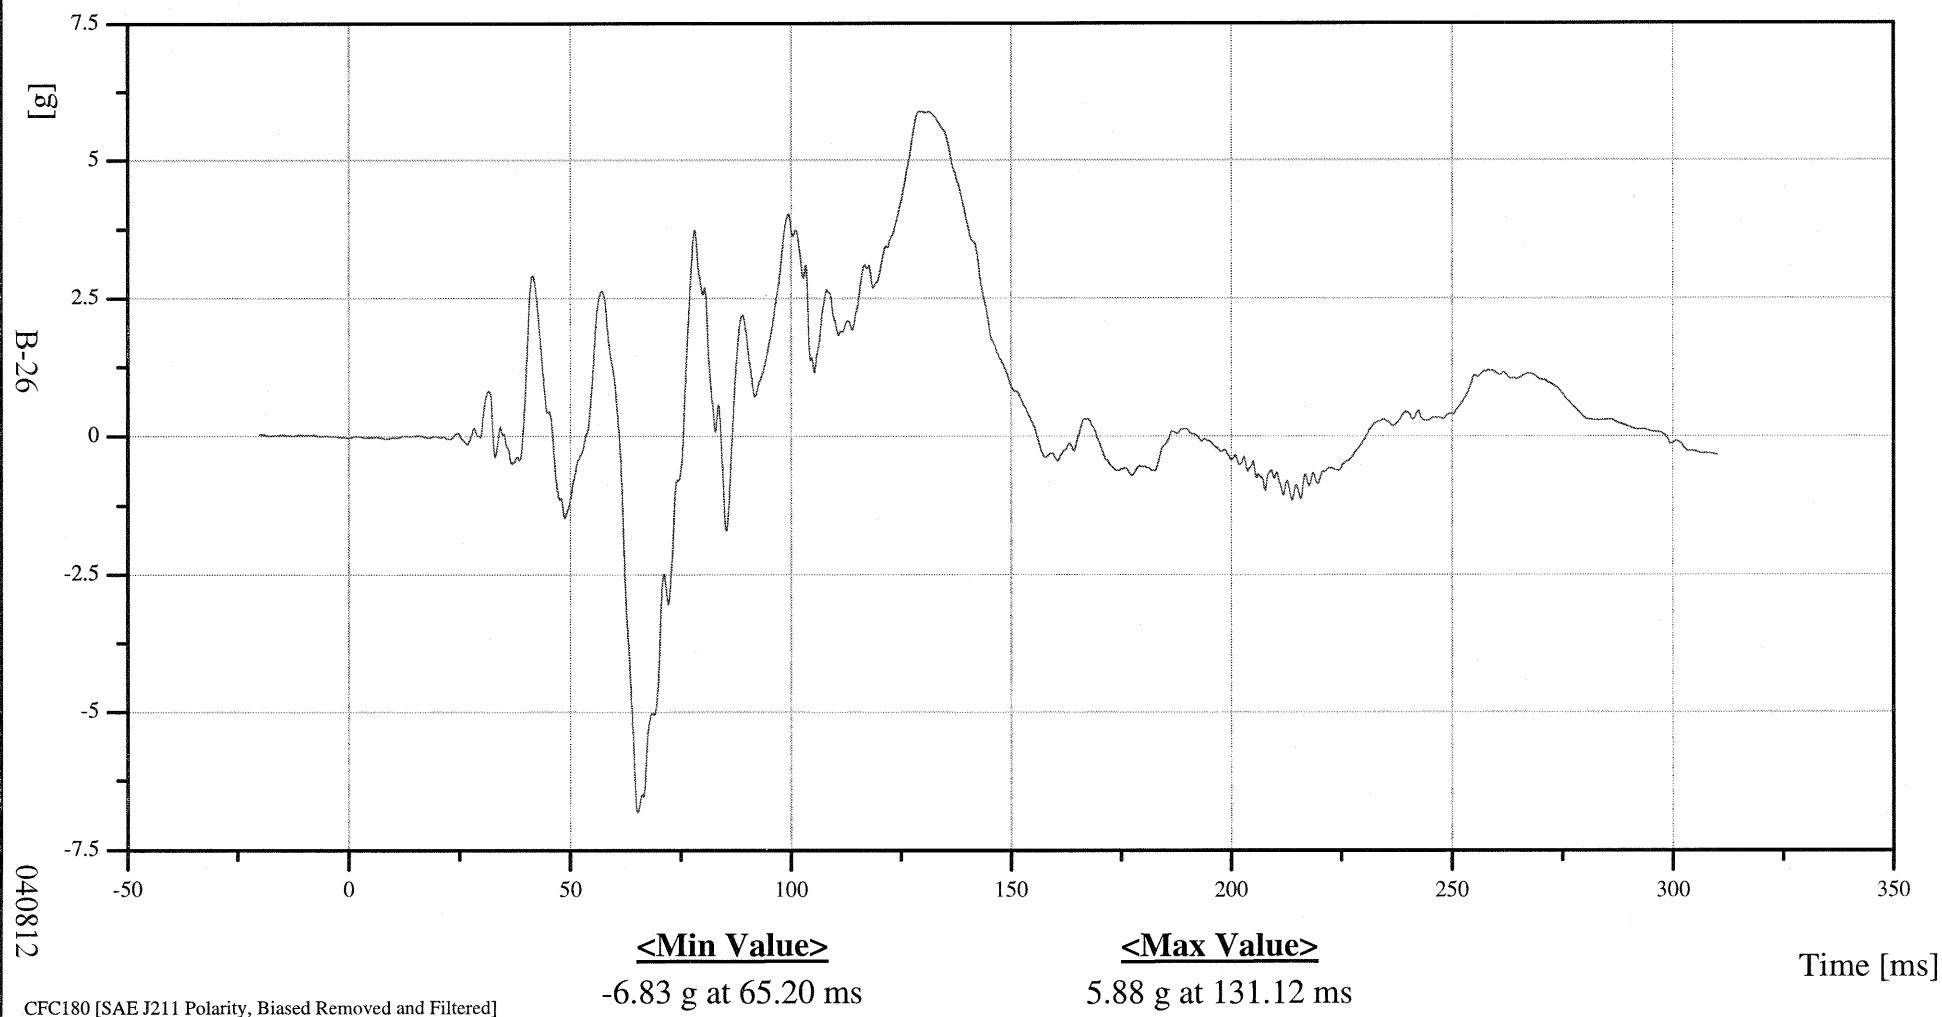



Transportation Research Center, Inc.

Chest Accel Red Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTZR1

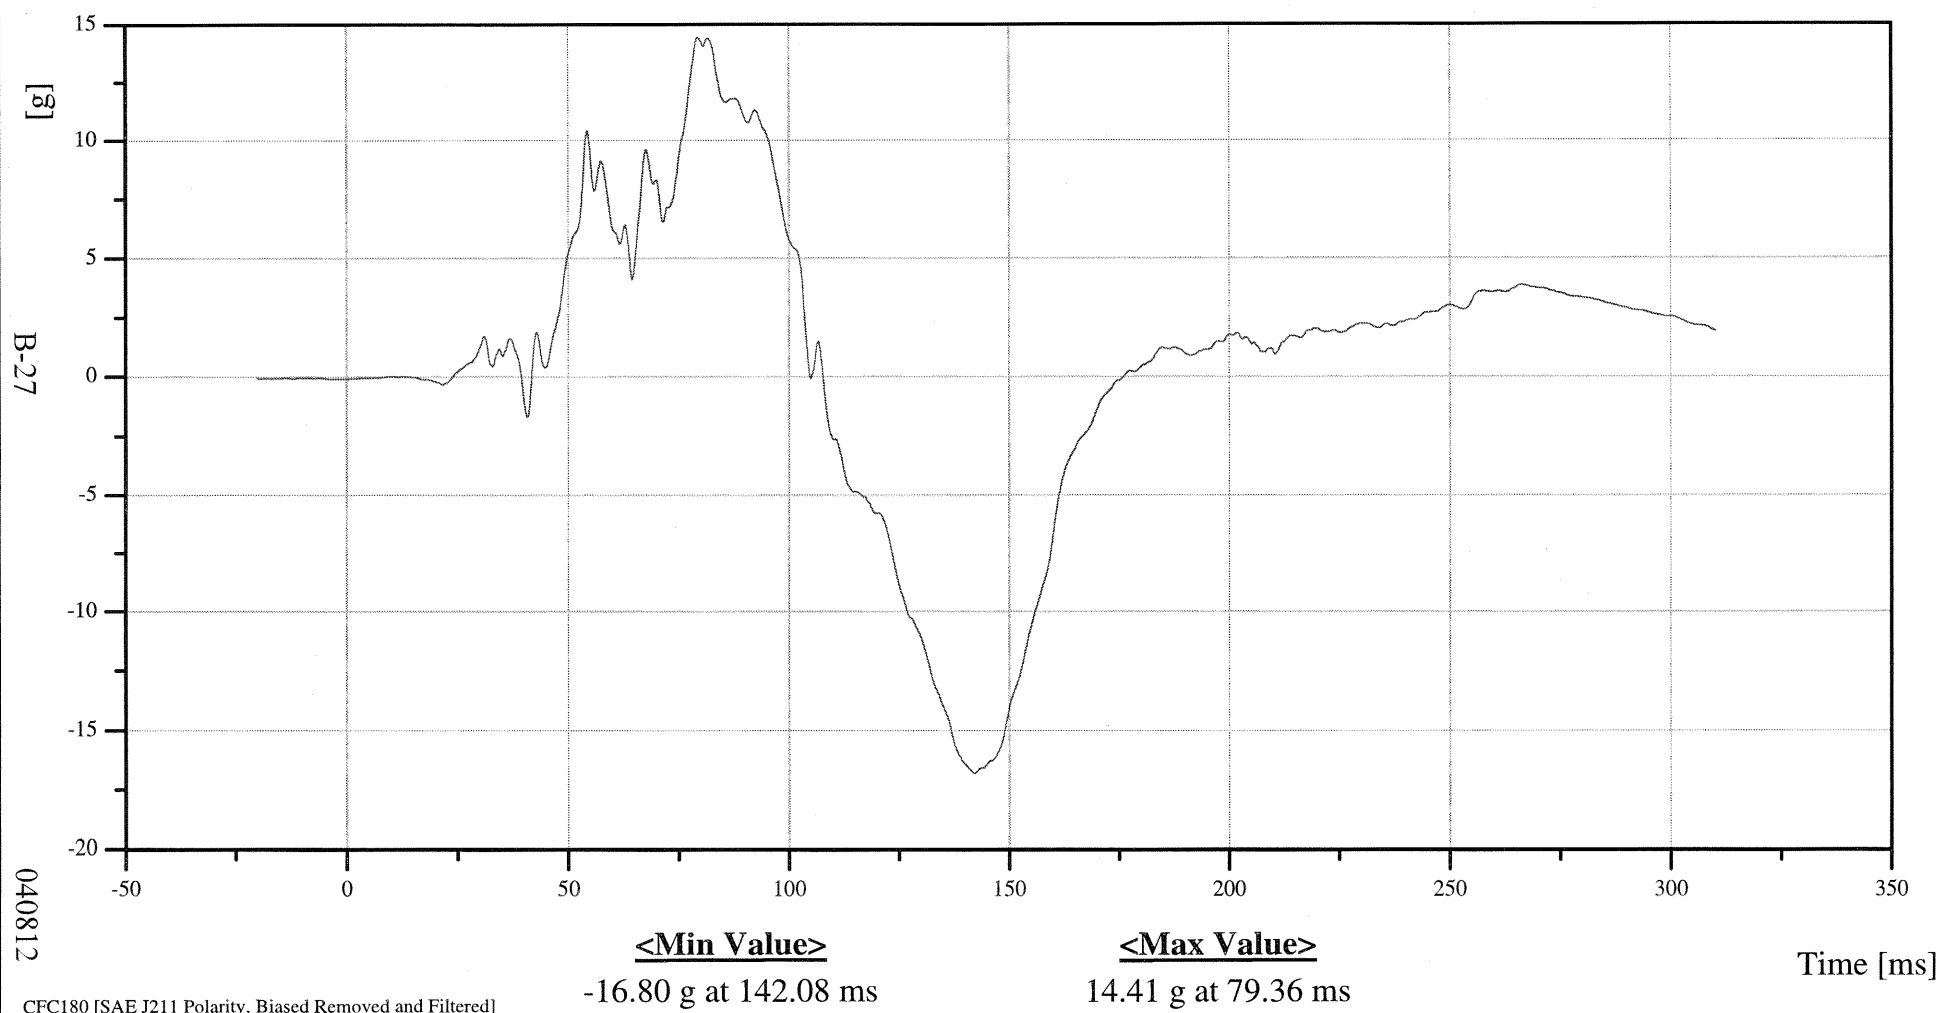



Transportation Research Center, Inc.

Chest Deflection X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXD1

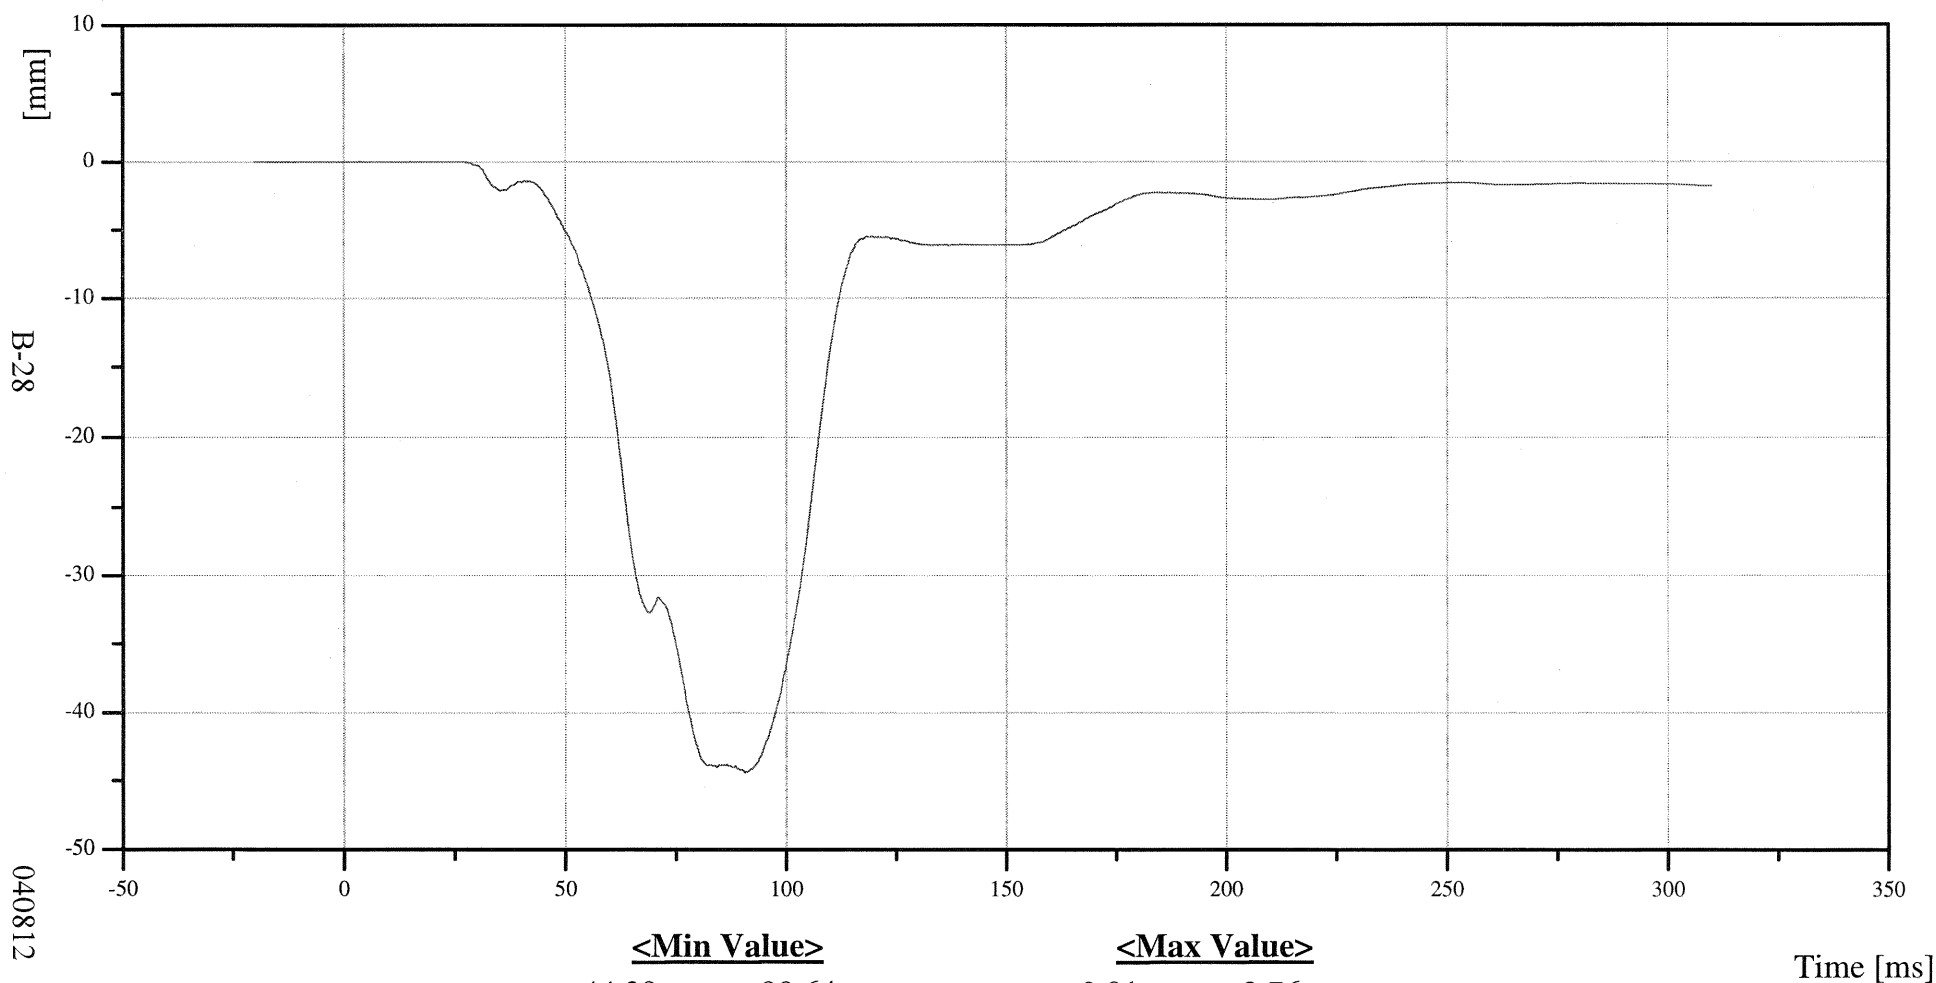

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVXG1

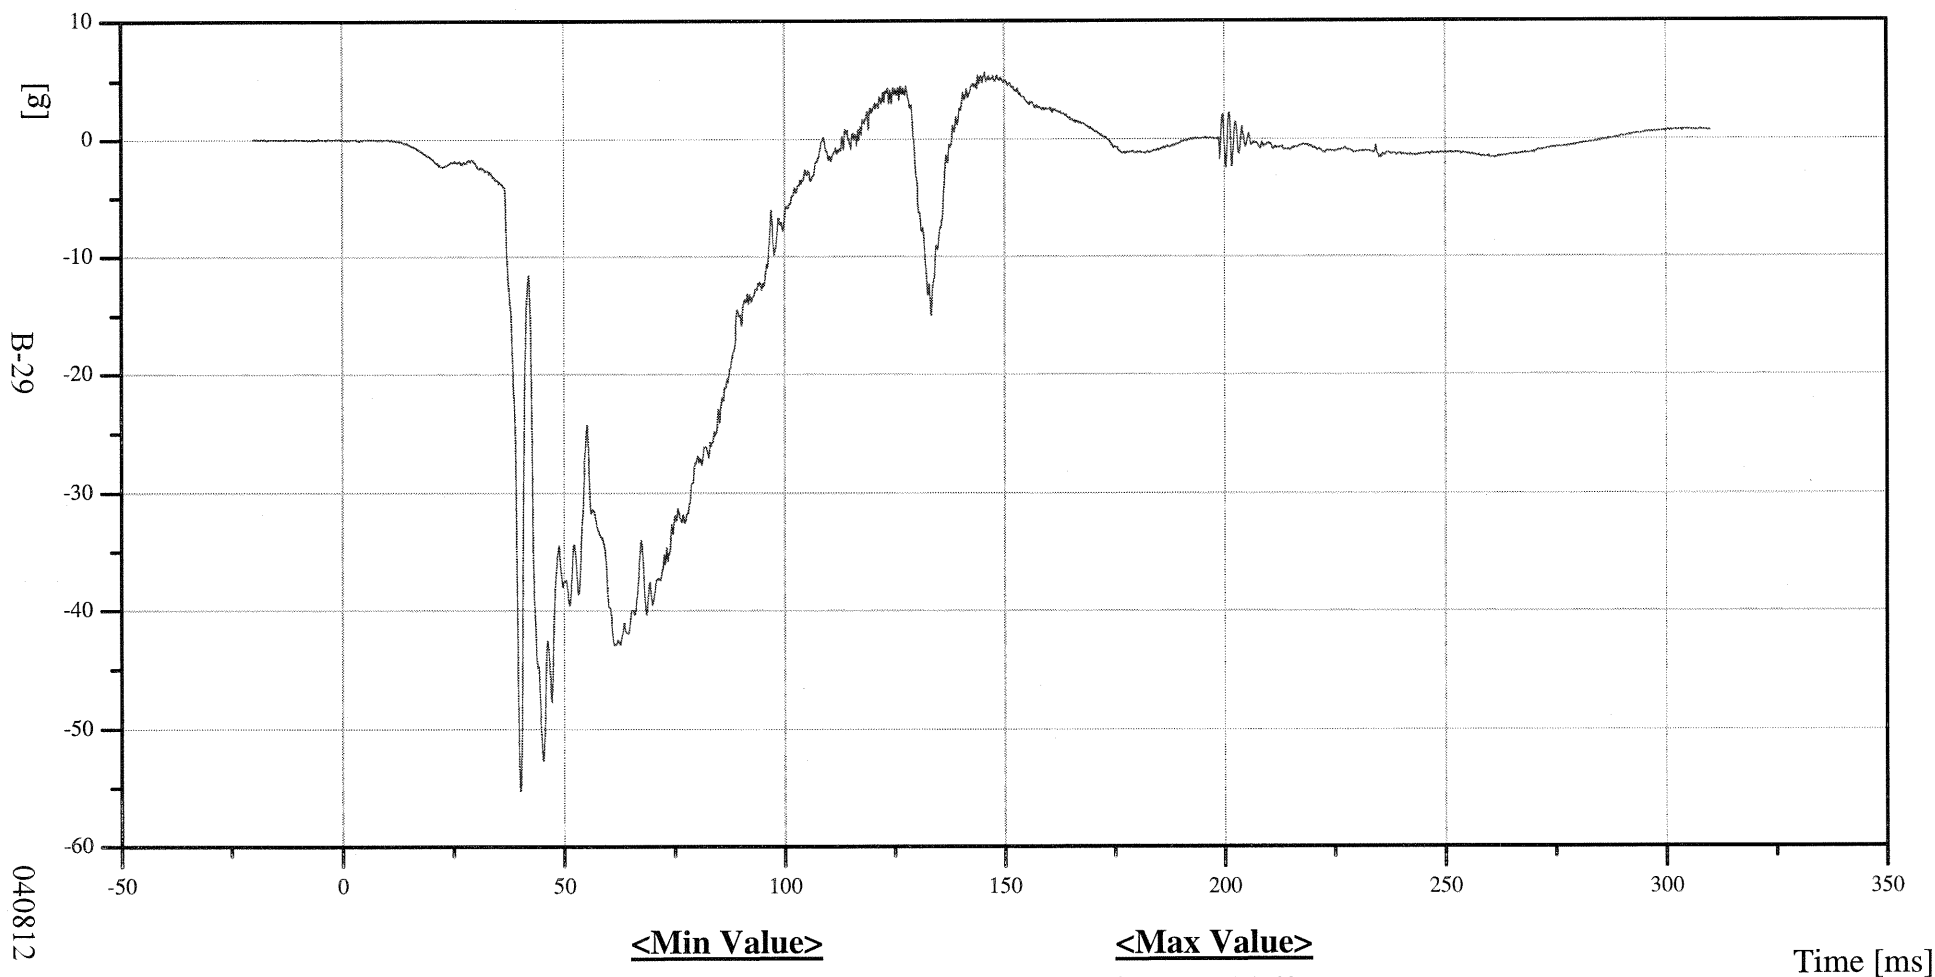

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVYG1

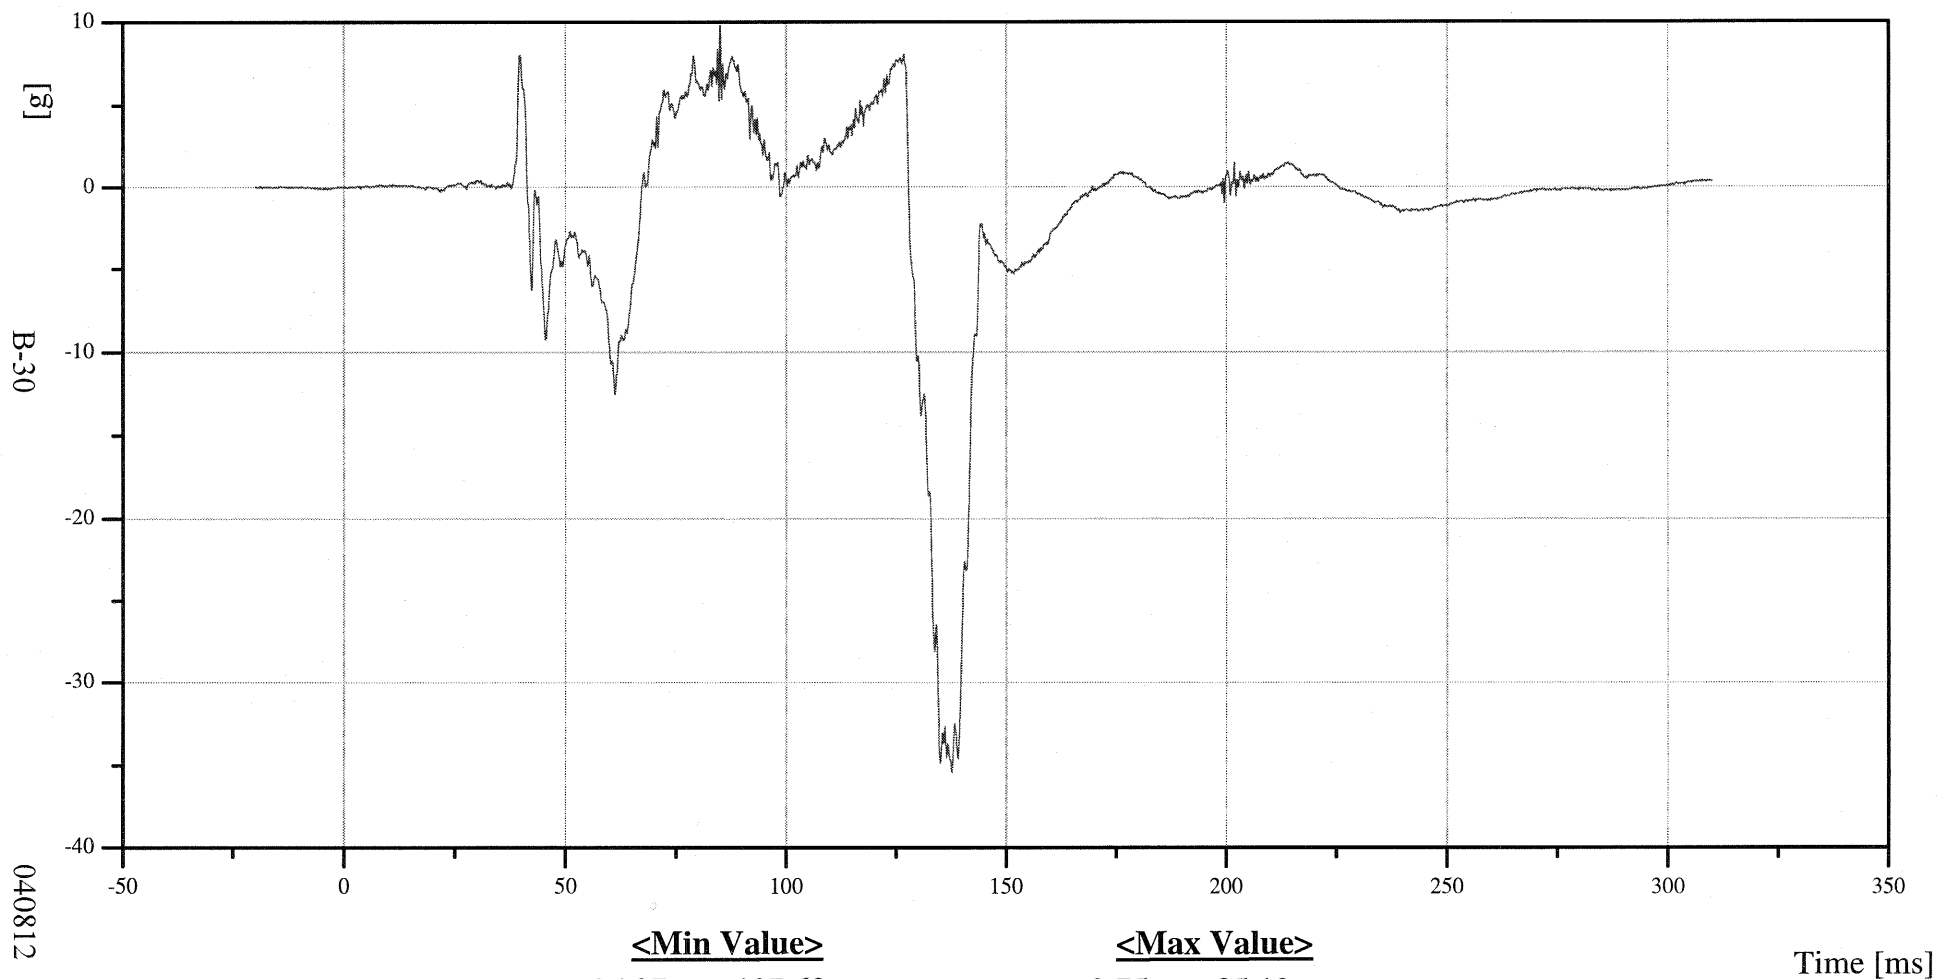

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVZG1

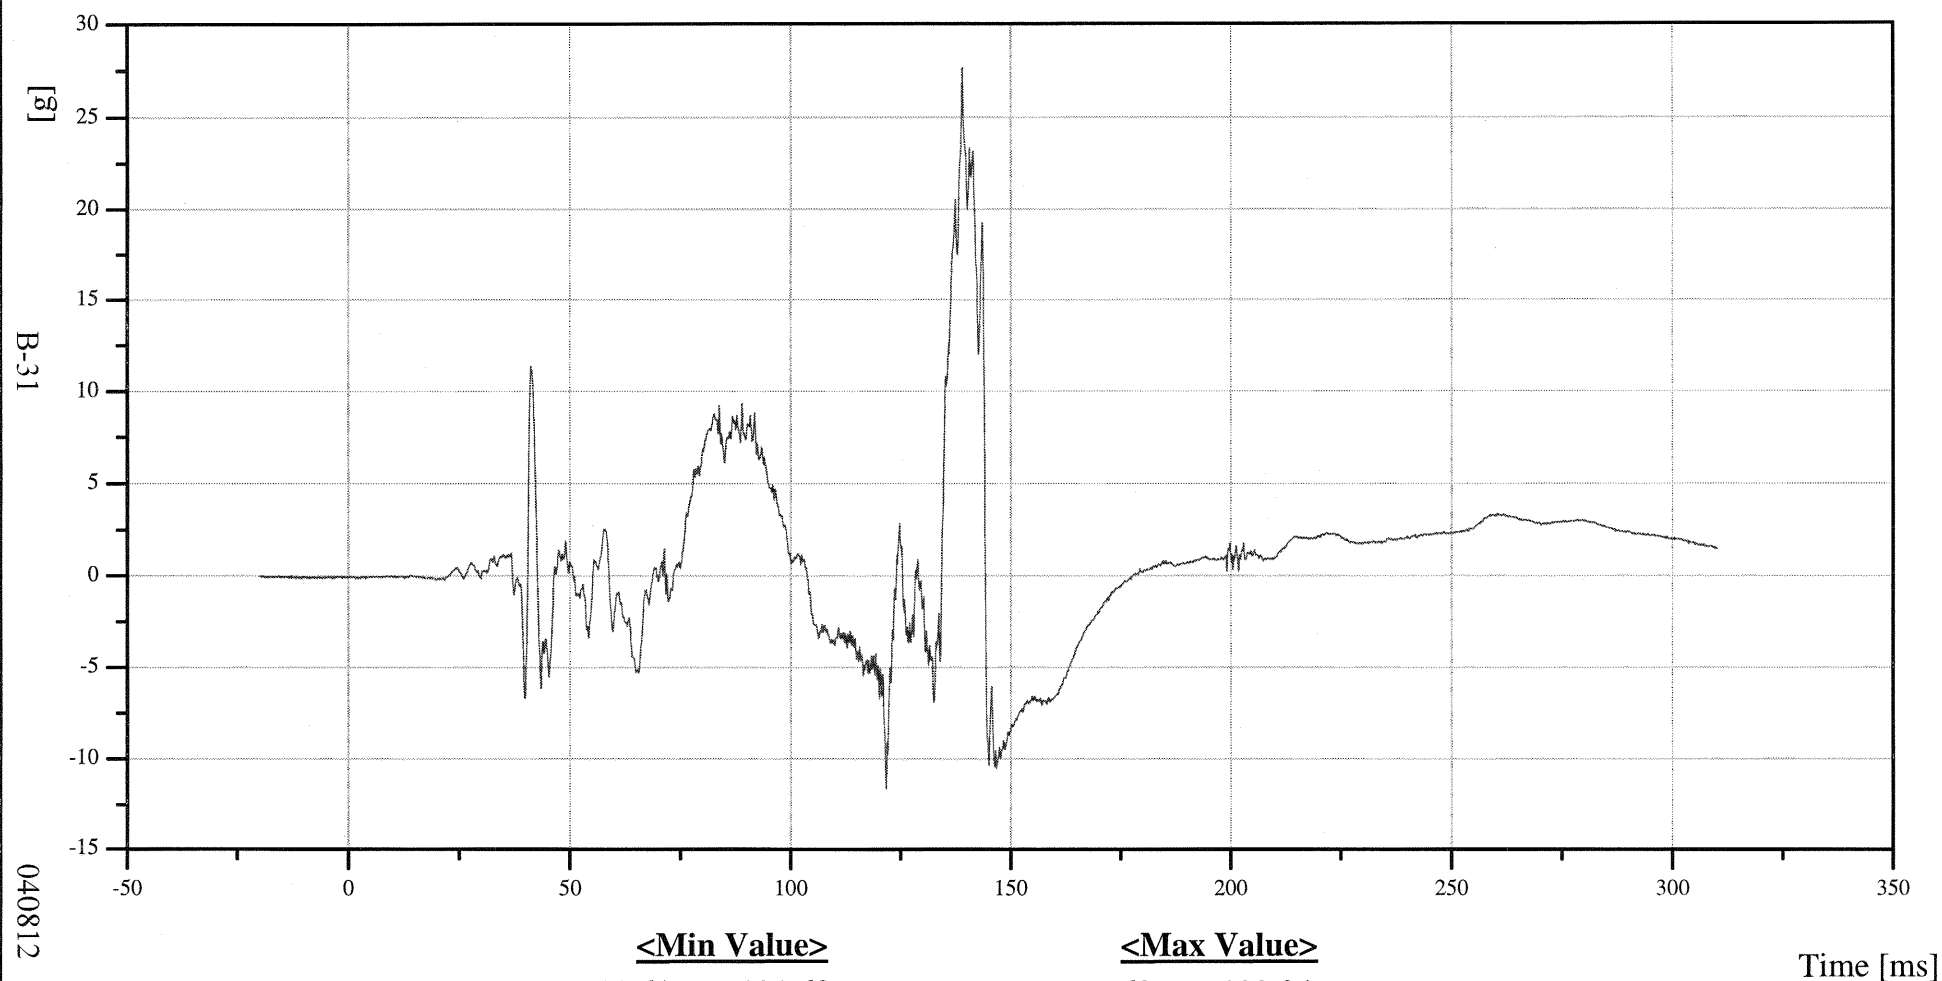

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVRG1

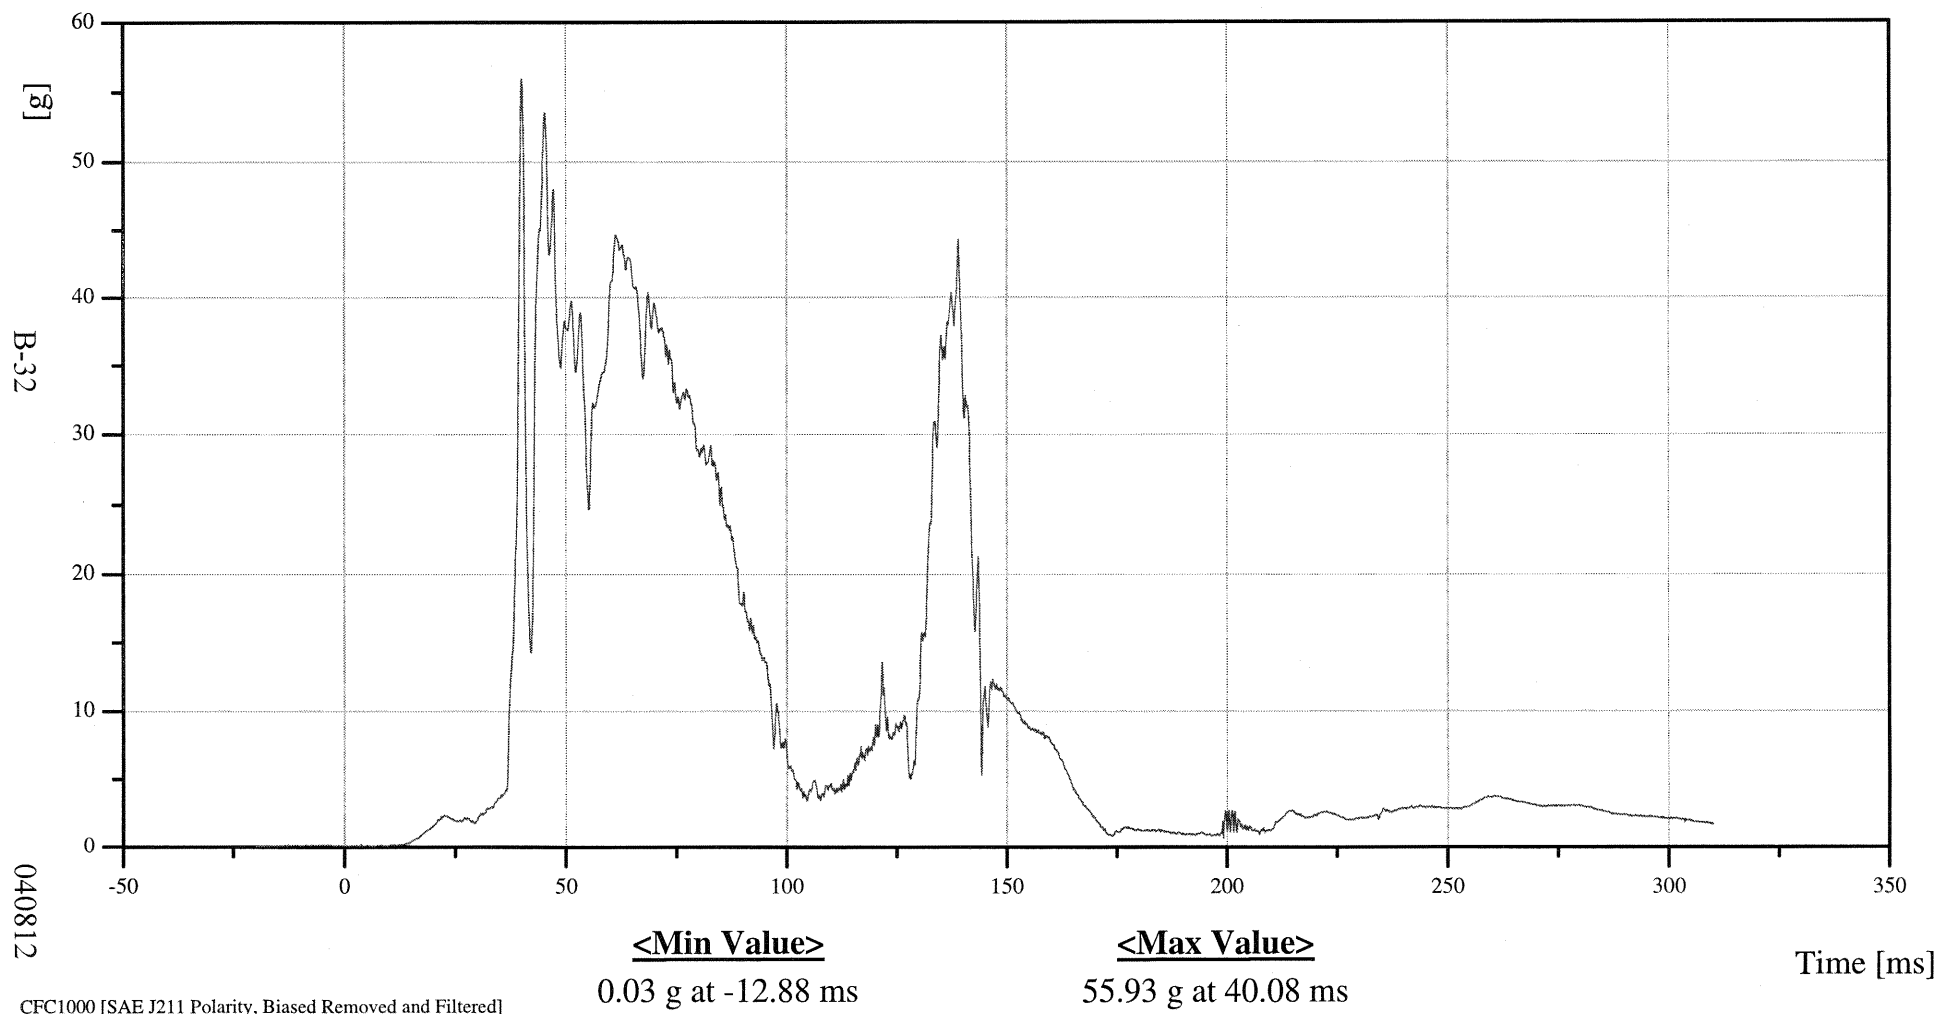



Transportation Research Center, Inc.

Left Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LFMZ1

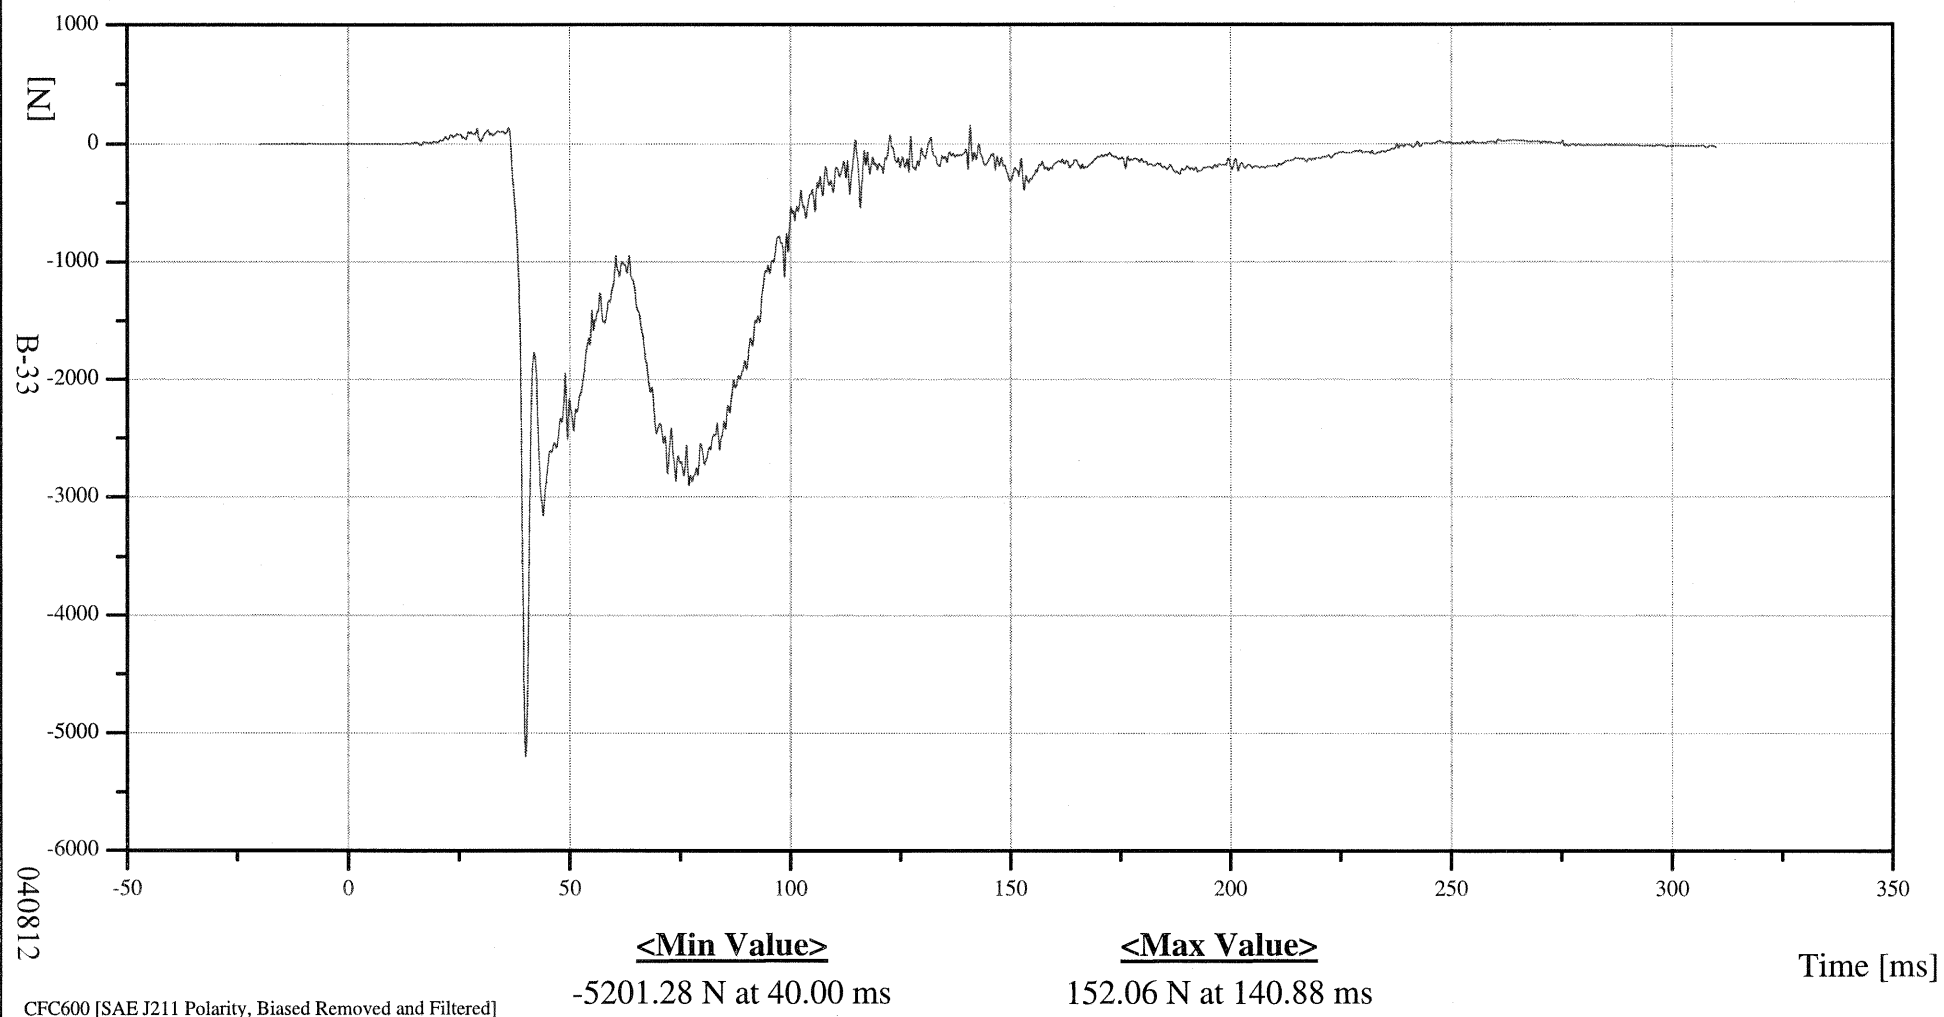



Transportation Research Center, Inc.

Left Knee Displacement

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

KNLXD1

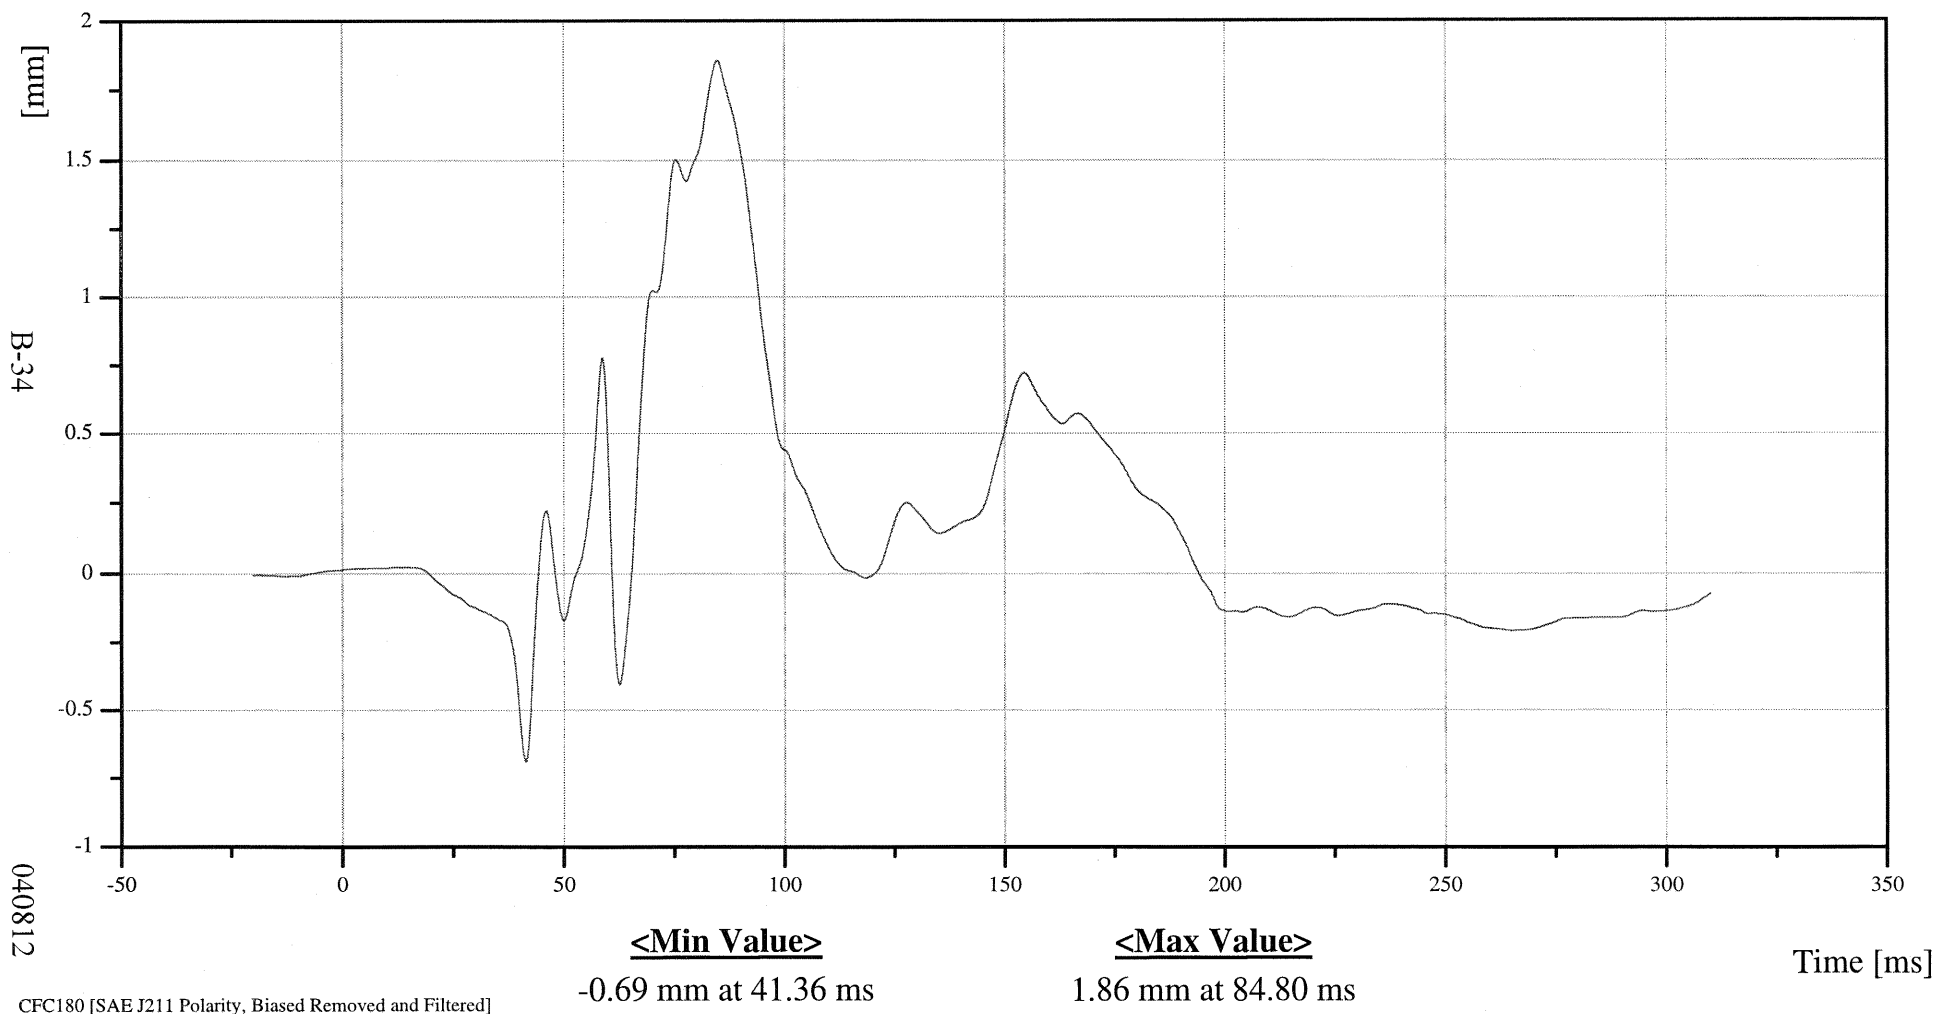



Transportation Research Center, Inc.

Left Upr Tibia Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLXF1

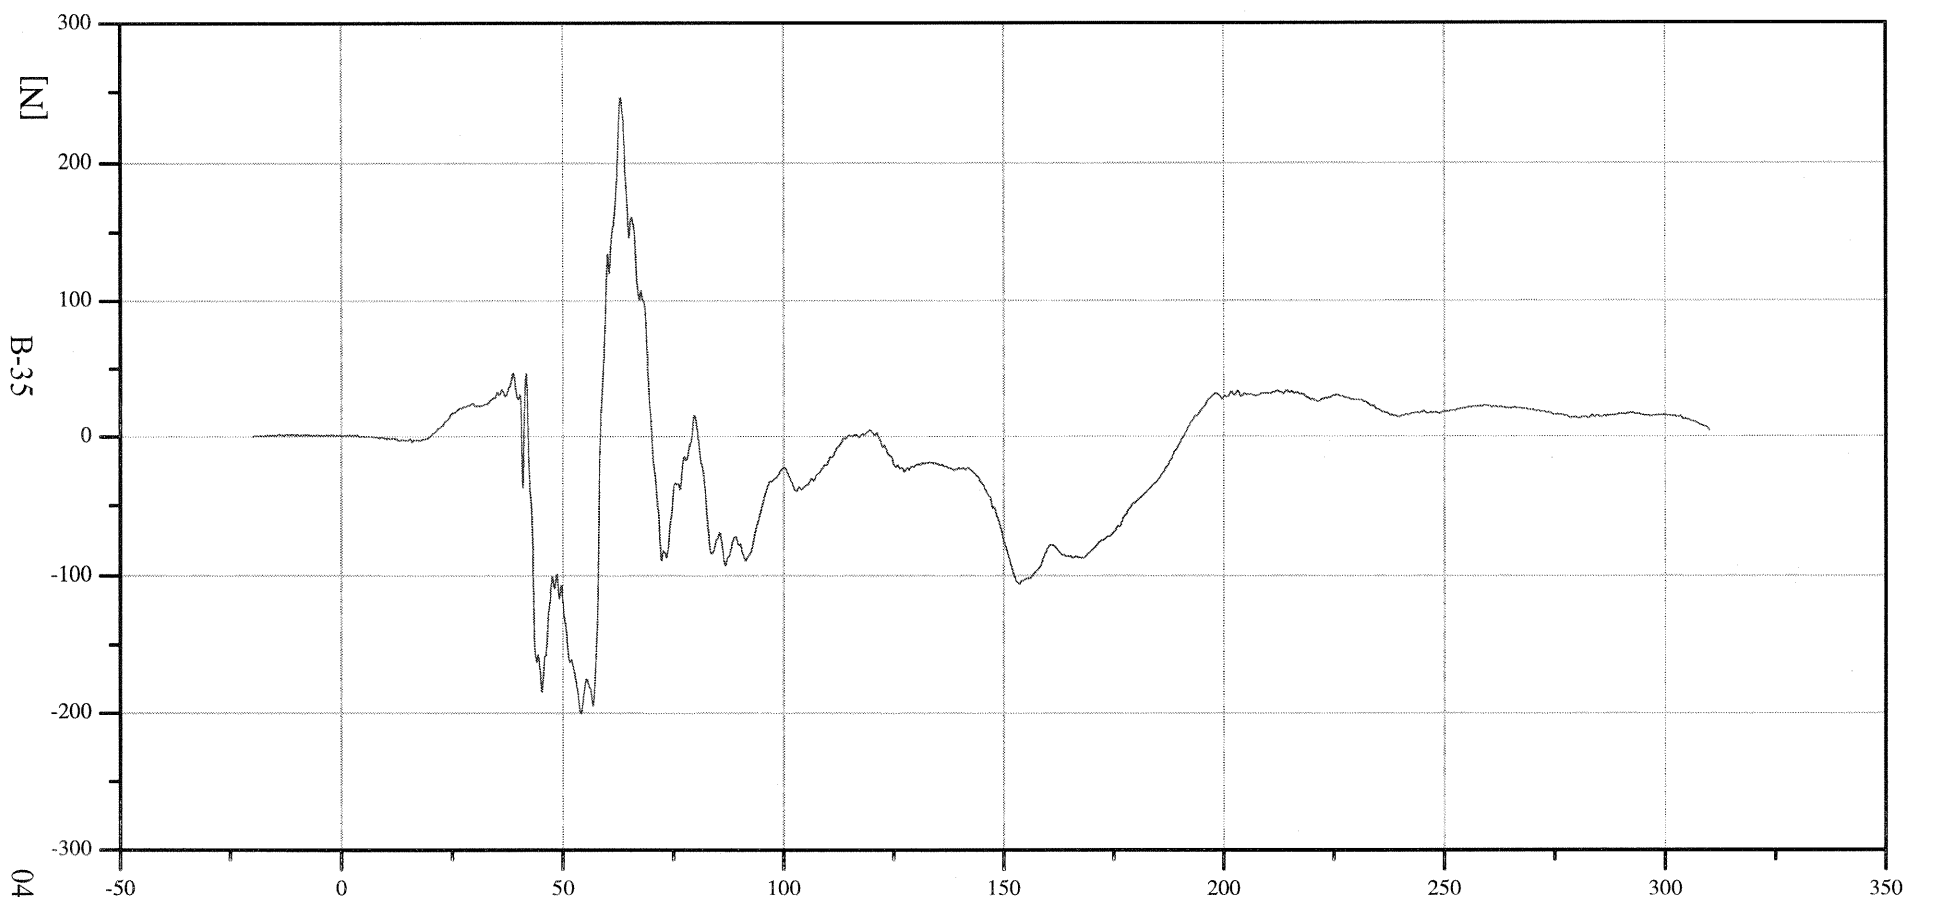

<Min Value>

-200.47 N at 54.08 ms

<Max Value>

245.83 N at 63.12 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Up'r Tibia Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLZF1

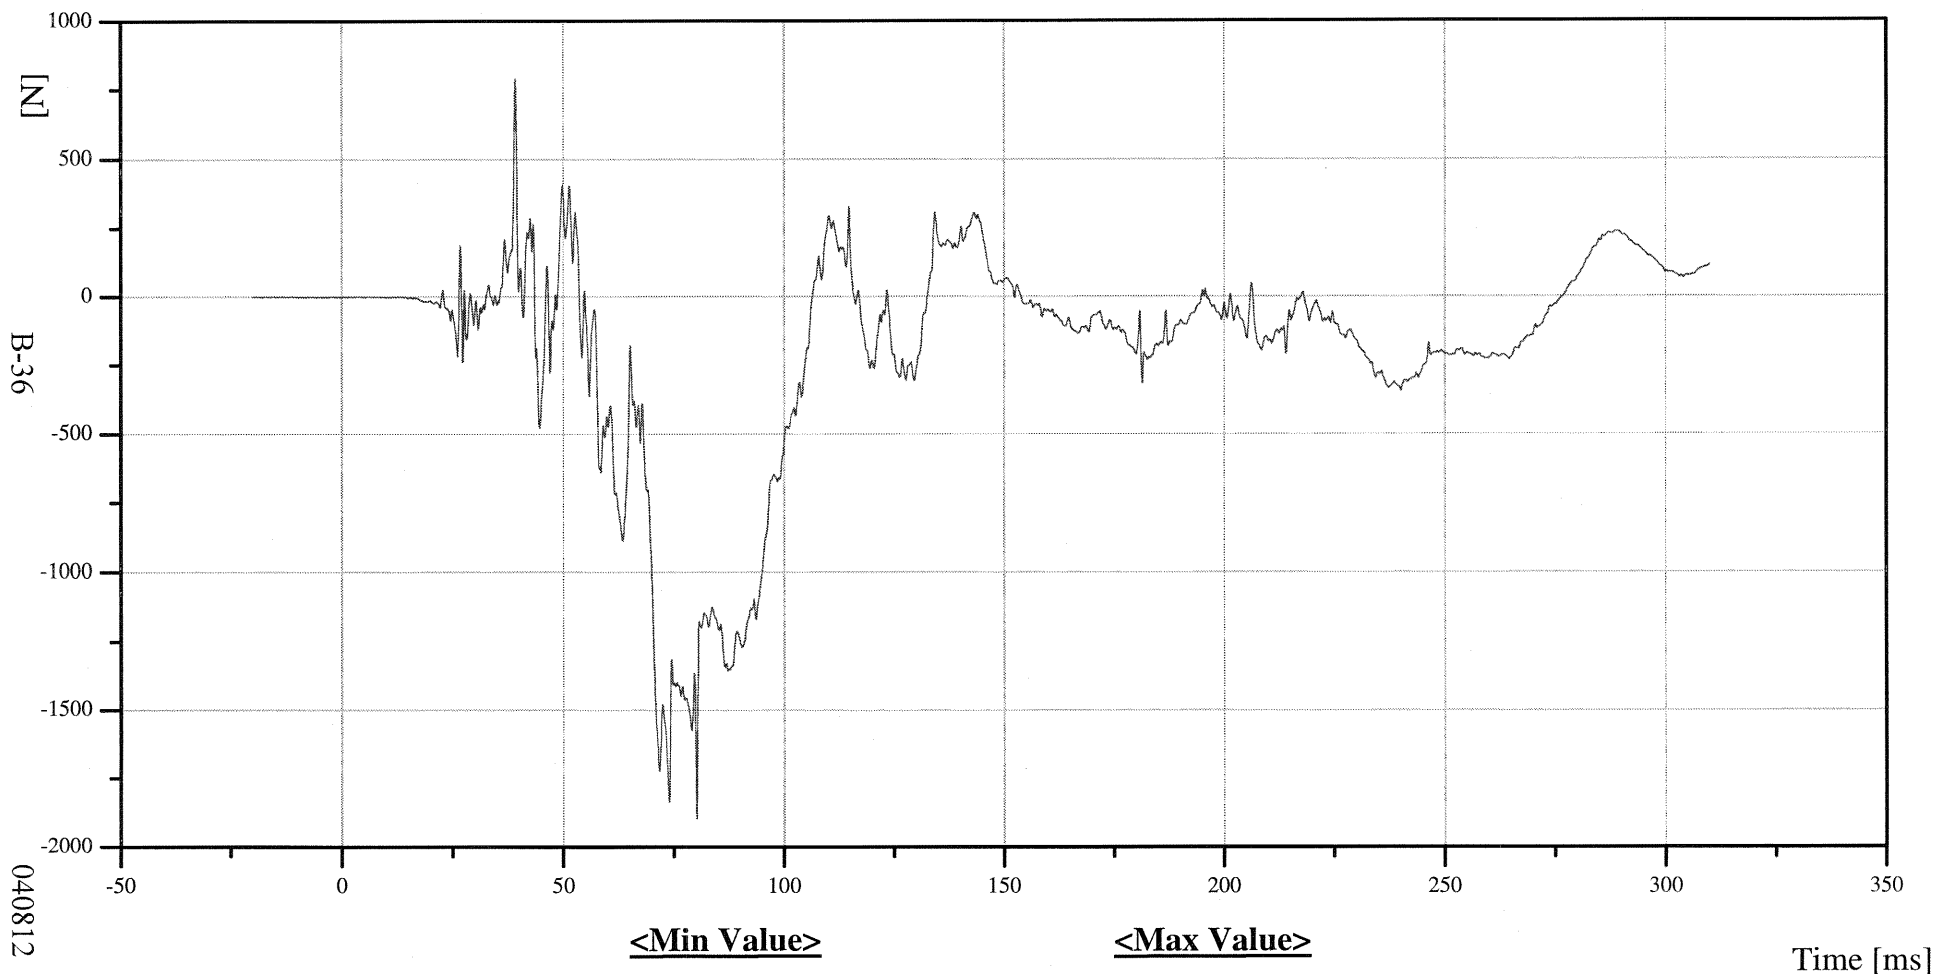

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Upr Tibia Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLXM1

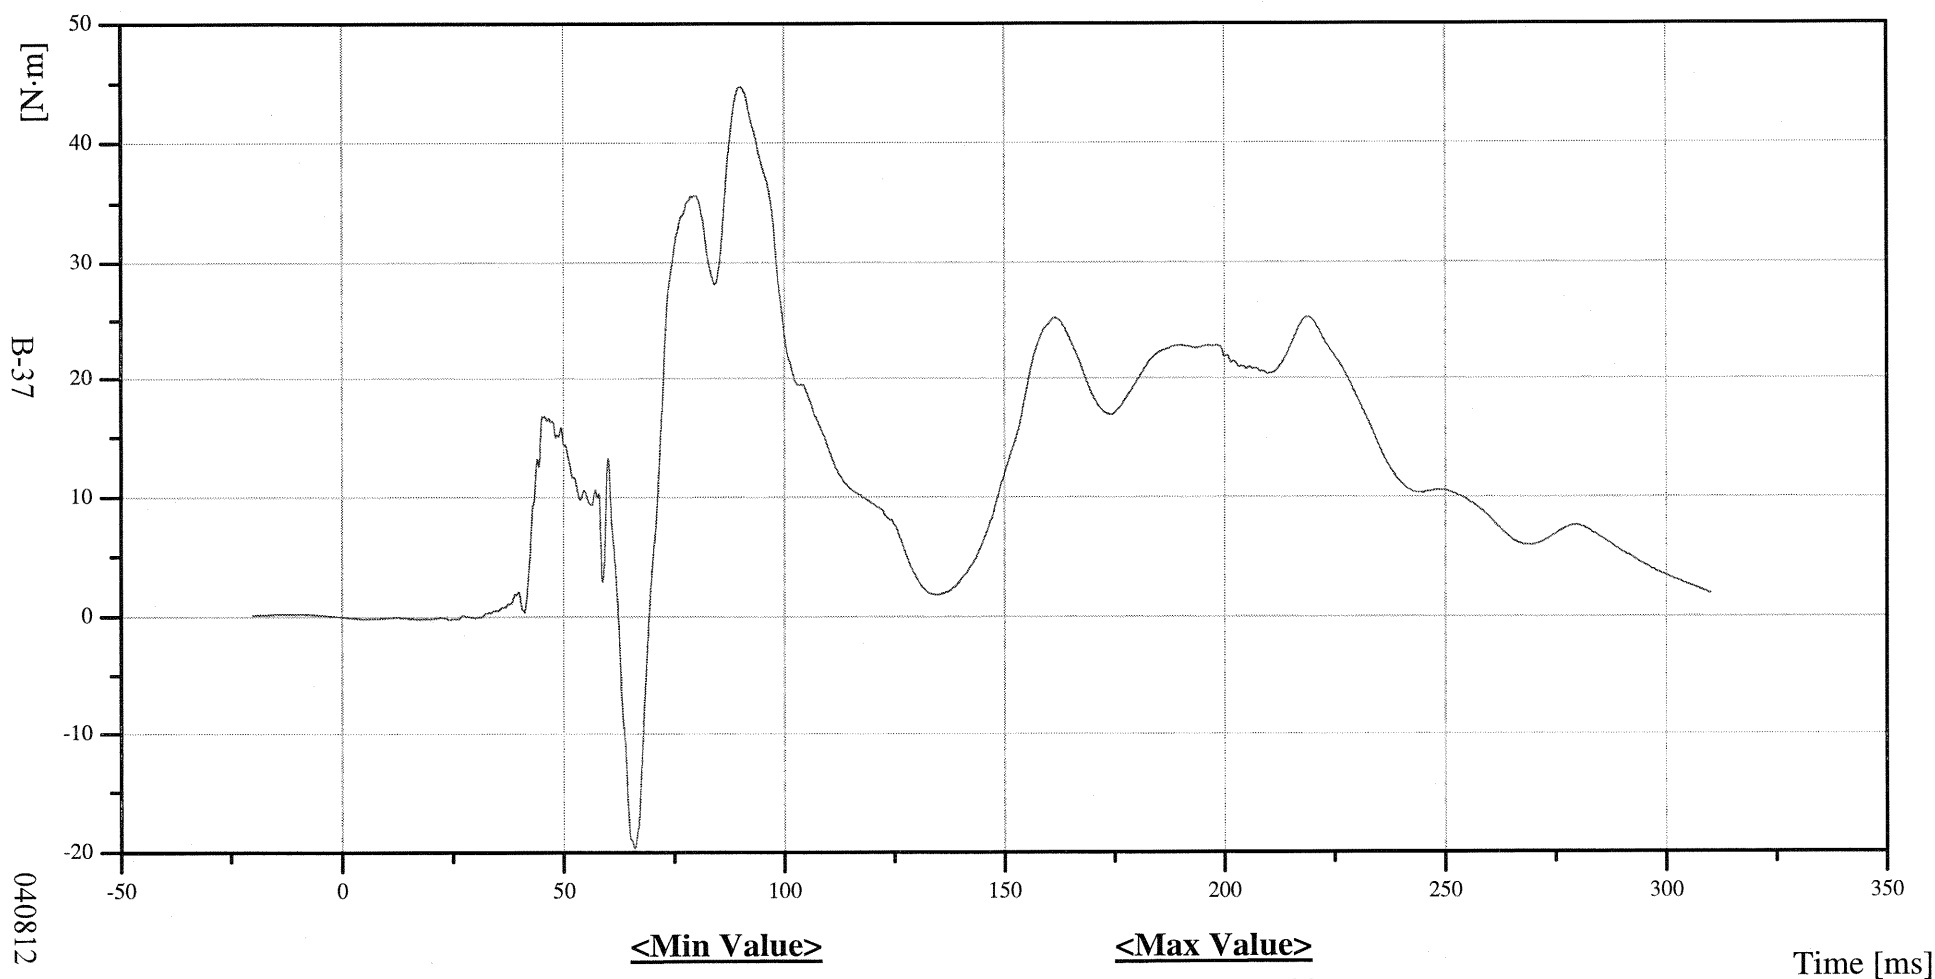

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Upr Tibia Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLYM1

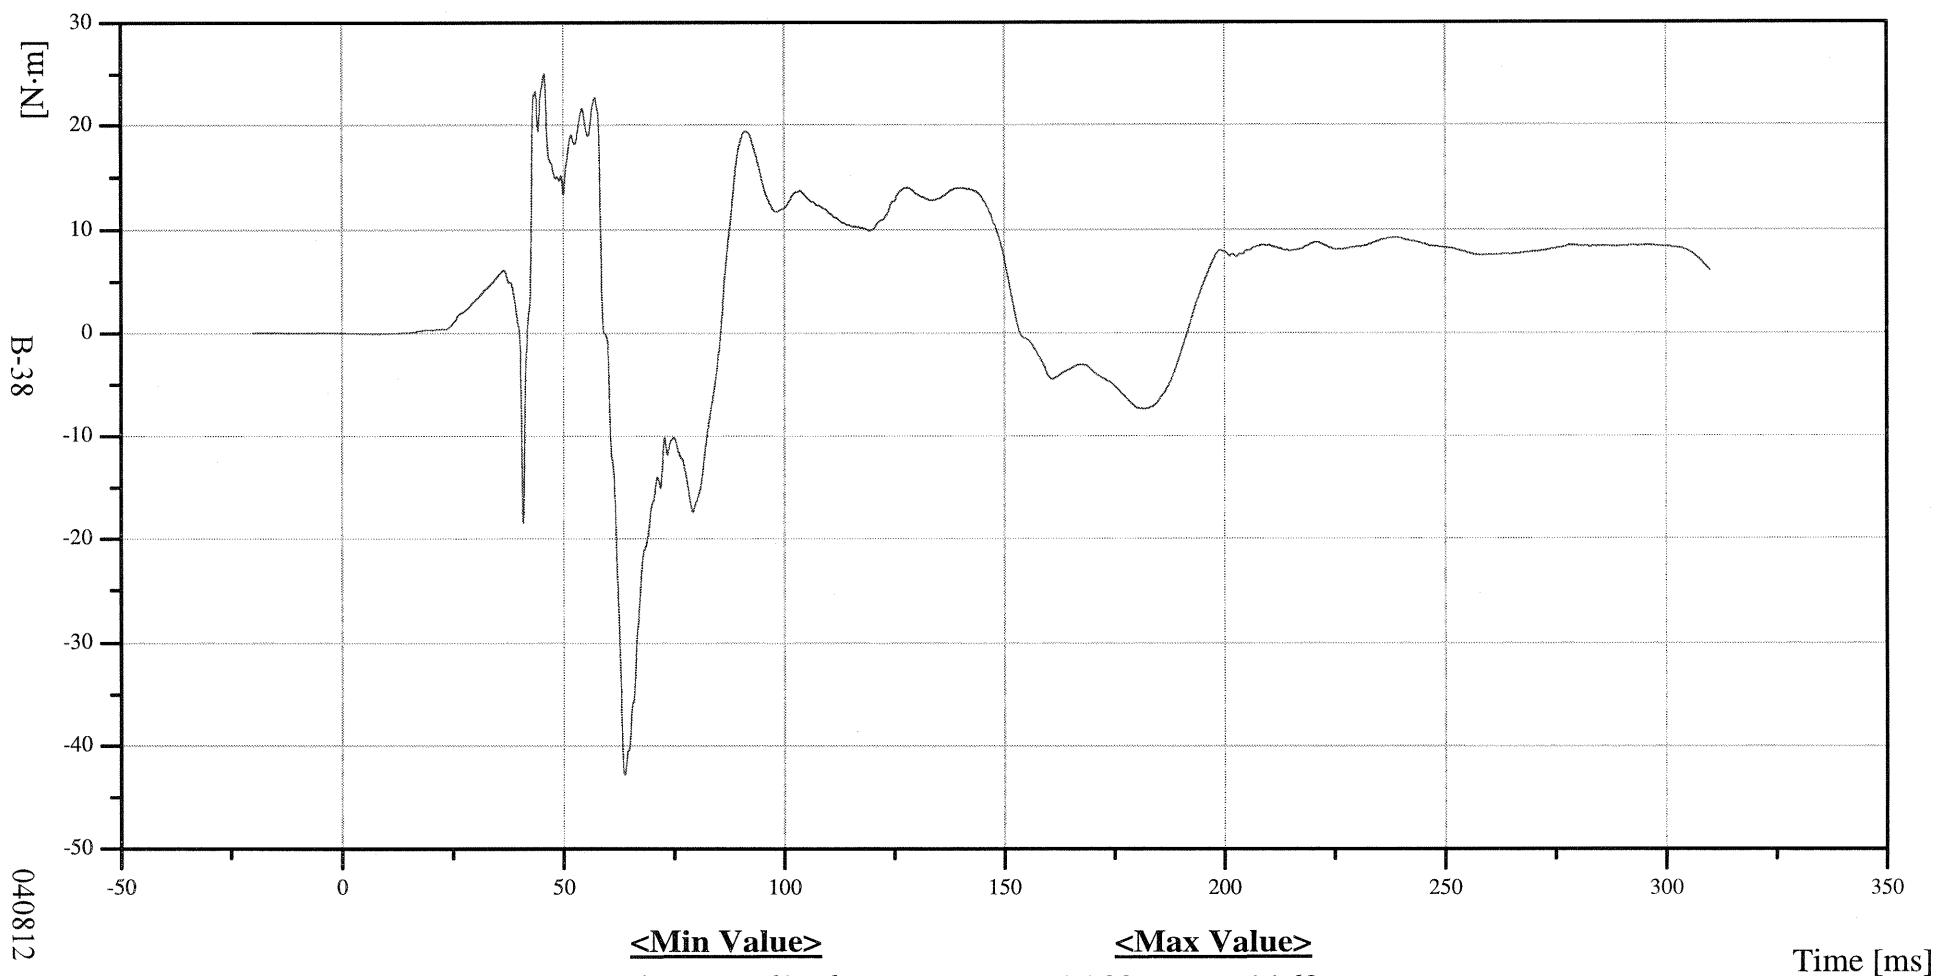

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Tibia Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLXG1

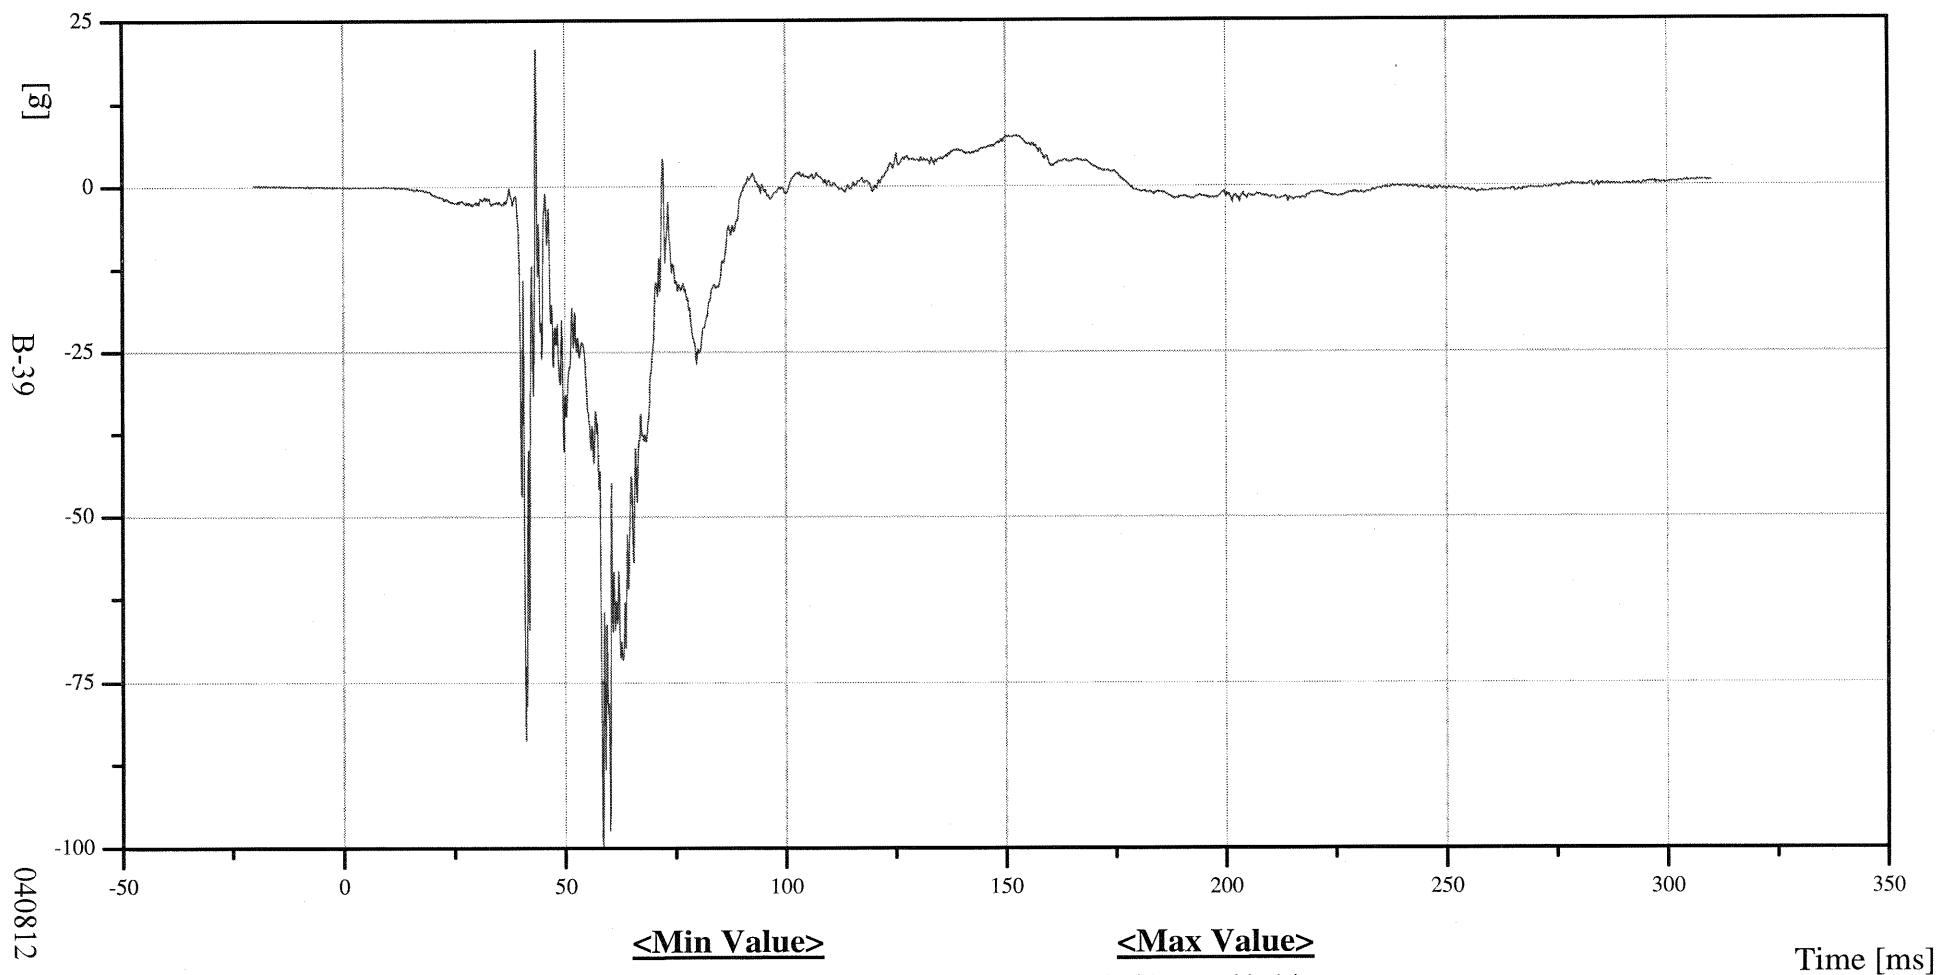

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Tibia Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBLYG1

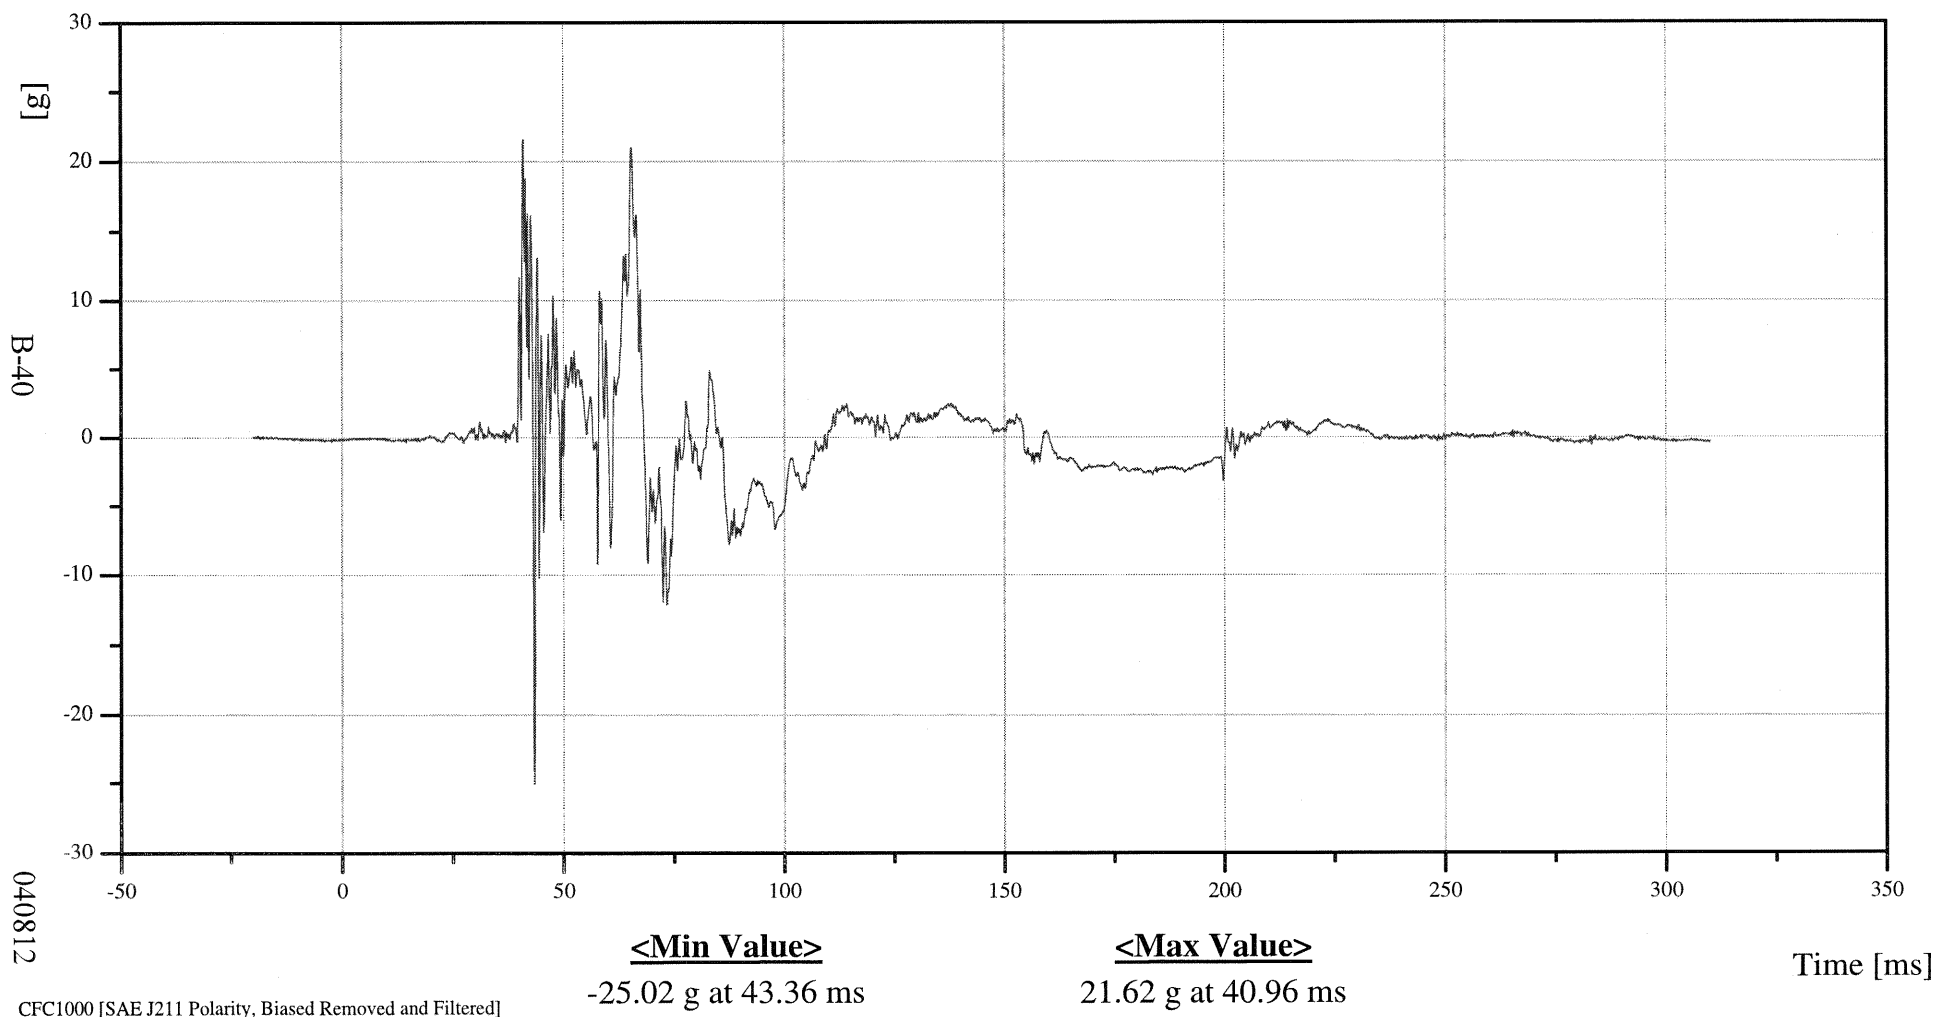



Transportation Research Center, Inc.

Left Lwr Tibia Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANLXF1

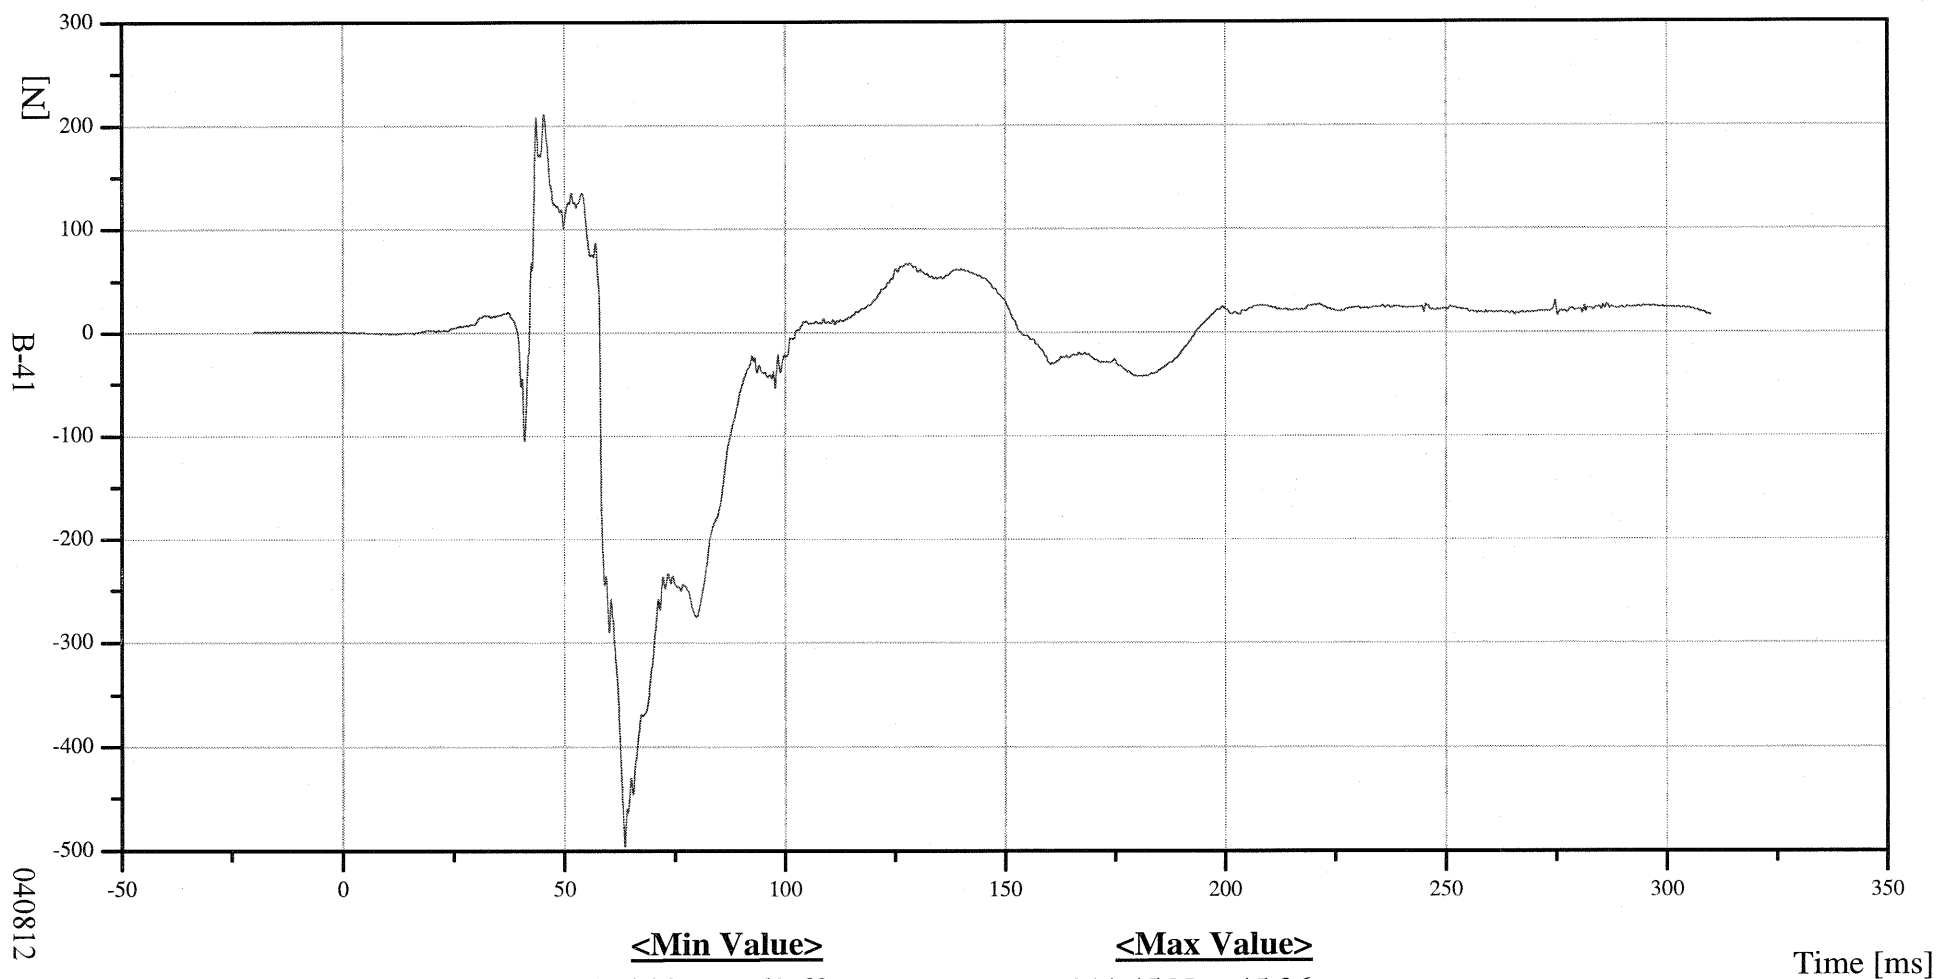

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Lwr Tibia Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANLYF1

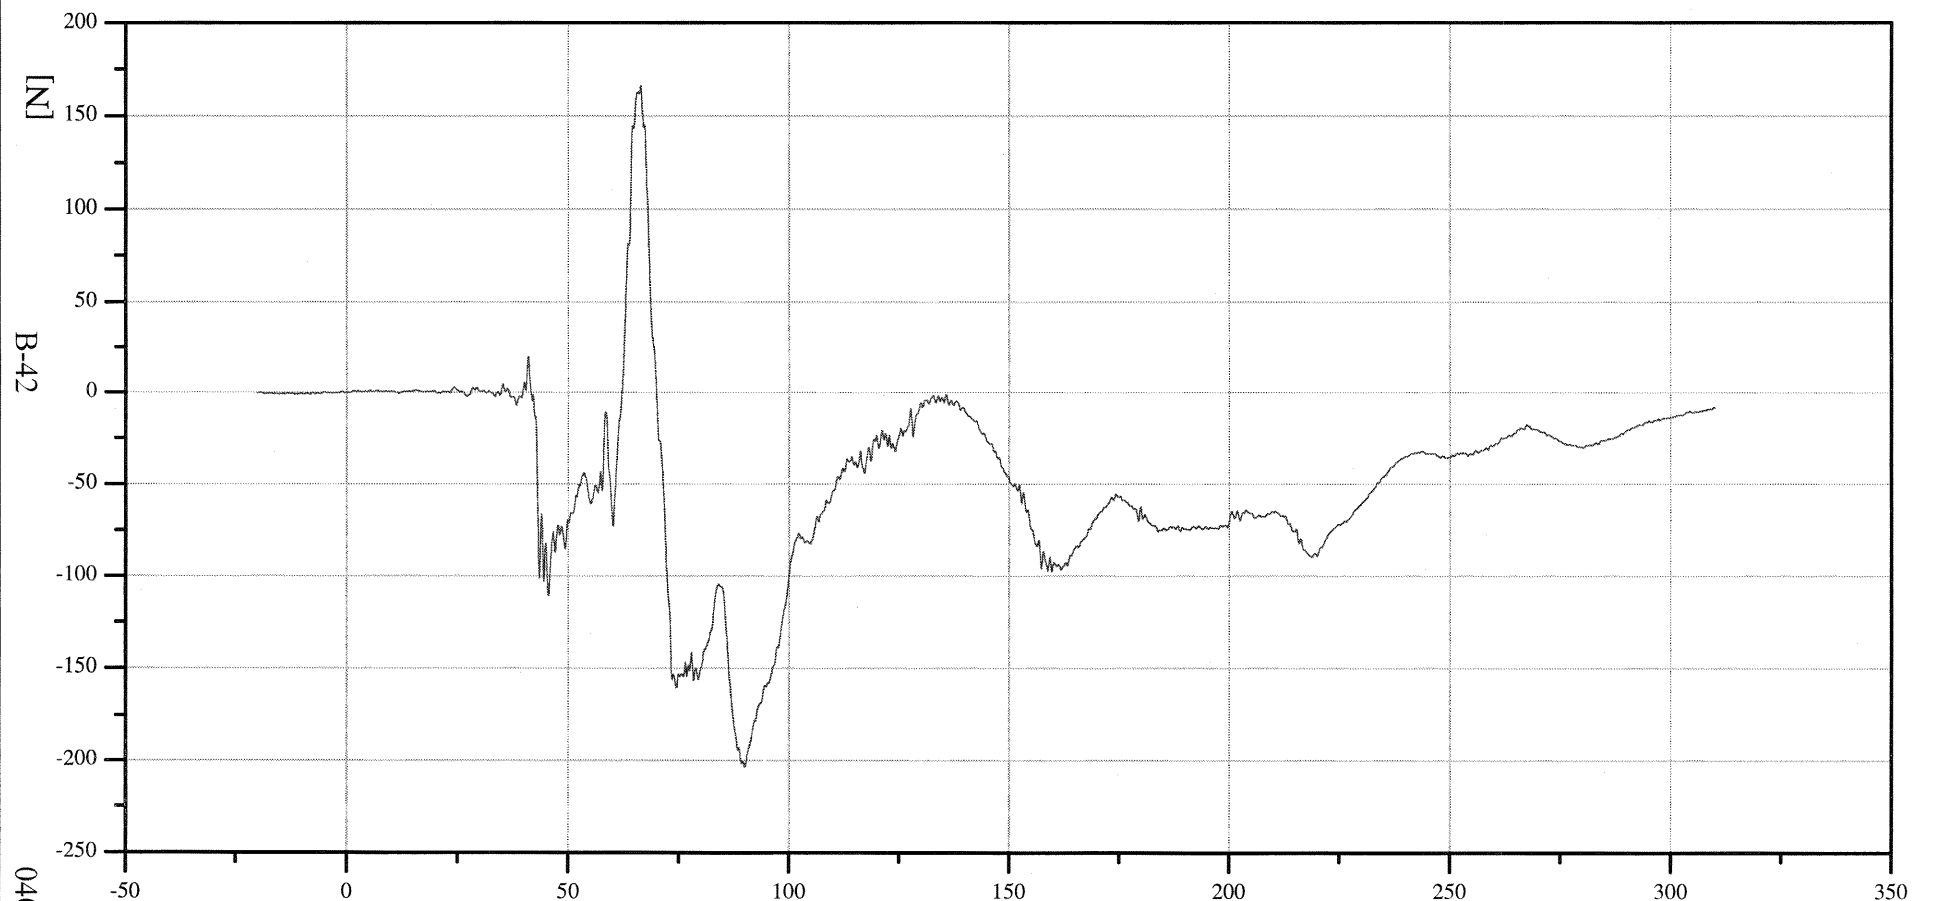

<Min Value>

<Max Value>

-203.44 N at 90.00 ms

165.92 N at 66.40 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Lwr Tibia Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANLZF1

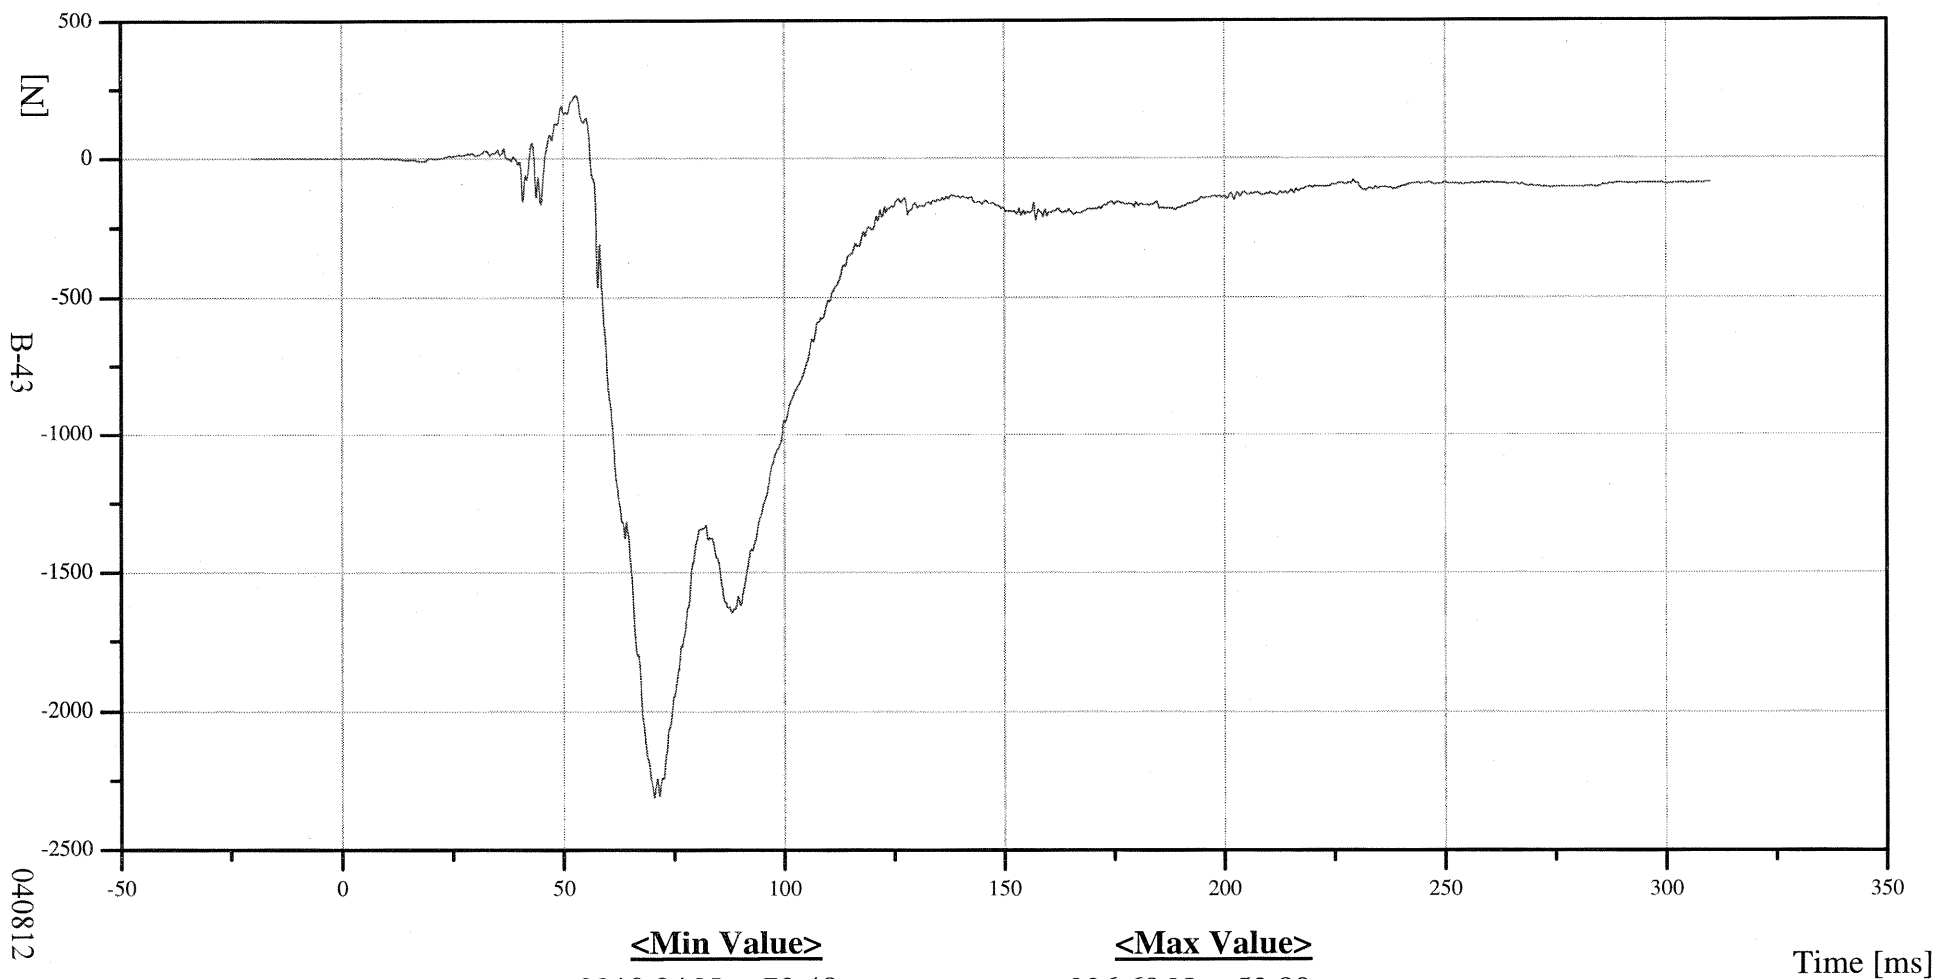

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]

-2310.84 N at 70.48 ms

226.69 N at 52.80 ms



Transportation Research Center, Inc.

Left Lwr Tibia Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANLXM1

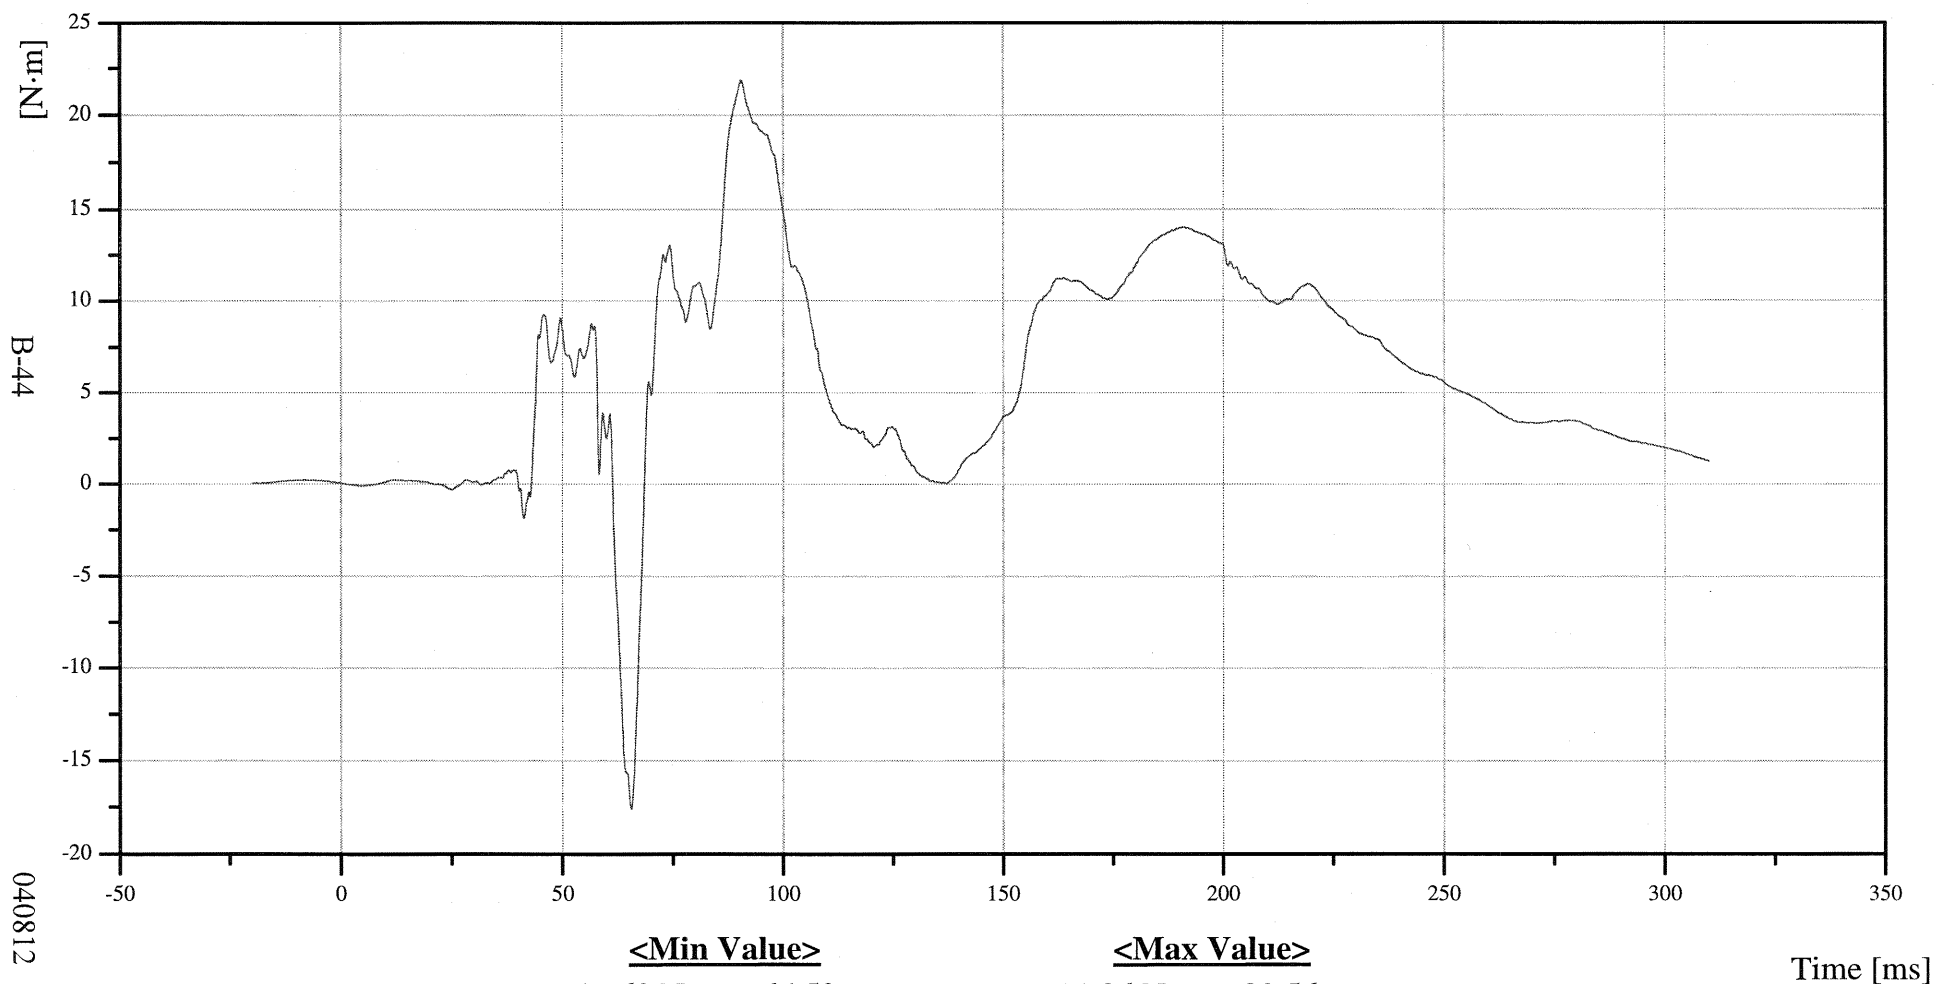

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Lwr Tibia Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANLYM1

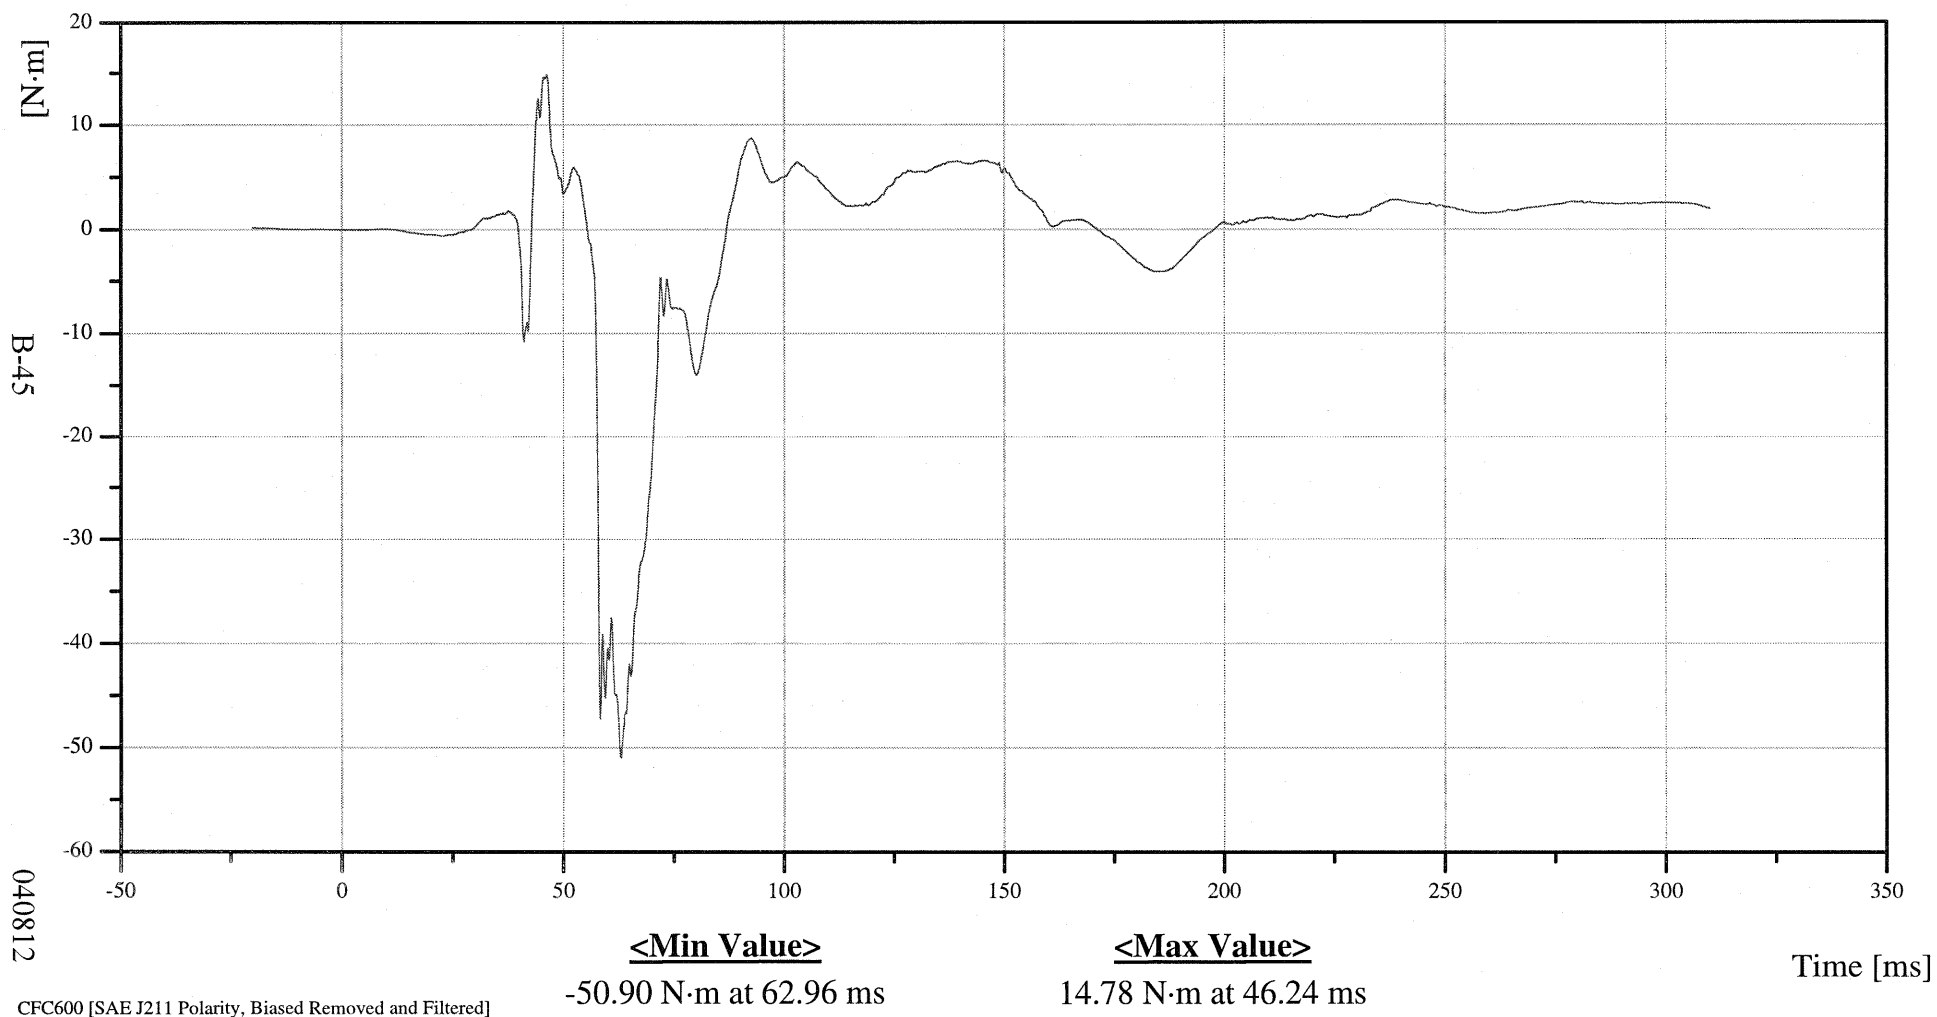



Transportation Research Center, Inc.

Left Foot Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTLXG1

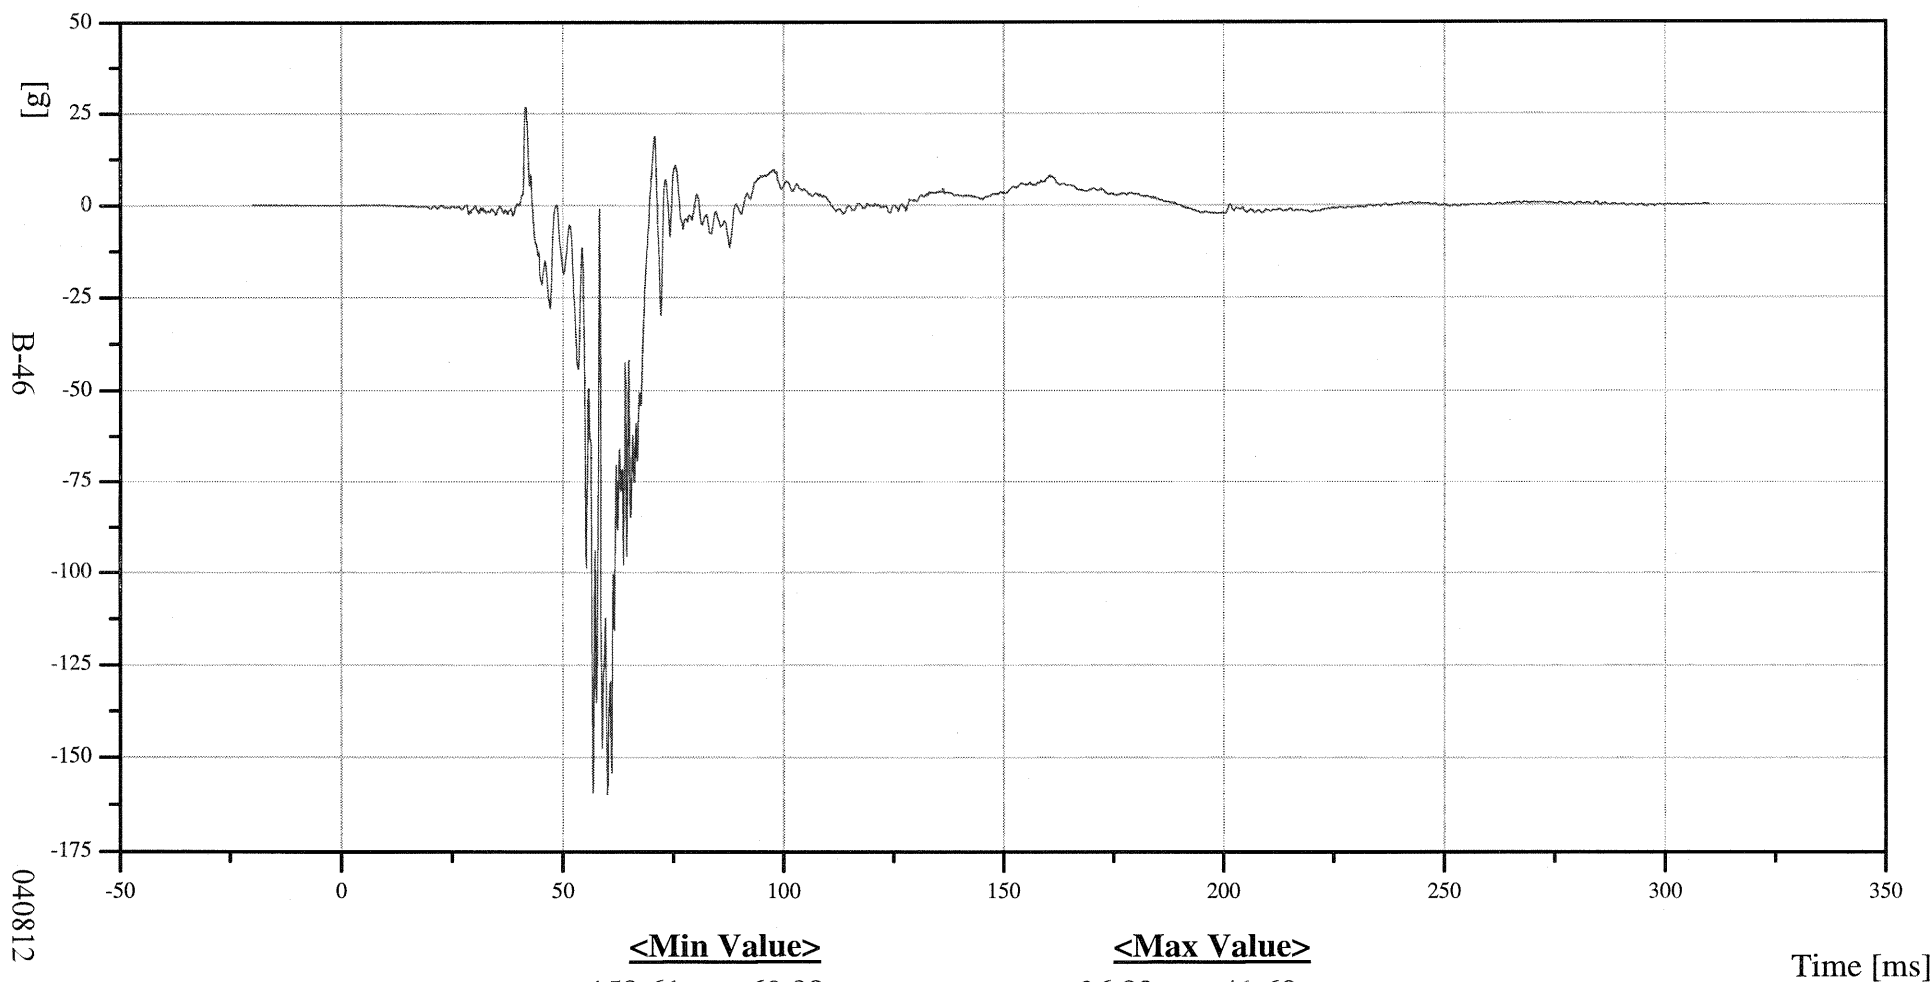

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left Foot Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTLYG1

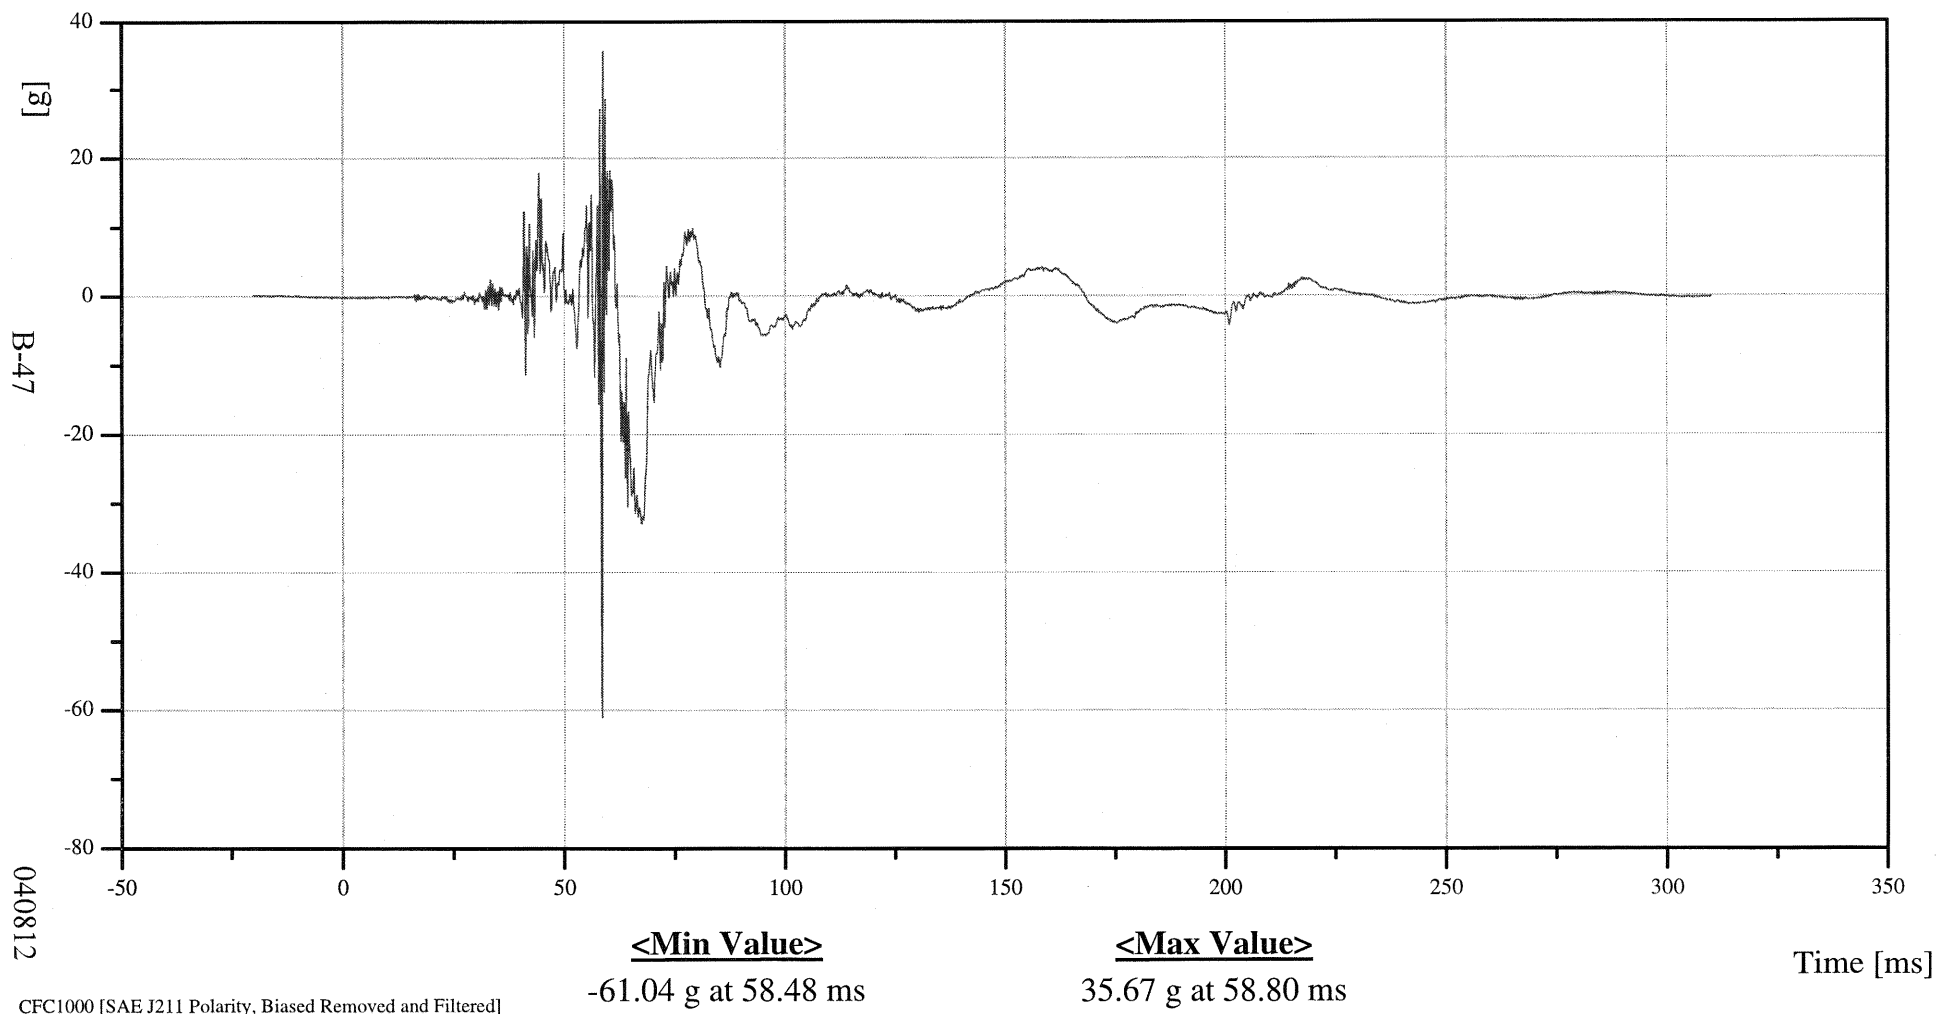



Transportation Research Center, Inc.

Left Foot Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTLZG1

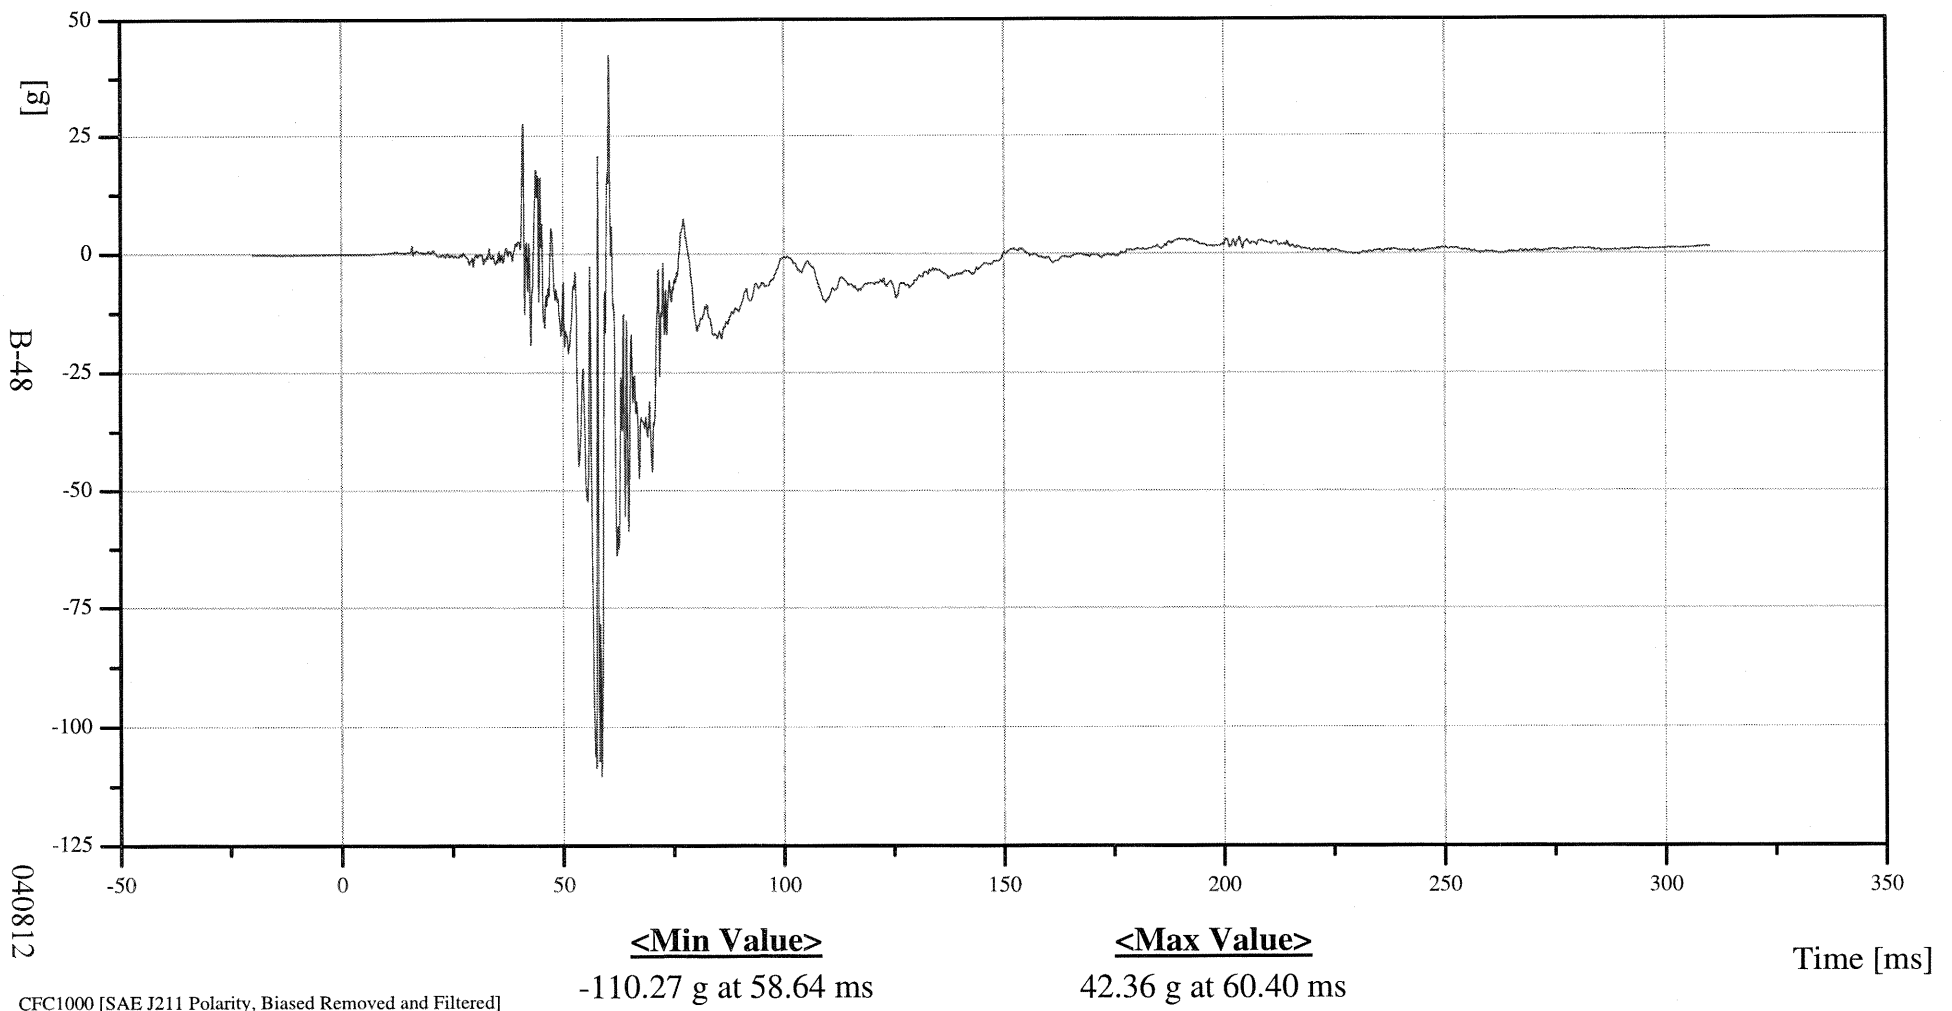



Transportation Research Center, Inc.

Left Foot Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTLRG1

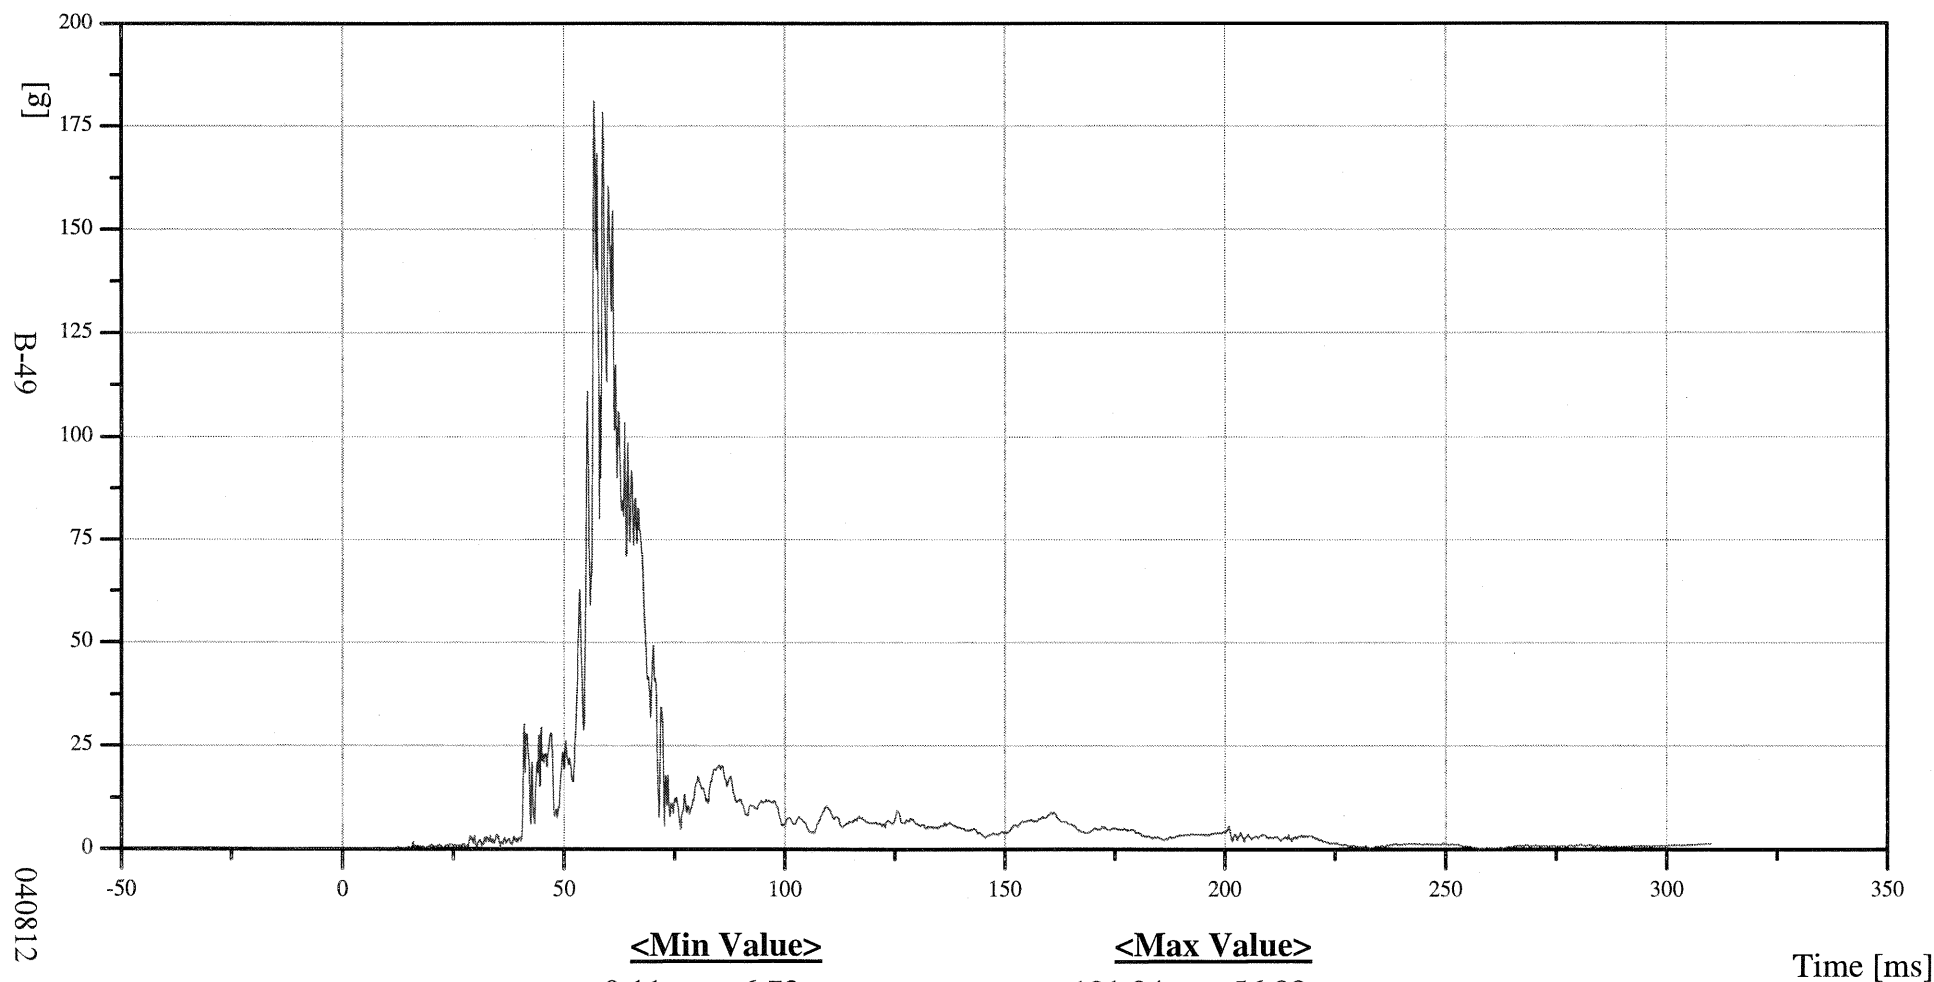

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RFMZF1

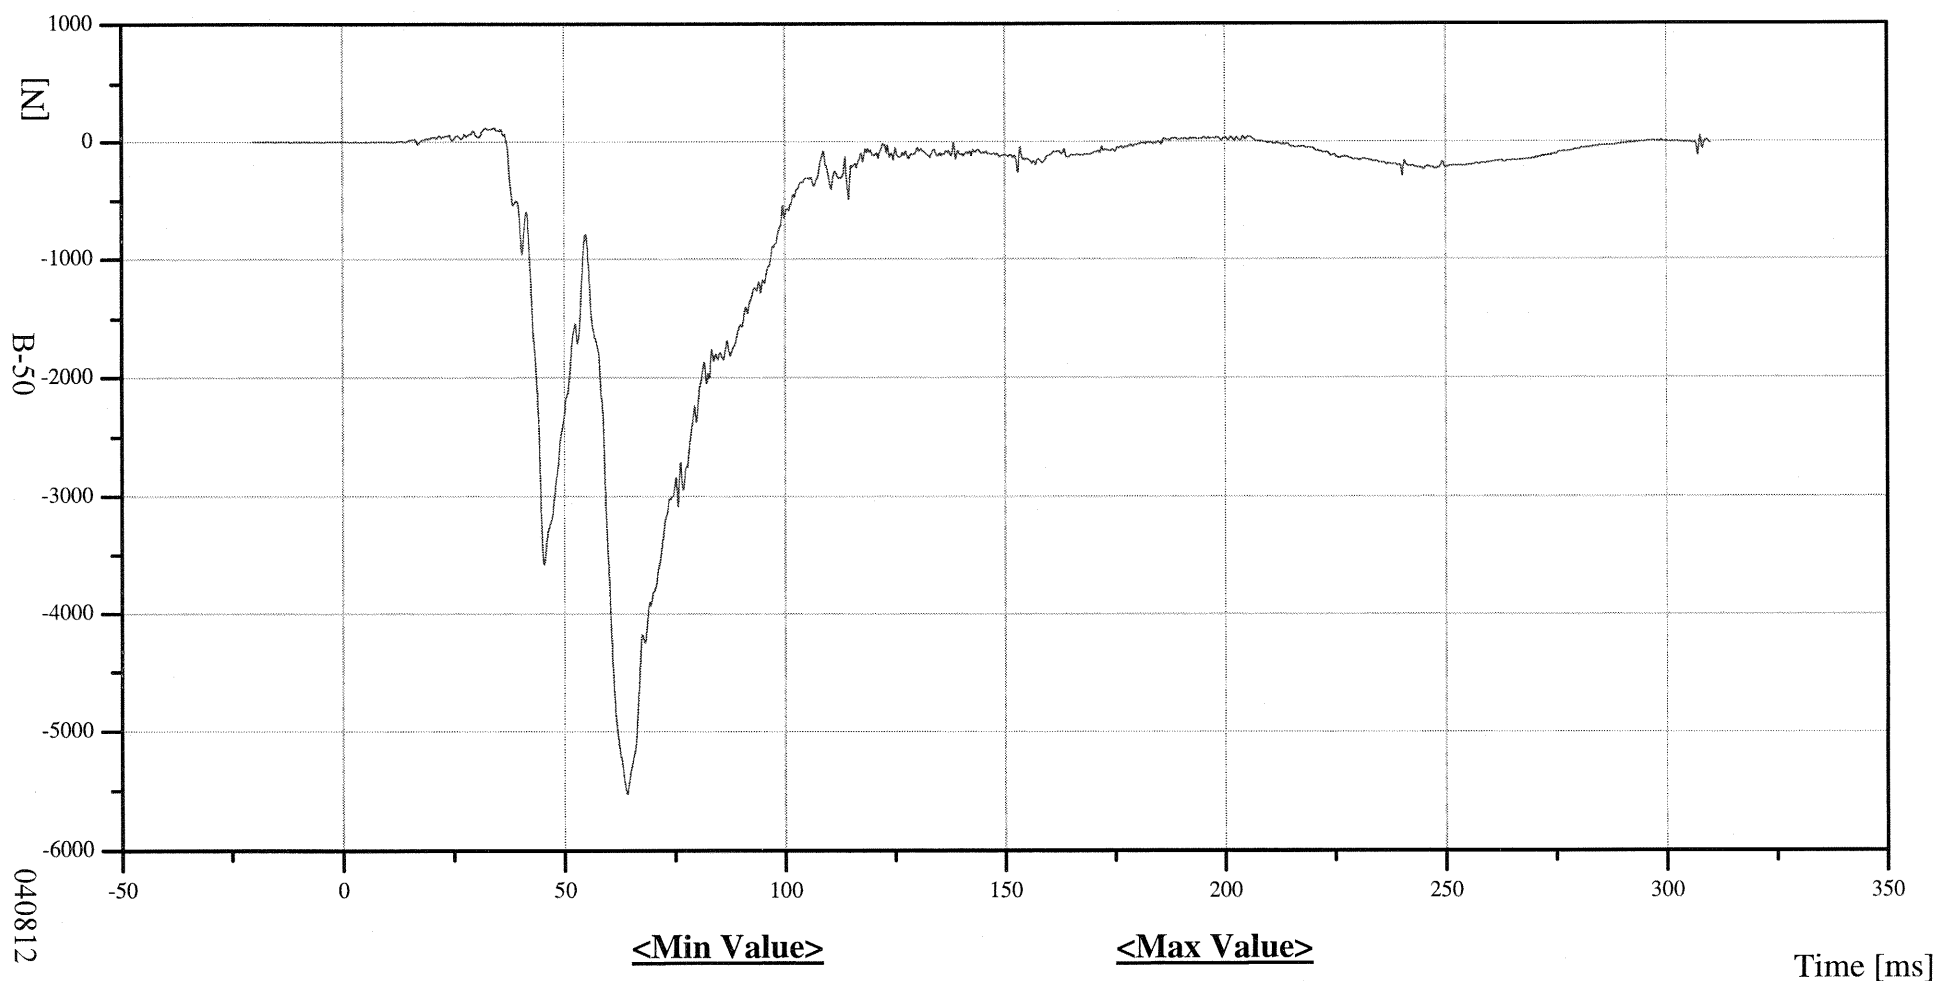

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Knee Displacement

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

KNR XD1

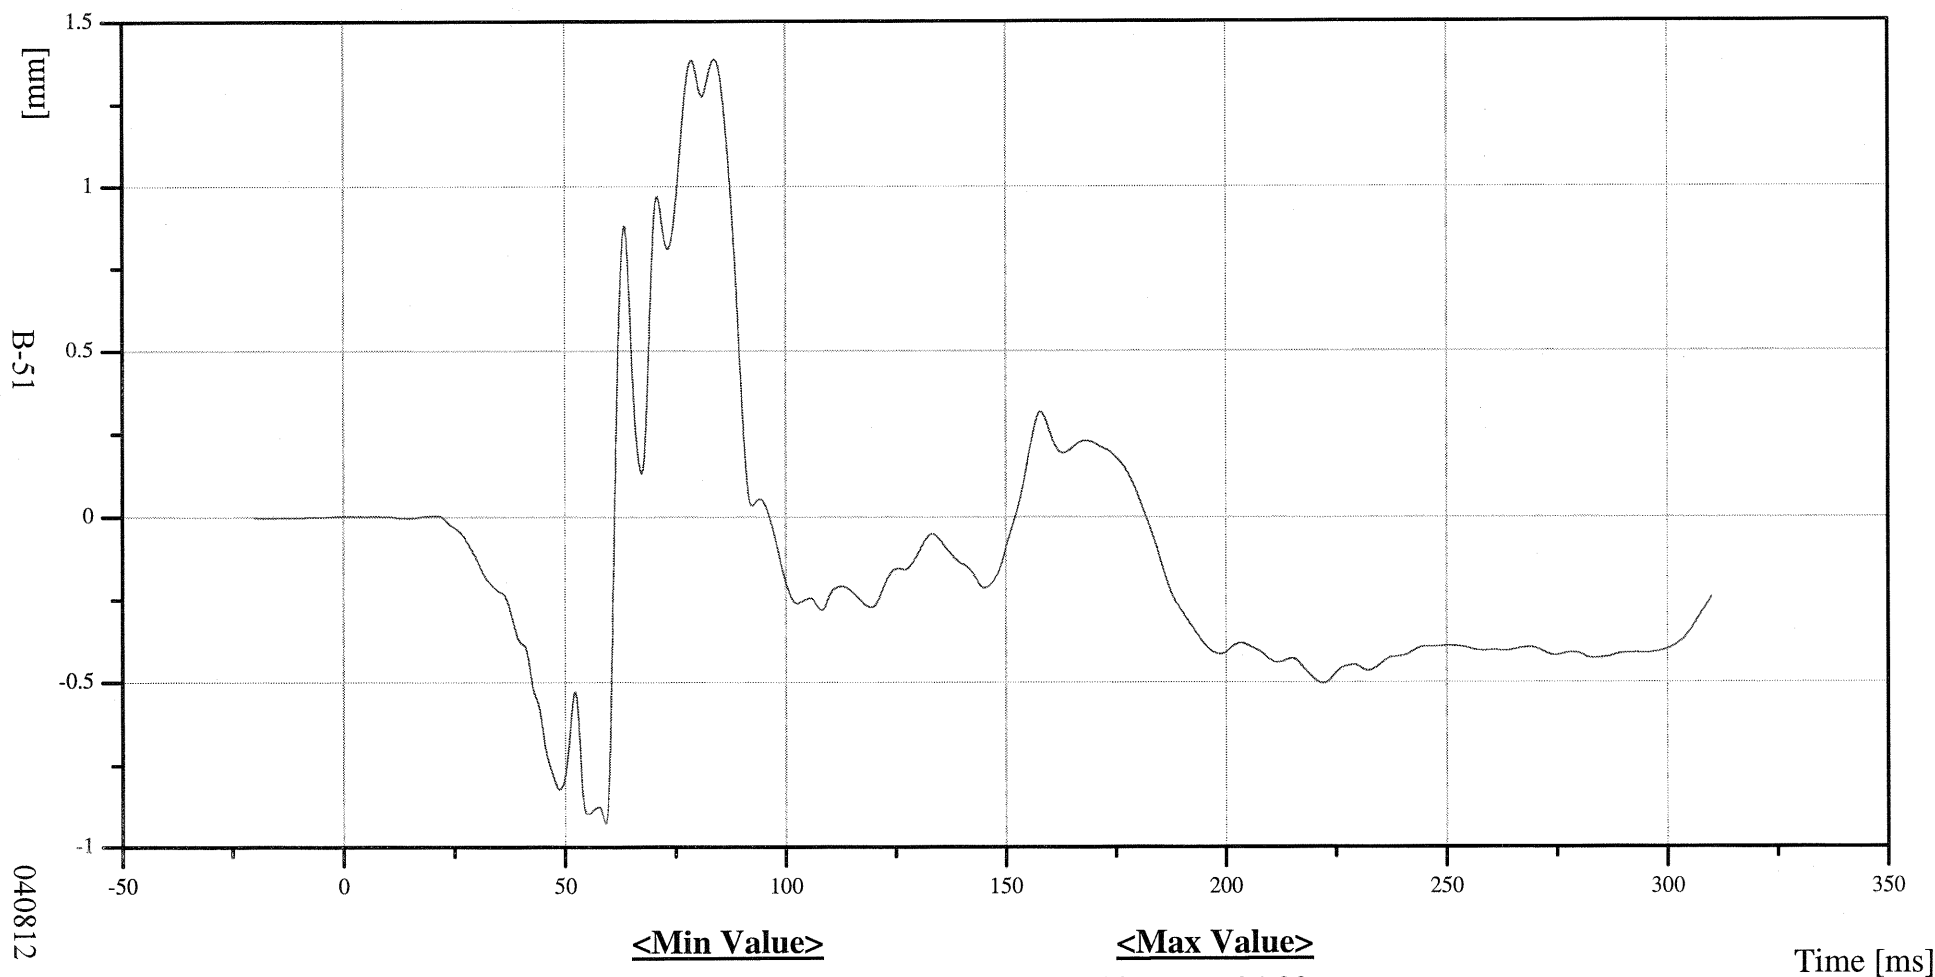

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Upr Tibia Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRXF1

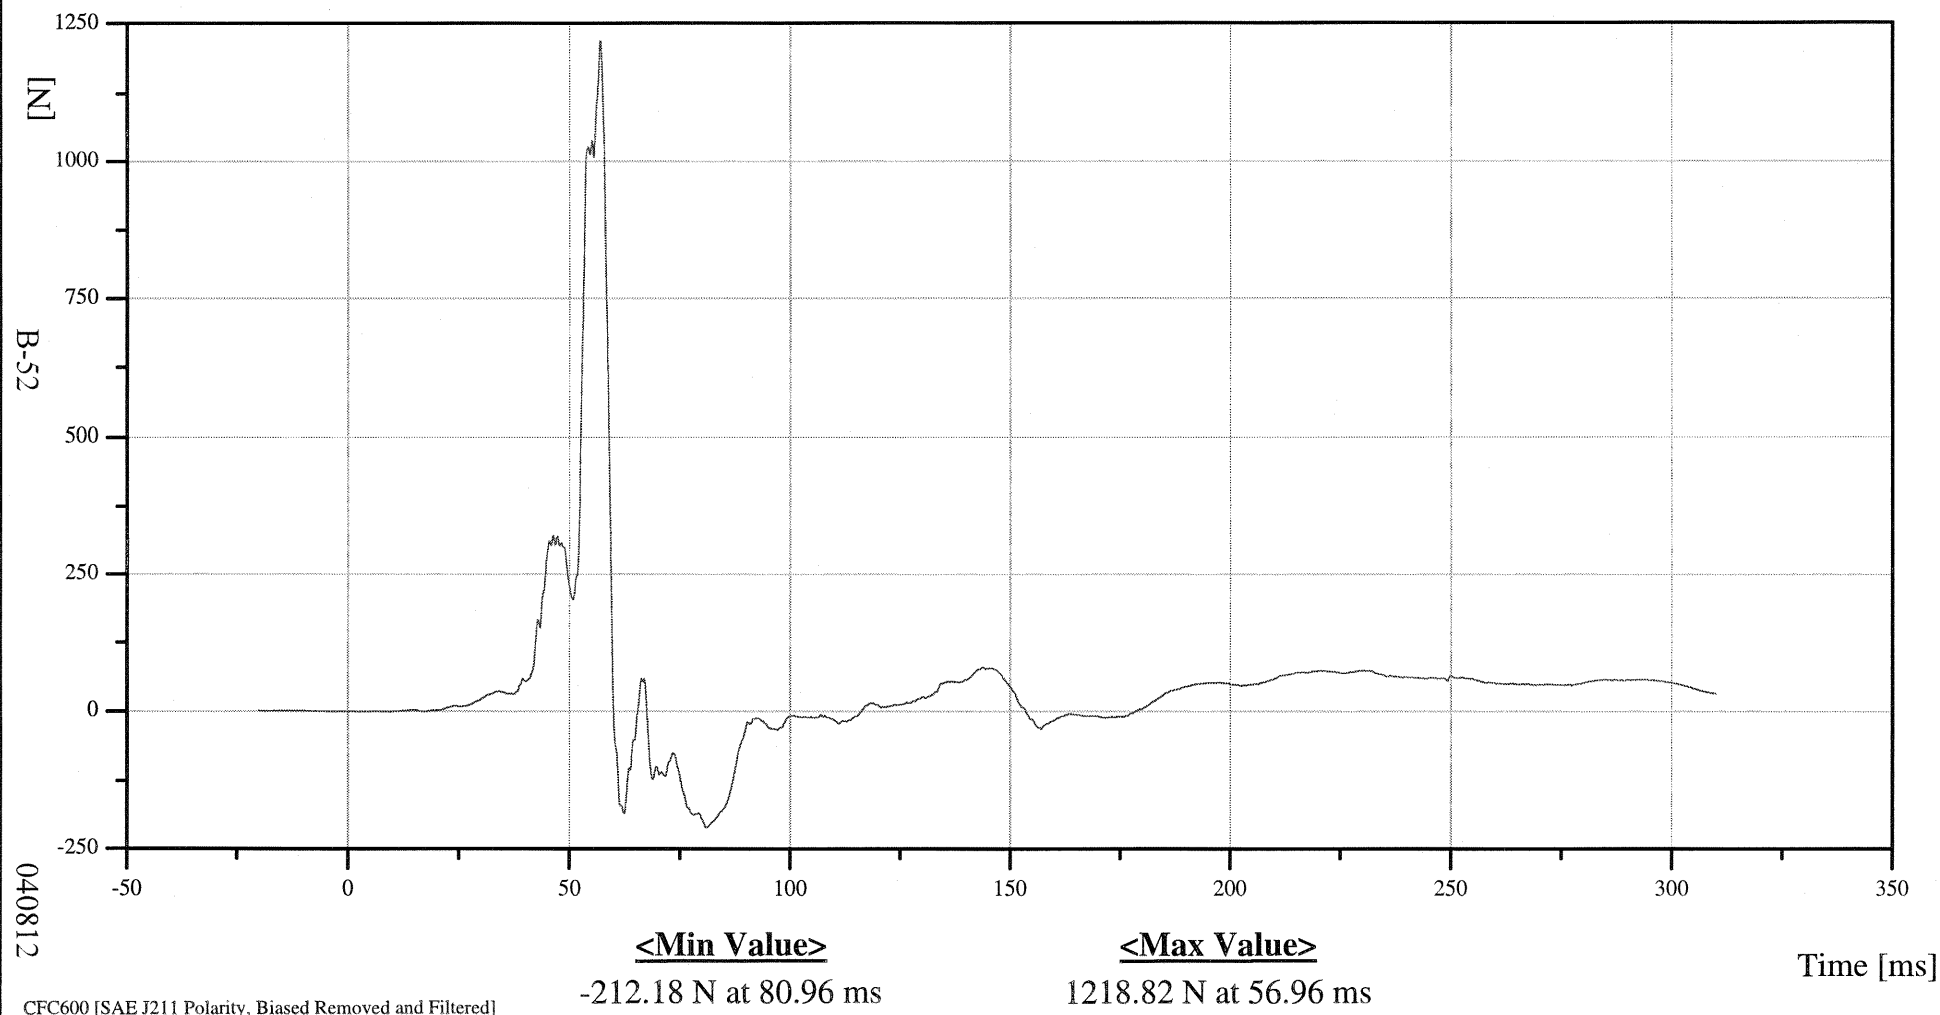



Transportation Research Center, Inc.

Right Upr Tibia Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRZF1

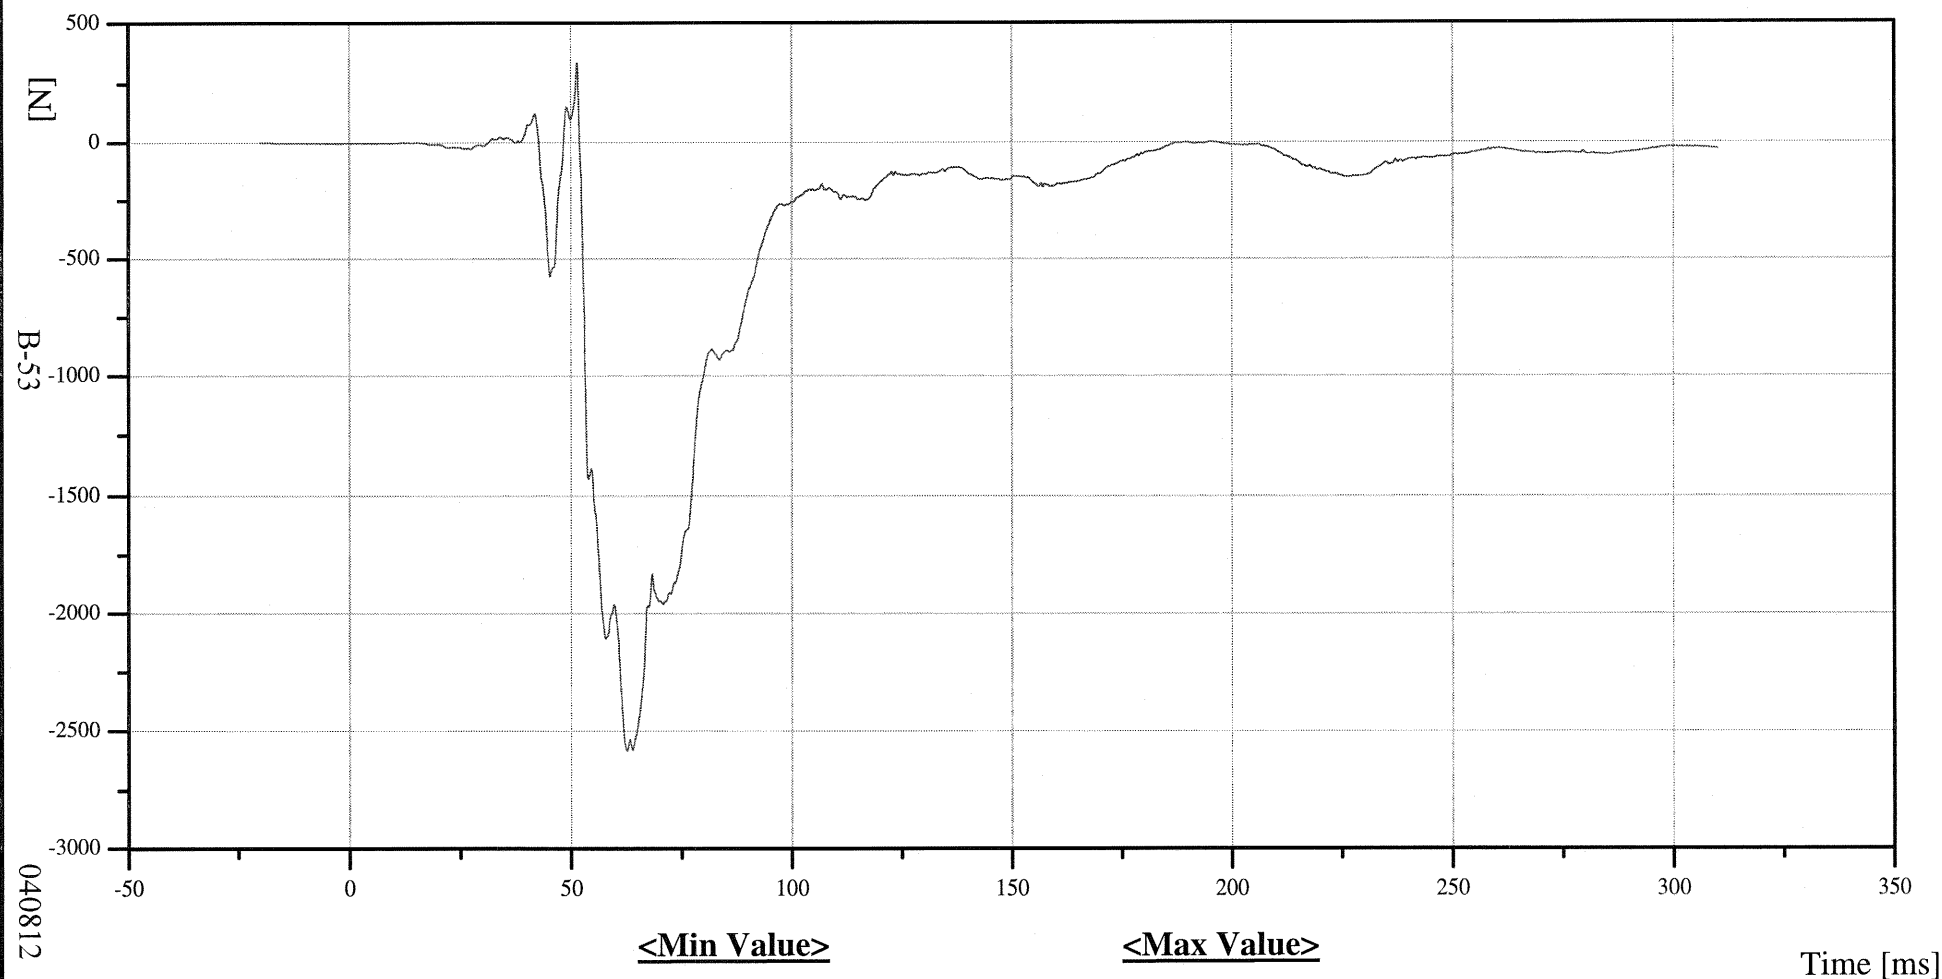

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Upr Tibia Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRXM1

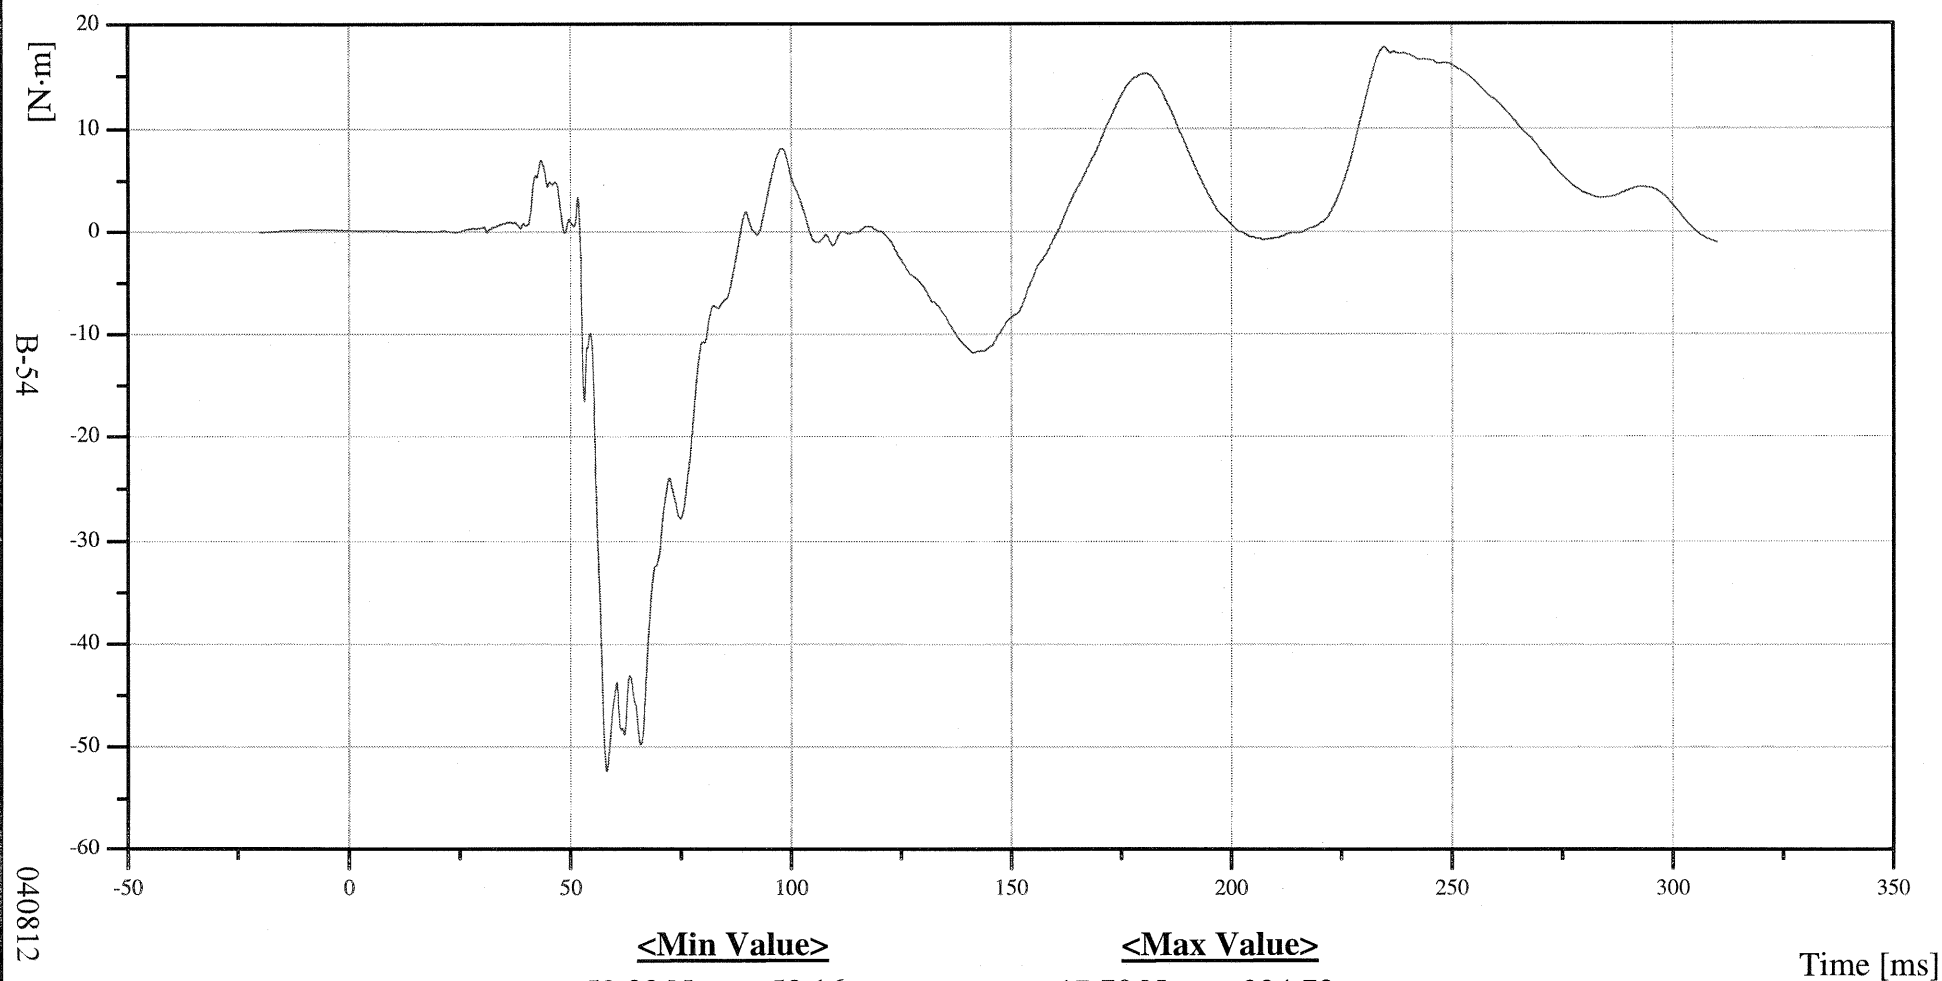

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Upr Tibia Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRYM1

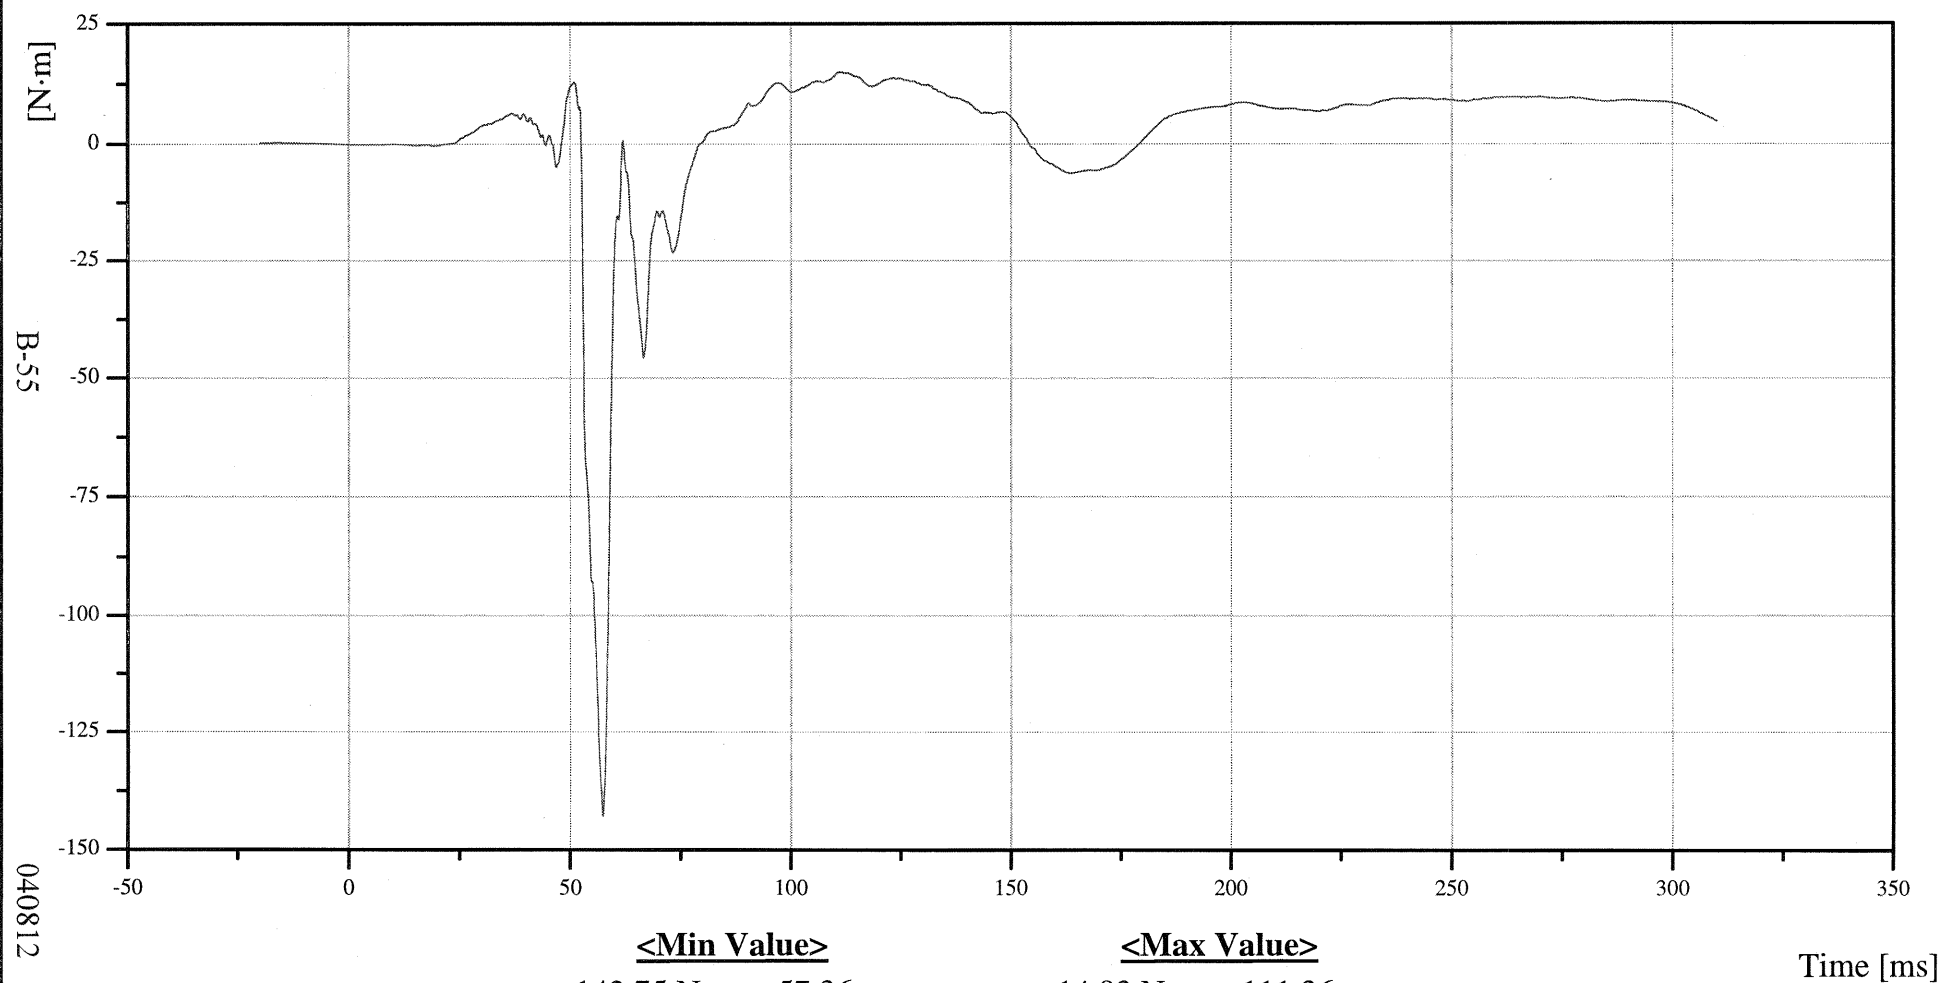

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Tibia Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRXG1

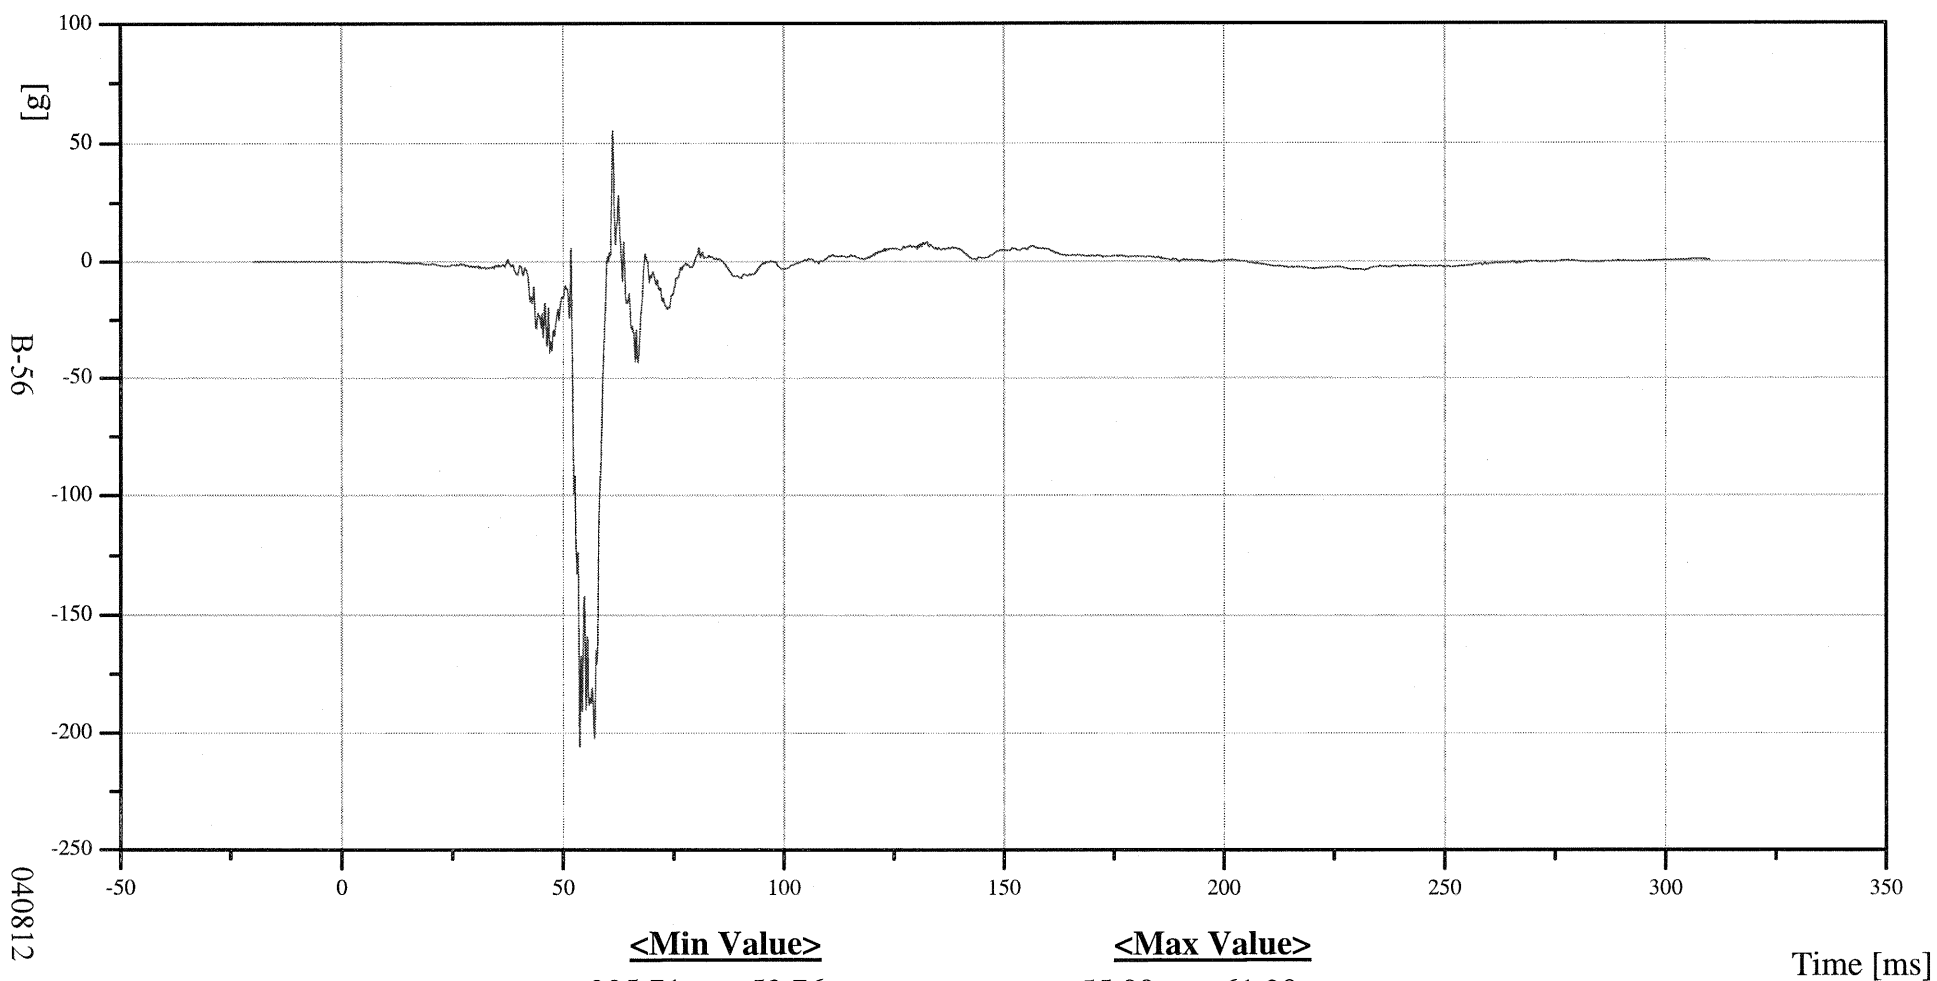

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Tibia Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TBRYG1

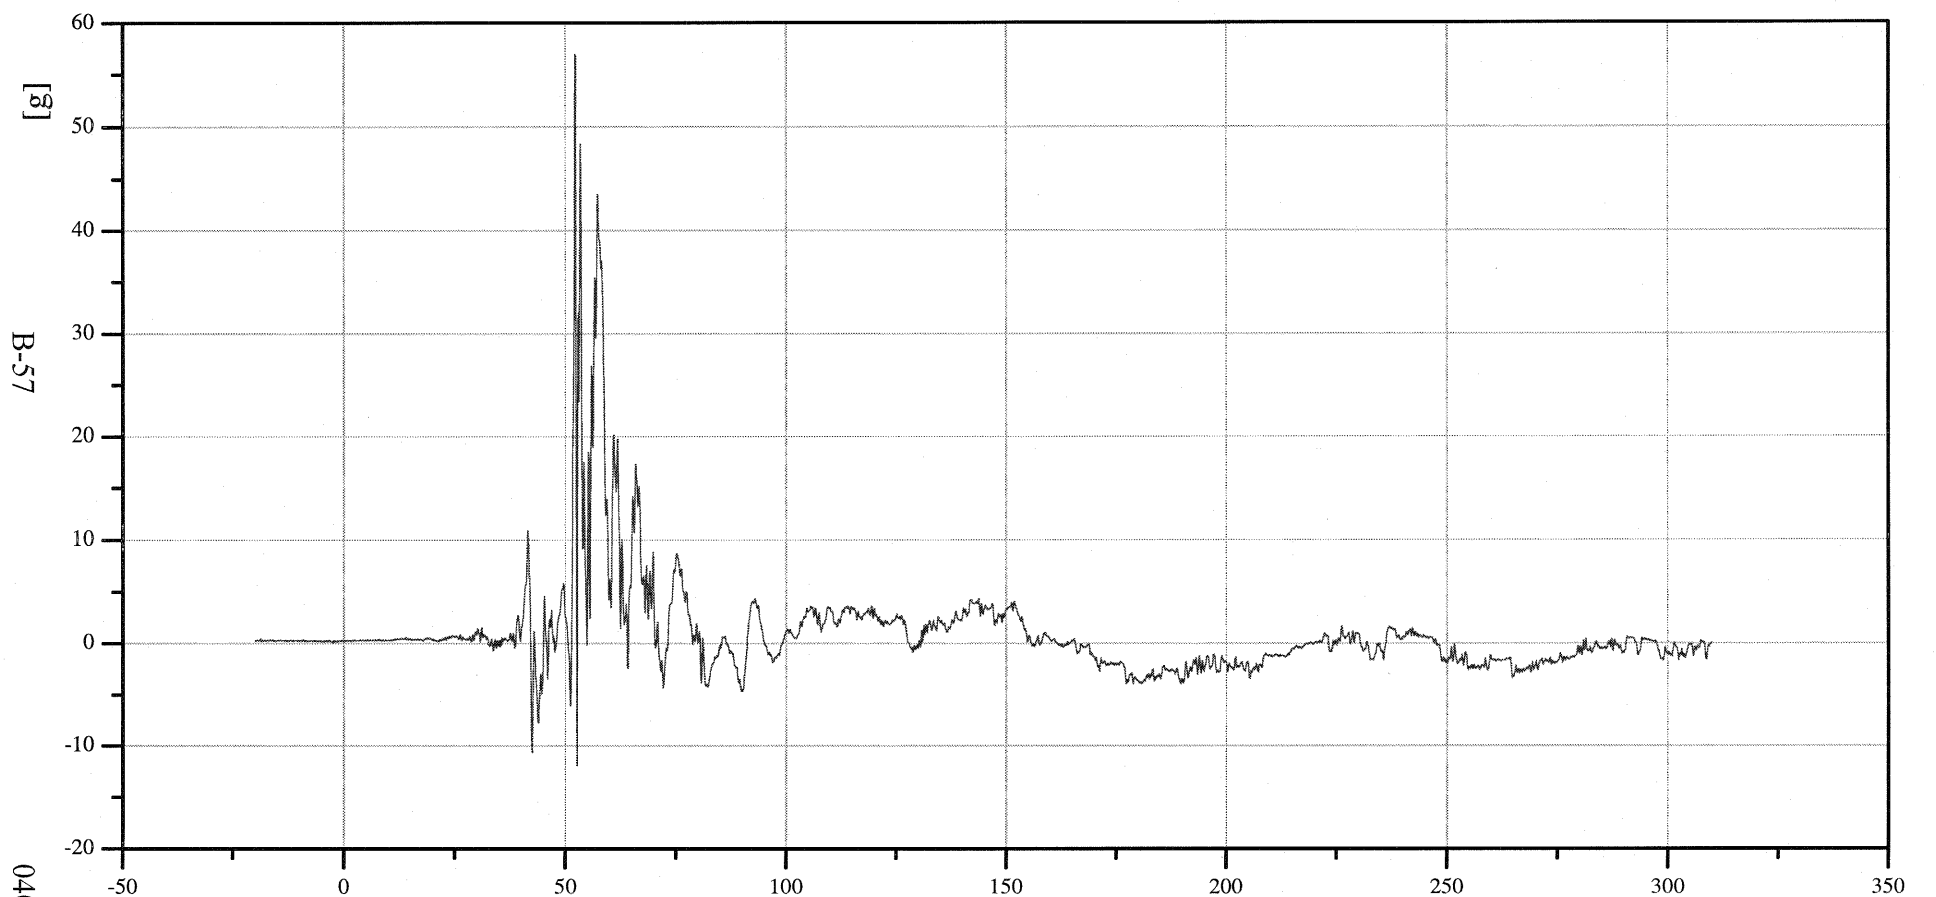

<Min Value>

-11.88 g at 52.64 ms

<Max Value>

56.93 g at 52.24 ms

Time [ms]

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Lwr Tibia Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANRXF1

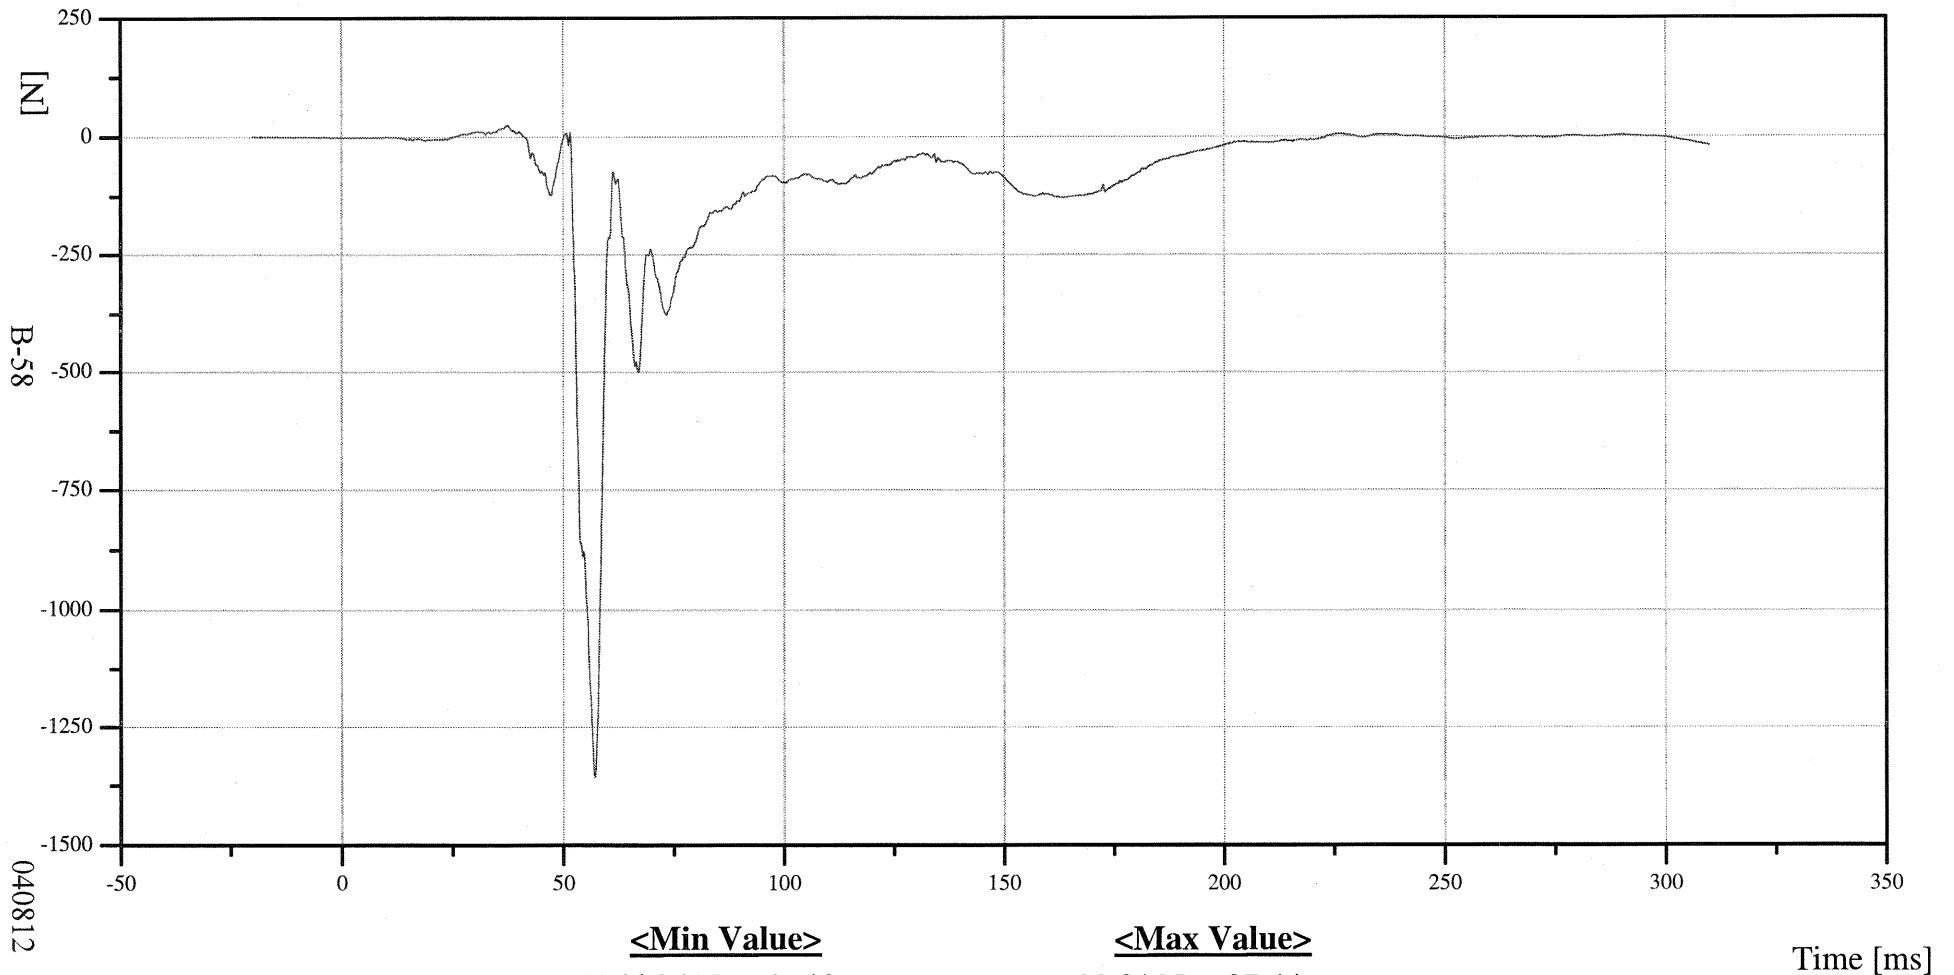

<Min Value>

-1356.95 N at 57.12 ms

<Max Value>

23.81 N at 37.44 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Lwr Tibia Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANRYF1

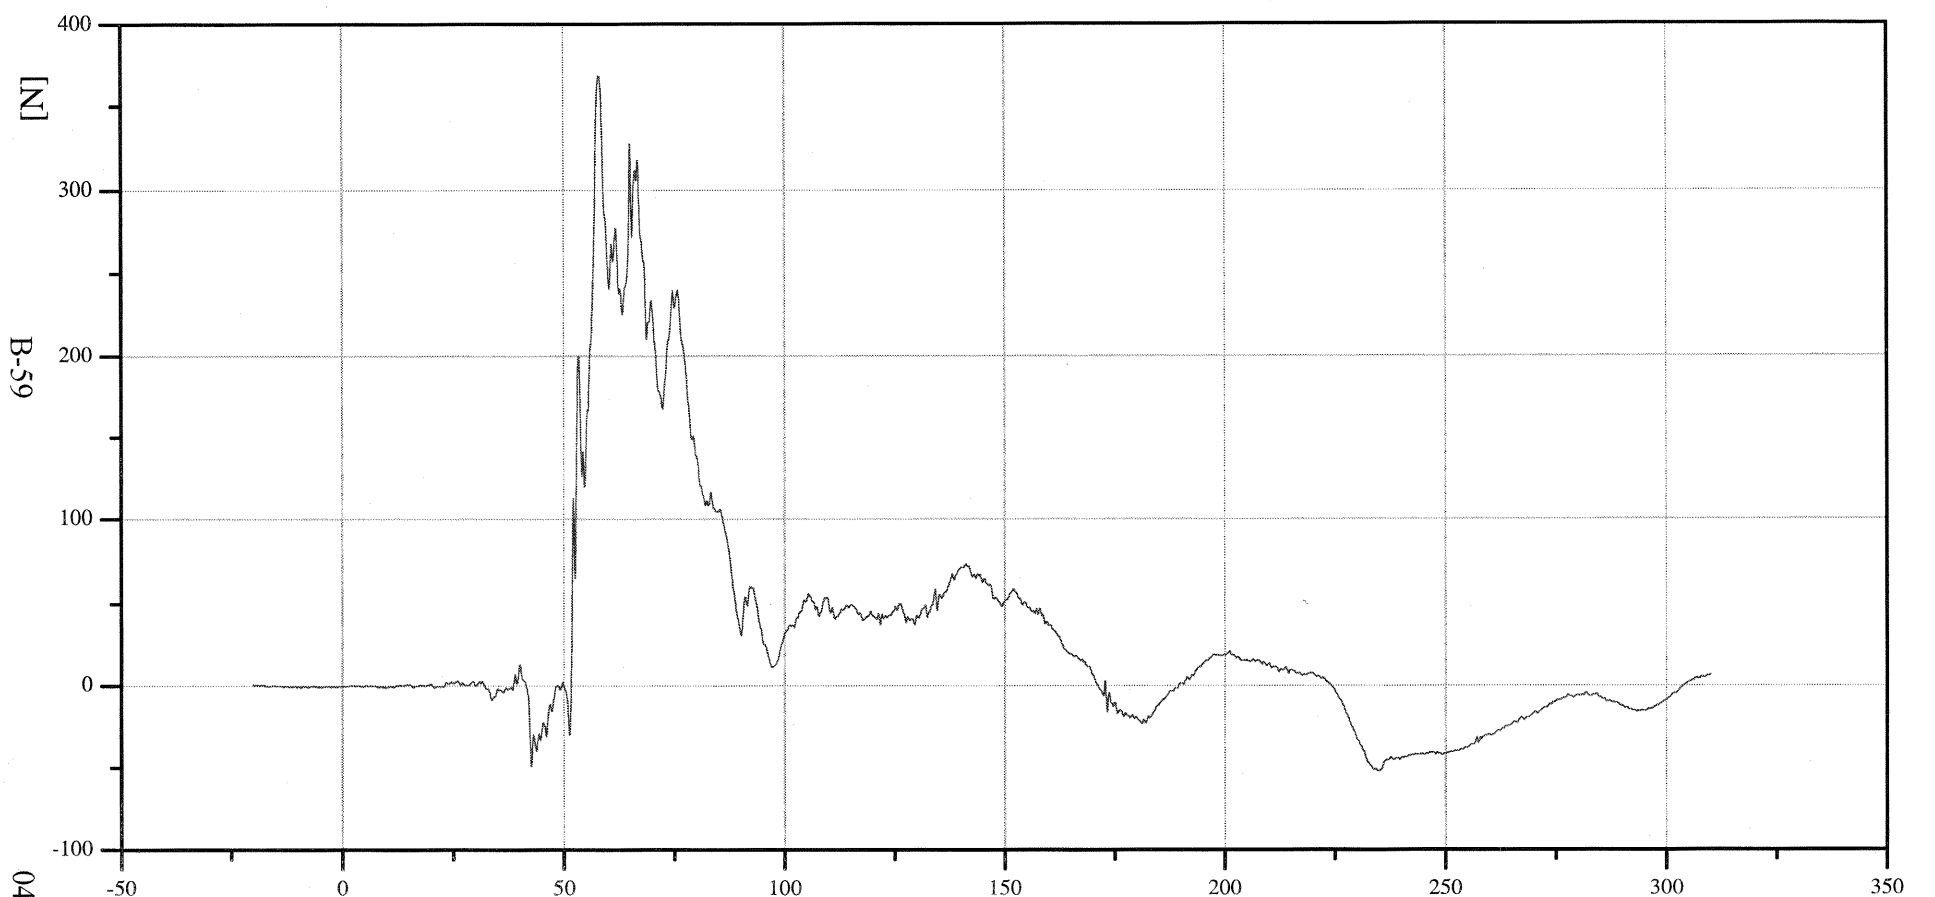

040812

<Min Value>

-52.13 N at 234.80 ms

<Max Value>

368.12 N at 58.00 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Lwr Tibia Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANRZF1

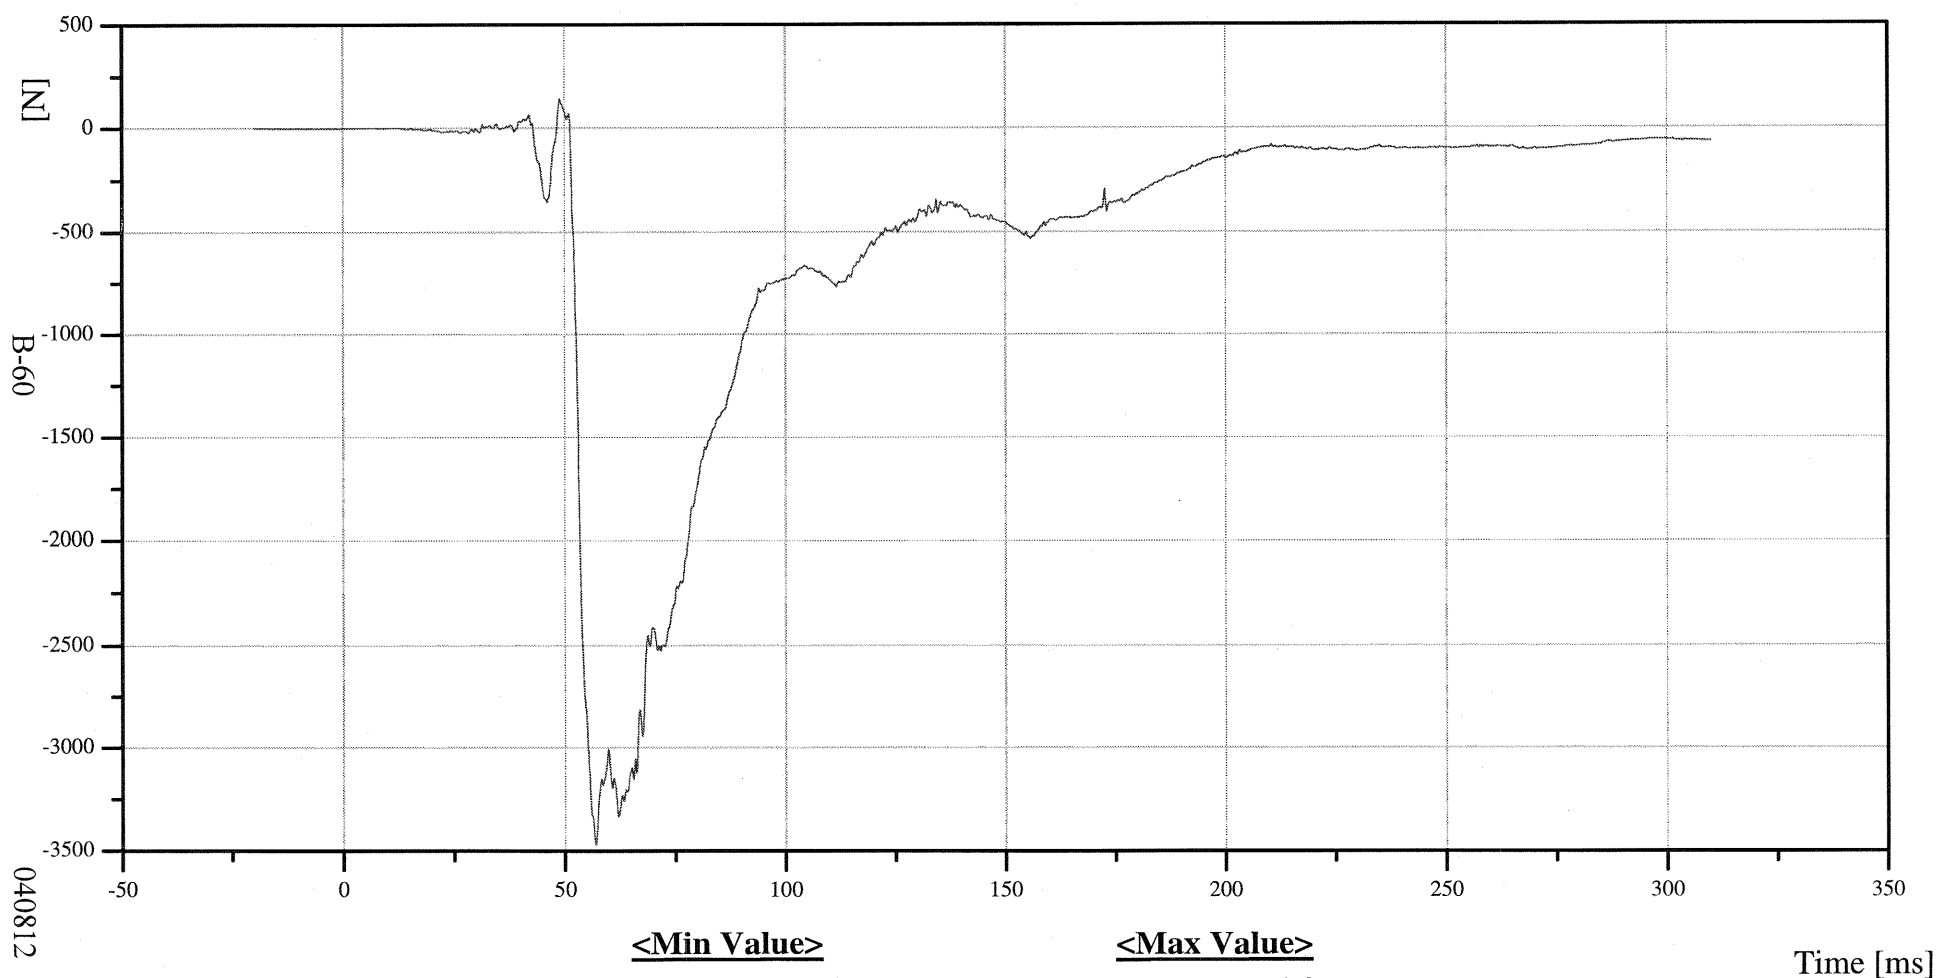

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Lwr Tibia Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANRXM1

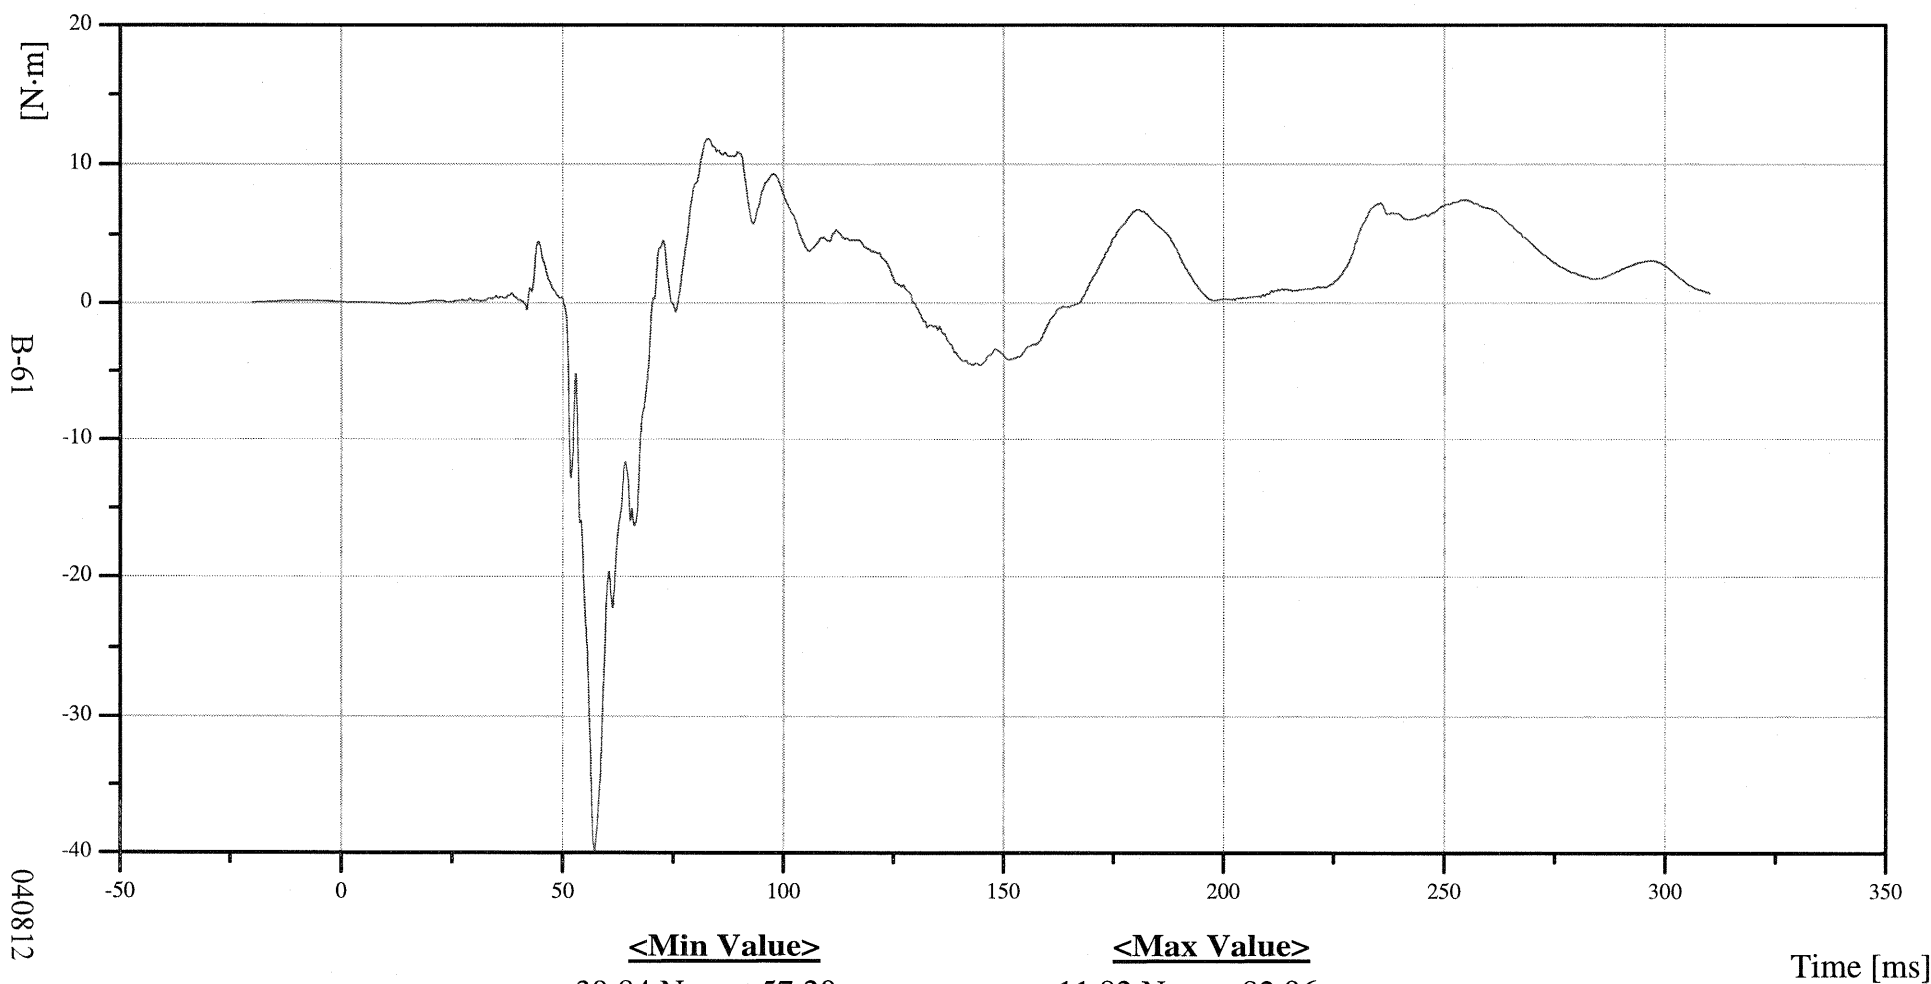

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Lwr Tibia Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

ANRYM1

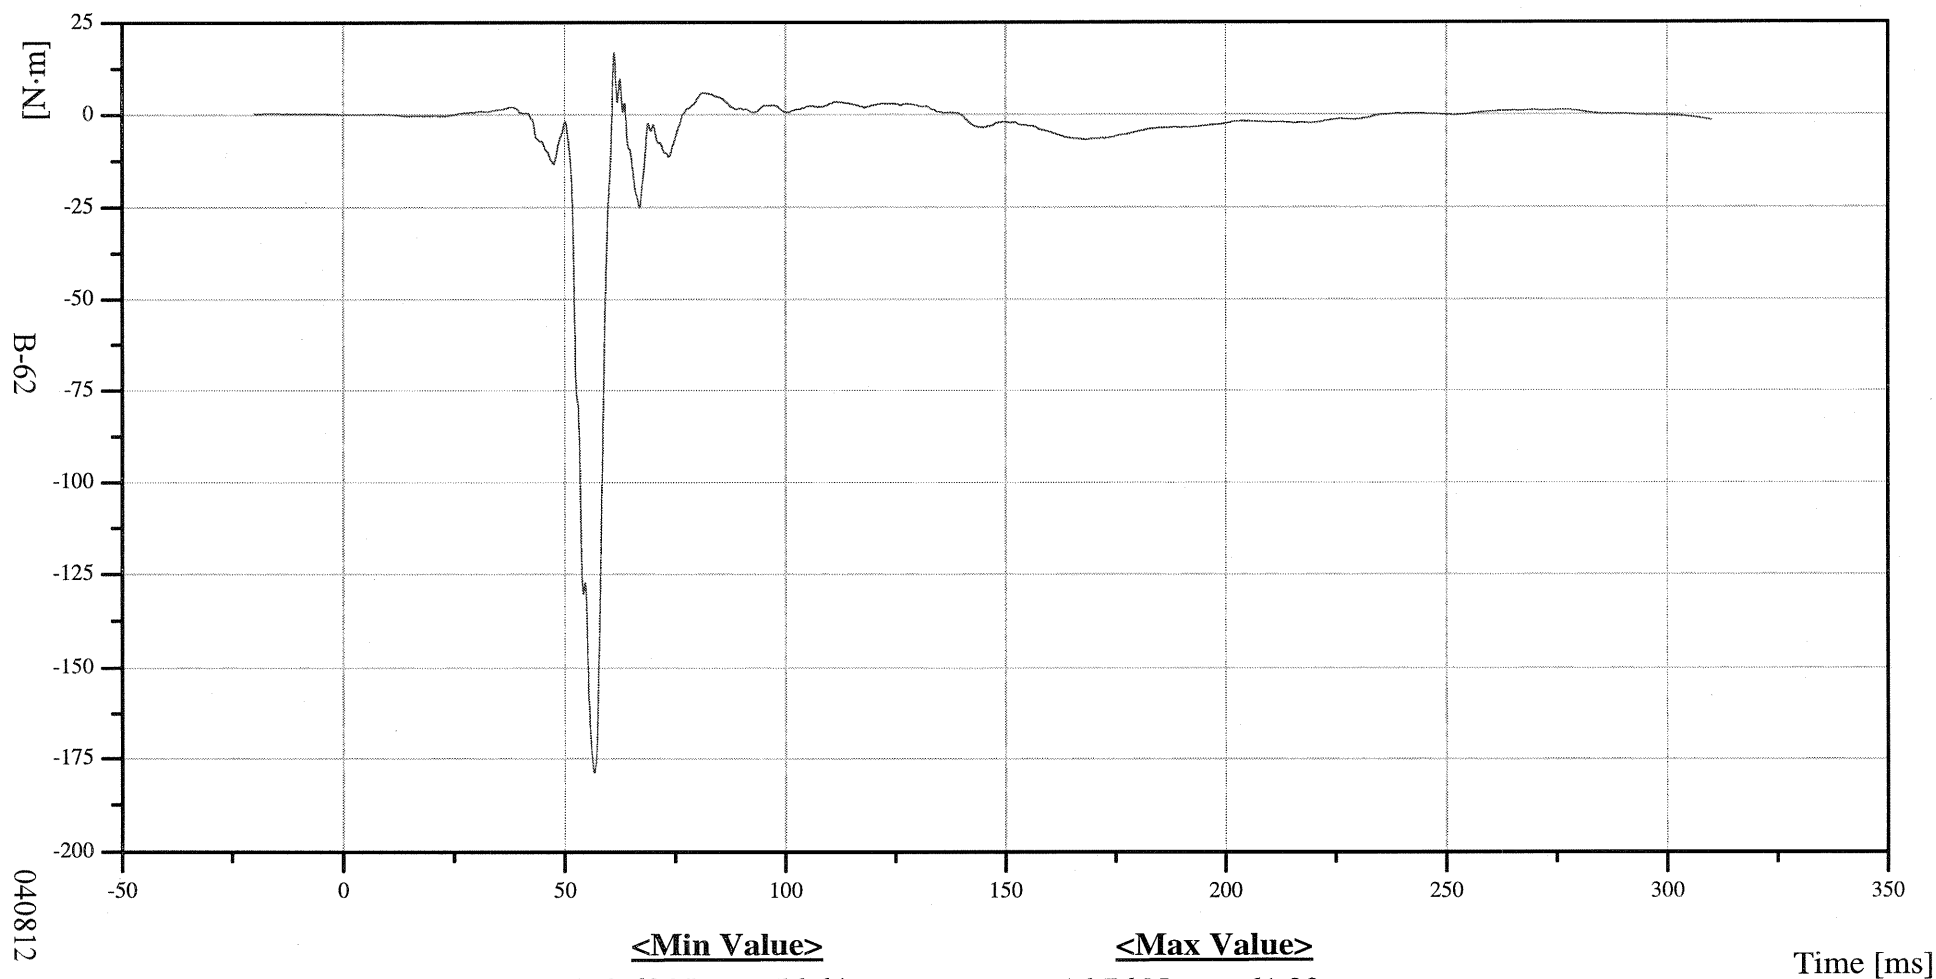

<Min Value>

-178.63 N·m at 56.64 ms

<Max Value>

16.76 N·m at 61.20 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Foot Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTRXG1

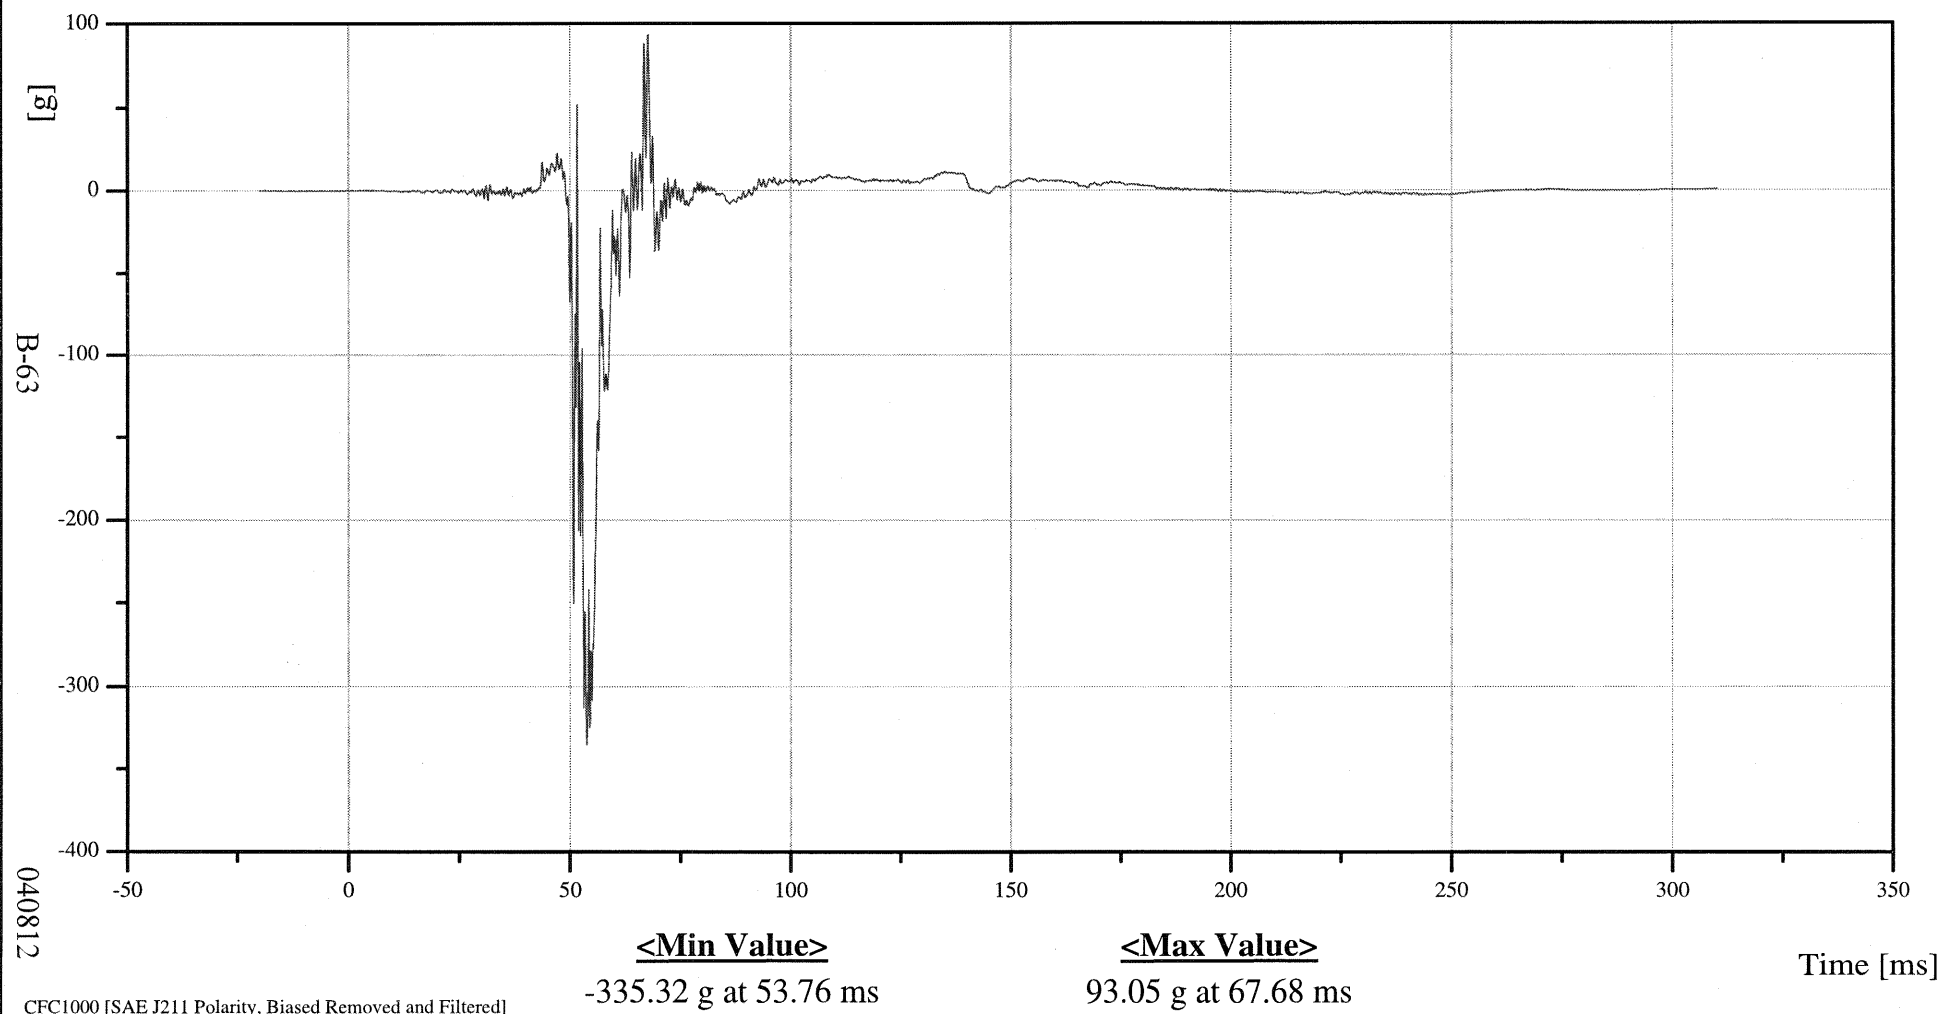



Transportation Research Center, Inc.

Right Foot Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTRYG1

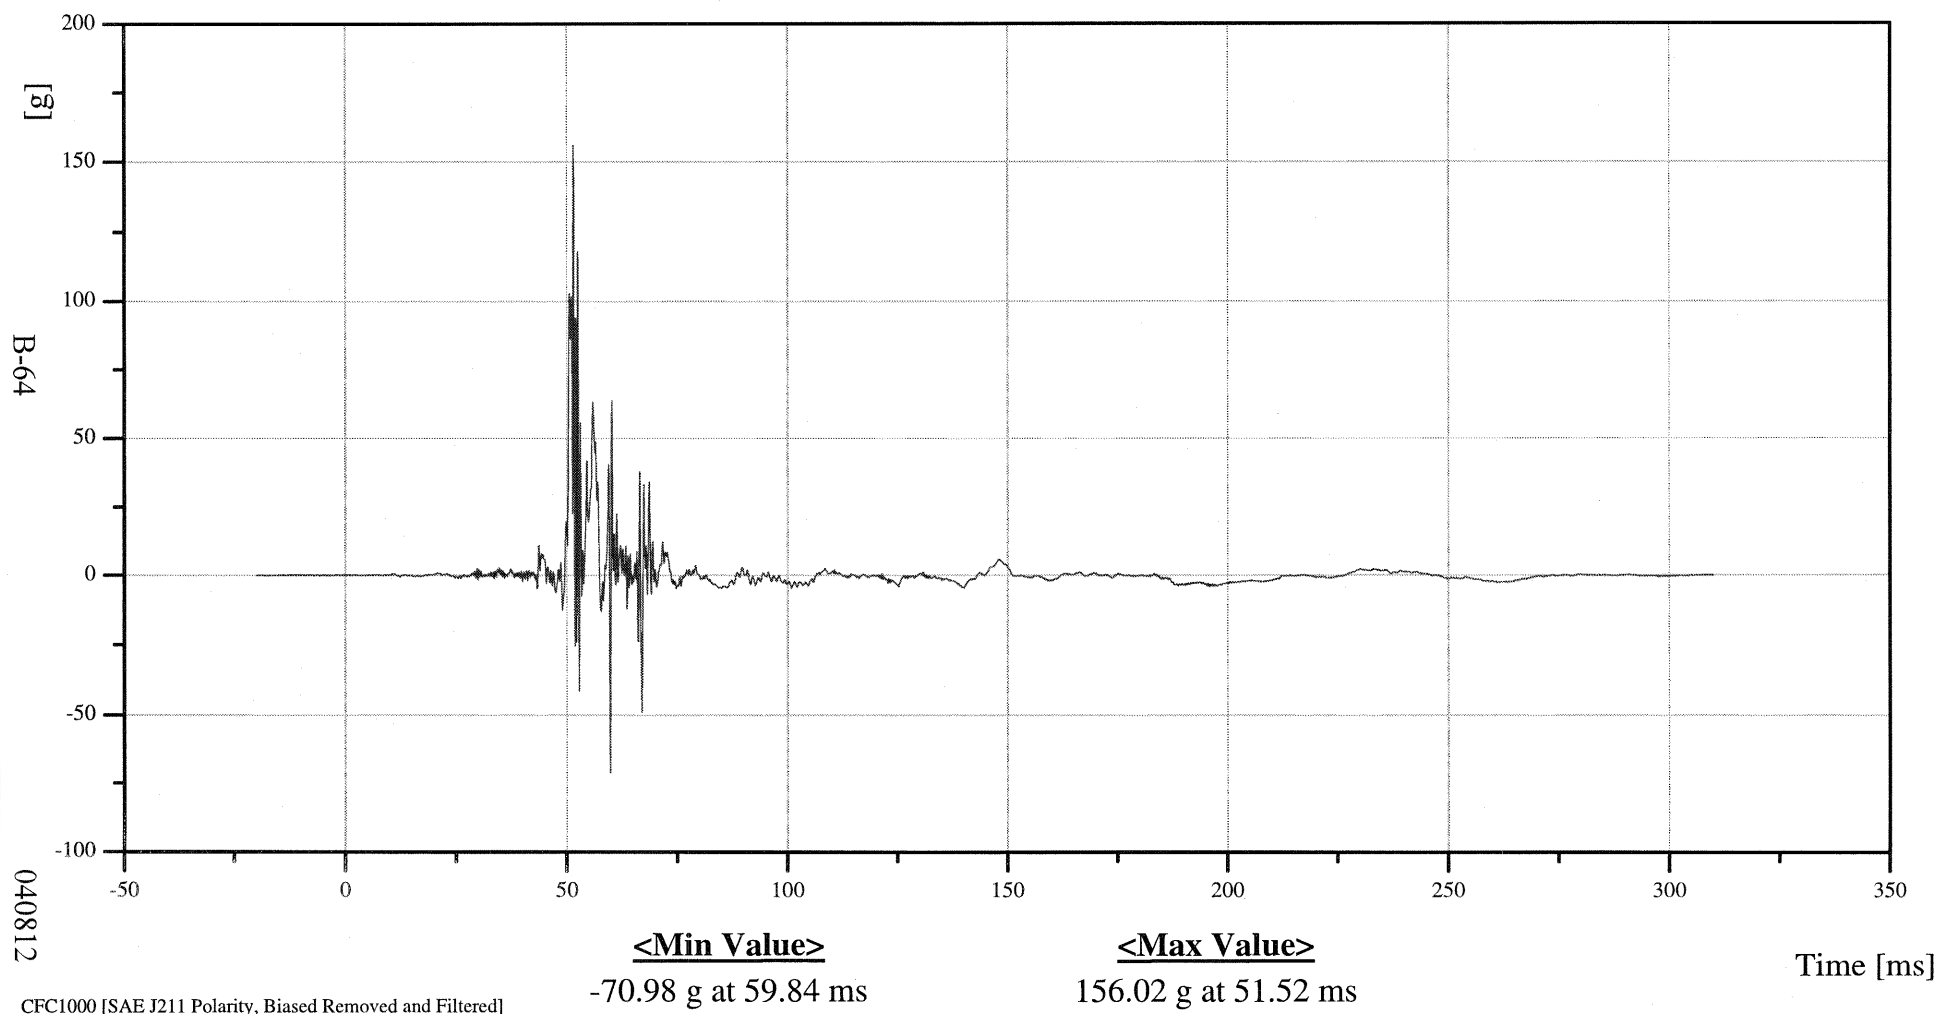



Transportation Research Center, Inc.

Right Foot Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTRZG1

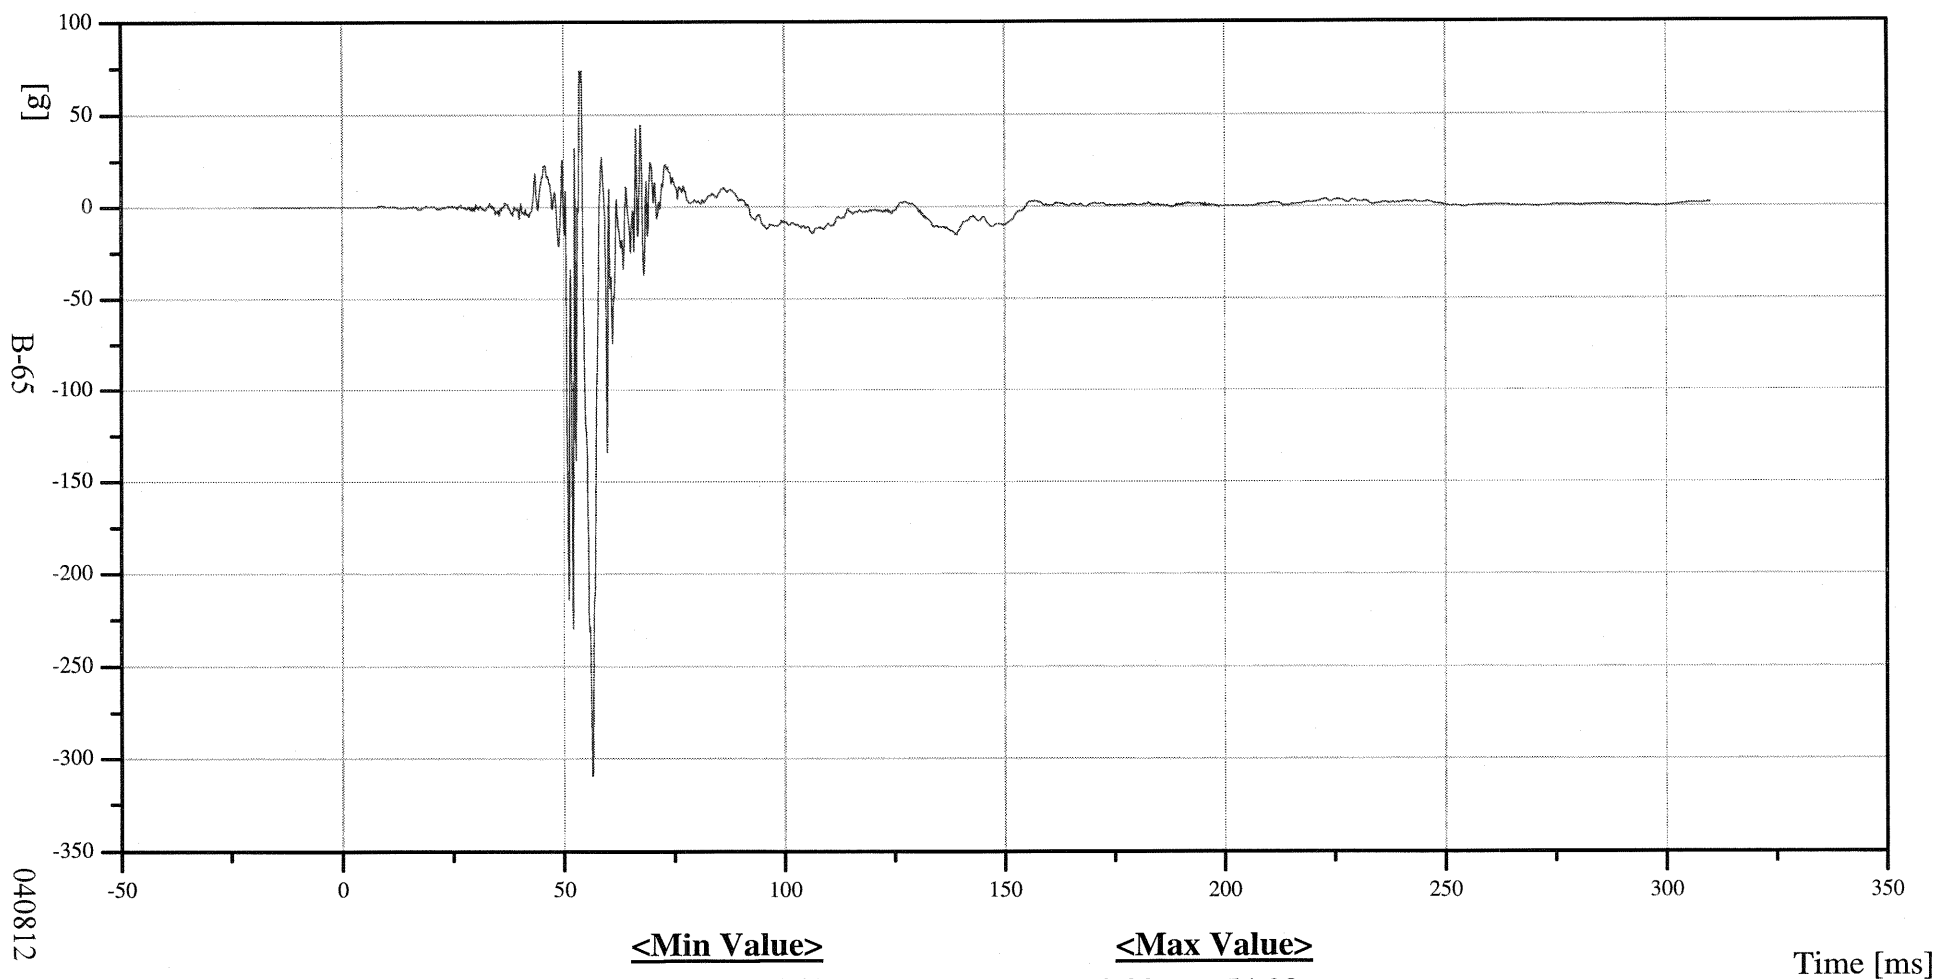

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Foot Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

FTRRG1

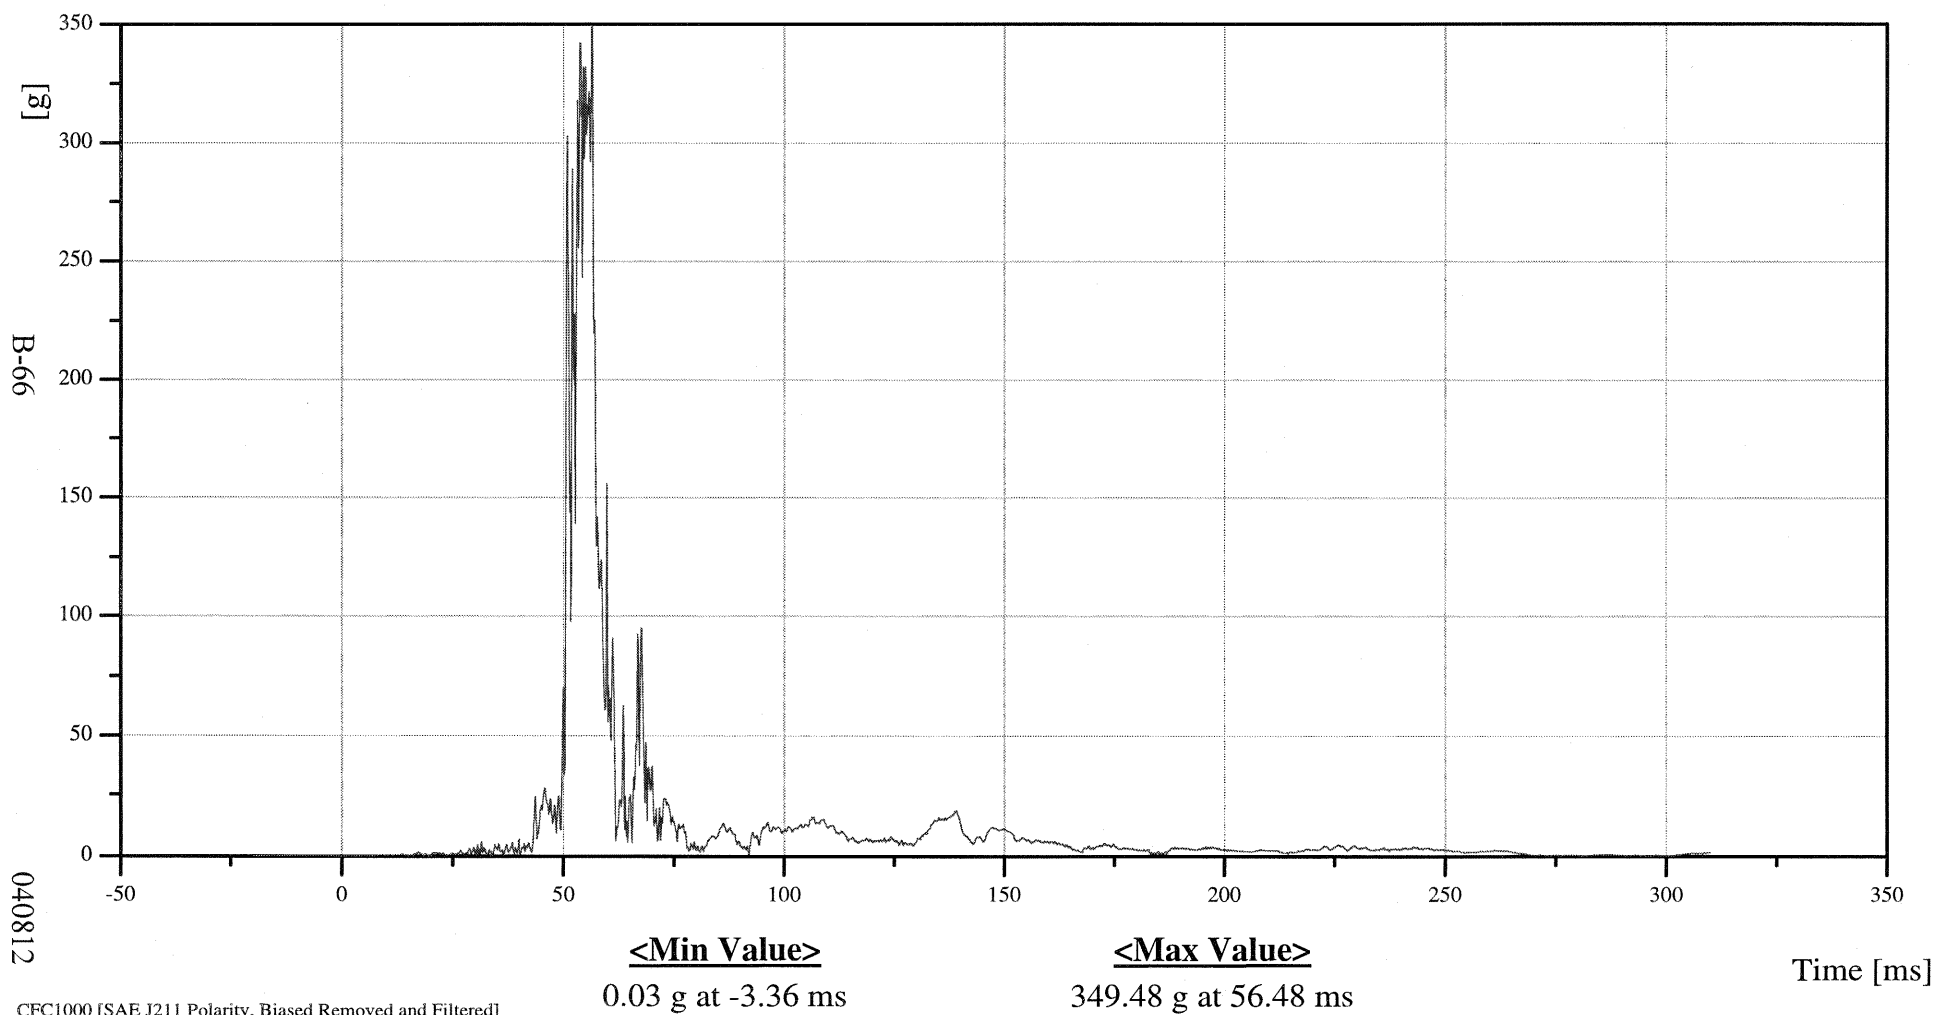



Transportation Research Center, Inc.

Head Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDXG2

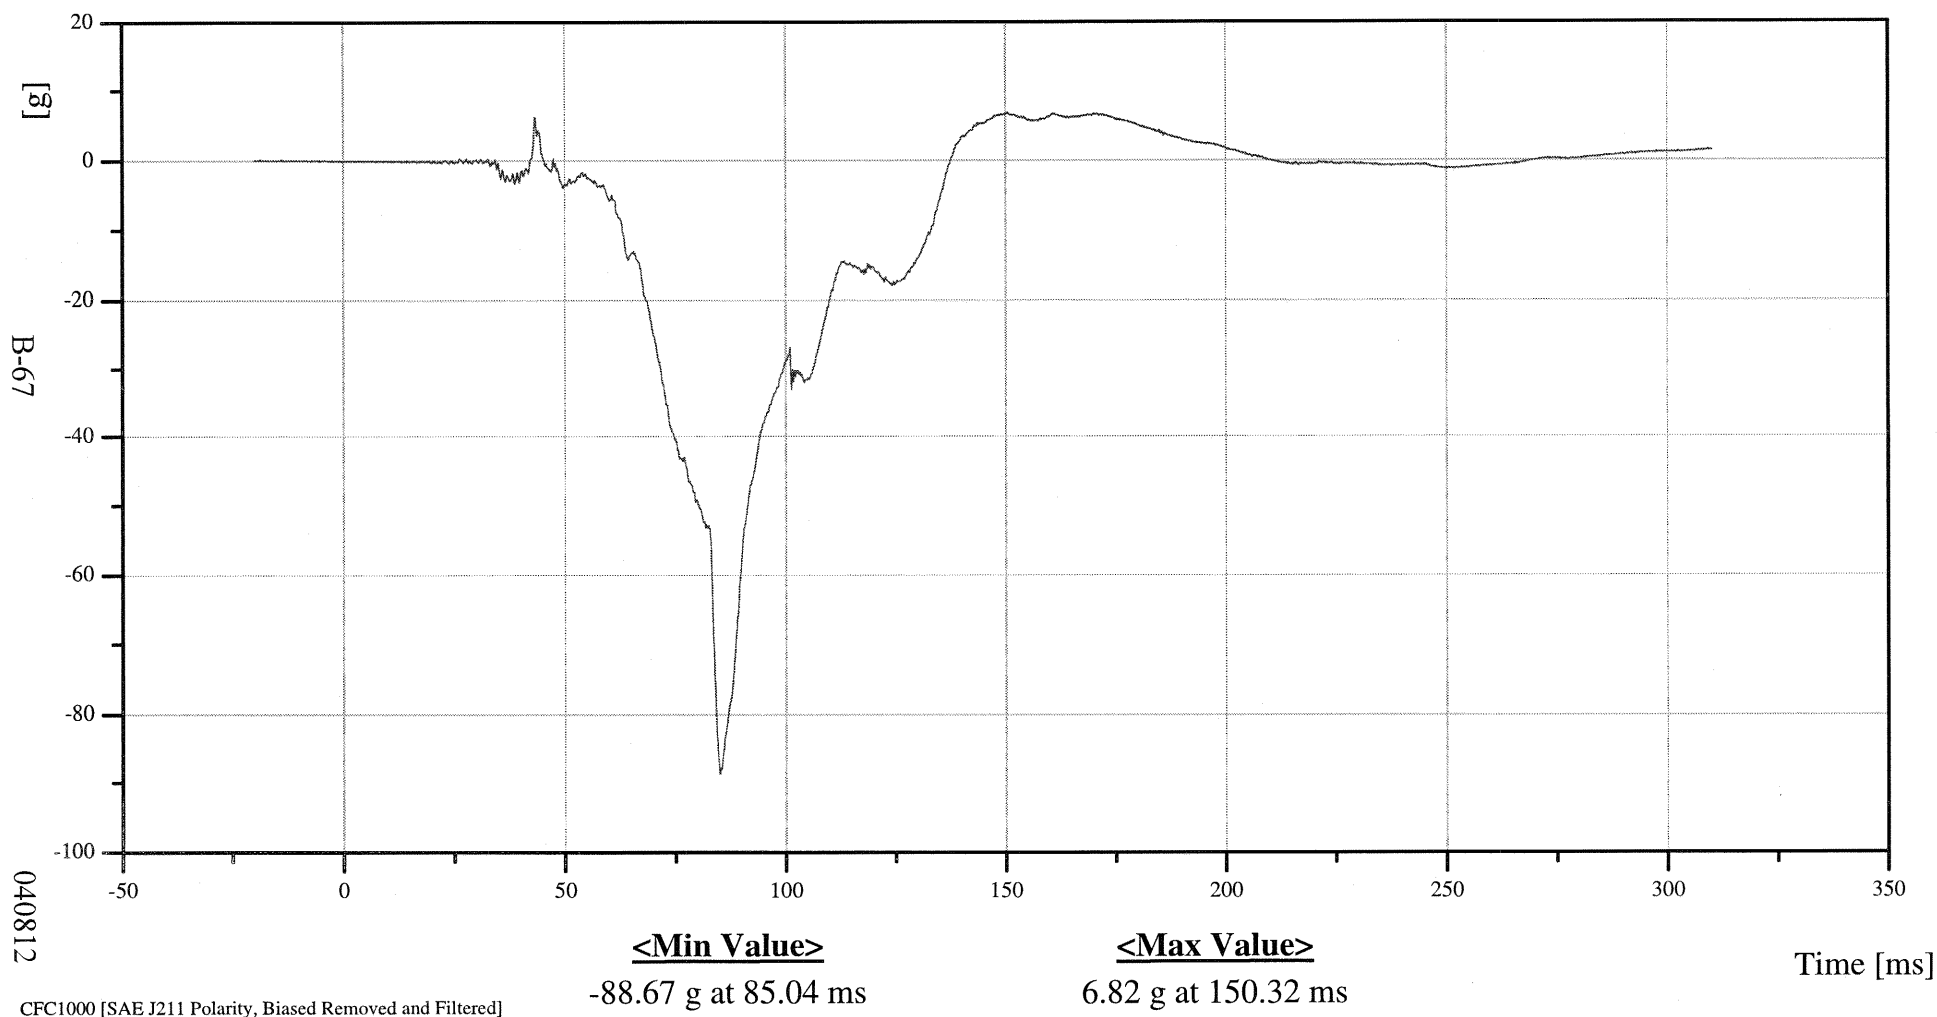



Transportation Research Center, Inc.

Head Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDYG2

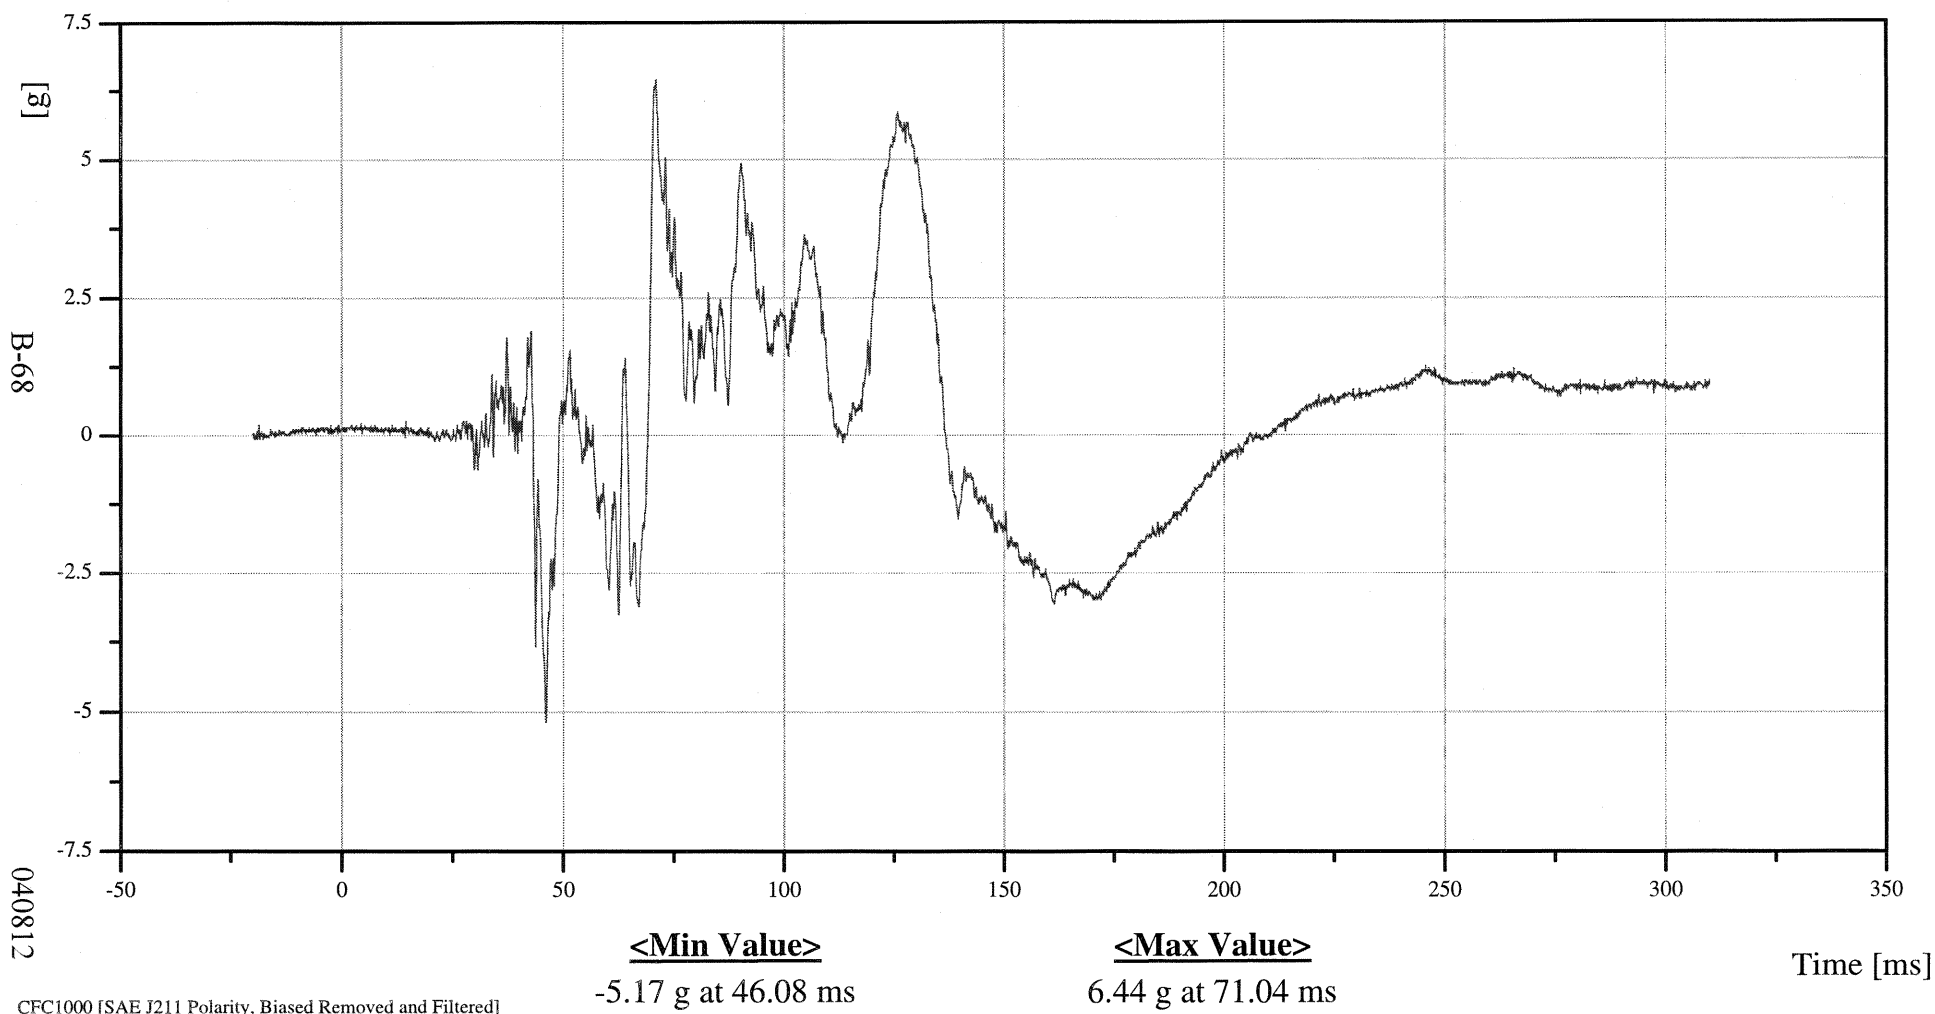



Transportation Research Center, Inc.

Head Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDZG2

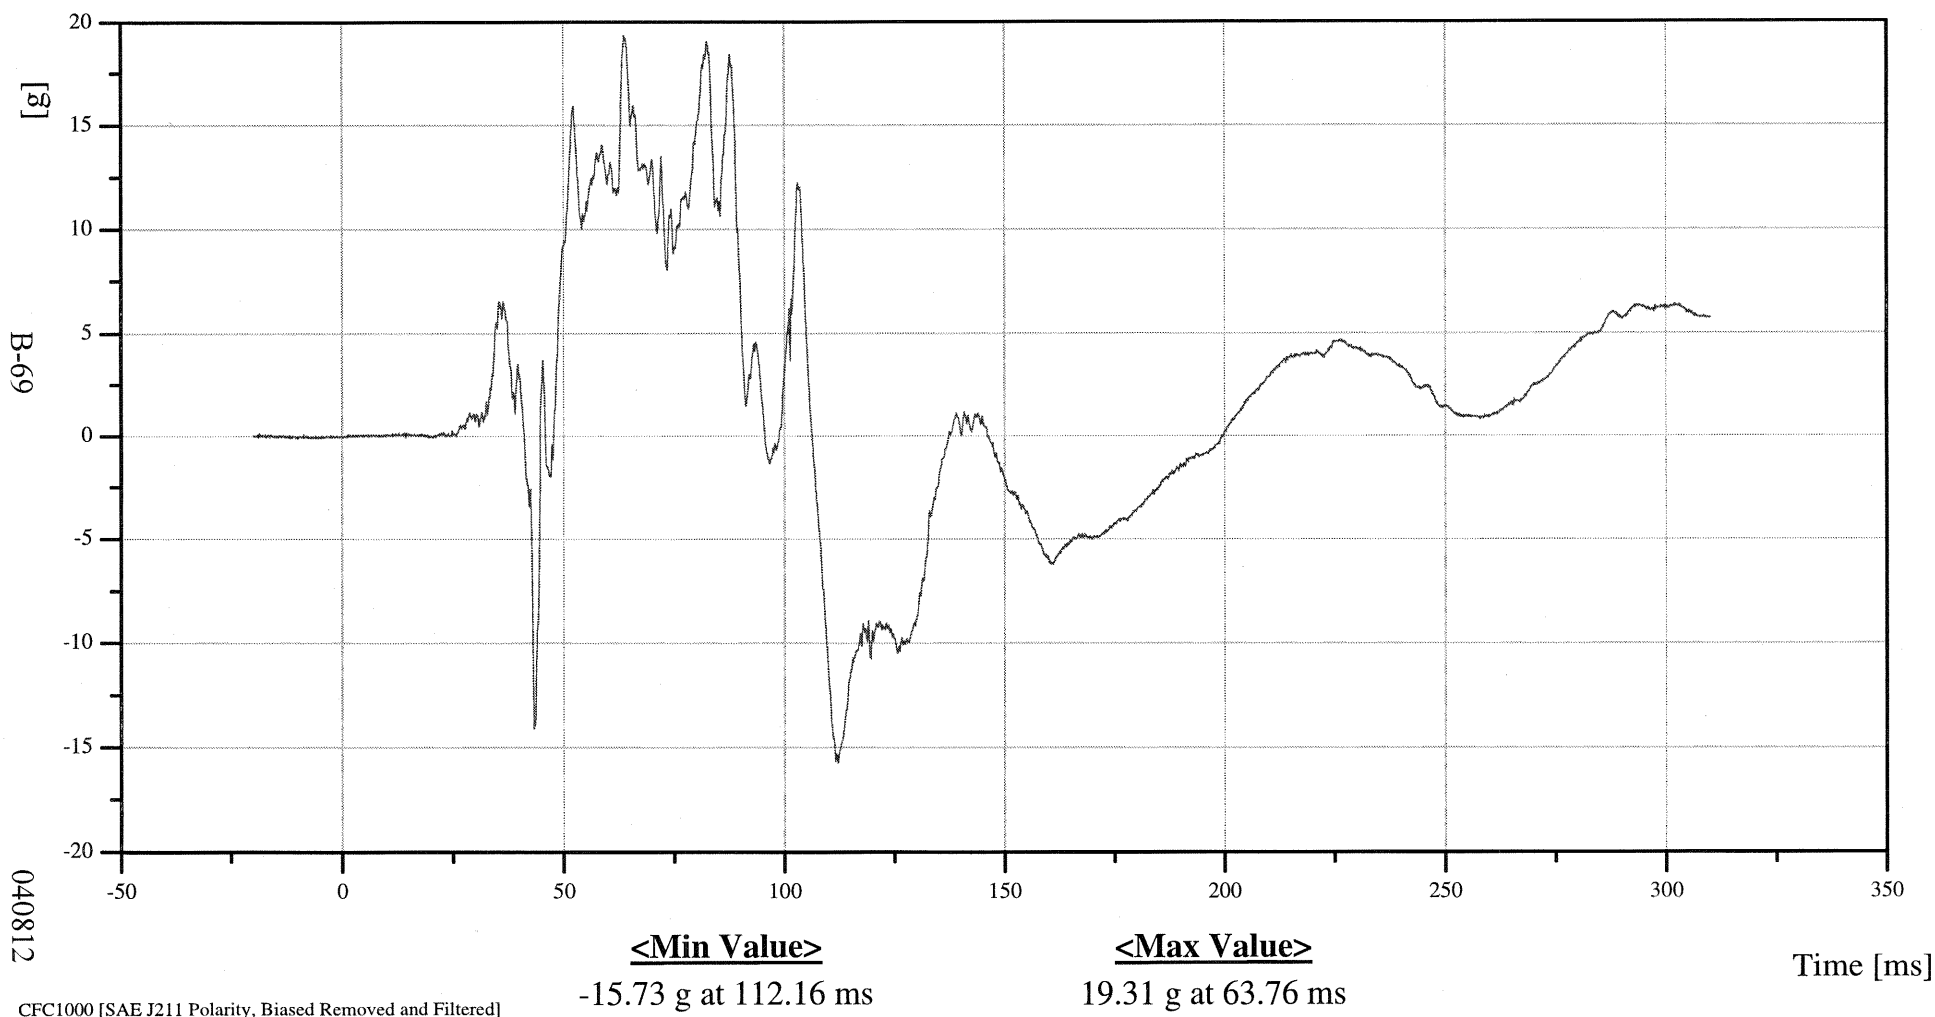



Transportation Research Center, Inc.

Head Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDRG2

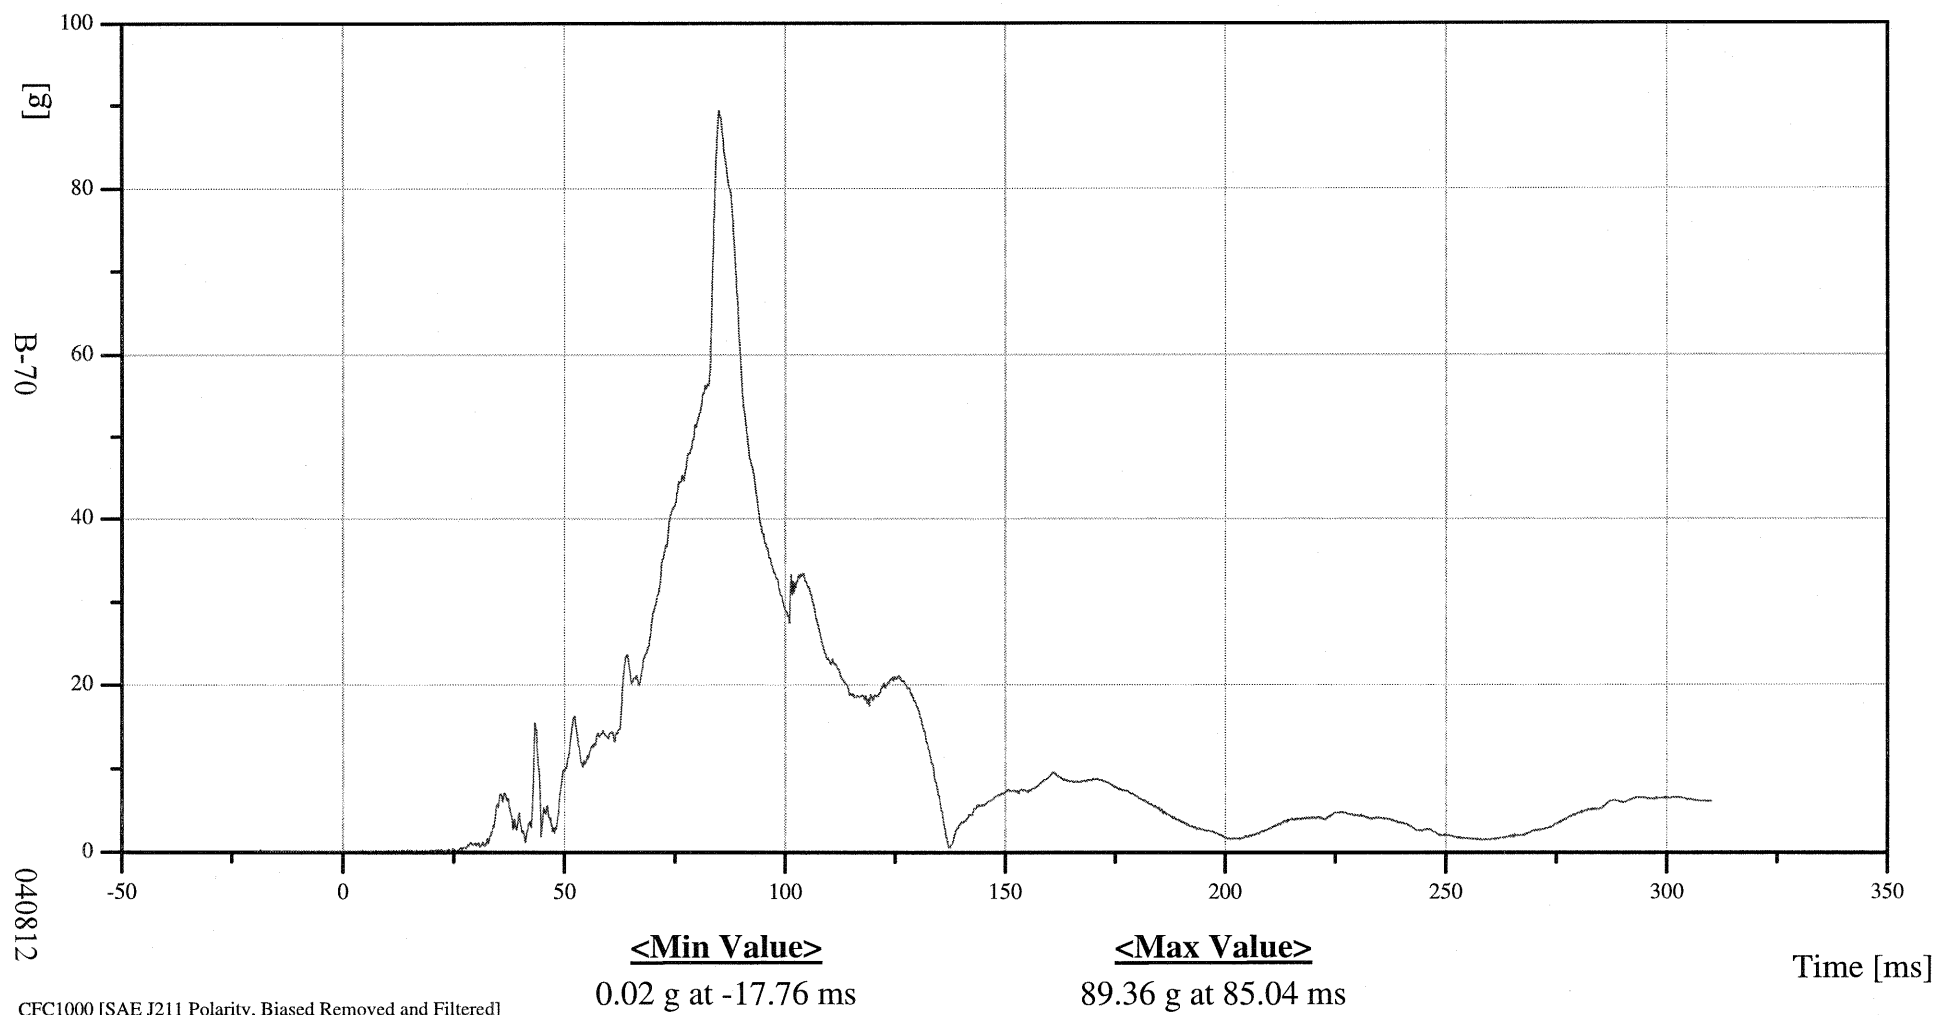



Transportation Research Center, Inc.

Head Accel Red X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDXR2

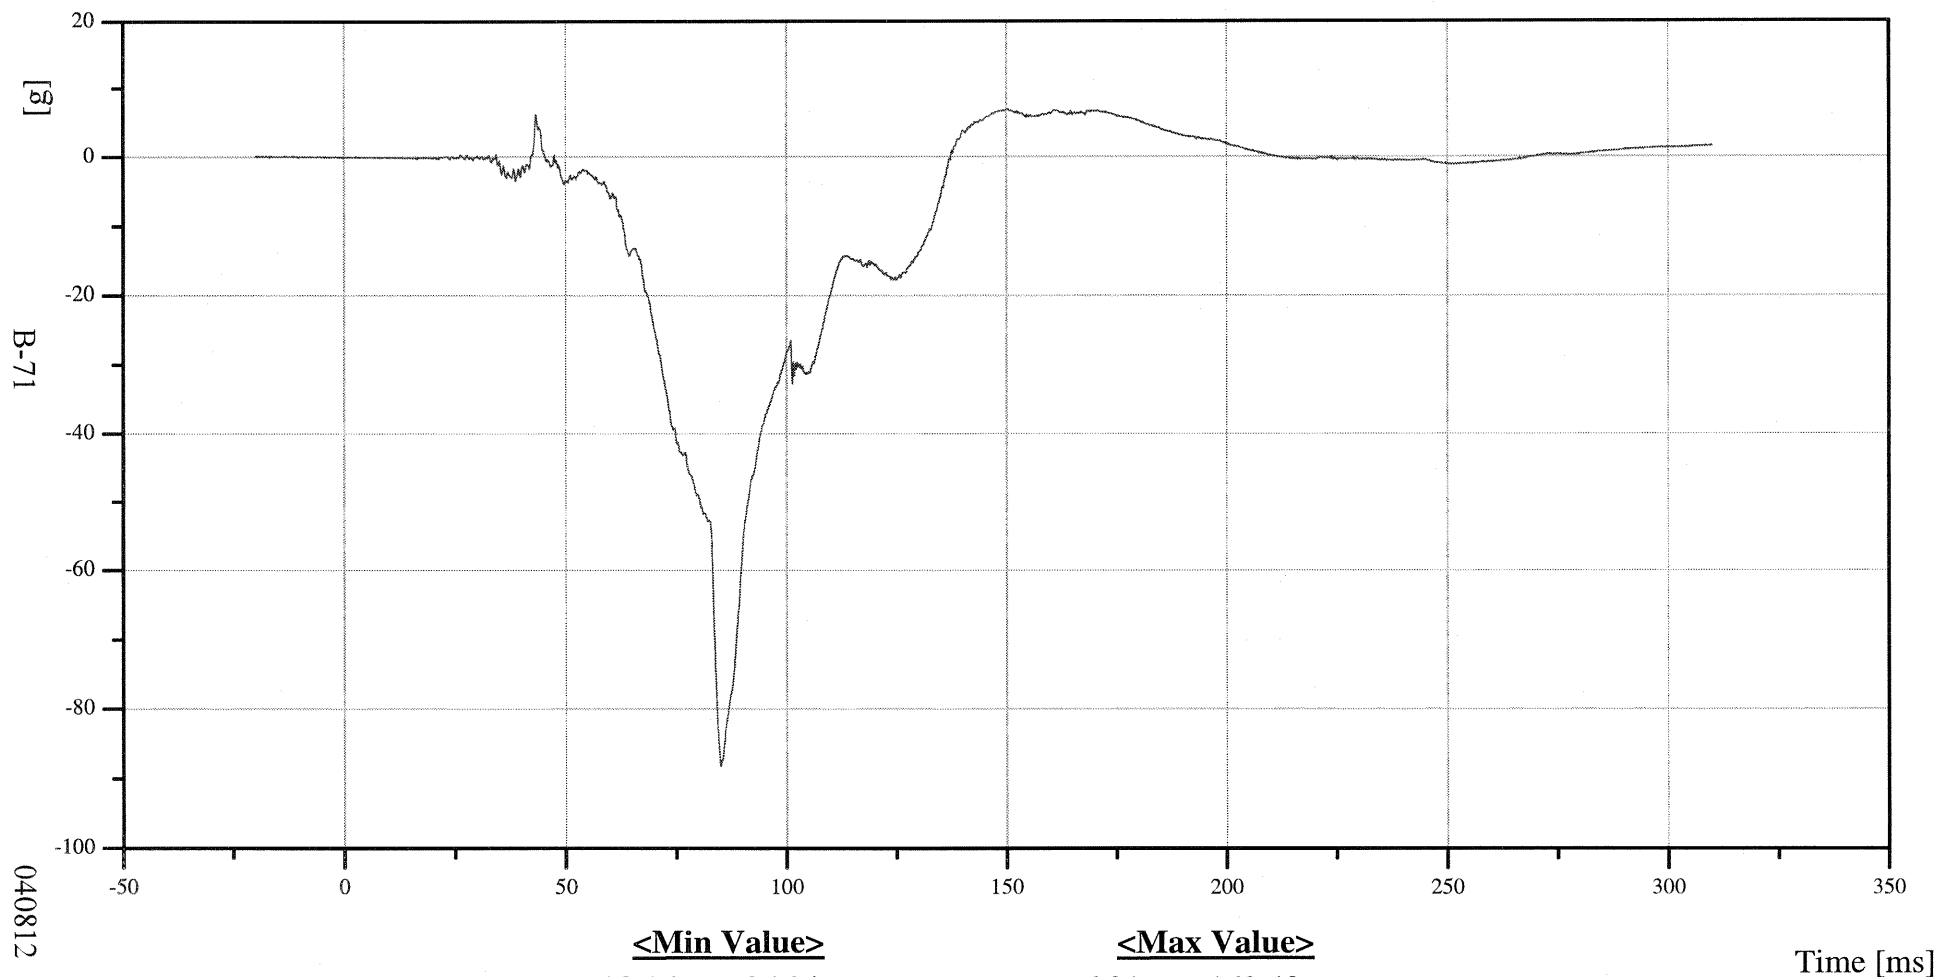

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Head Accel Red Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDYR2

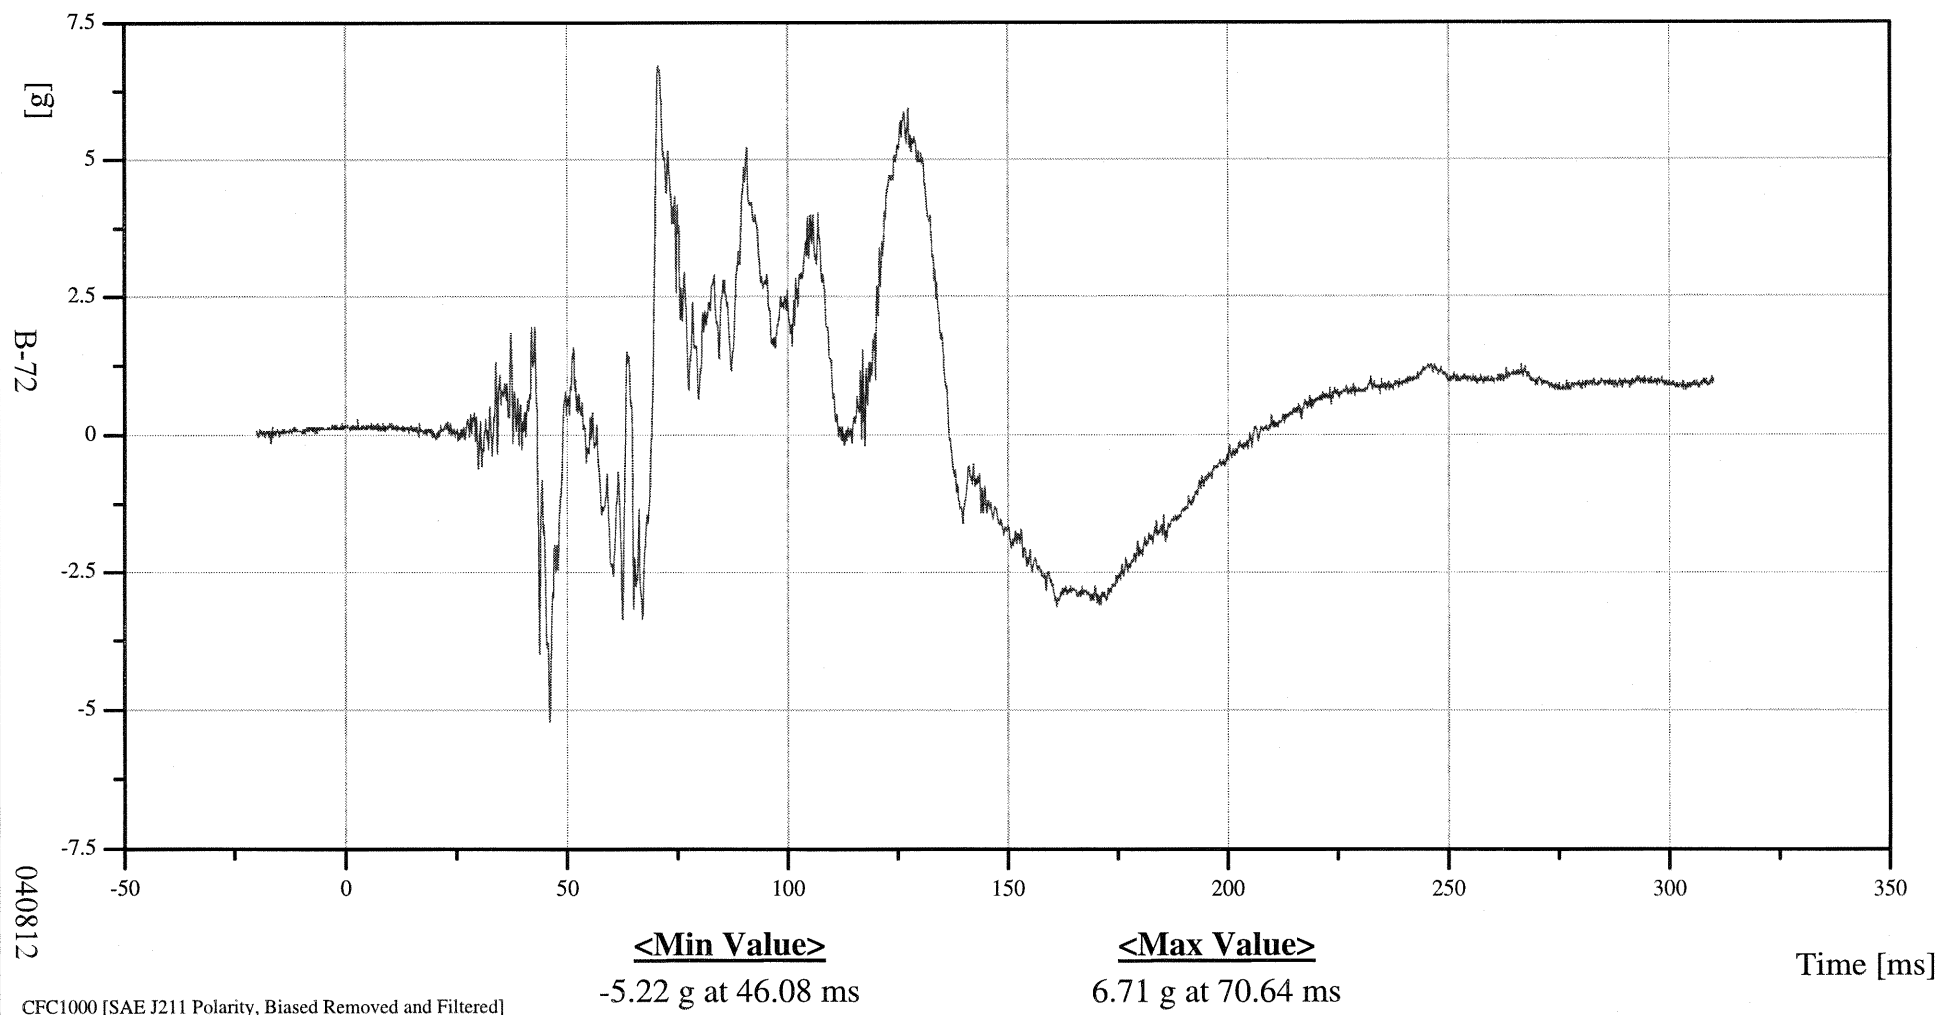



Transportation Research Center, Inc.

Head Accel Red Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDZR2

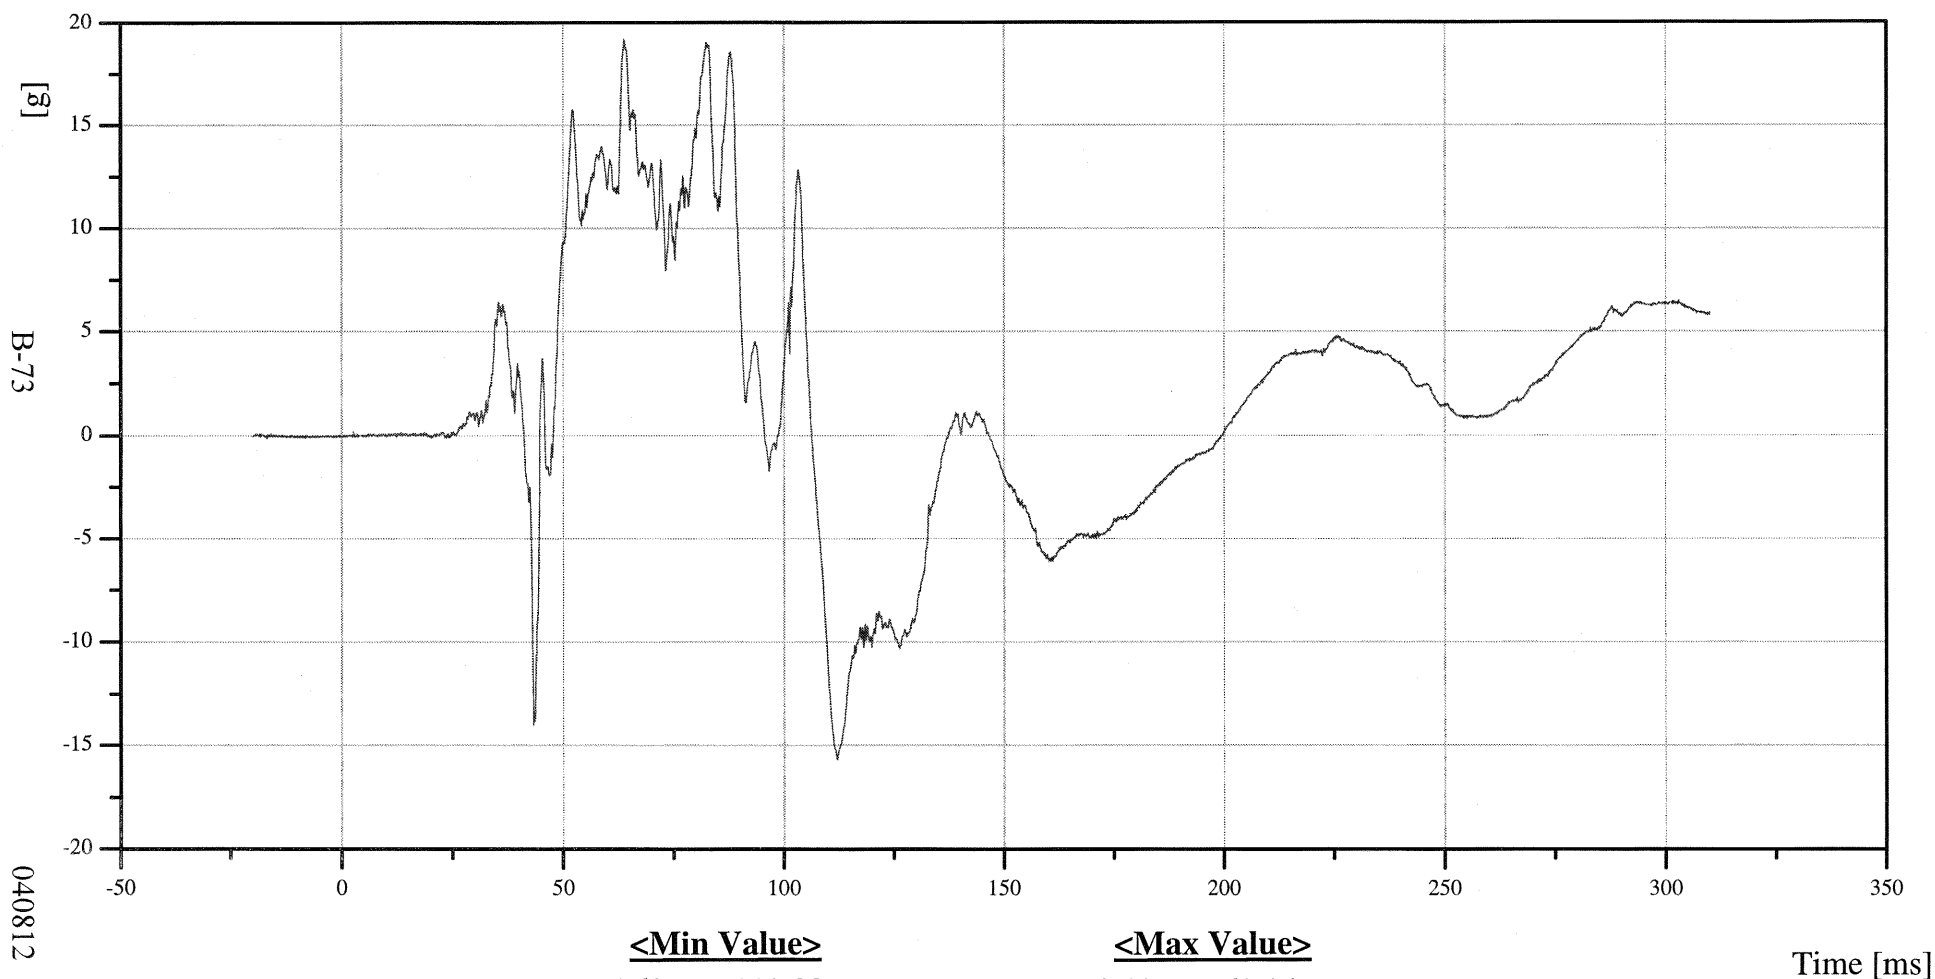

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXF2

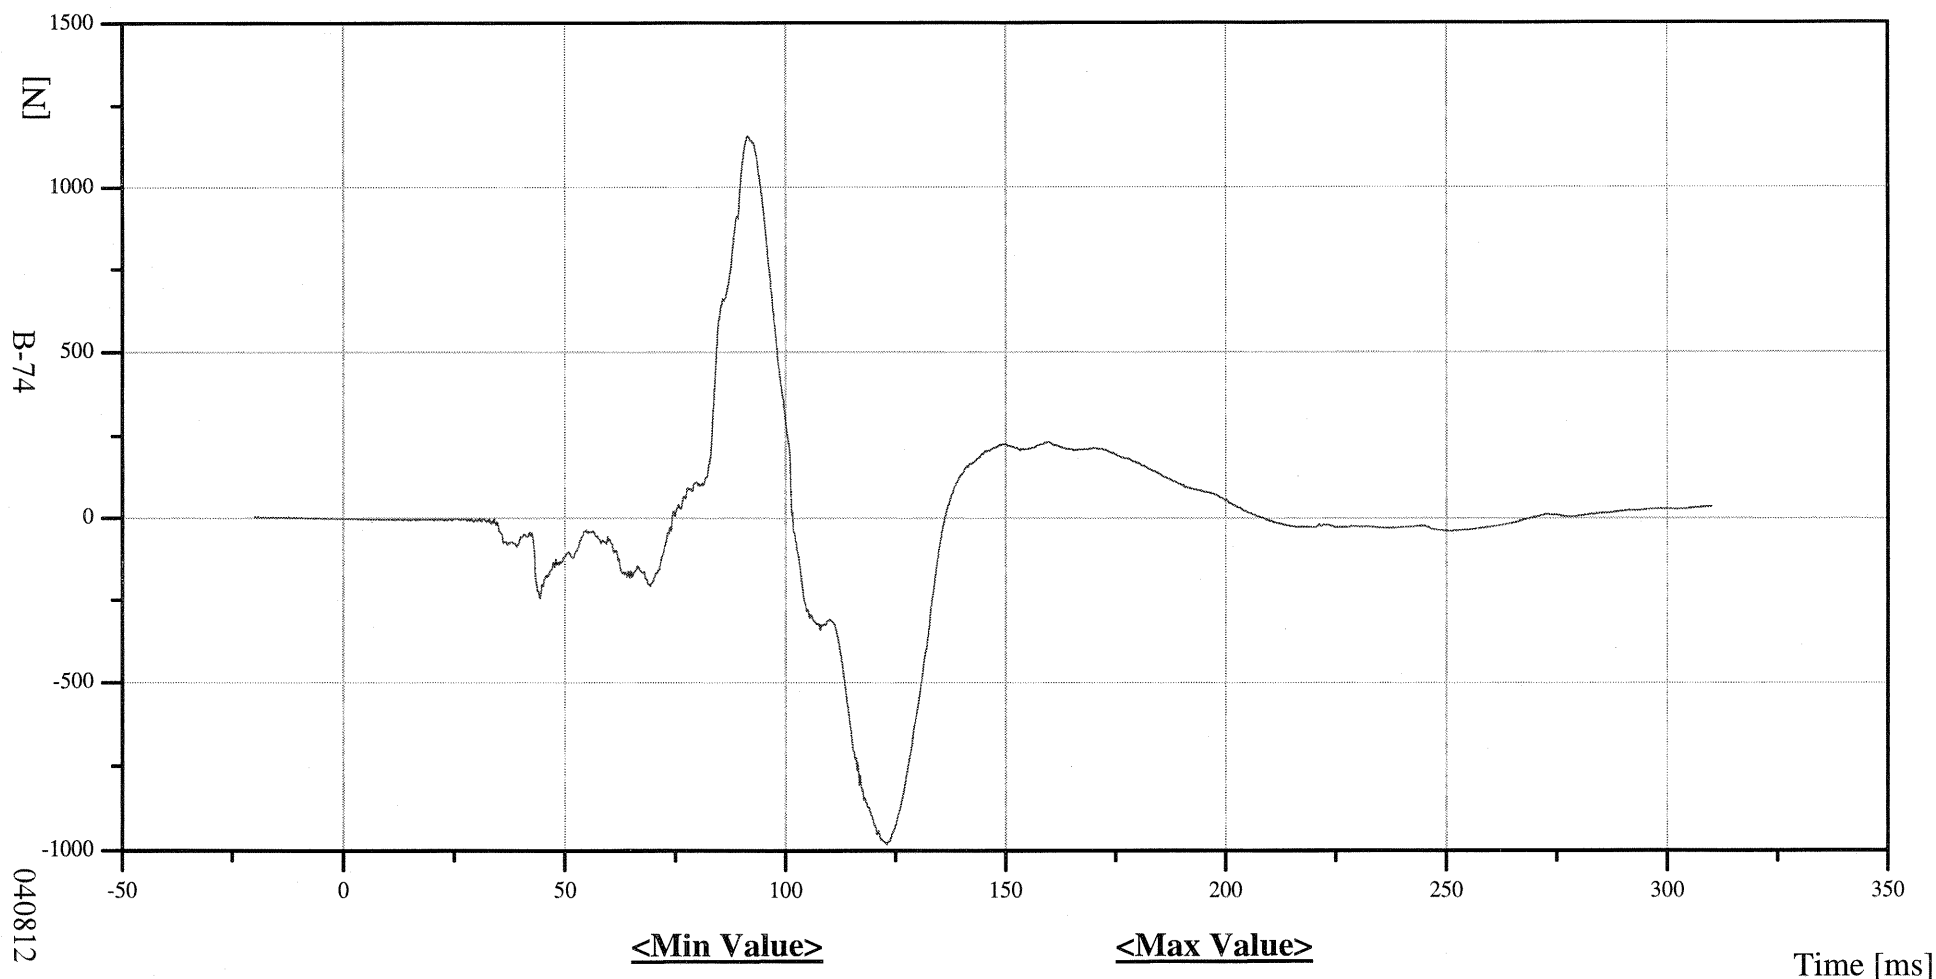

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYF2

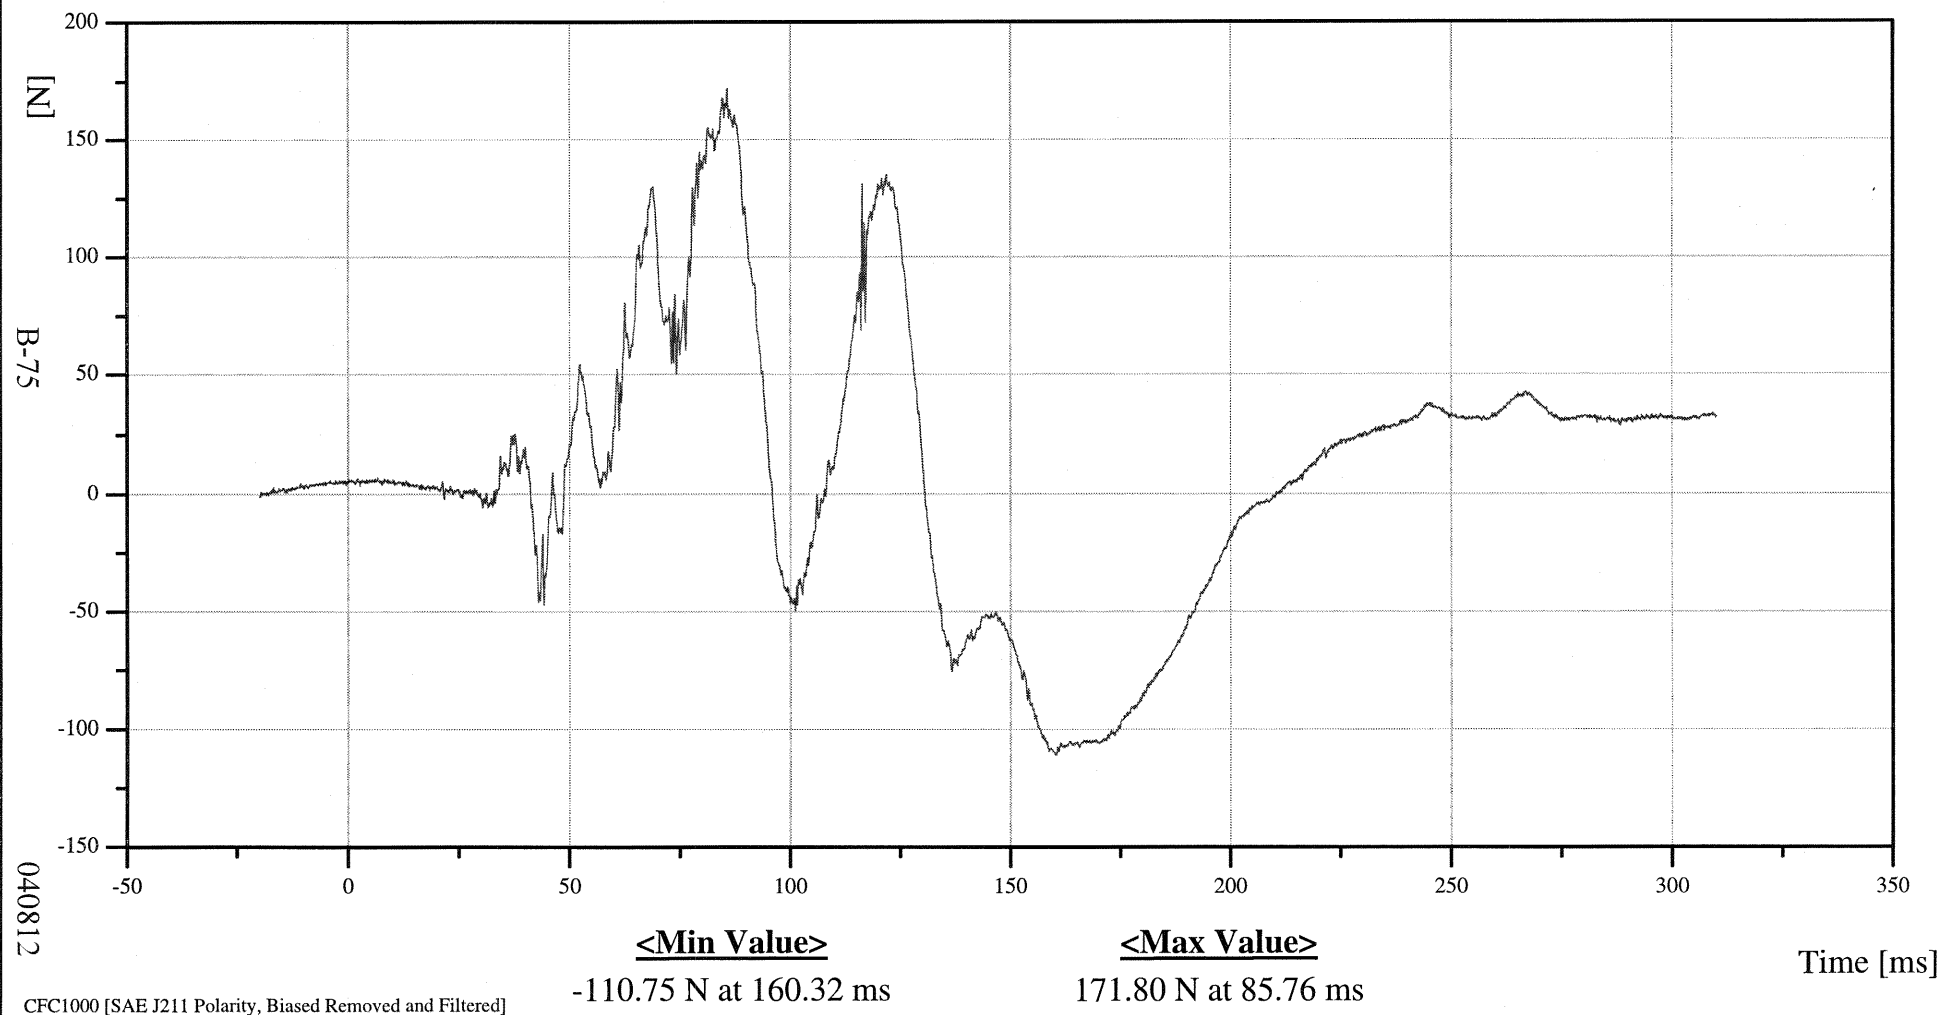



Transportation Research Center, Inc.

Neck Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZF2

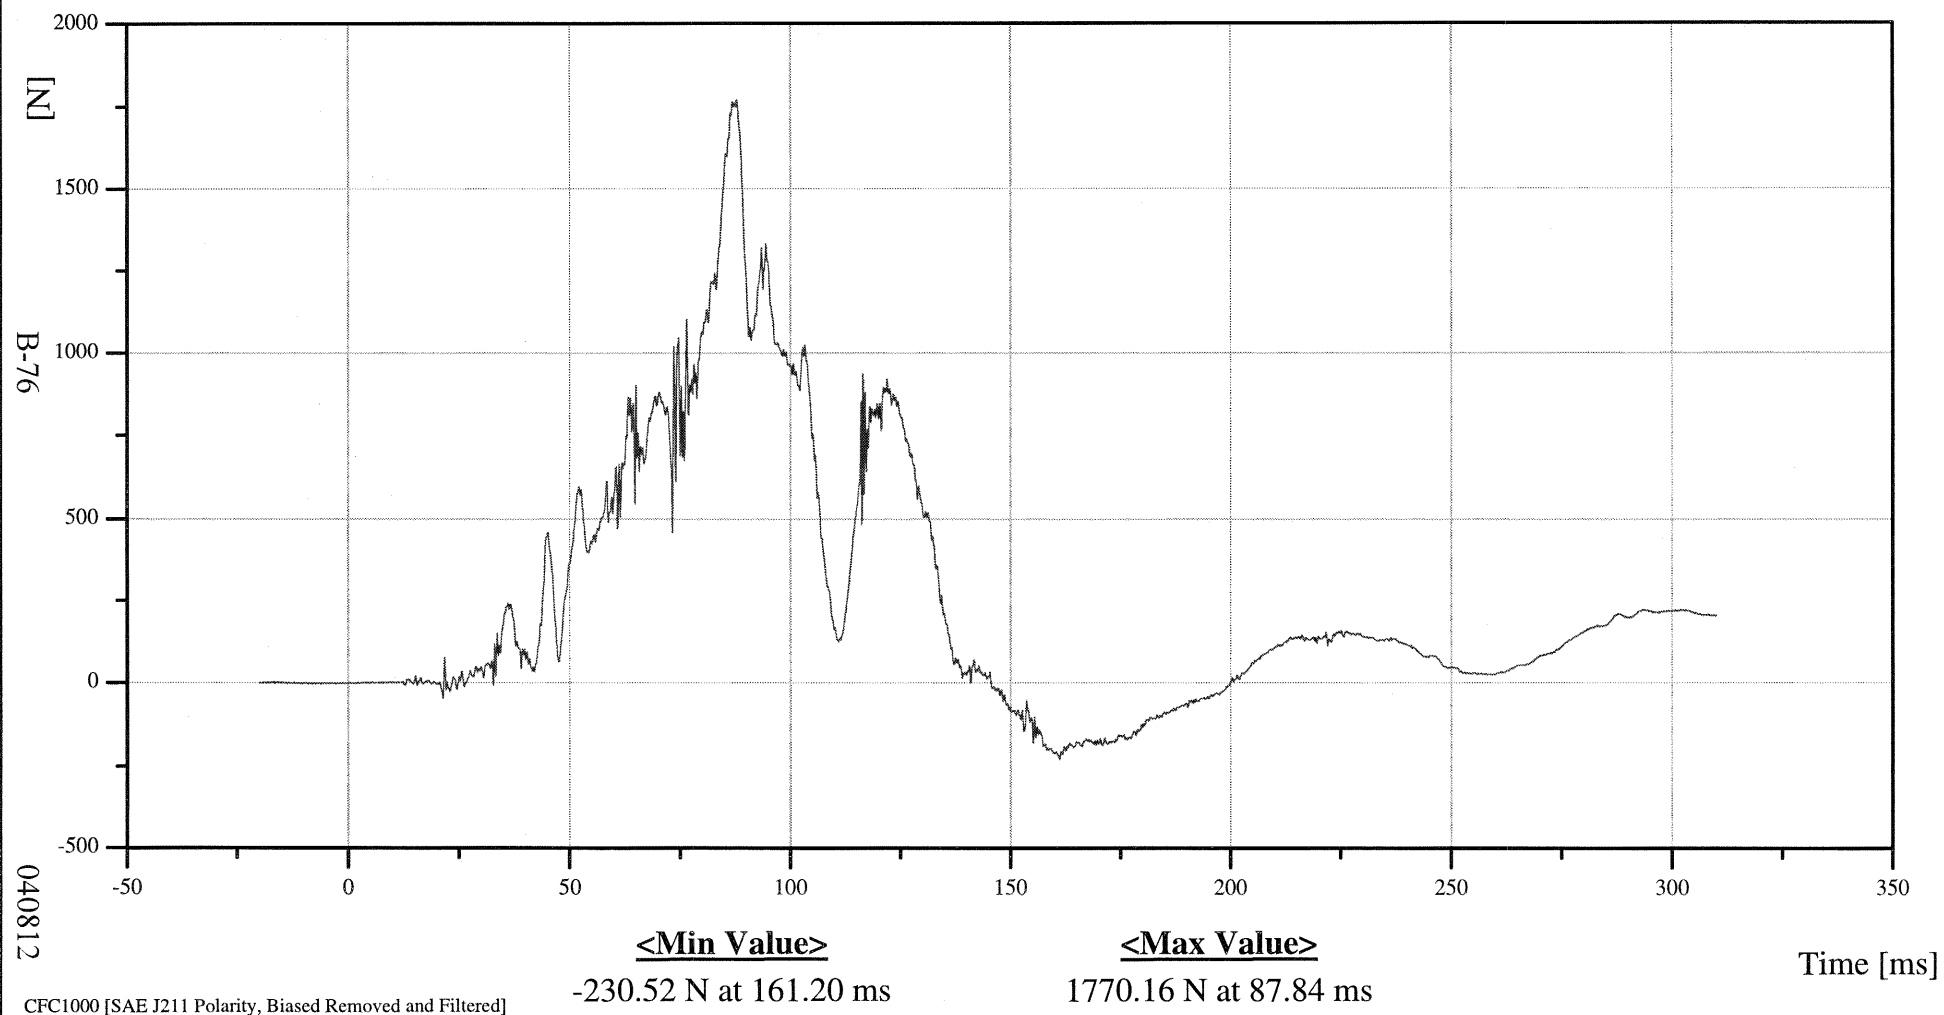



Transportation Research Center, Inc.

Neck Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXM2

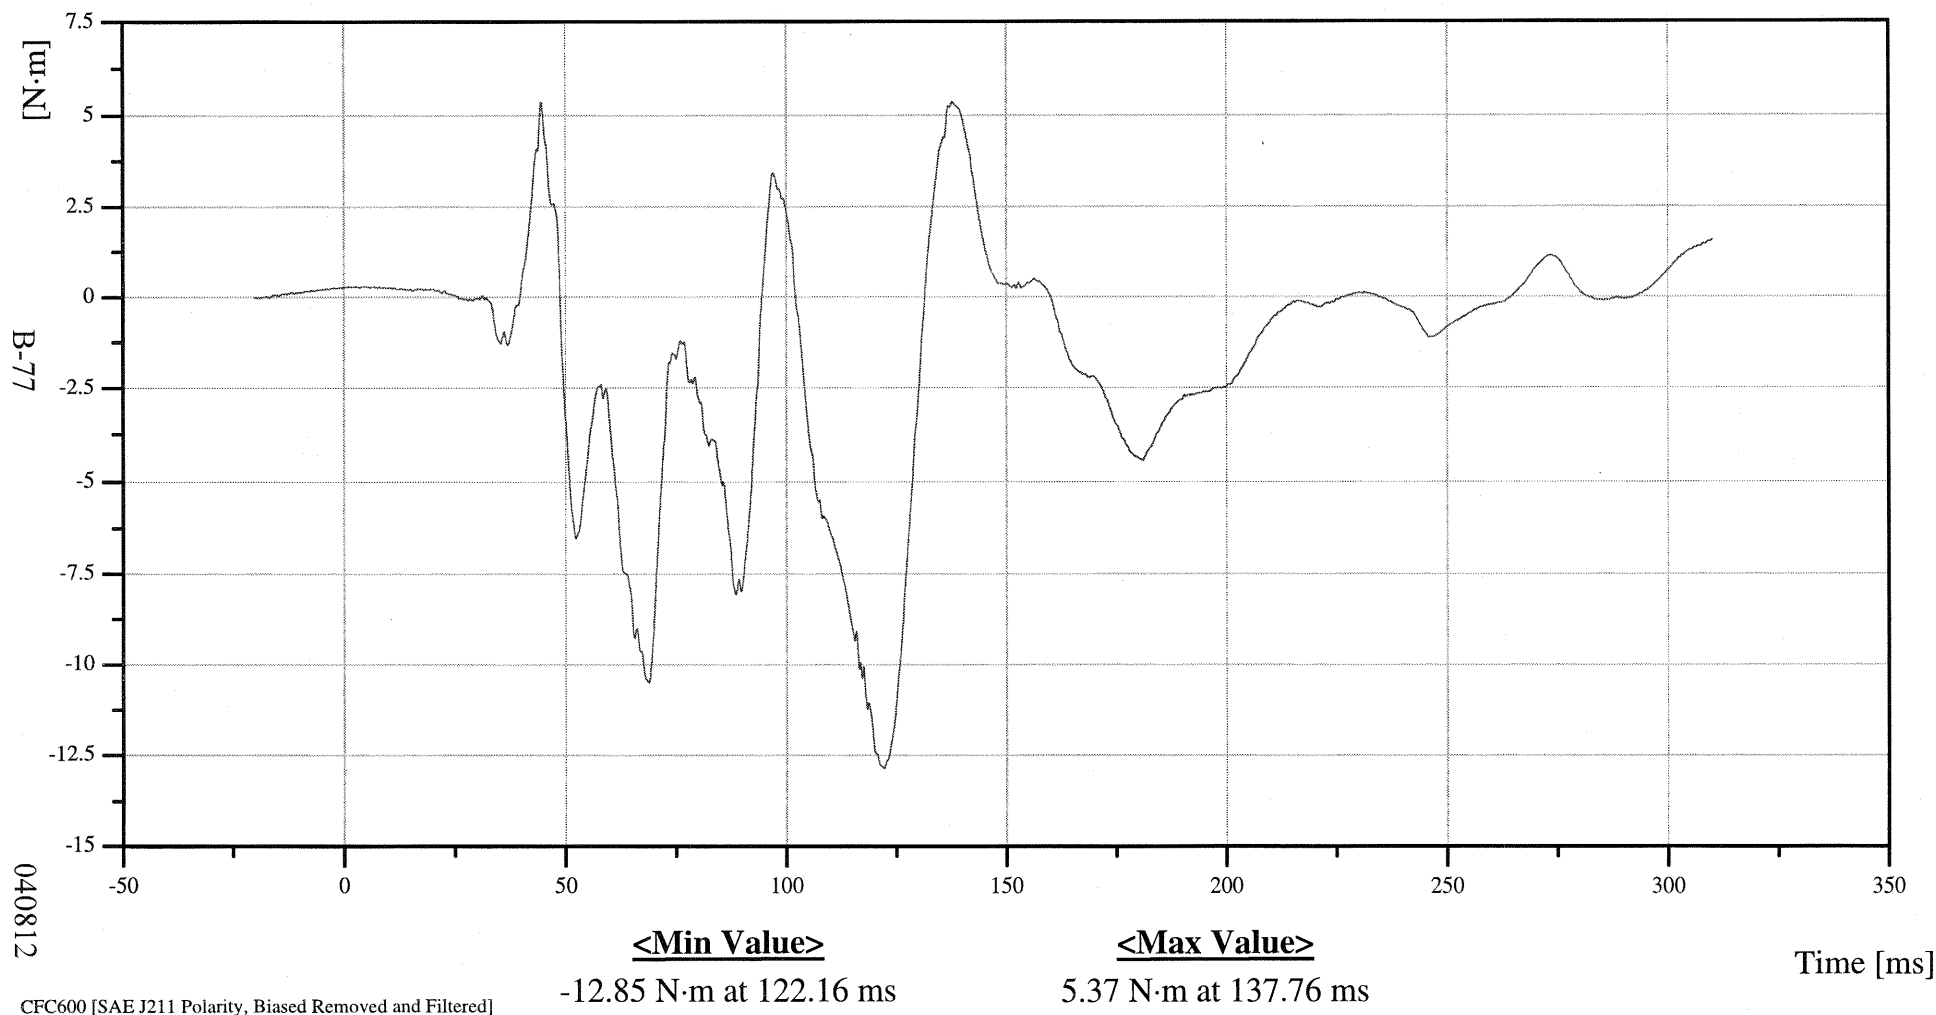



Transportation Research Center, Inc.

Neck Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYM2

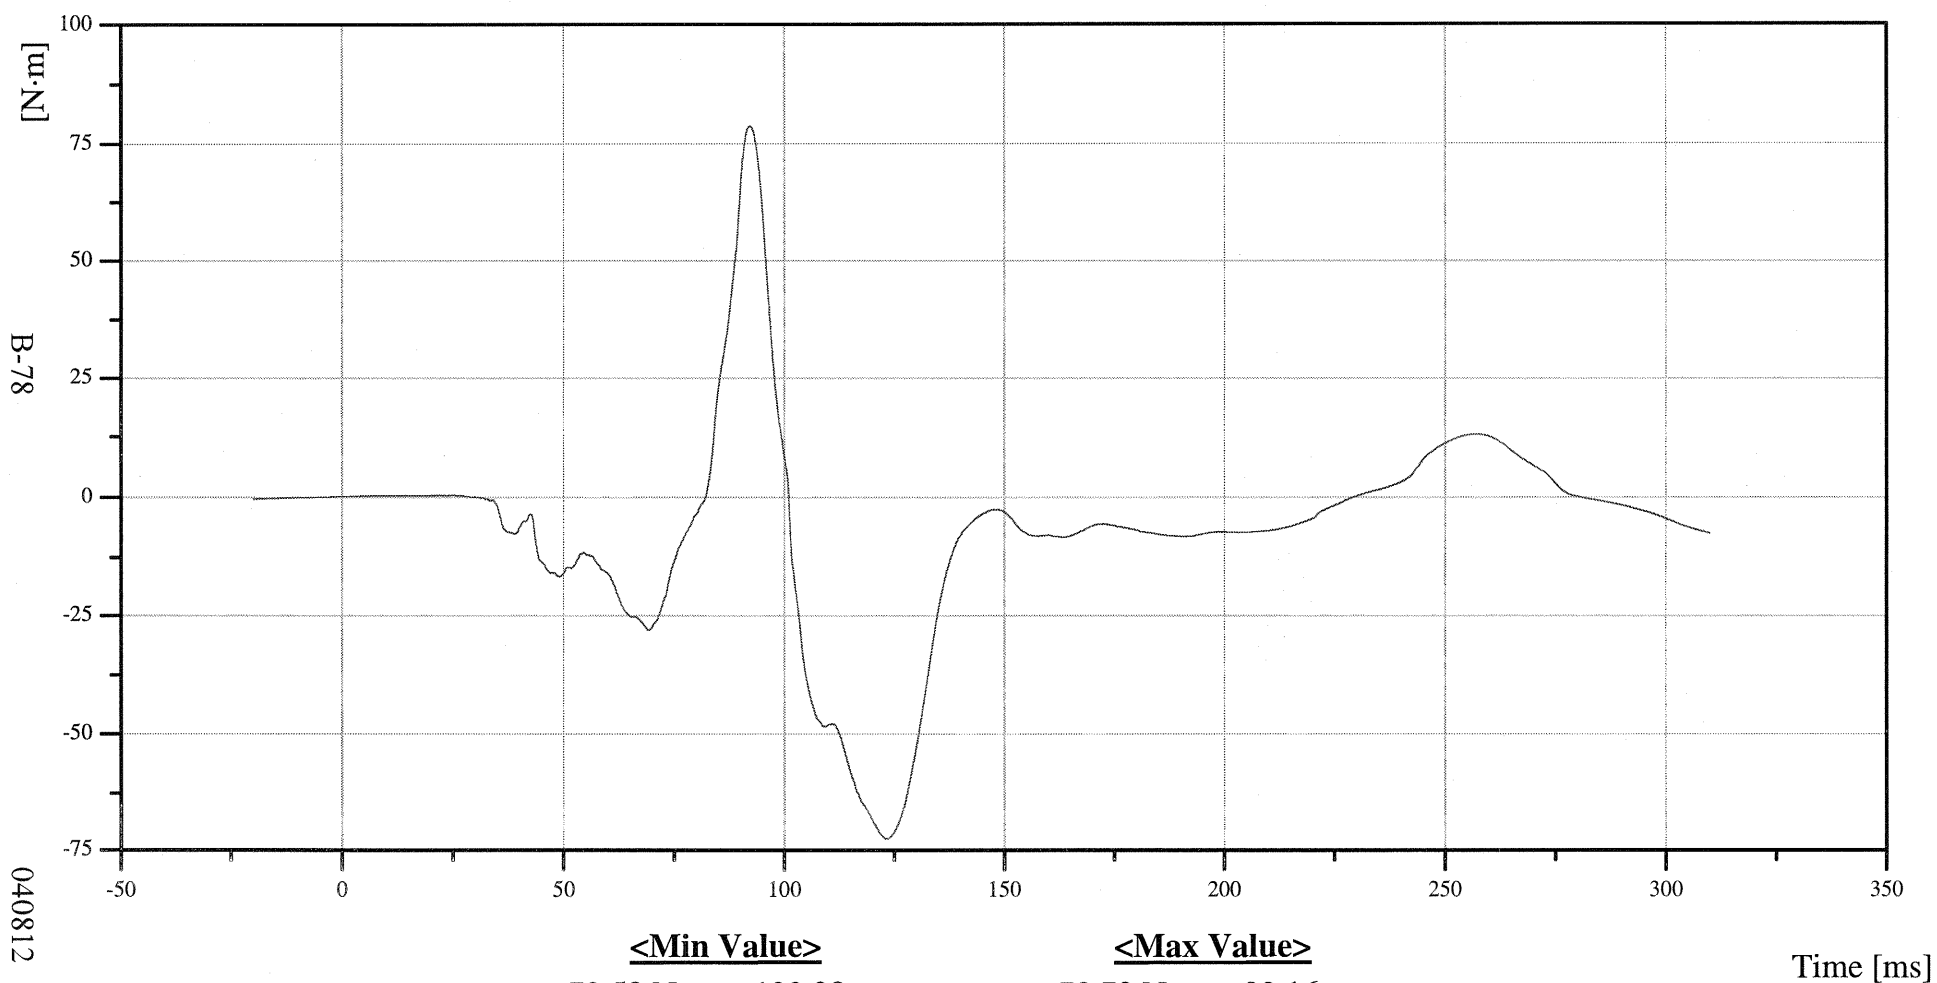

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZM2

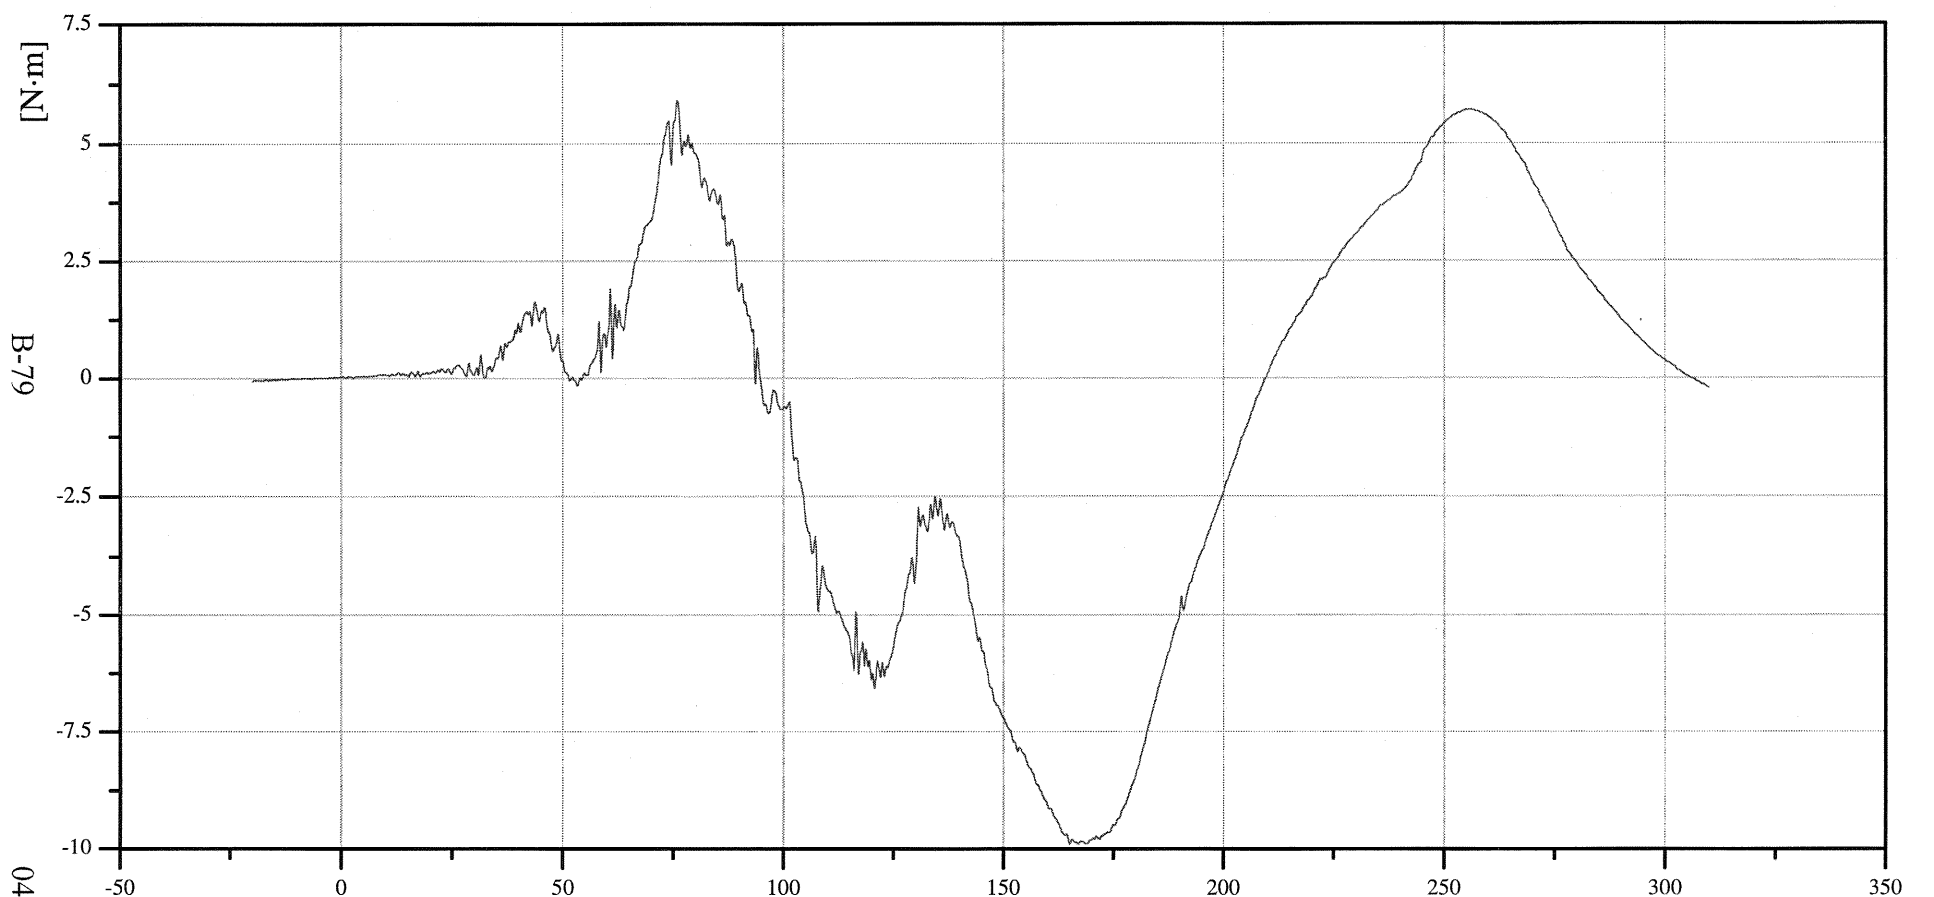

<Min Value>

-9.90 N·m at 167.04 ms

<Max Value>

5.90 N·m at 76.00 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXF2

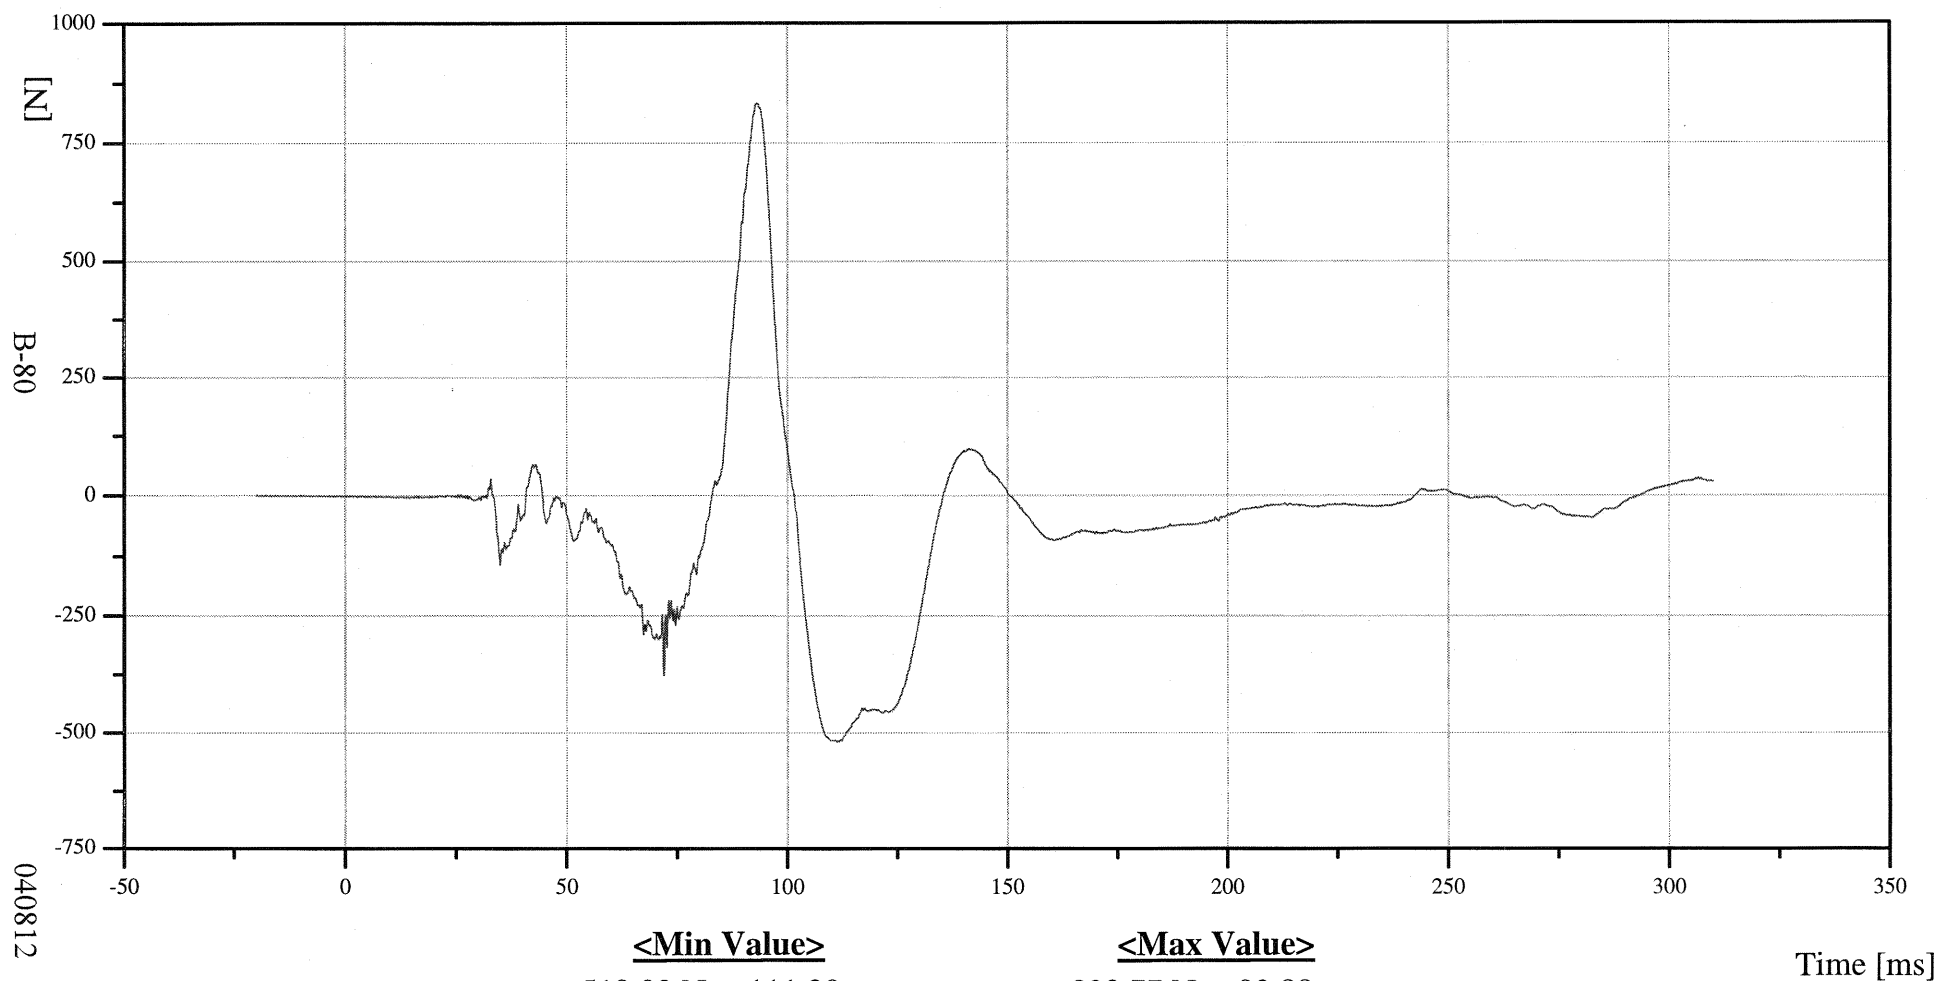

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYF2

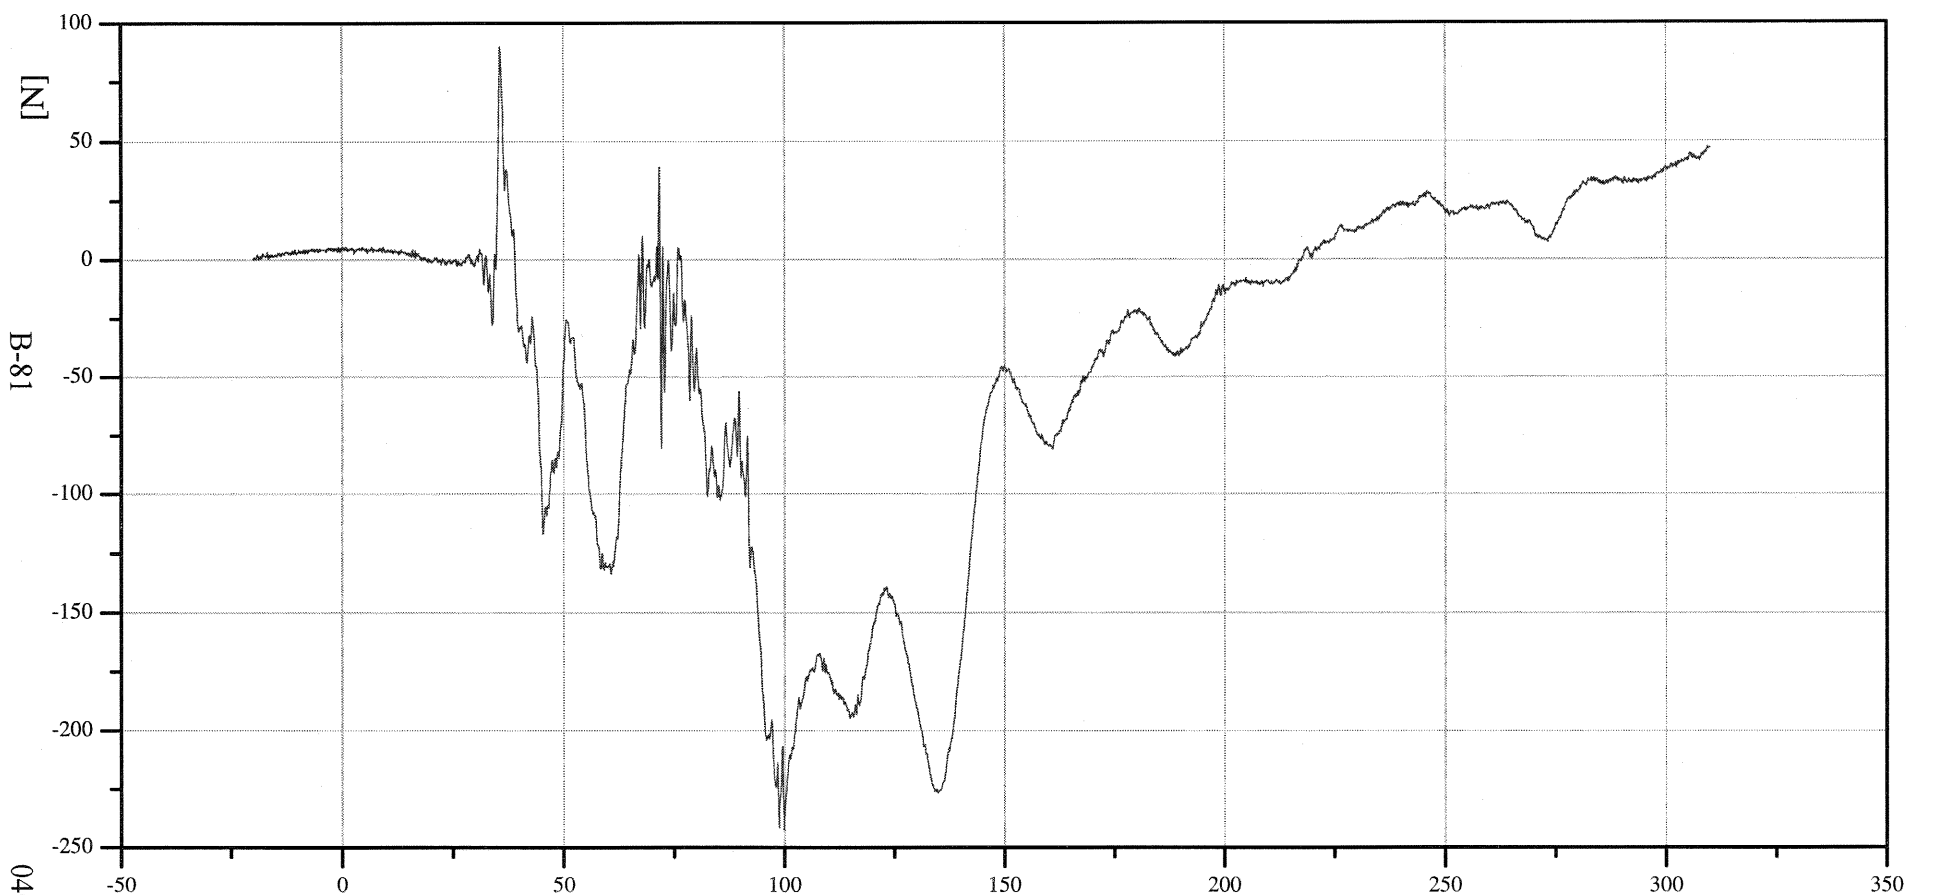

<Min Value>

<Max Value>

-242.29 N at 99.92 ms

89.47 N at 35.68 ms

Time [ms]

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZF2

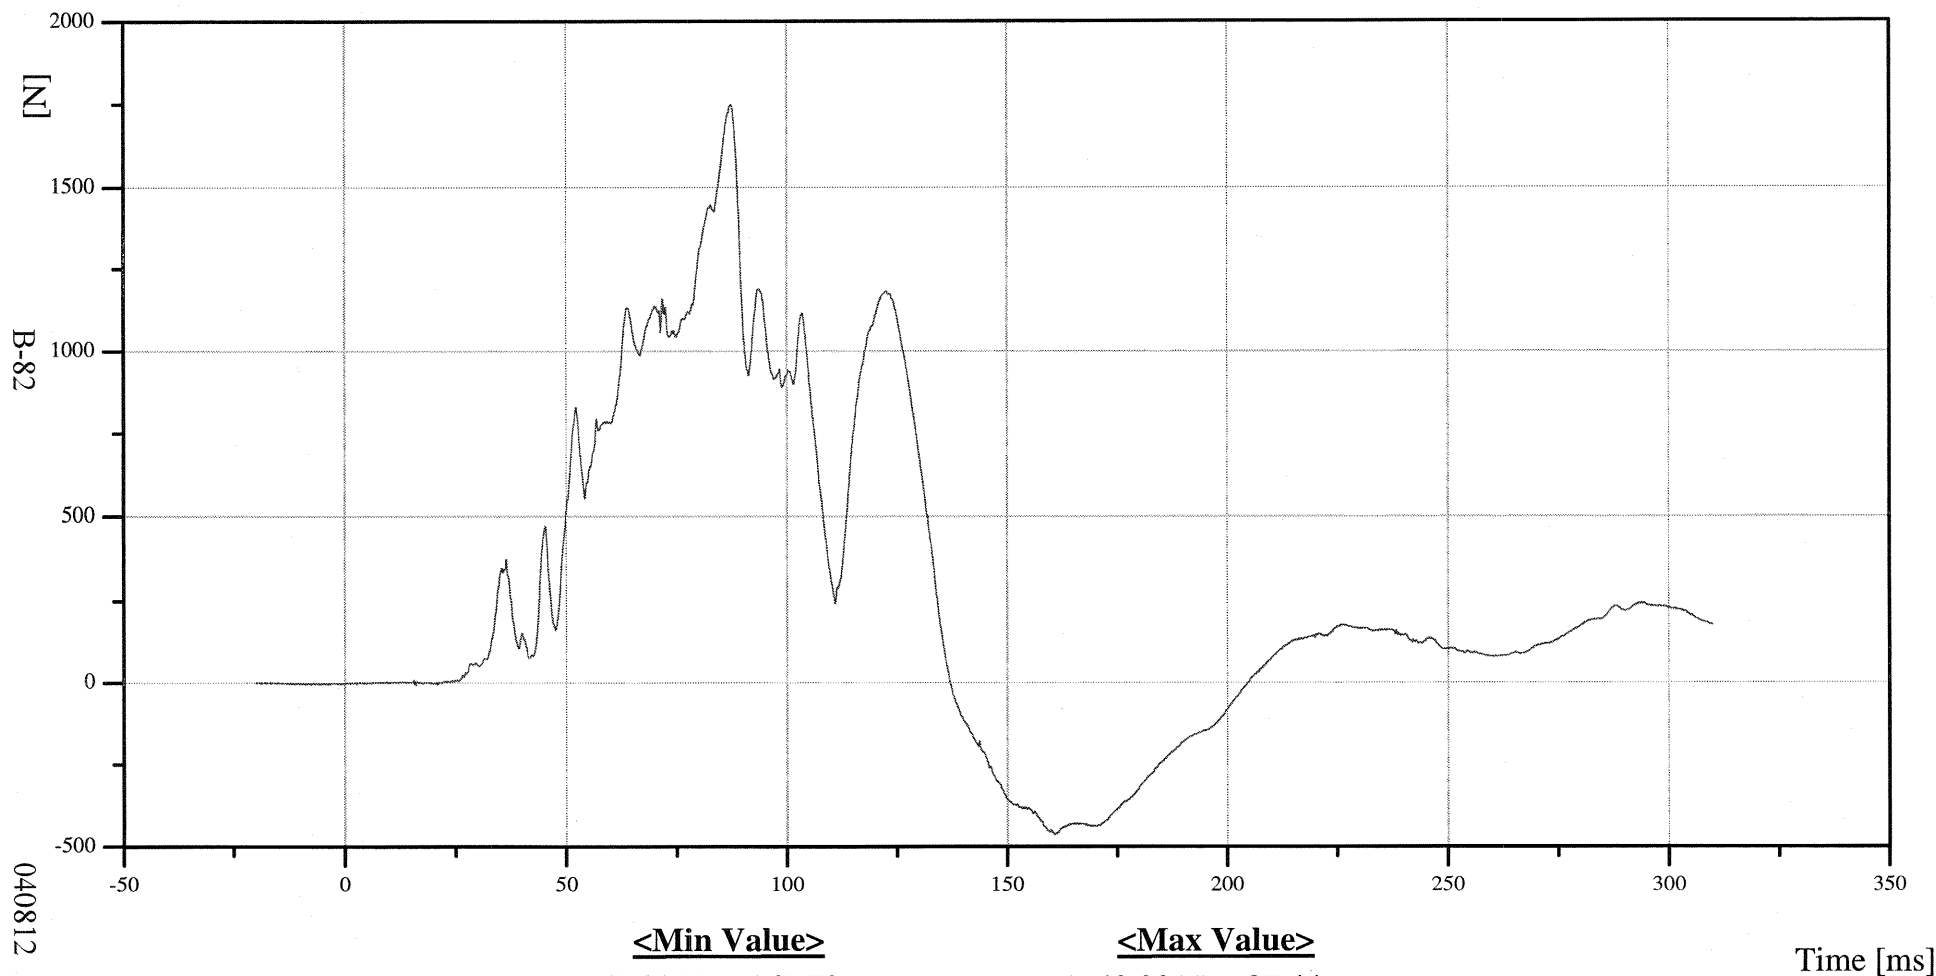

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXM2

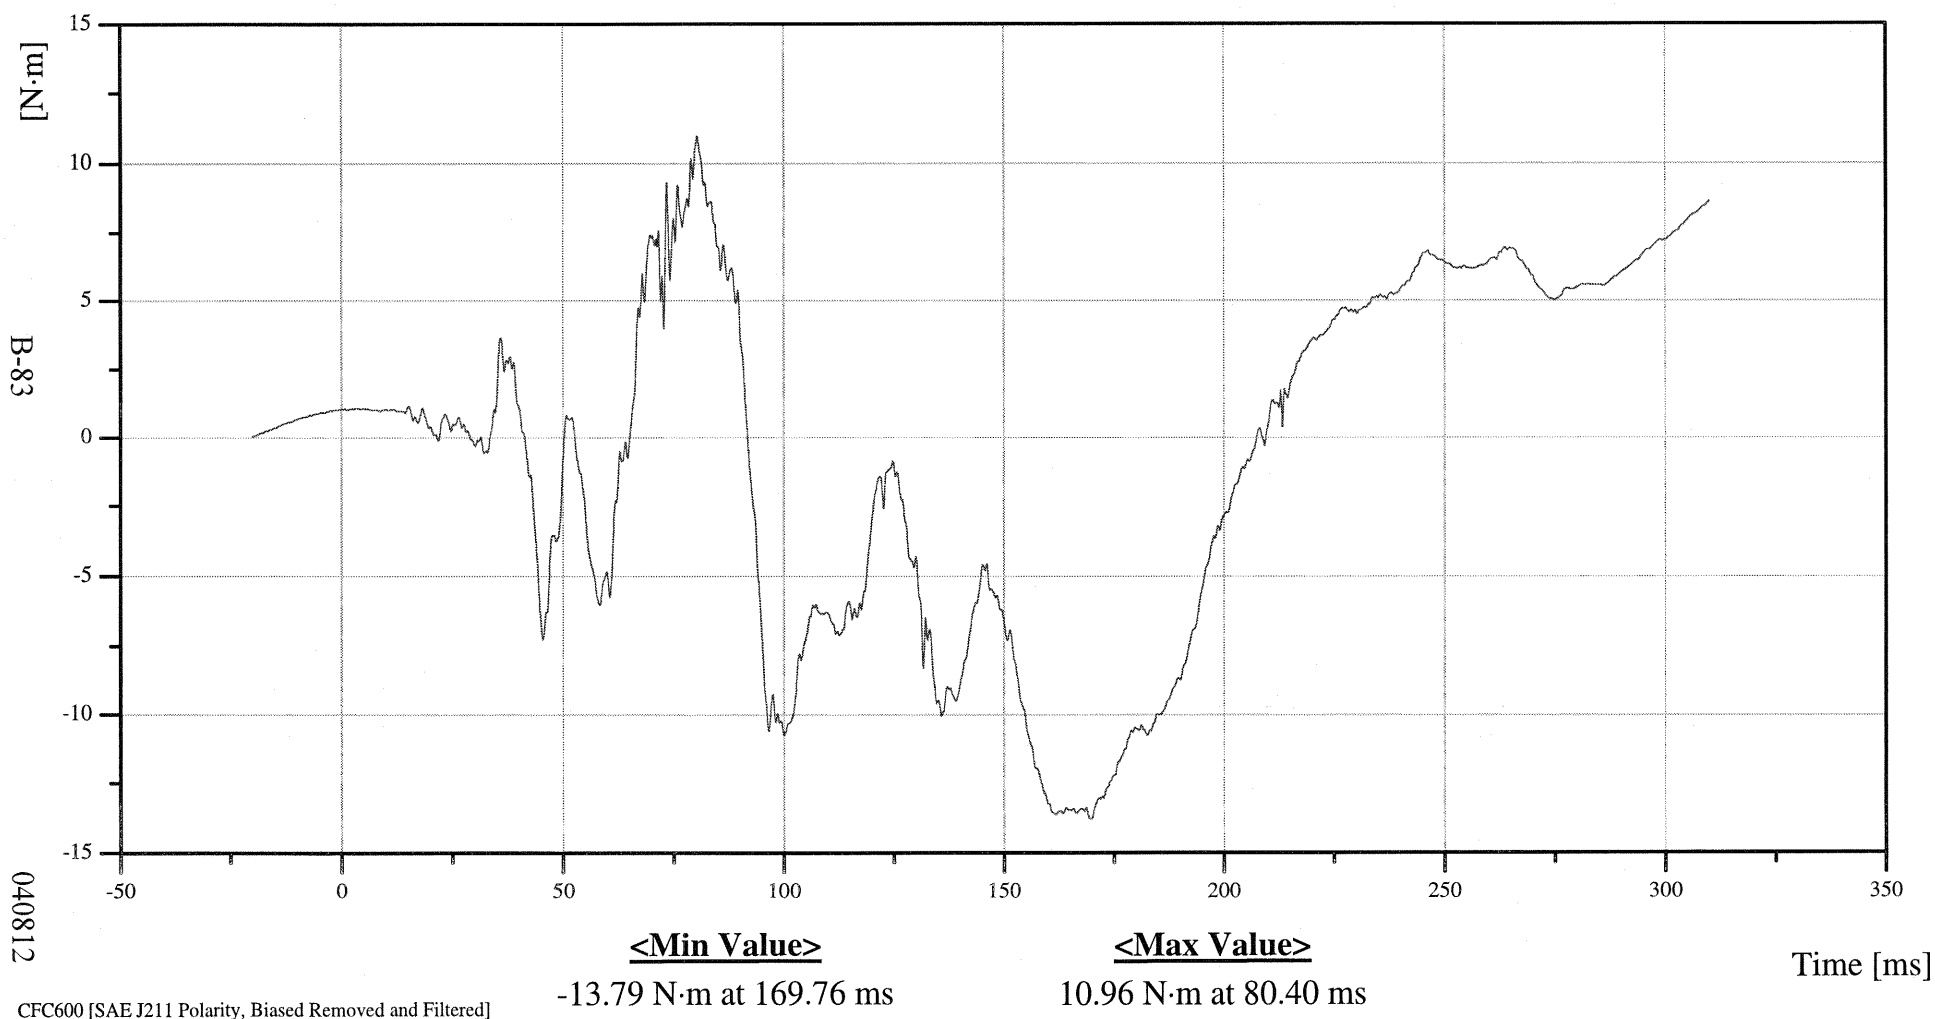



Transportation Research Center, Inc.

Neck Lwr Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYM2

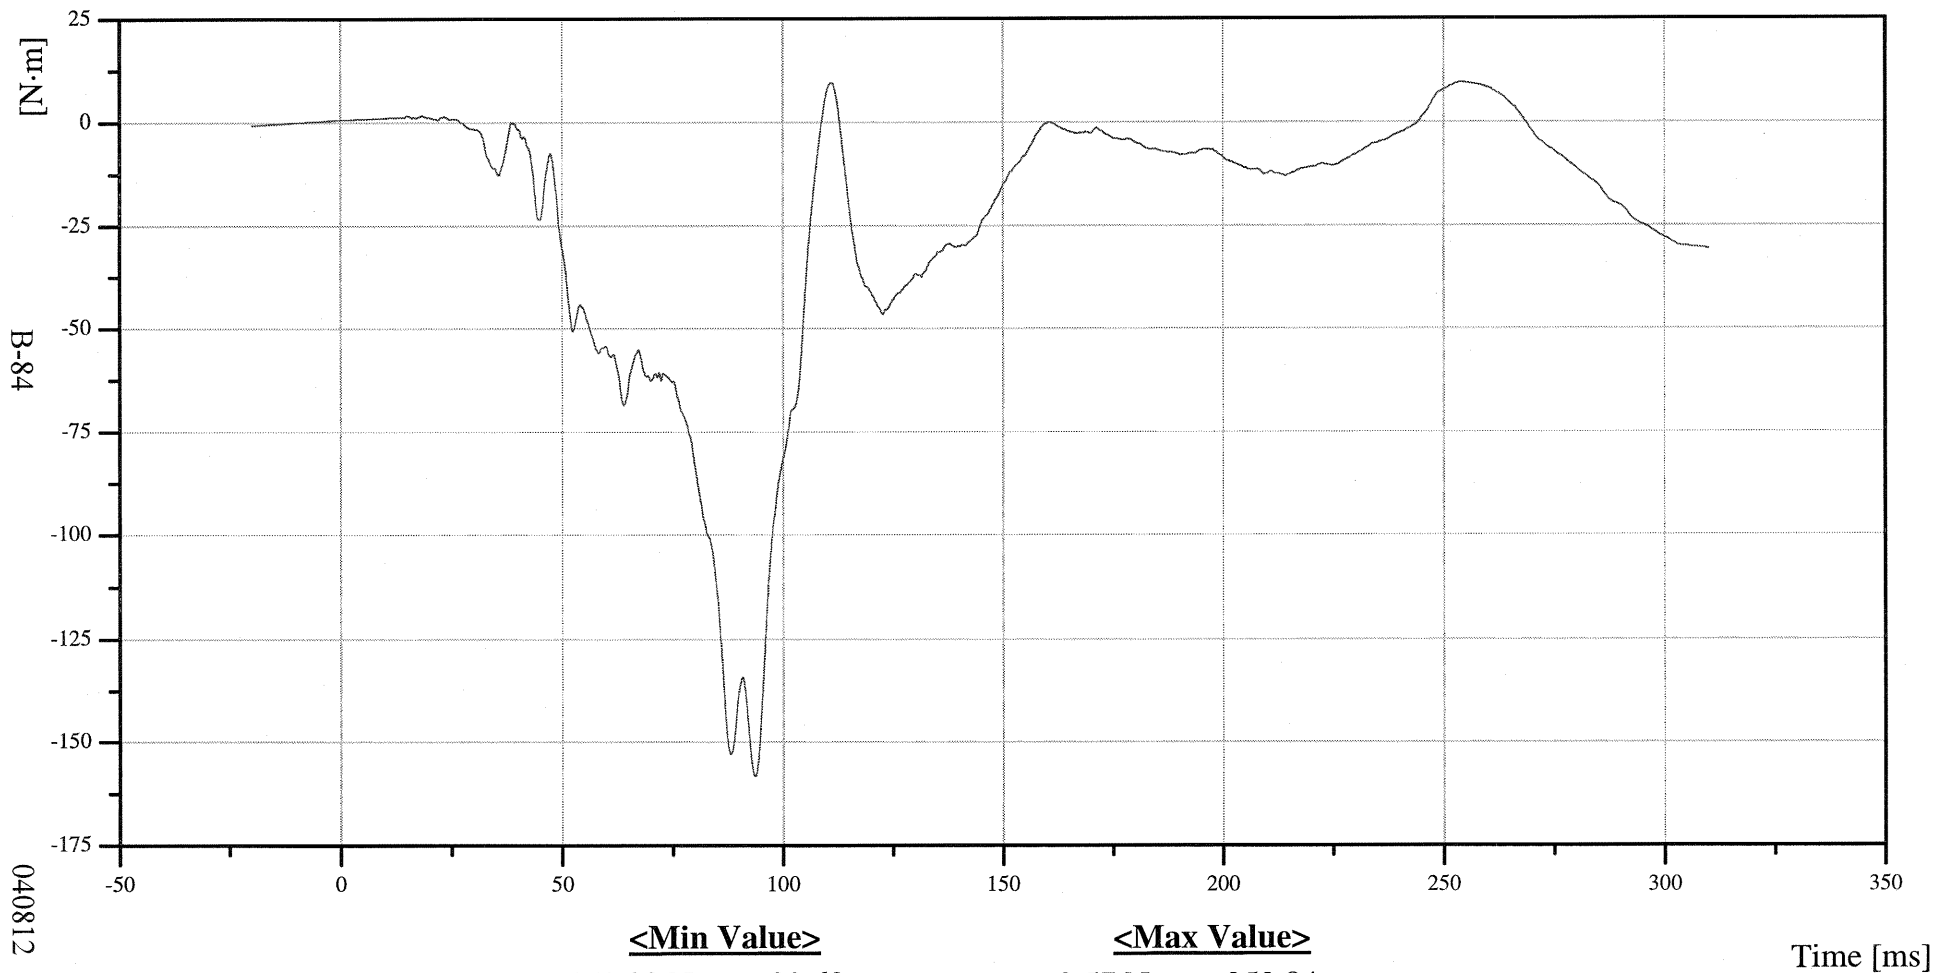

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZM2

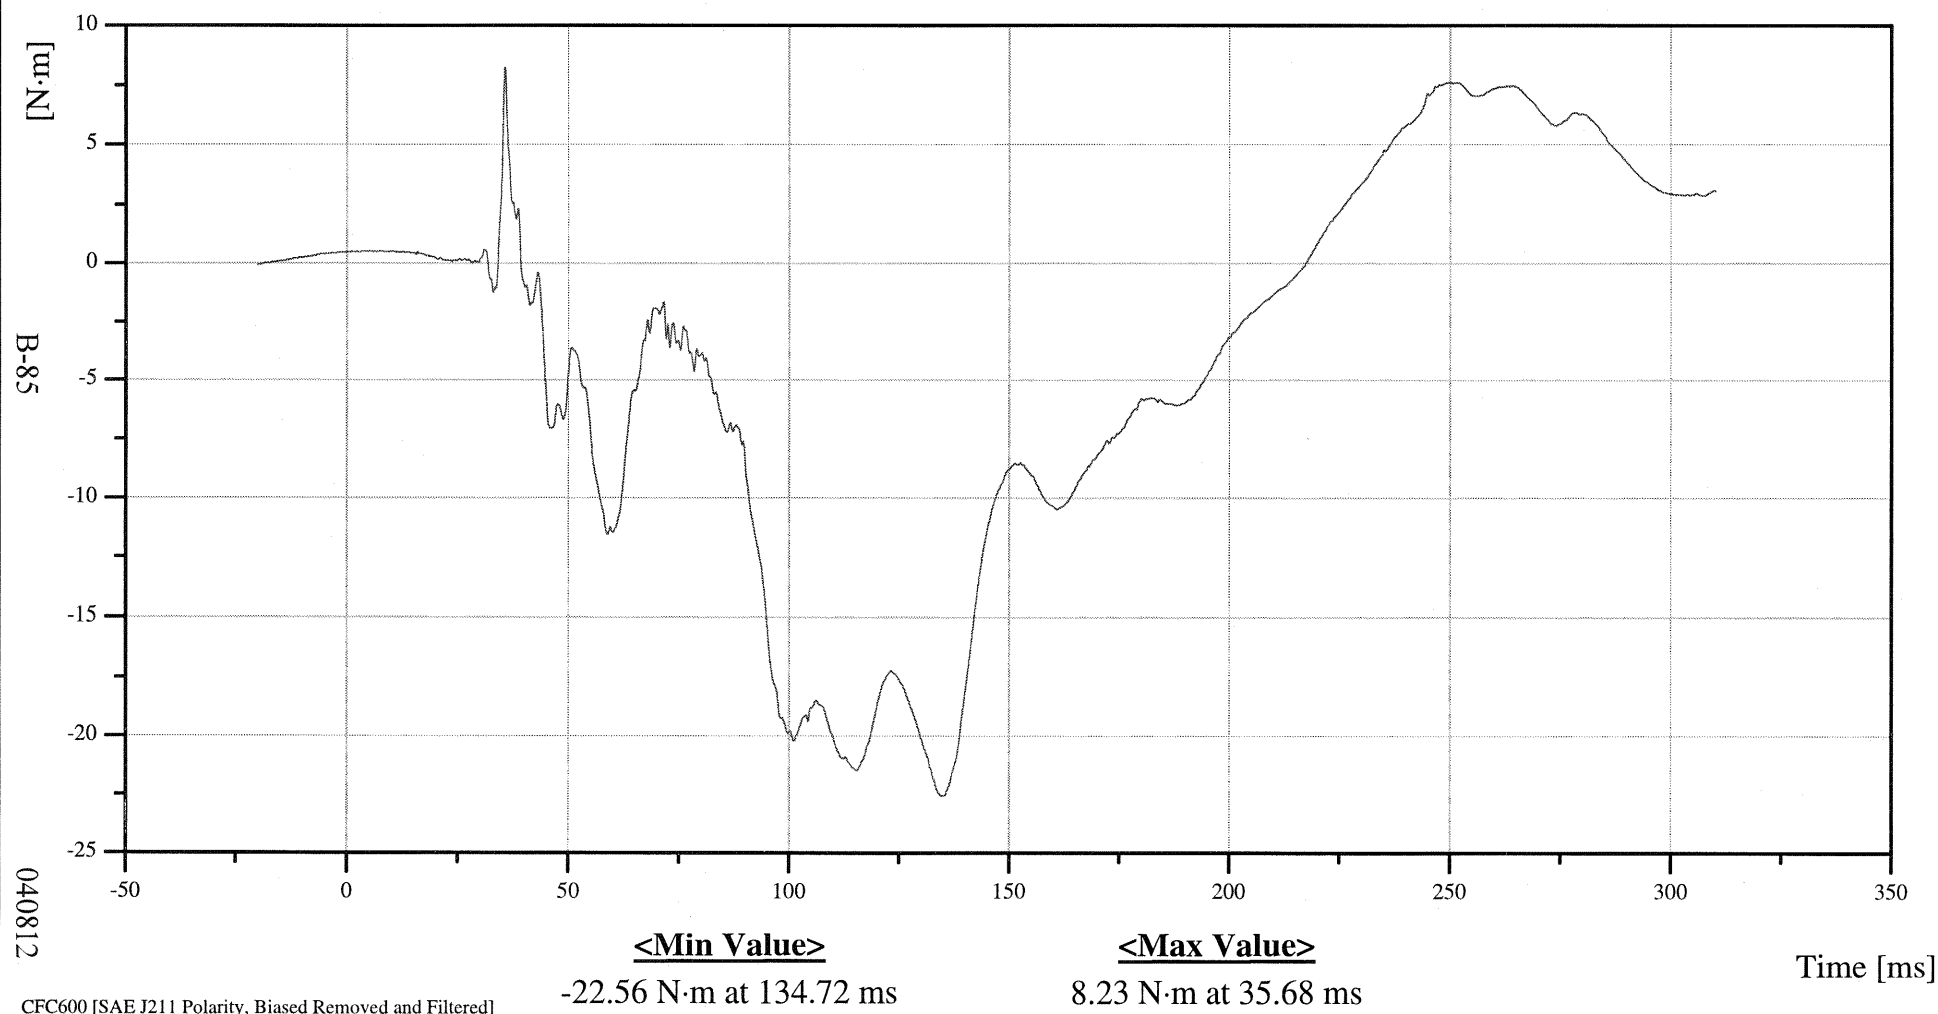



Transportation Research Center, Inc.

Chest Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXG2

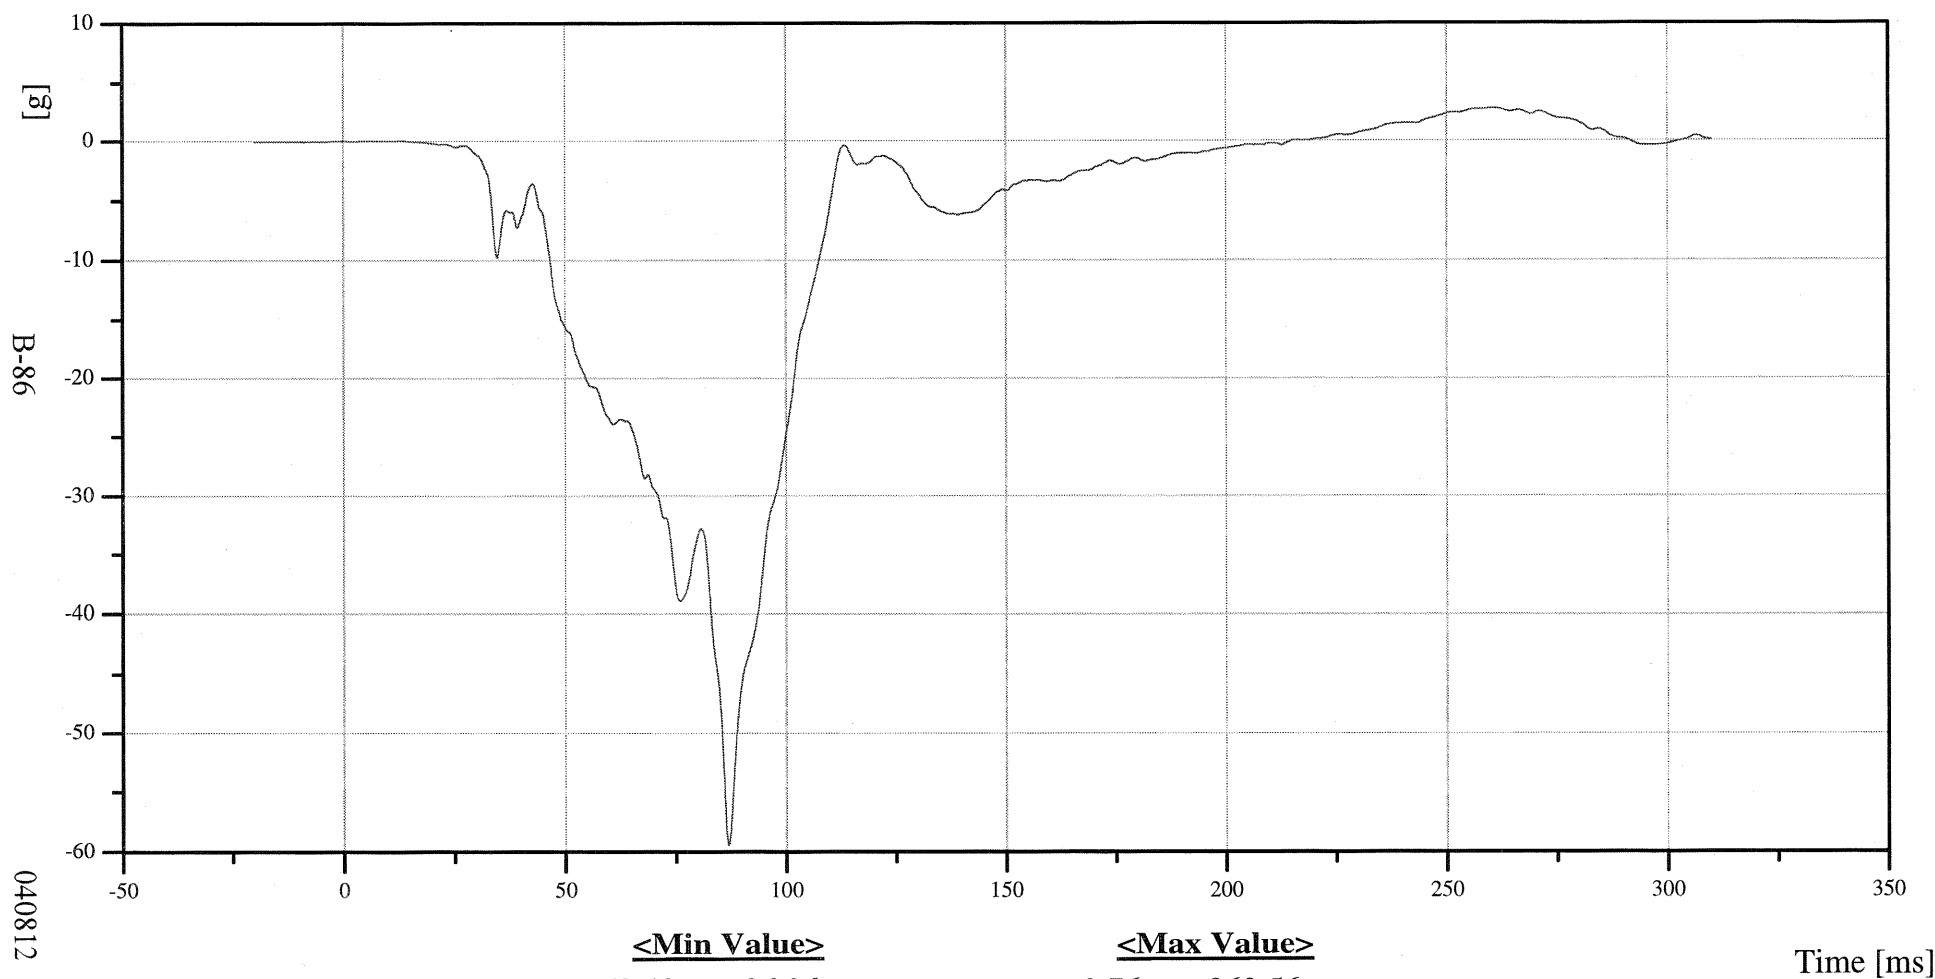

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTYG2

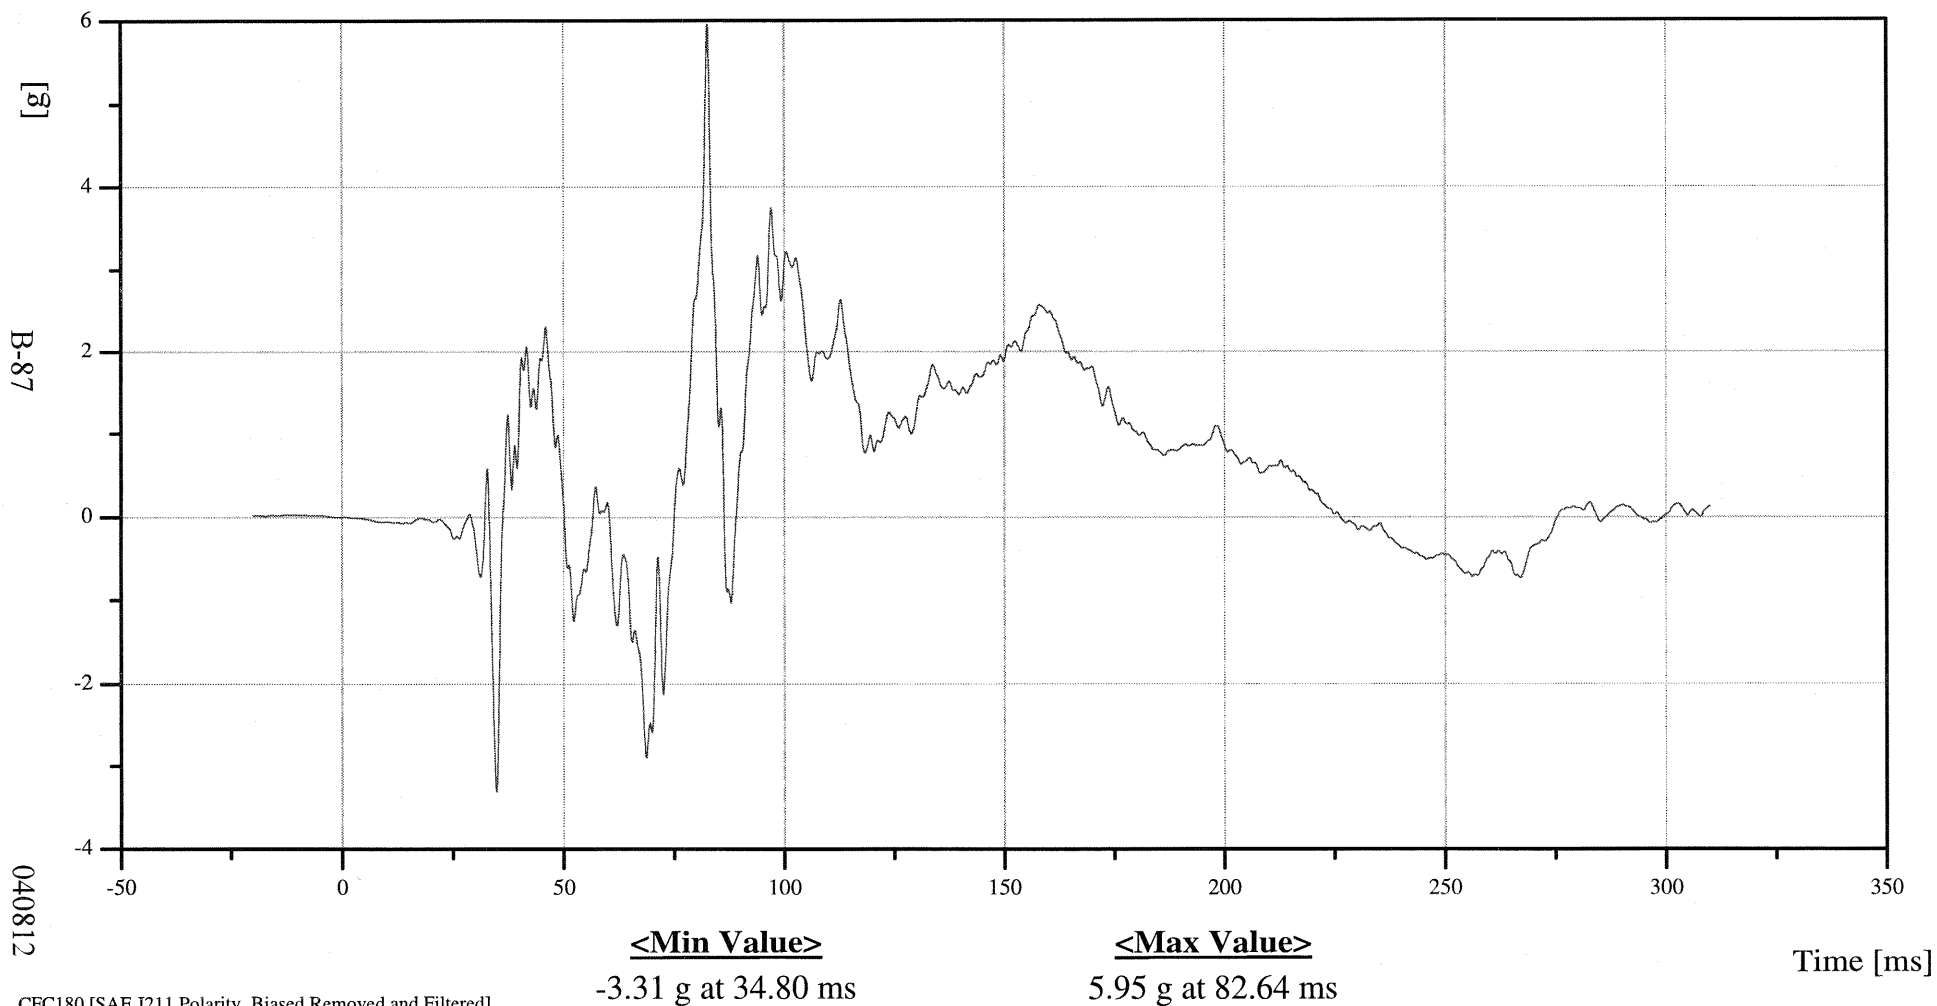



Transportation Research Center, Inc.

Chest Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTZG2

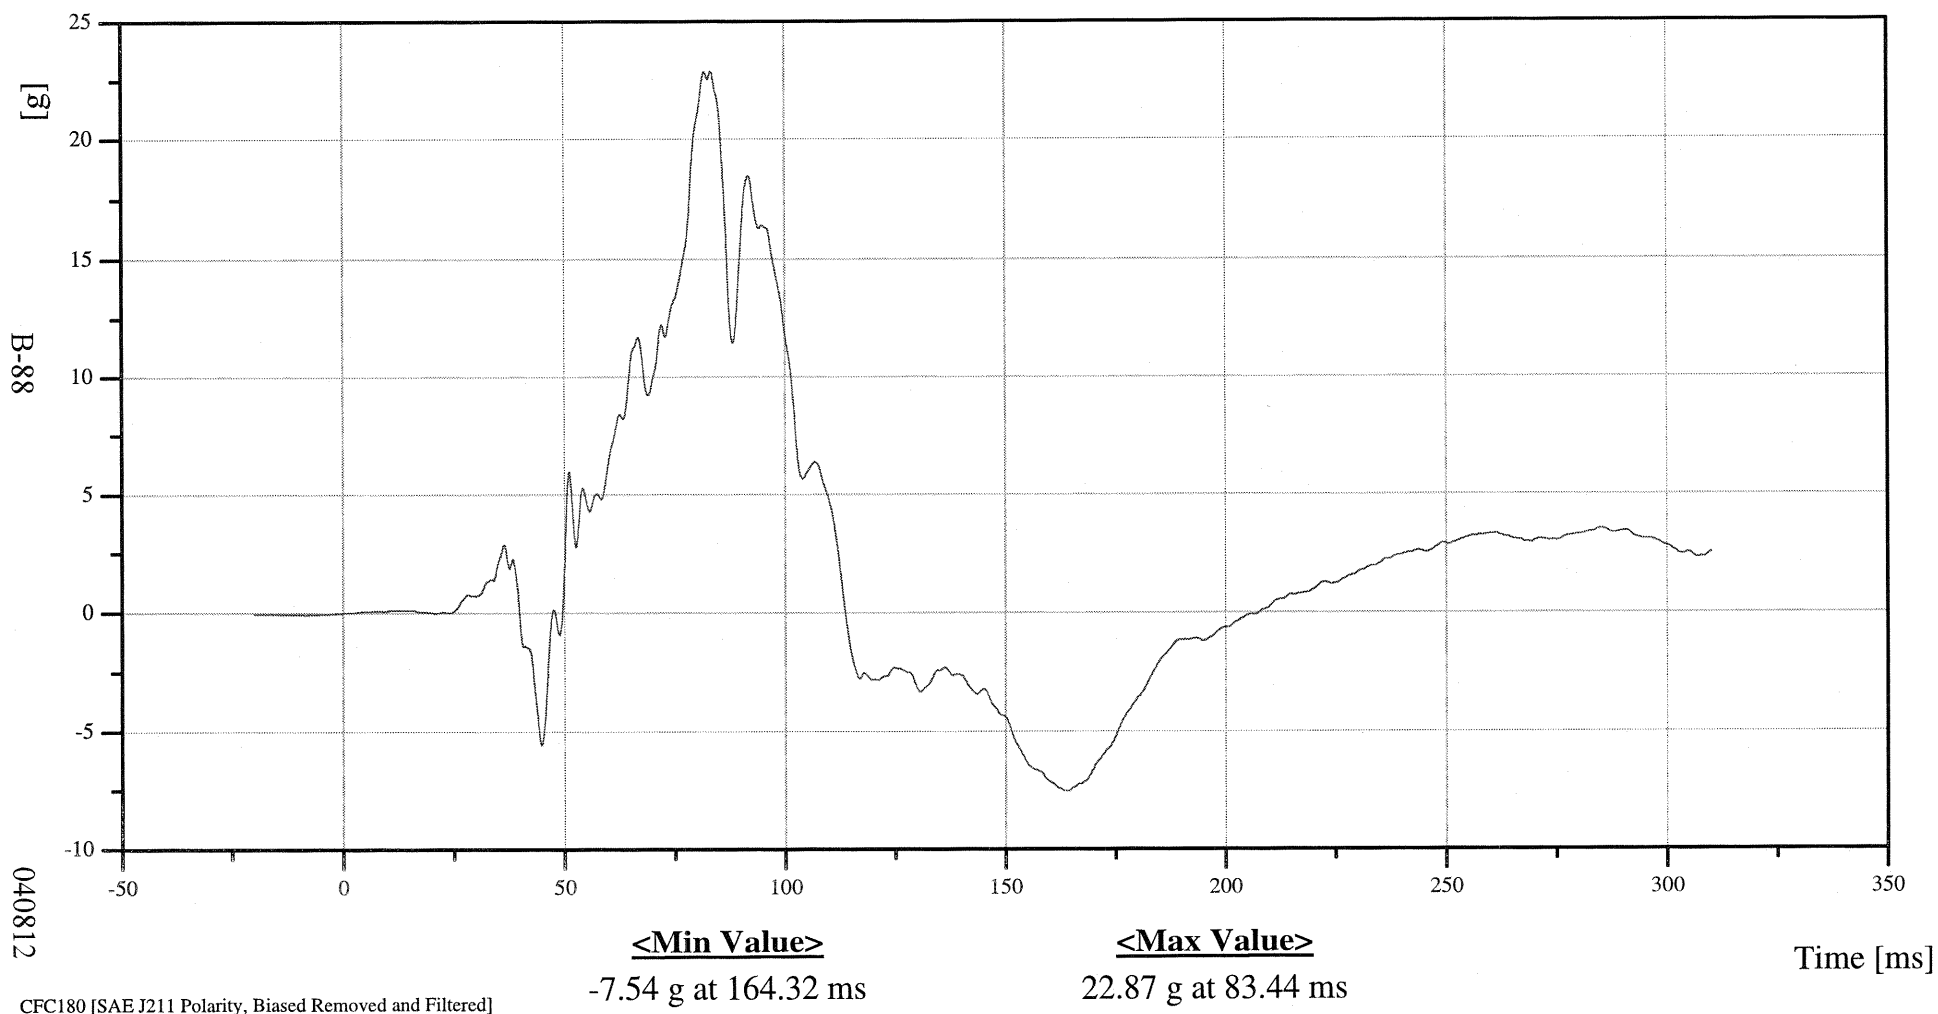



Transportation Research Center, Inc.

Chest Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTRG2

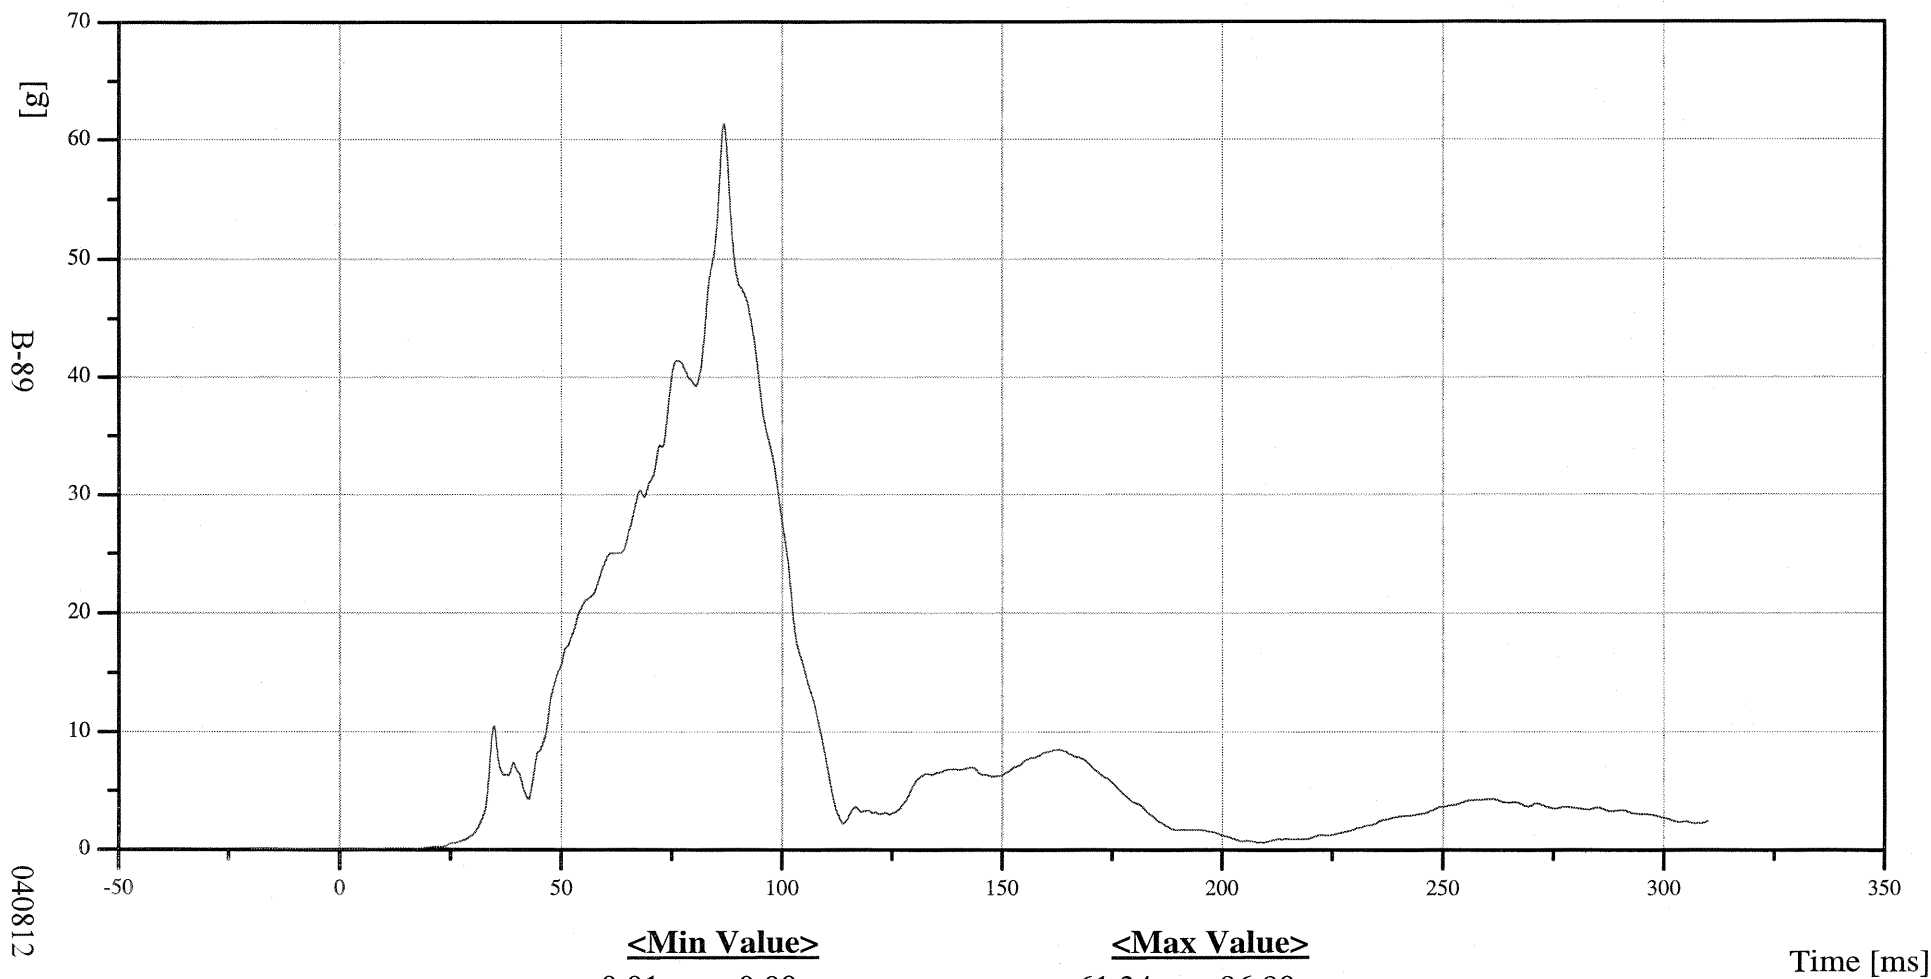

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Red X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXR2

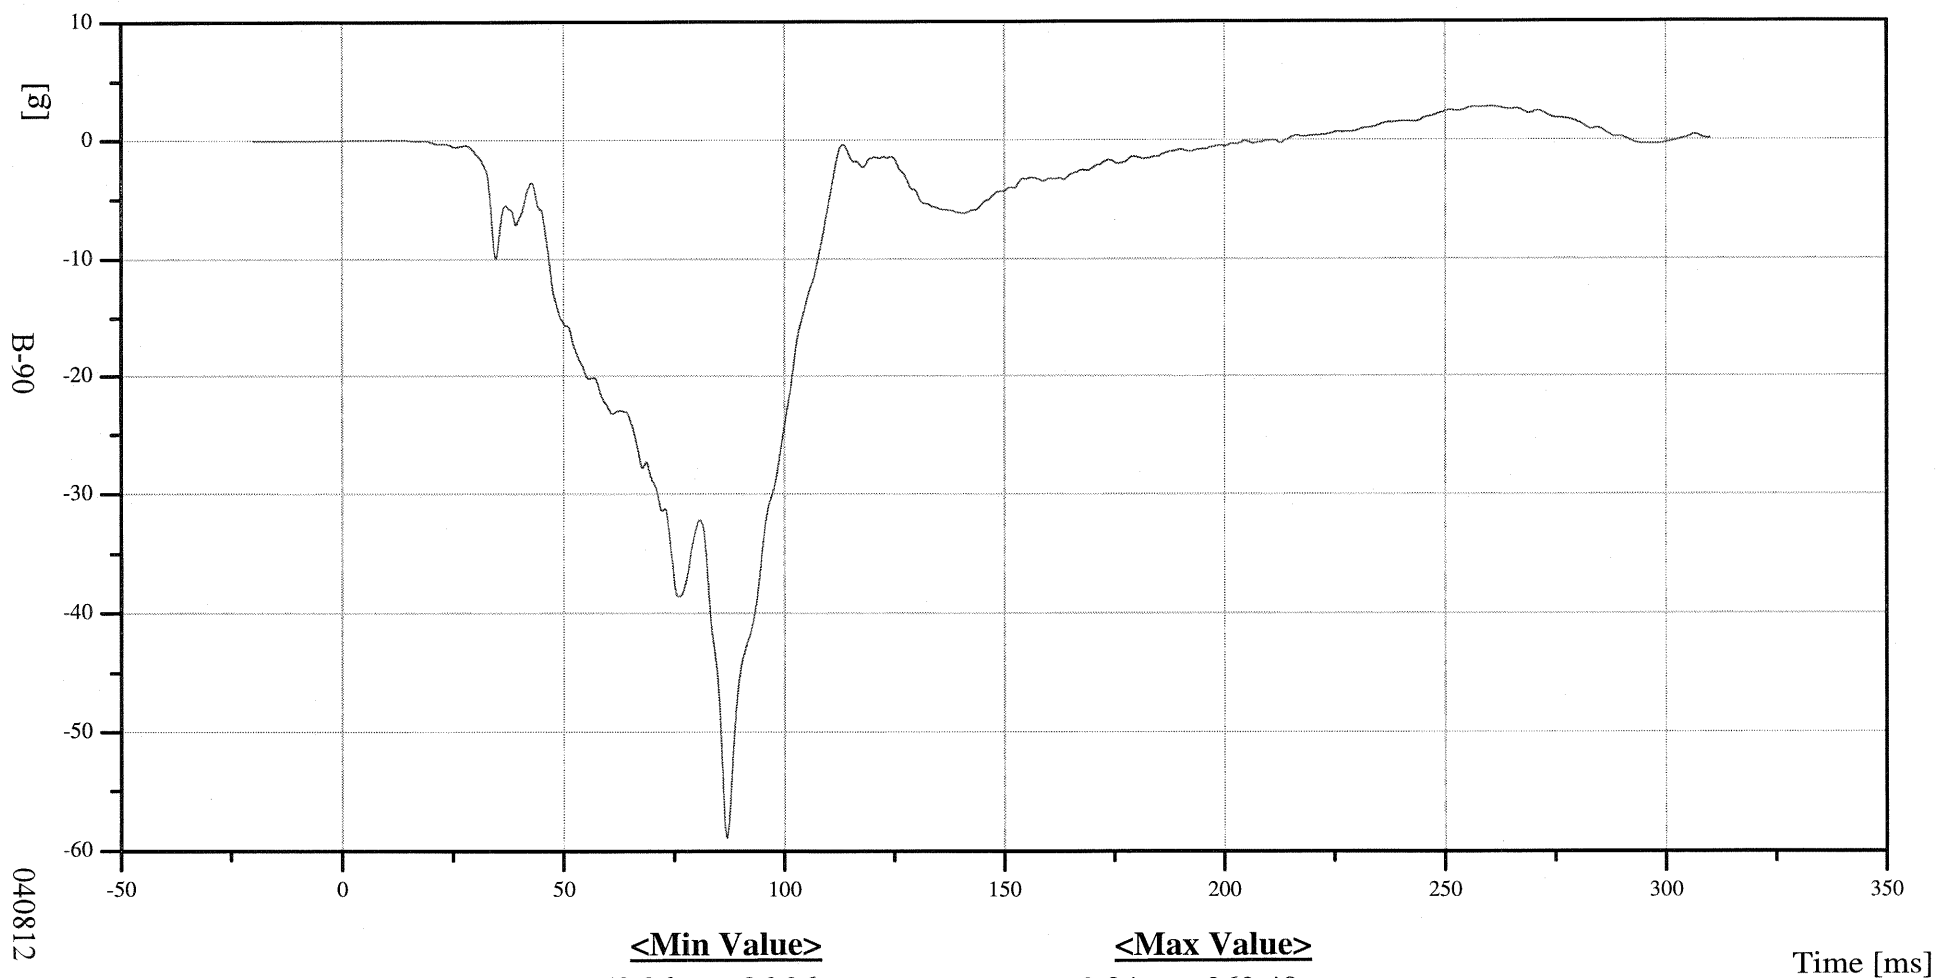

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Red Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTYR2

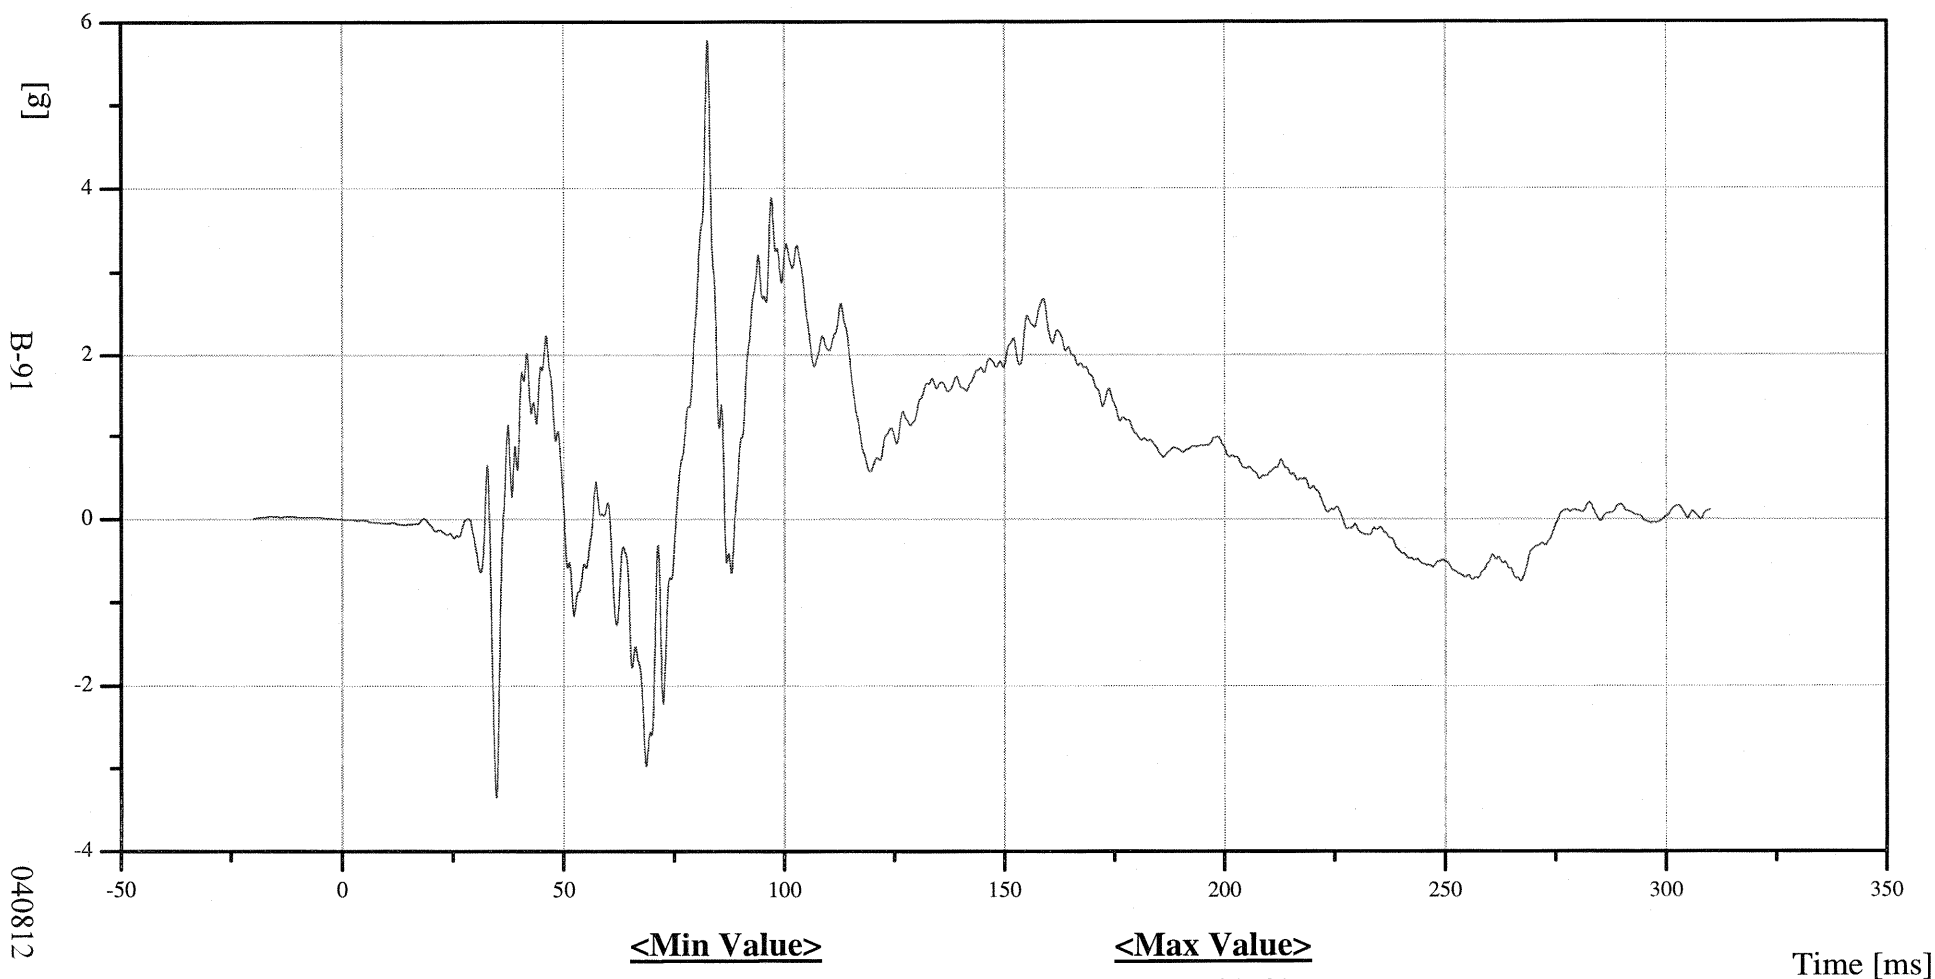

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Red Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTZR2

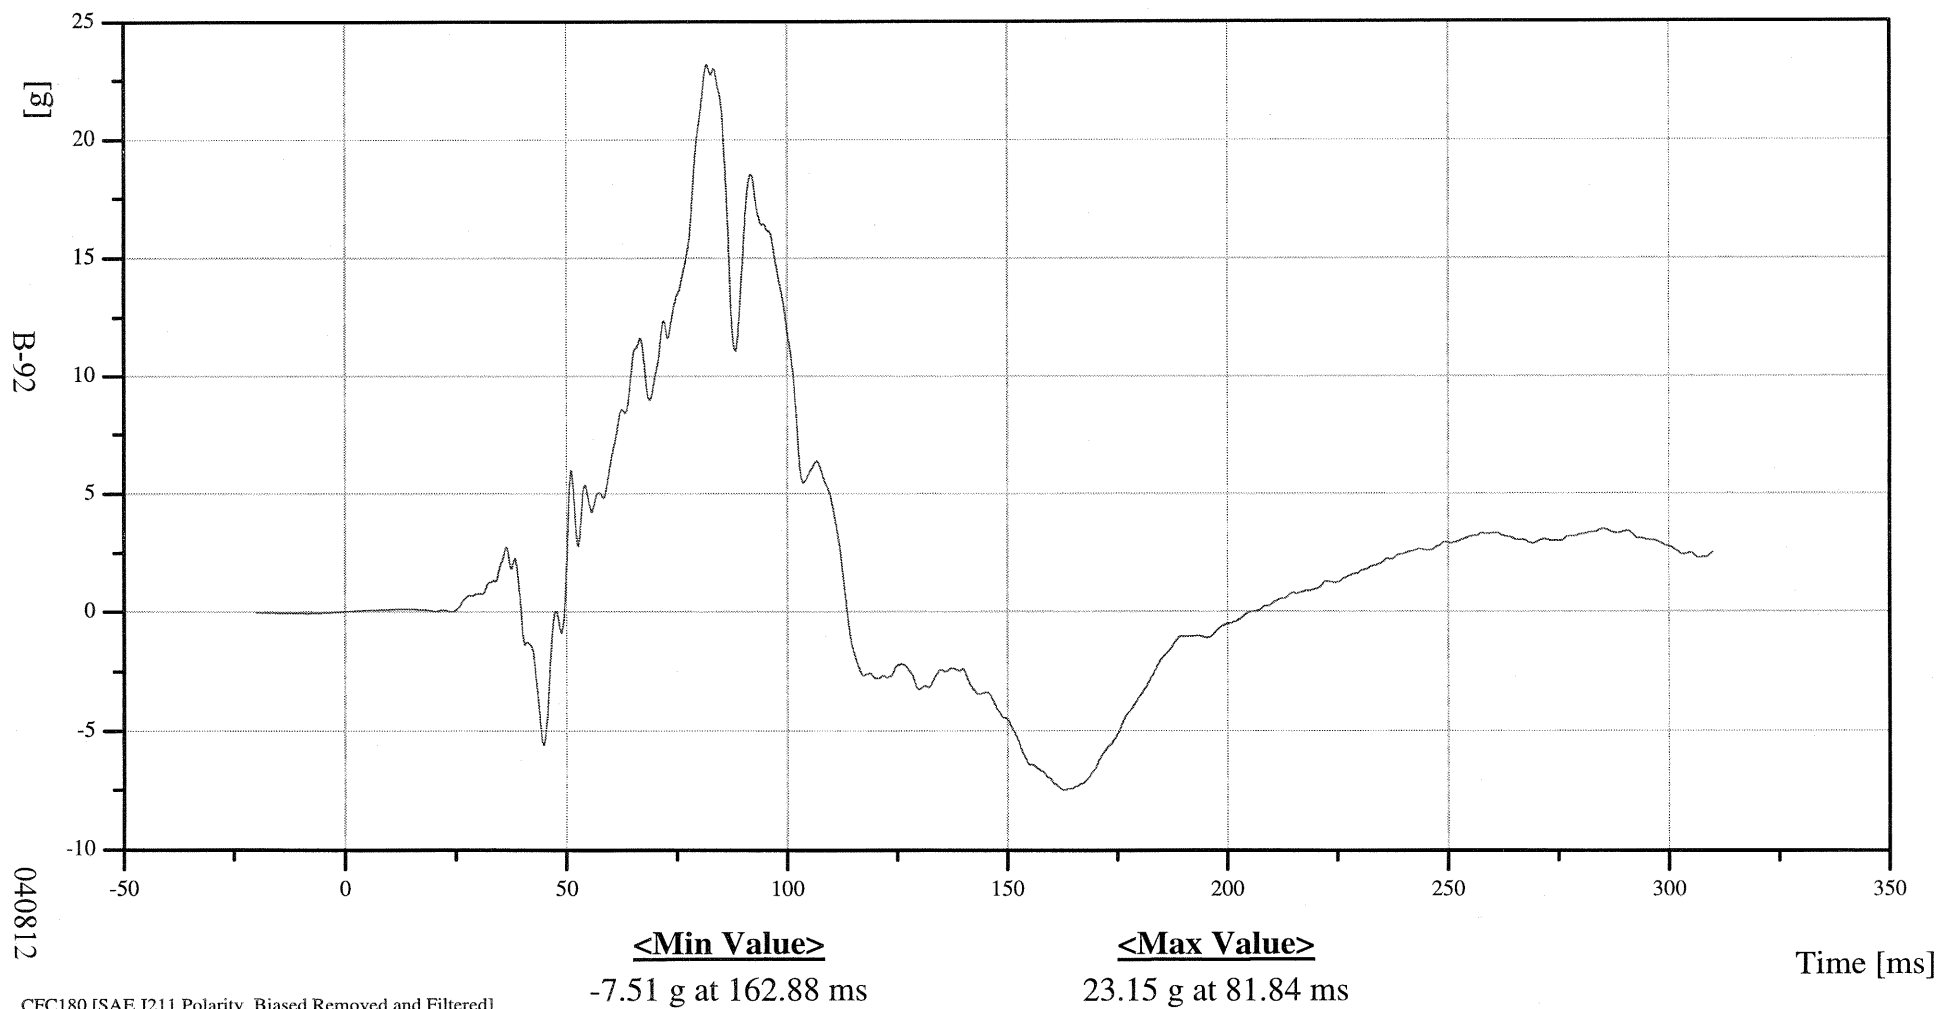



Transportation Research Center, Inc.

Chest Deflection X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXD2

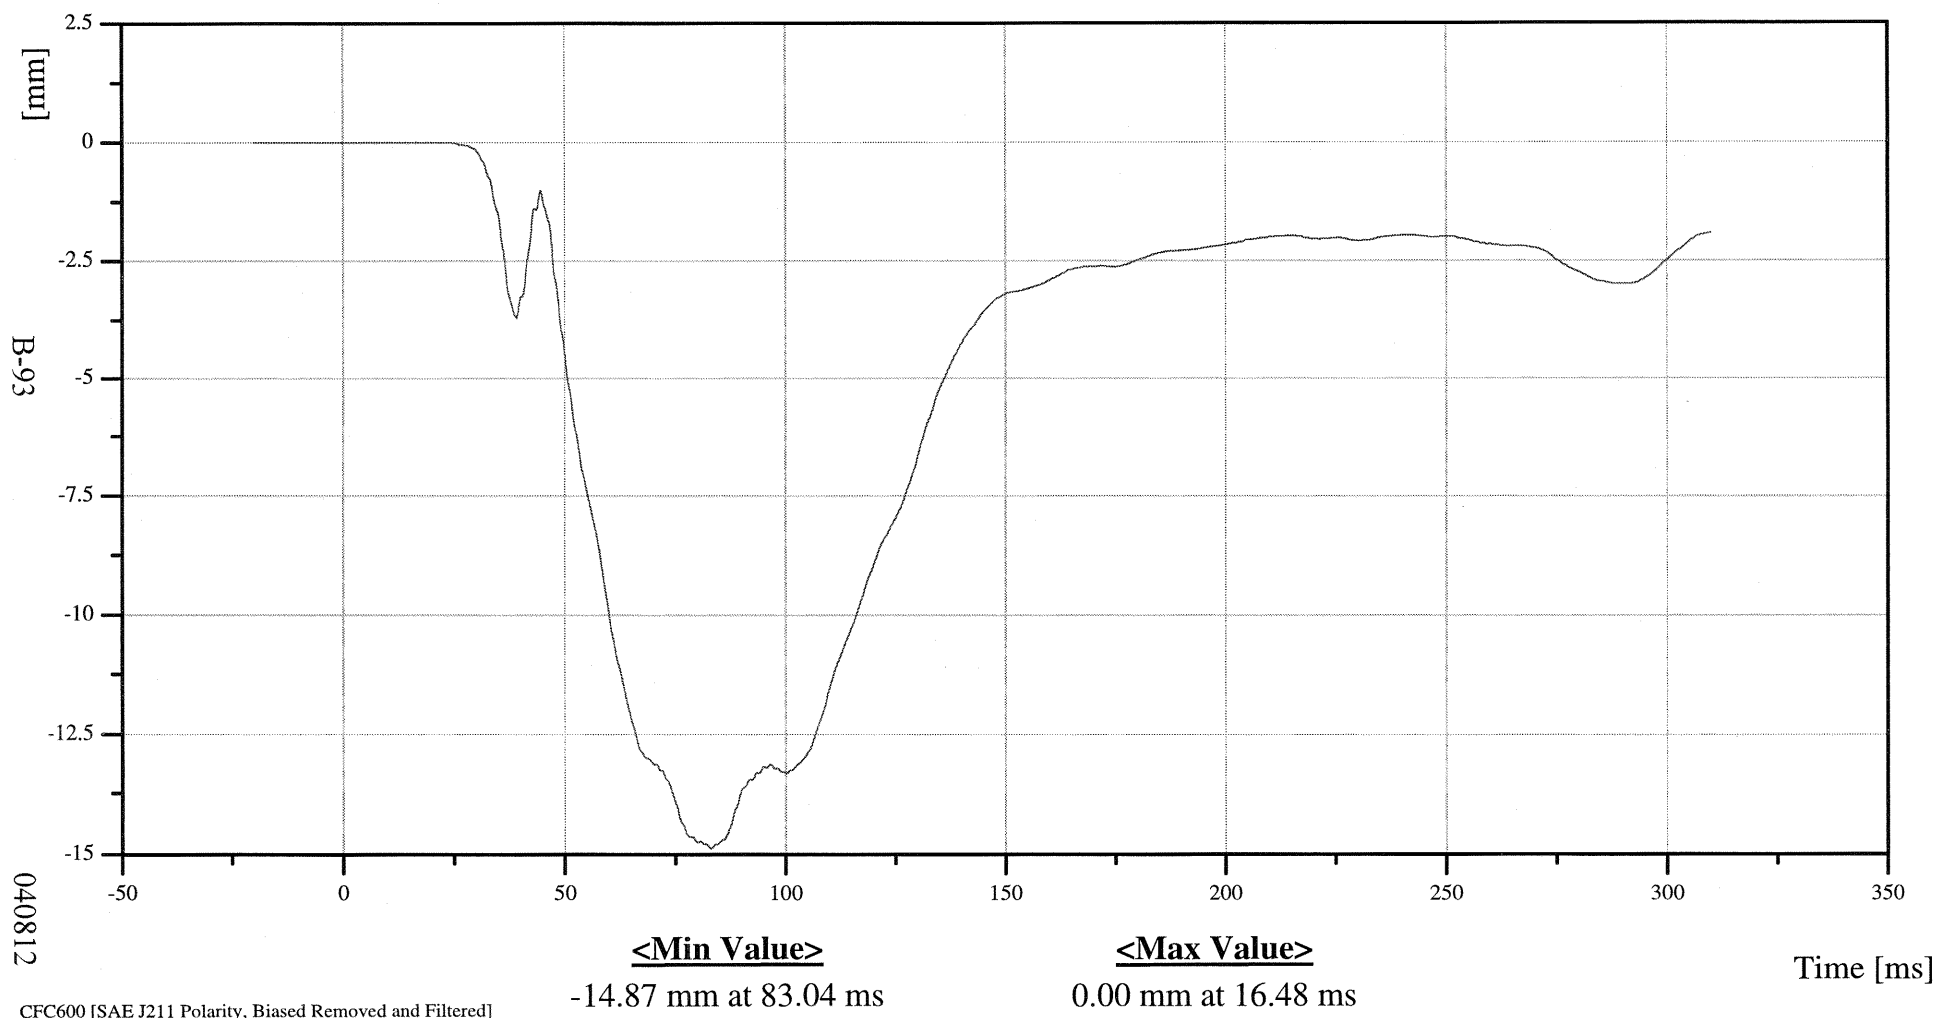



Transportation Research Center, Inc.

Pelvis Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVXG2

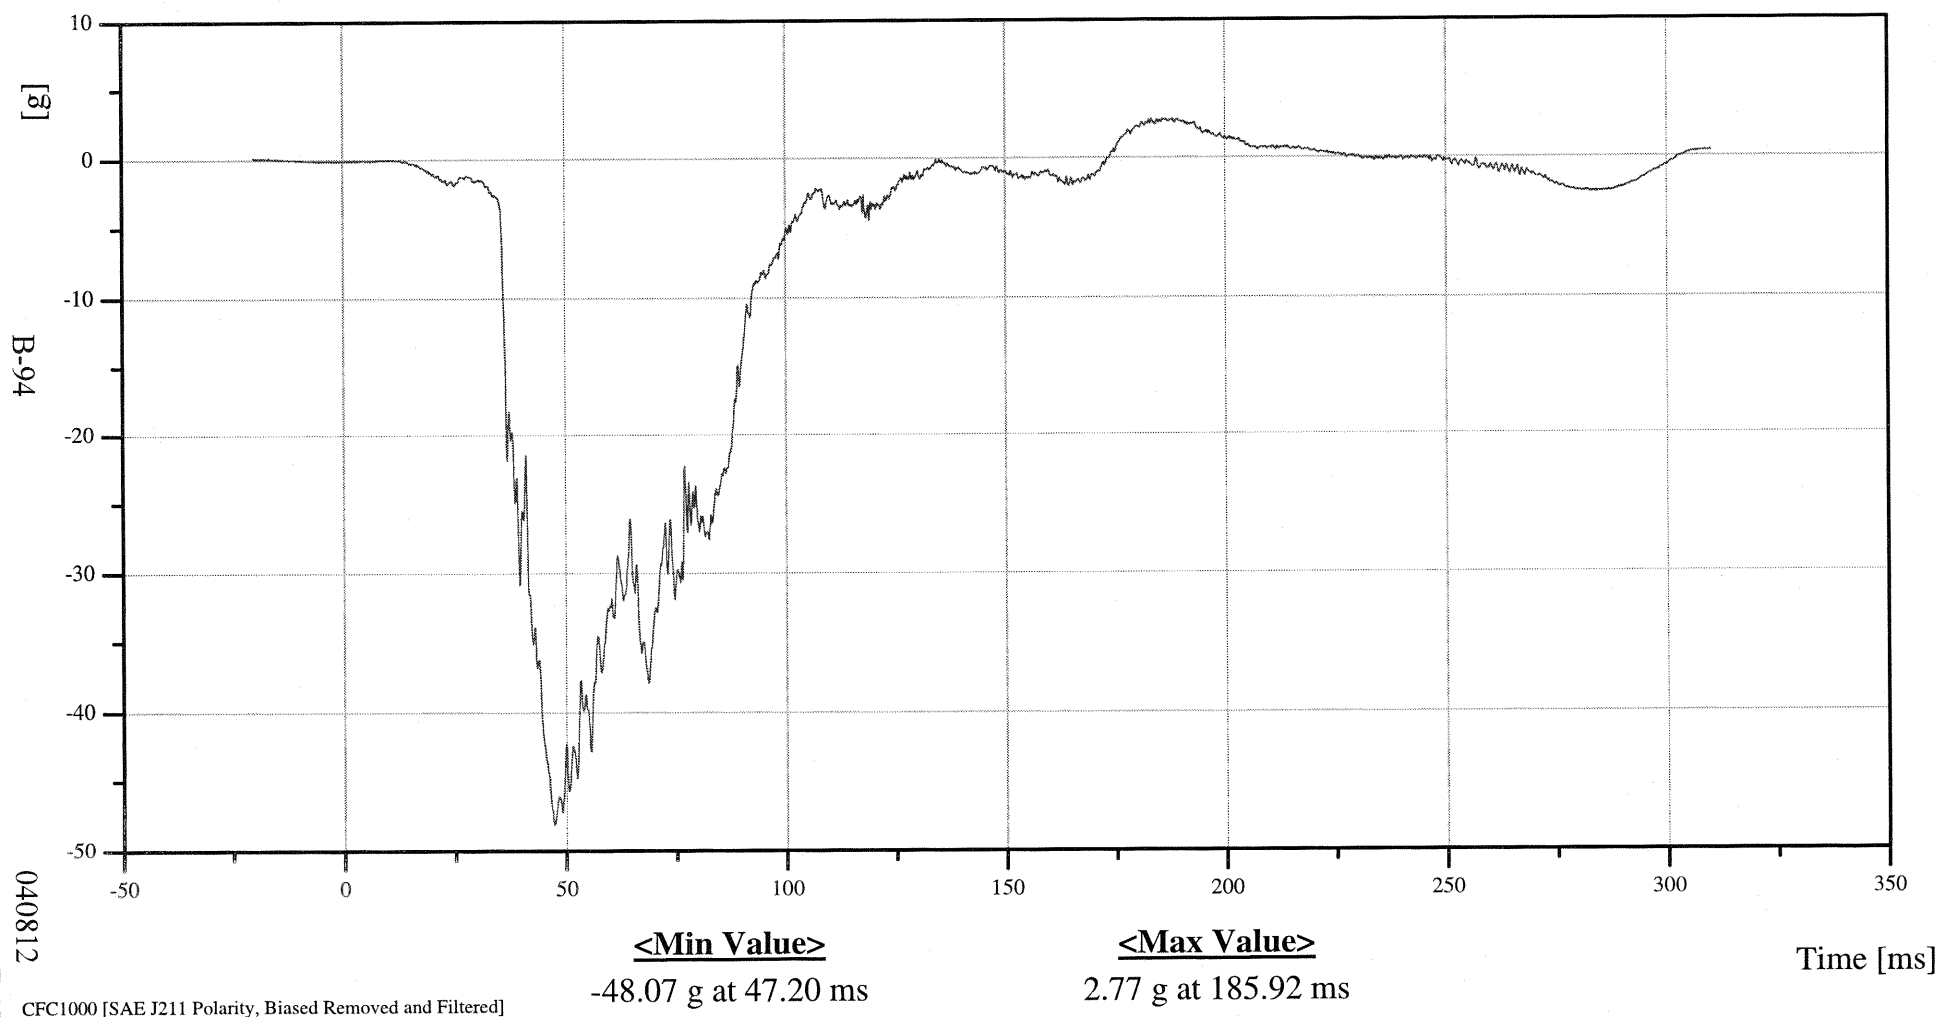



Transportation Research Center, Inc.

Pelvis Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVYG2

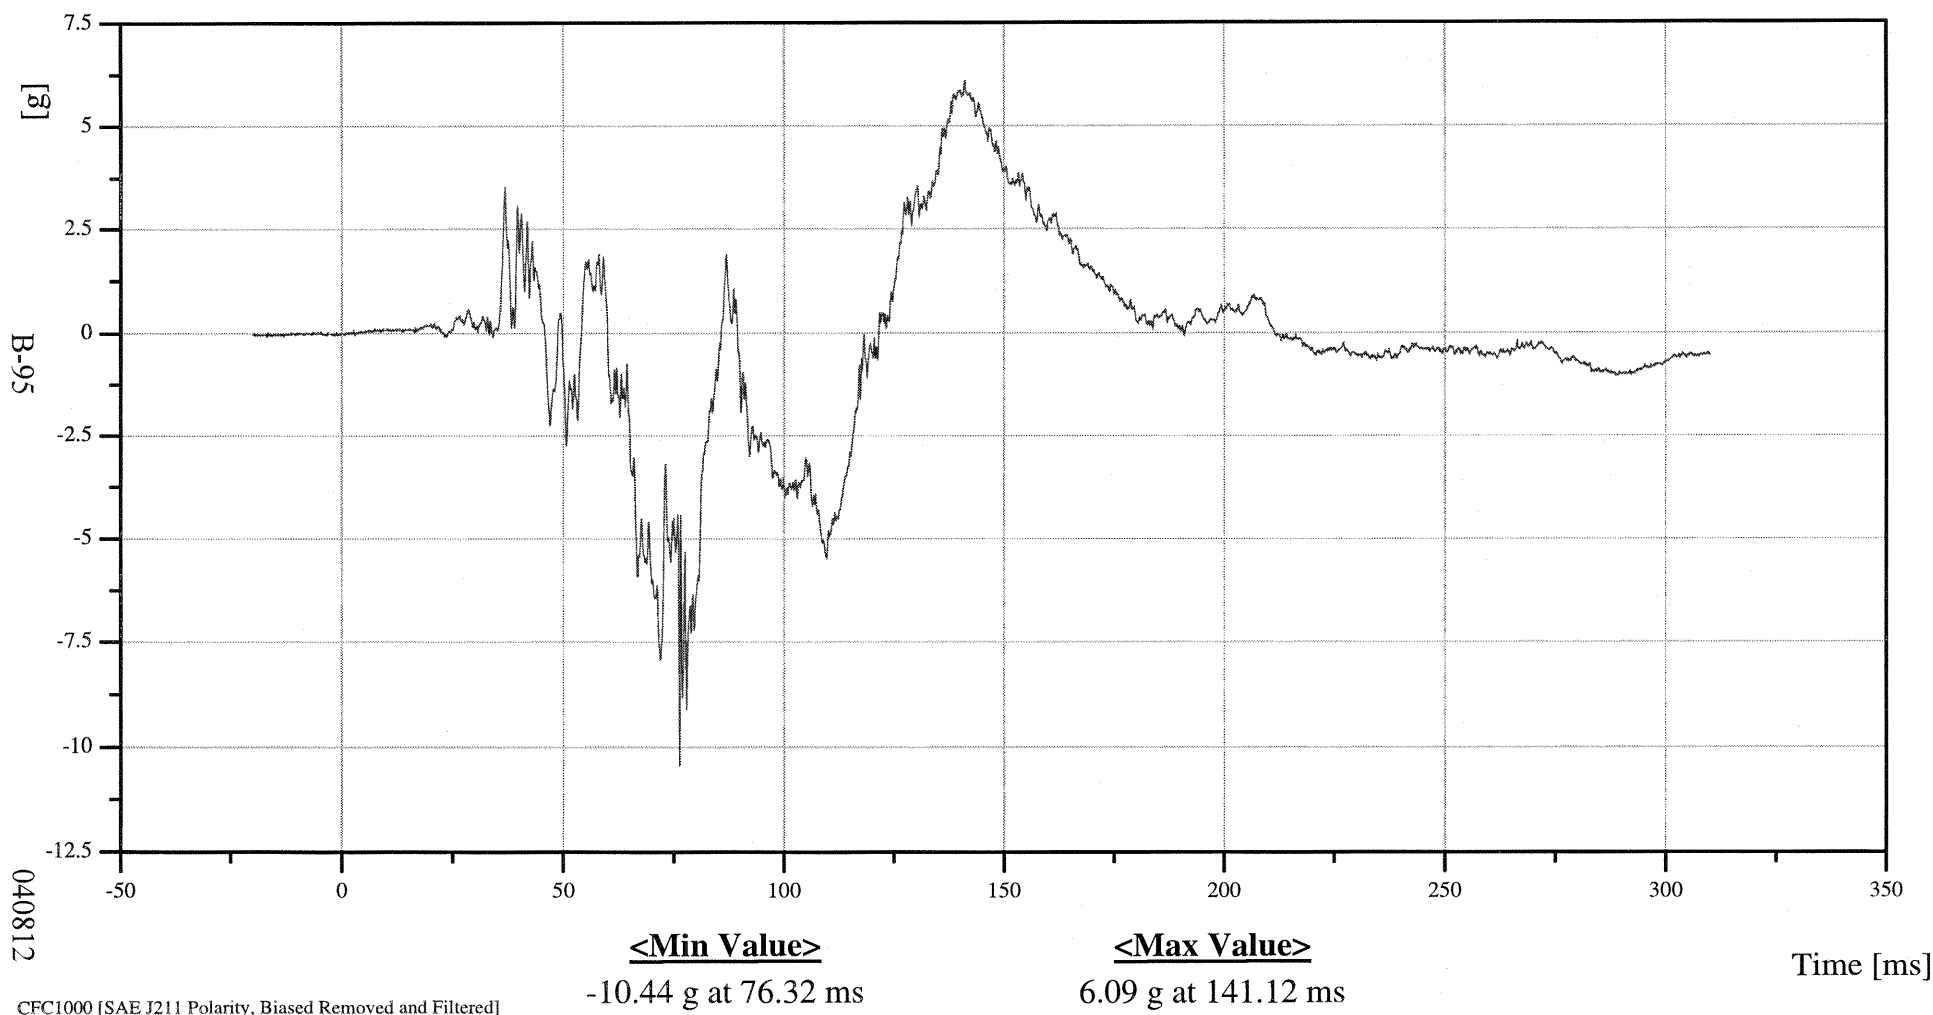



Transportation Research Center, Inc.

Pelvis Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVZG2

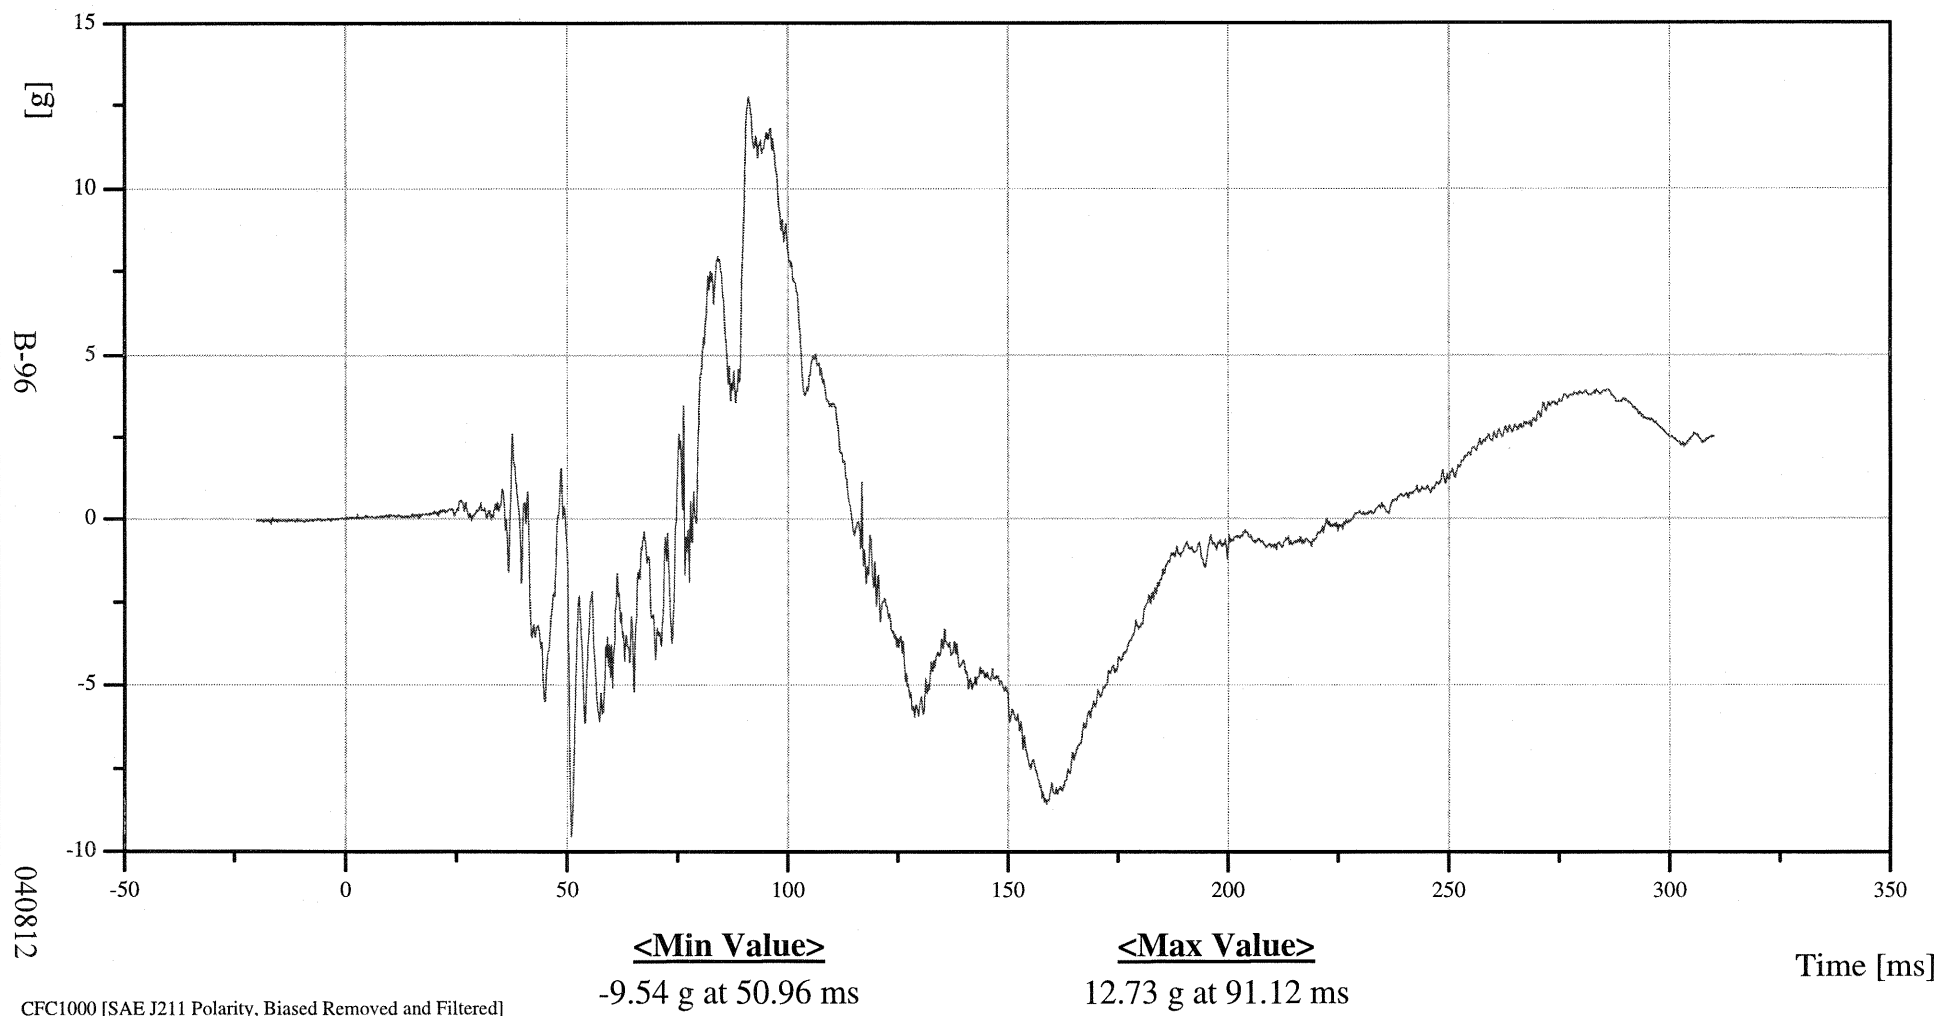



Transportation Research Center, Inc.

Pelvis Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVRG2

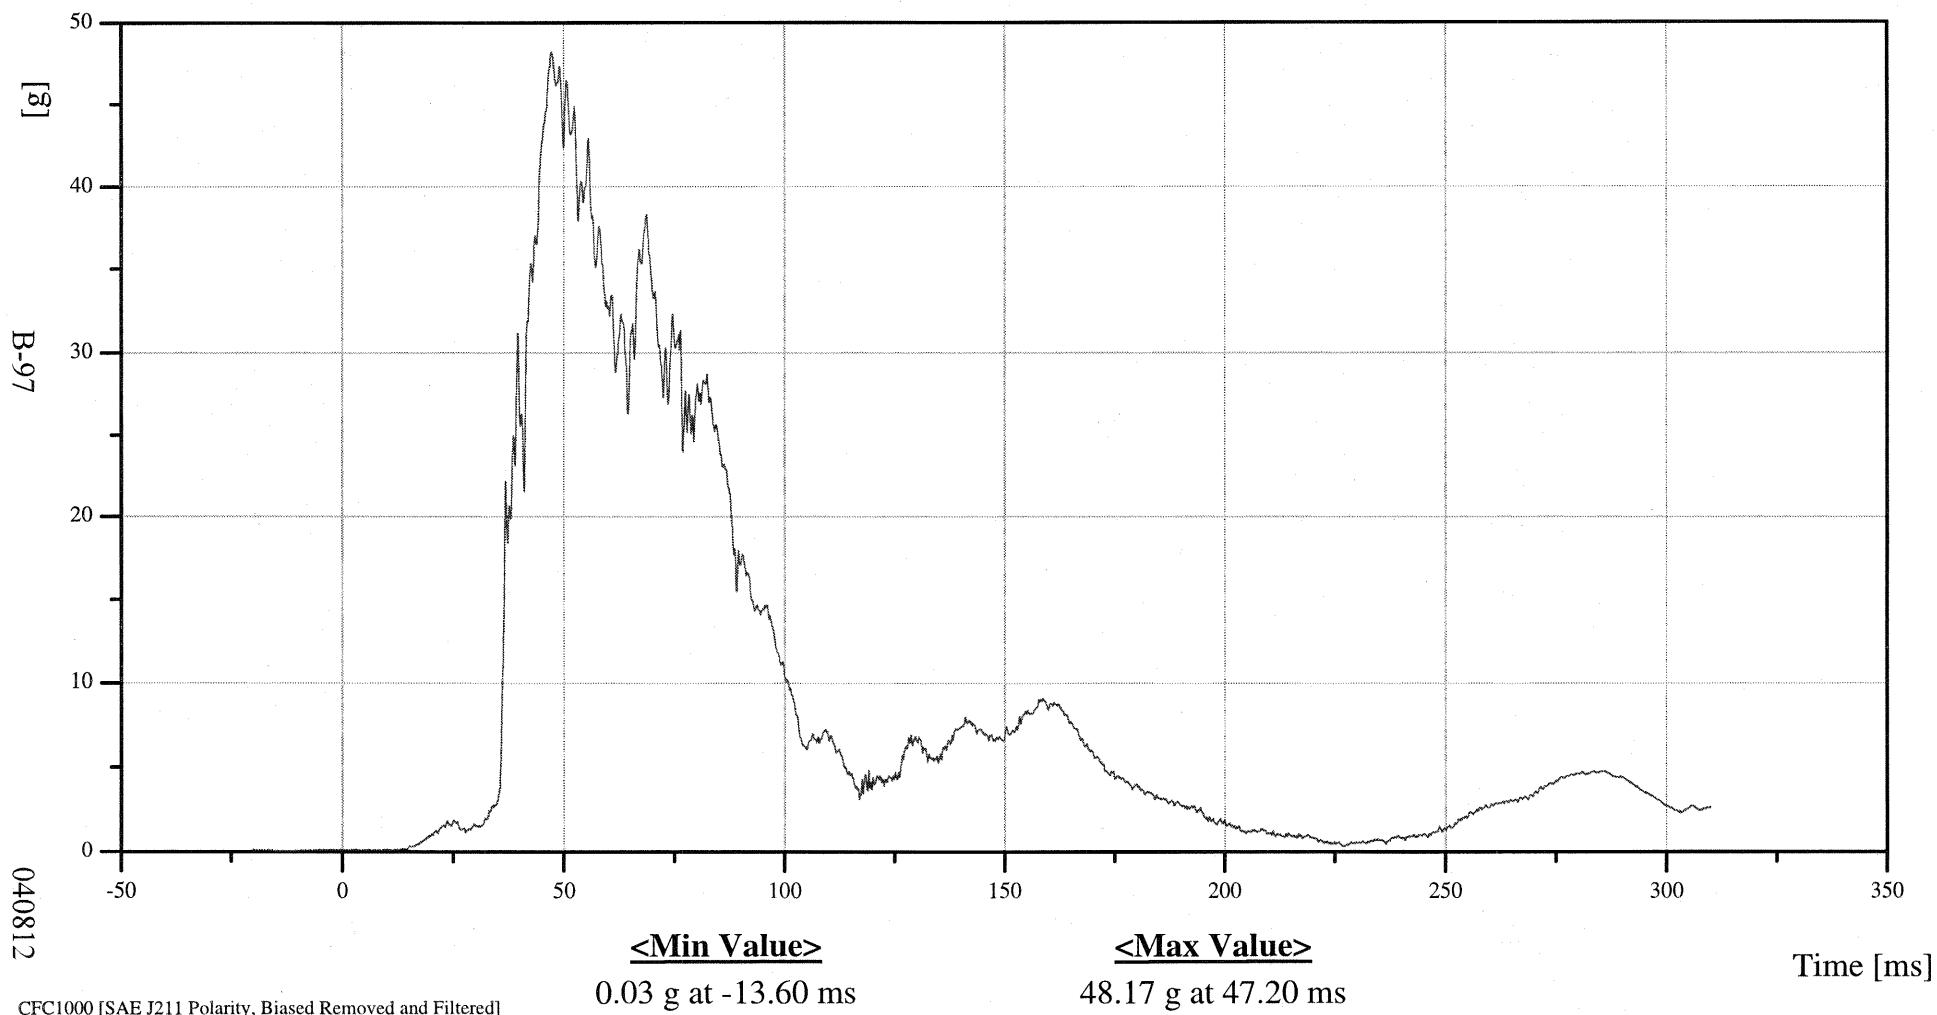



Transportation Research Center, Inc.

Left Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LFMZ2

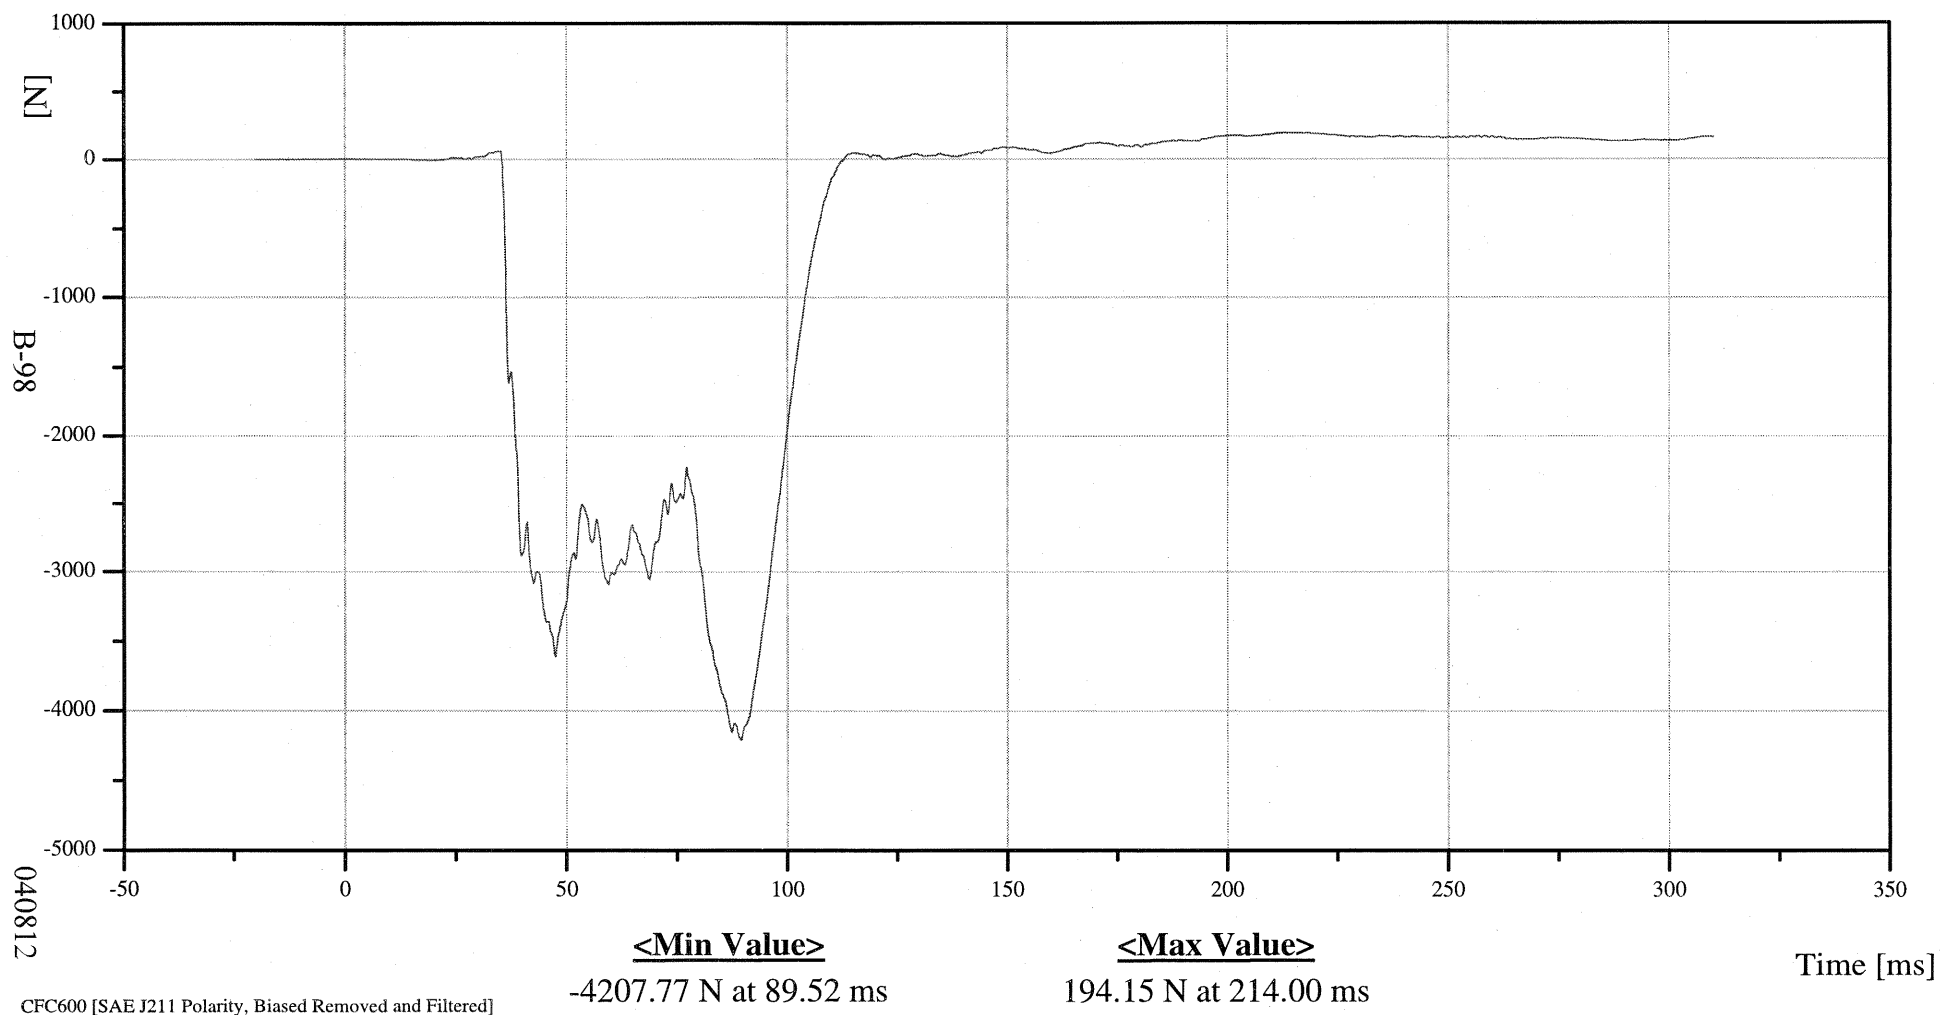



Transportation Research Center, Inc.

Right Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RFMZF2

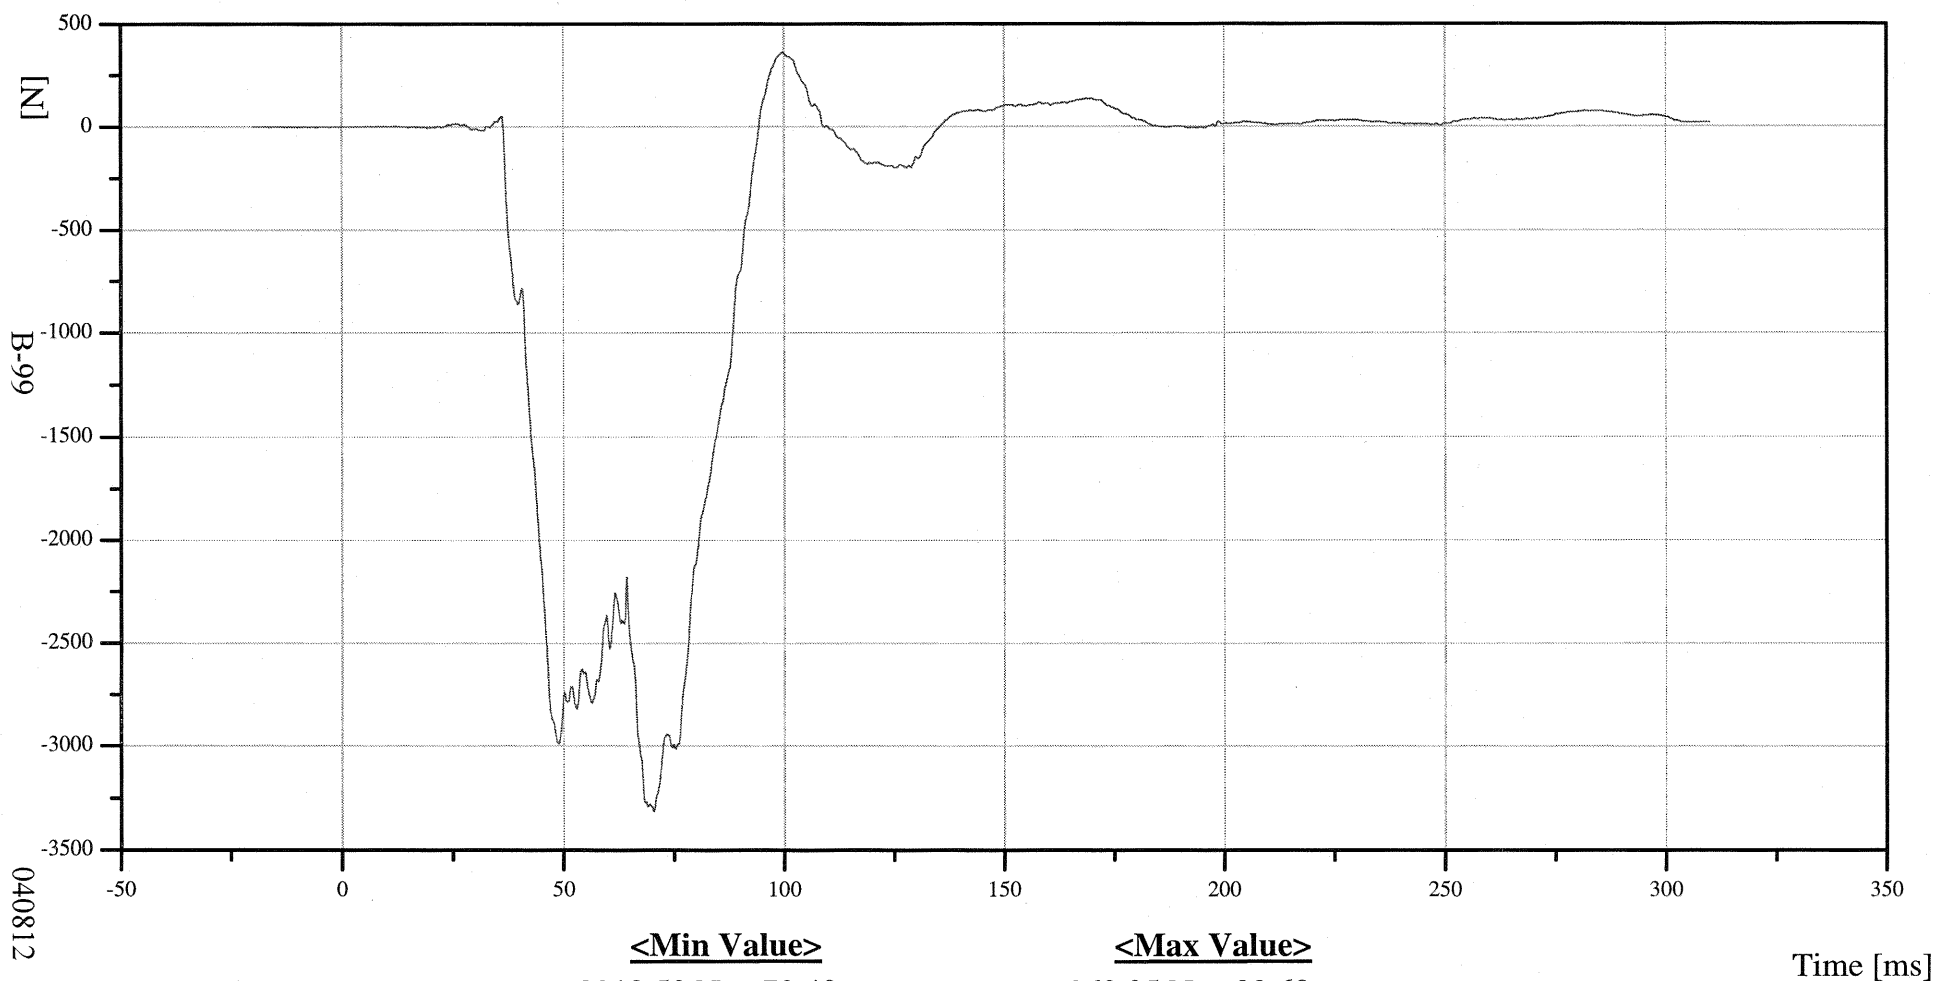

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]

-3313.50 N at 70.40 ms

362.05 N at 99.68 ms



Transportation Research Center, Inc.

Head Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDXG3

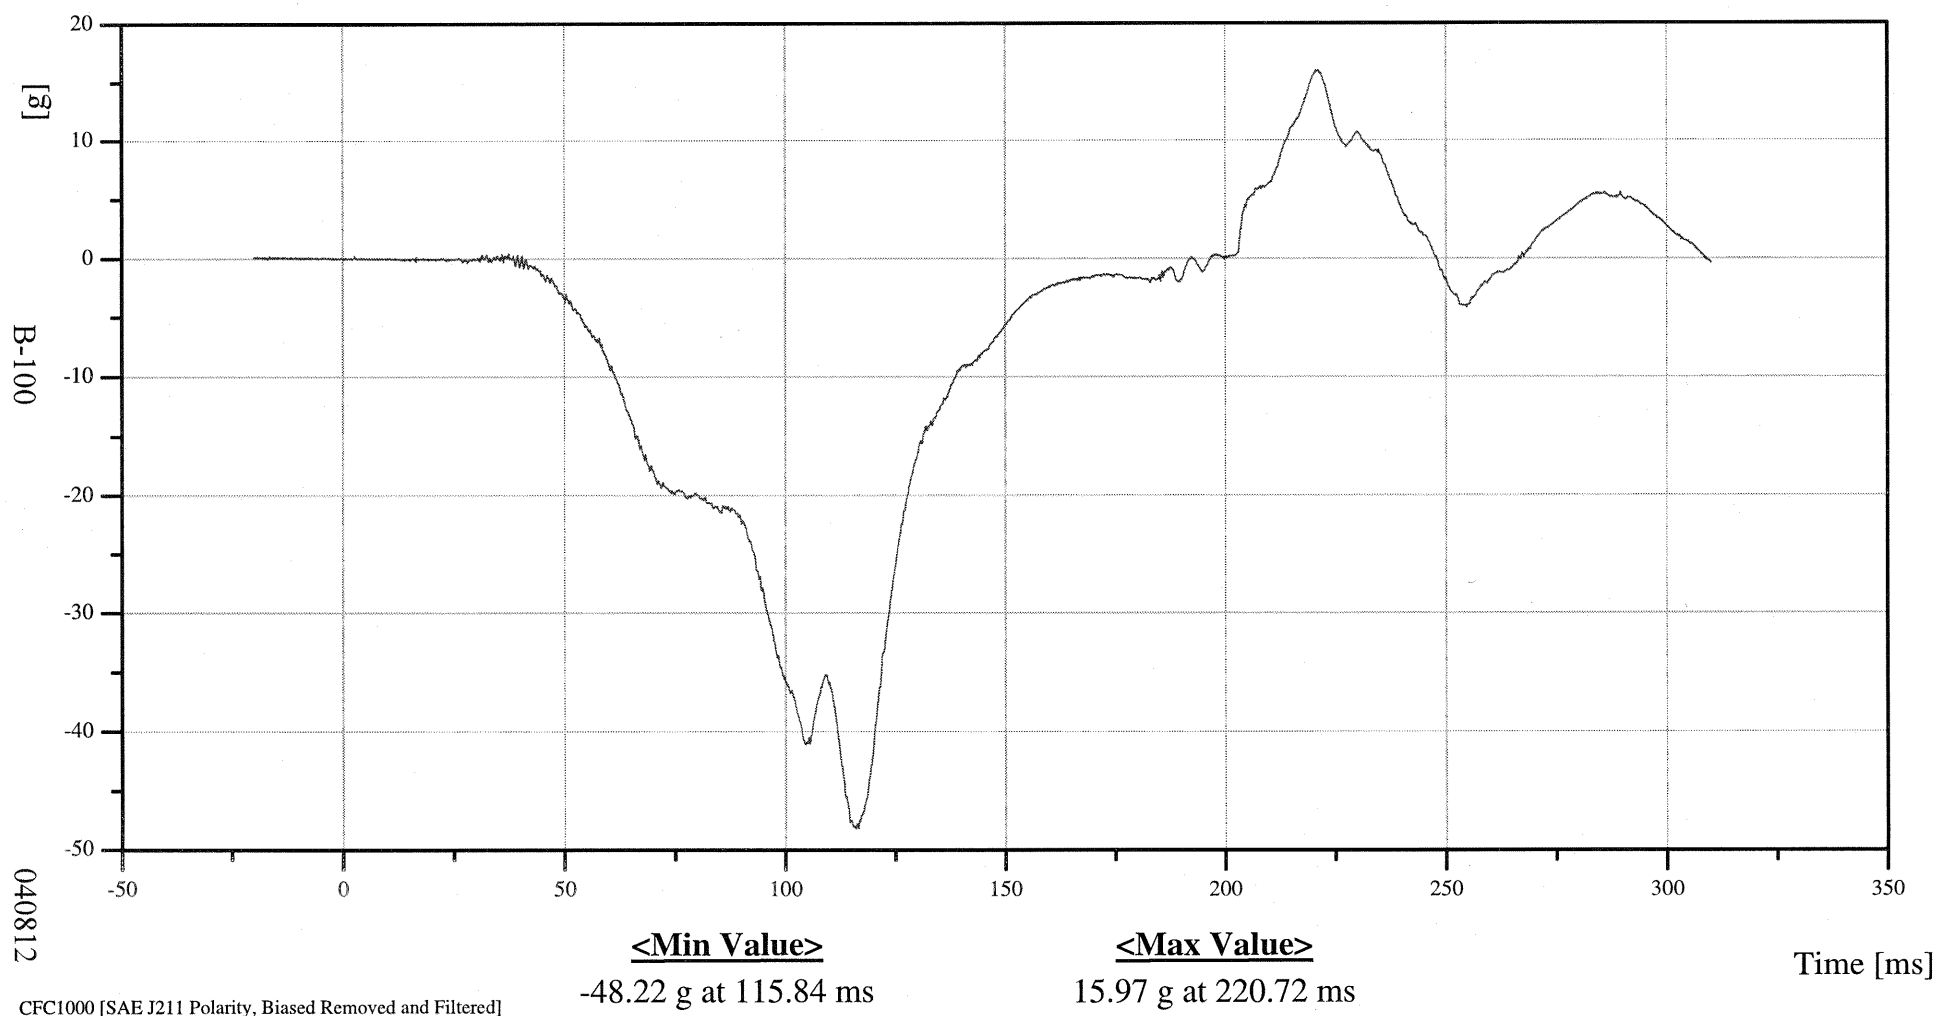



Transportation Research Center, Inc.

Head Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDYG3

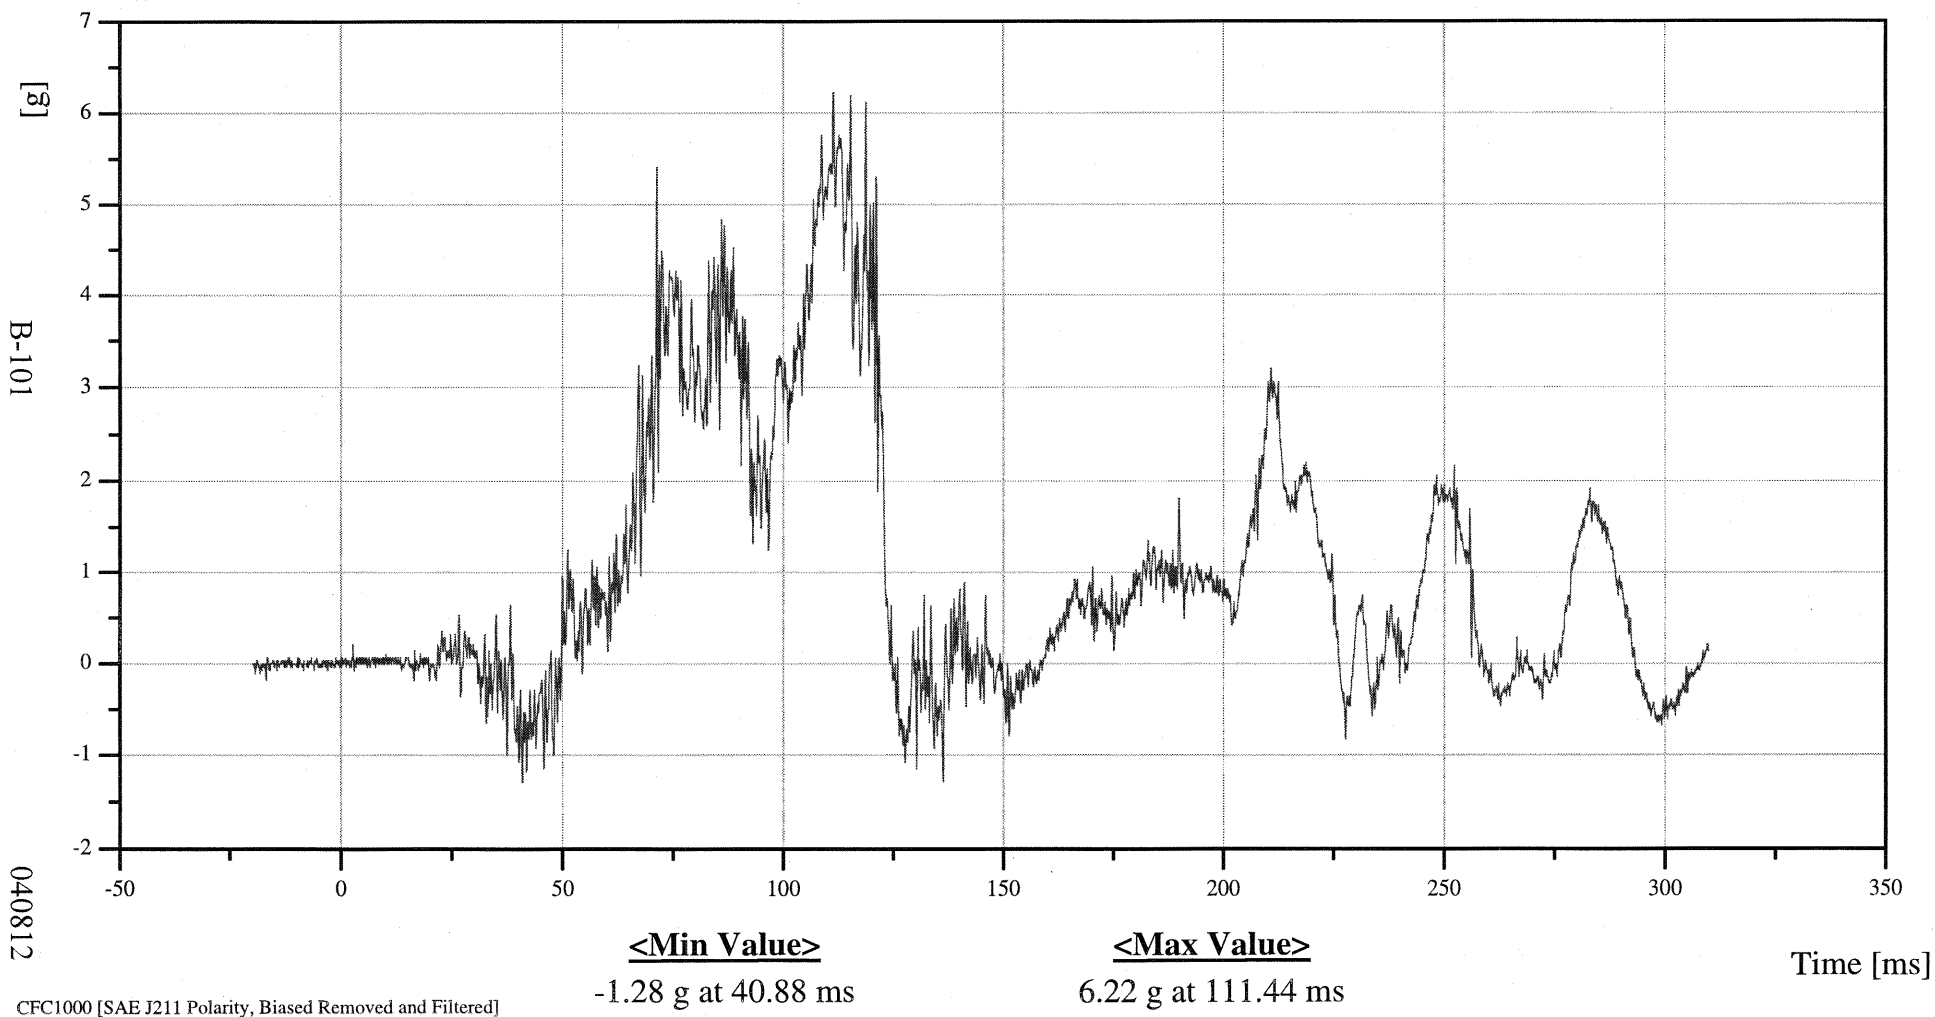



Transportation Research Center, Inc.

Head Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDZG3

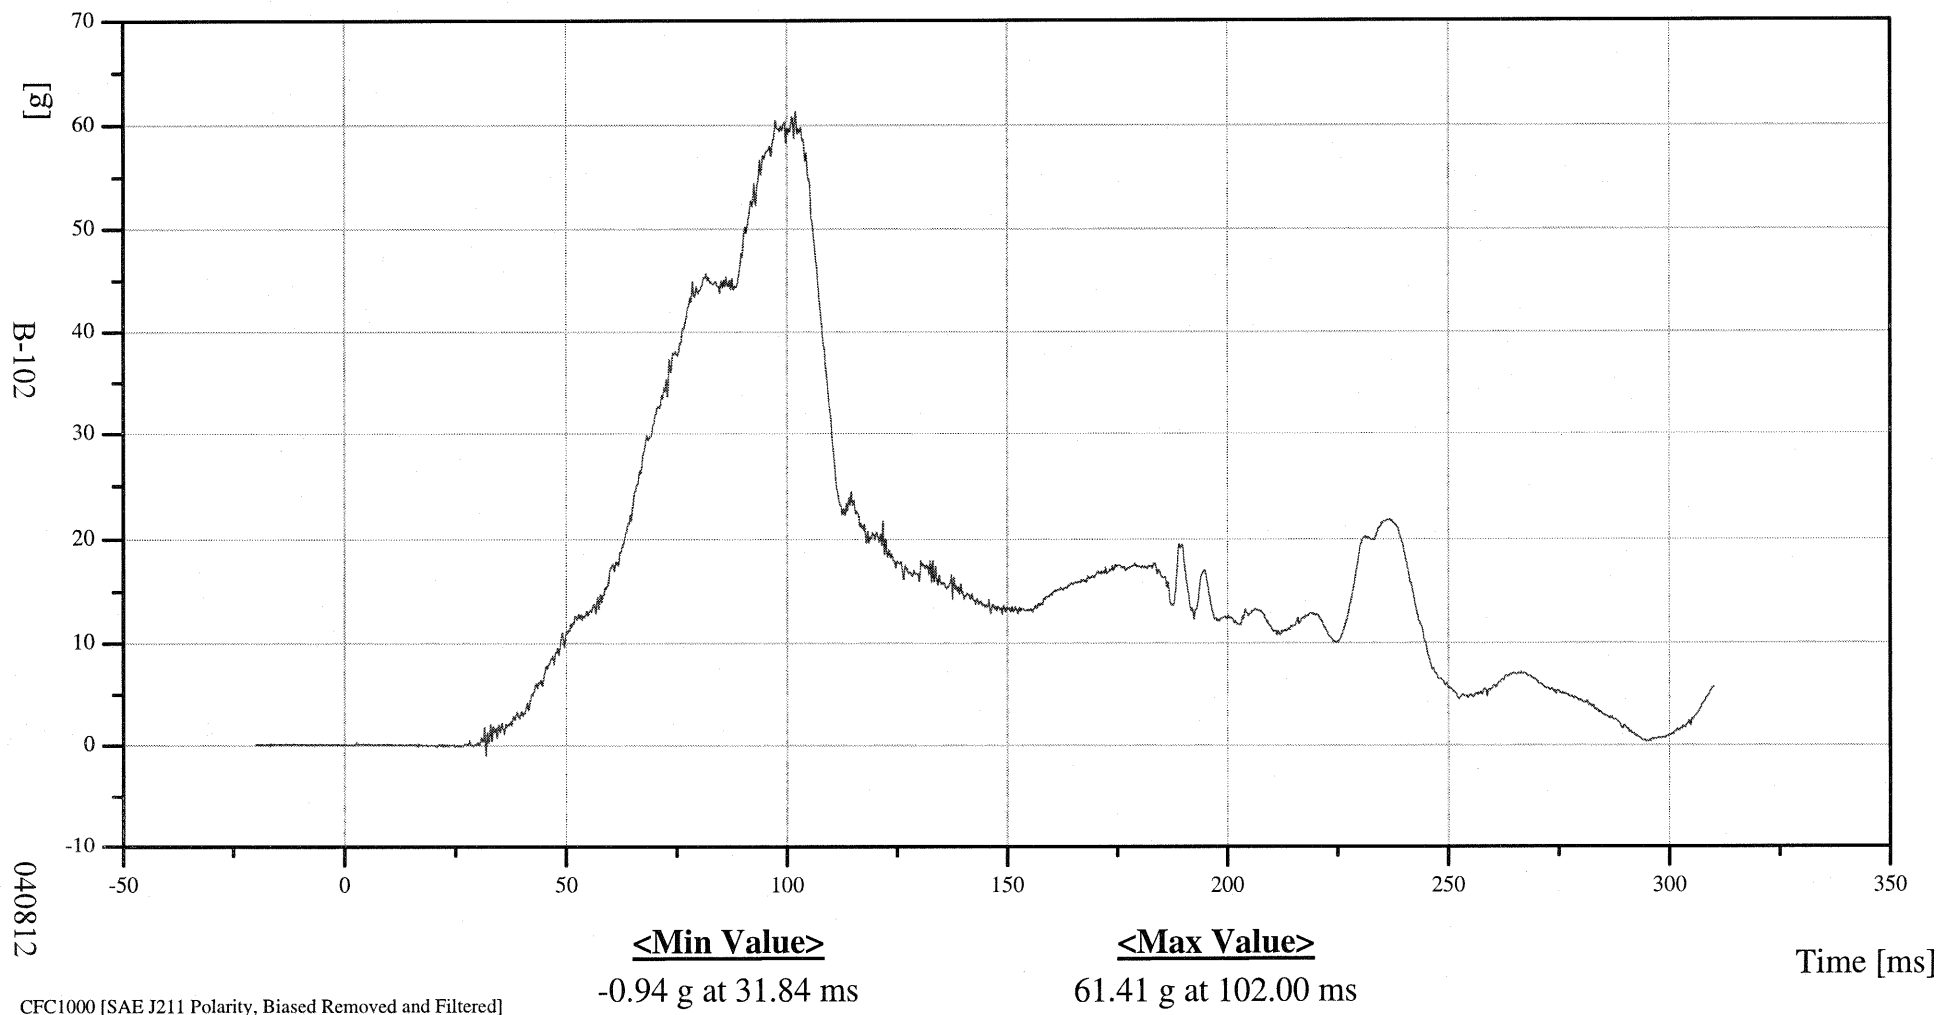



Transportation Research Center, Inc.

Head Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

HEDRG3

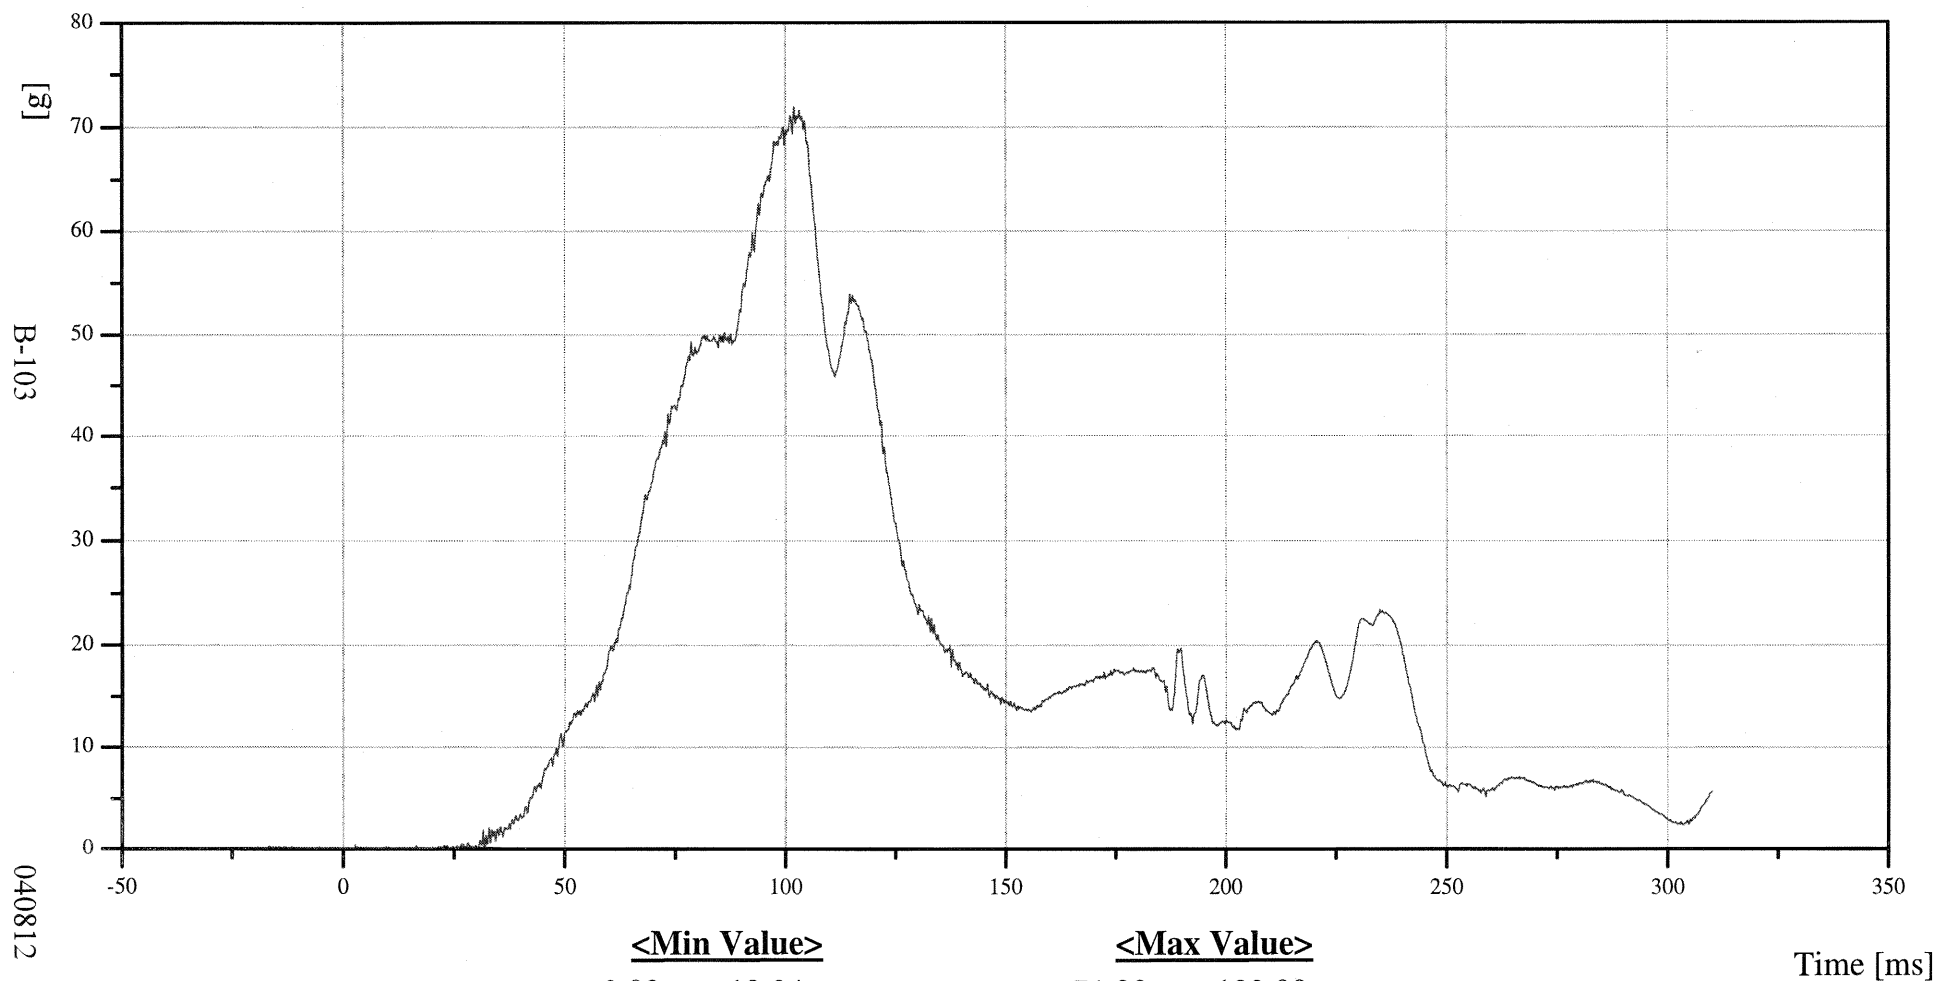

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXF3

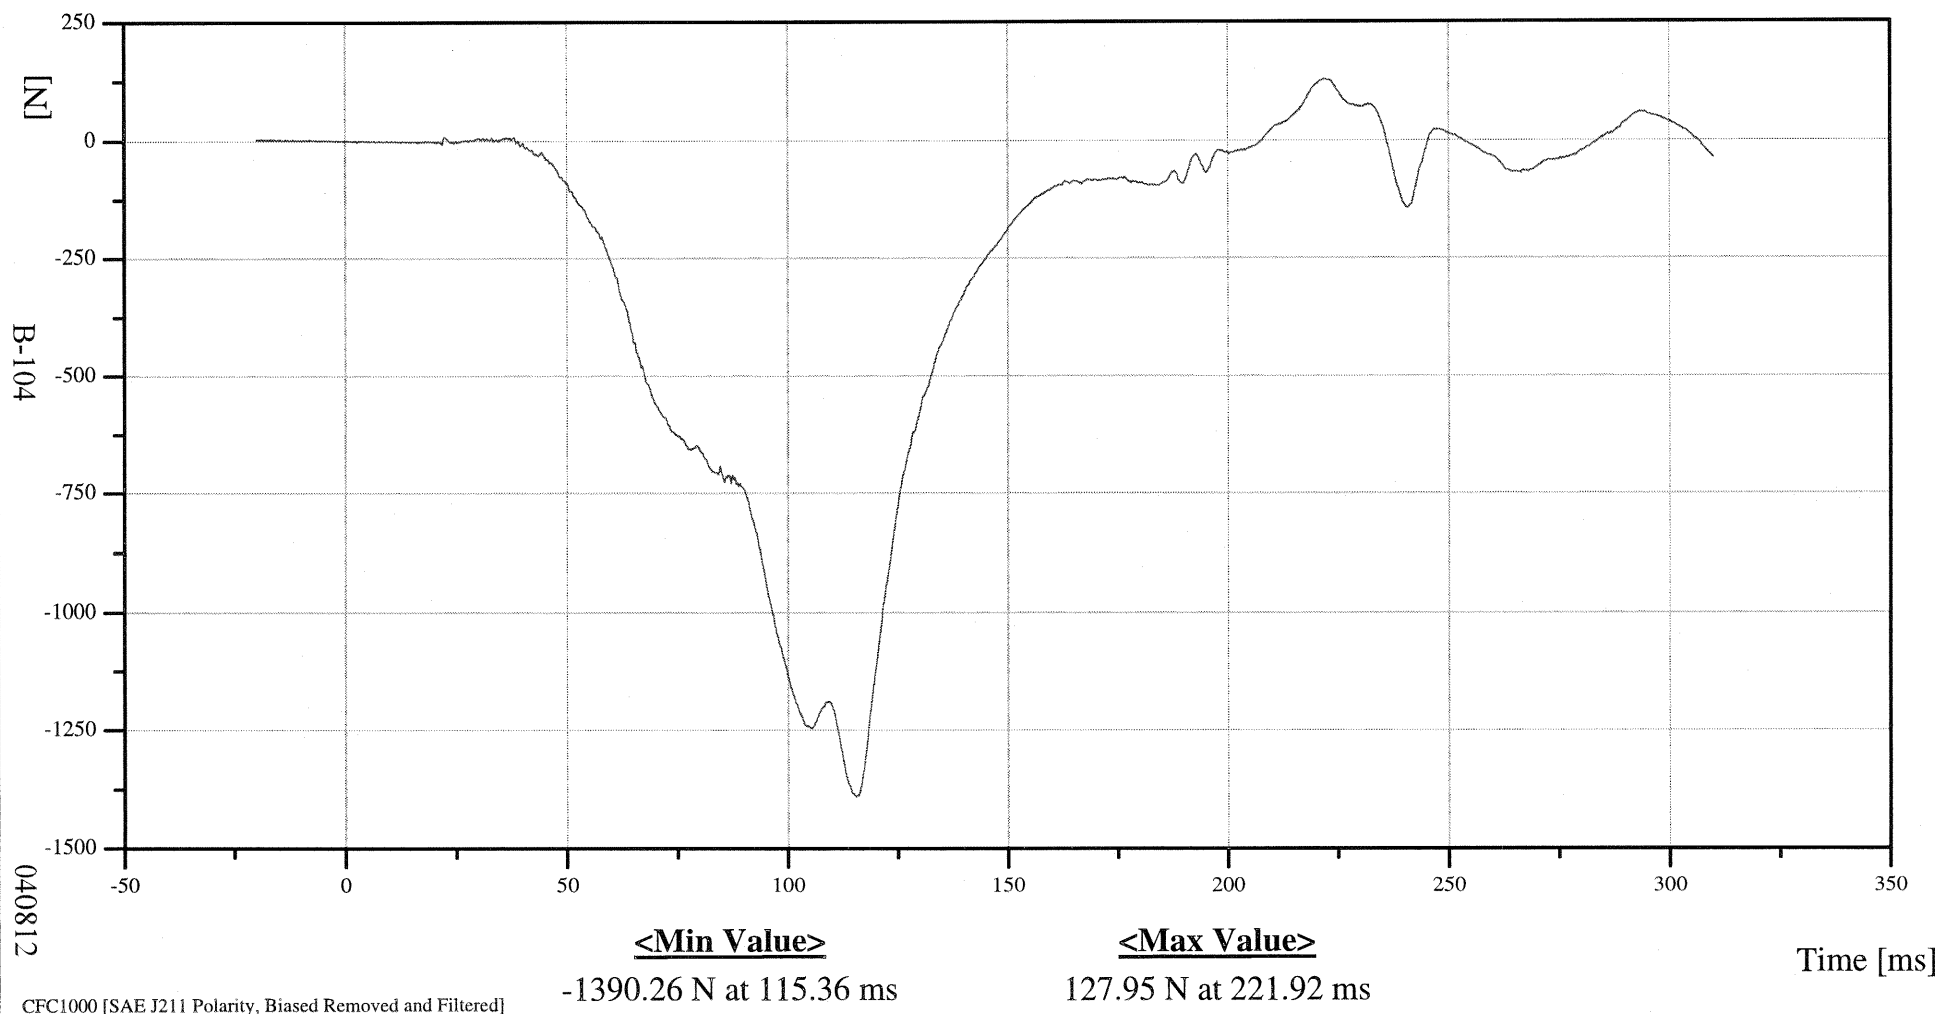



Transportation Research Center, Inc.

Neck Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYF3

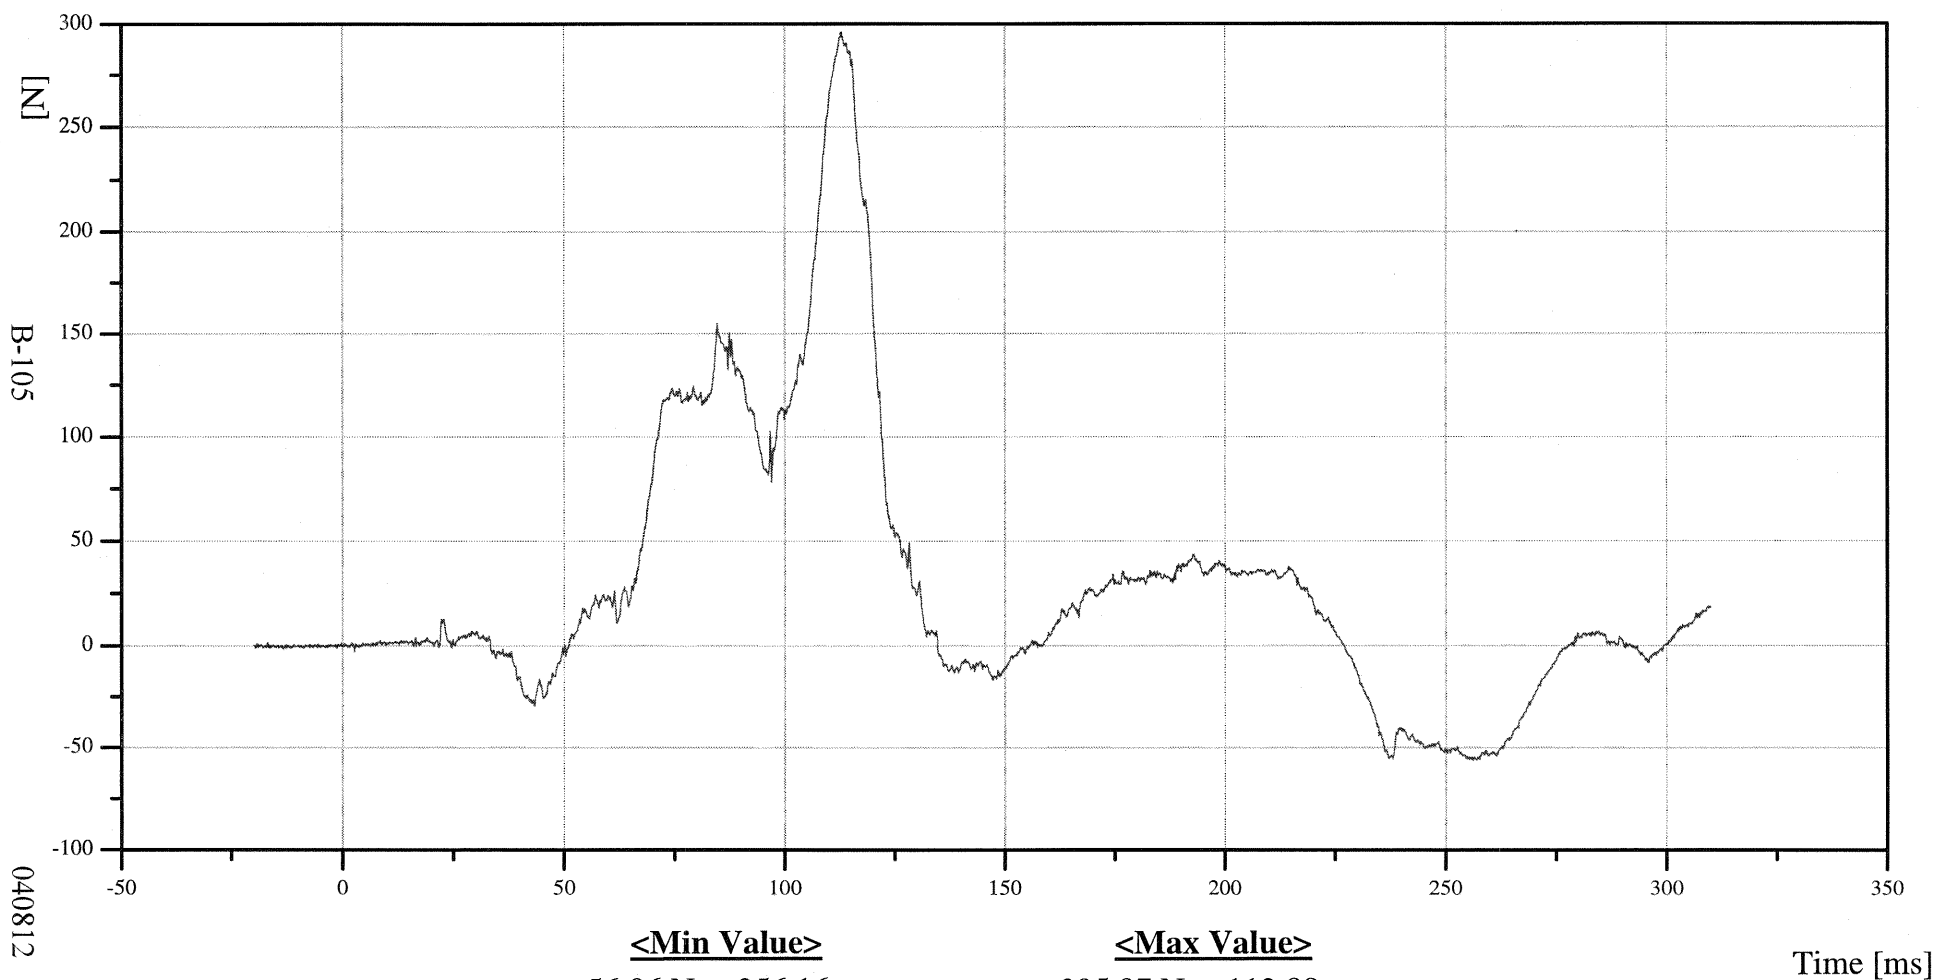

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZF3

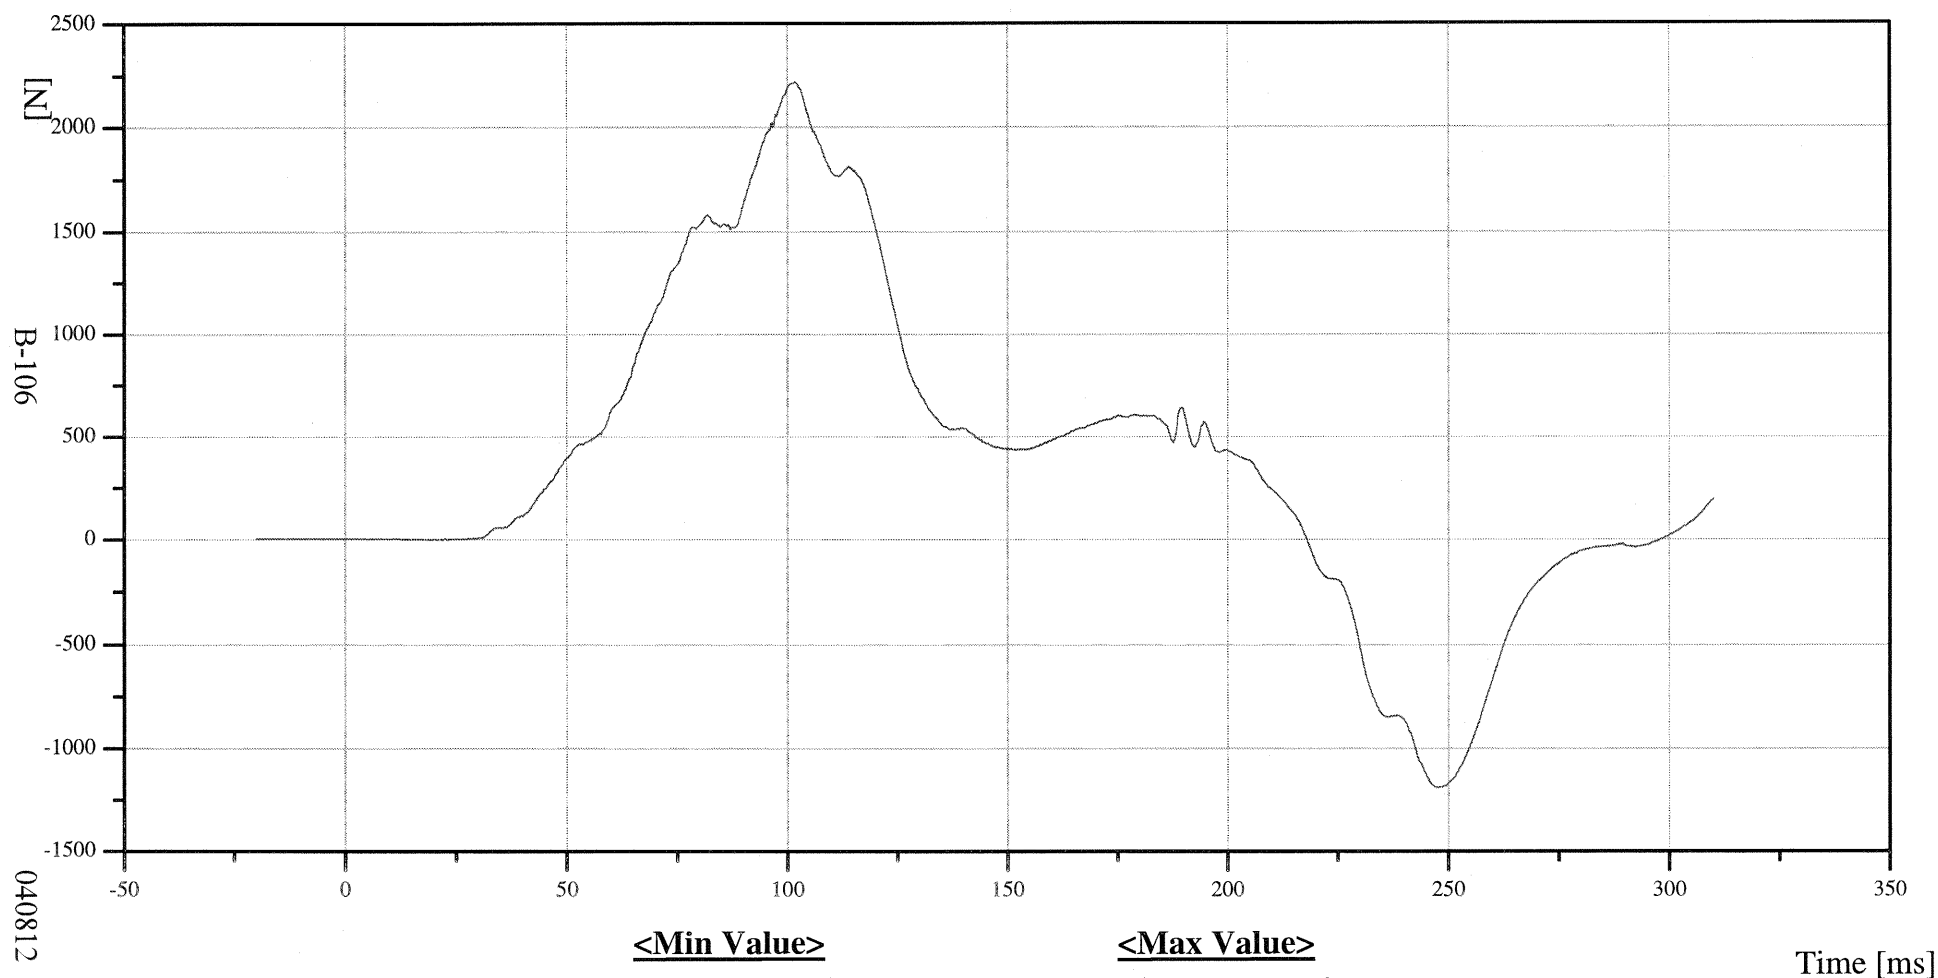

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKXM3

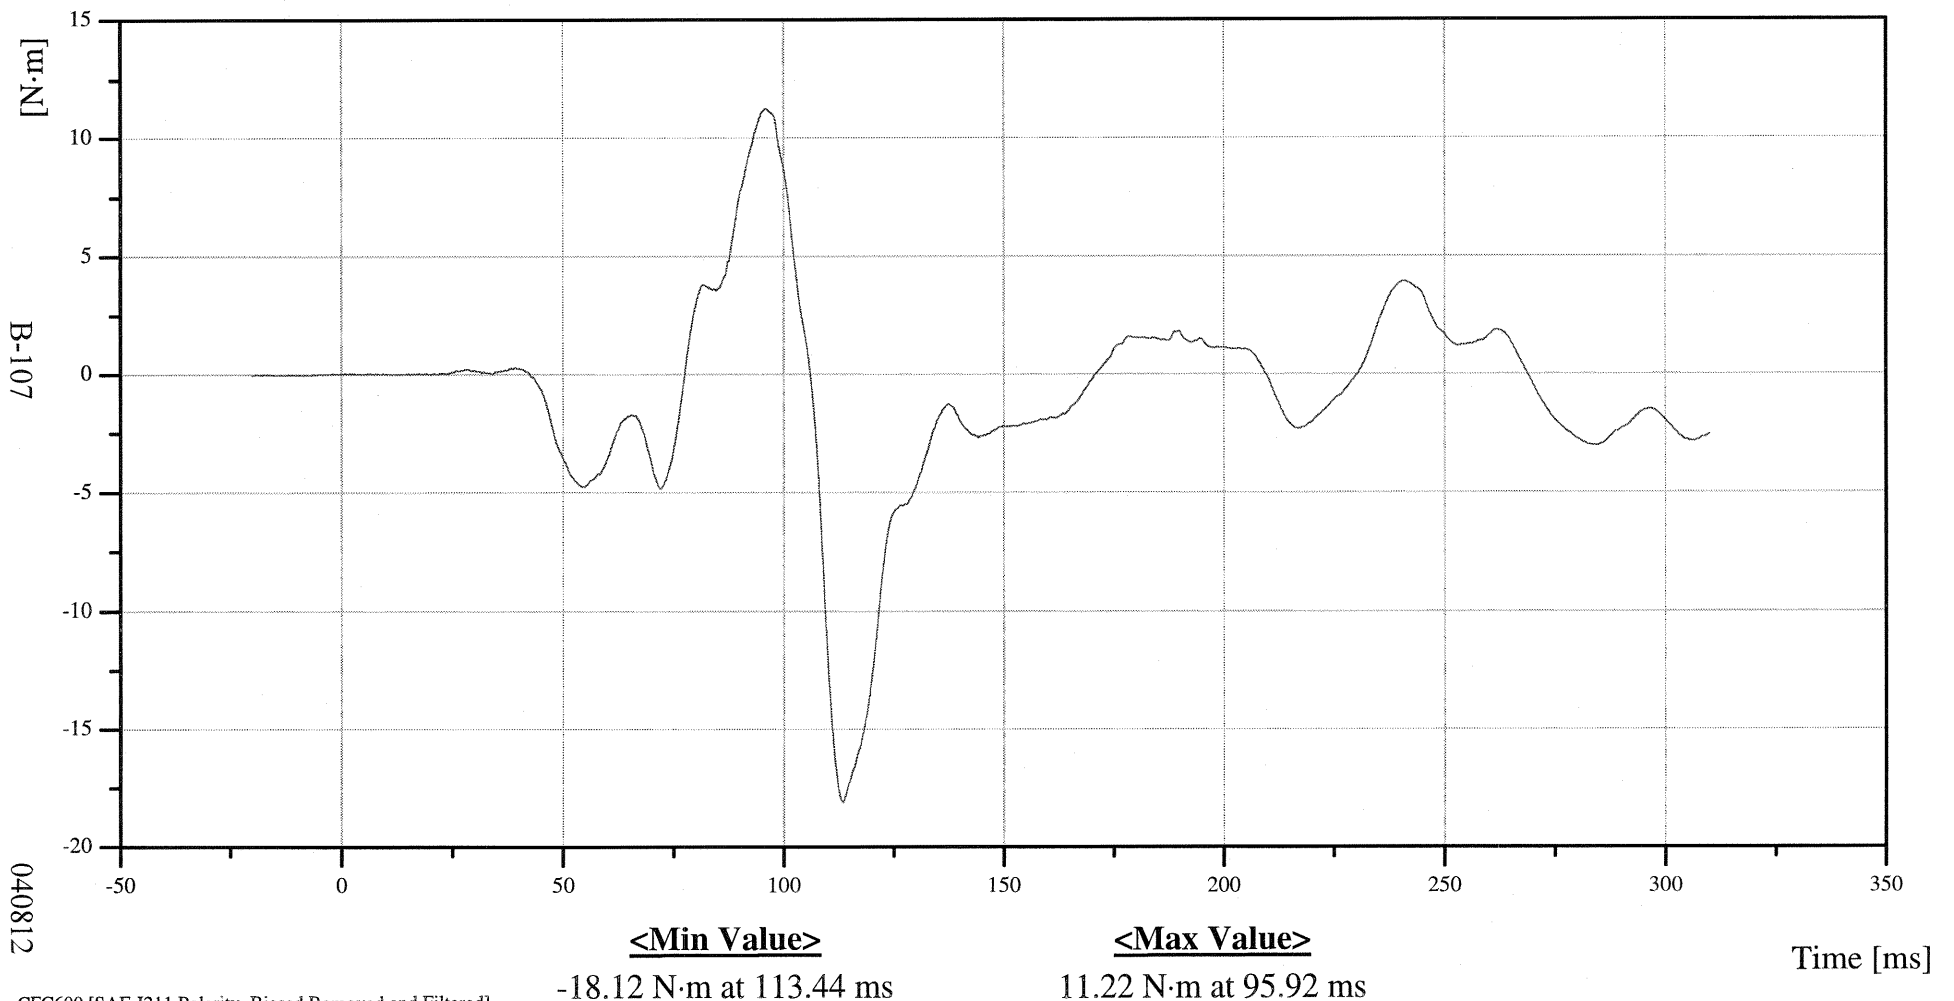

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKYM3

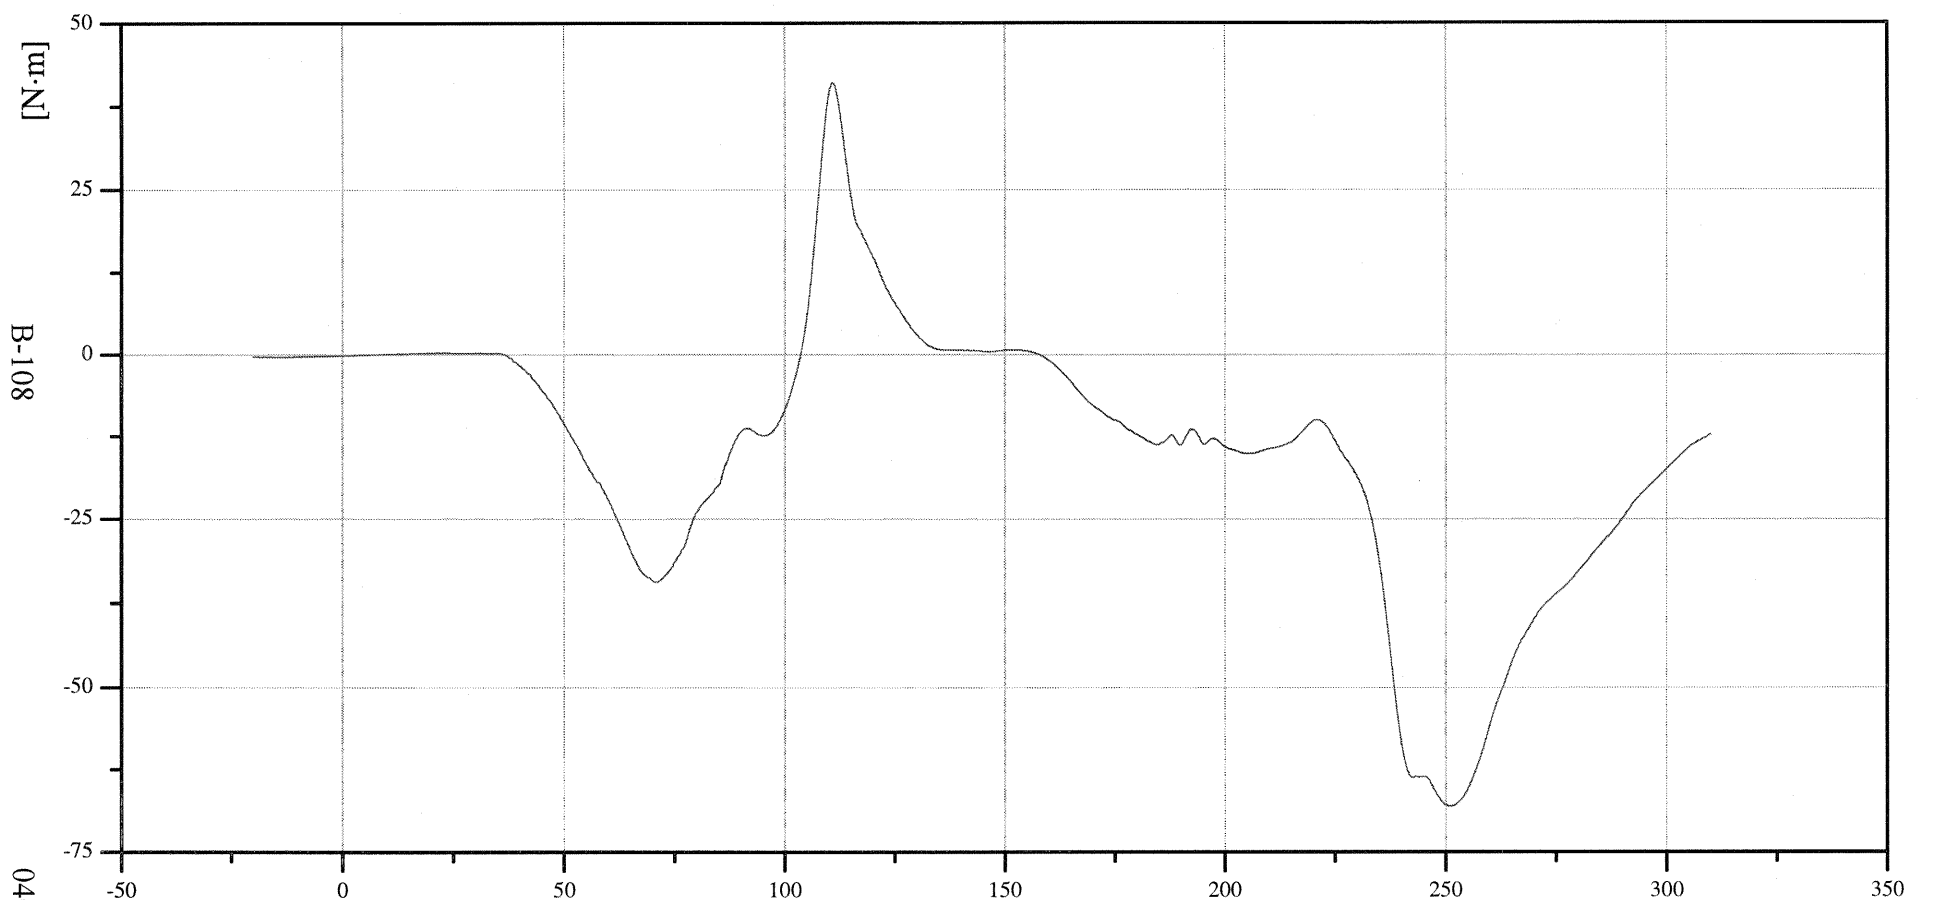

<Min Value>

-68.05 N·m at 251.20 ms

<Max Value>

41.07 N·m at 110.96 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NEKZM3

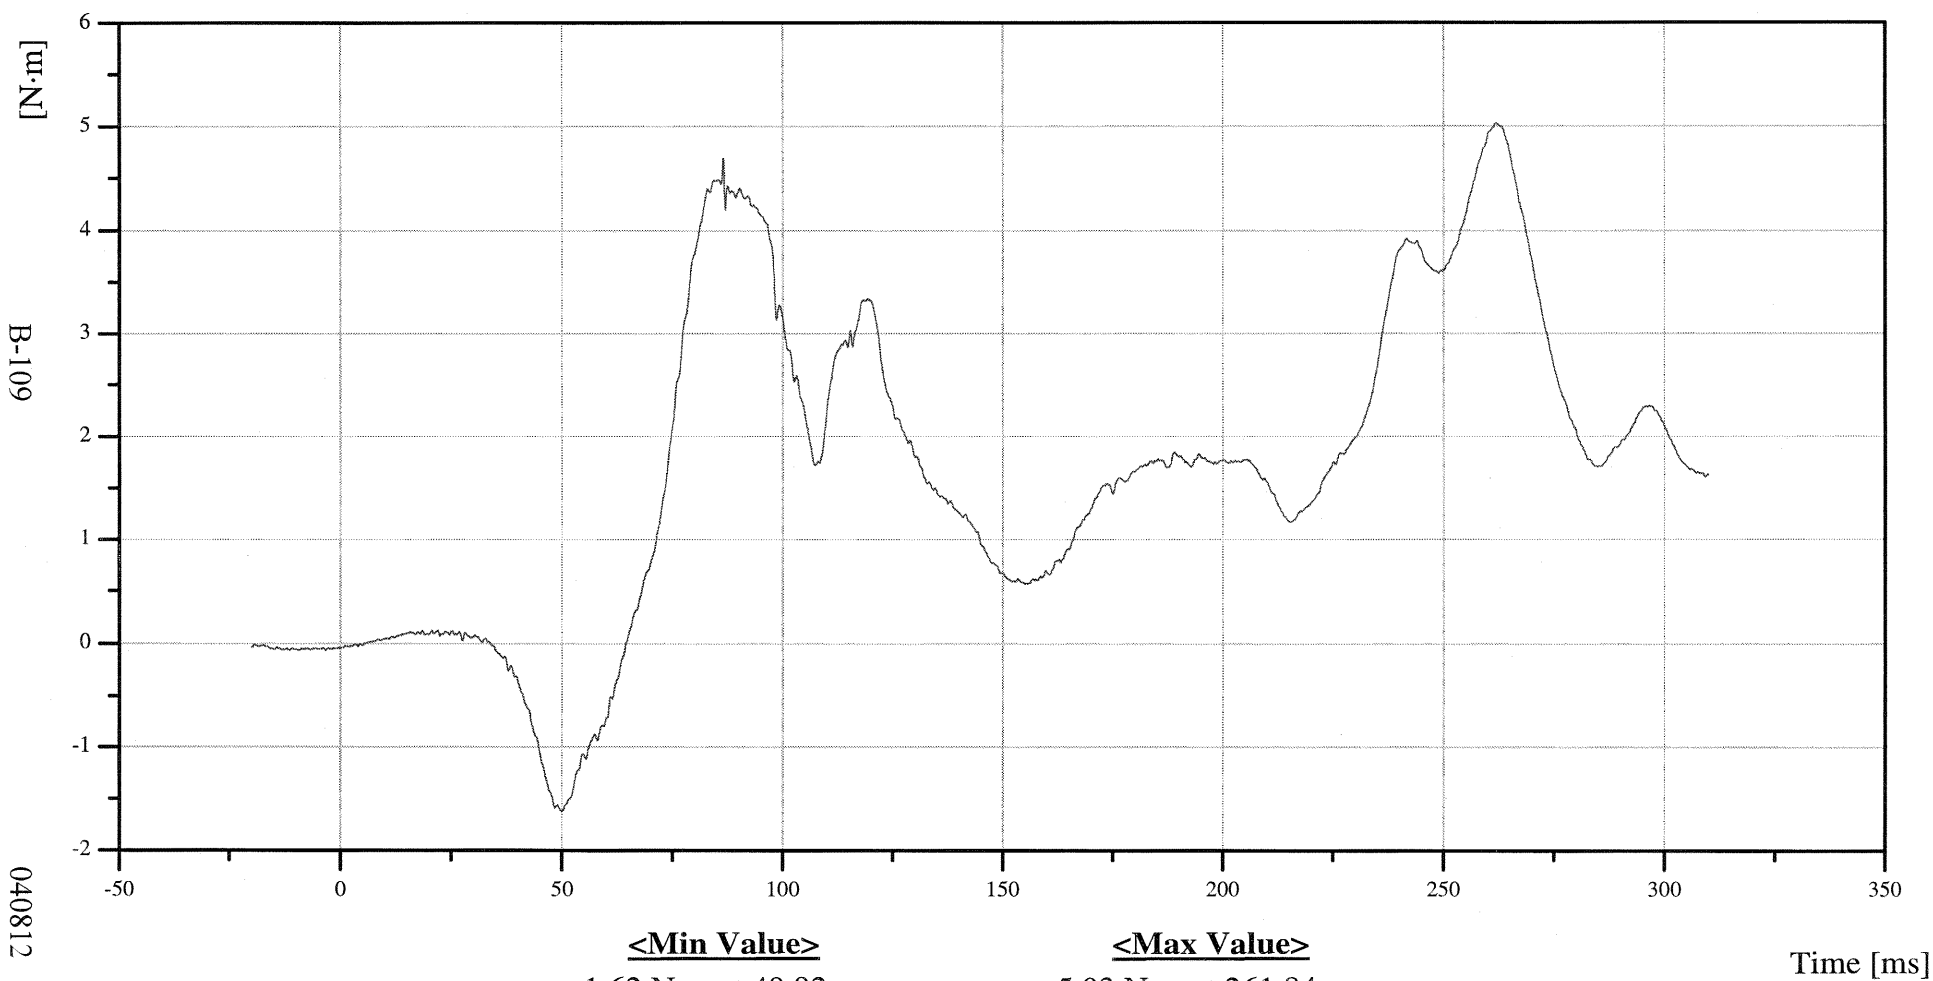

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXF3

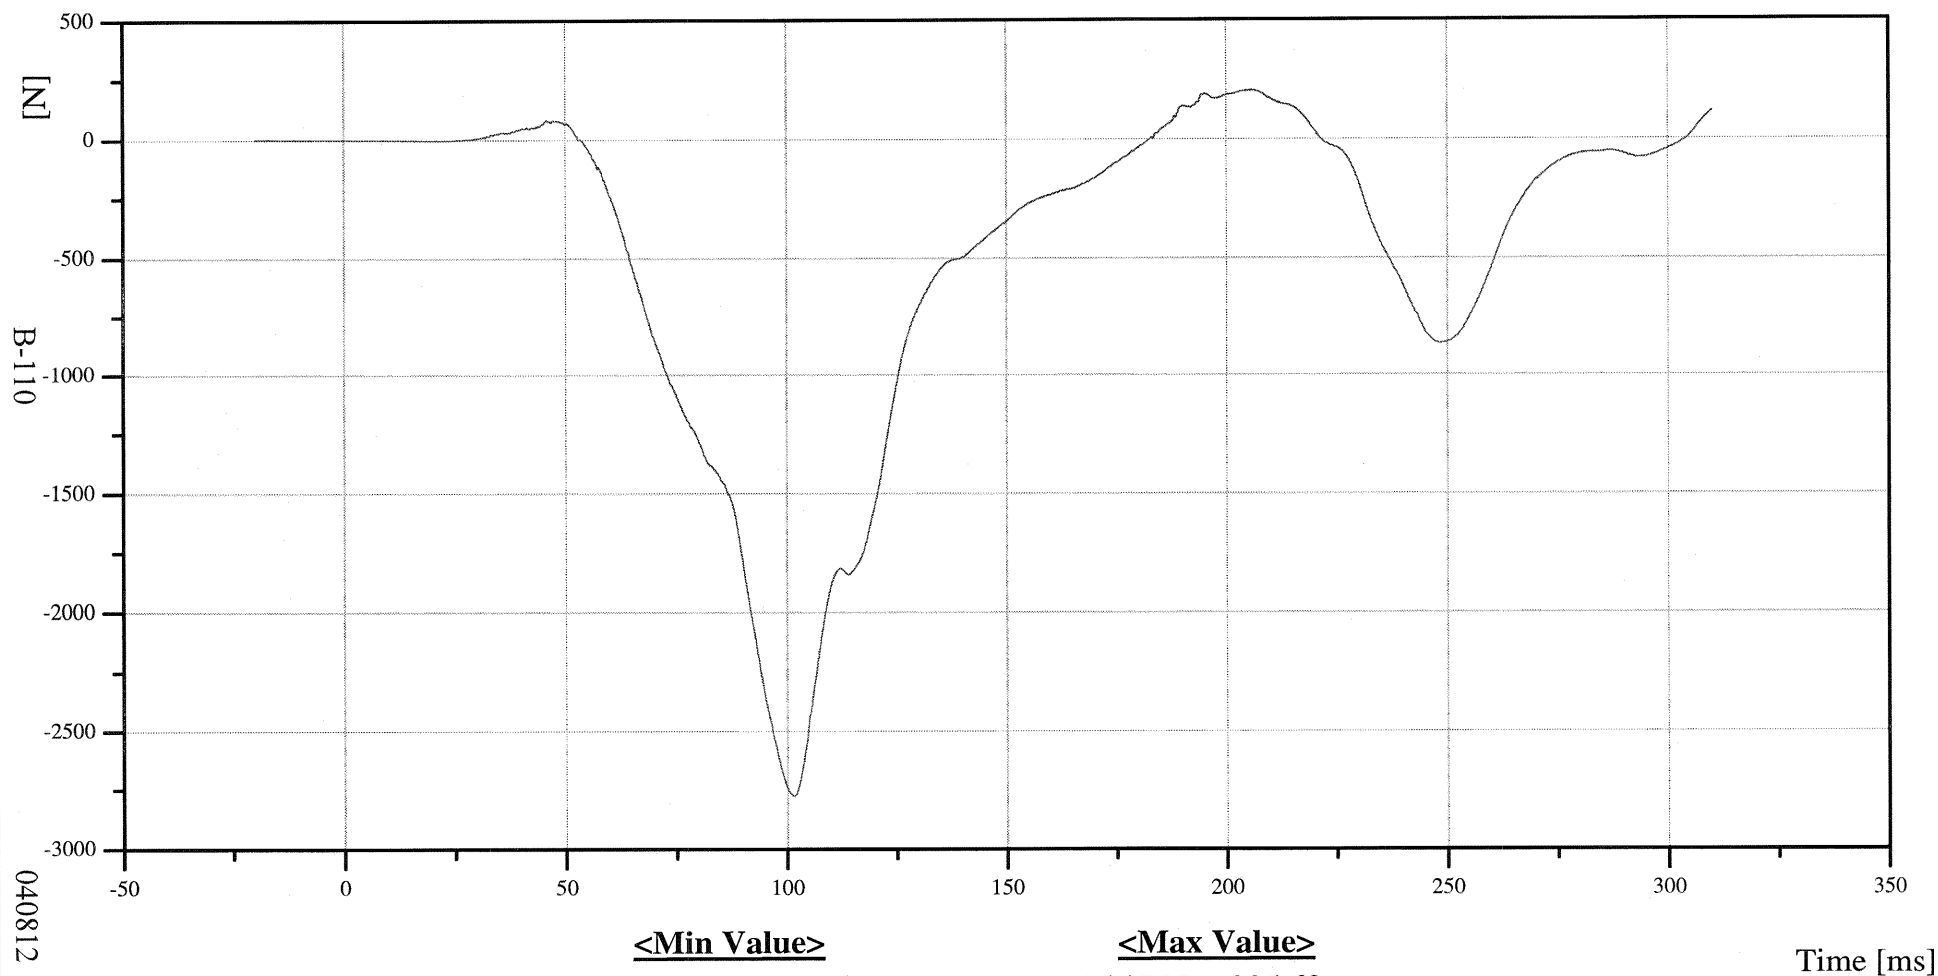

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Force Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYF3

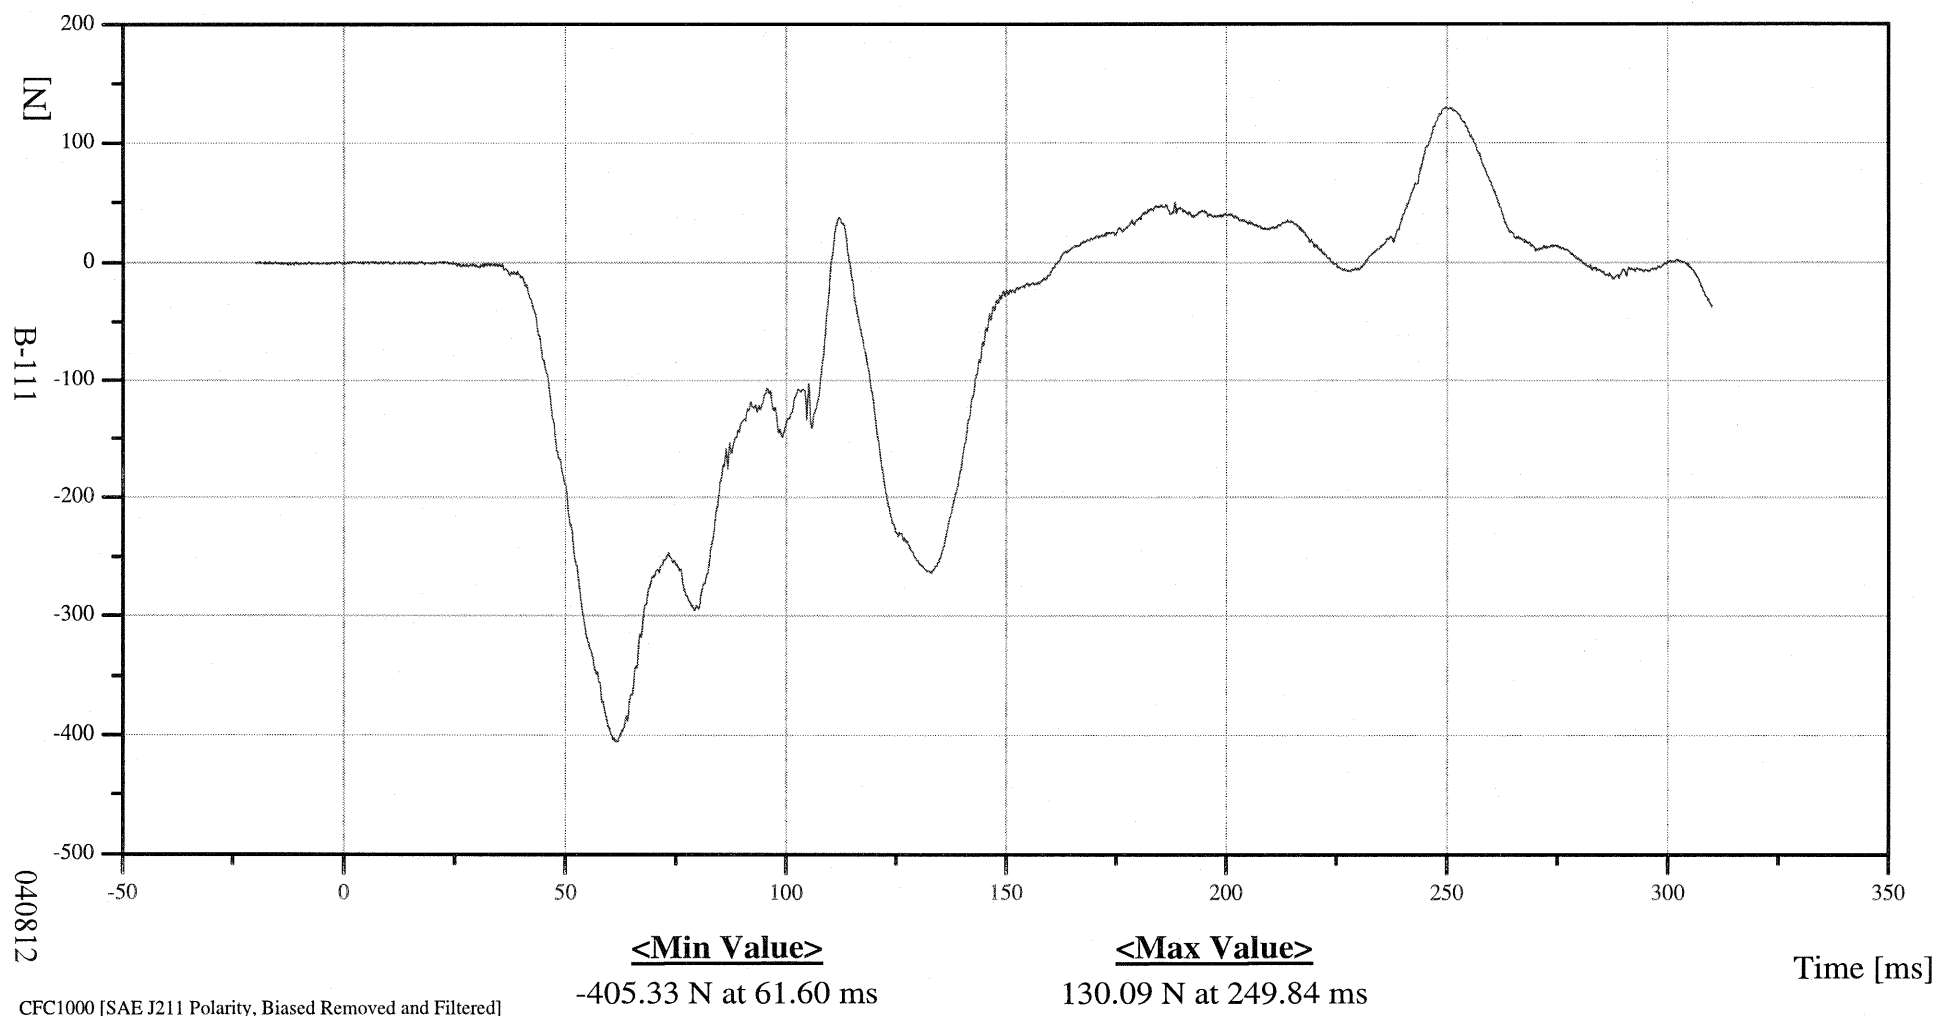



Transportation Research Center, Inc.

Neck Lwr Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZF3

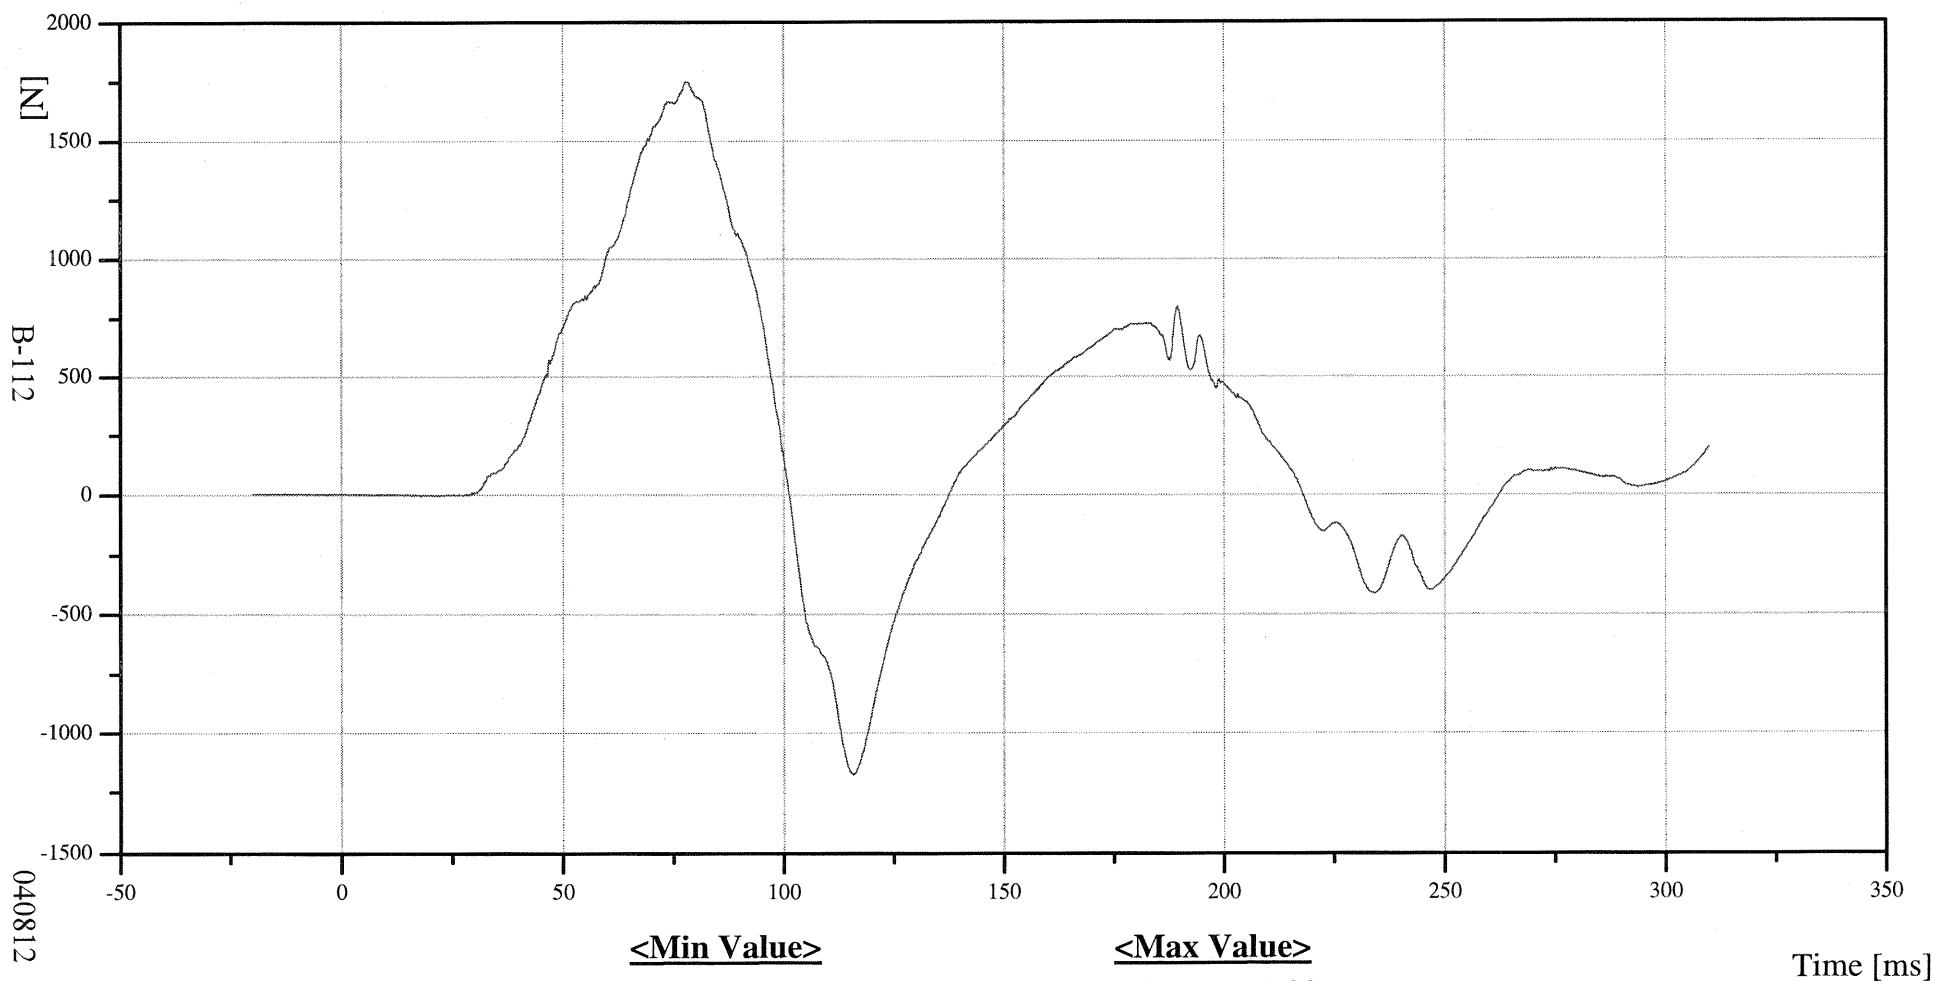

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Neck Lwr Moment X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLXM3

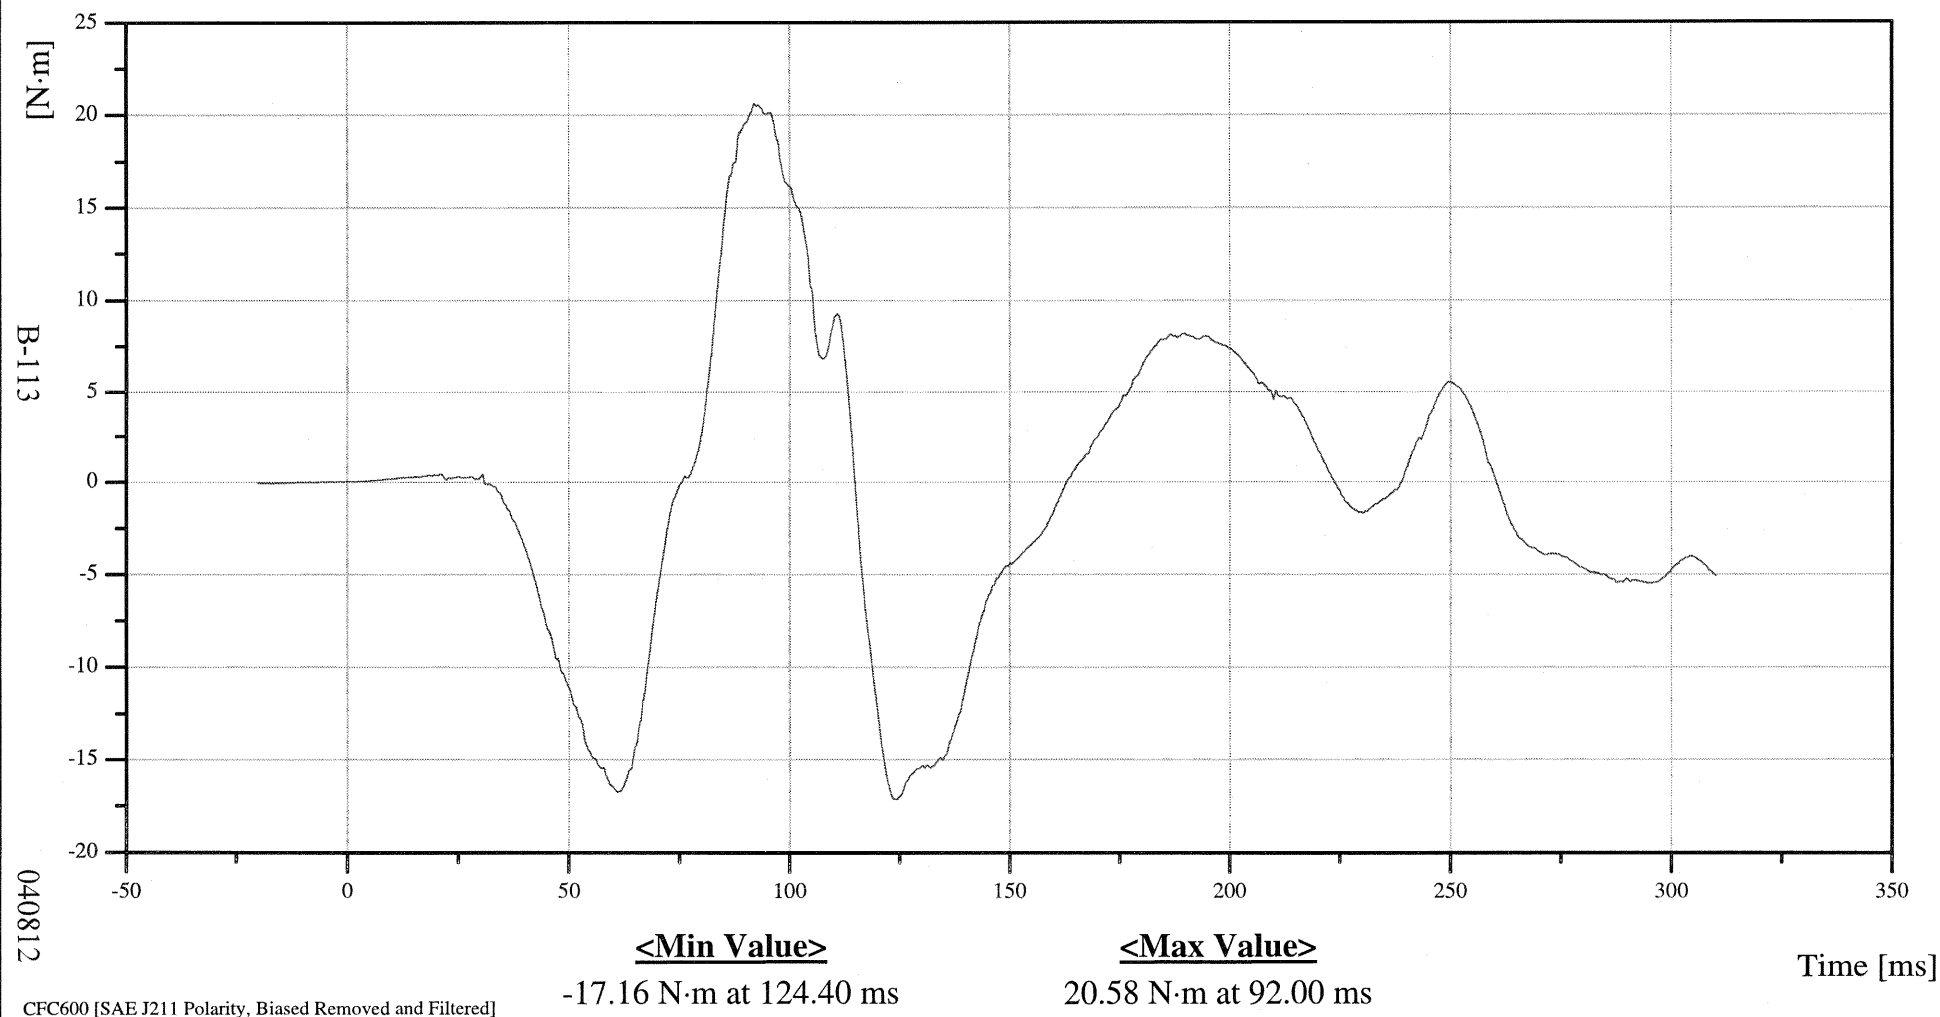



Transportation Research Center, Inc.

Neck Lwr Moment Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLYM3

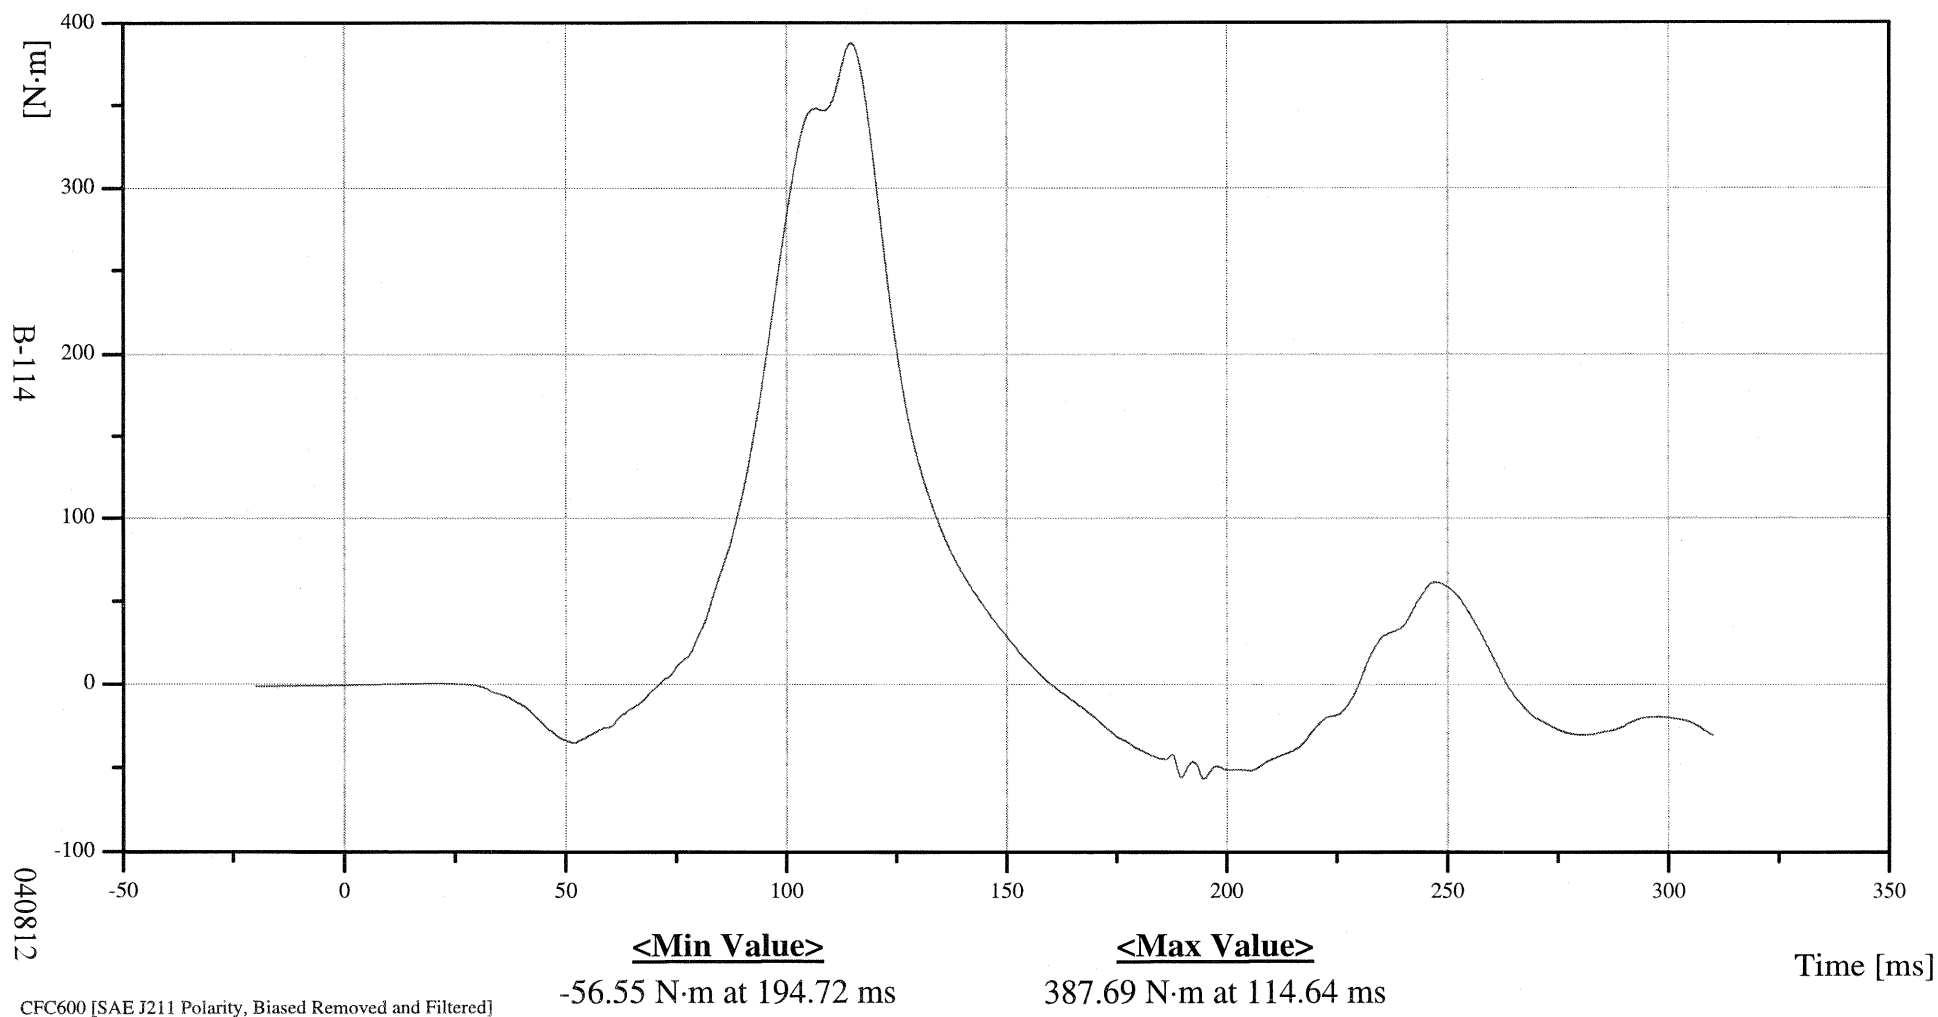



Transportation Research Center, Inc.

Neck Lwr Moment Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

NKLZM3

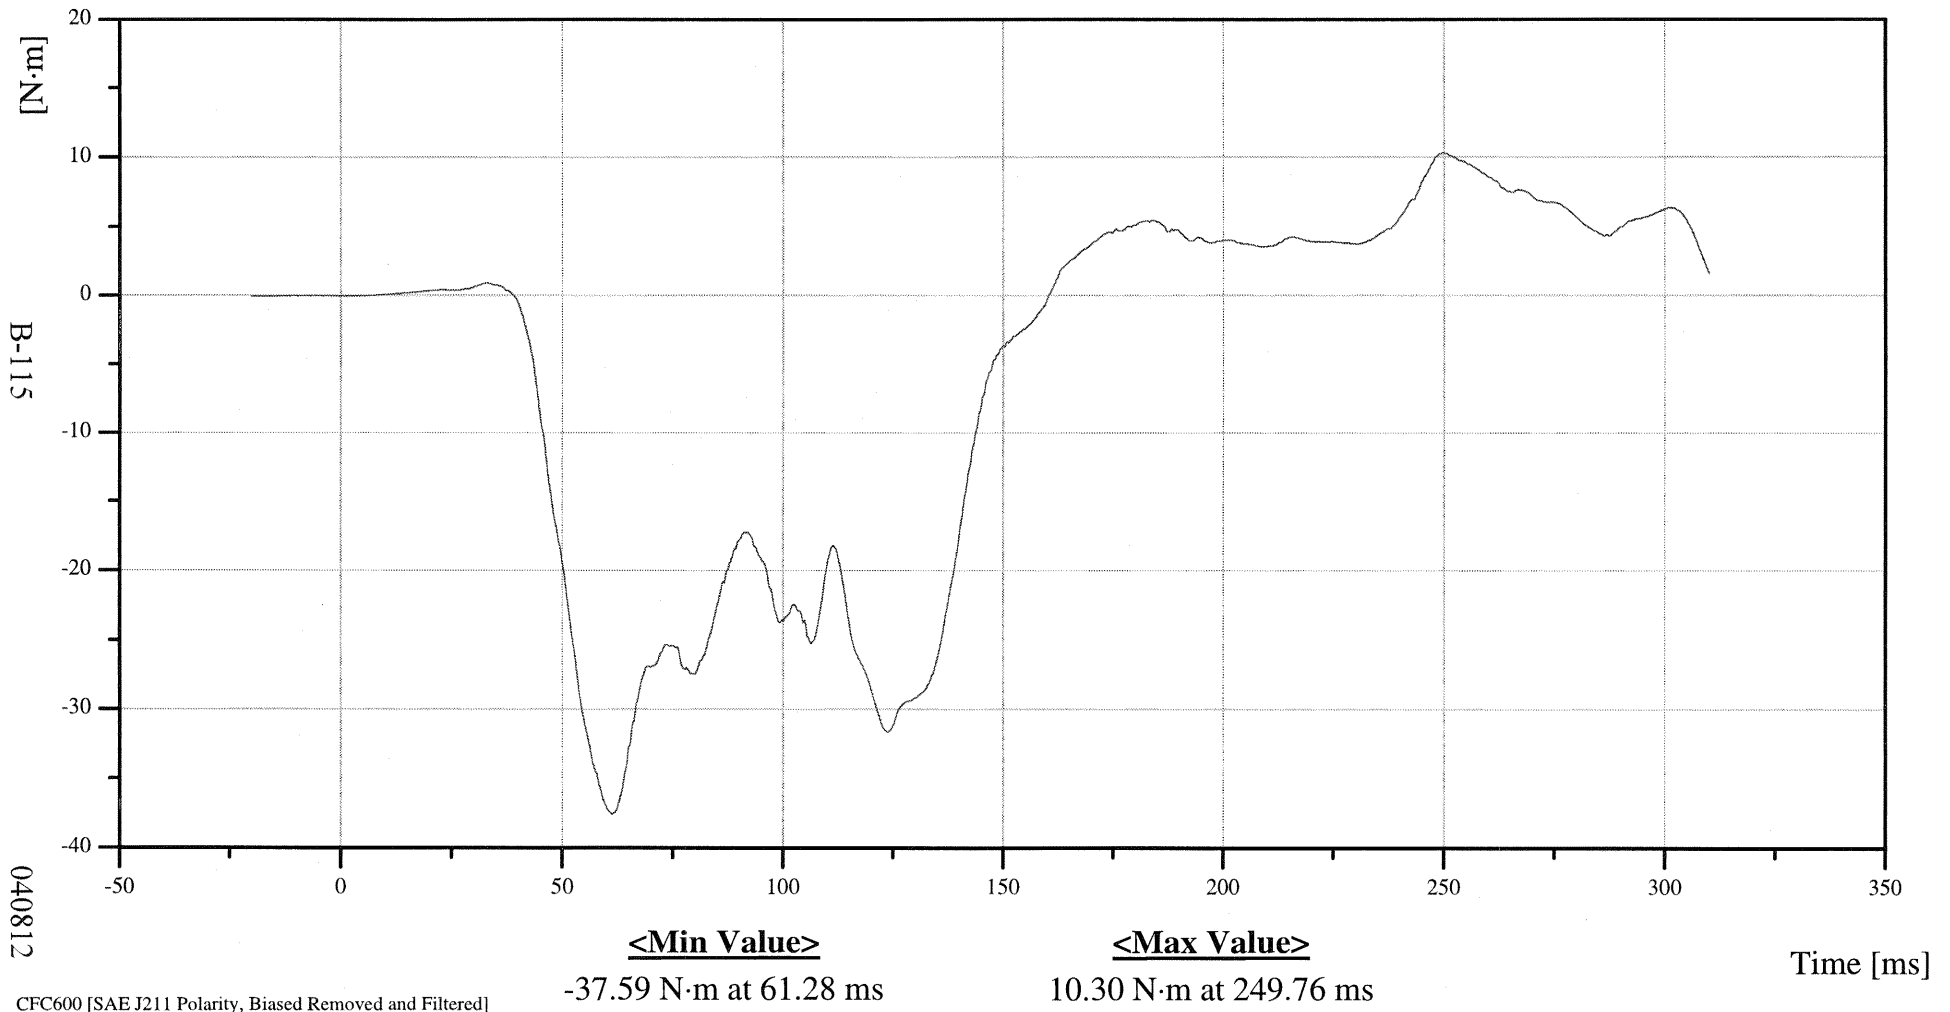



Transportation Research Center, Inc.

Chest Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXG3

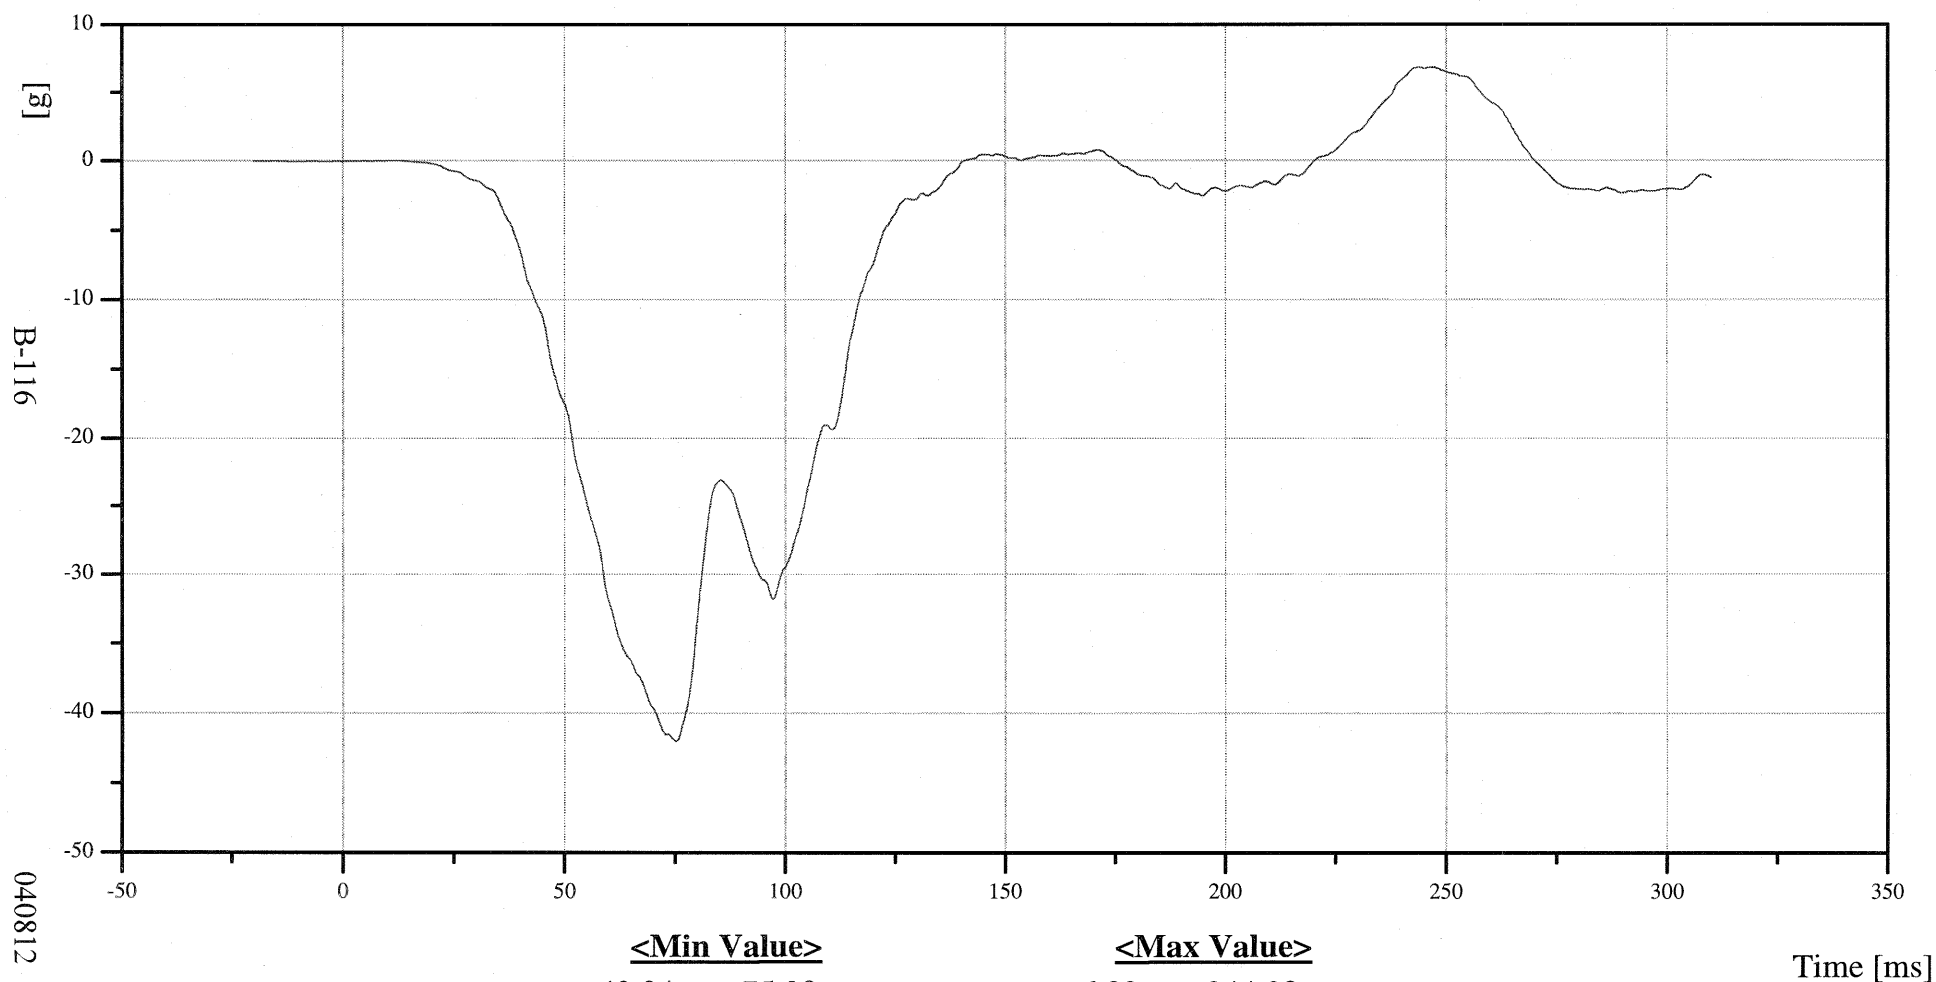

CFC180 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Chest Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTYG3

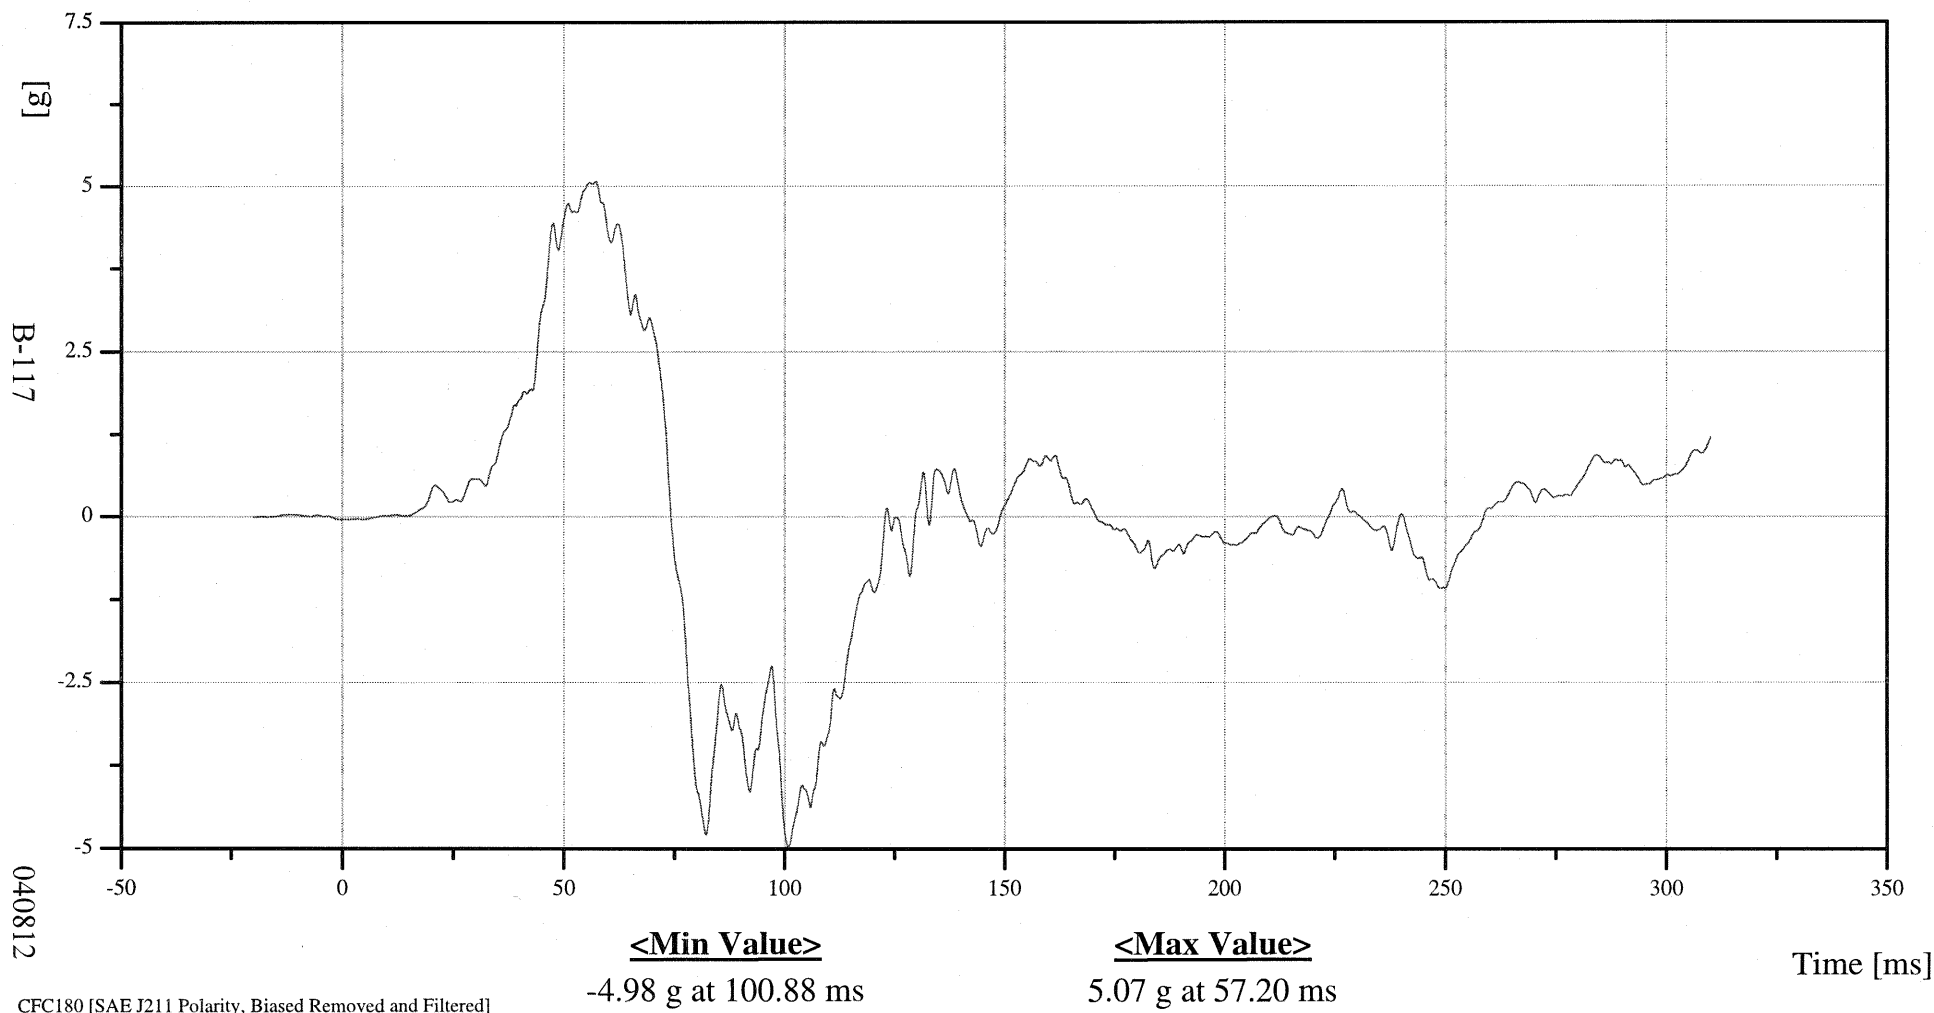



Transportation Research Center, Inc.

Chest Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTZG3

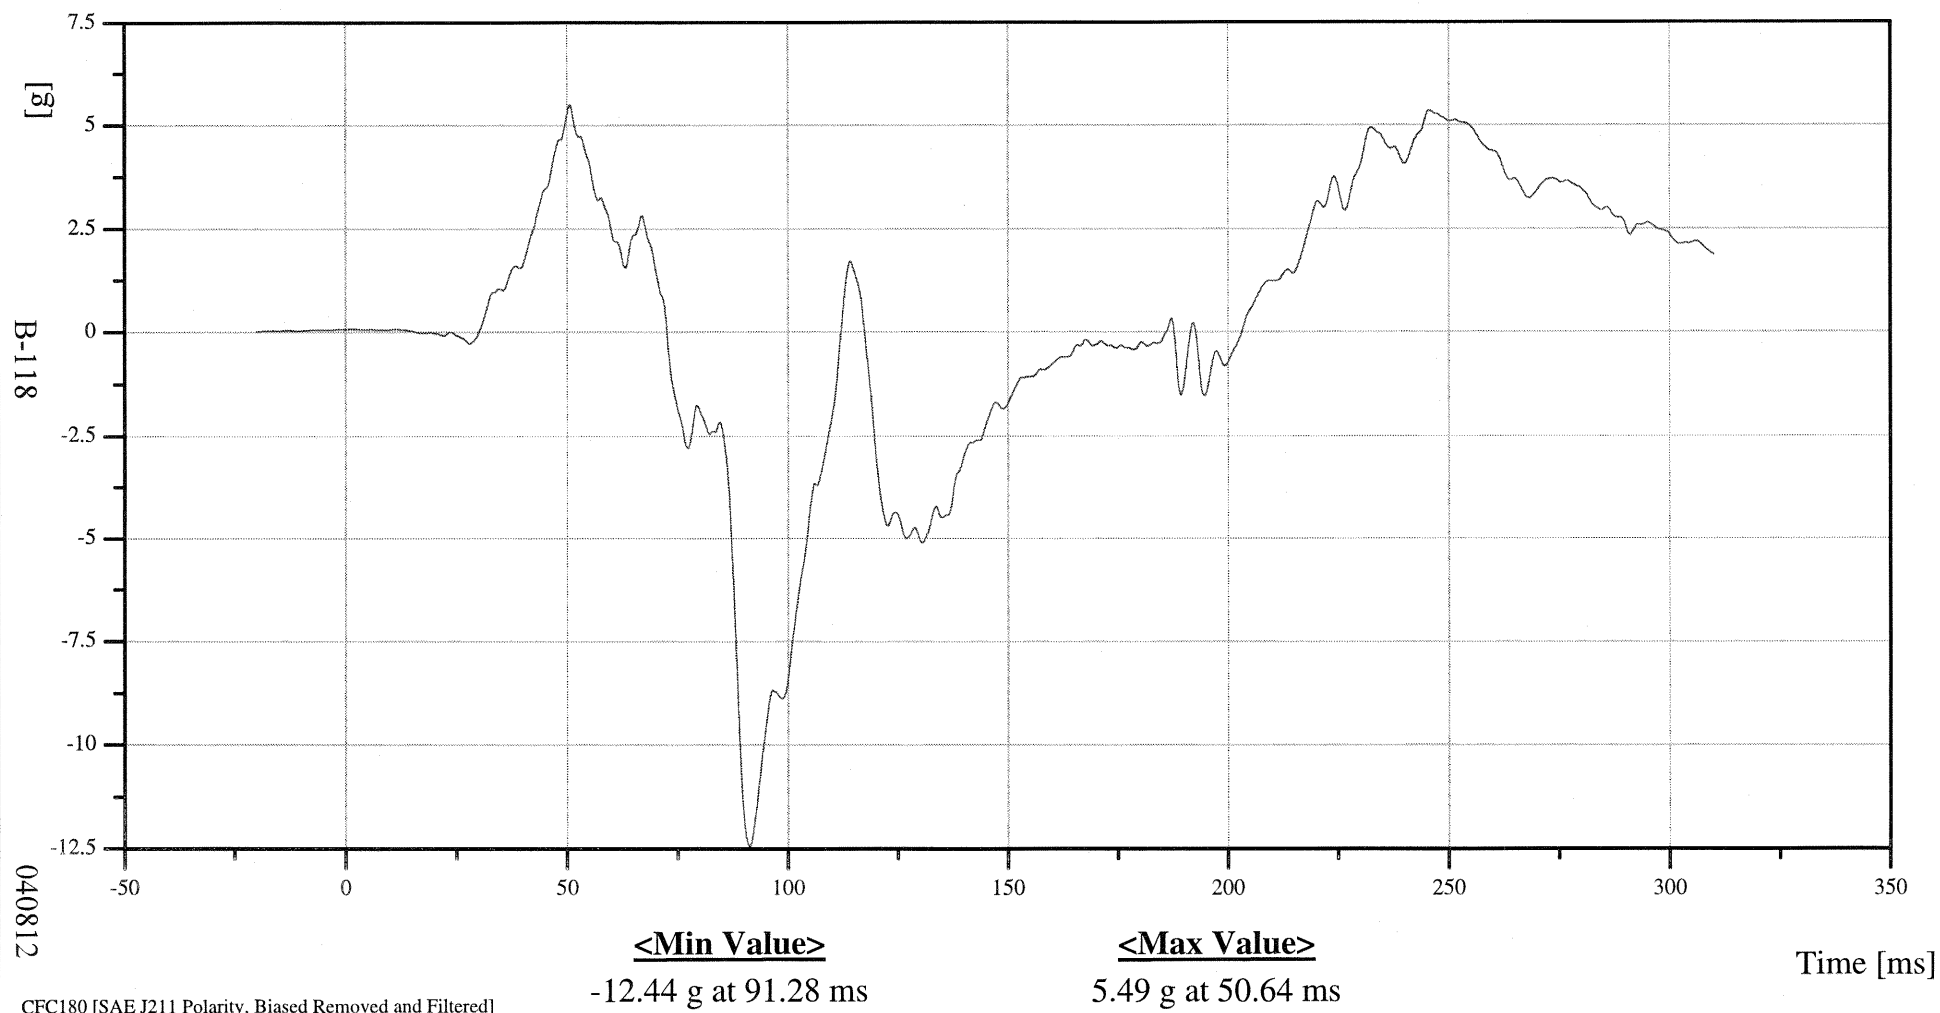



Transportation Research Center, Inc.

Chest Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTRG3

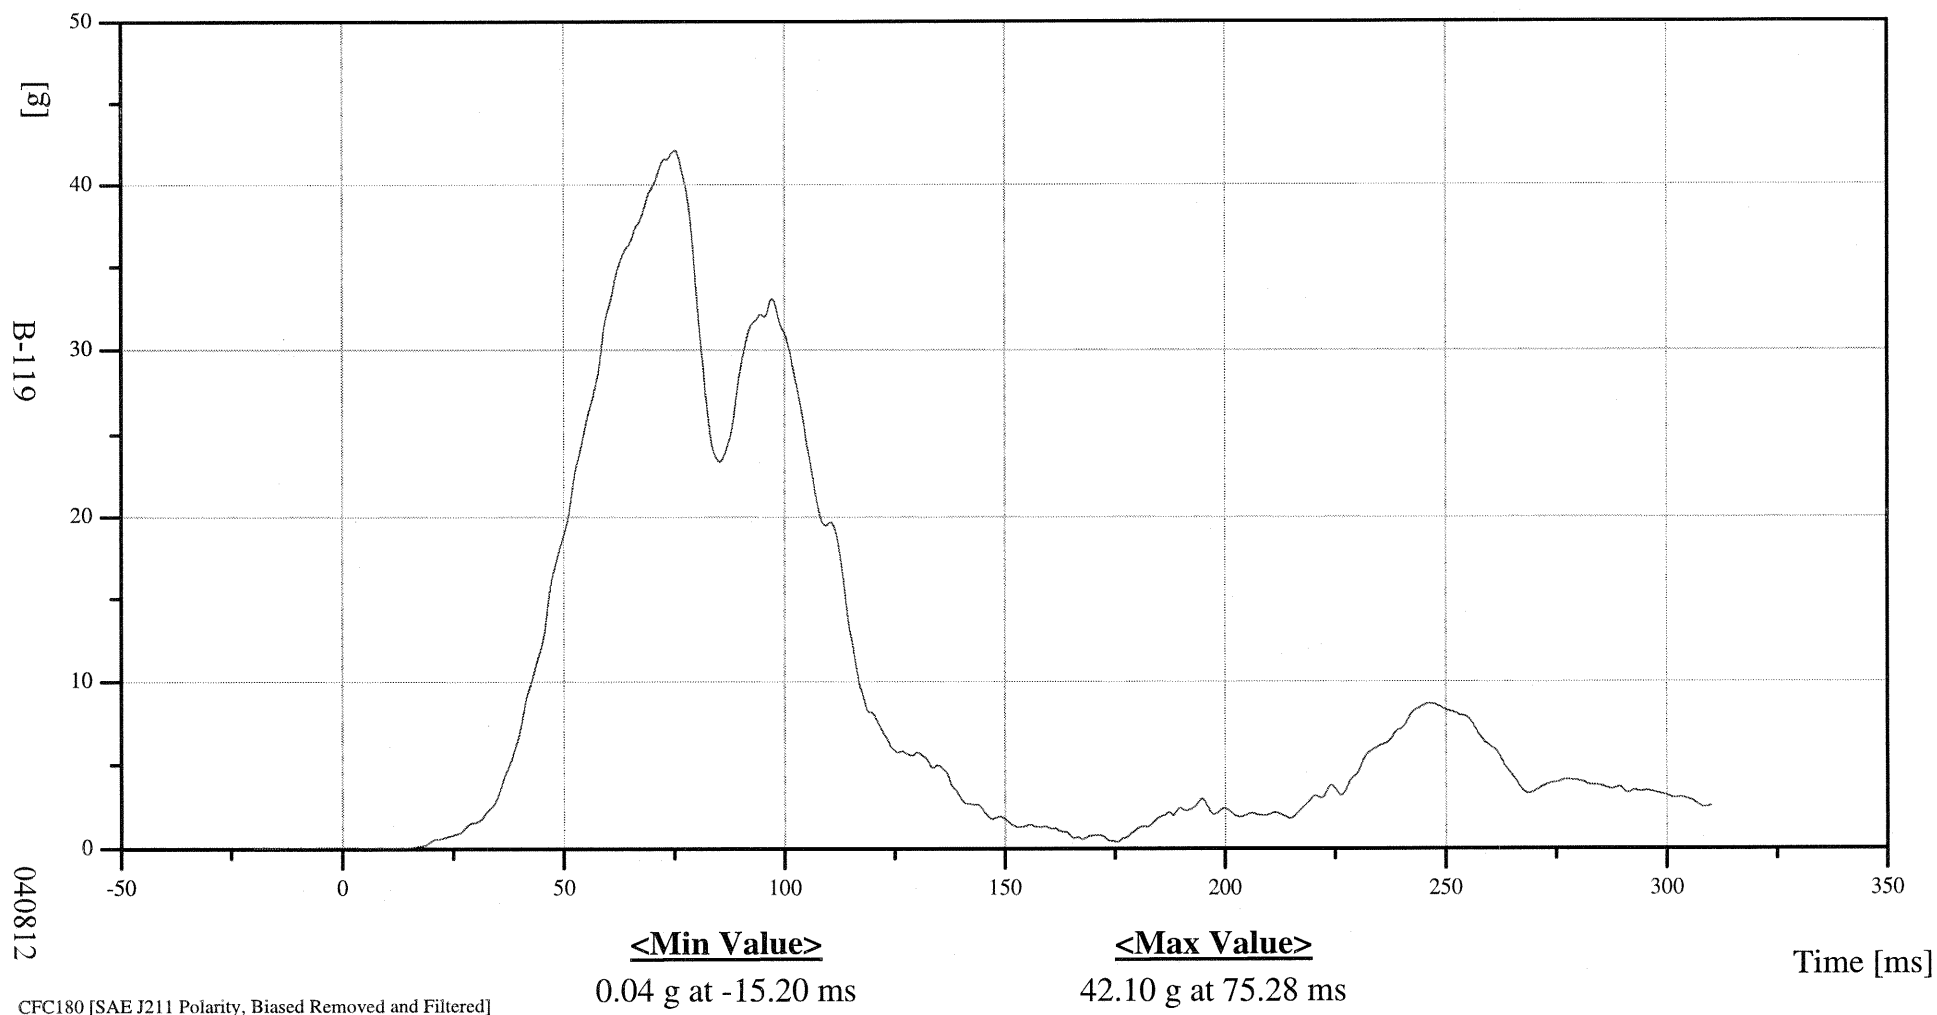



Transportation Research Center, Inc.

Chest Deflection X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

CSTXD3

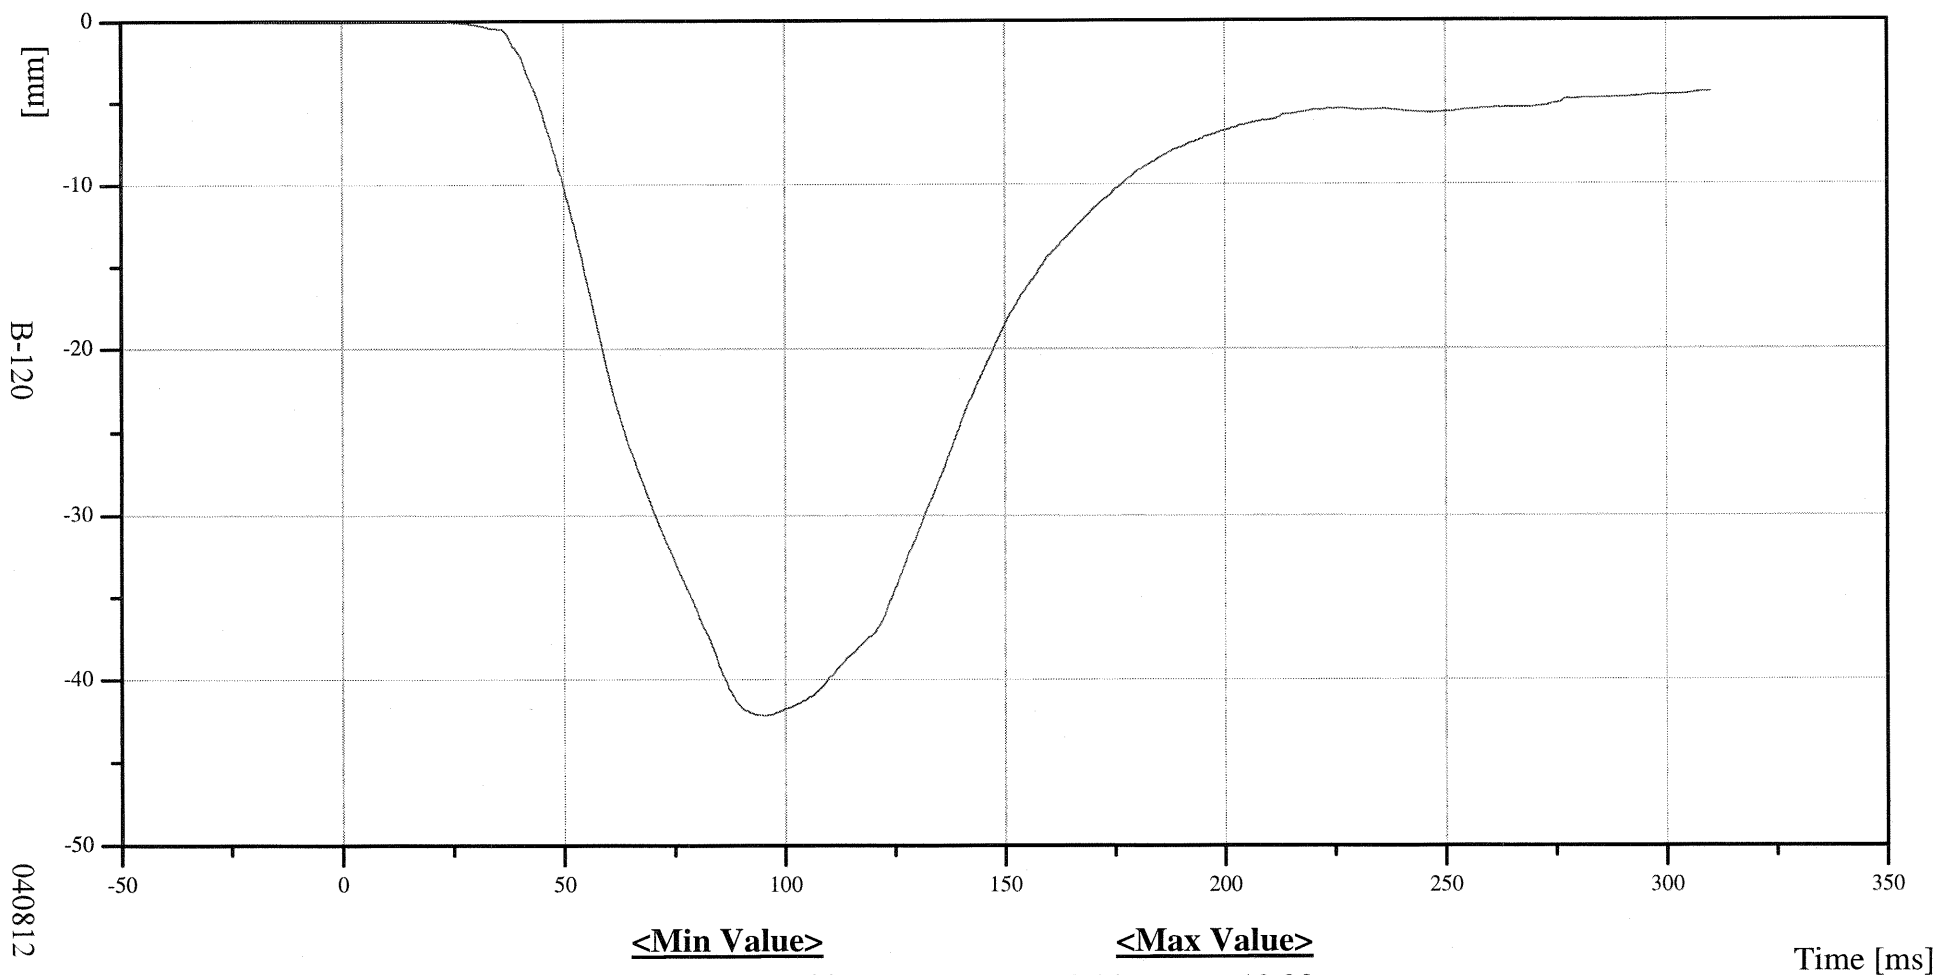

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Accel X

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVXG3

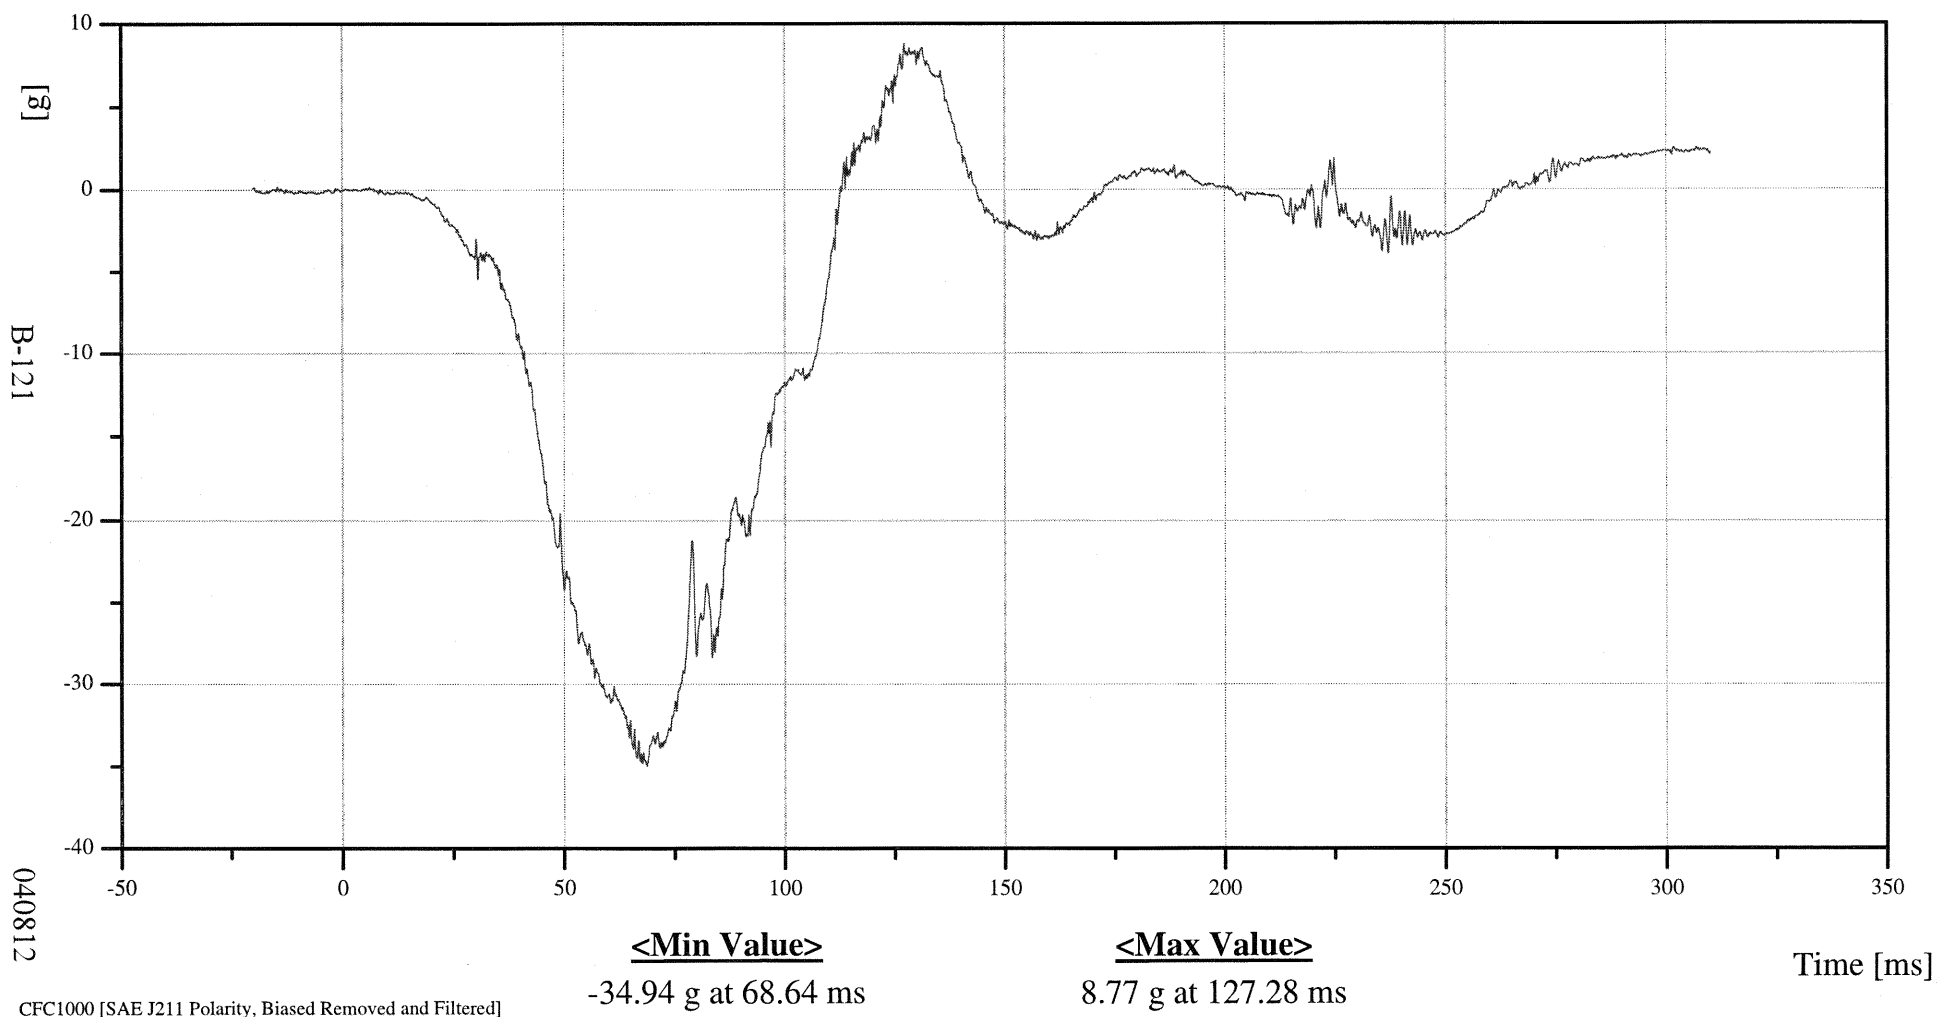



Transportation Research Center, Inc.

Pelvis Accel Y

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVYG3

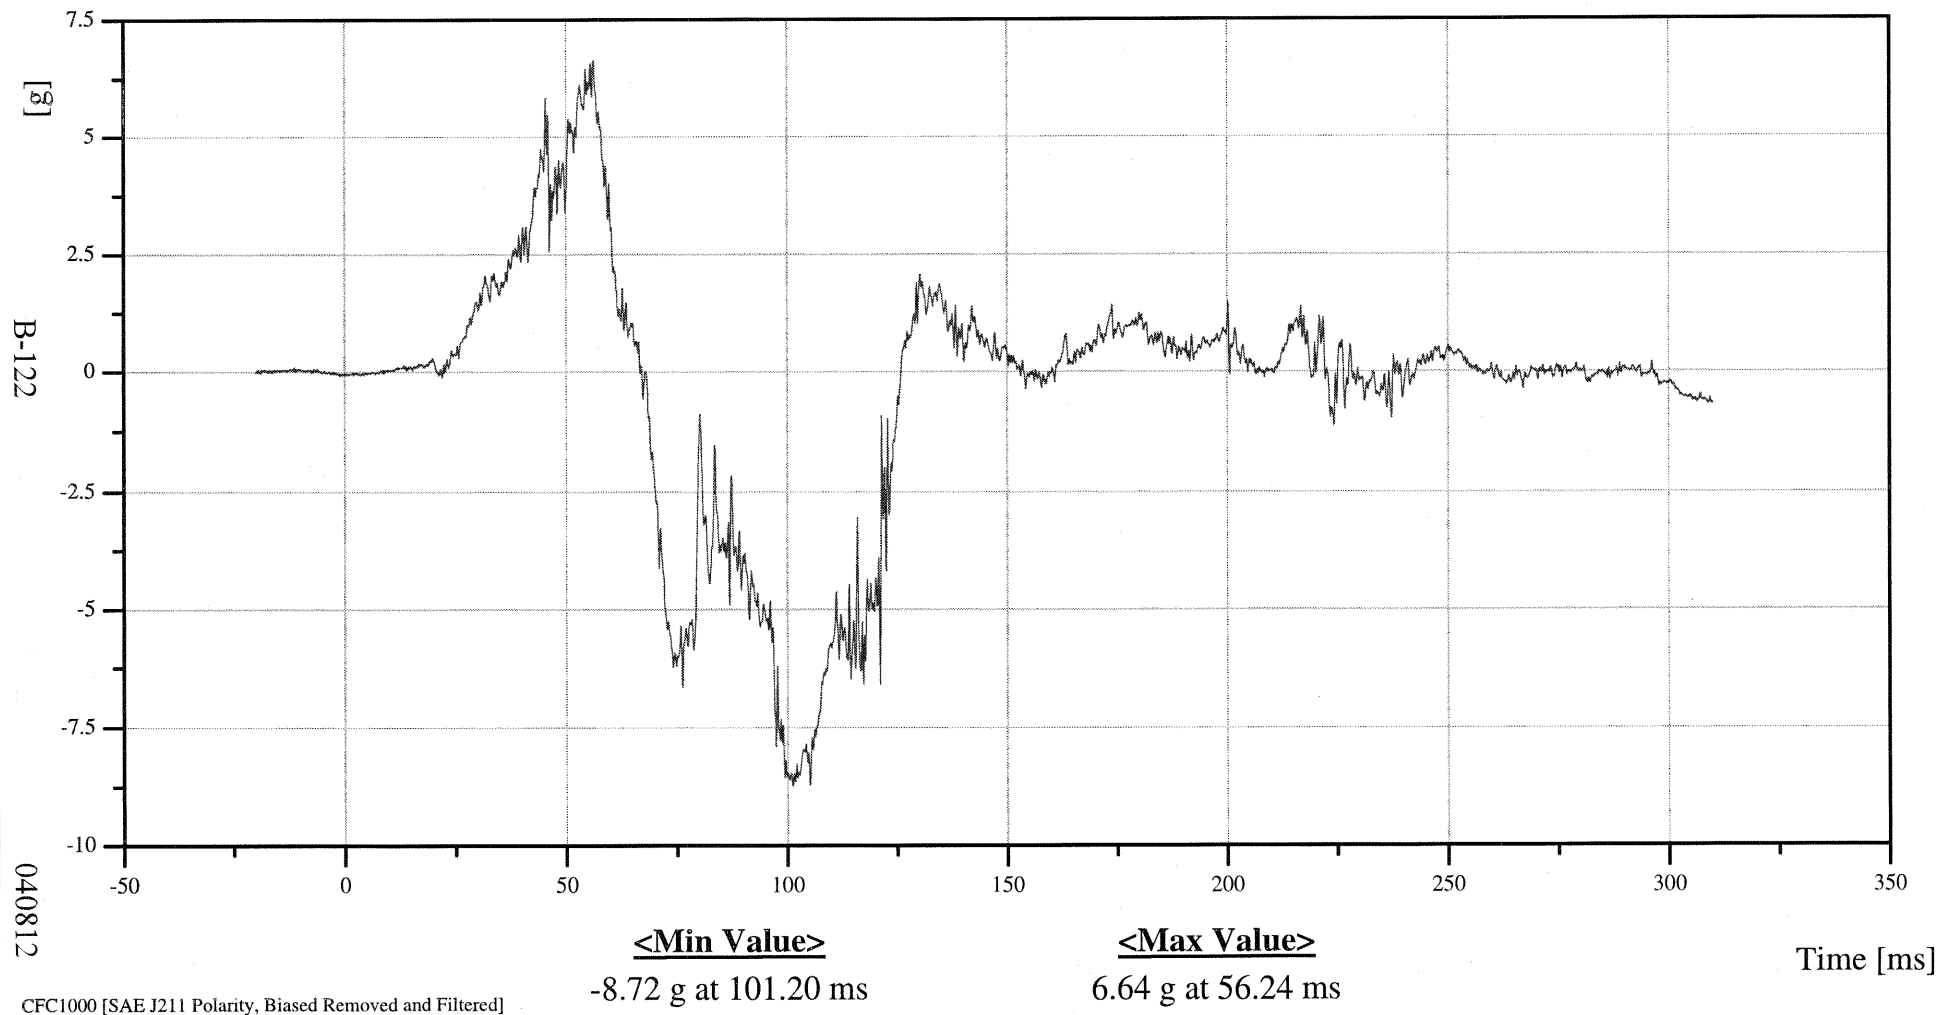



Transportation Research Center, Inc.

Pelvis Accel Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVZG3

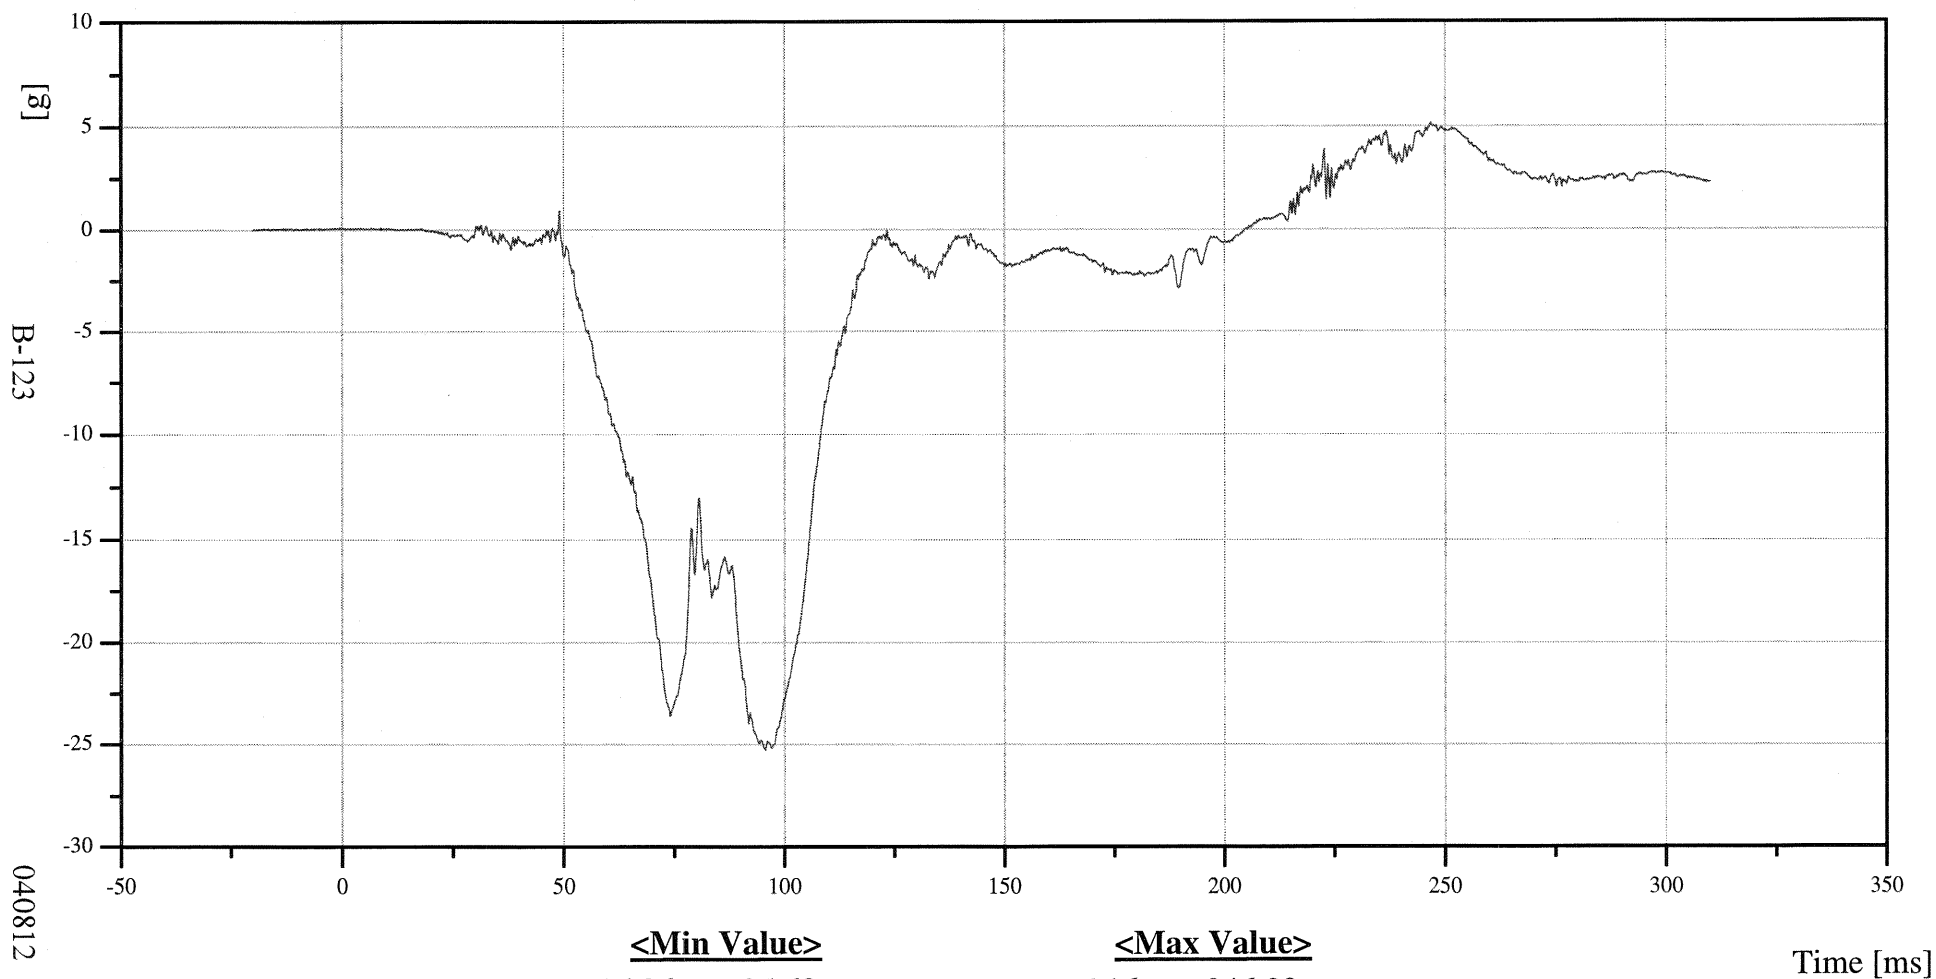

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Pelvis Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PEVRG3

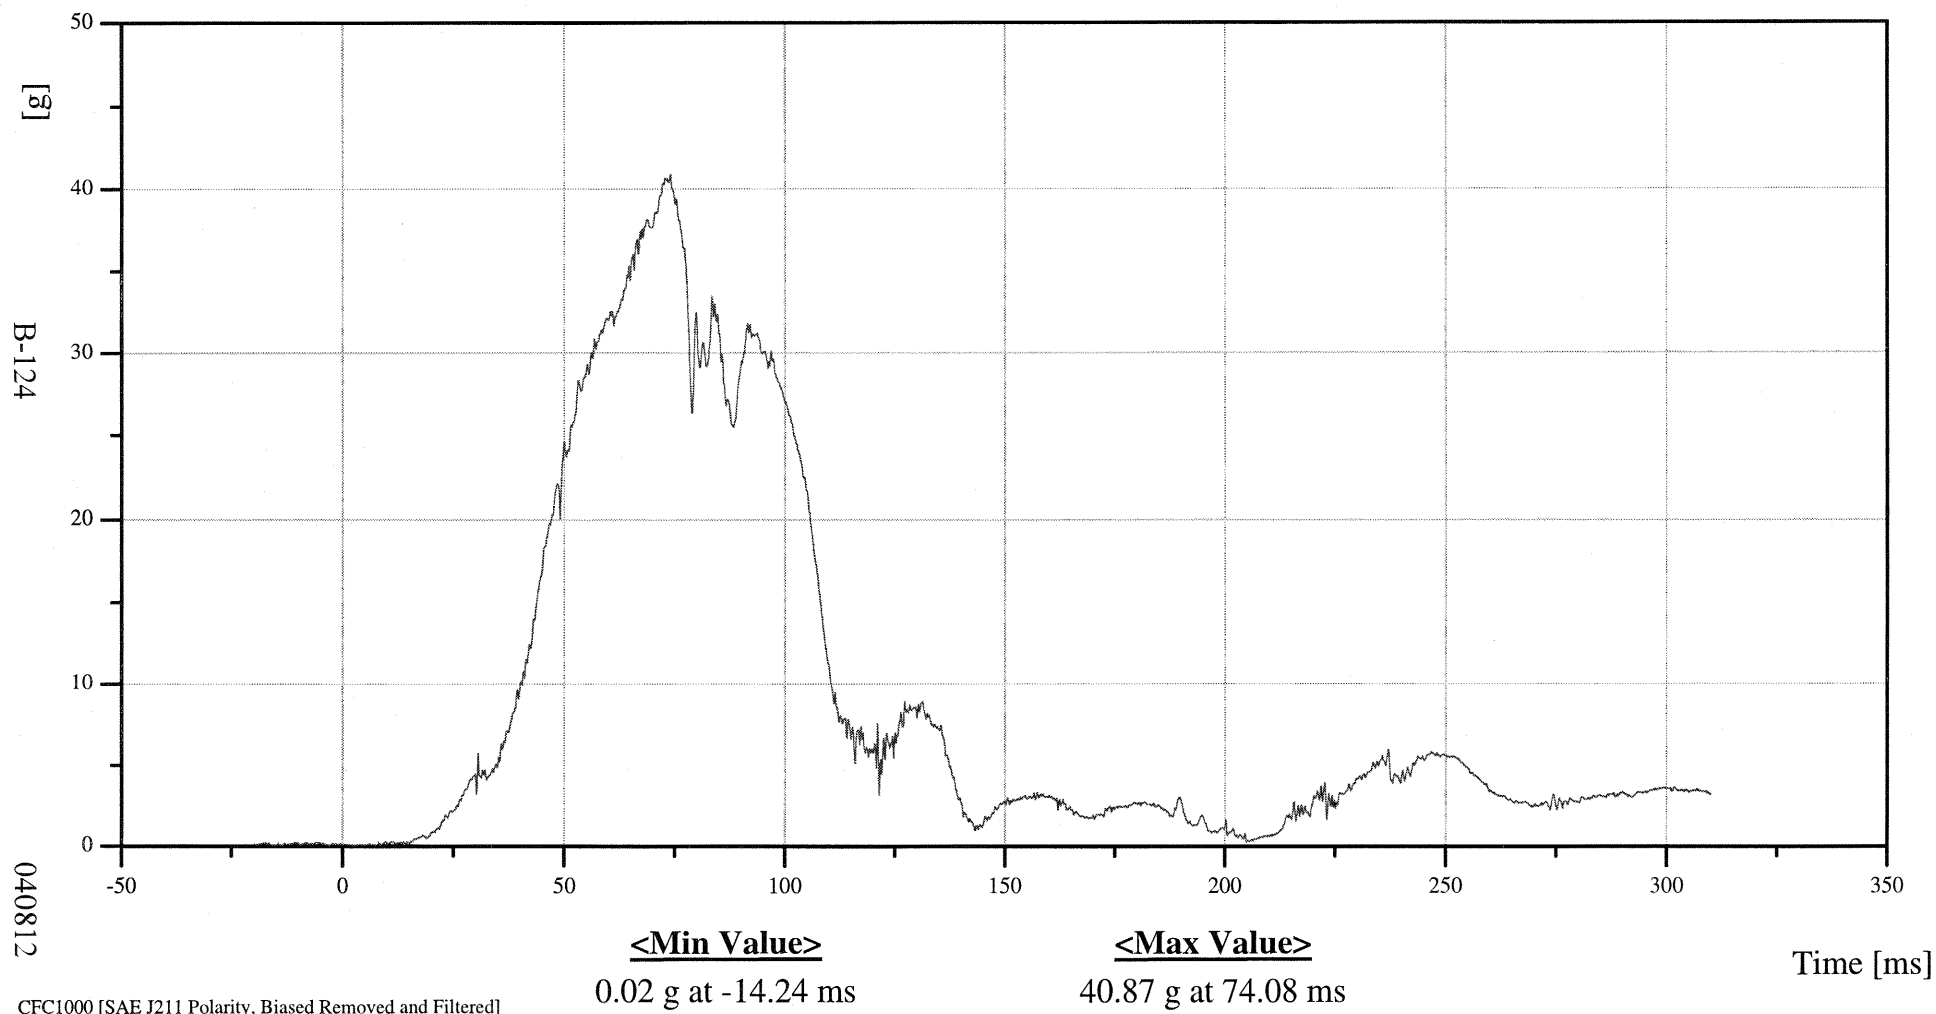



Transportation Research Center, Inc.

Left Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LFMZ F3

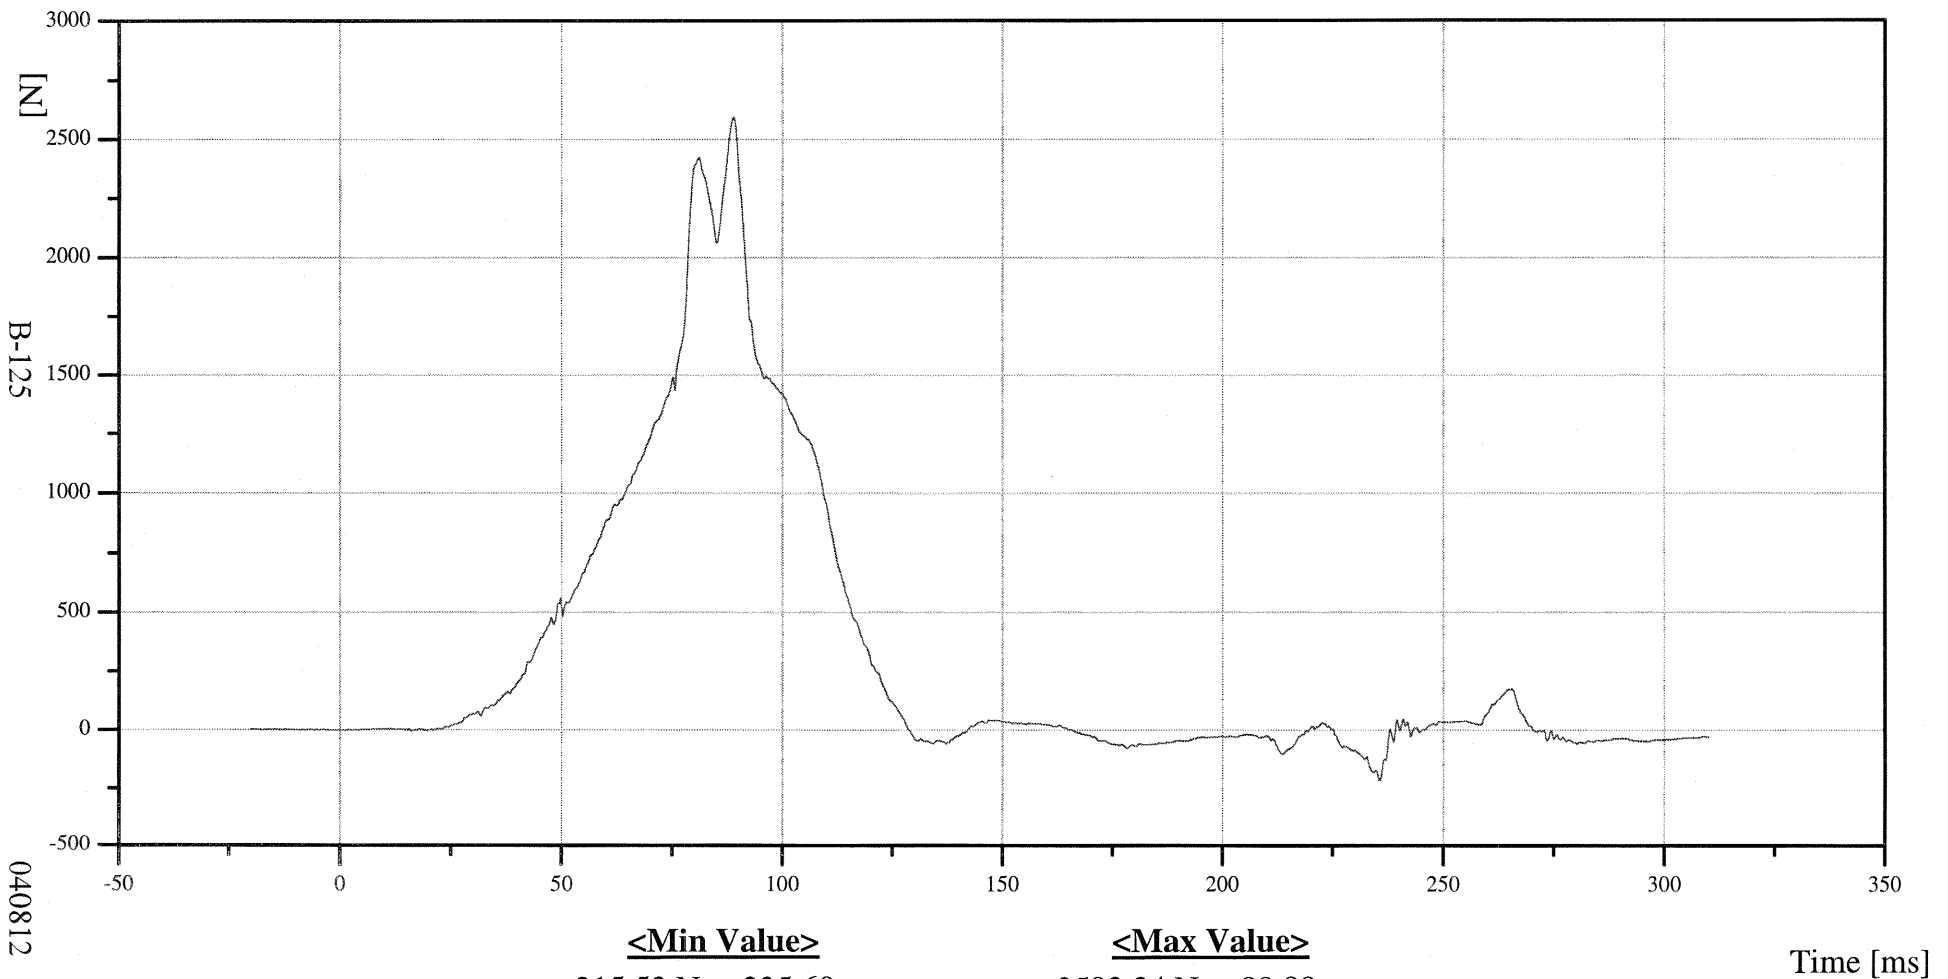

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right Femur Force Z

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RFMZ3

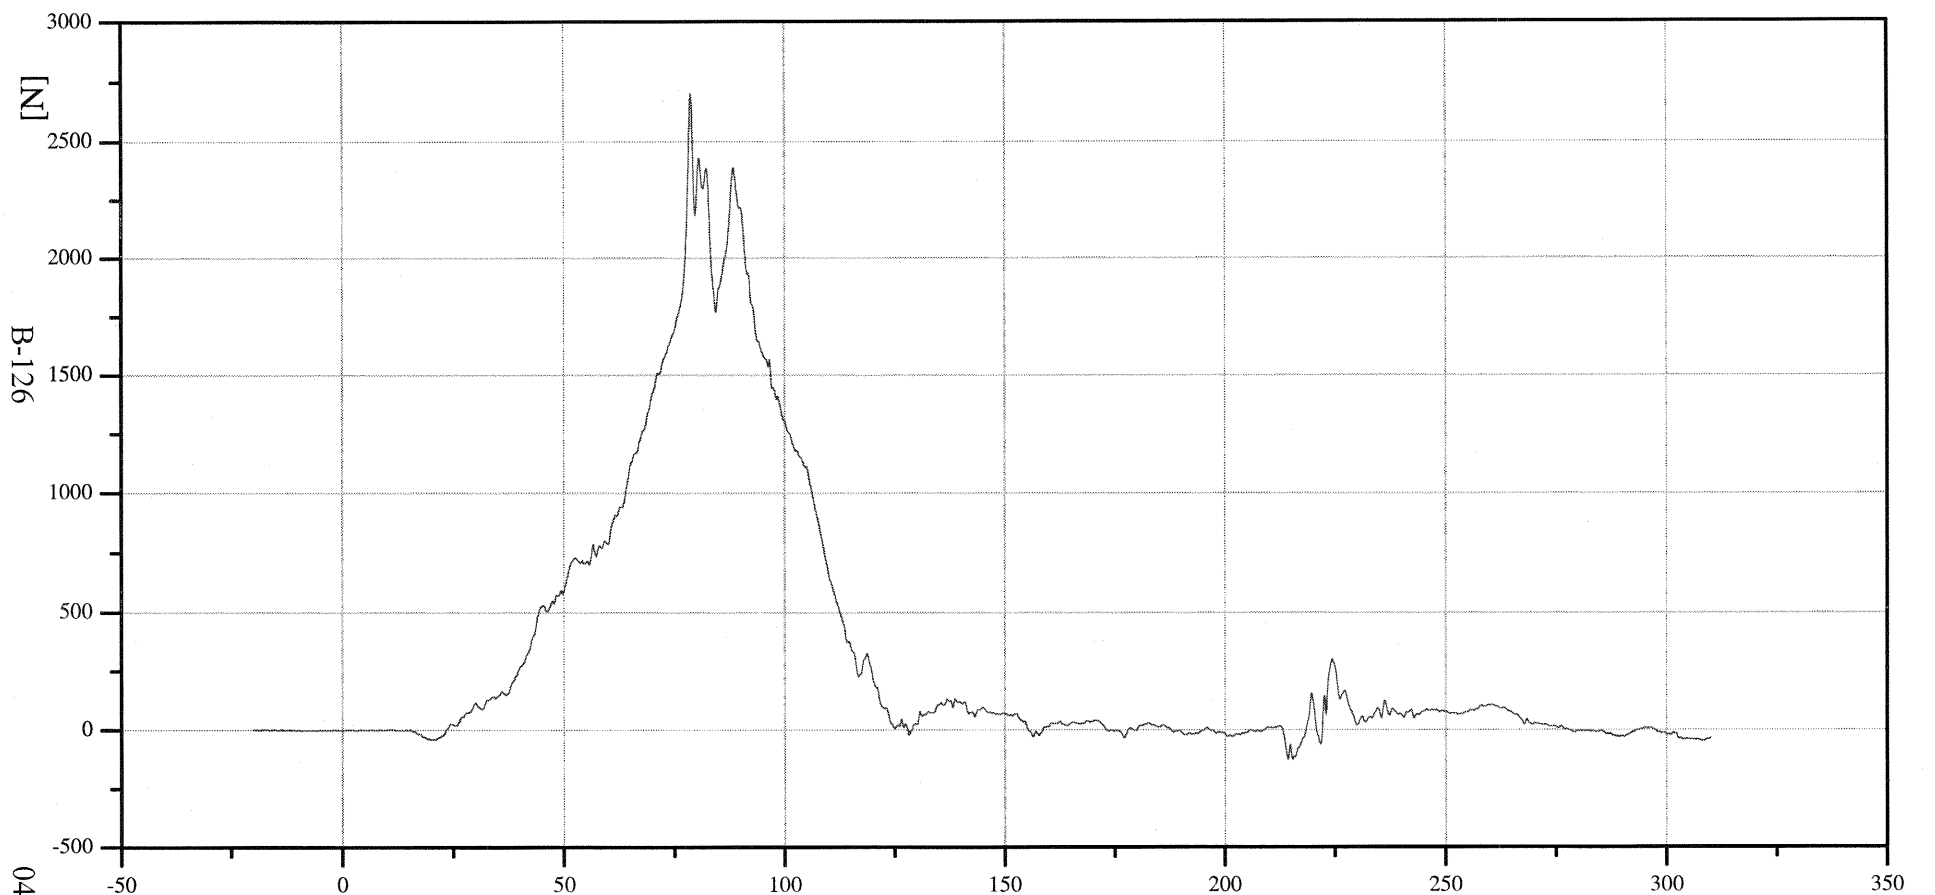

<Min Value>

-125.96 N at 215.36 ms

<Max Value>

2701.26 N at 78.80 ms

Time [ms]

CFC600 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Left RR Seat X-member X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LSXXG

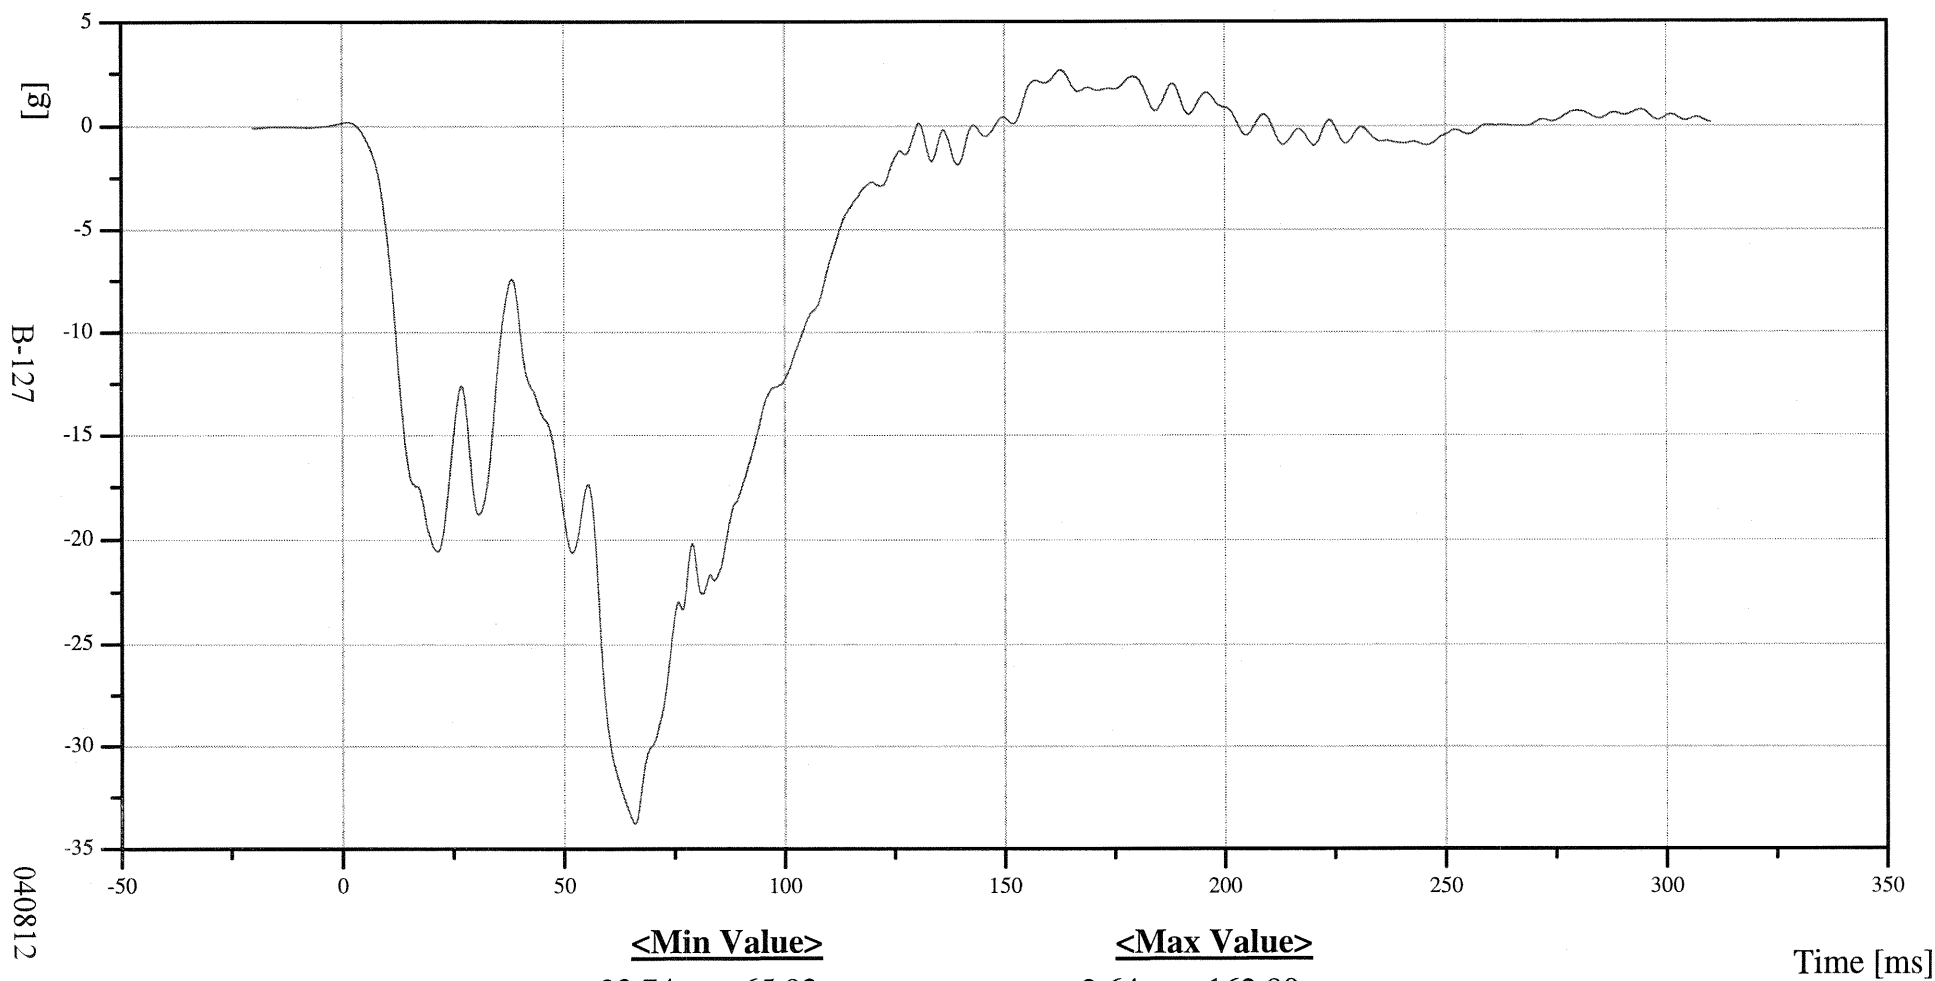

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right RR Seat X-member X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RSXXG

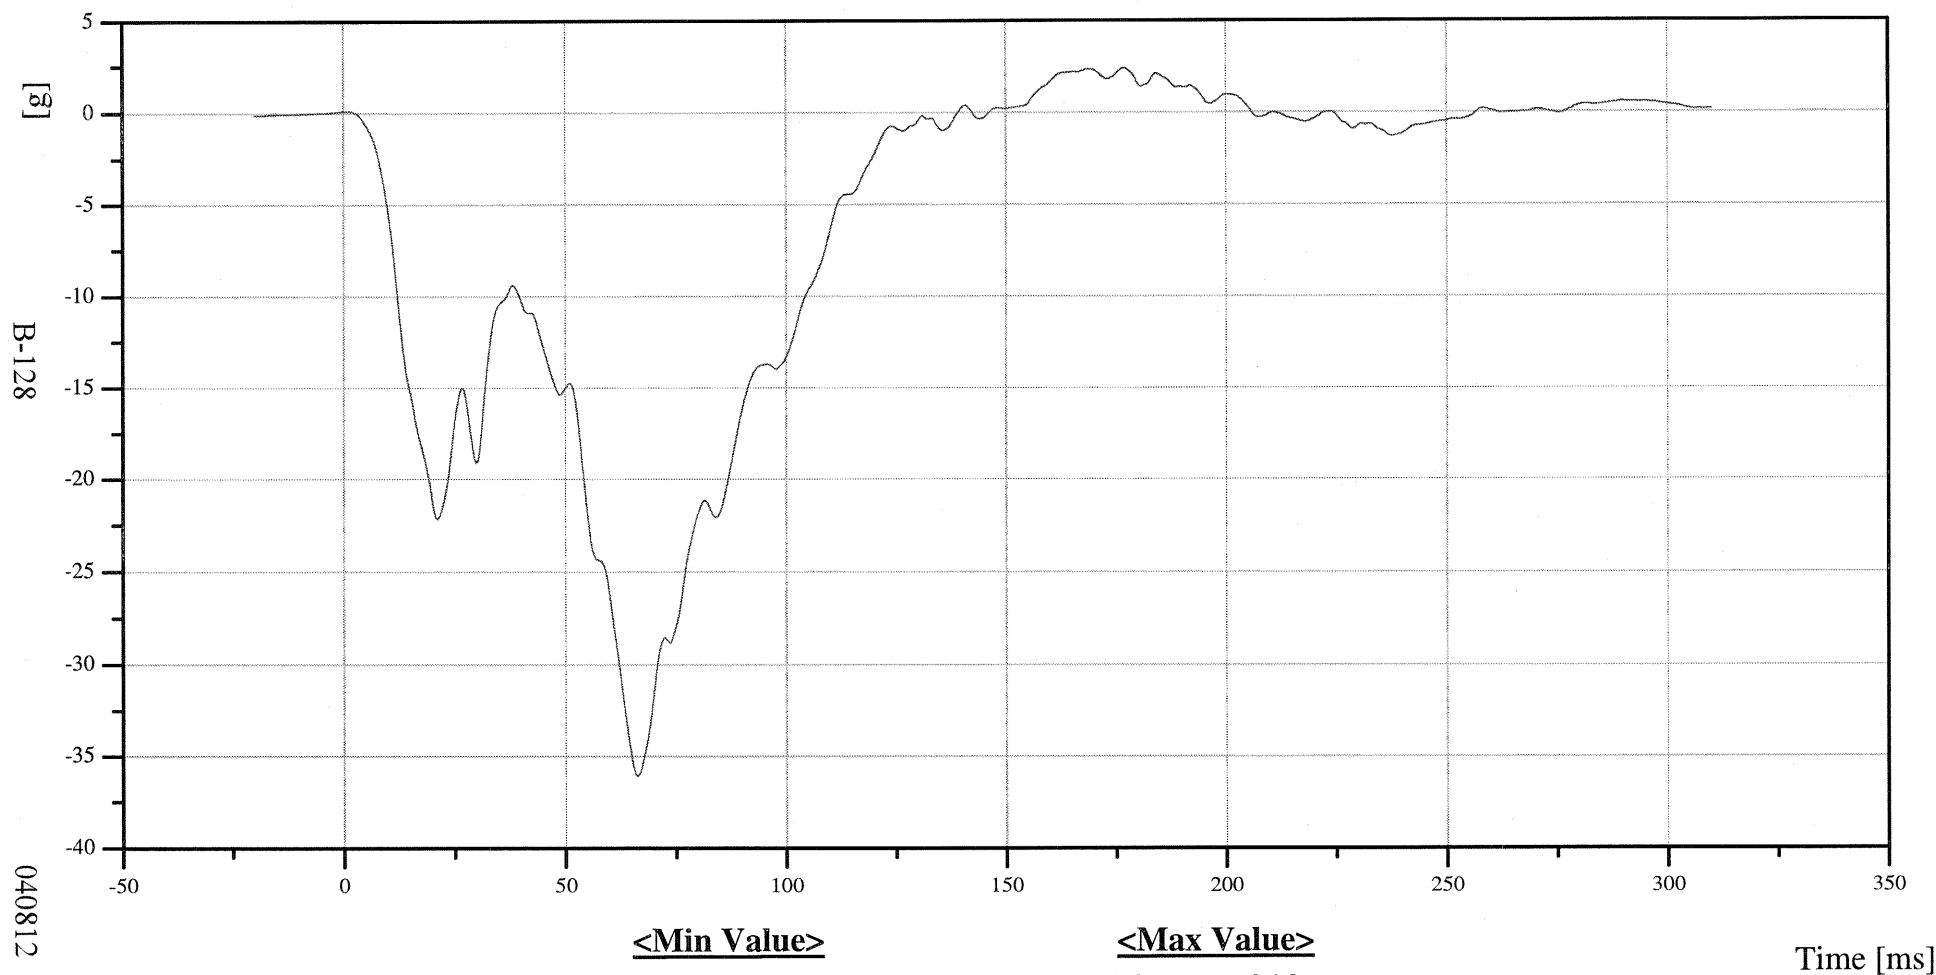

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Top Engine X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

TENXG

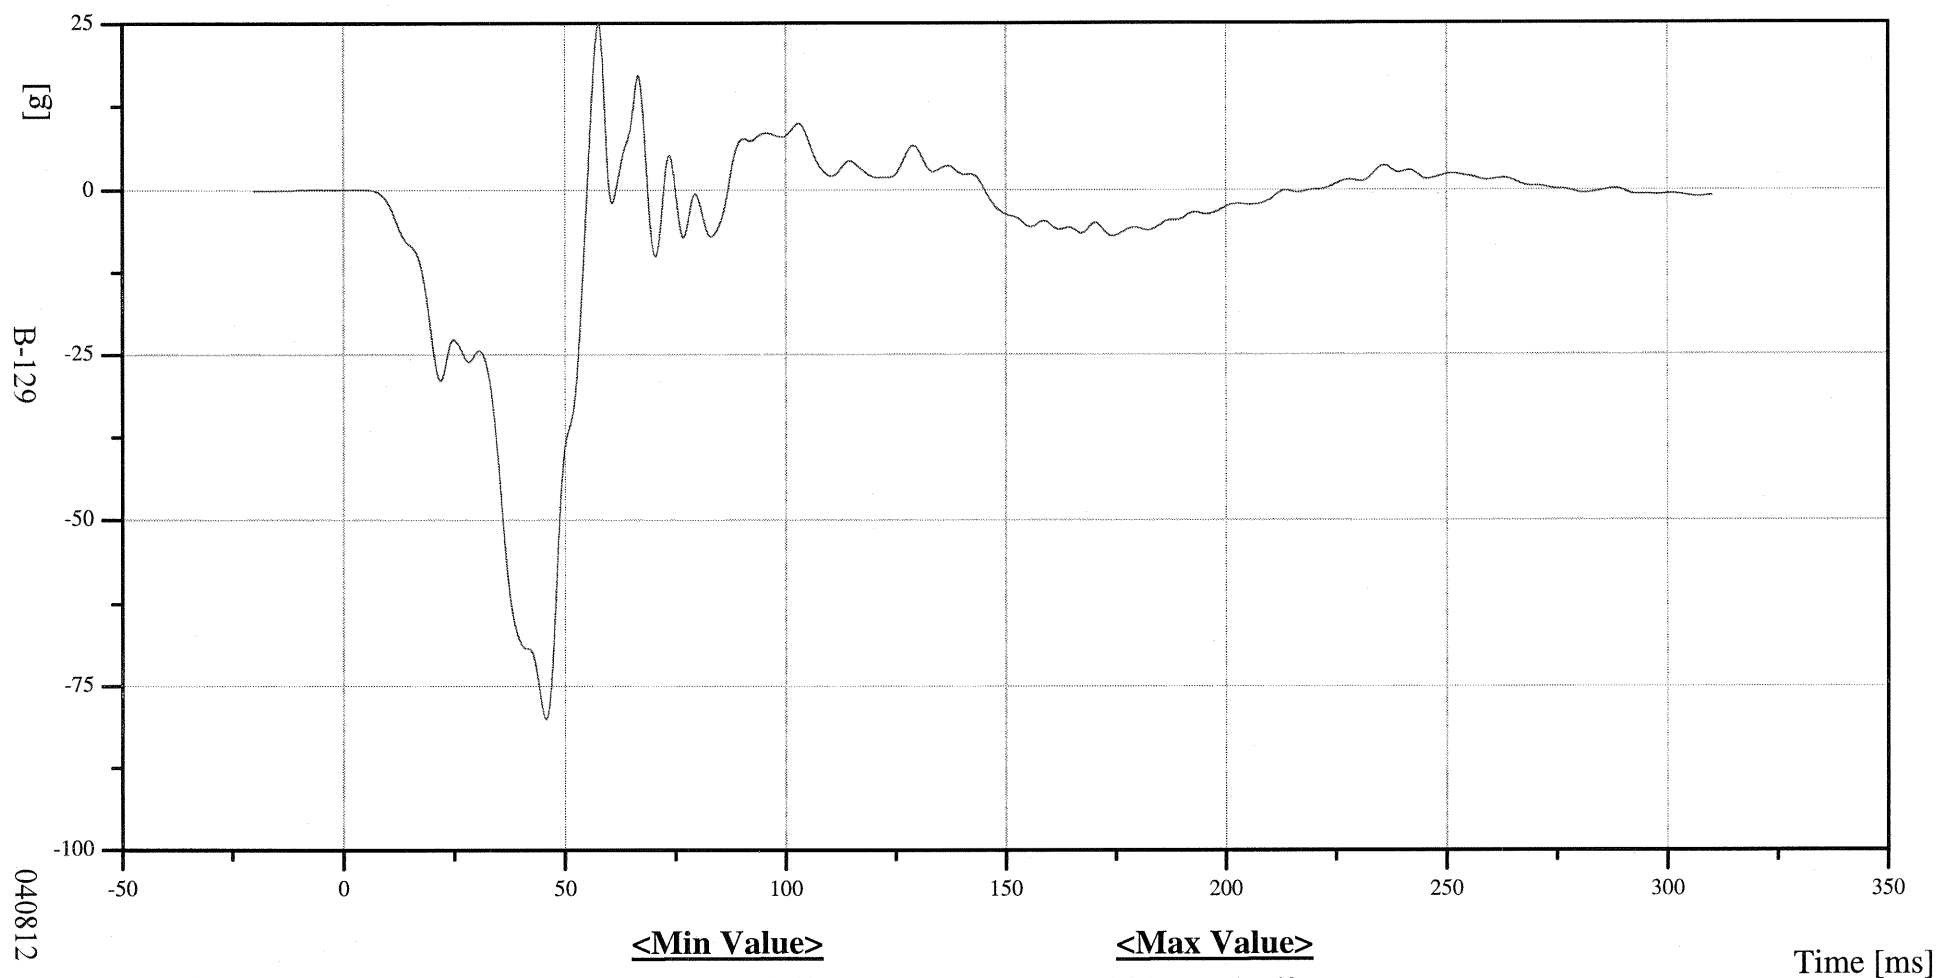

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Bottom Engine X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

BENXG

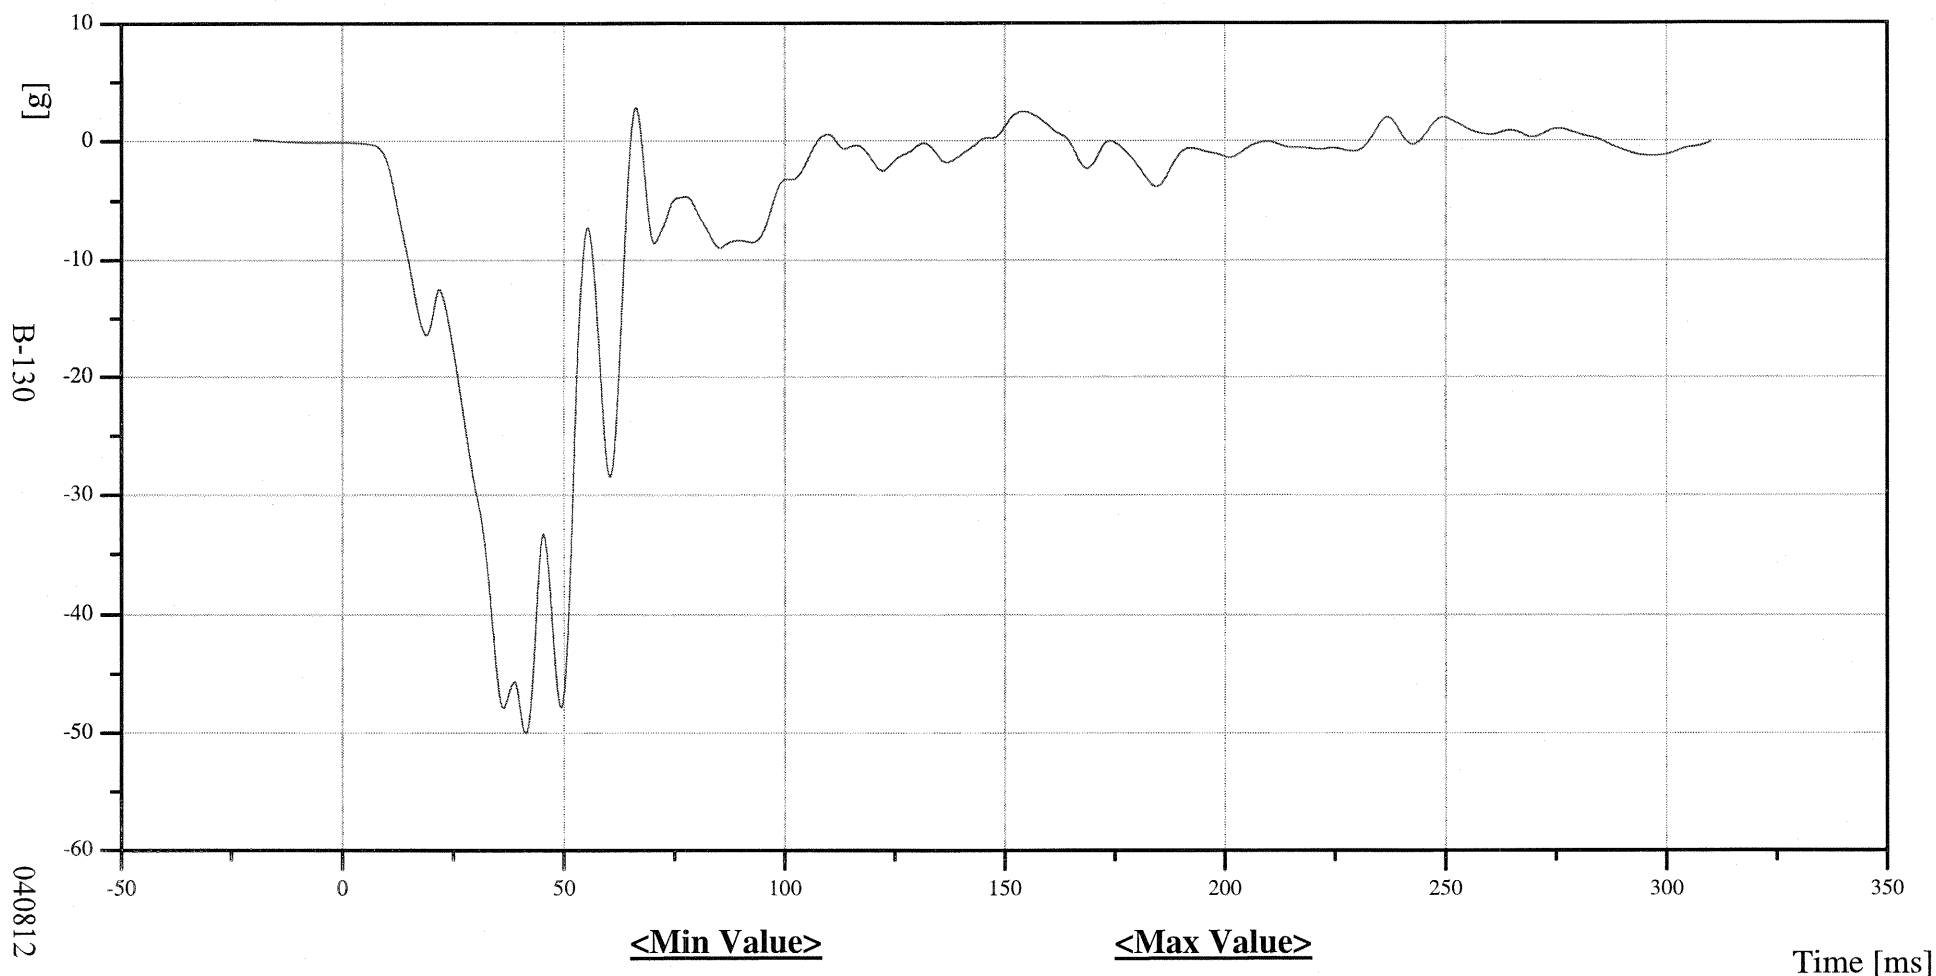

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Right FR Brake Caliper X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RFCXG

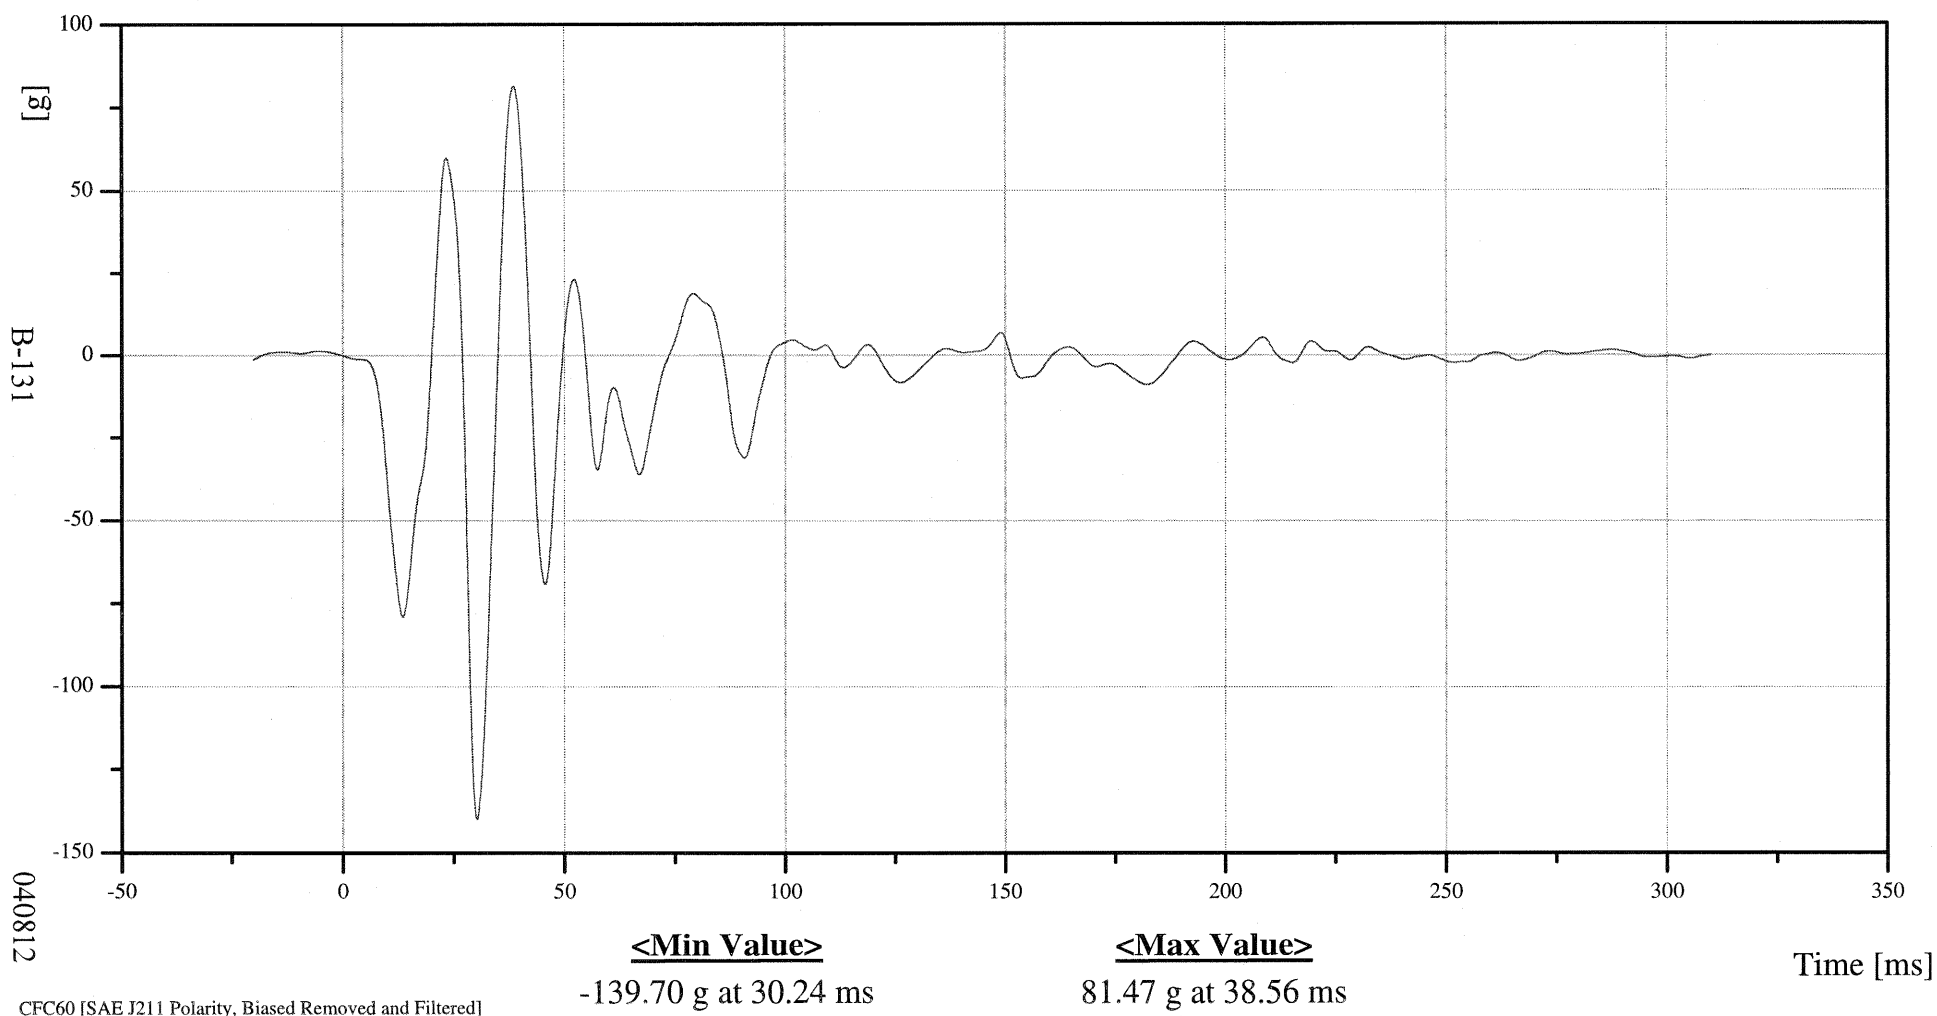



Transportation Research Center, Inc.

Left FR Brake Caliper X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LFCXG

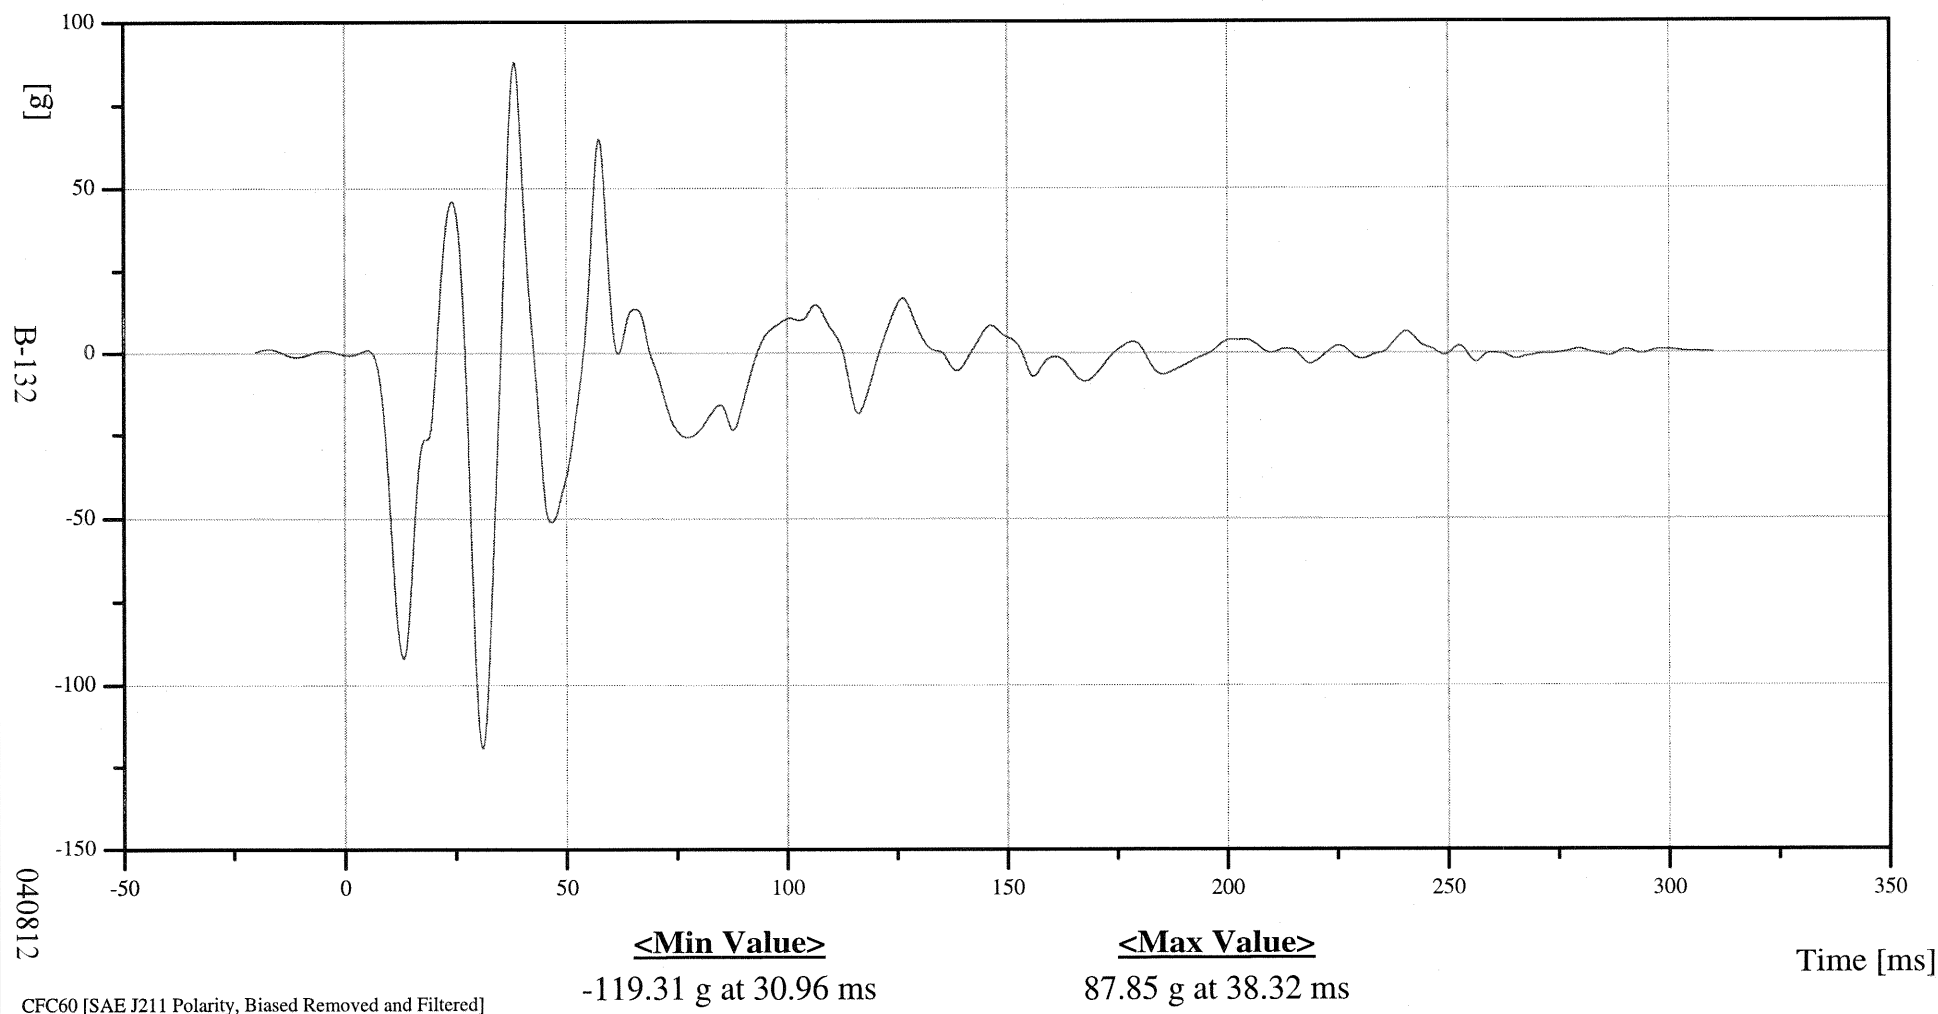



Transportation Research Center, Inc.

Instrument Panel Top Center X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

DPCXG

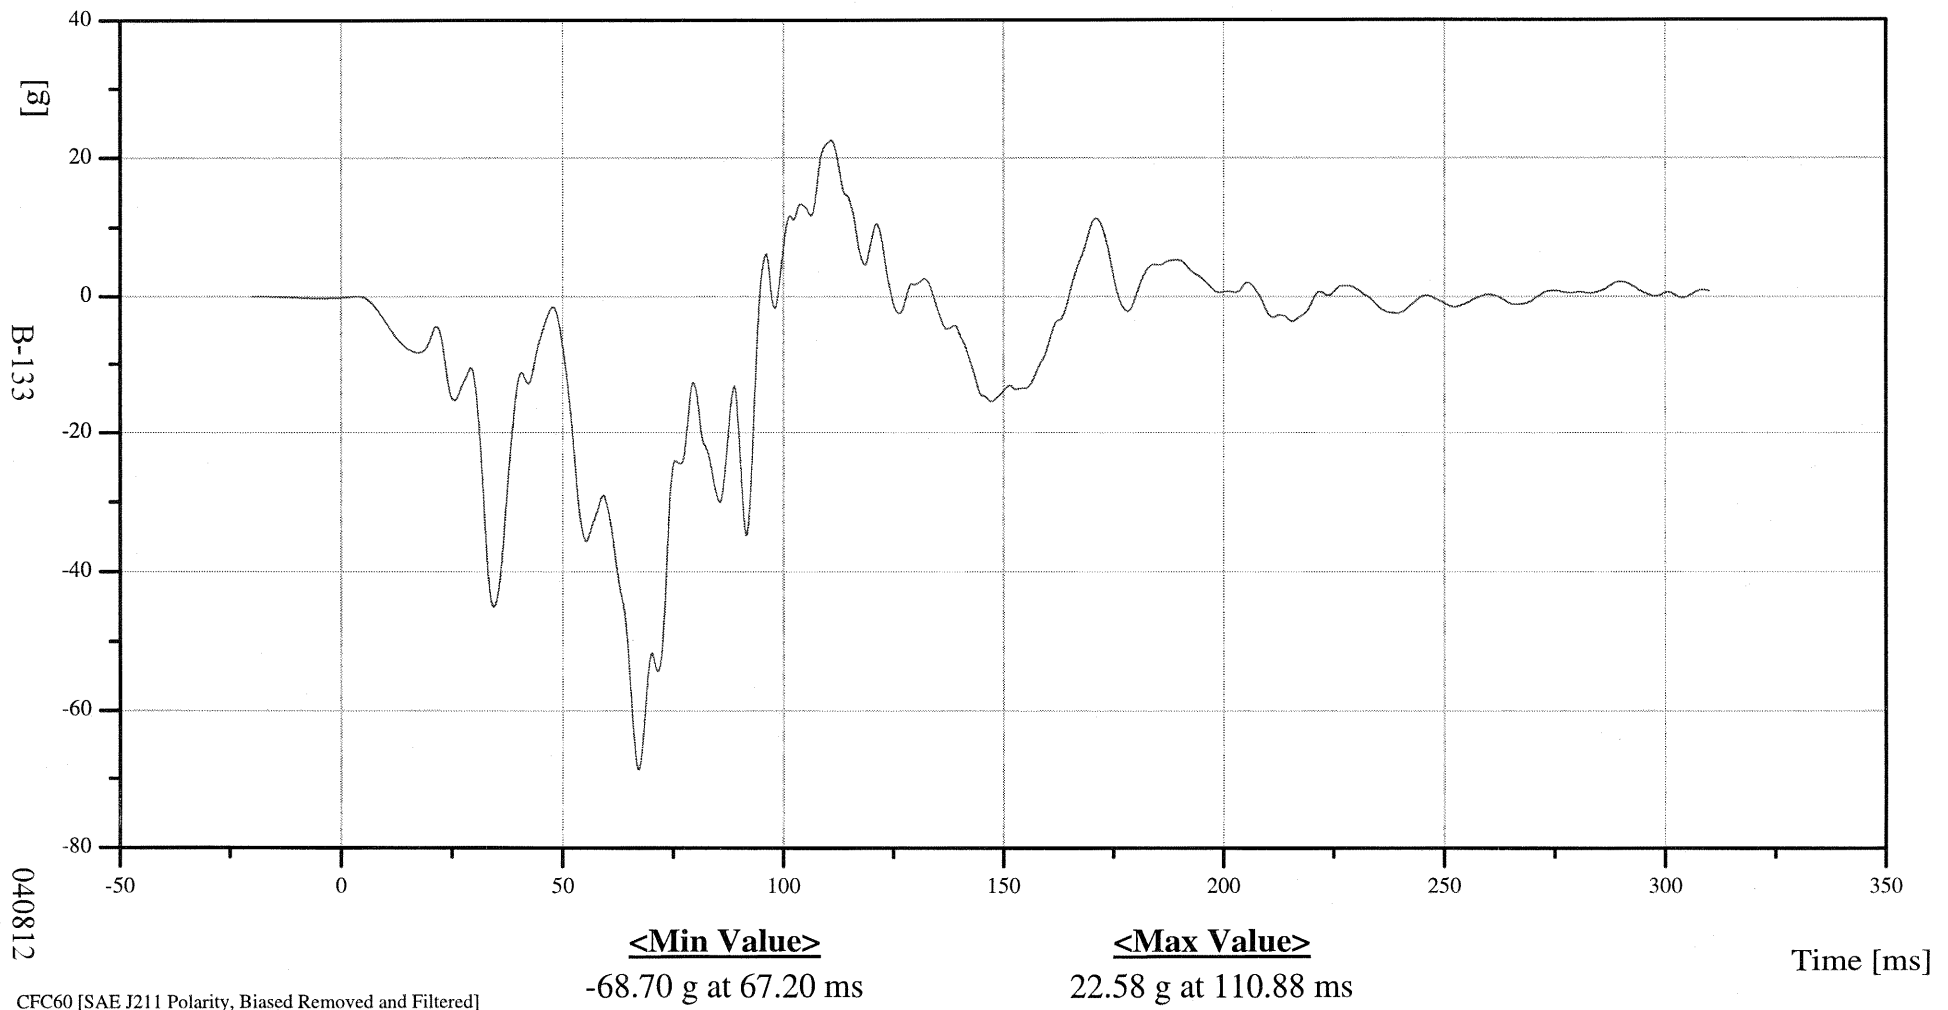



Transportation Research Center, Inc.

Vehicle CG X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

VCGXG

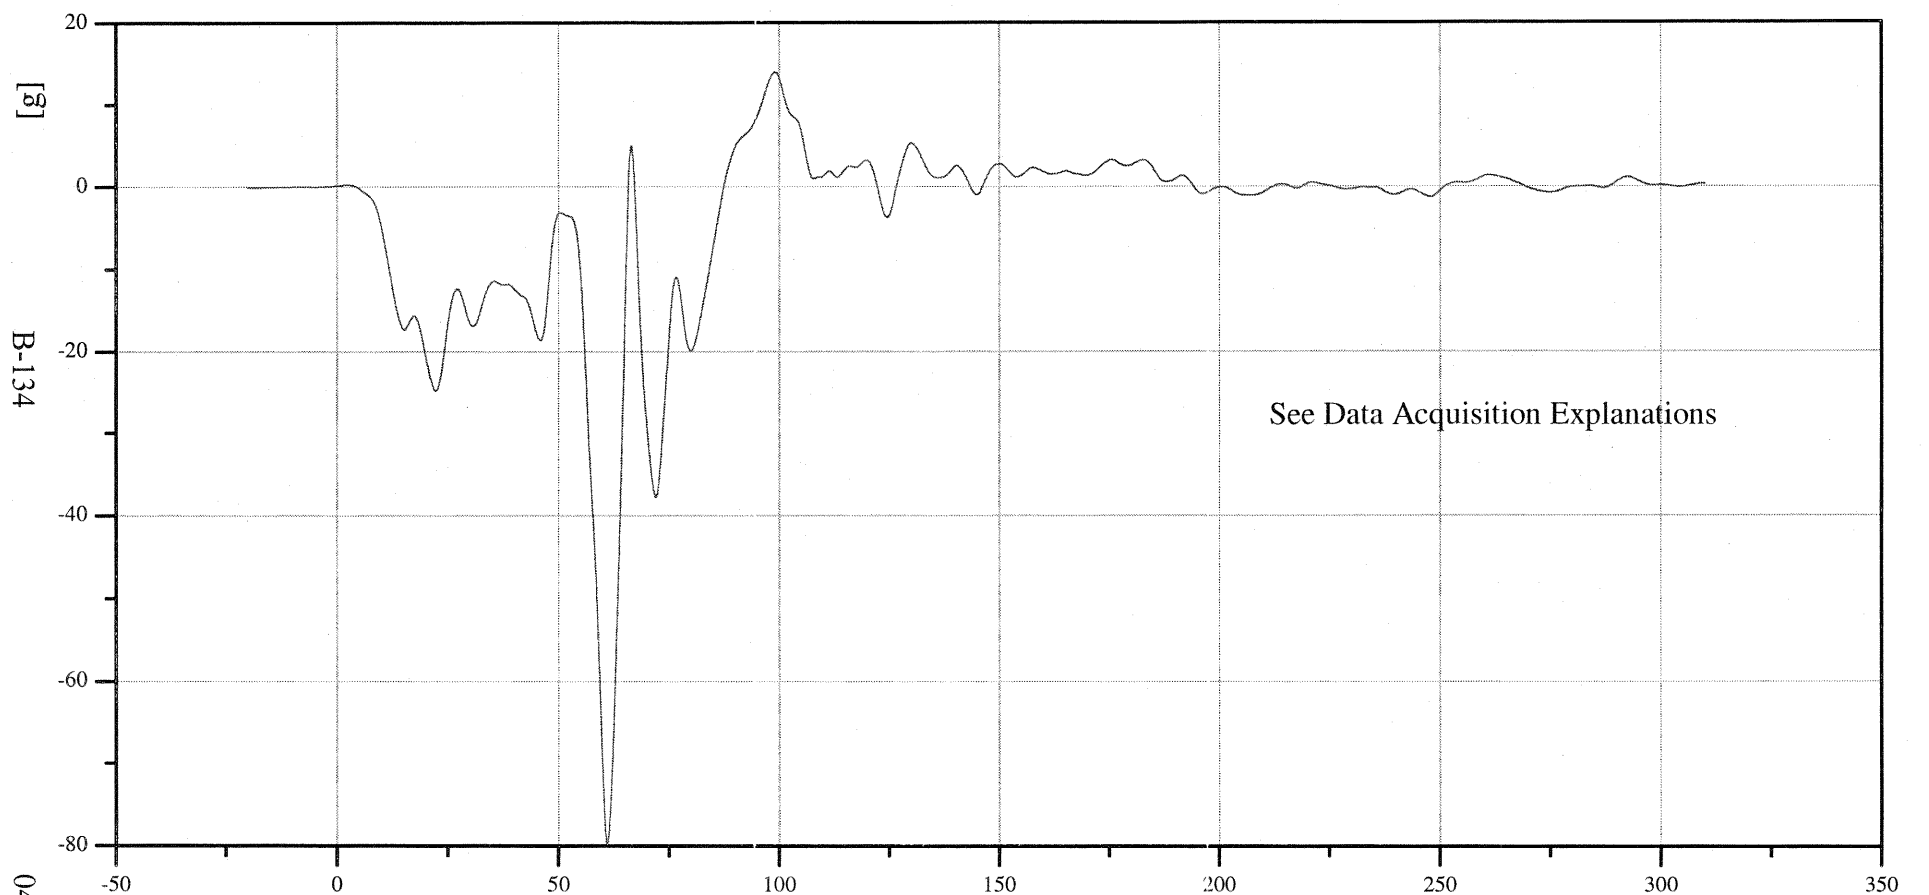

<Min Value>

-79.73 g at 61.04 ms

<Max Value>

13.92 g at 99.12 ms

Time [ms]

040812

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Vehicle CG Y Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

VCGYG

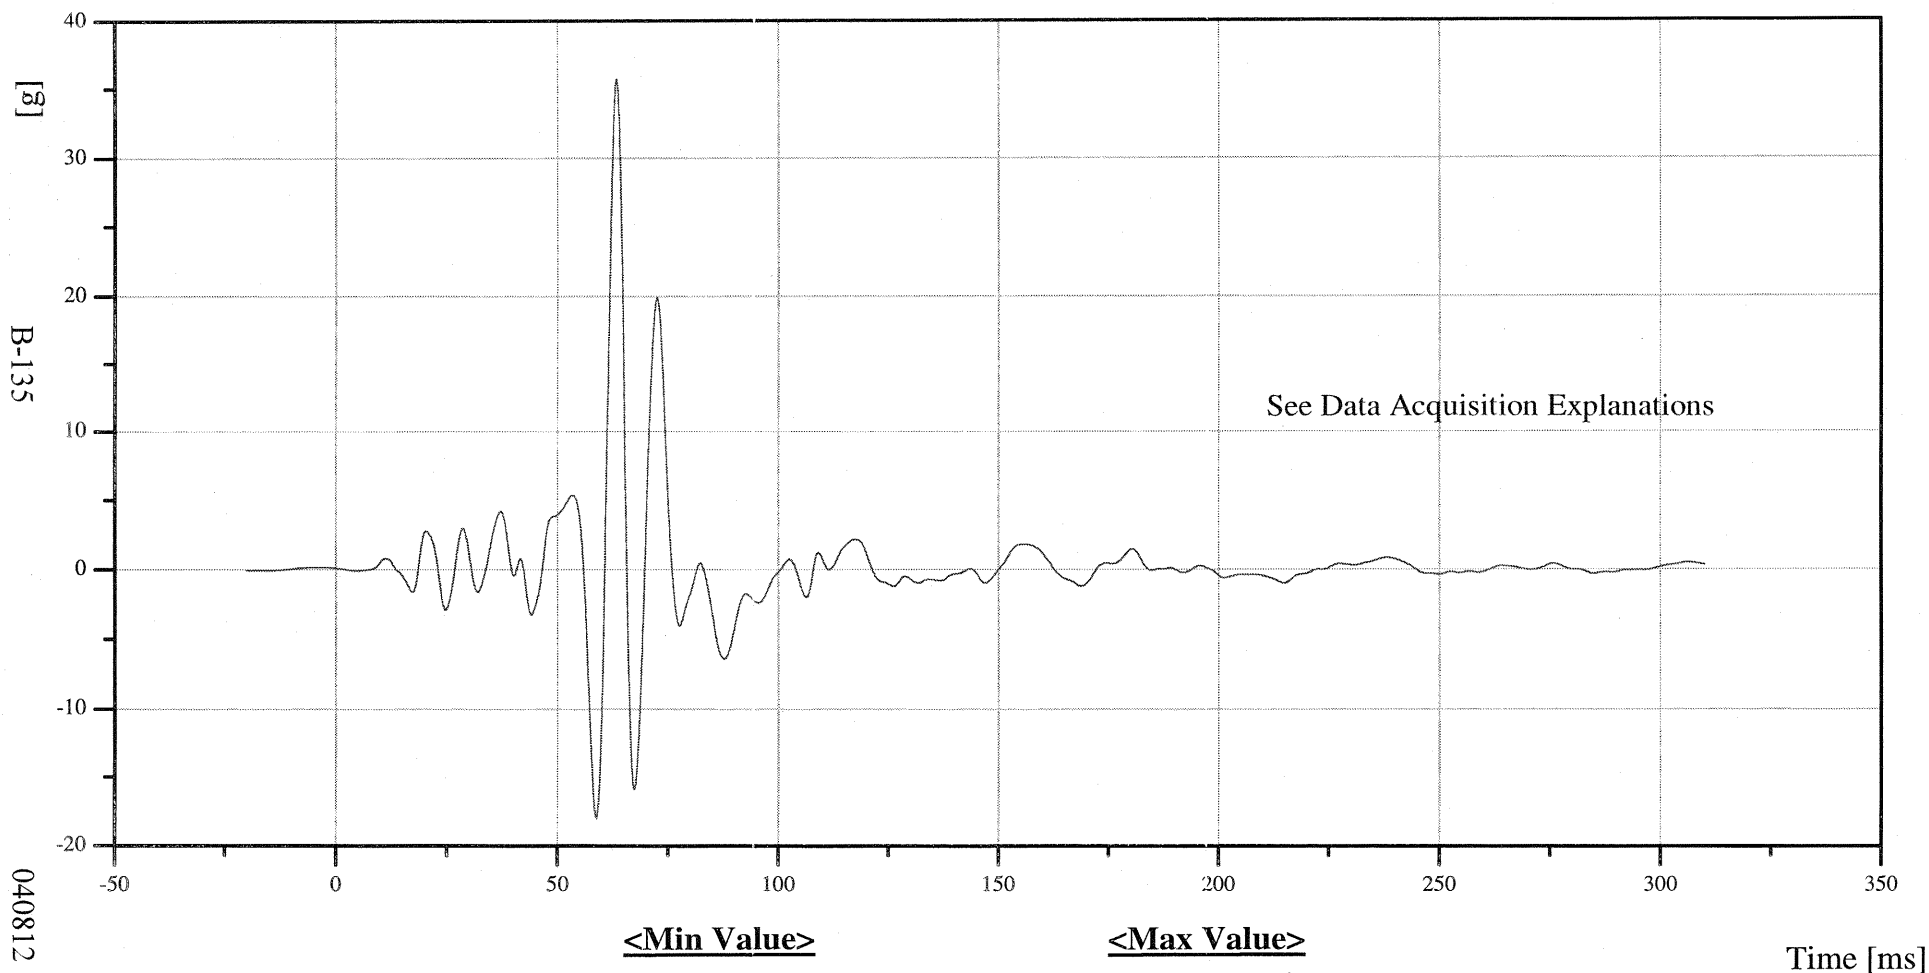

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Vehicle CG Z Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

VCGZG

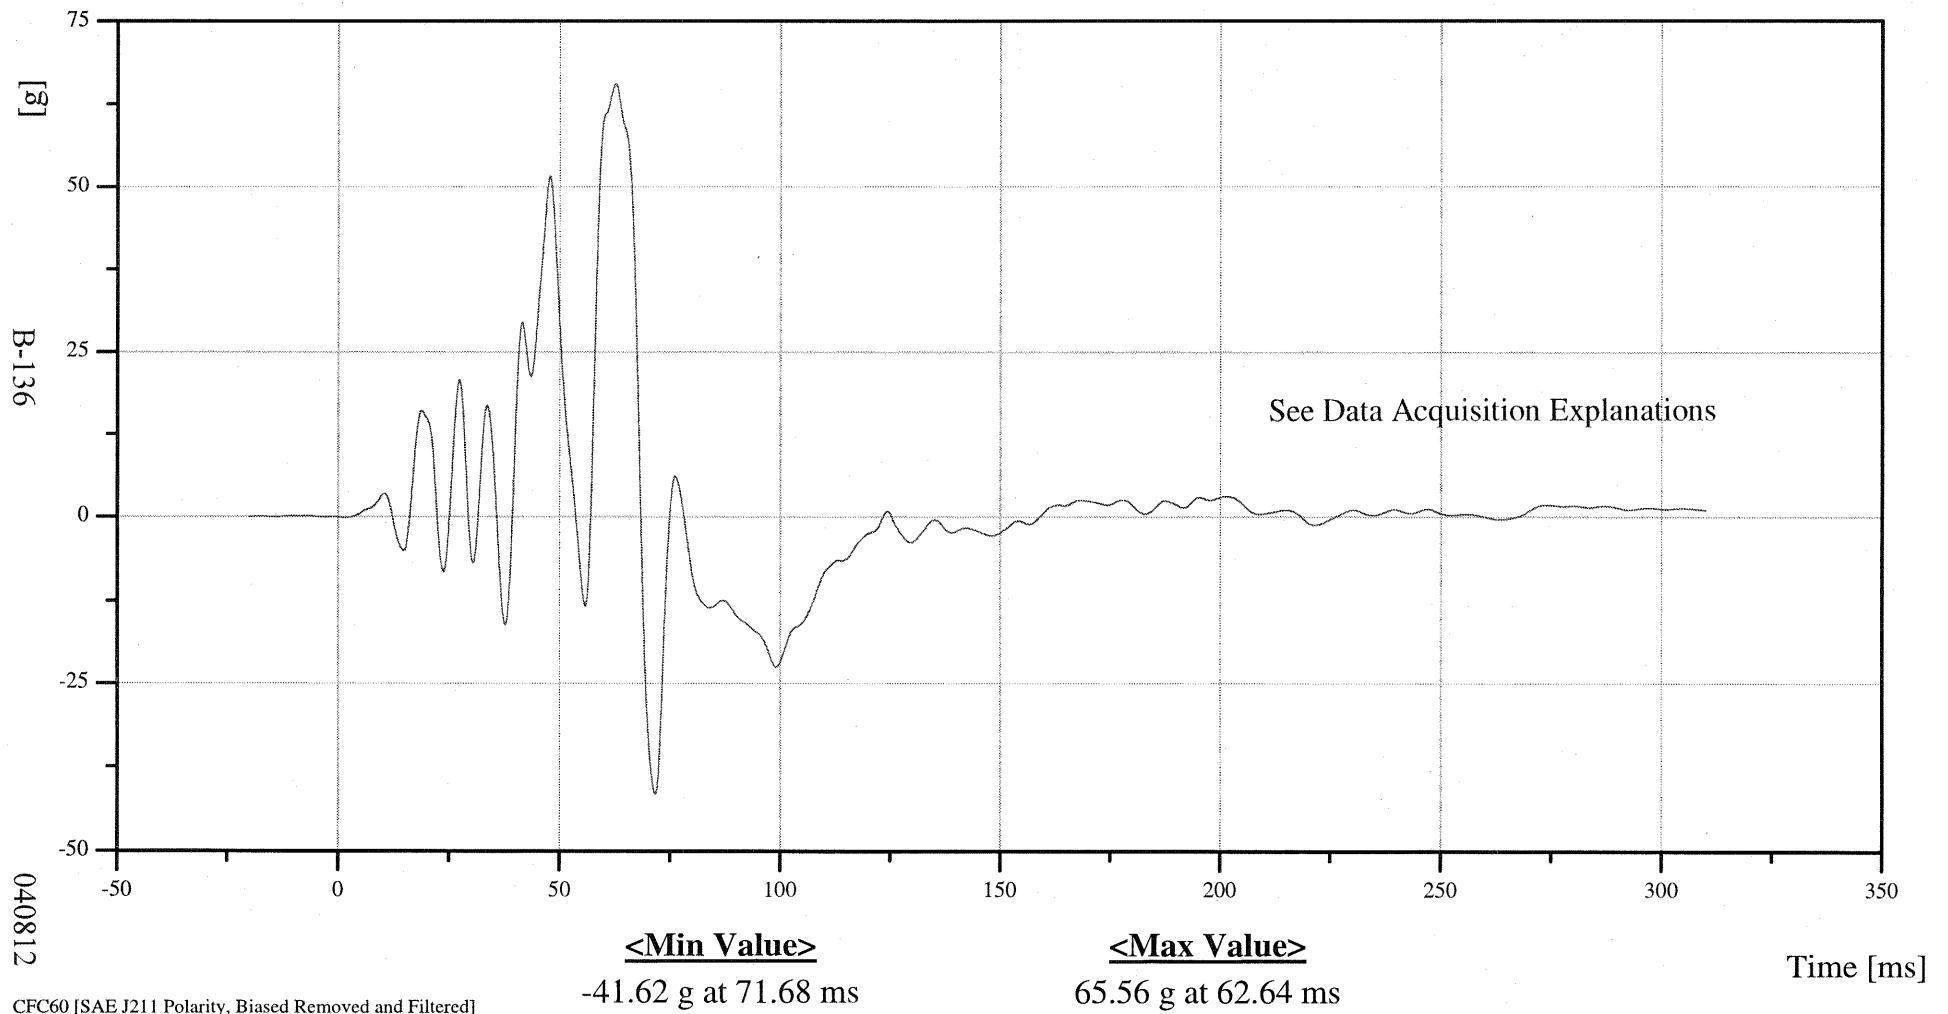



Transportation Research Center, Inc.

Vehicle CG Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

VCGRG

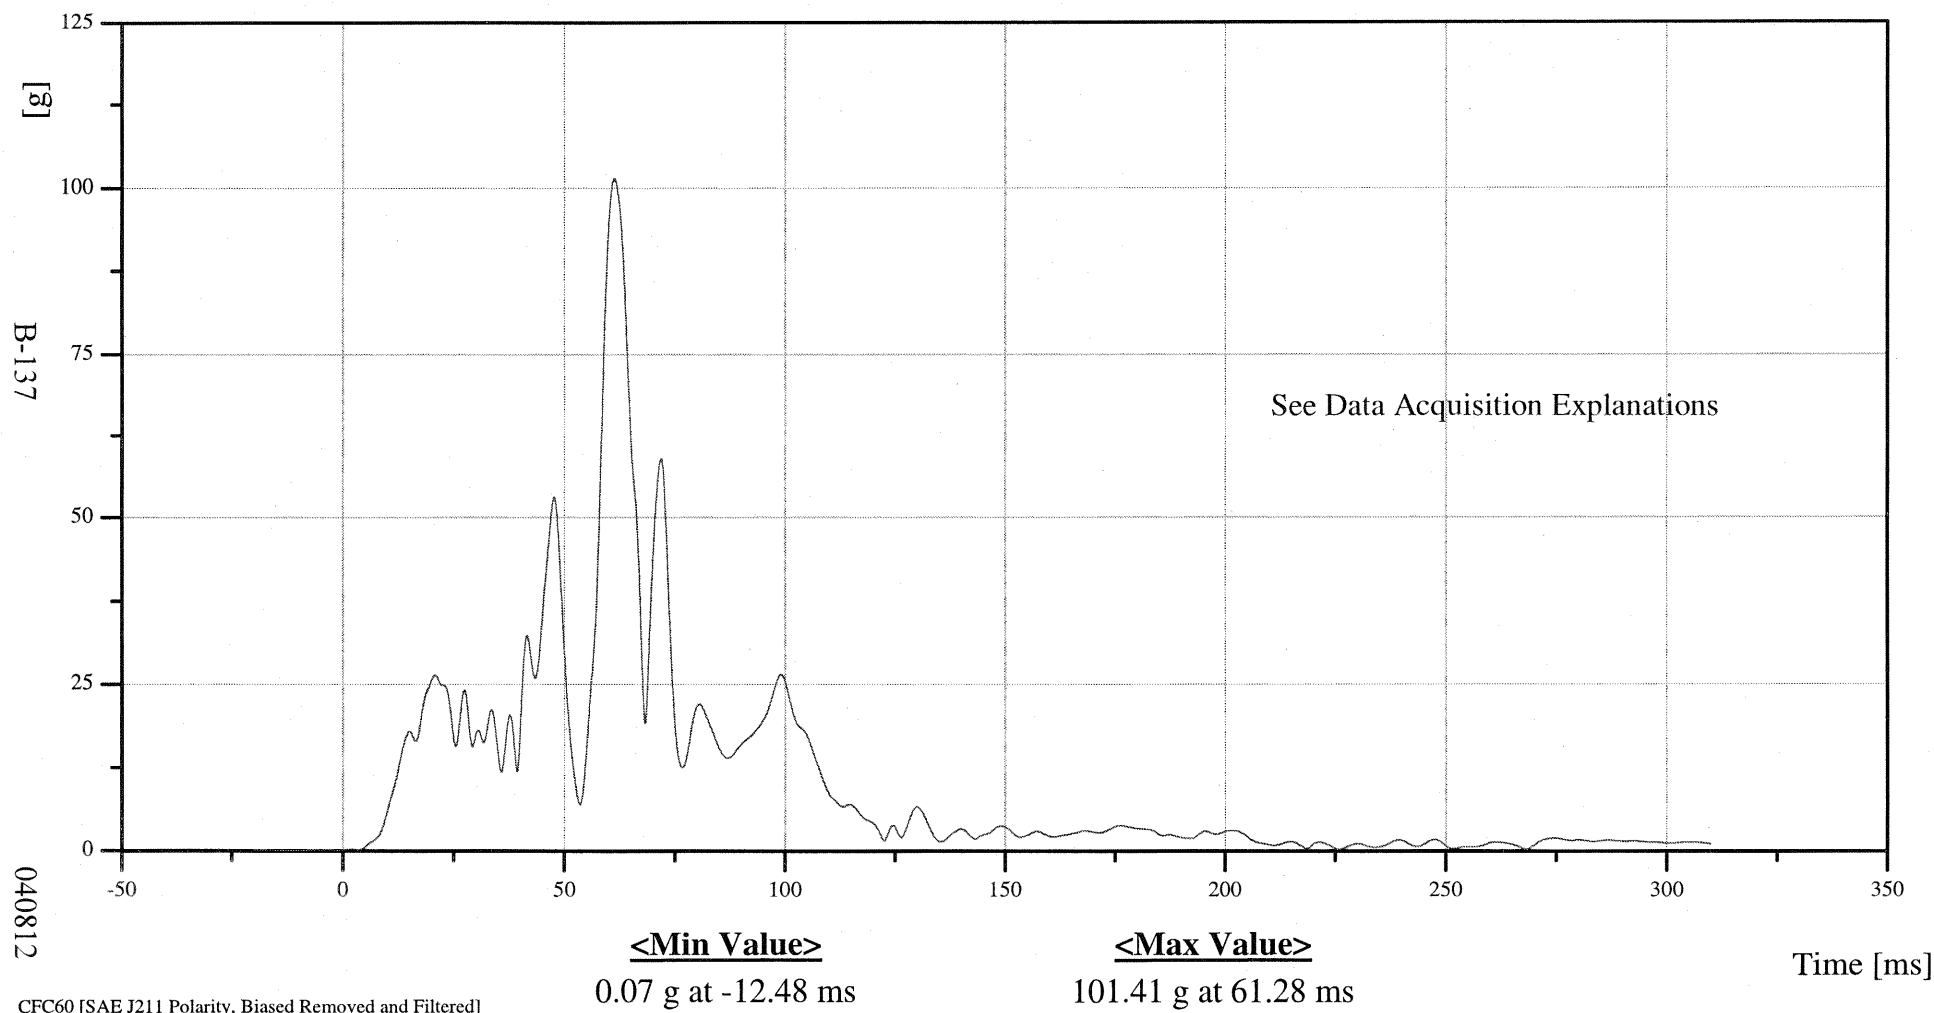



Transportation Research Center, Inc.

Vehicle RR deck X Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RDKXG

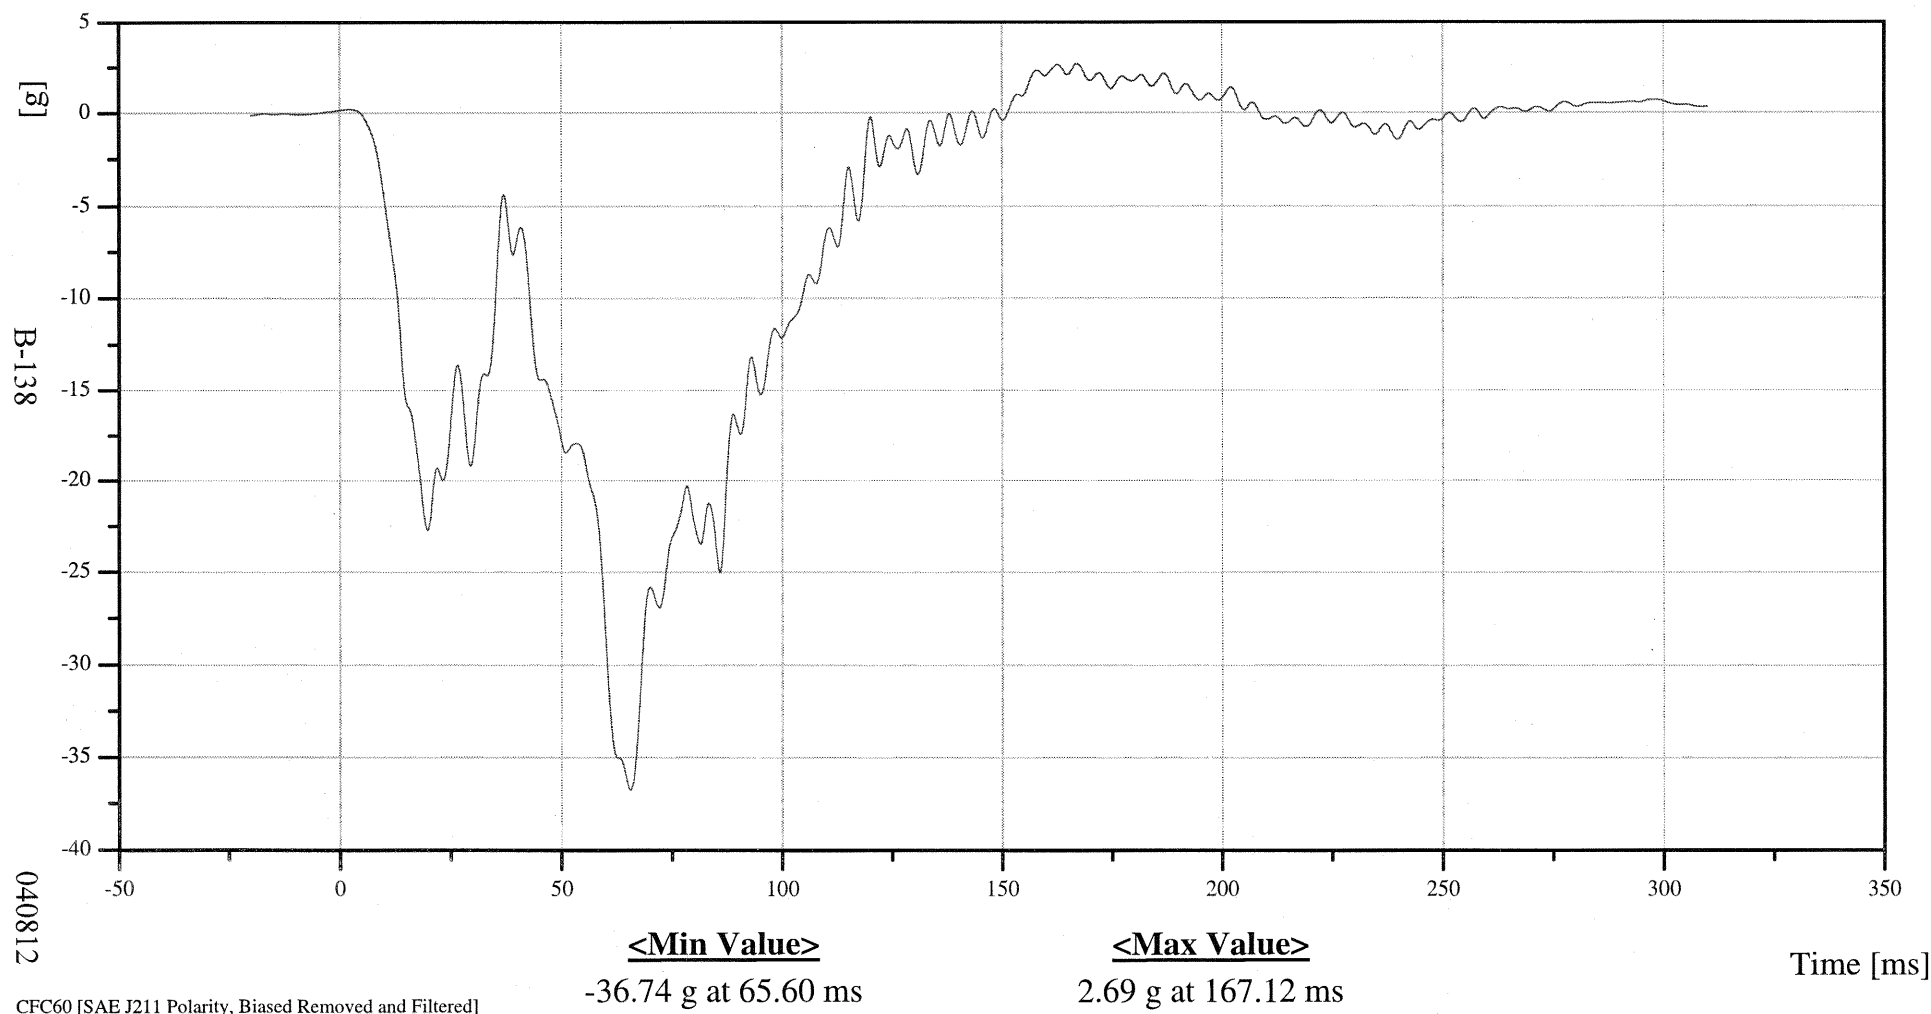



Transportation Research Center, Inc.

Vehicle RR deck Yacc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RDKY G

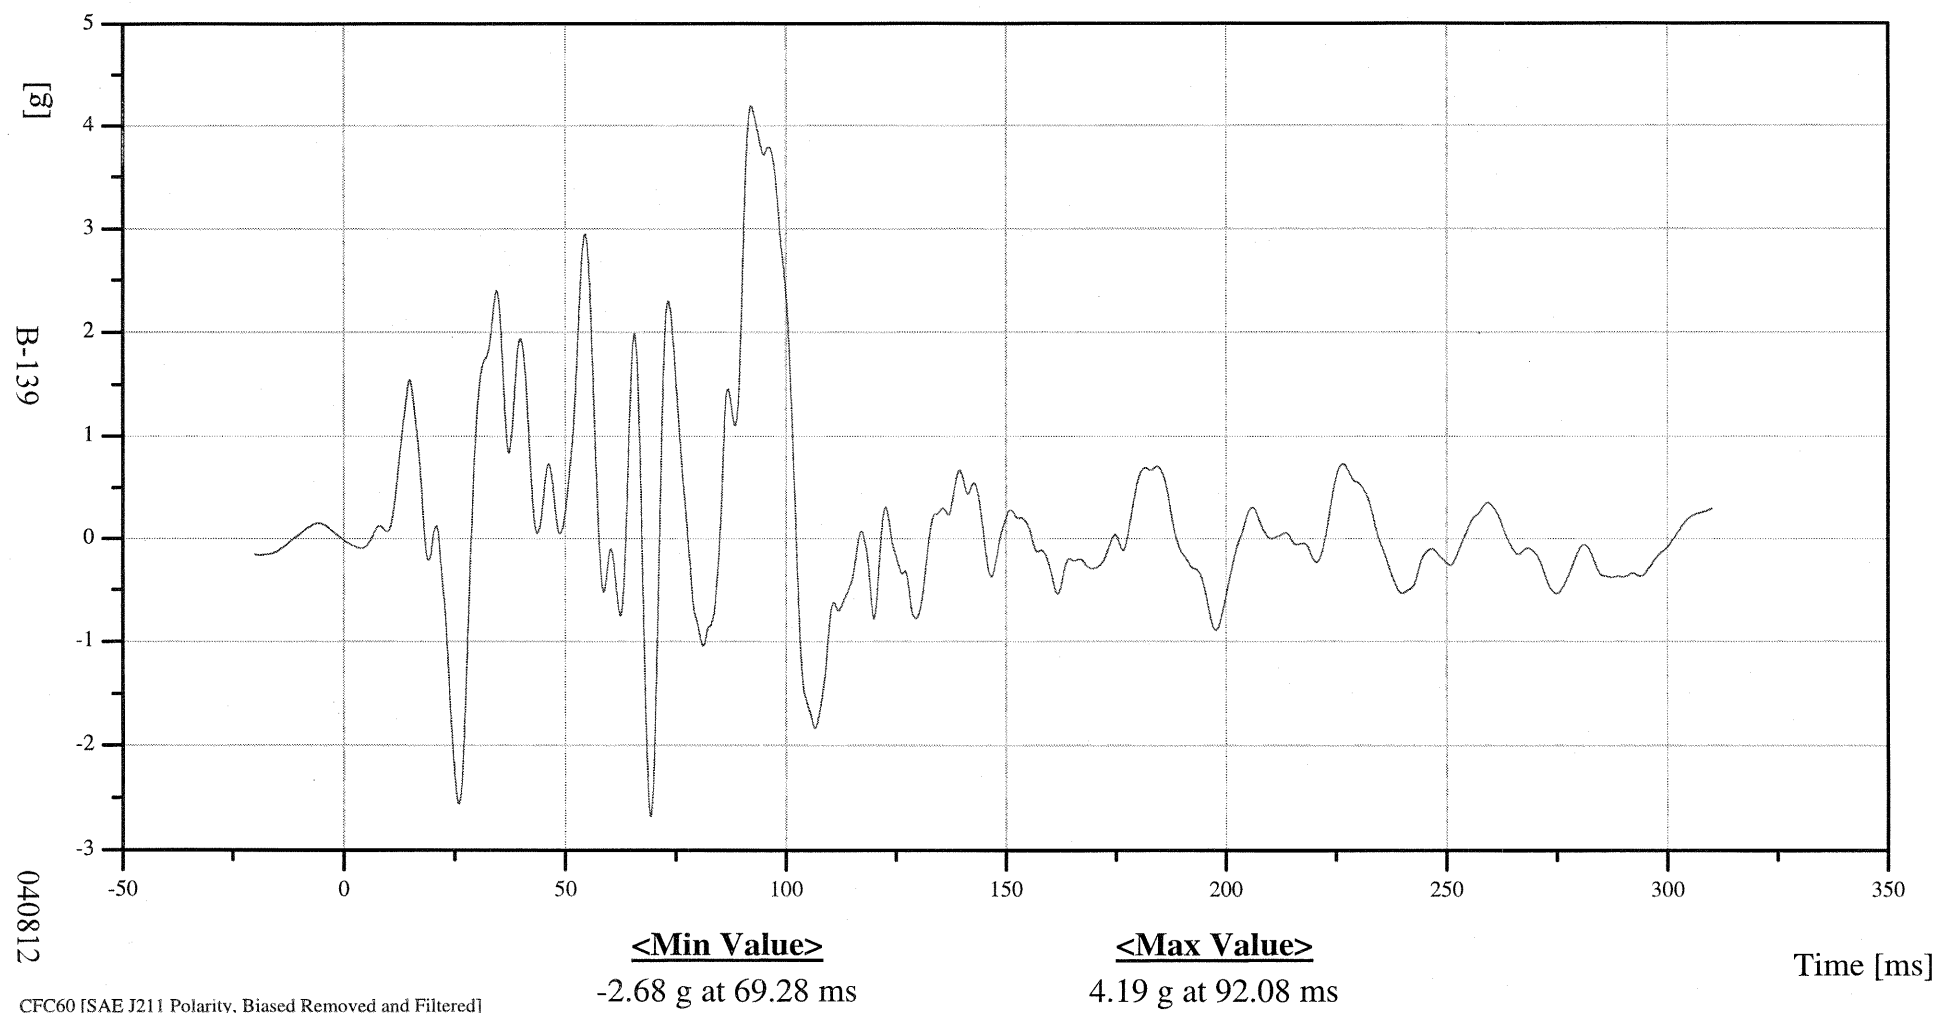



Transportation Research Center, Inc.

Vehicle RR deck Z Acc

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RDKZG

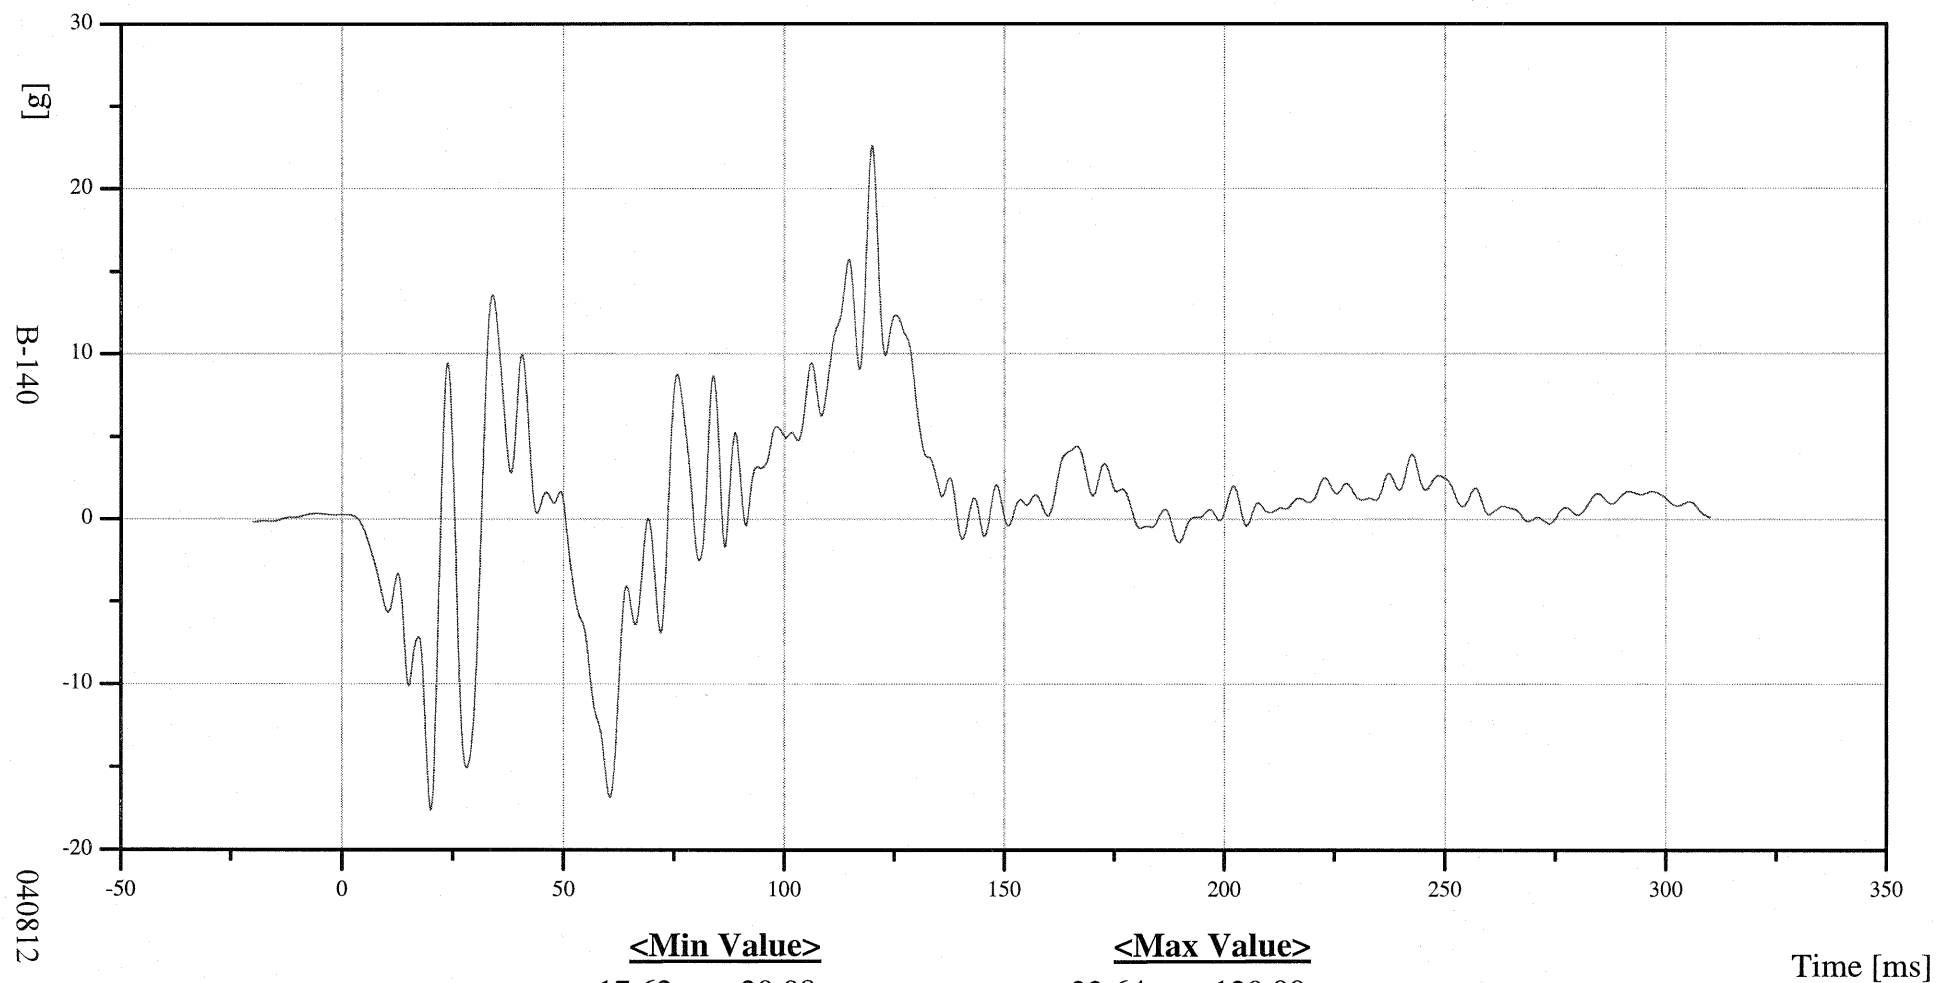

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Vehicle Rear Deck Resultant Acceleration

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

RDKRG

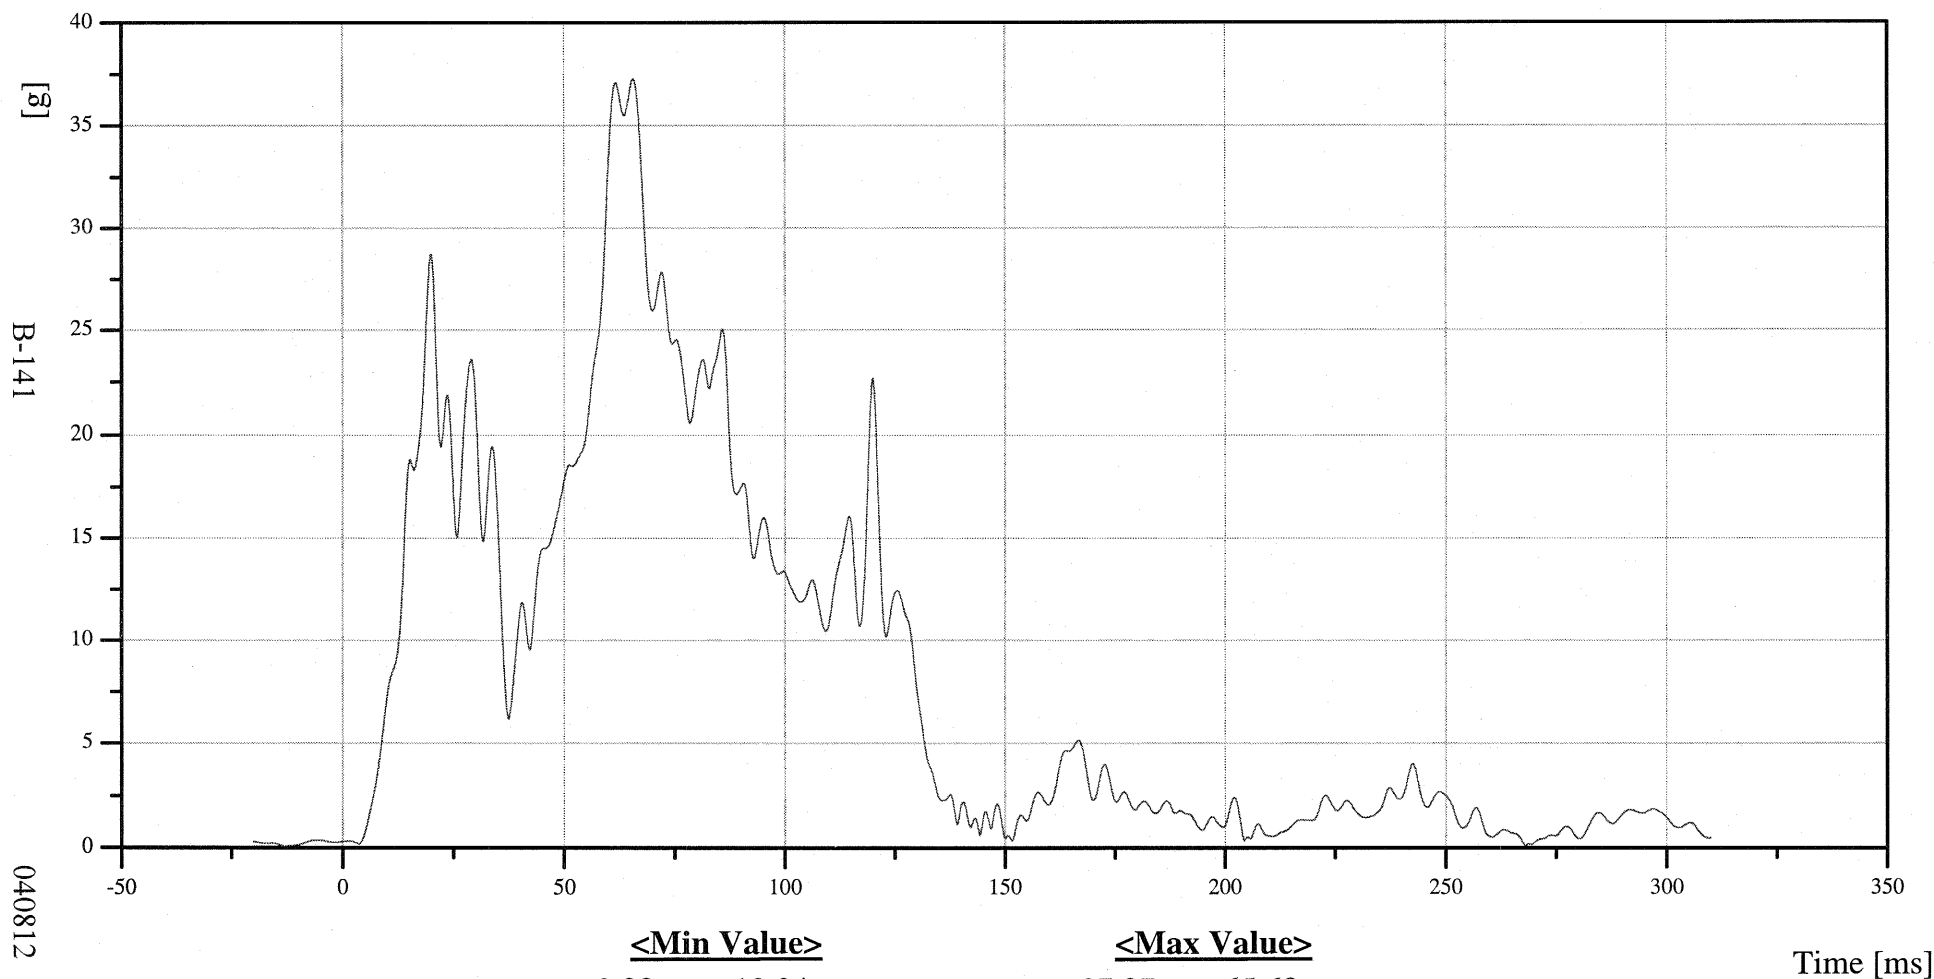

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

RT RR PASS. SHLDR BELT FORCE

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

SHBF3

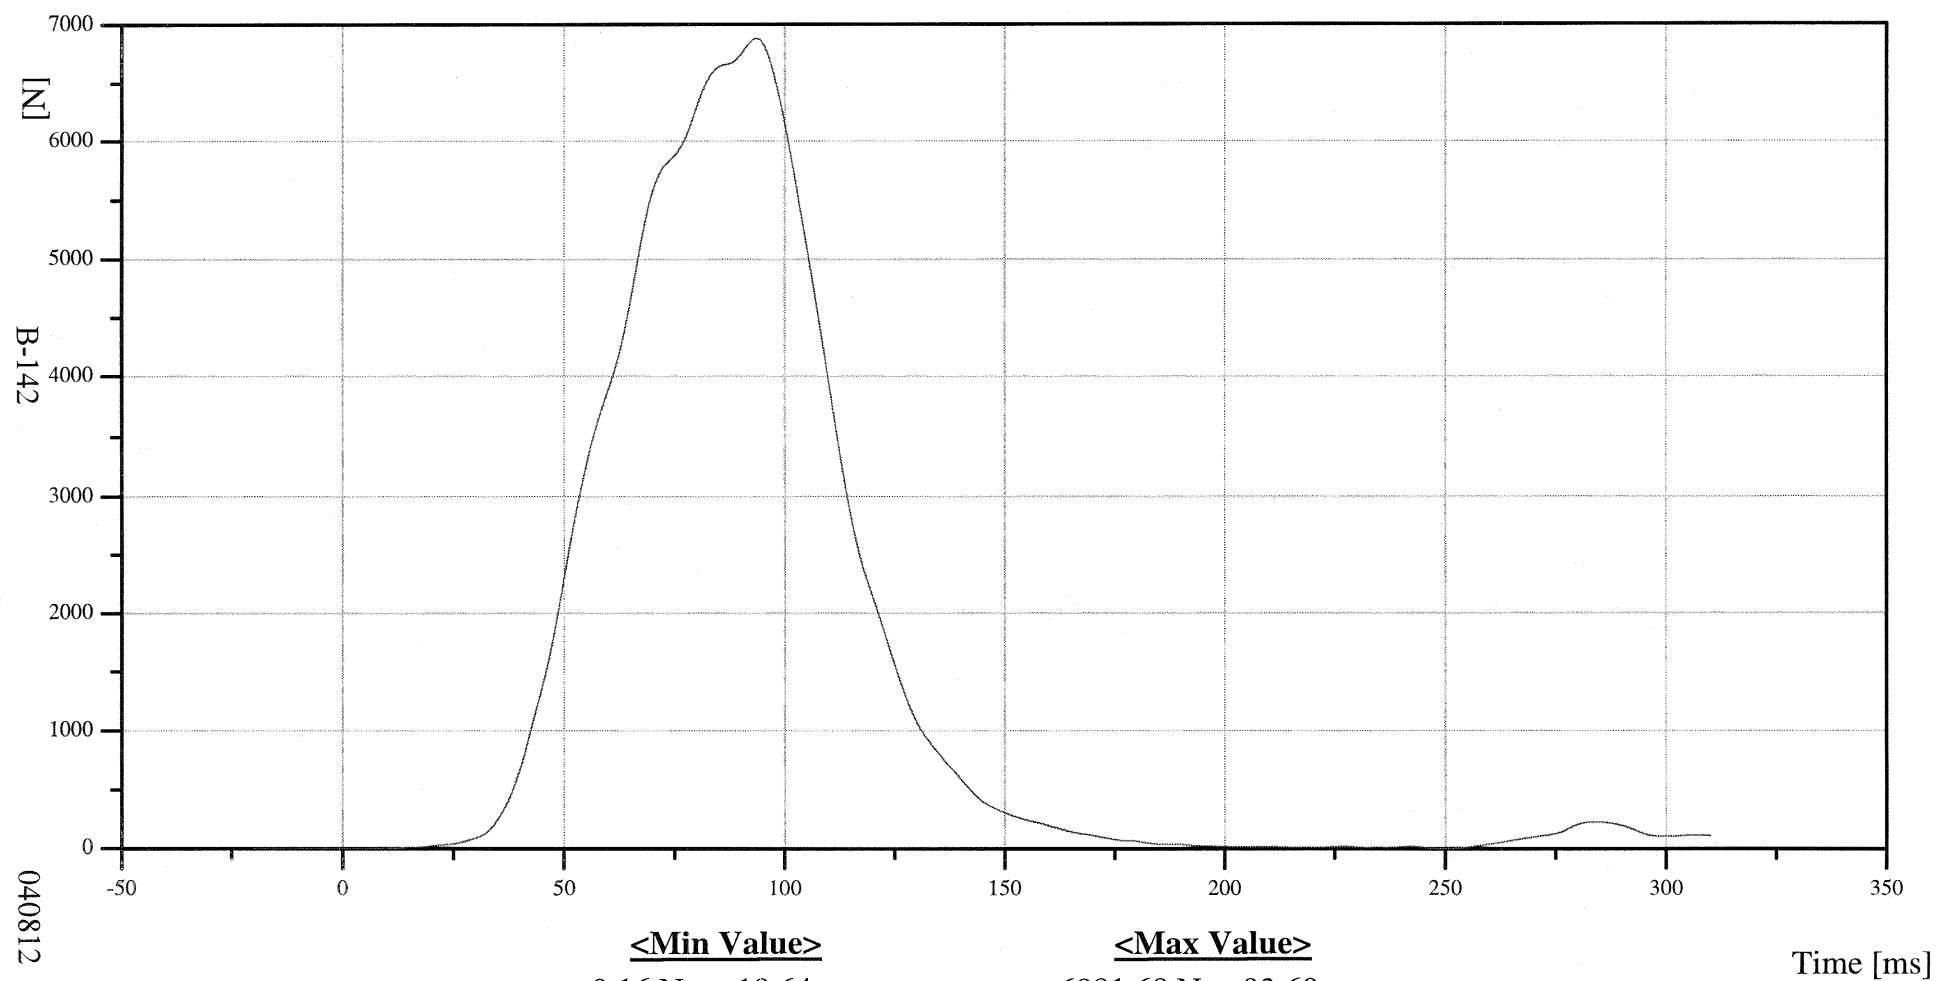

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

RT RR PASS. LAP BELT FORCE

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LBOF3

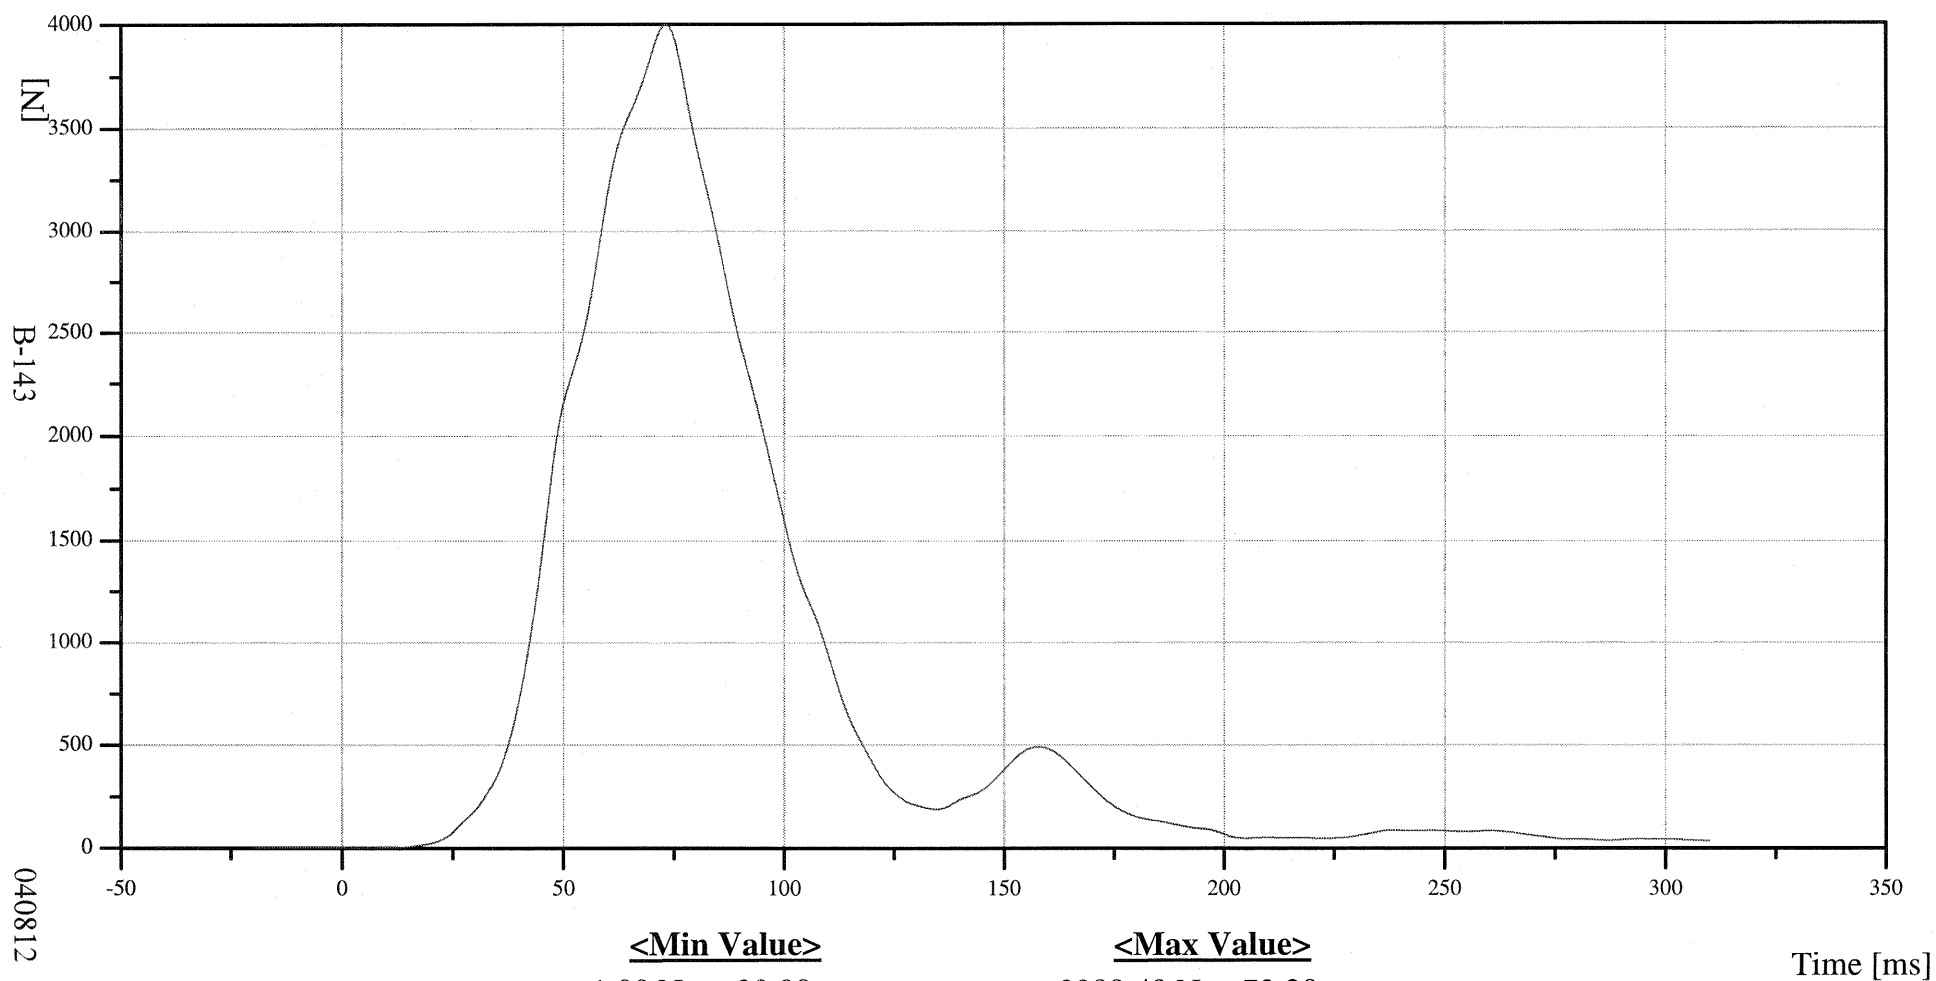

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Driver airbag primary

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

DABETA

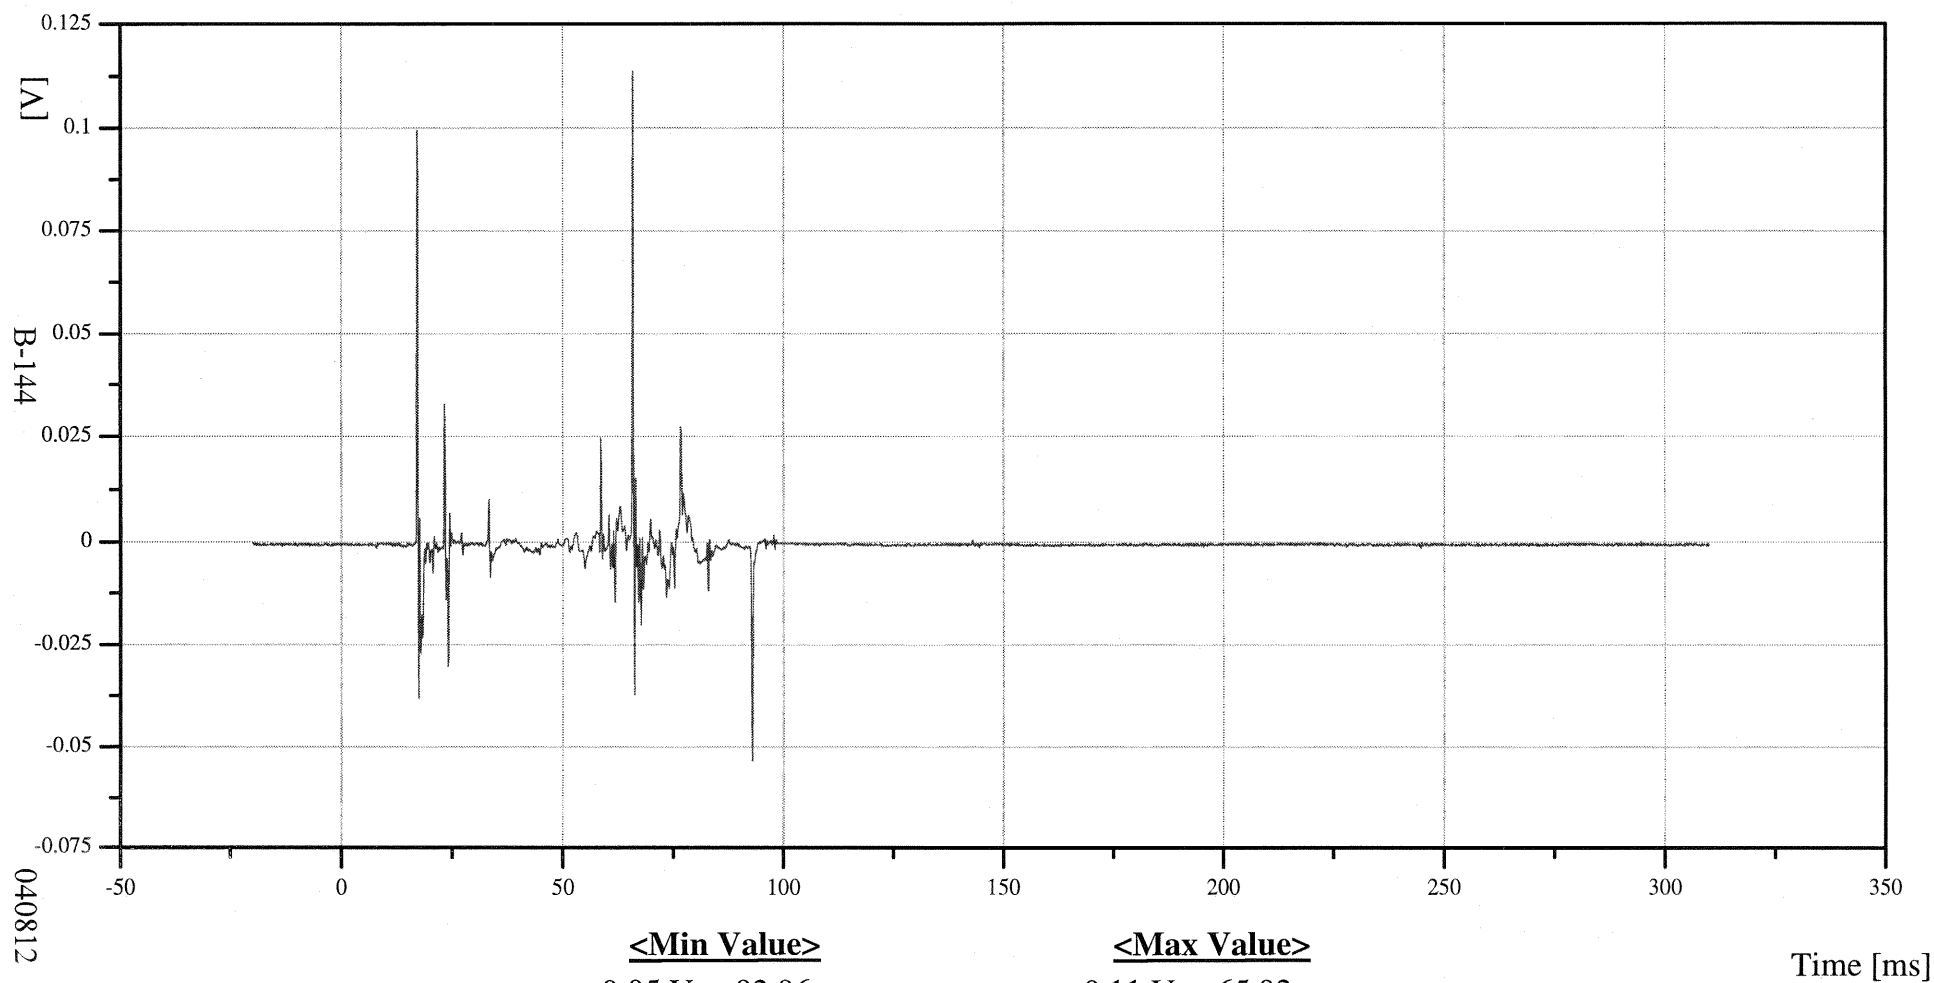

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Driver airbag secondary

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

DABETB

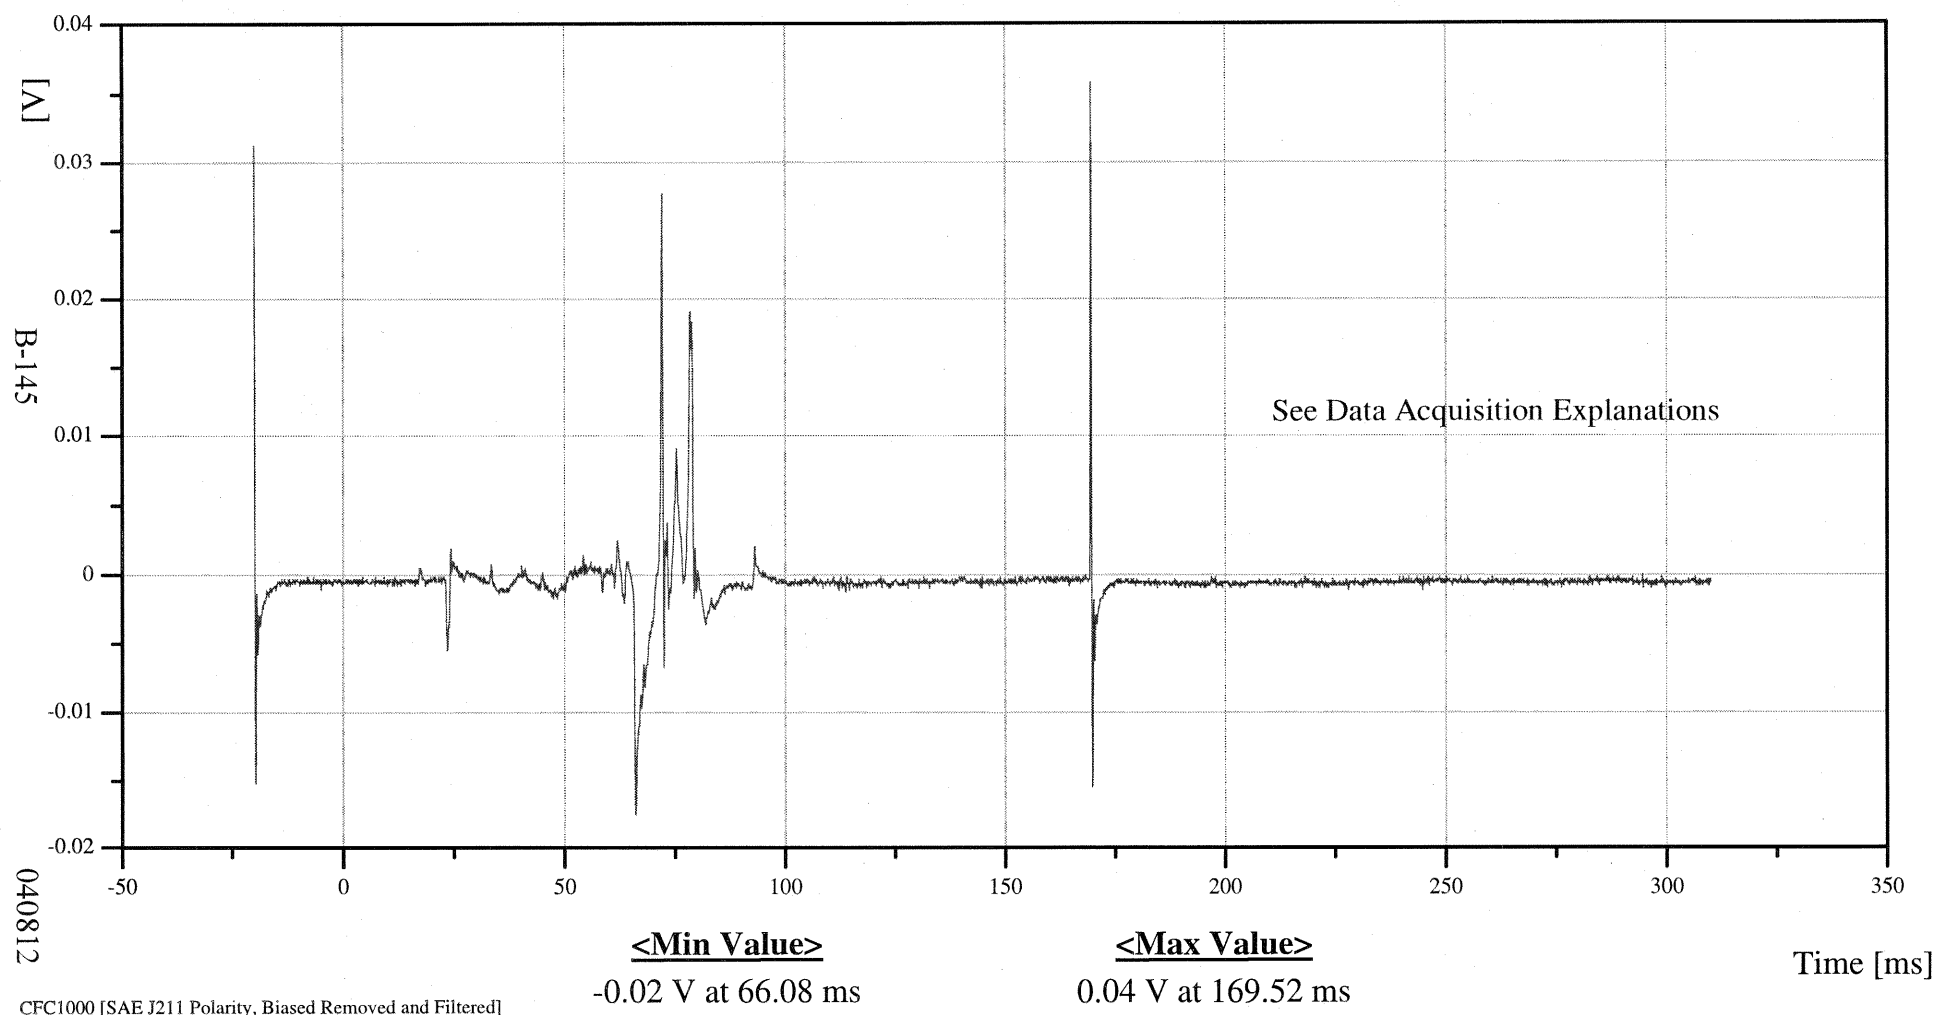



Transportation Research Center, Inc.

Passenger airbag primary

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PABETA

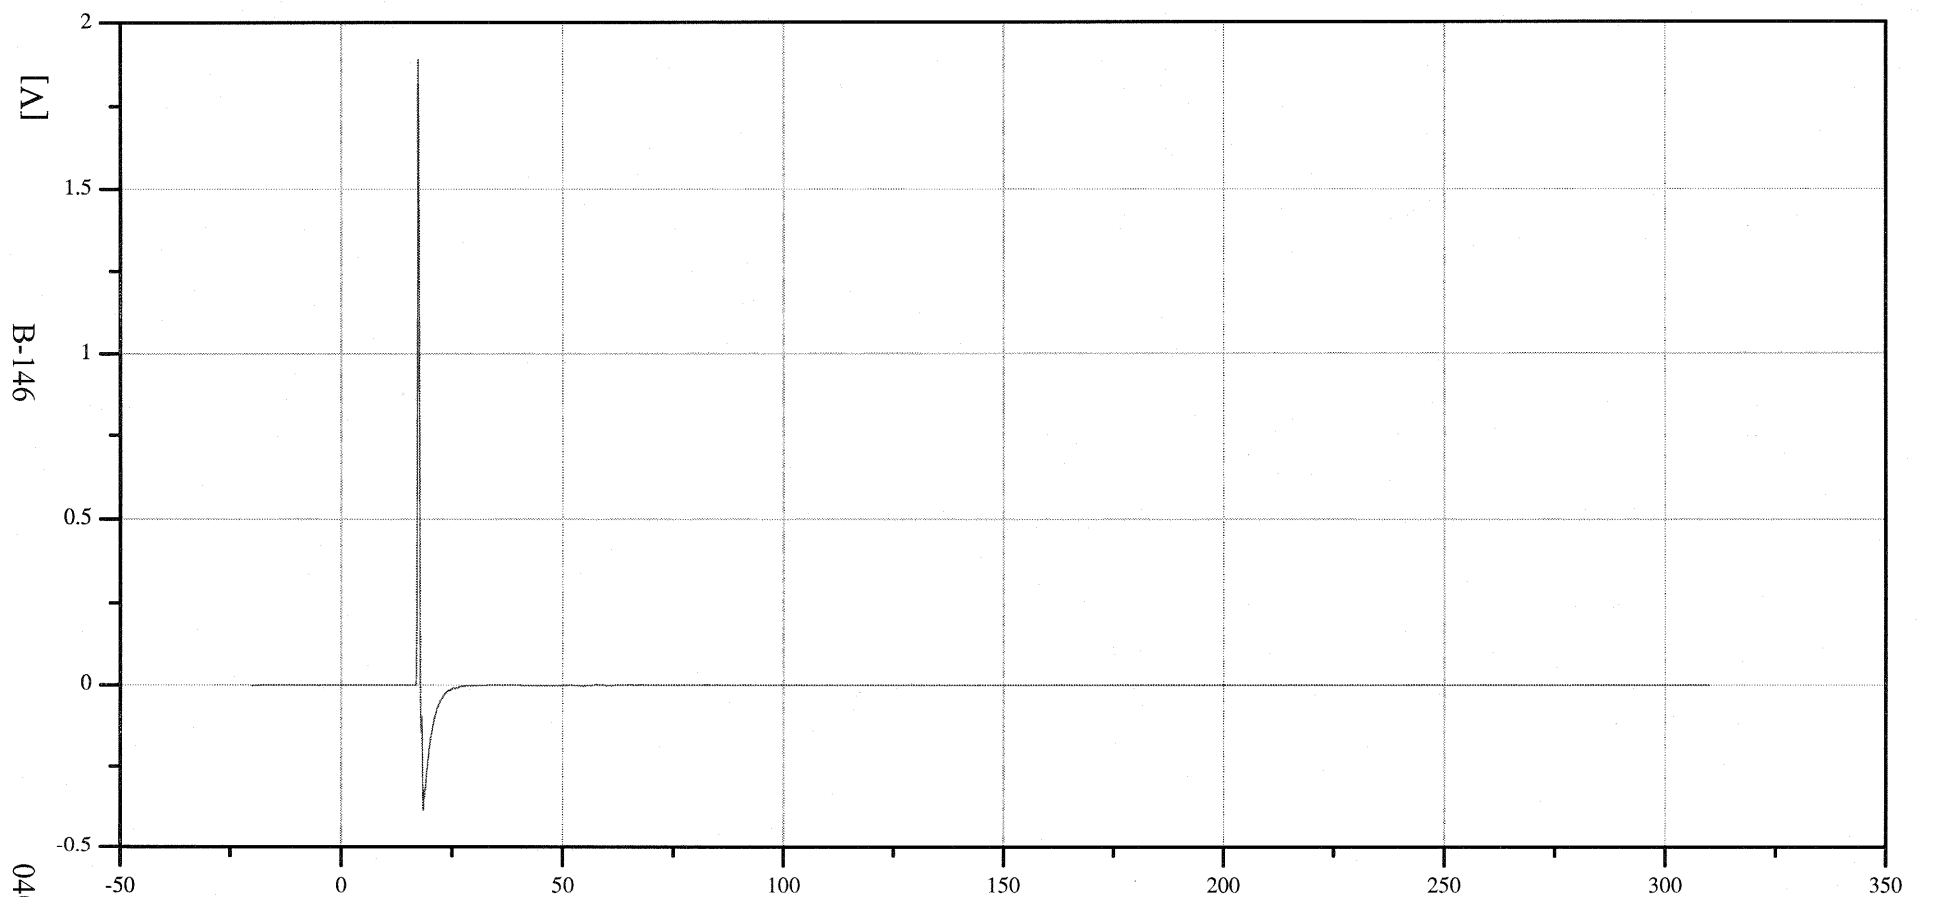

<Min Value>

-0.38 V at 18.56 ms

<Max Value>

1.89 V at 17.36 ms

Time [ms]

CFC1000 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

Passenger airbag secondary

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

PABETB

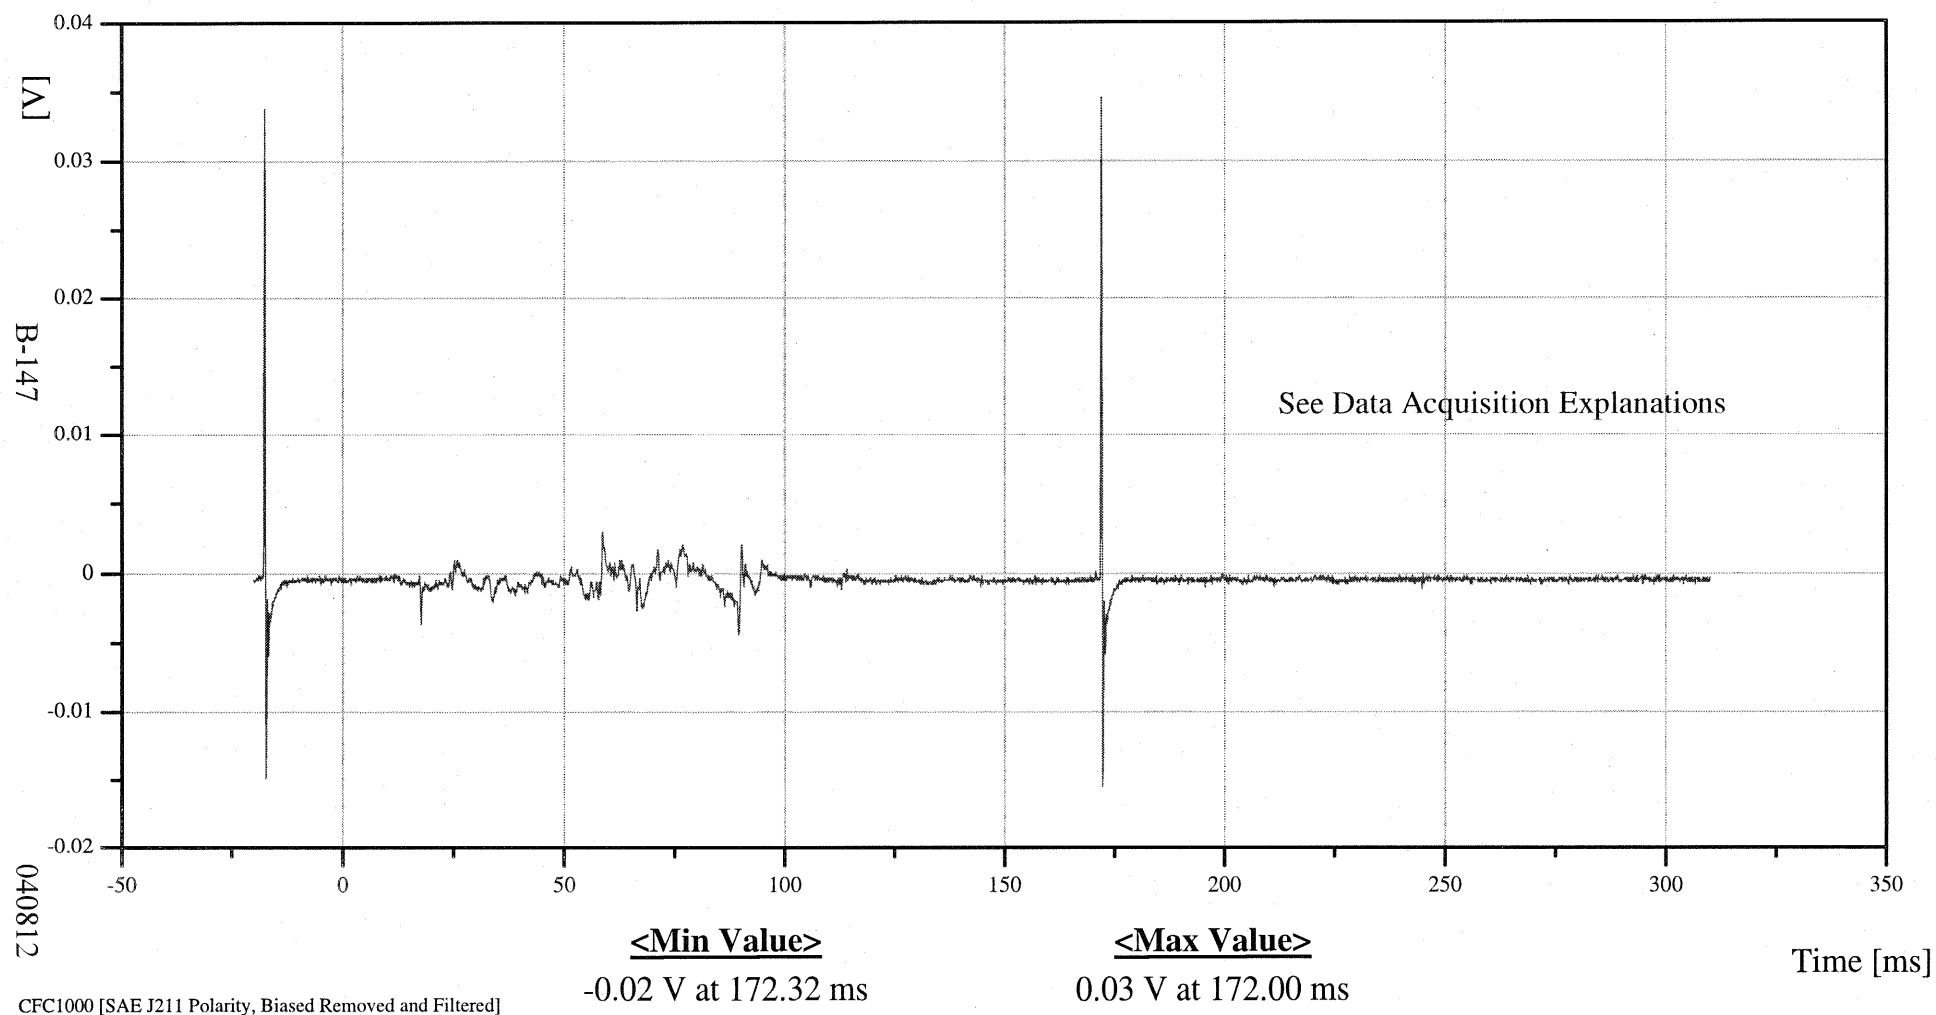



Transportation Research Center, Inc.

ROW 1 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0101

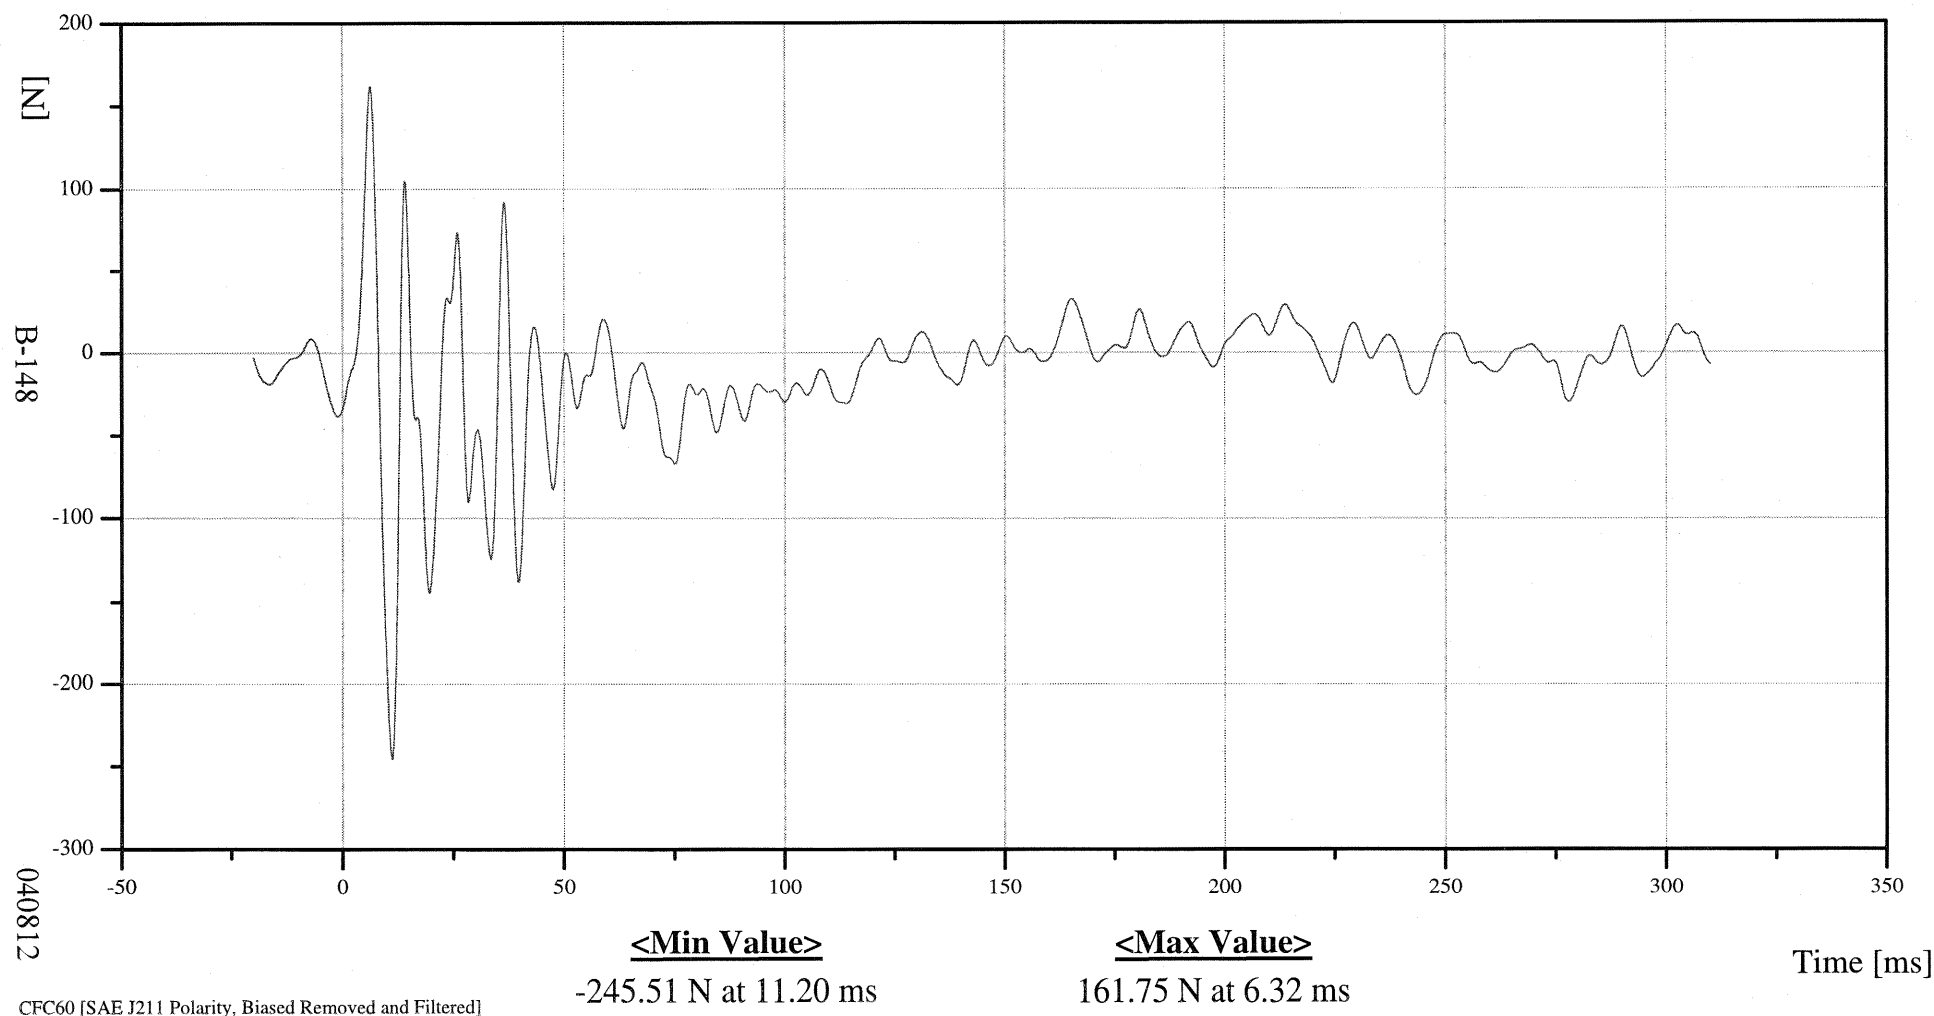



Transportation Research Center, Inc.

ROW 1 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0102

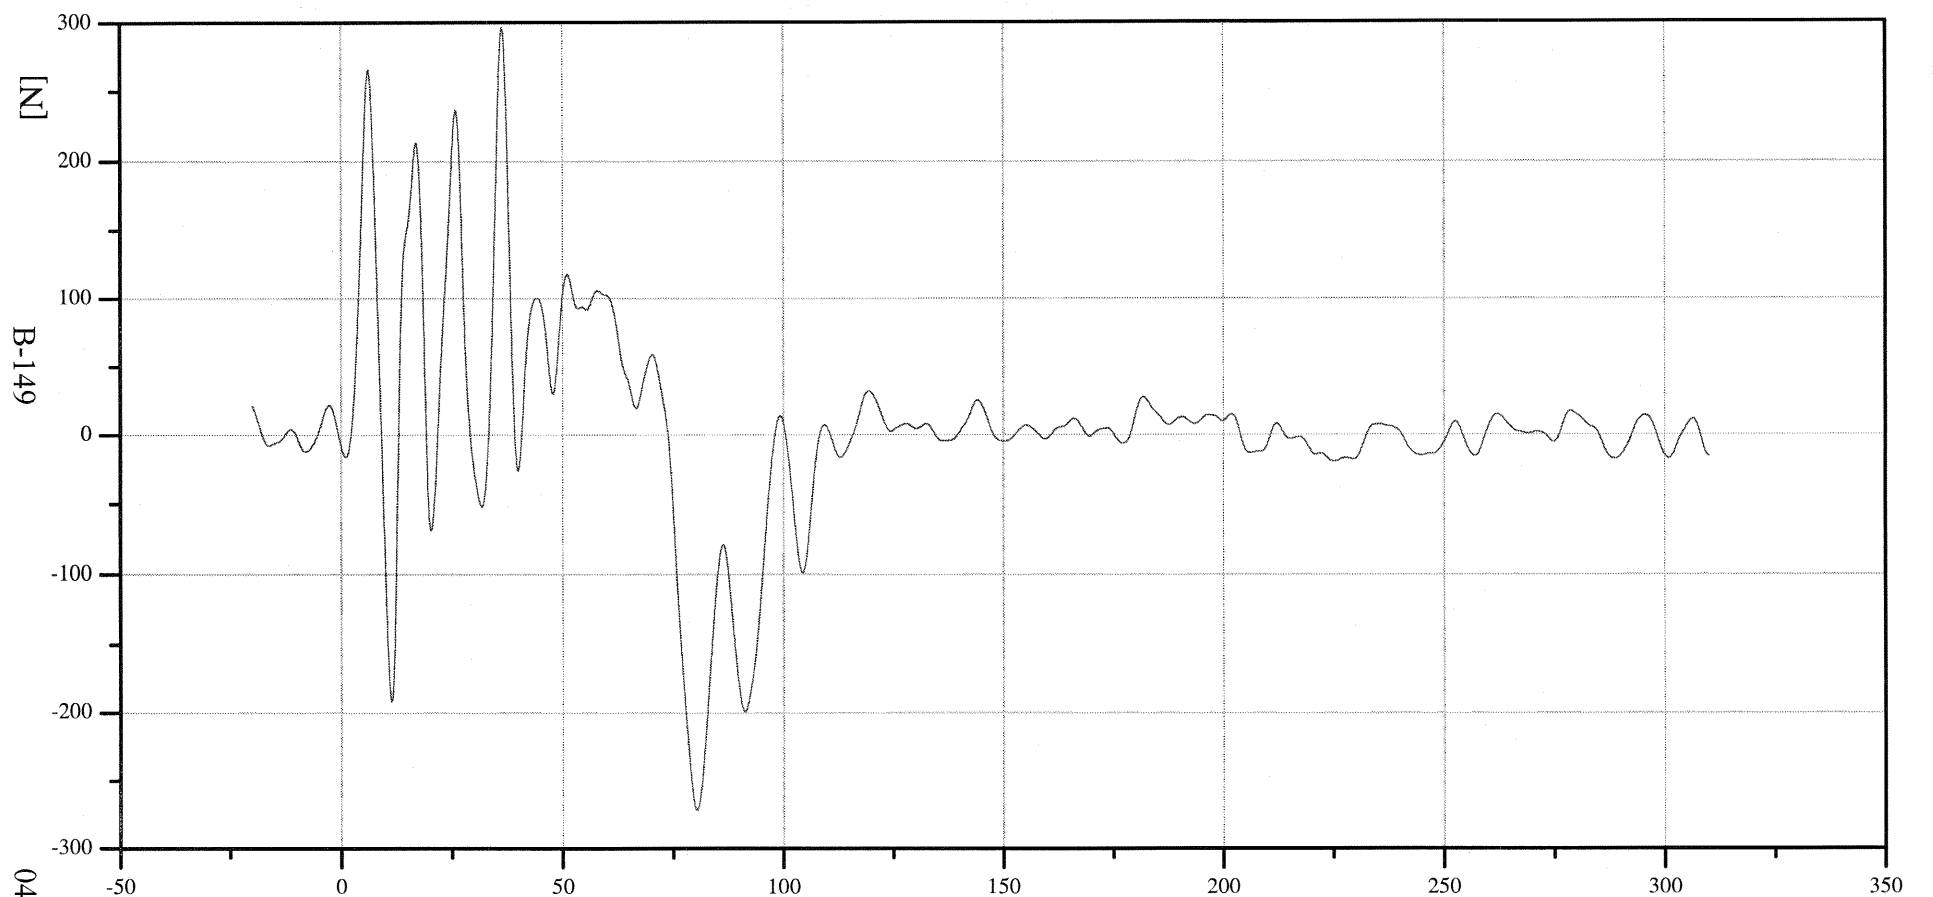

<Min Value>

-271.87 N at 80.32 ms

<Max Value>

296.36 N at 36.32 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0103

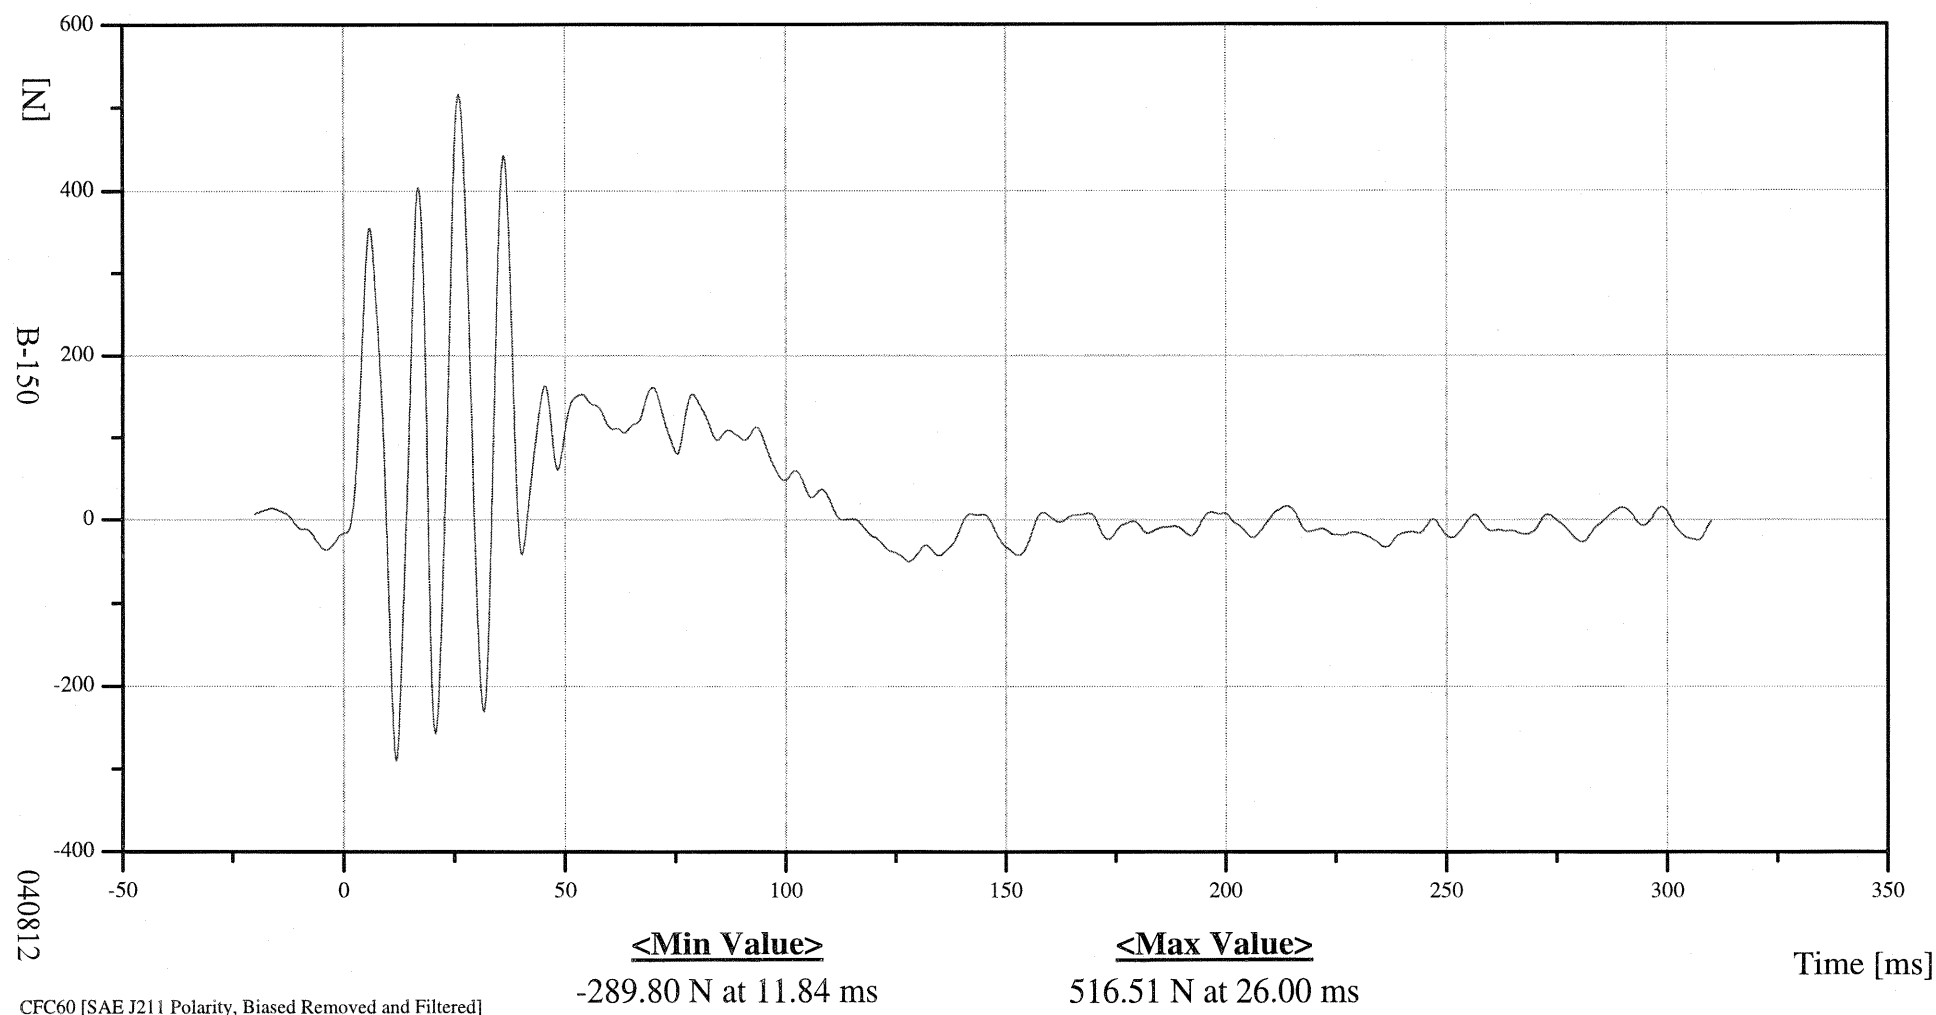



Transportation Research Center, Inc.

ROW 1 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0104

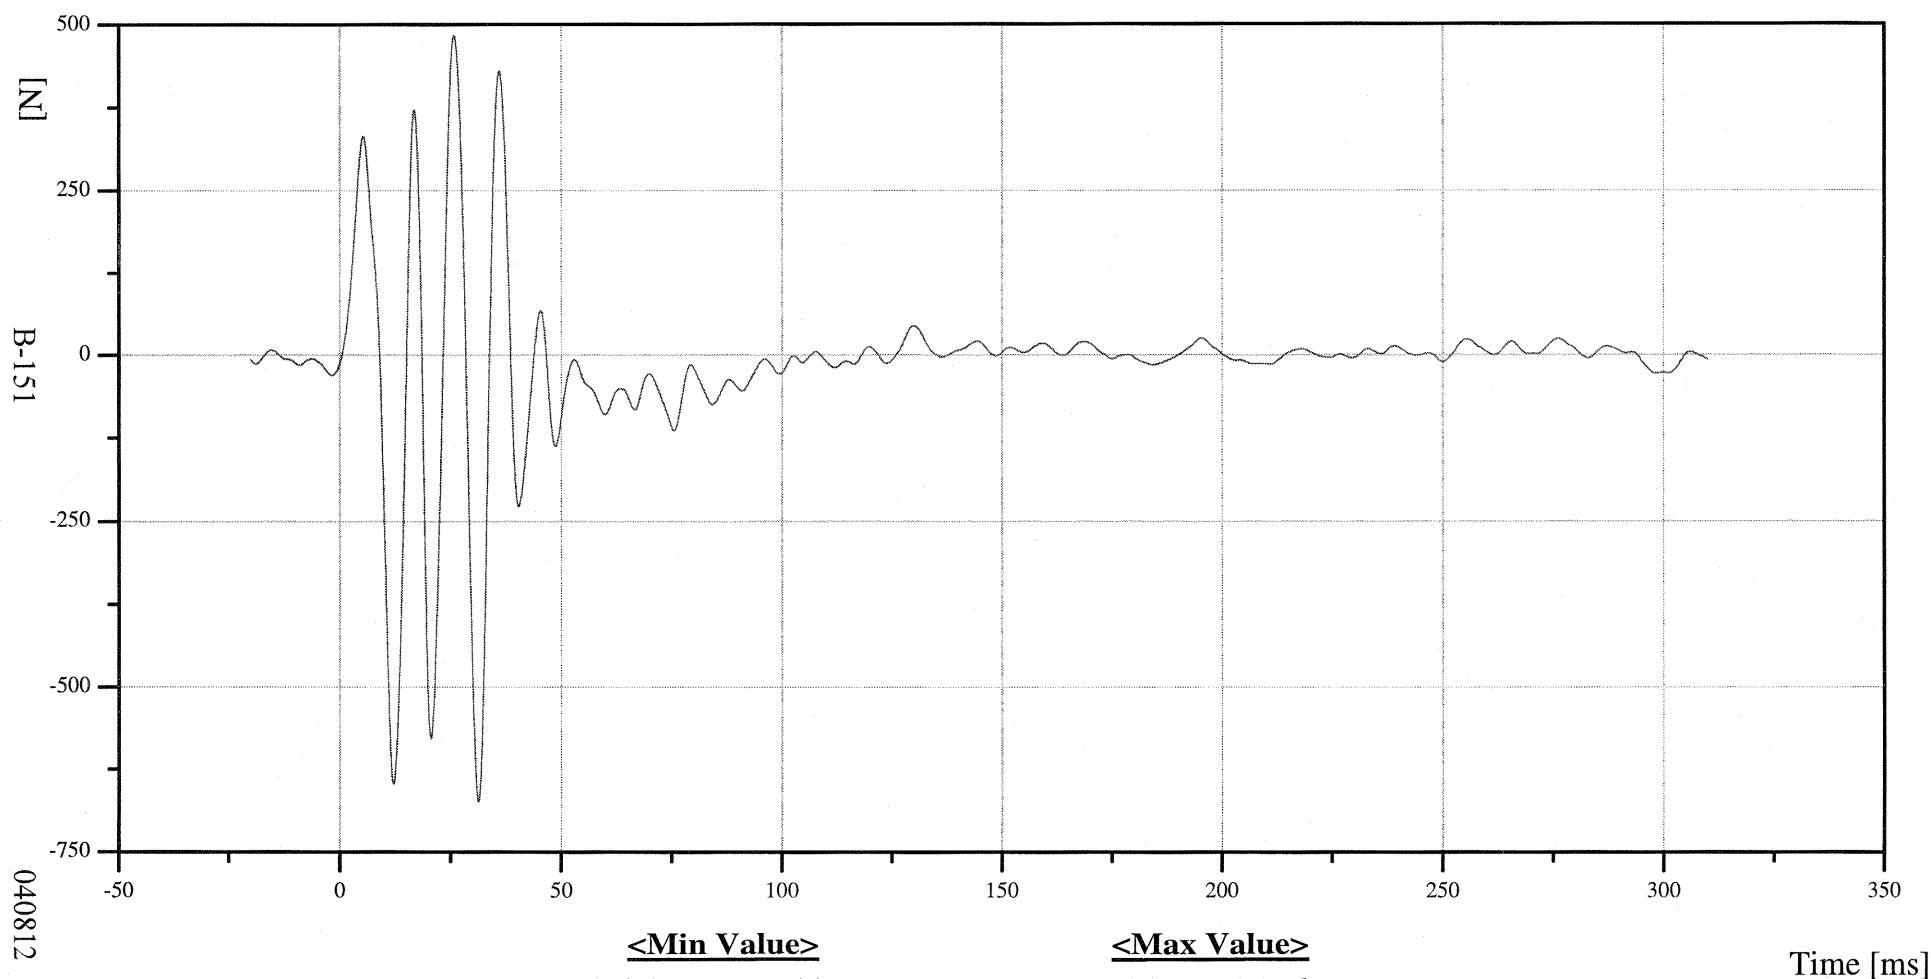

-674.47 N at 31.28 ms

483.24 N at 25.76 ms

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0105

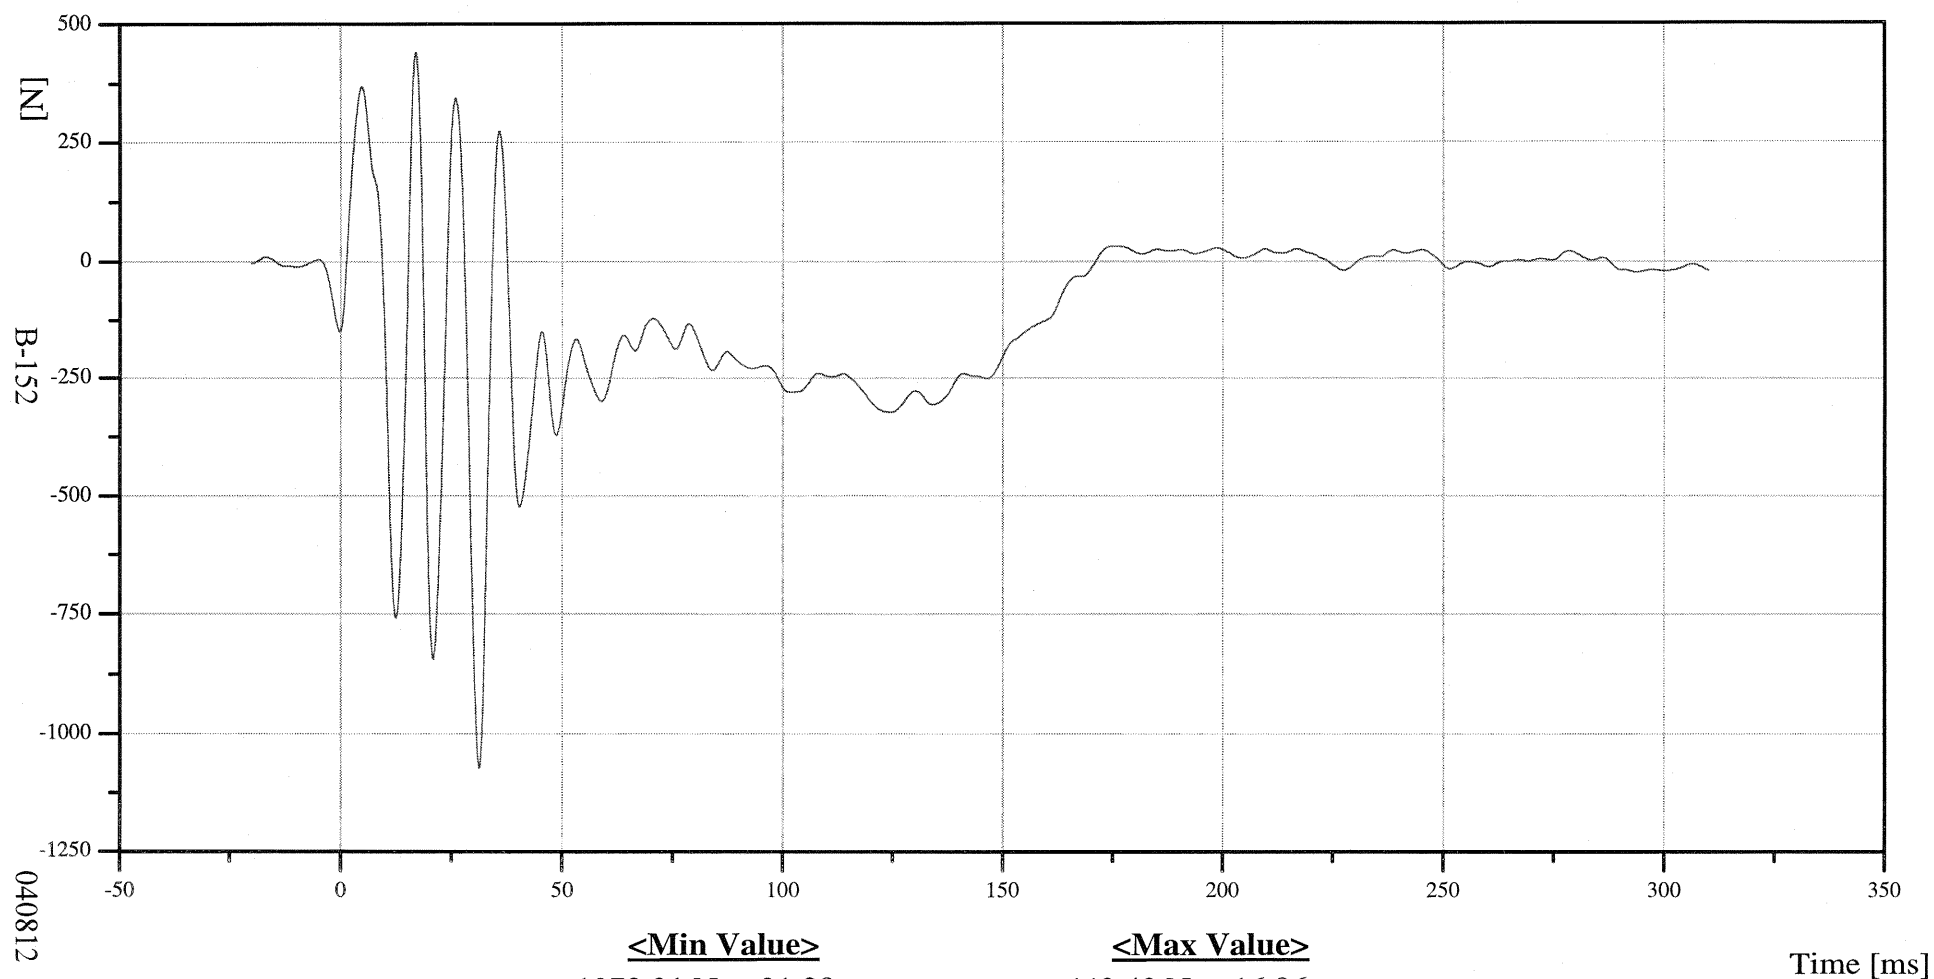

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0106

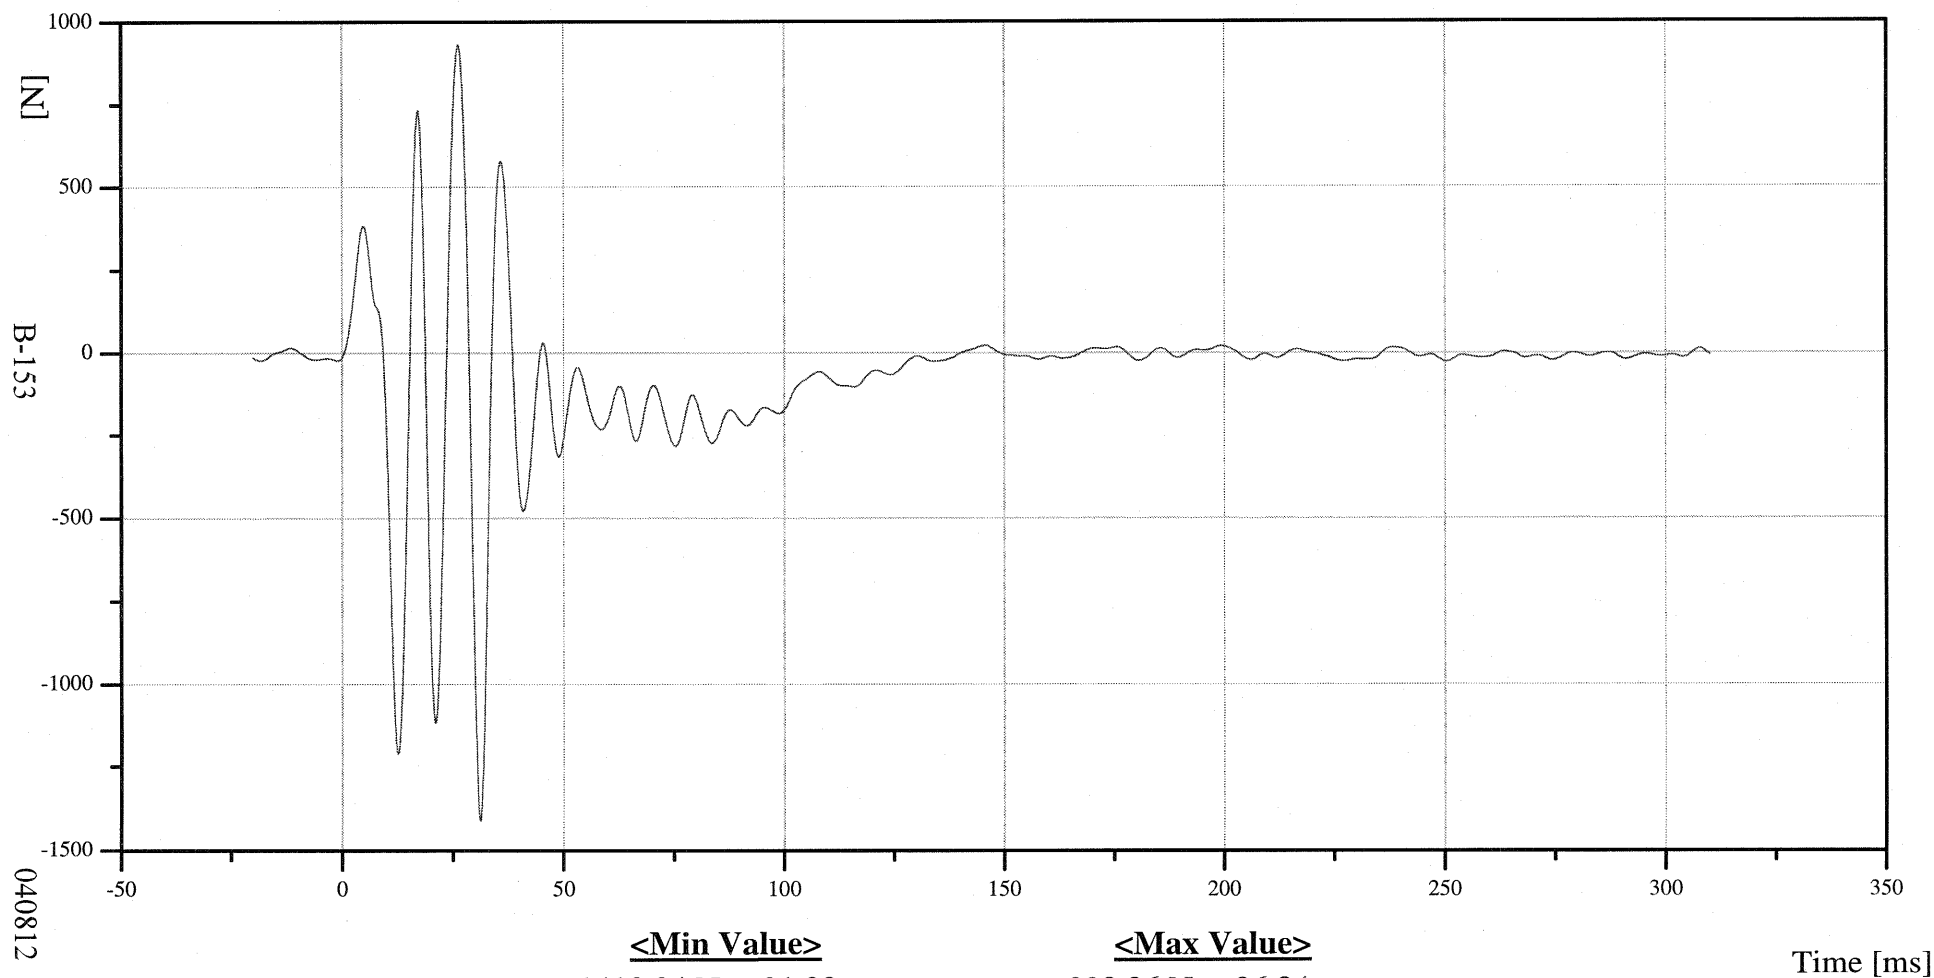

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0107

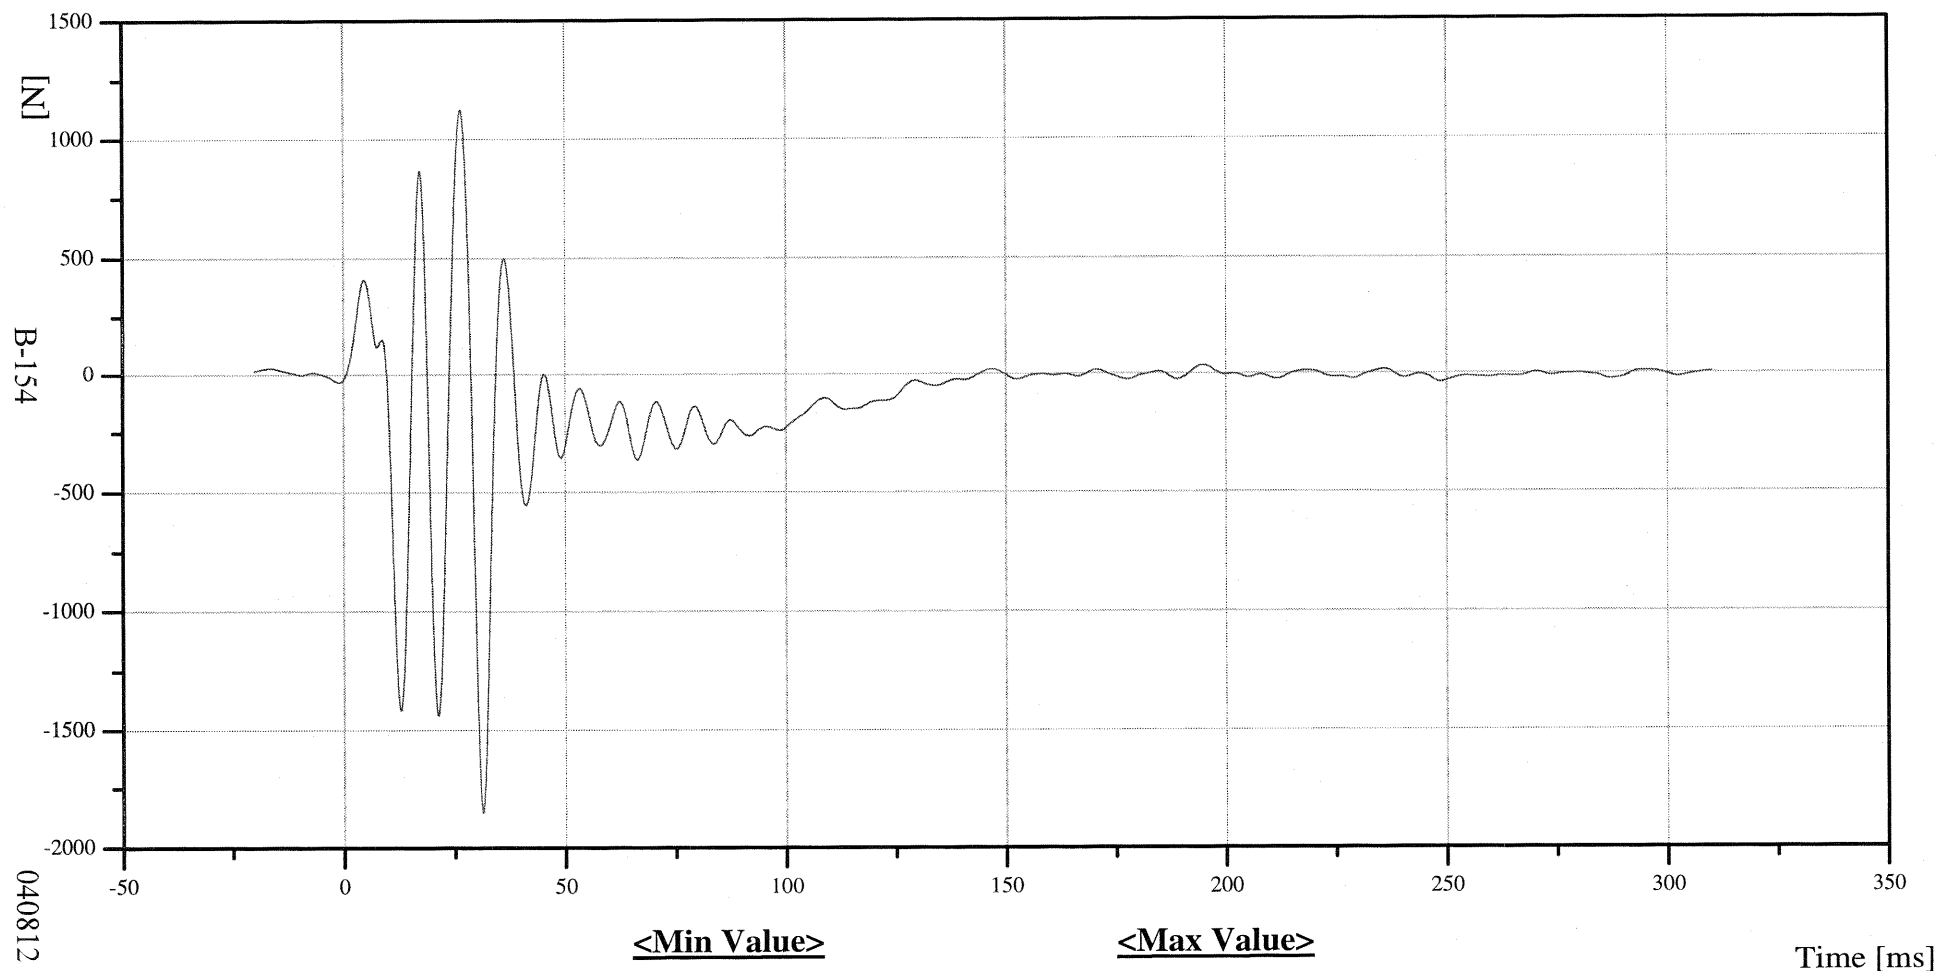

<Min Value>

-1850.17 N at 31.28 ms

<Max Value>

1124.64 N at 26.48 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0108

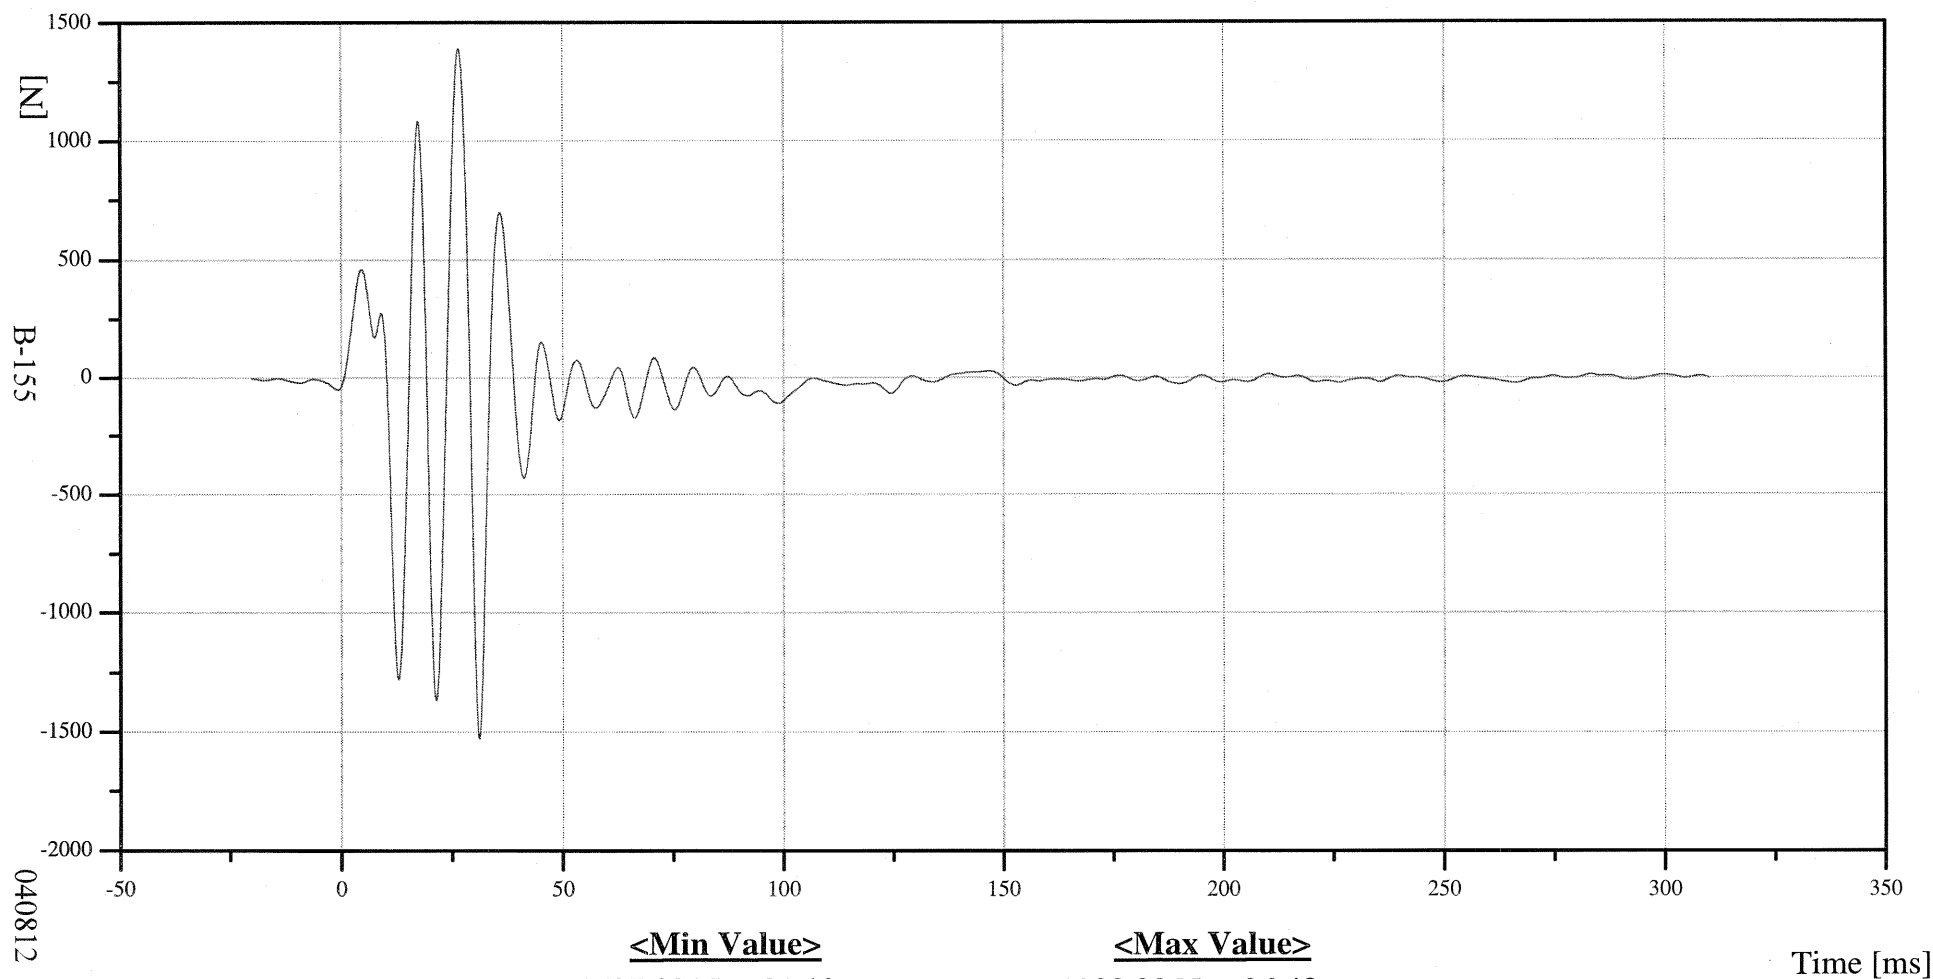

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0109

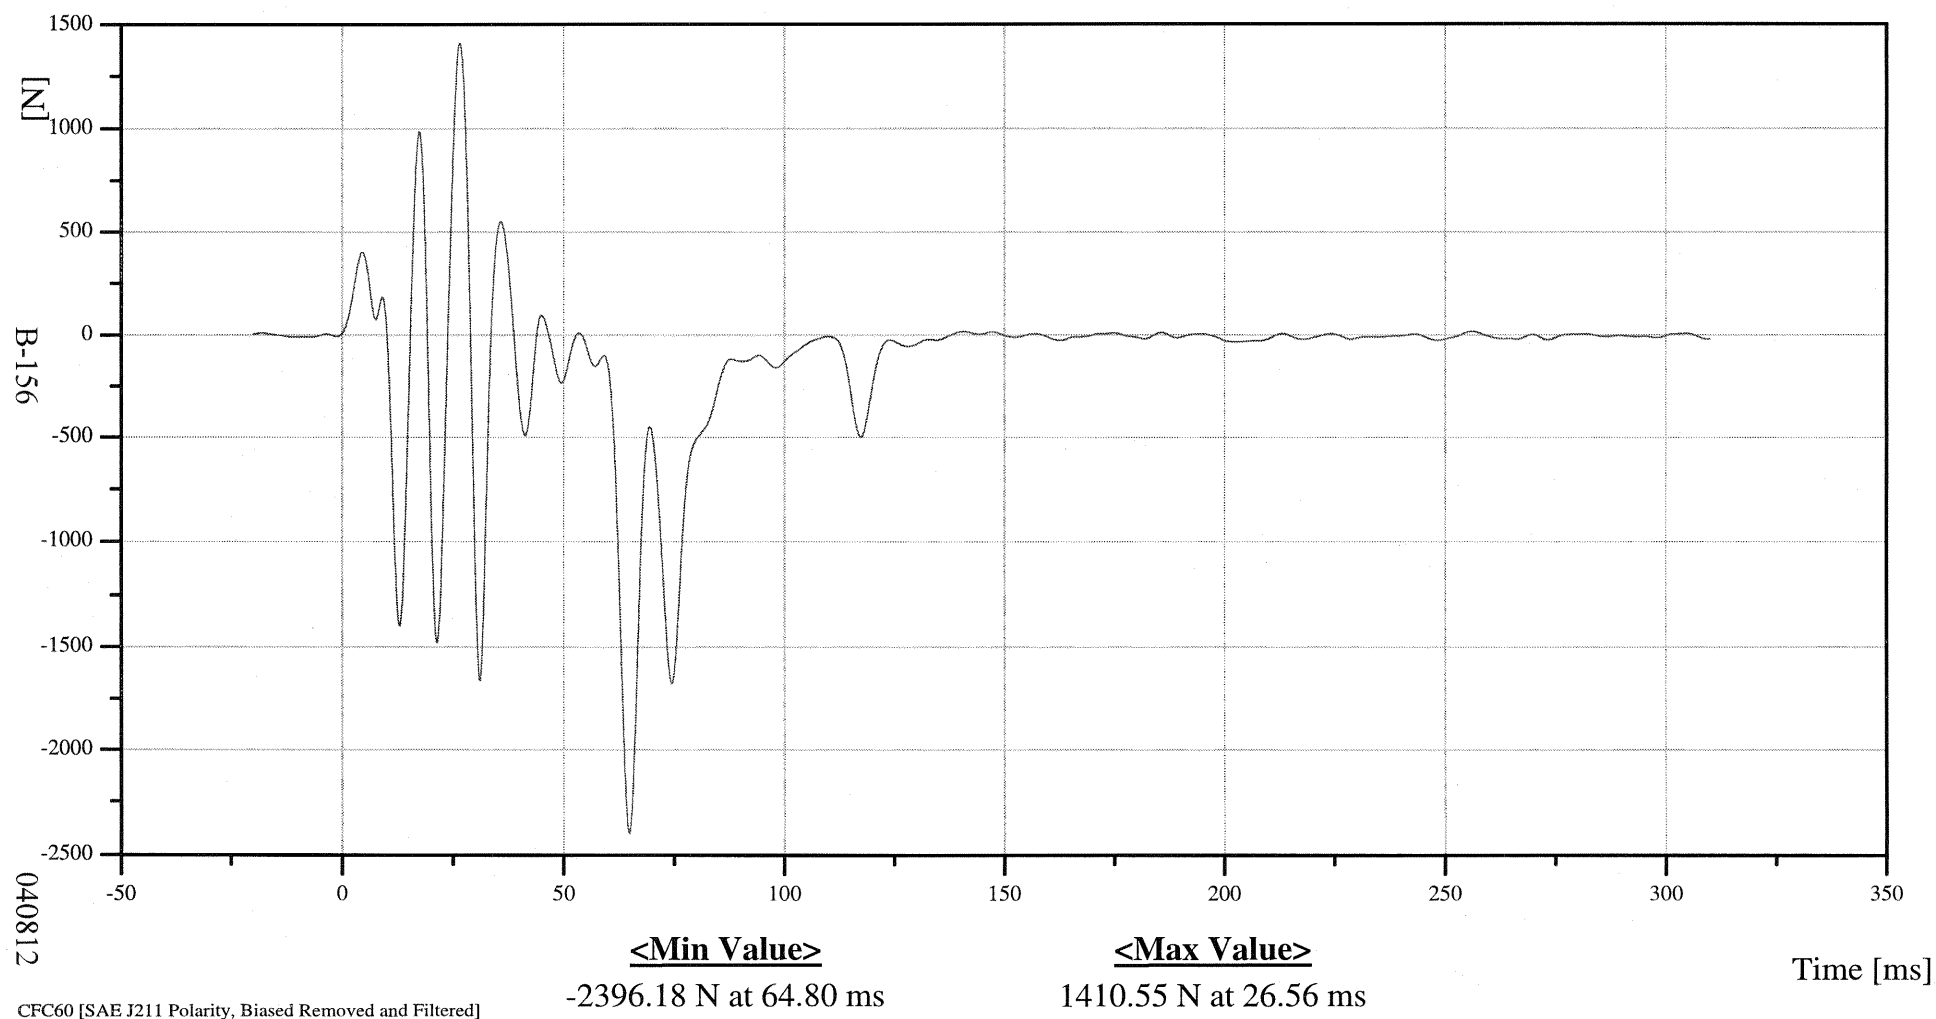



Transportation Research Center, Inc.

ROW 1 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0110

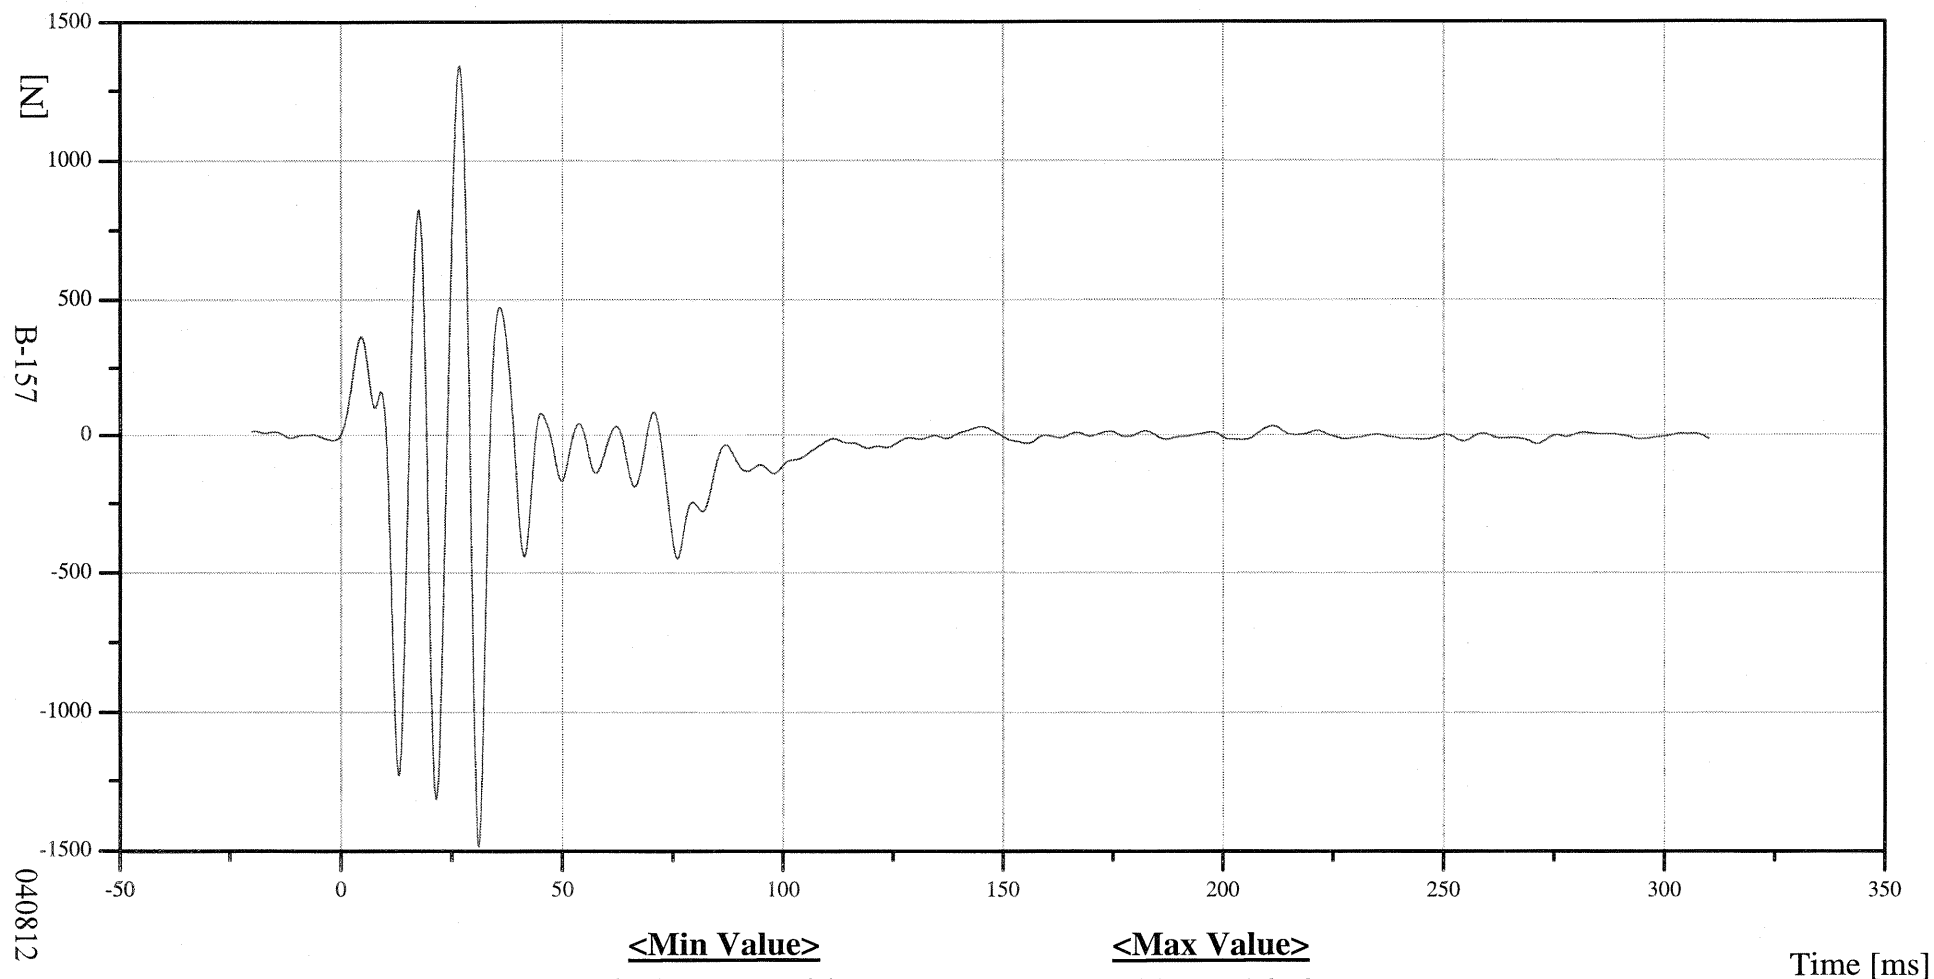

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0111

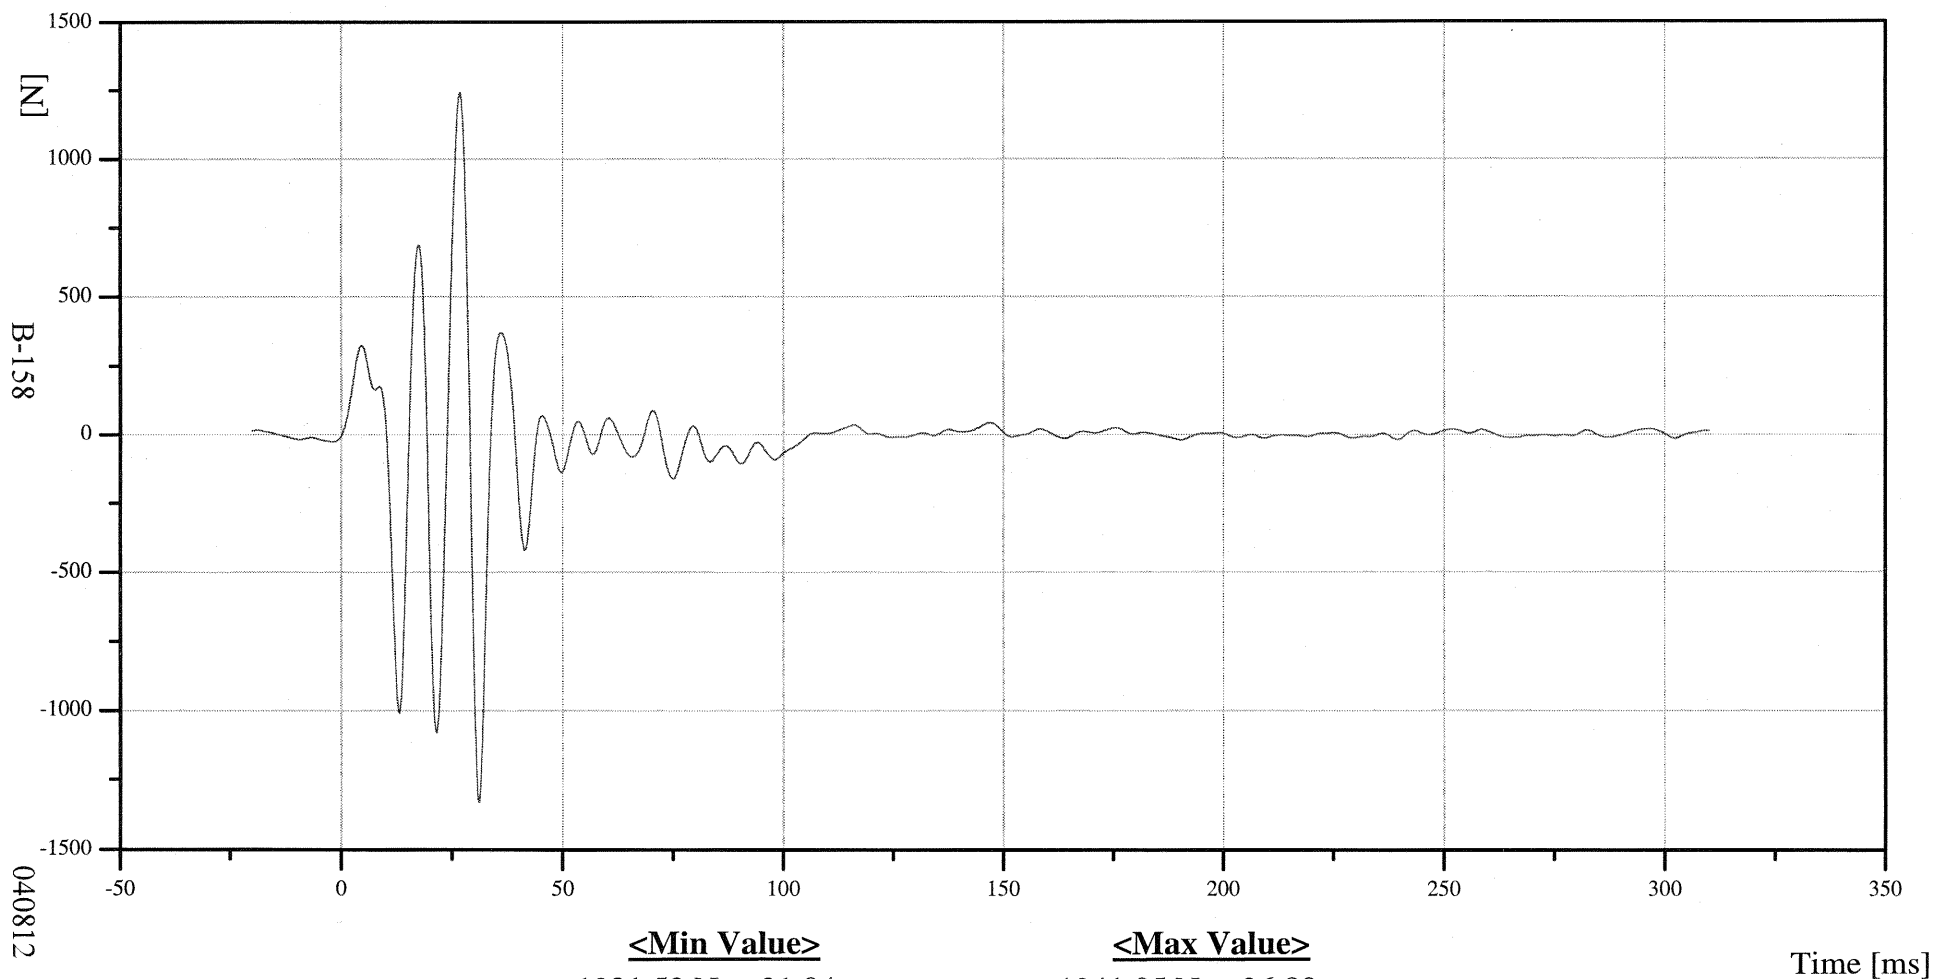

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0112

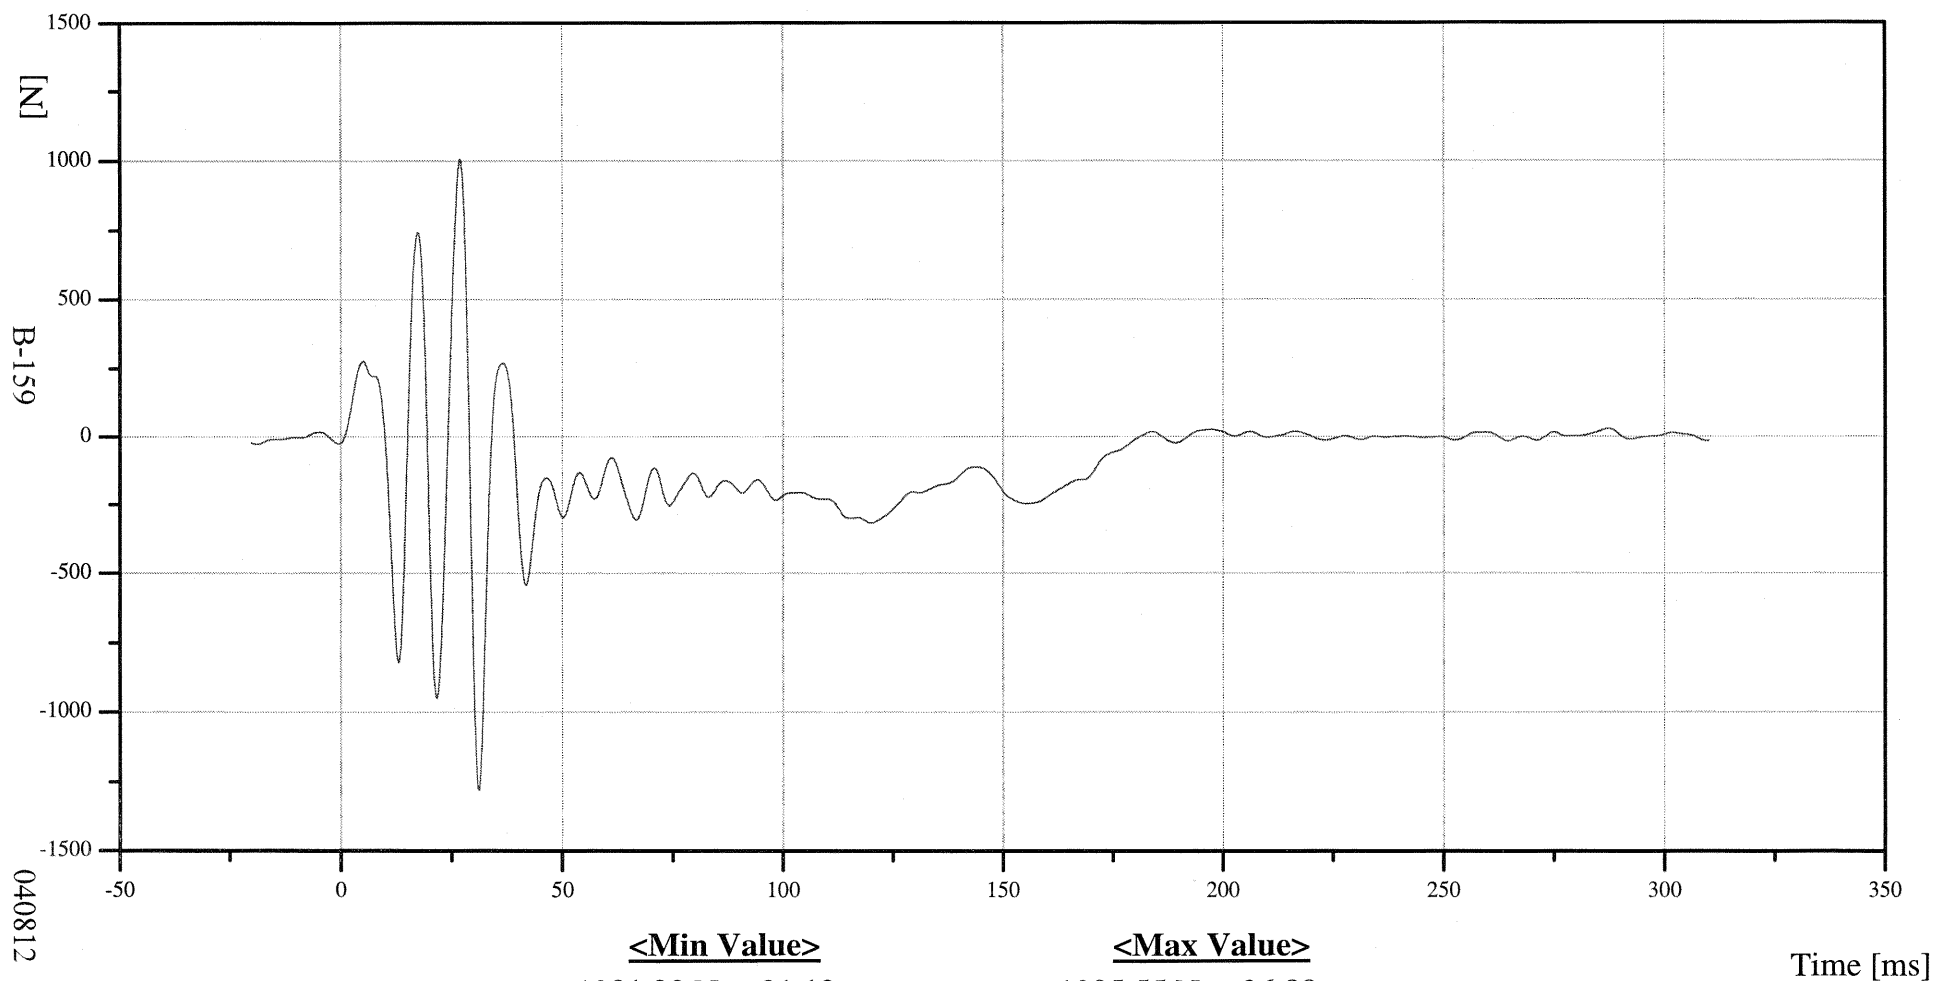

<Min Value>

-1281.90 N at 31.12 ms

<Max Value>

1005.55 N at 26.88 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0113

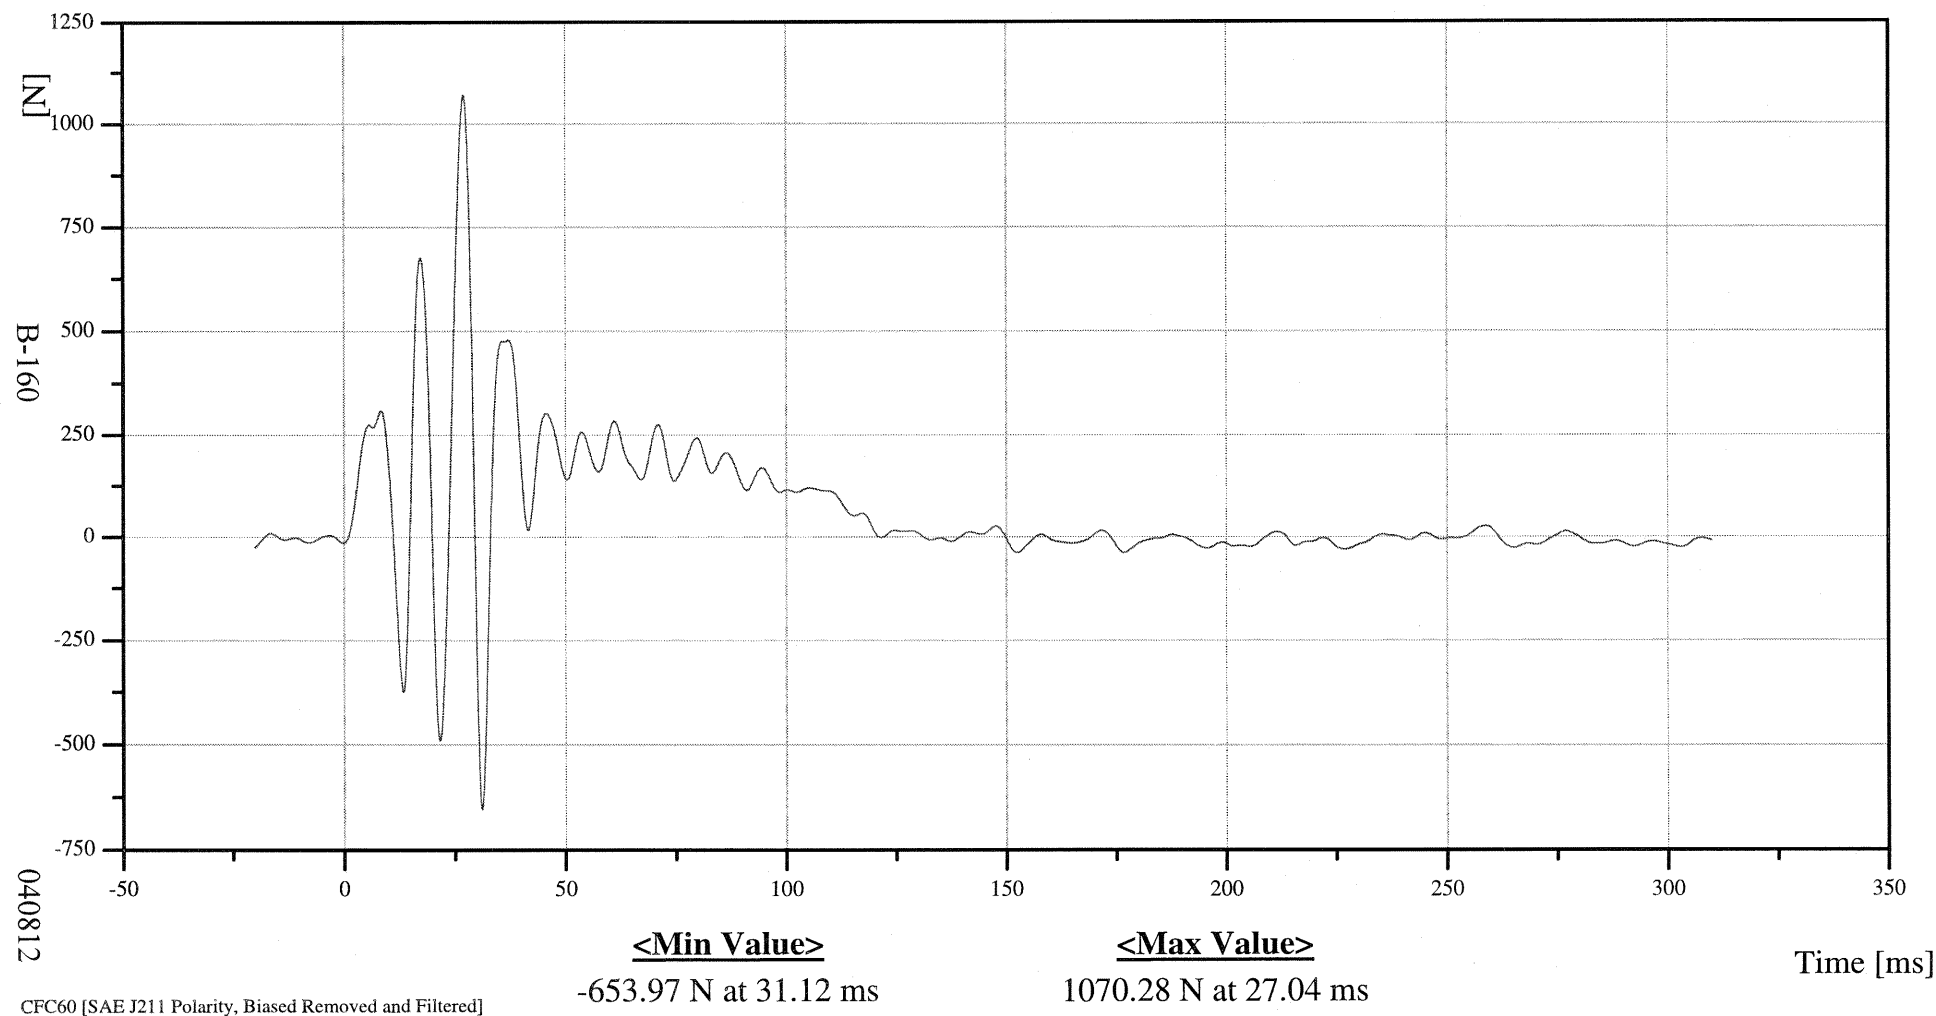



Transportation Research Center, Inc.

ROW 1 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0114

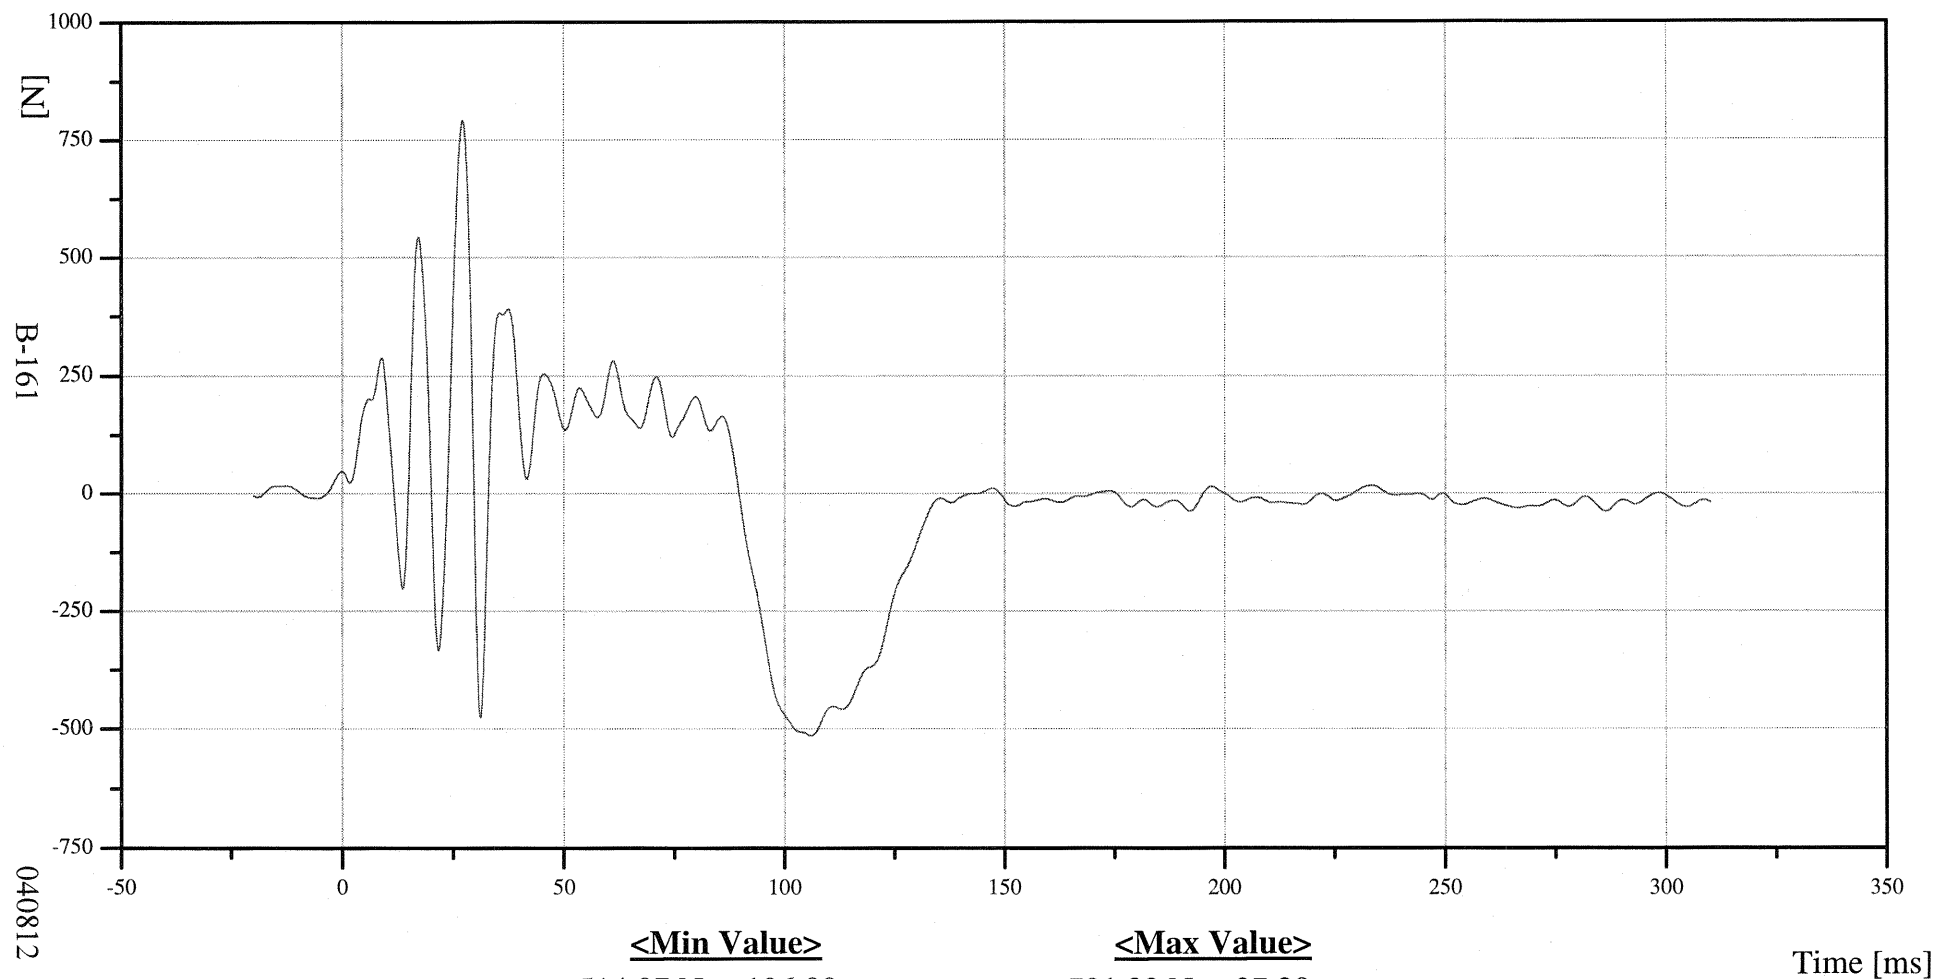

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0115

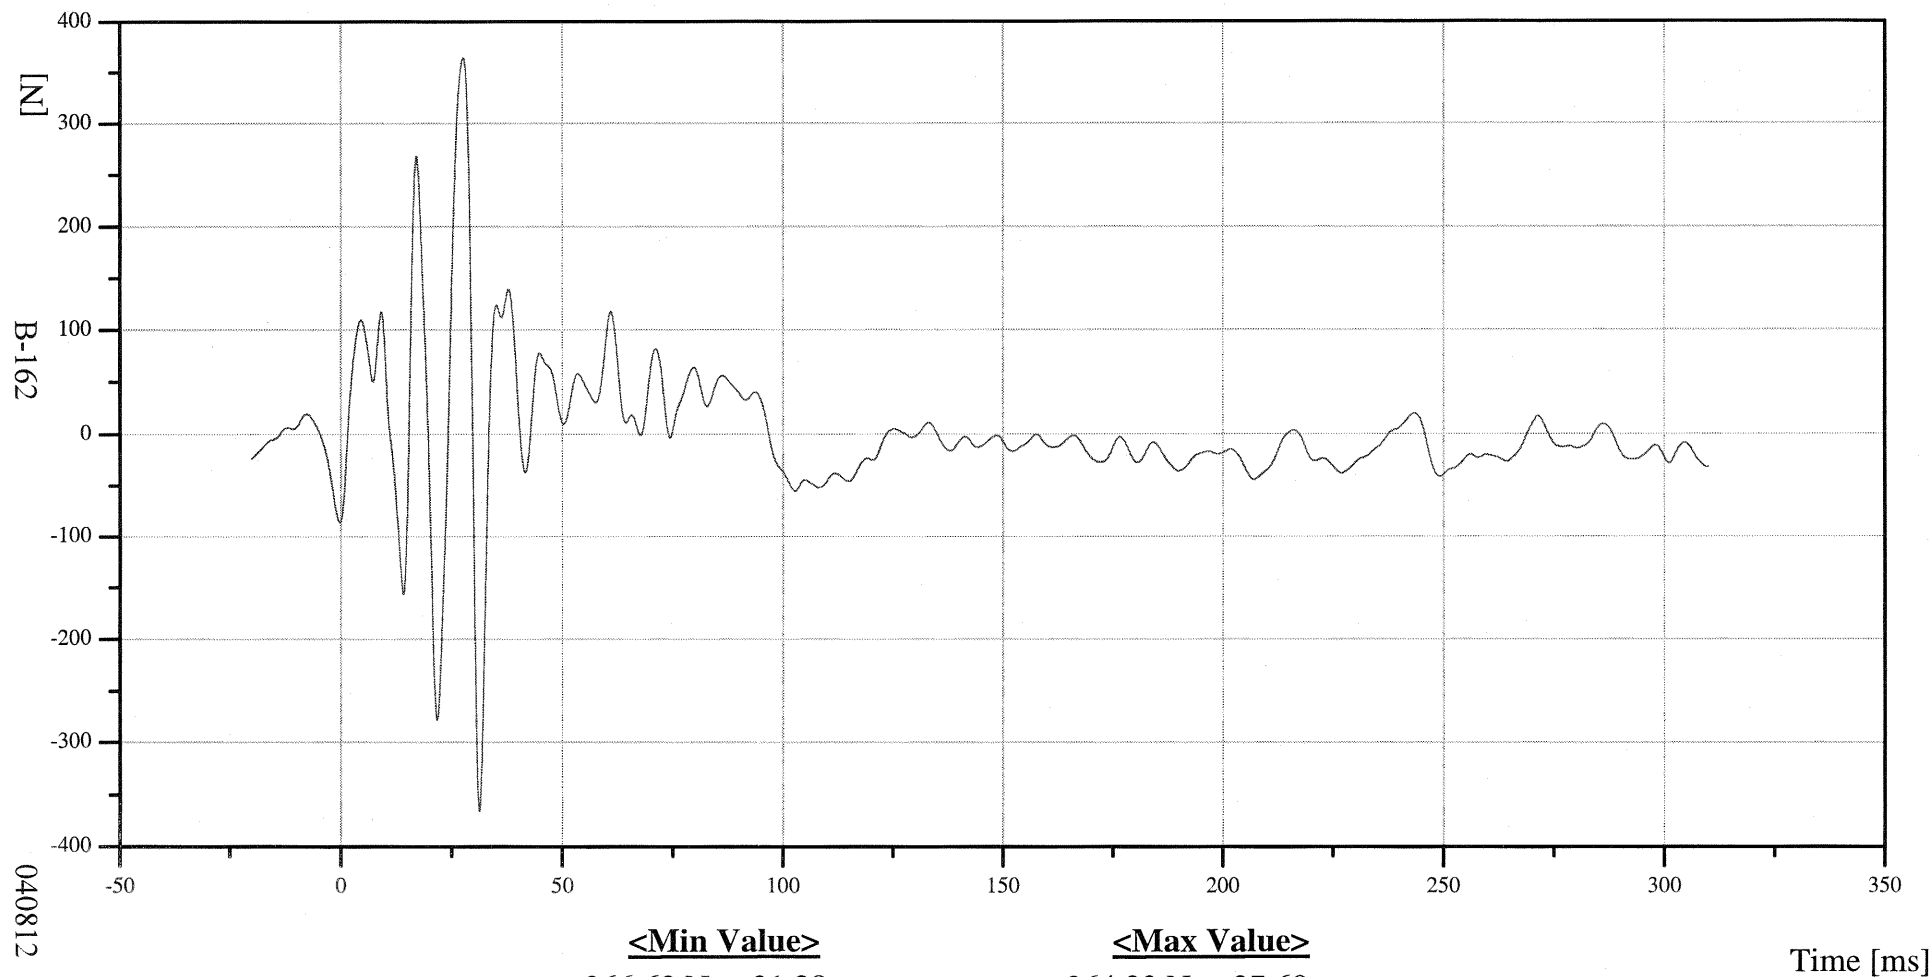

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 1 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0116

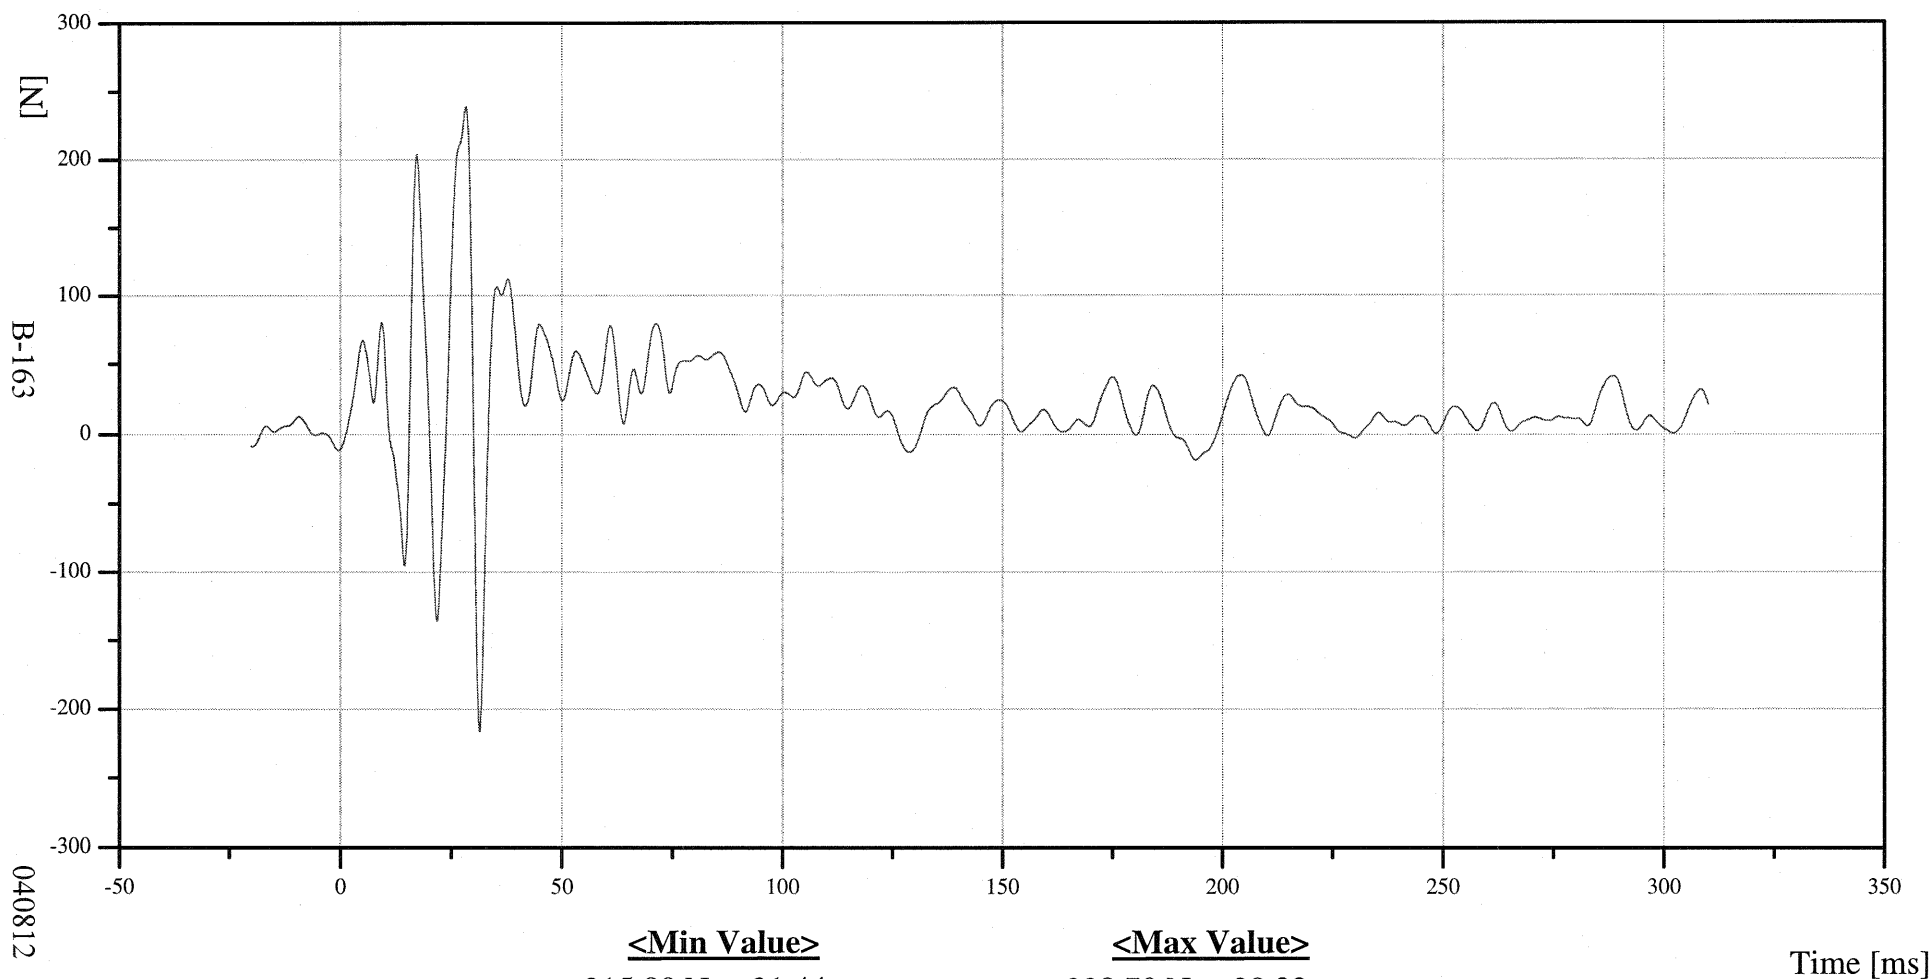

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0201

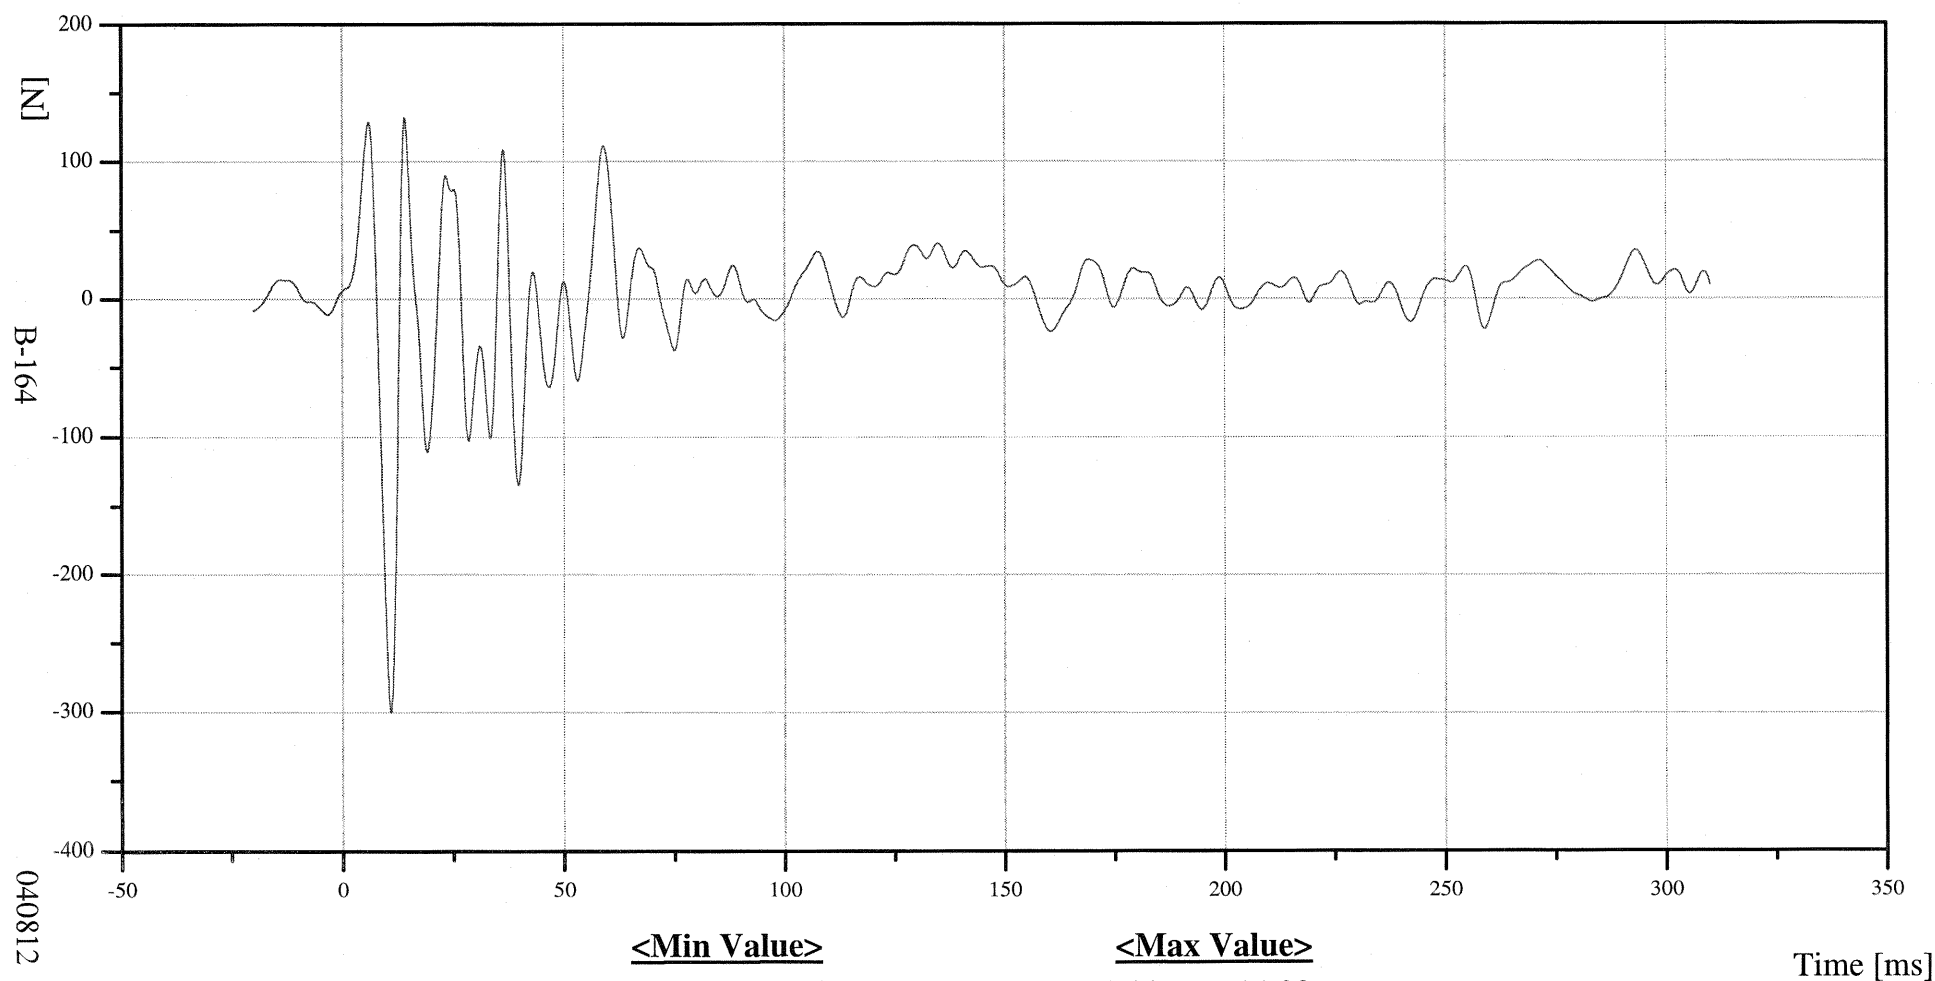

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0202

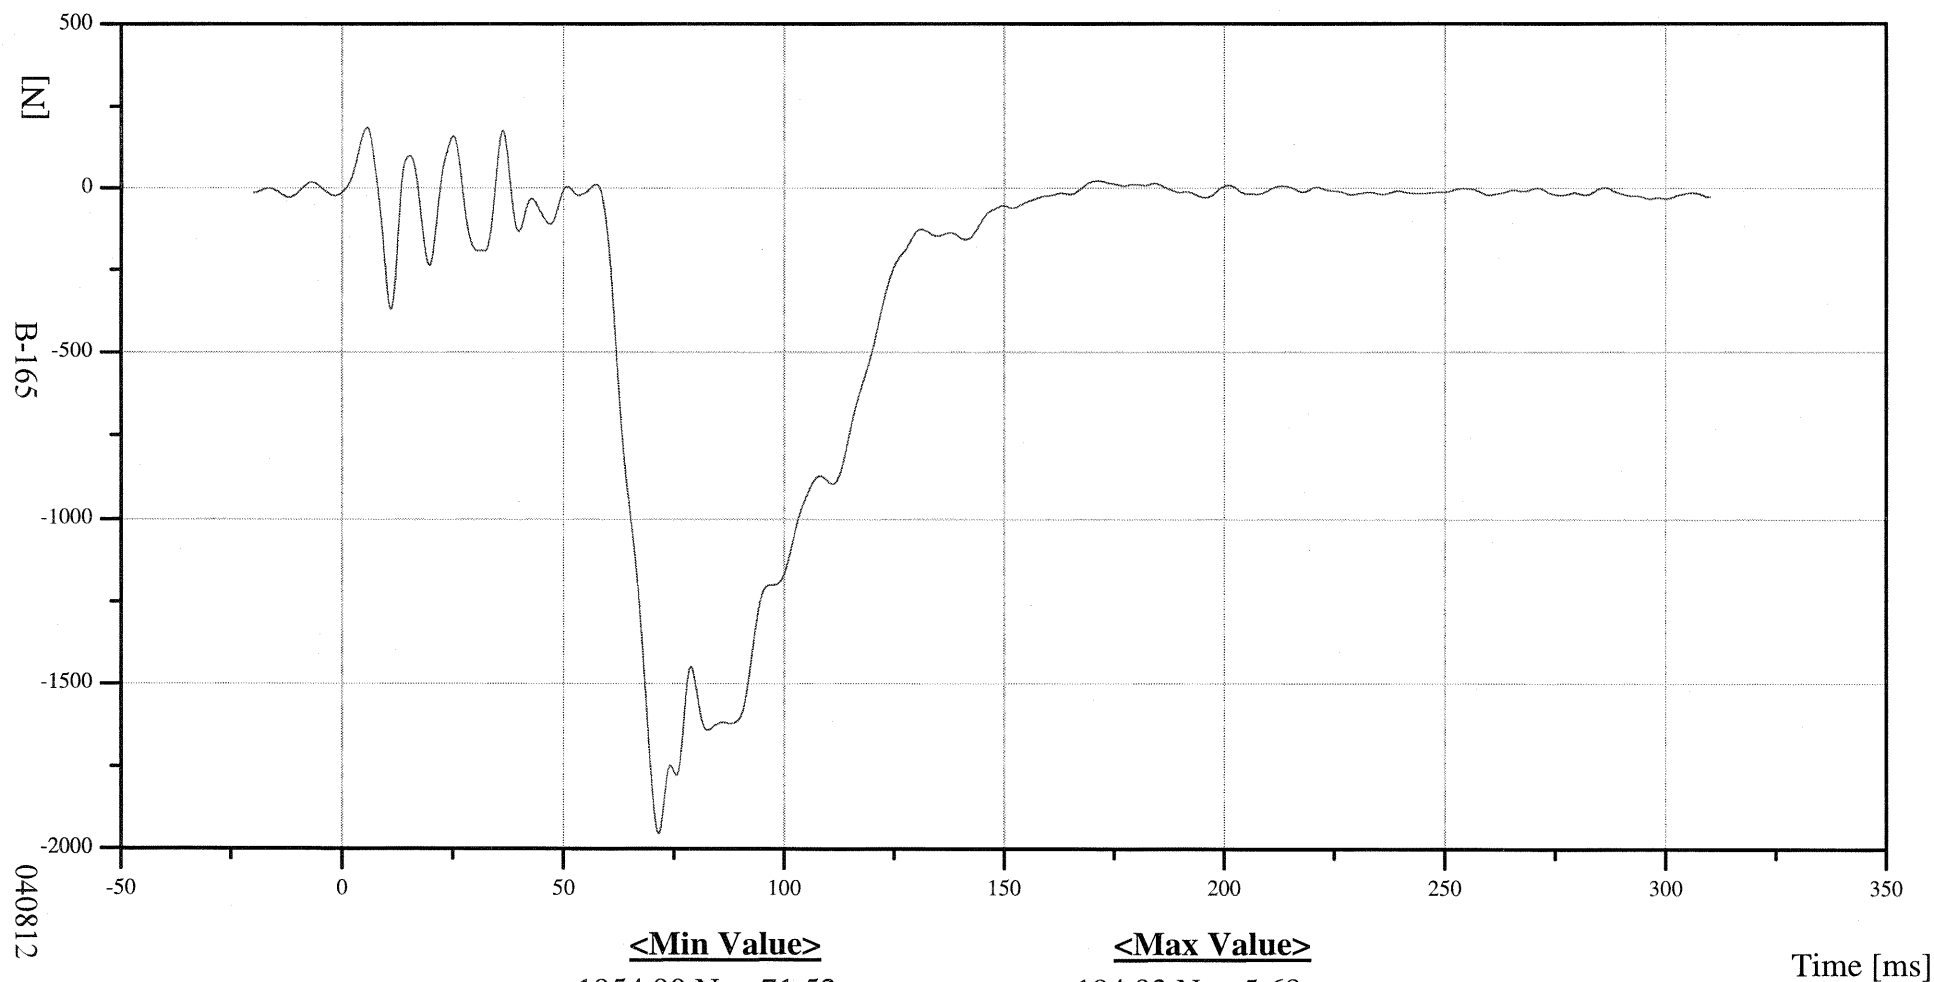

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0203

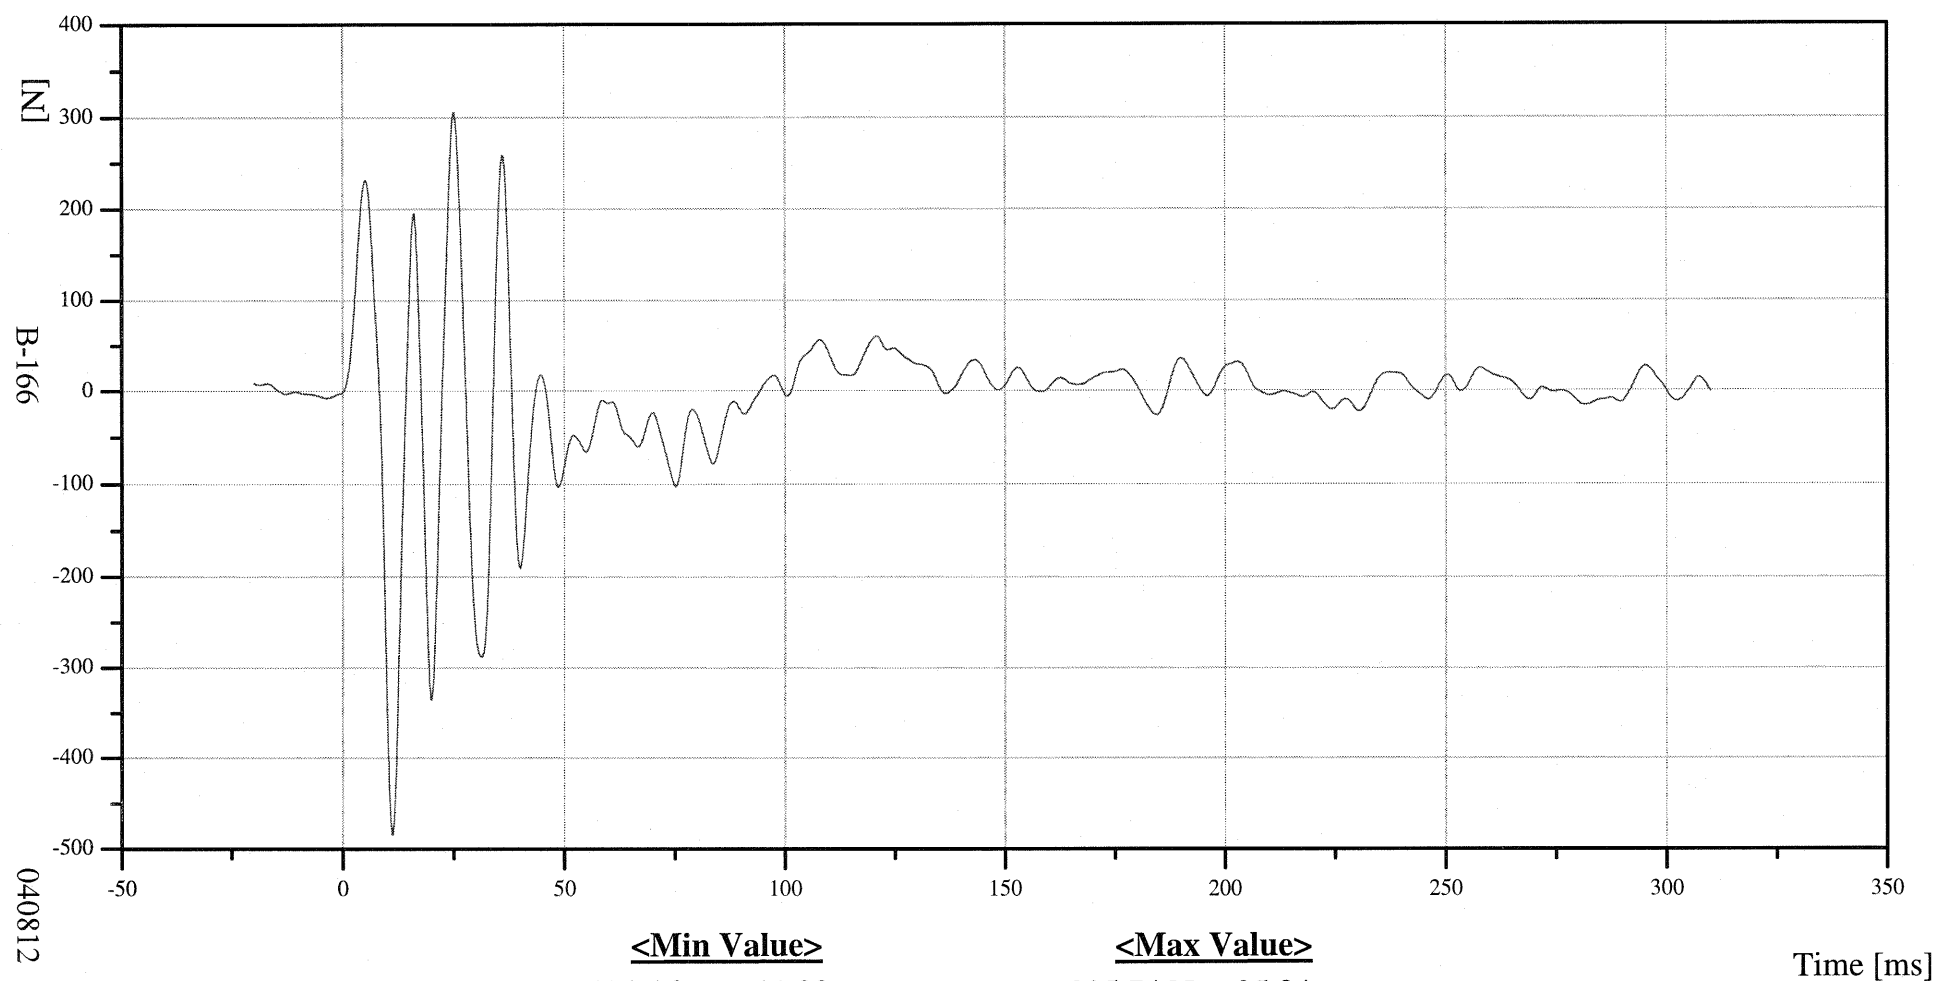

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0204

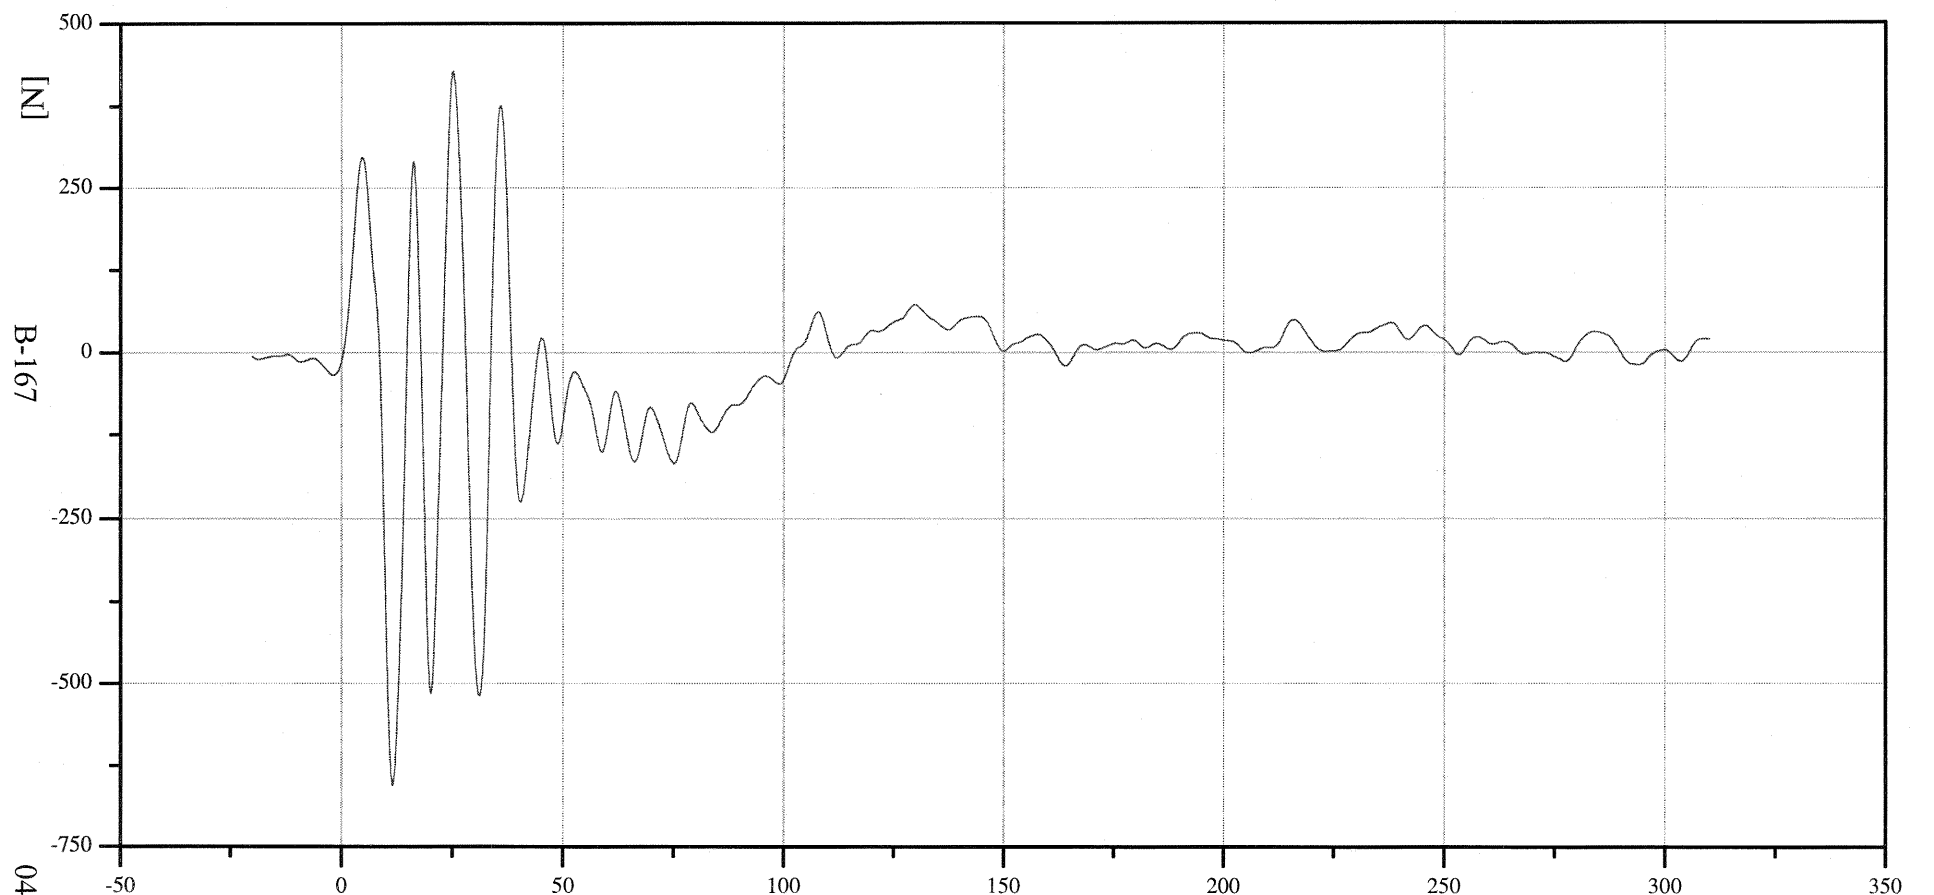

<Min Value>

-654.17 N at 11.52 ms

<Max Value>

427.63 N at 25.20 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0205

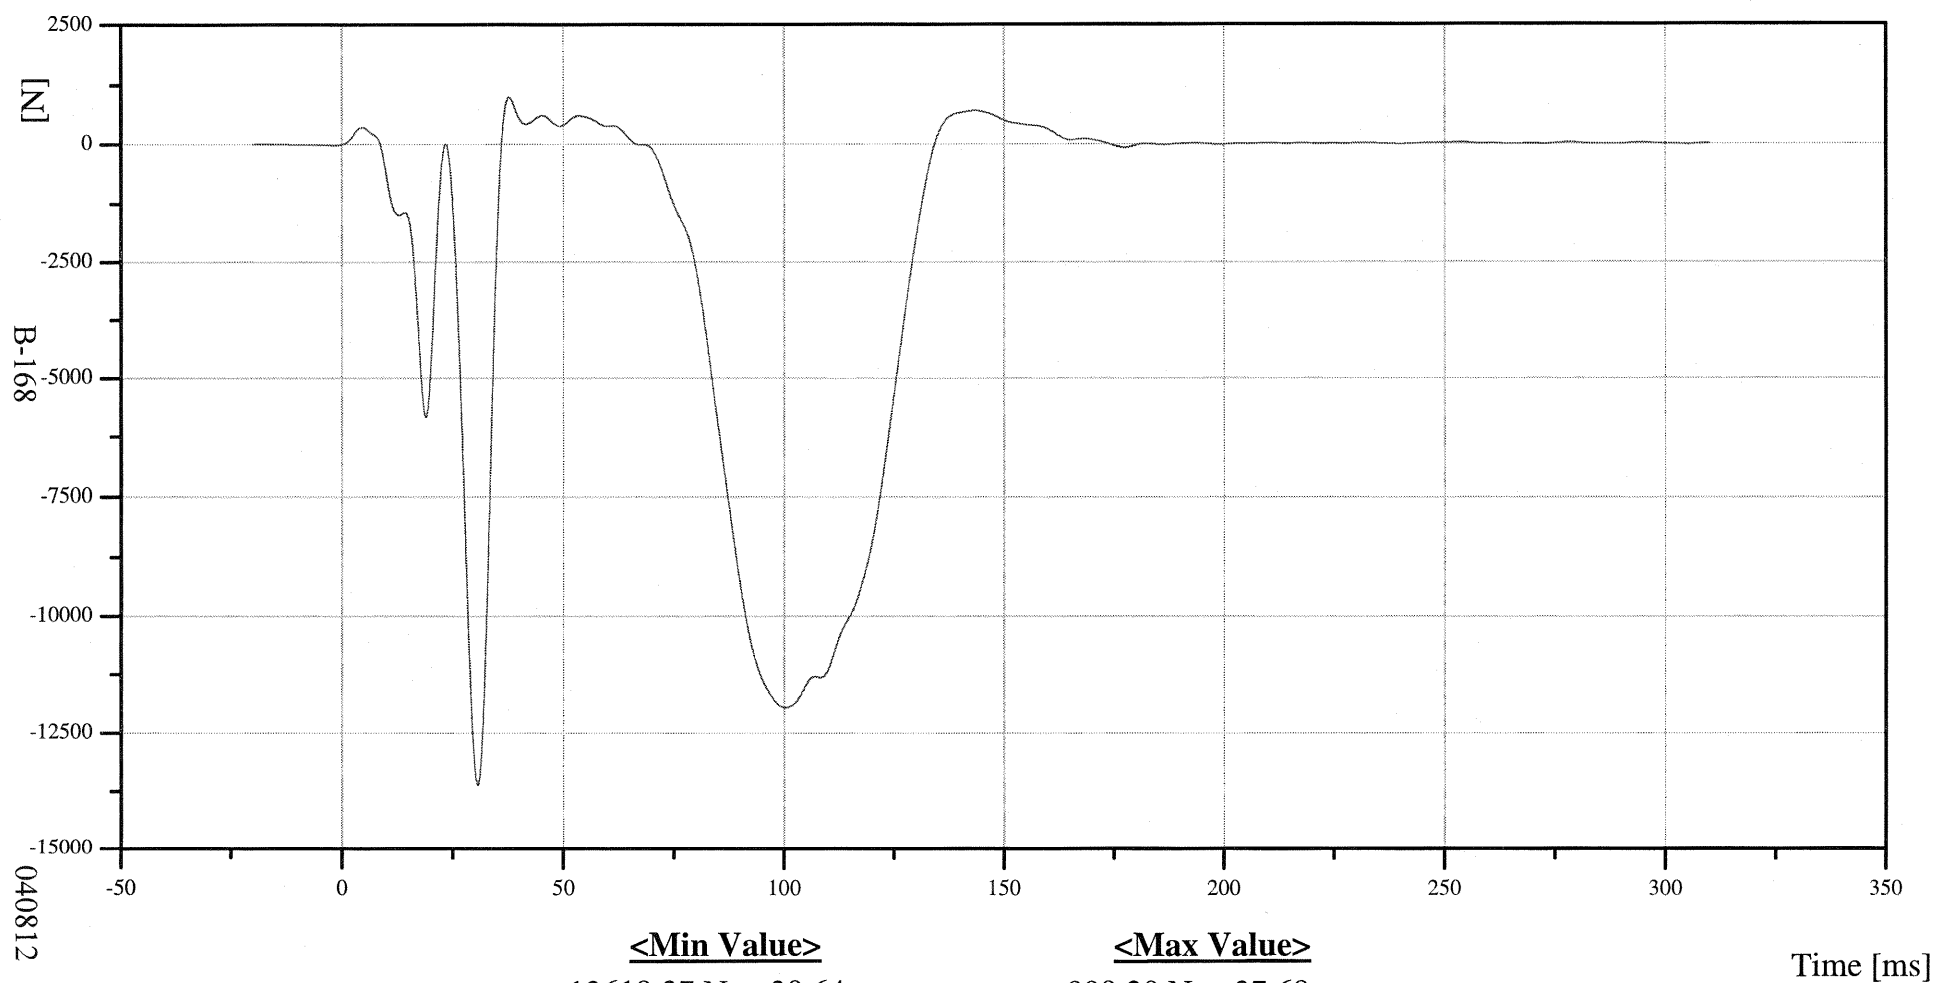

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0206

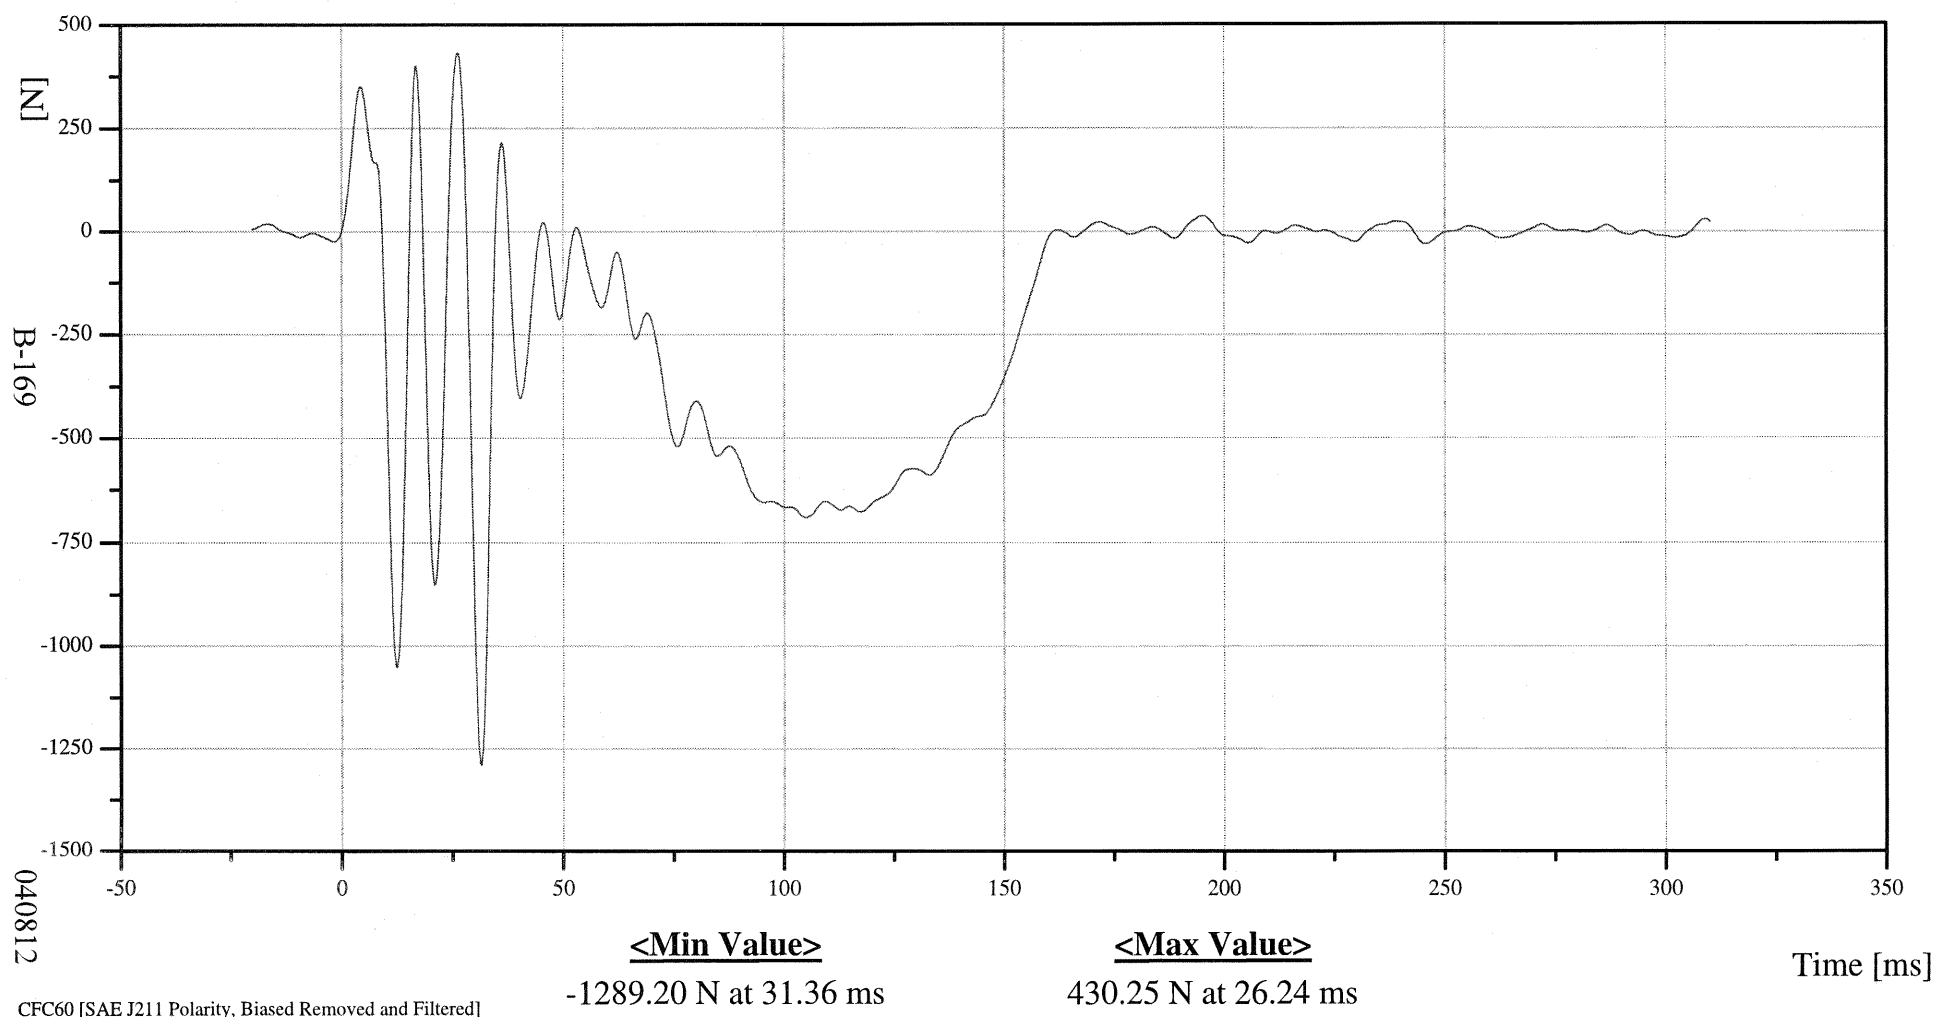



Transportation Research Center, Inc.

ROW 2 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0207

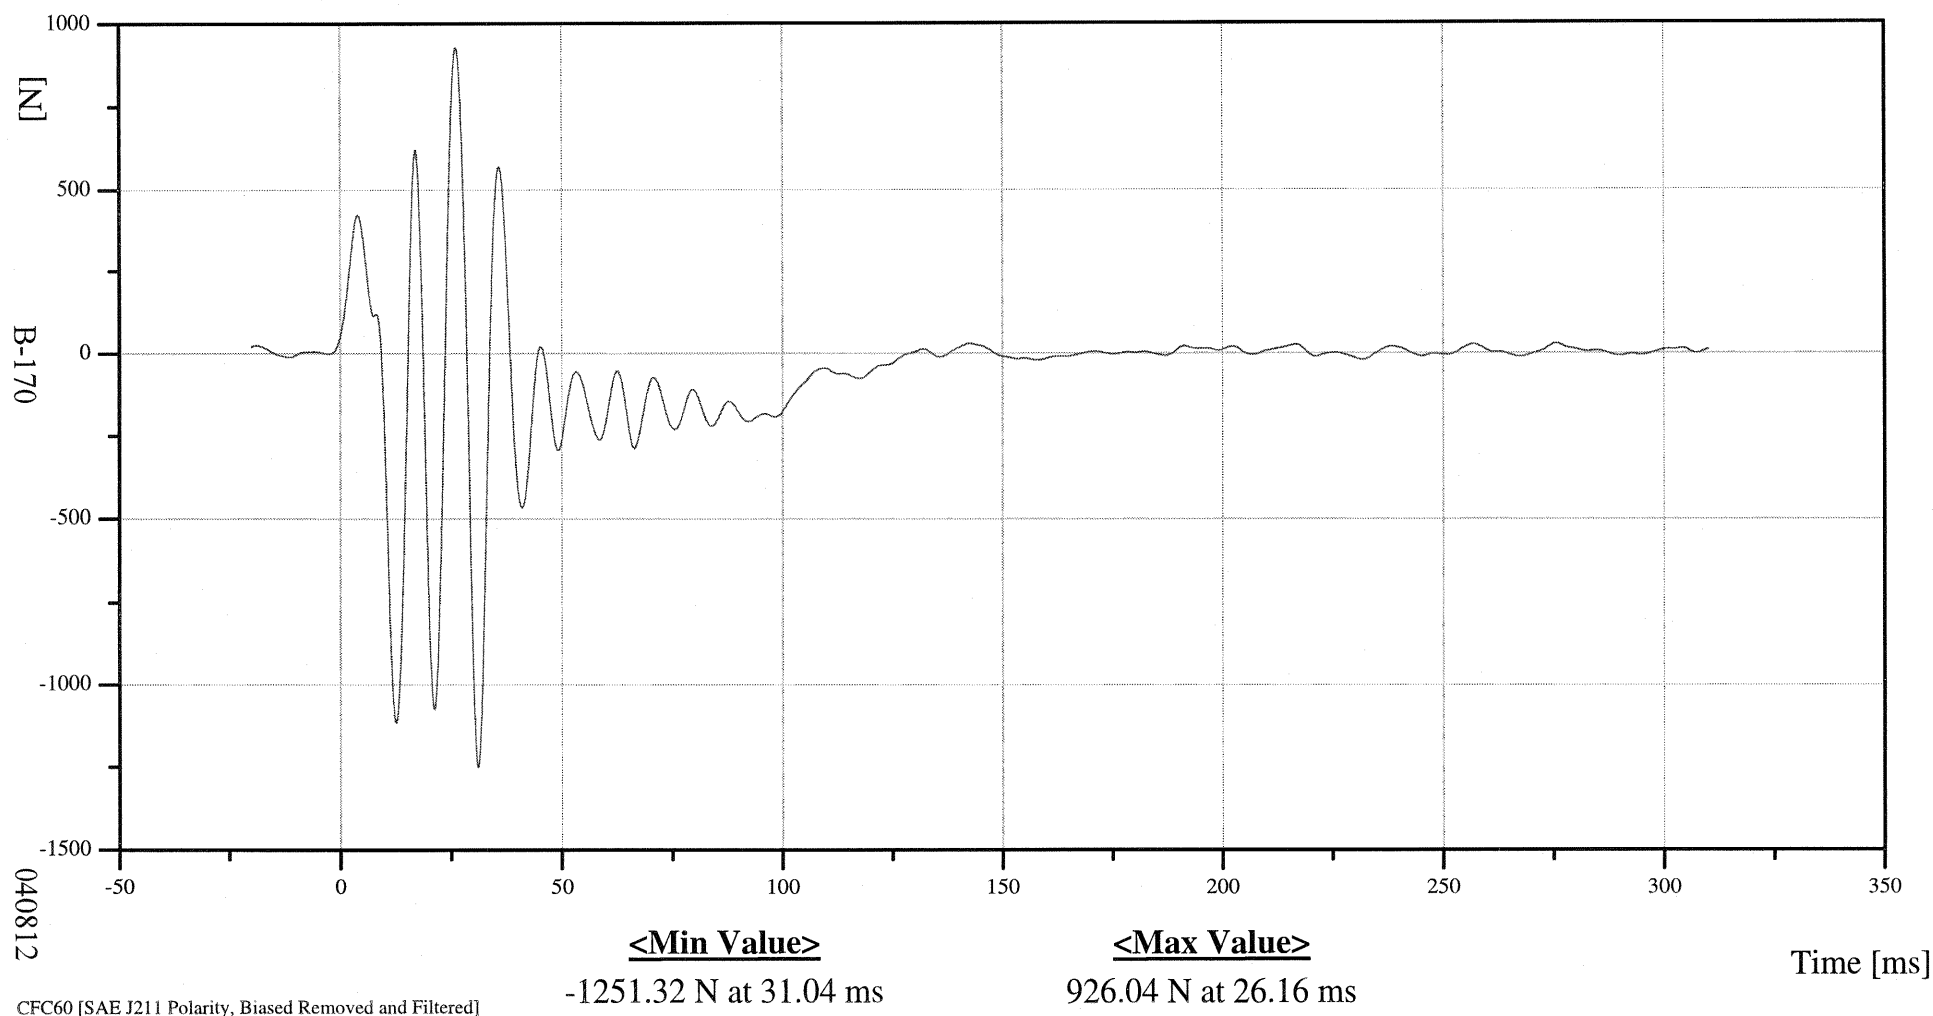



Transportation Research Center, Inc.

ROW 2 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0208

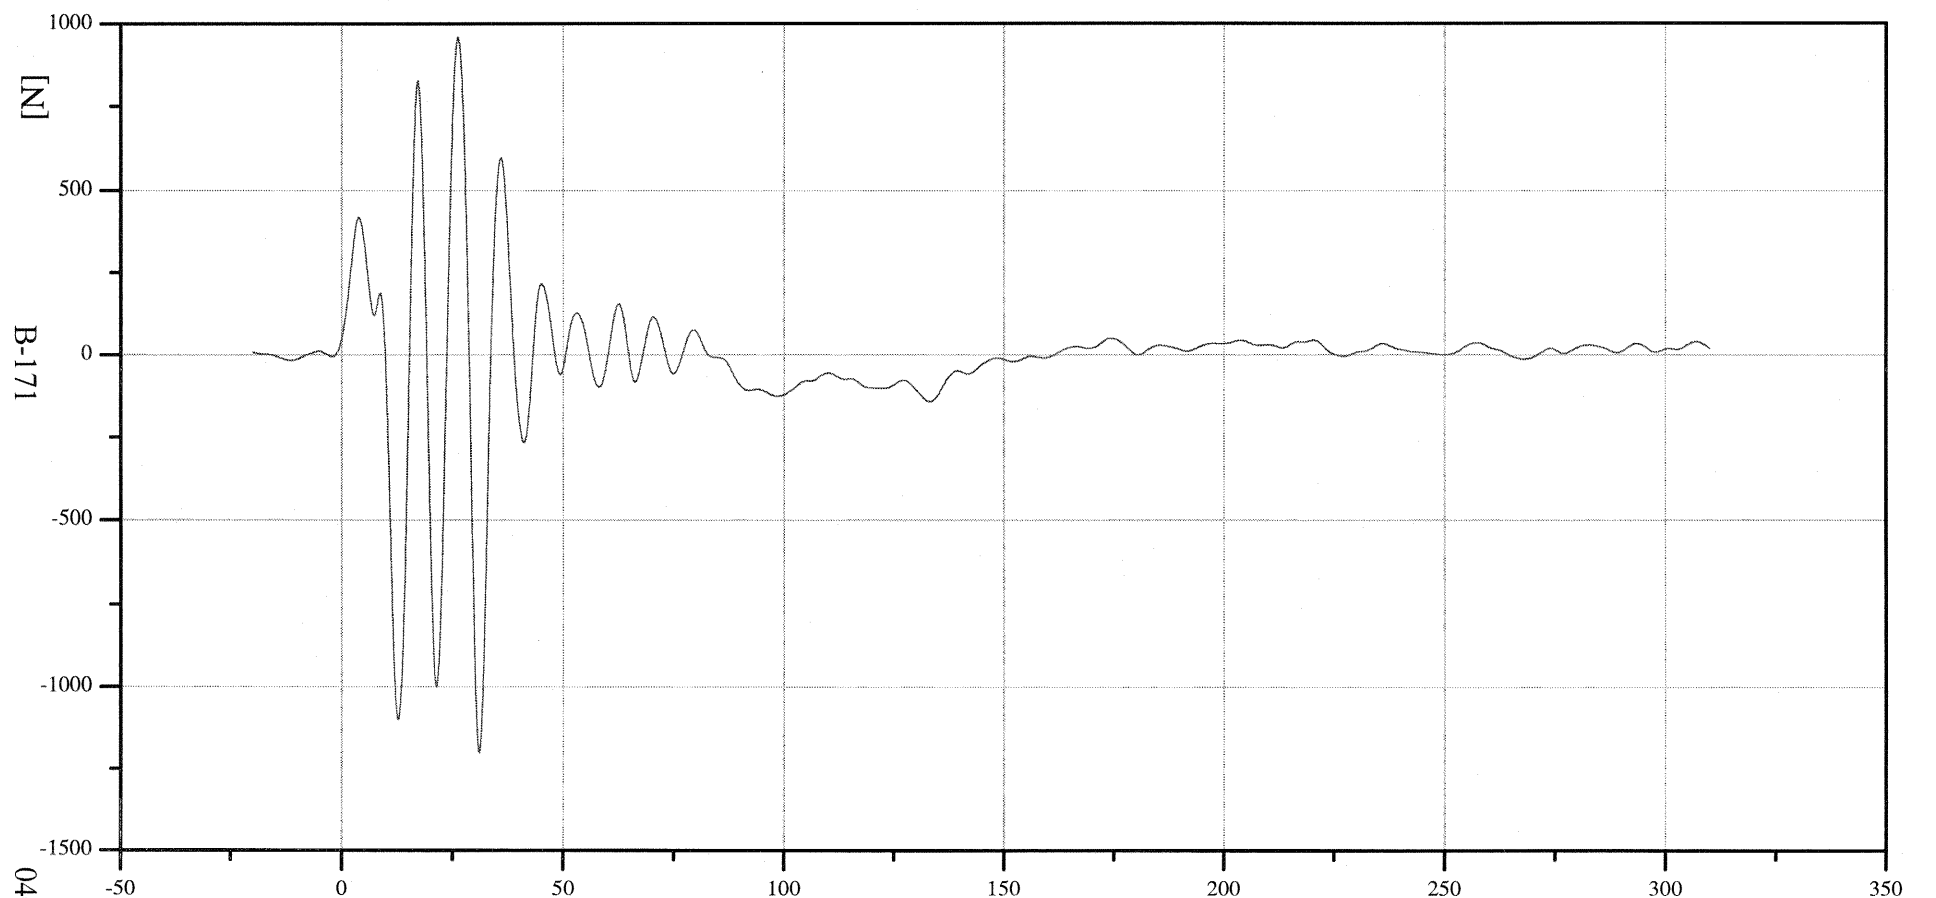

<Min Value>

-1199.66 N at 31.04 ms

<Max Value>

957.84 N at 26.24 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0209

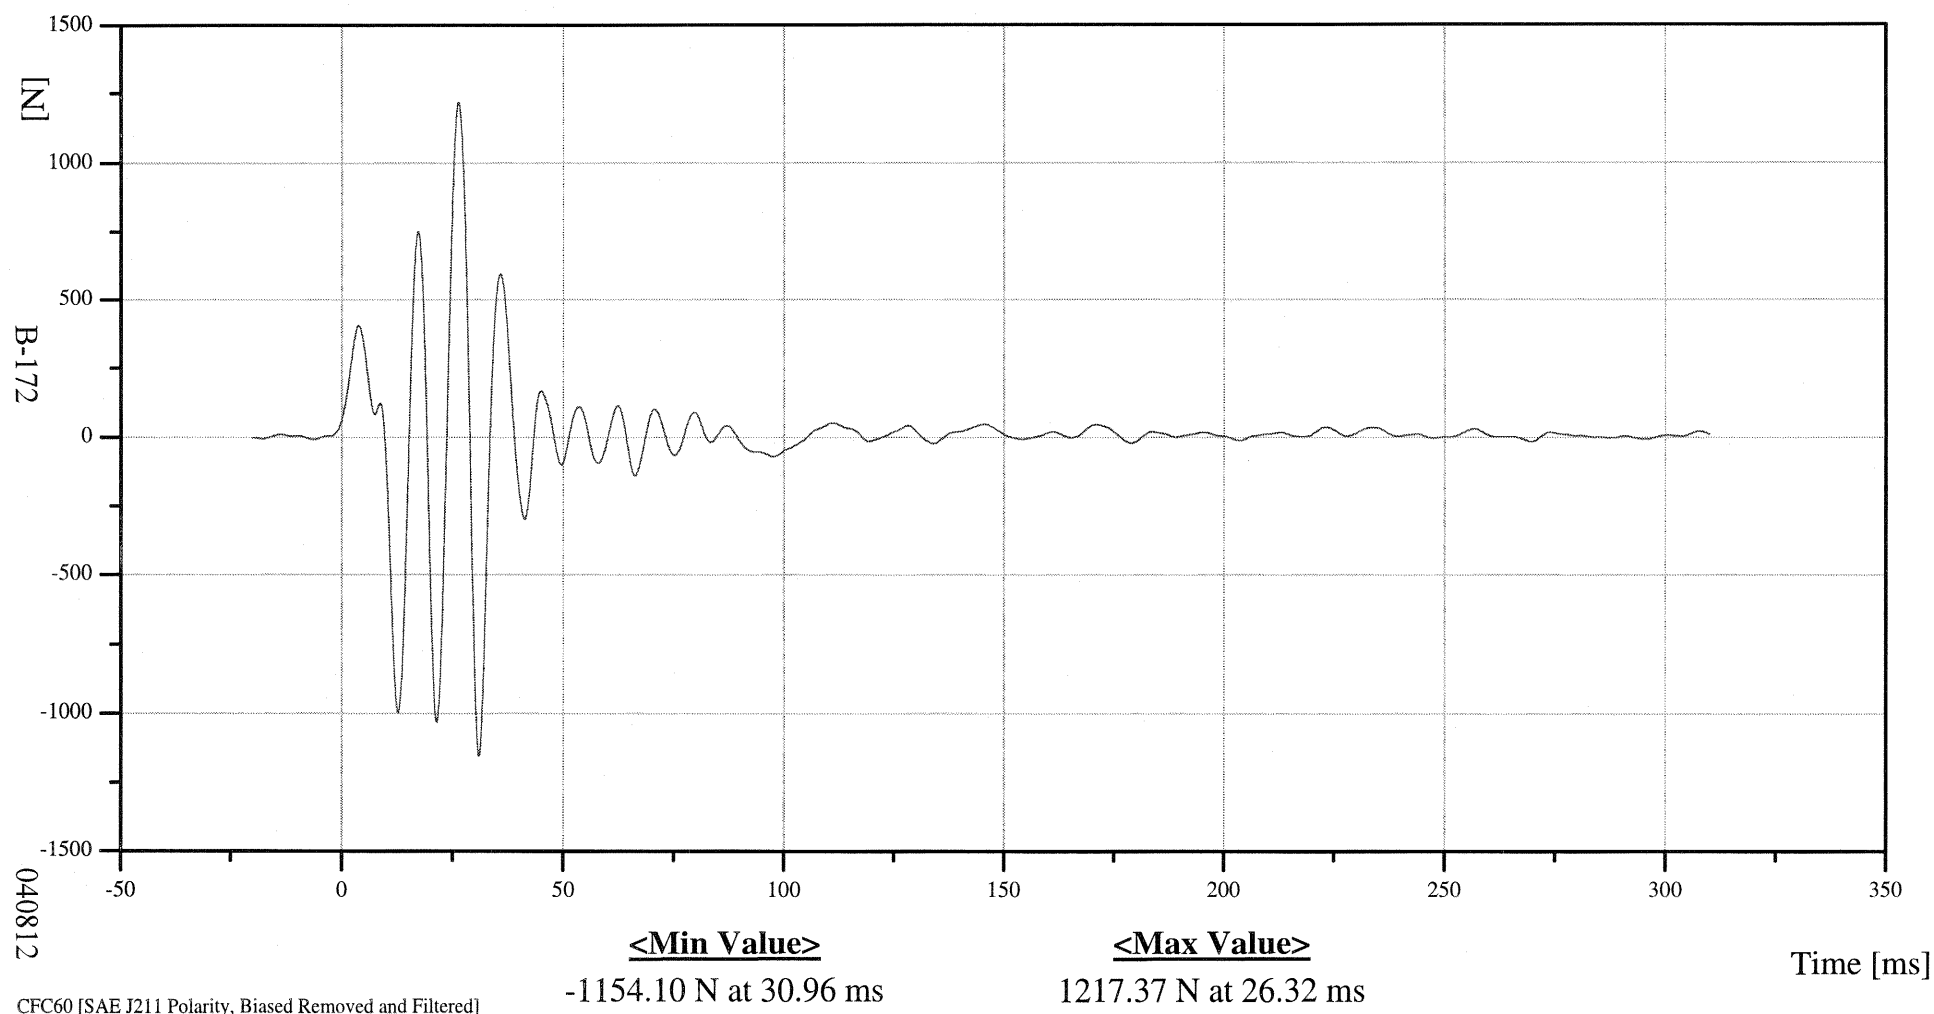



Transportation Research Center, Inc.

ROW 2 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0210

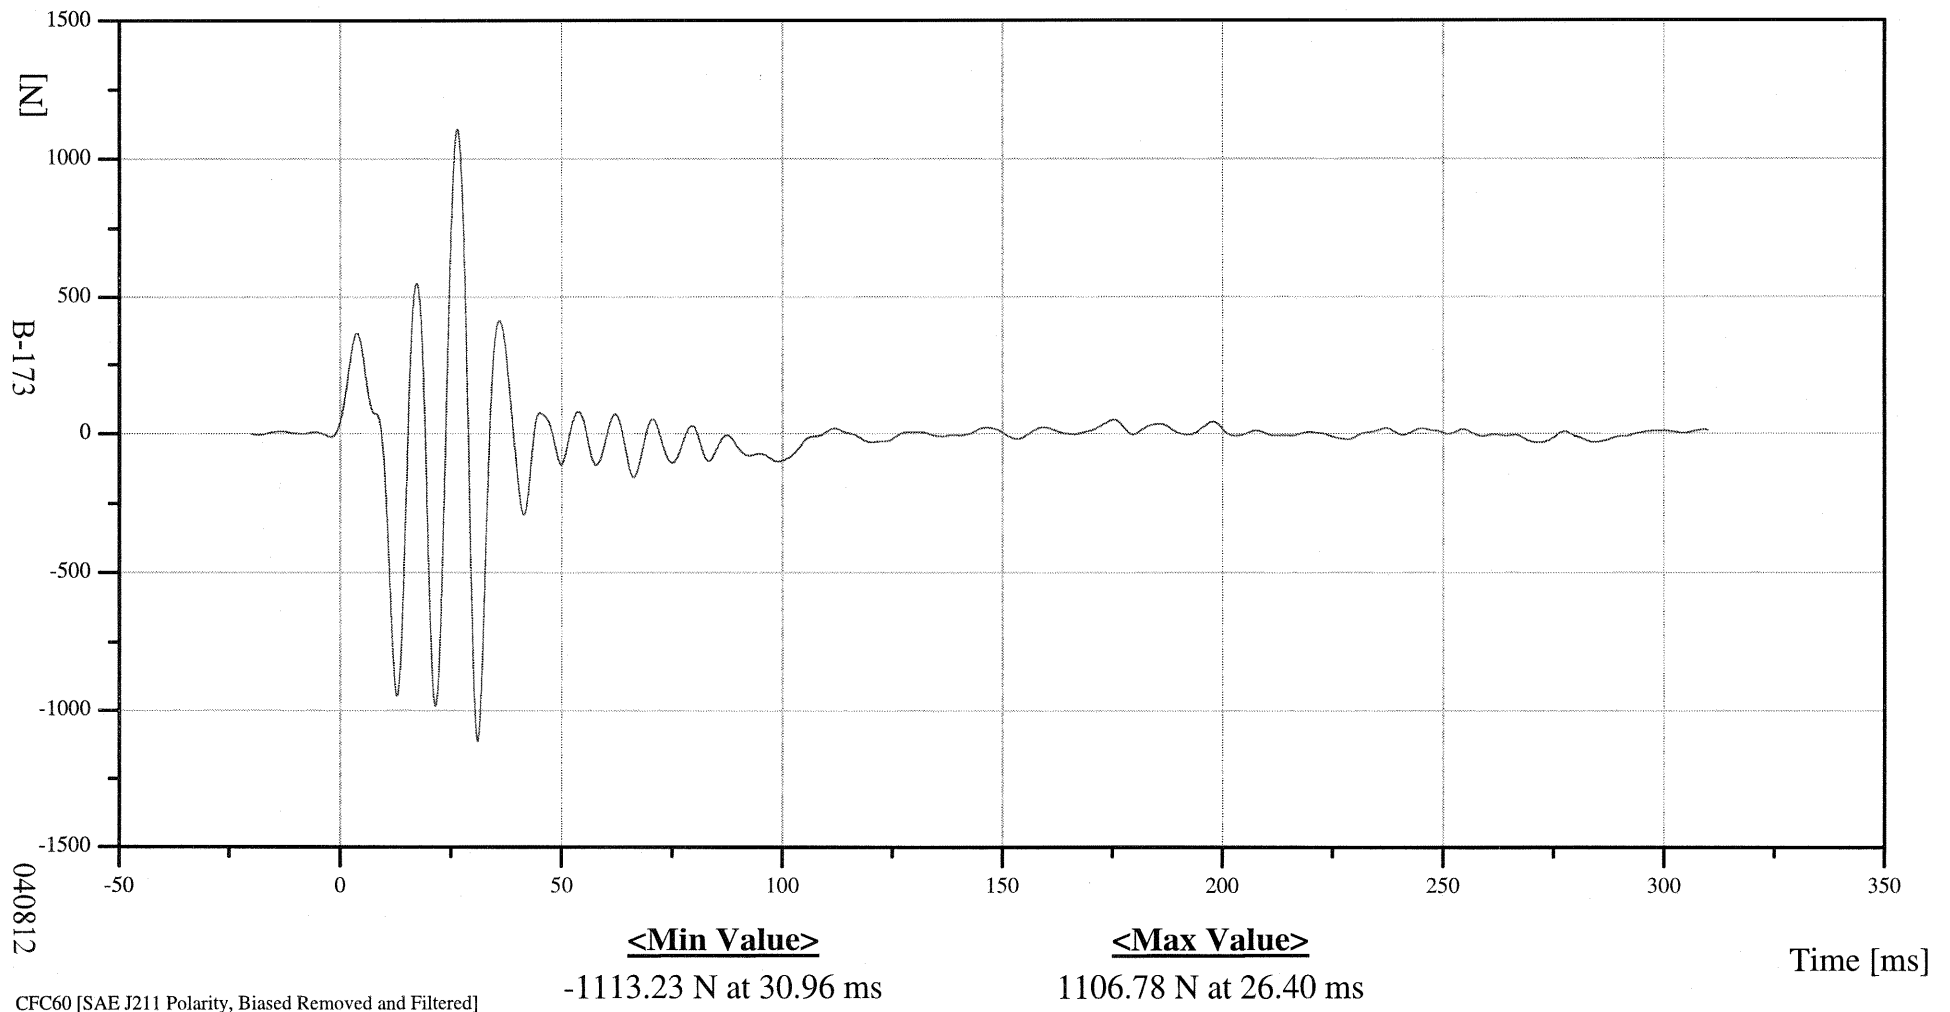



Transportation Research Center, Inc.

ROW 2 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0211

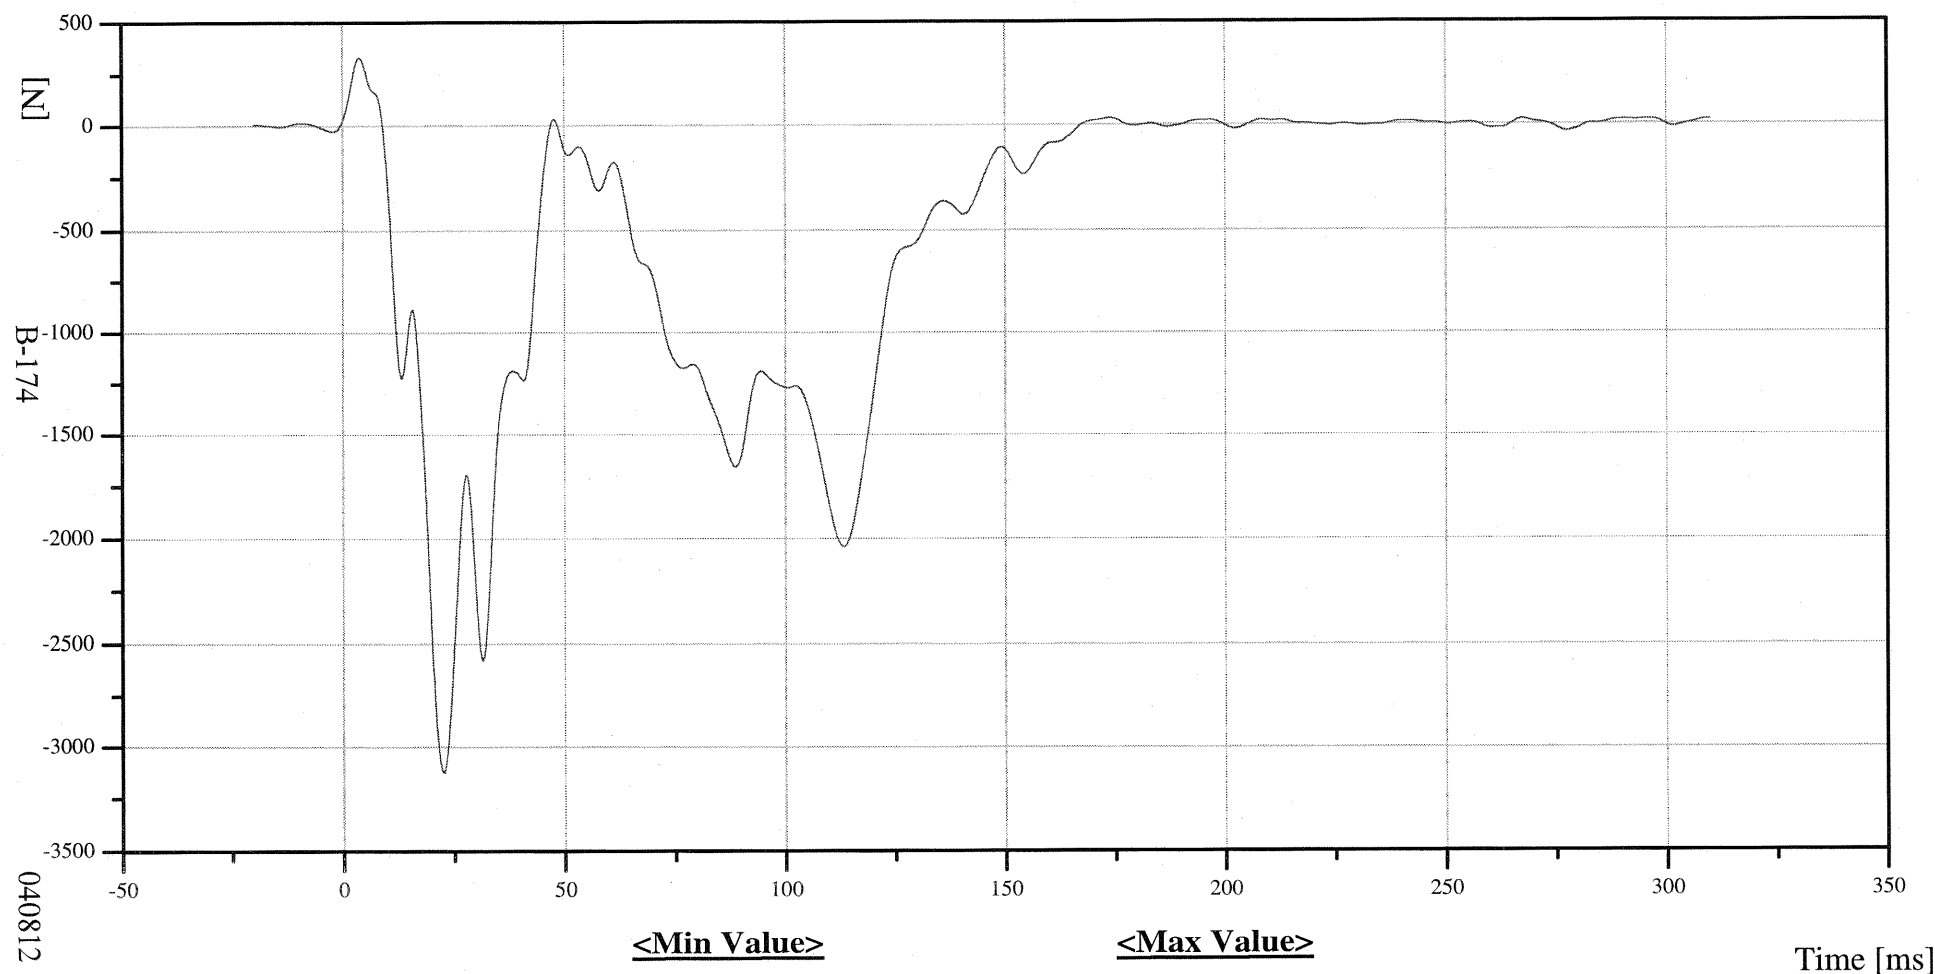

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 12

Date: 08/12/2004
Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0212

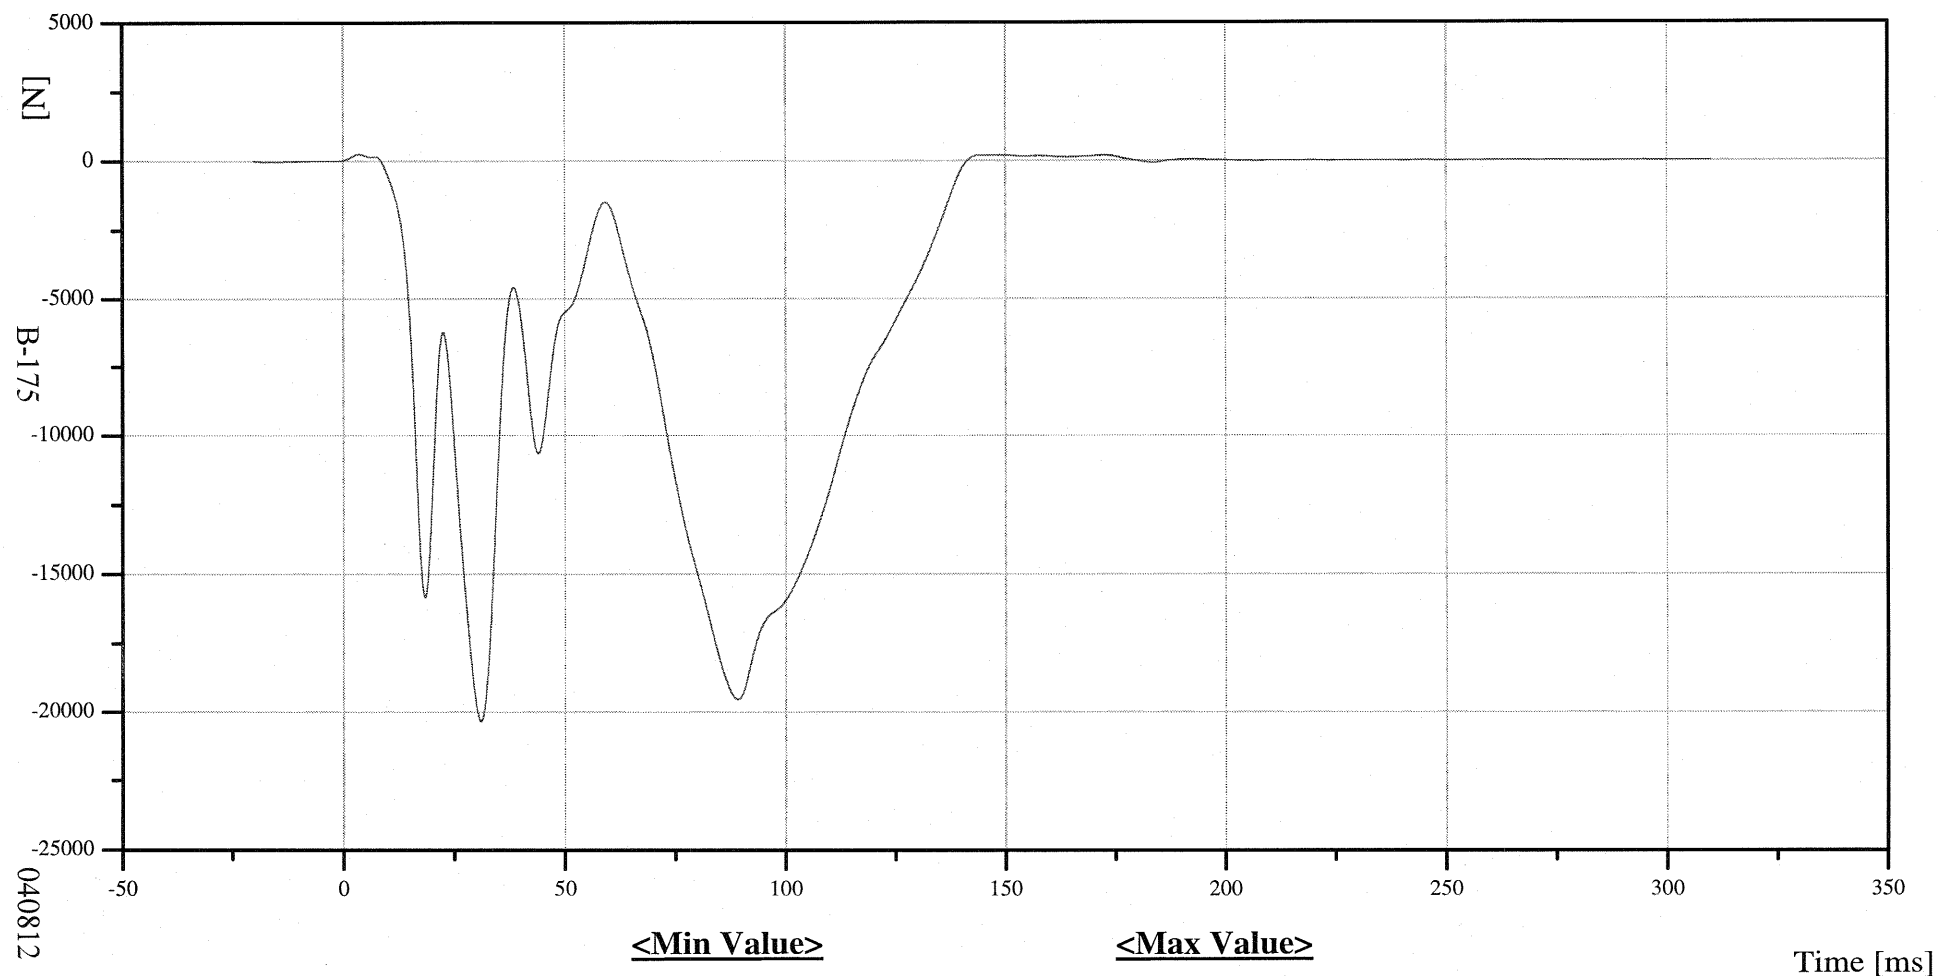

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0213

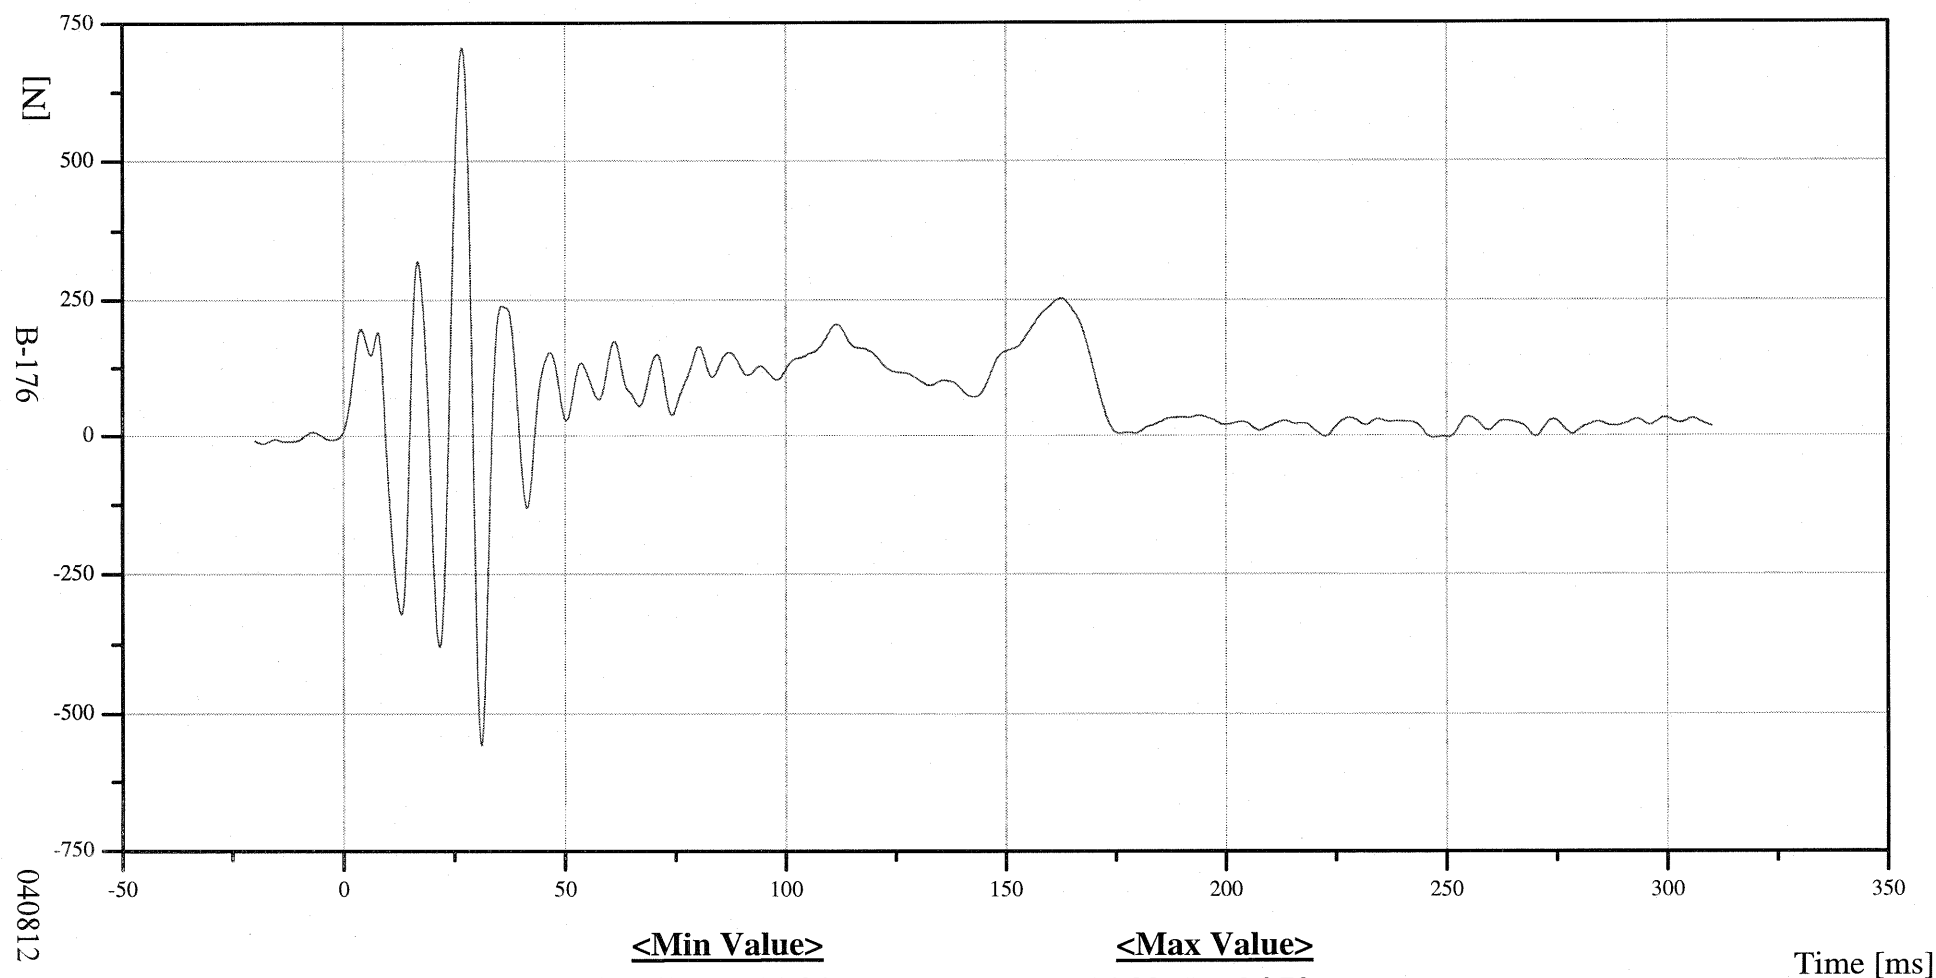

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0214

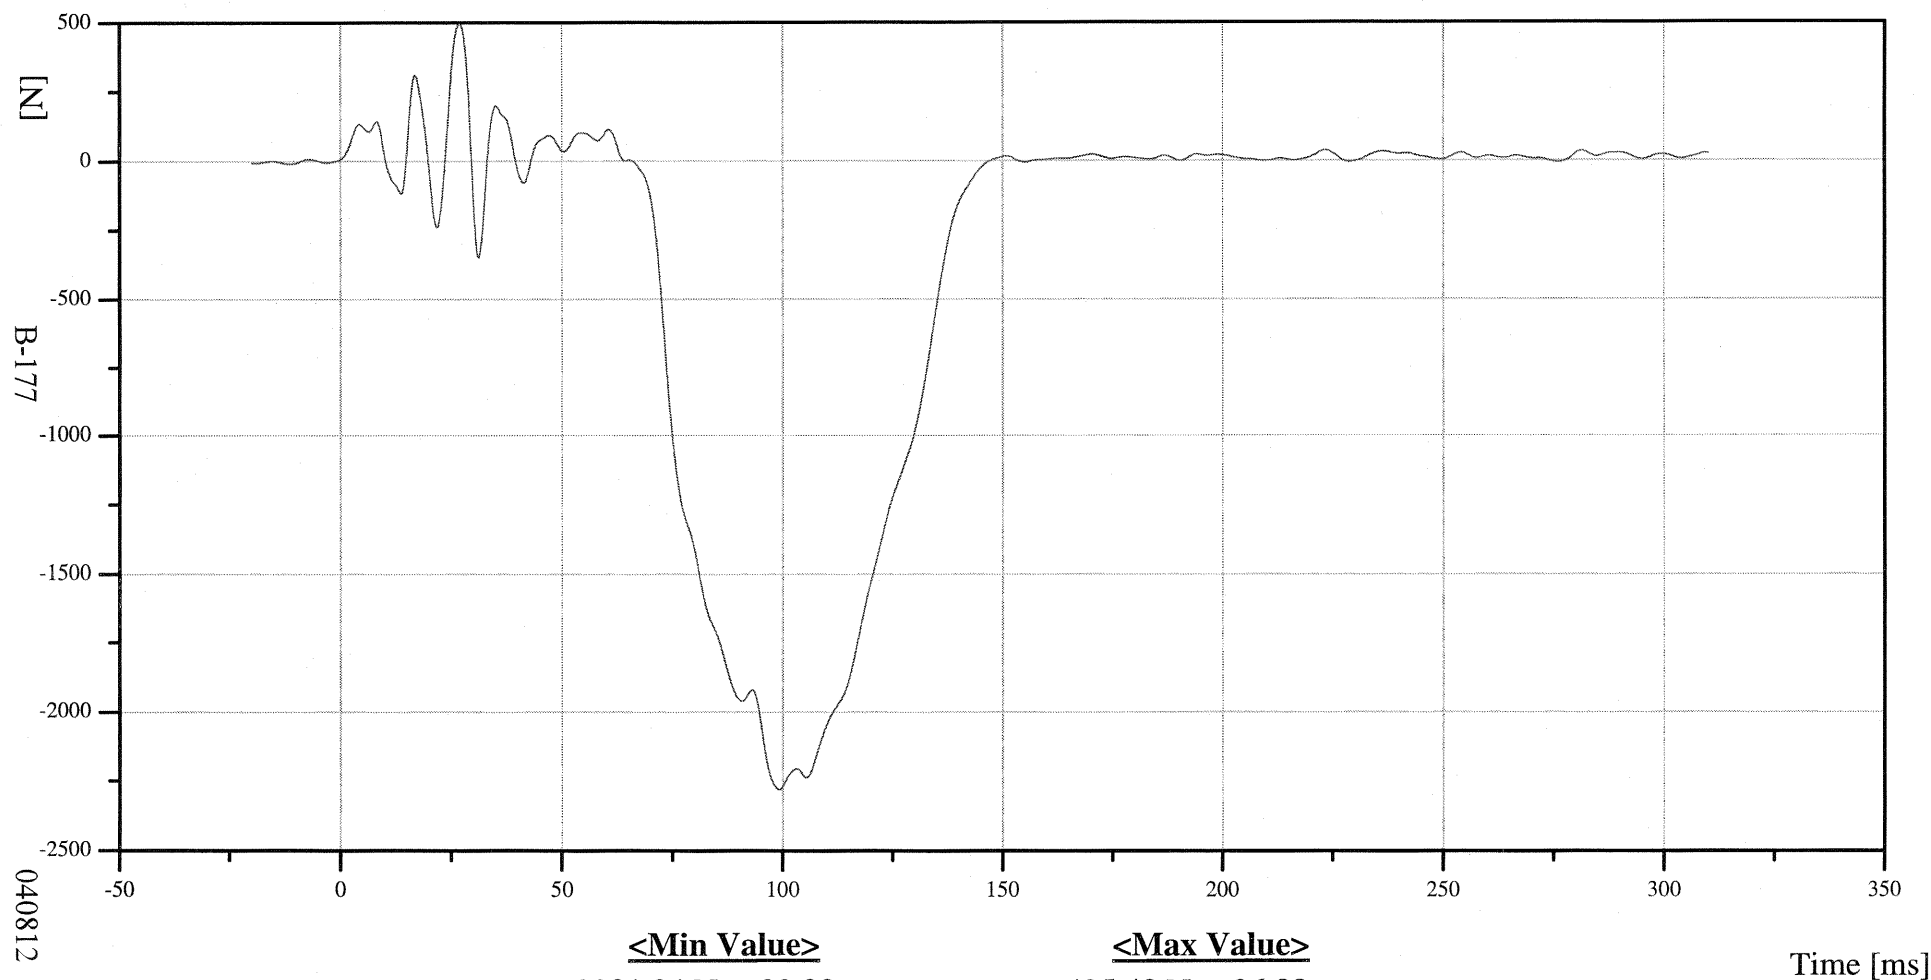

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0215

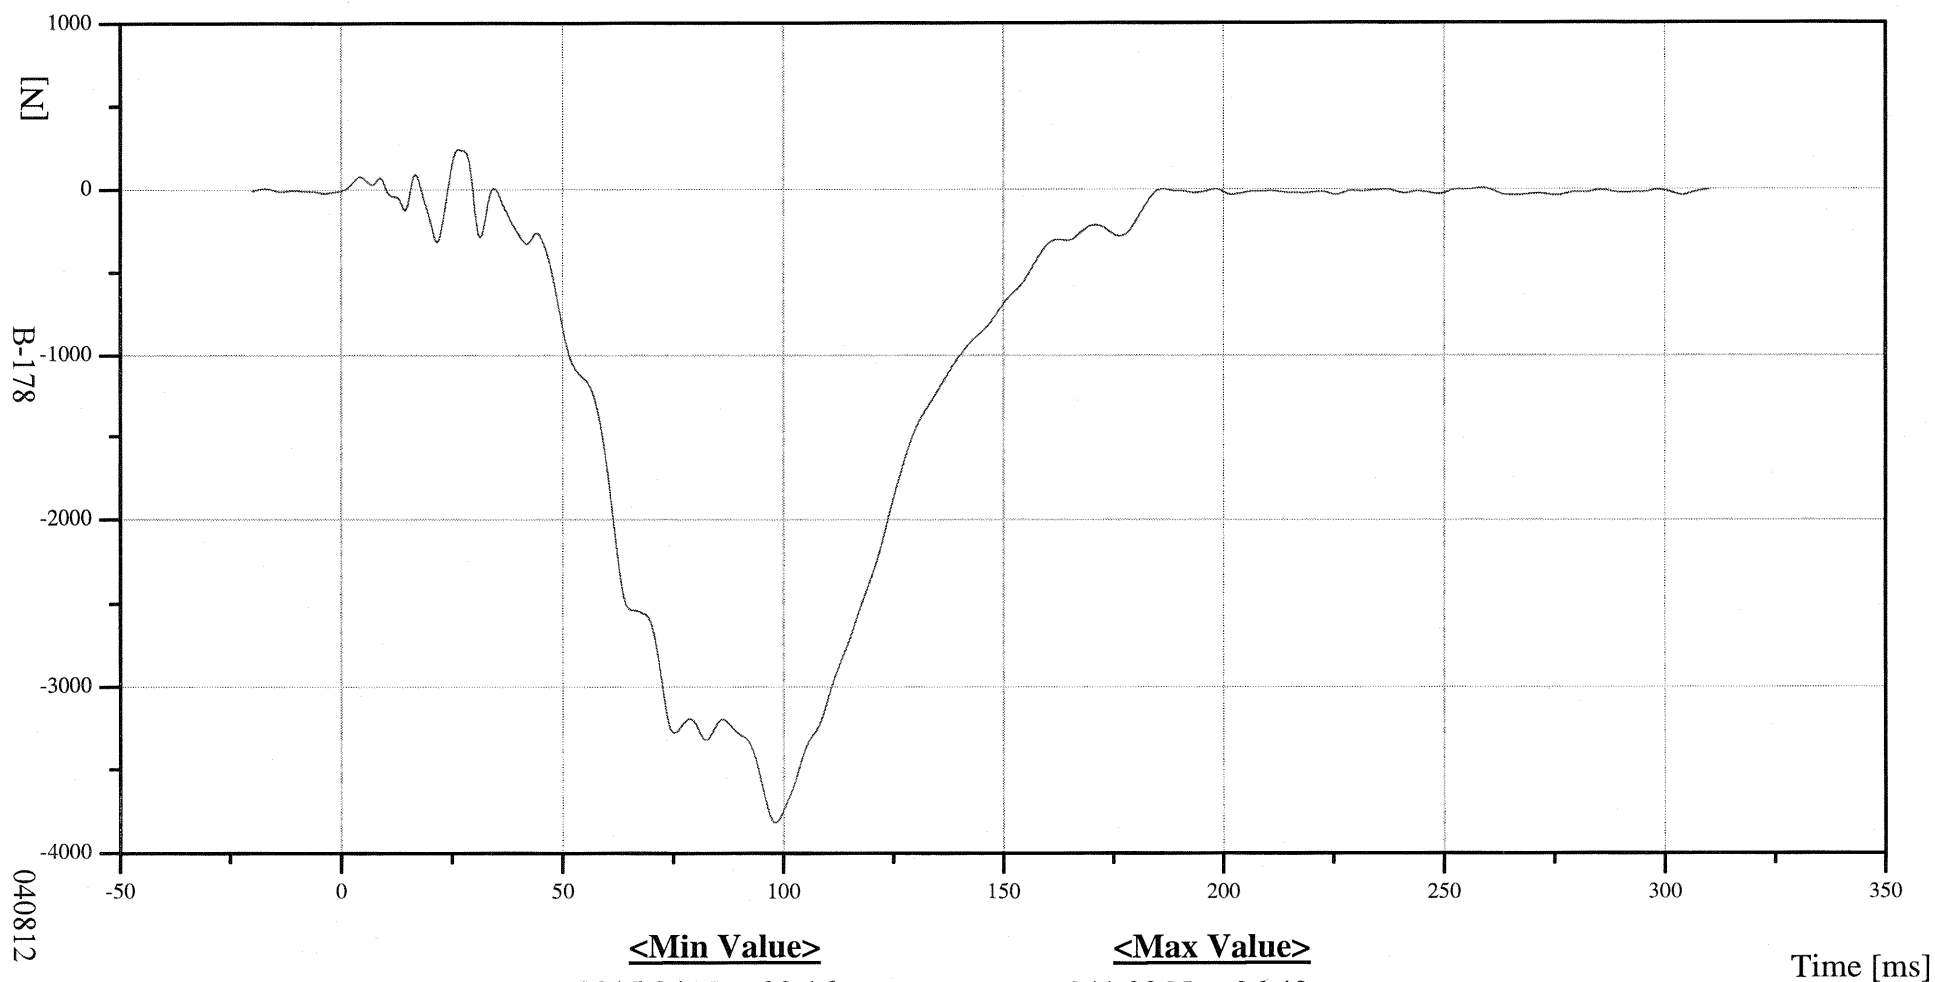

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 2 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0216

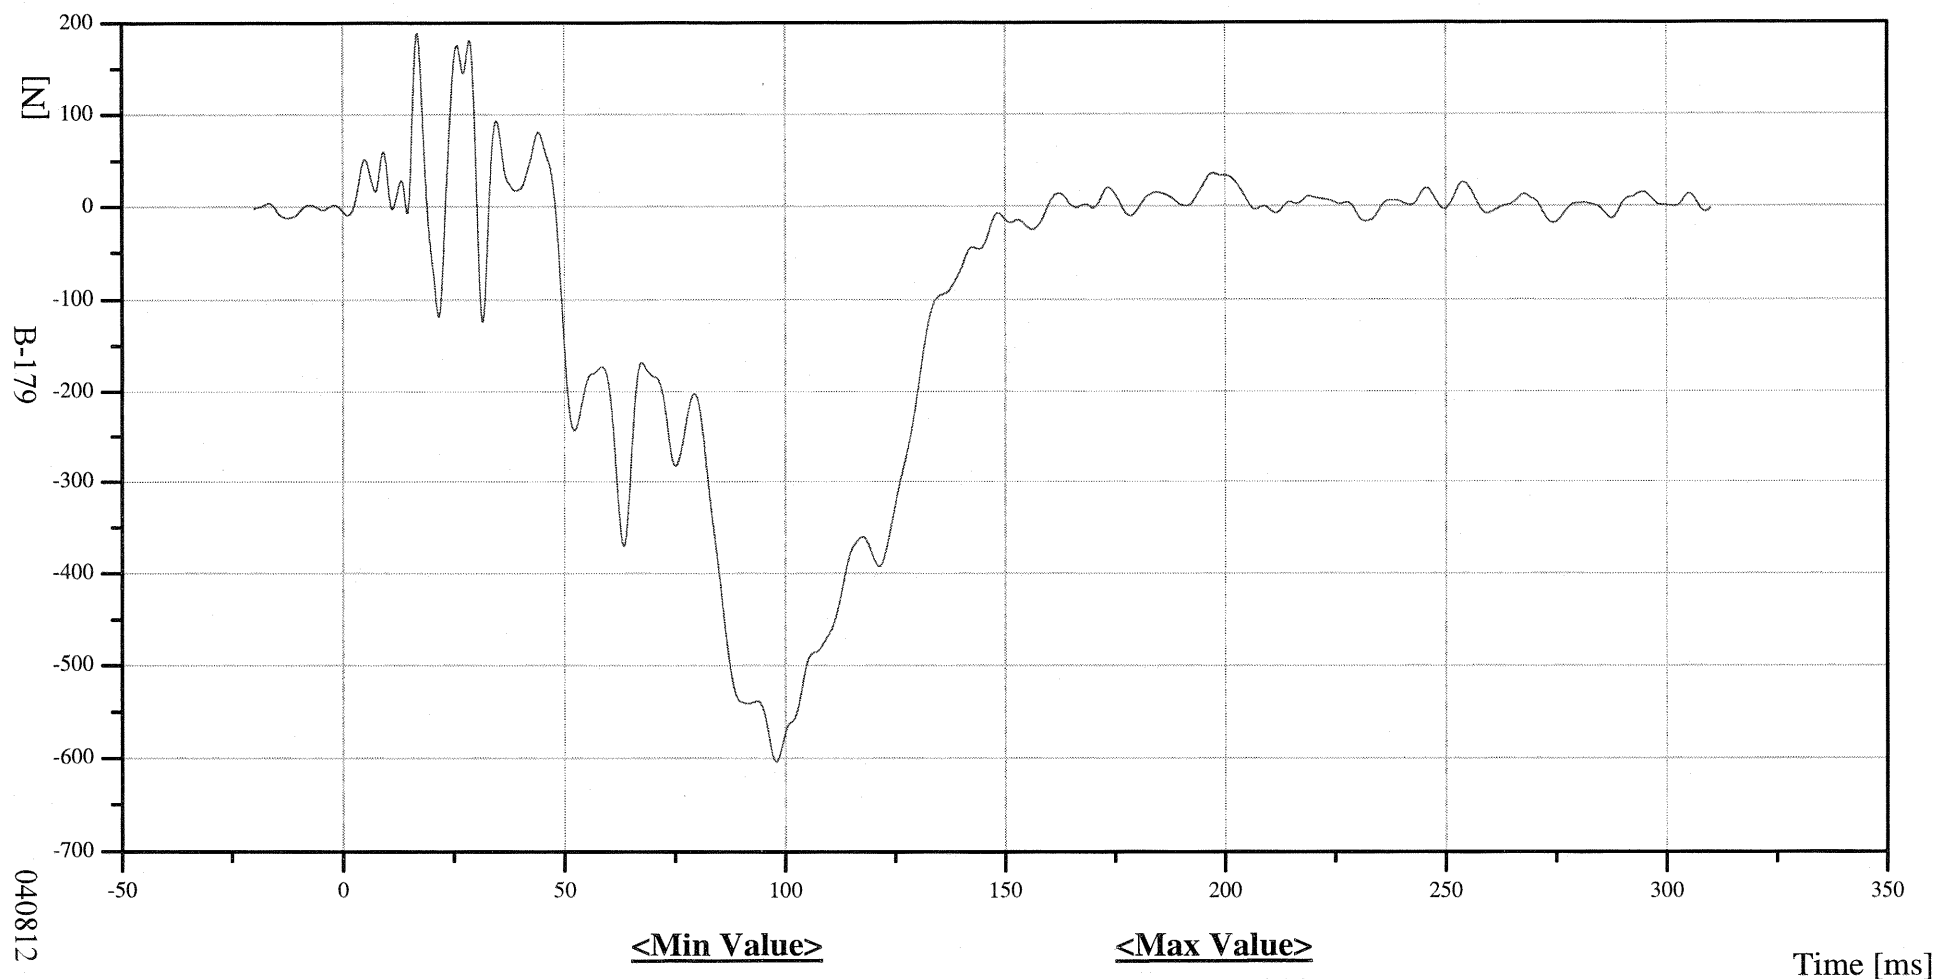

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0301

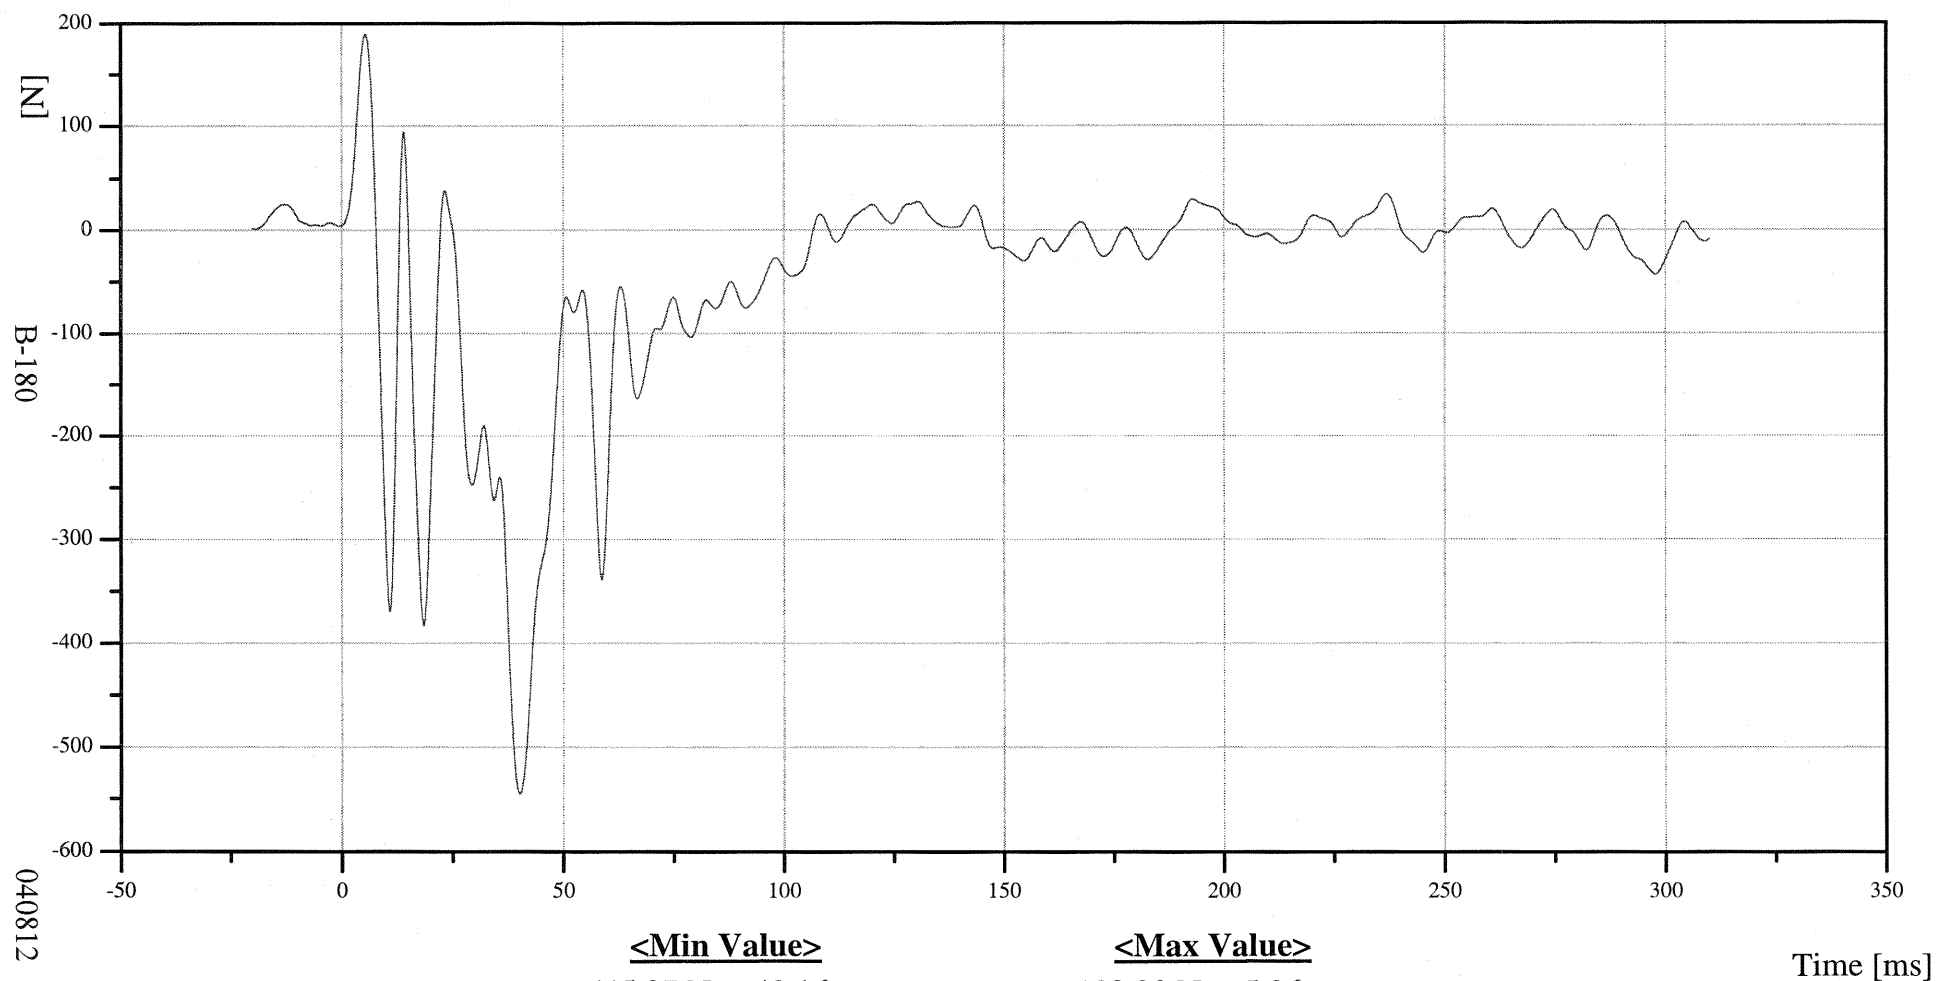

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0302

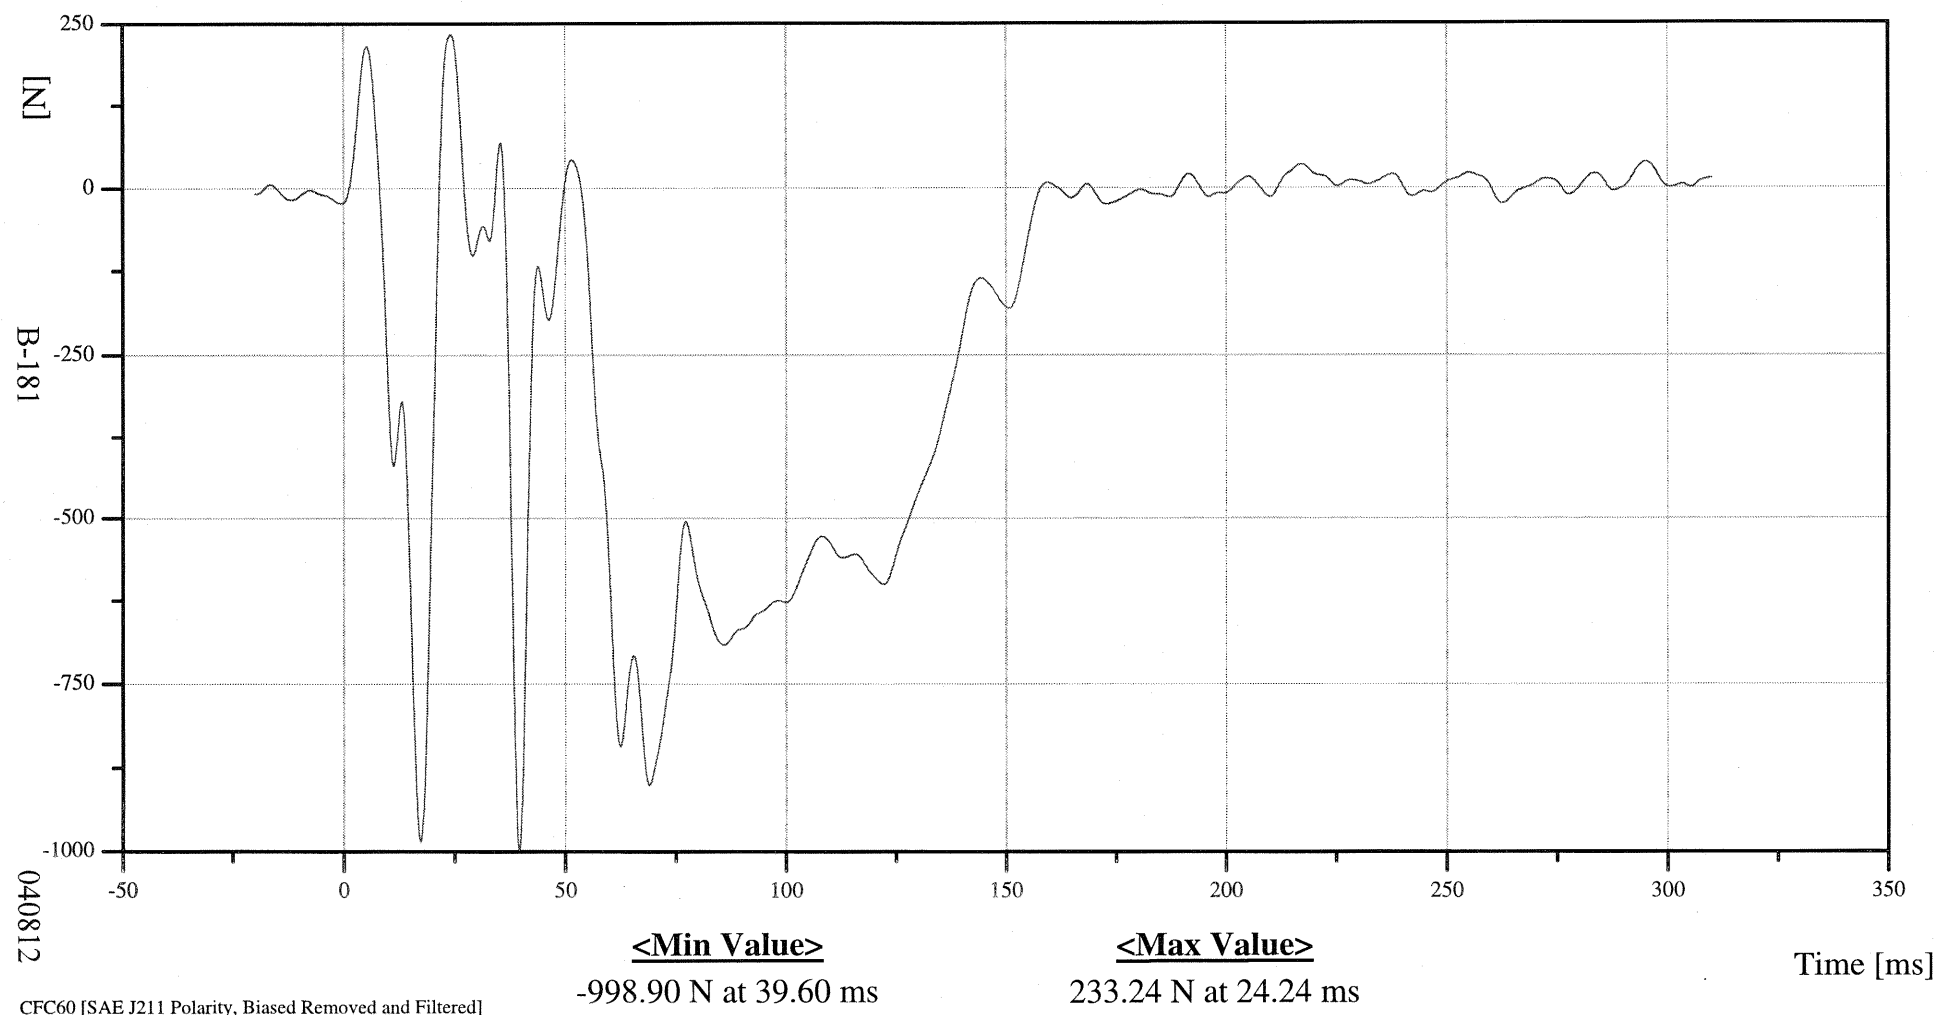



Transportation Research Center, Inc.

ROW 3 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0303

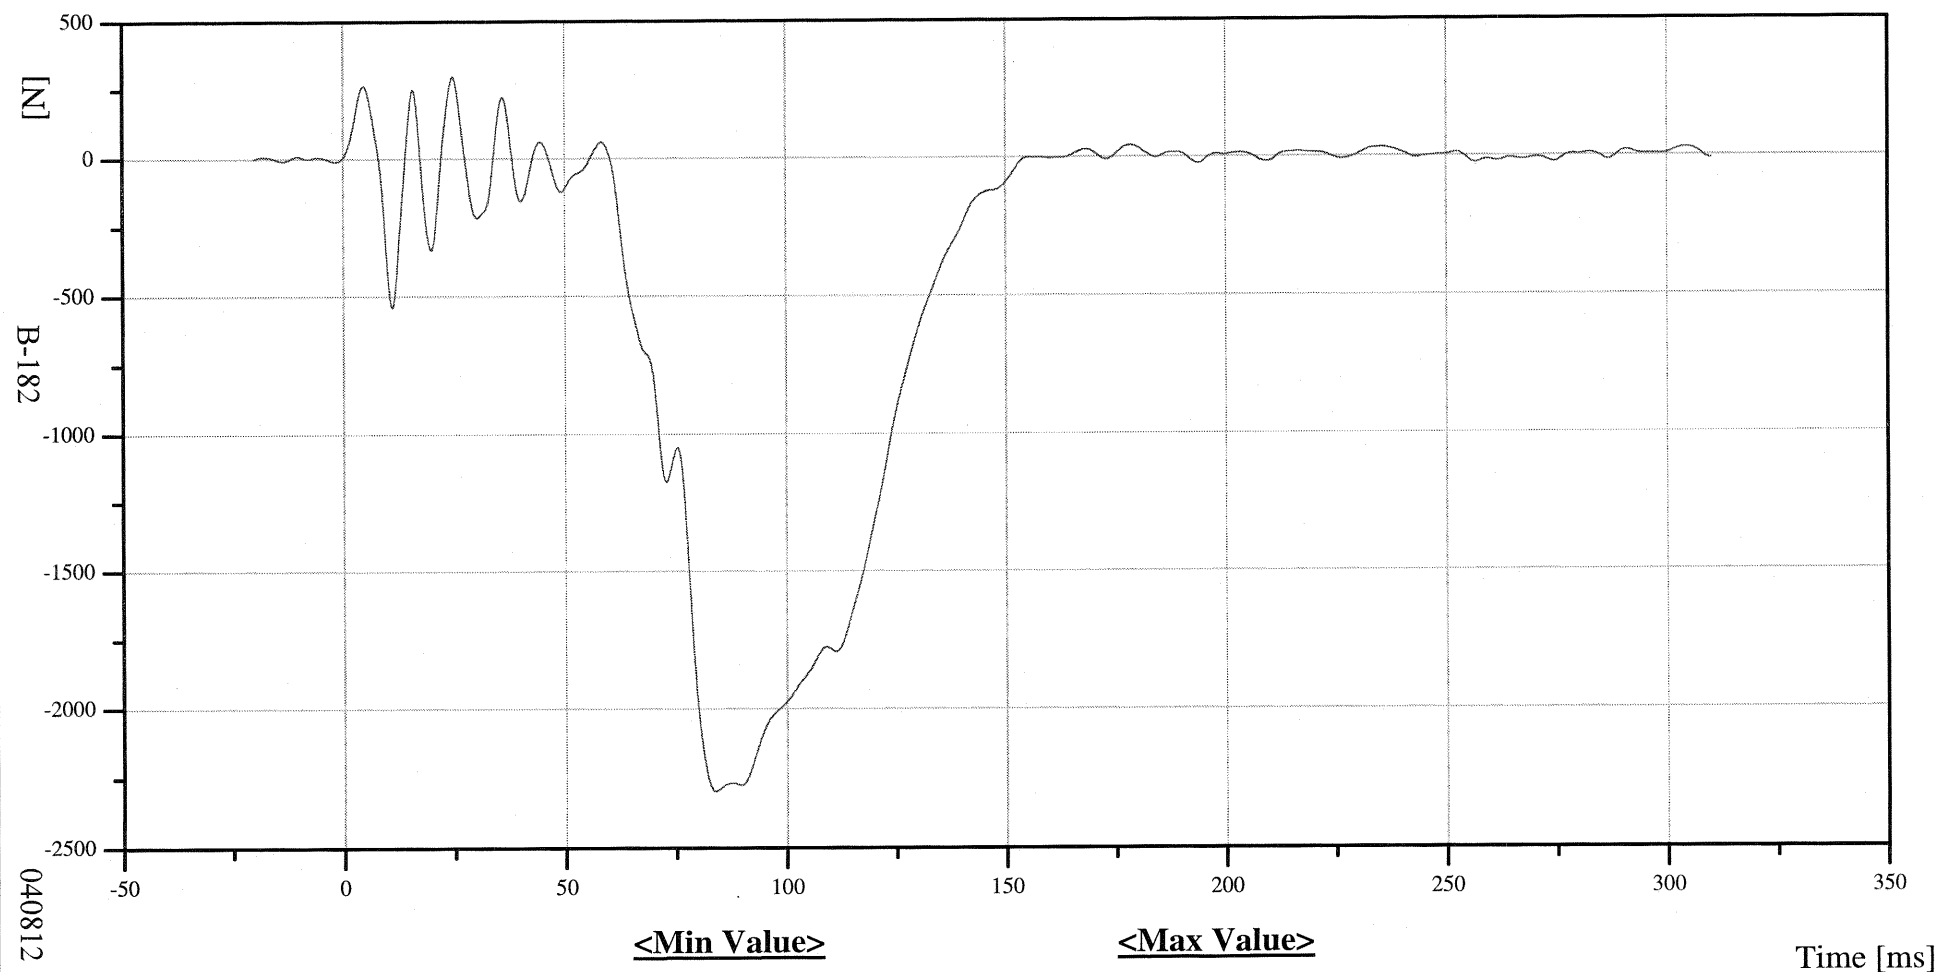

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0304

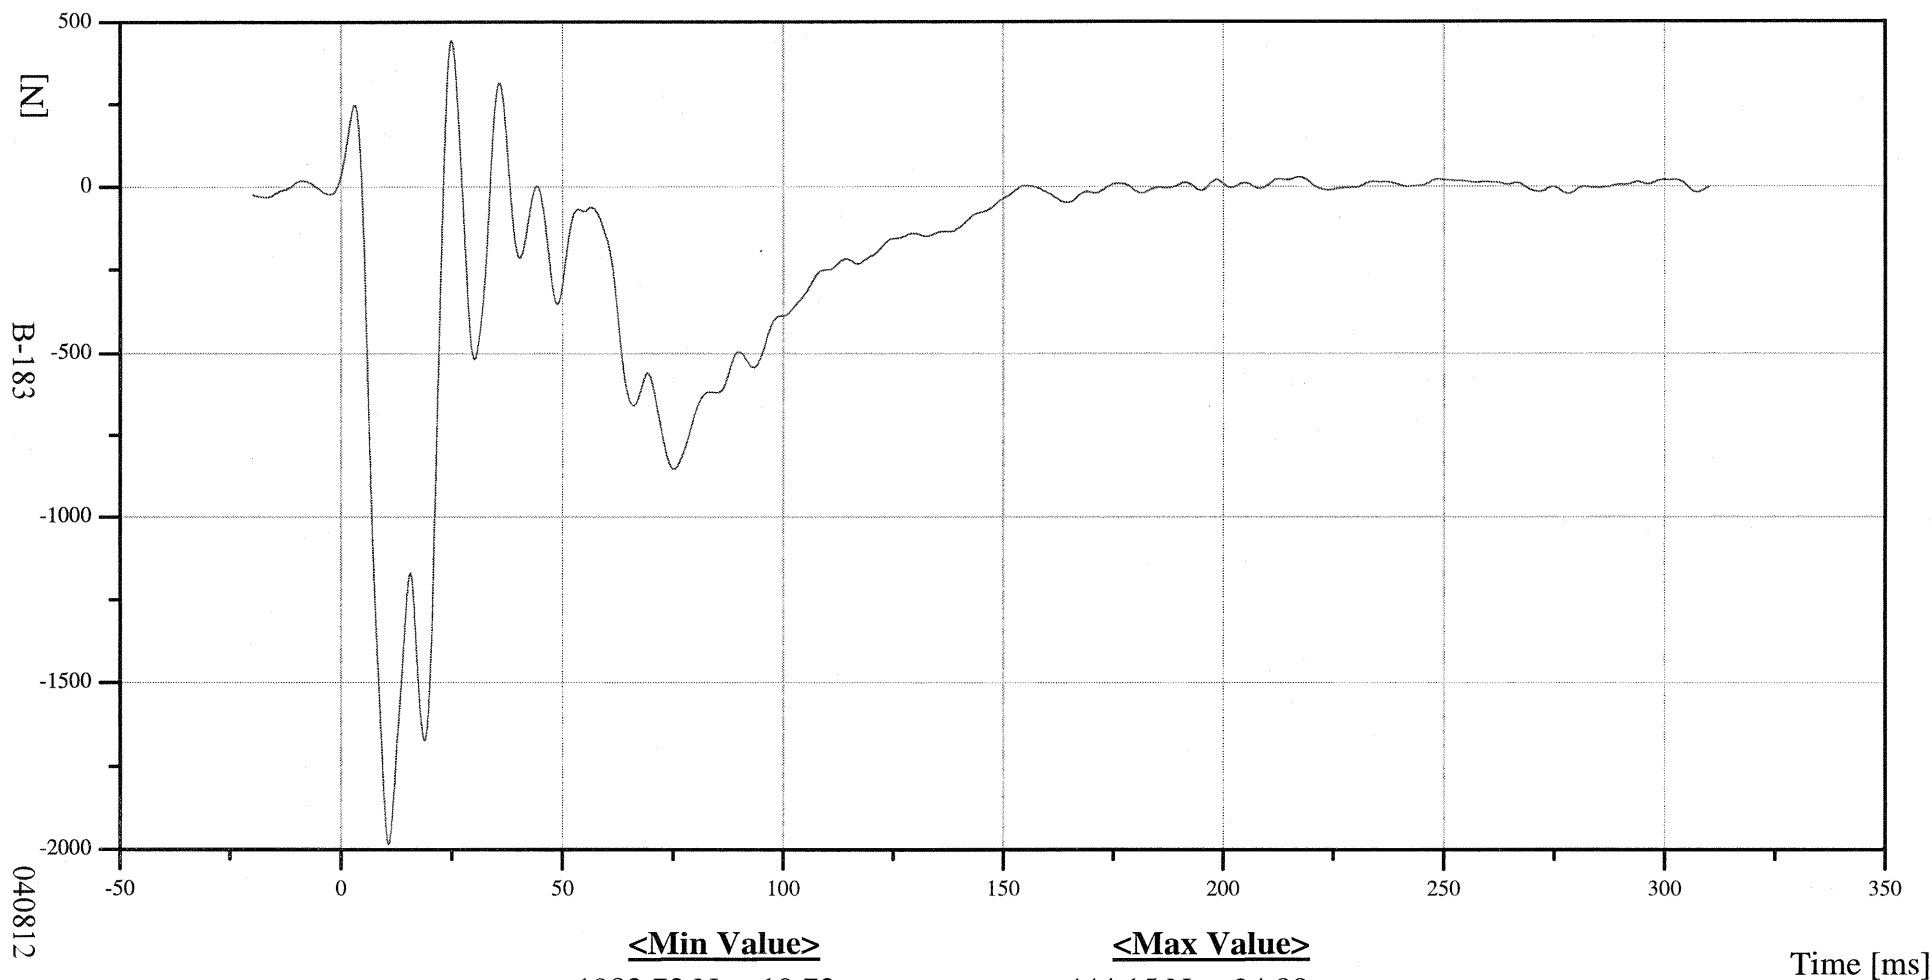

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0305

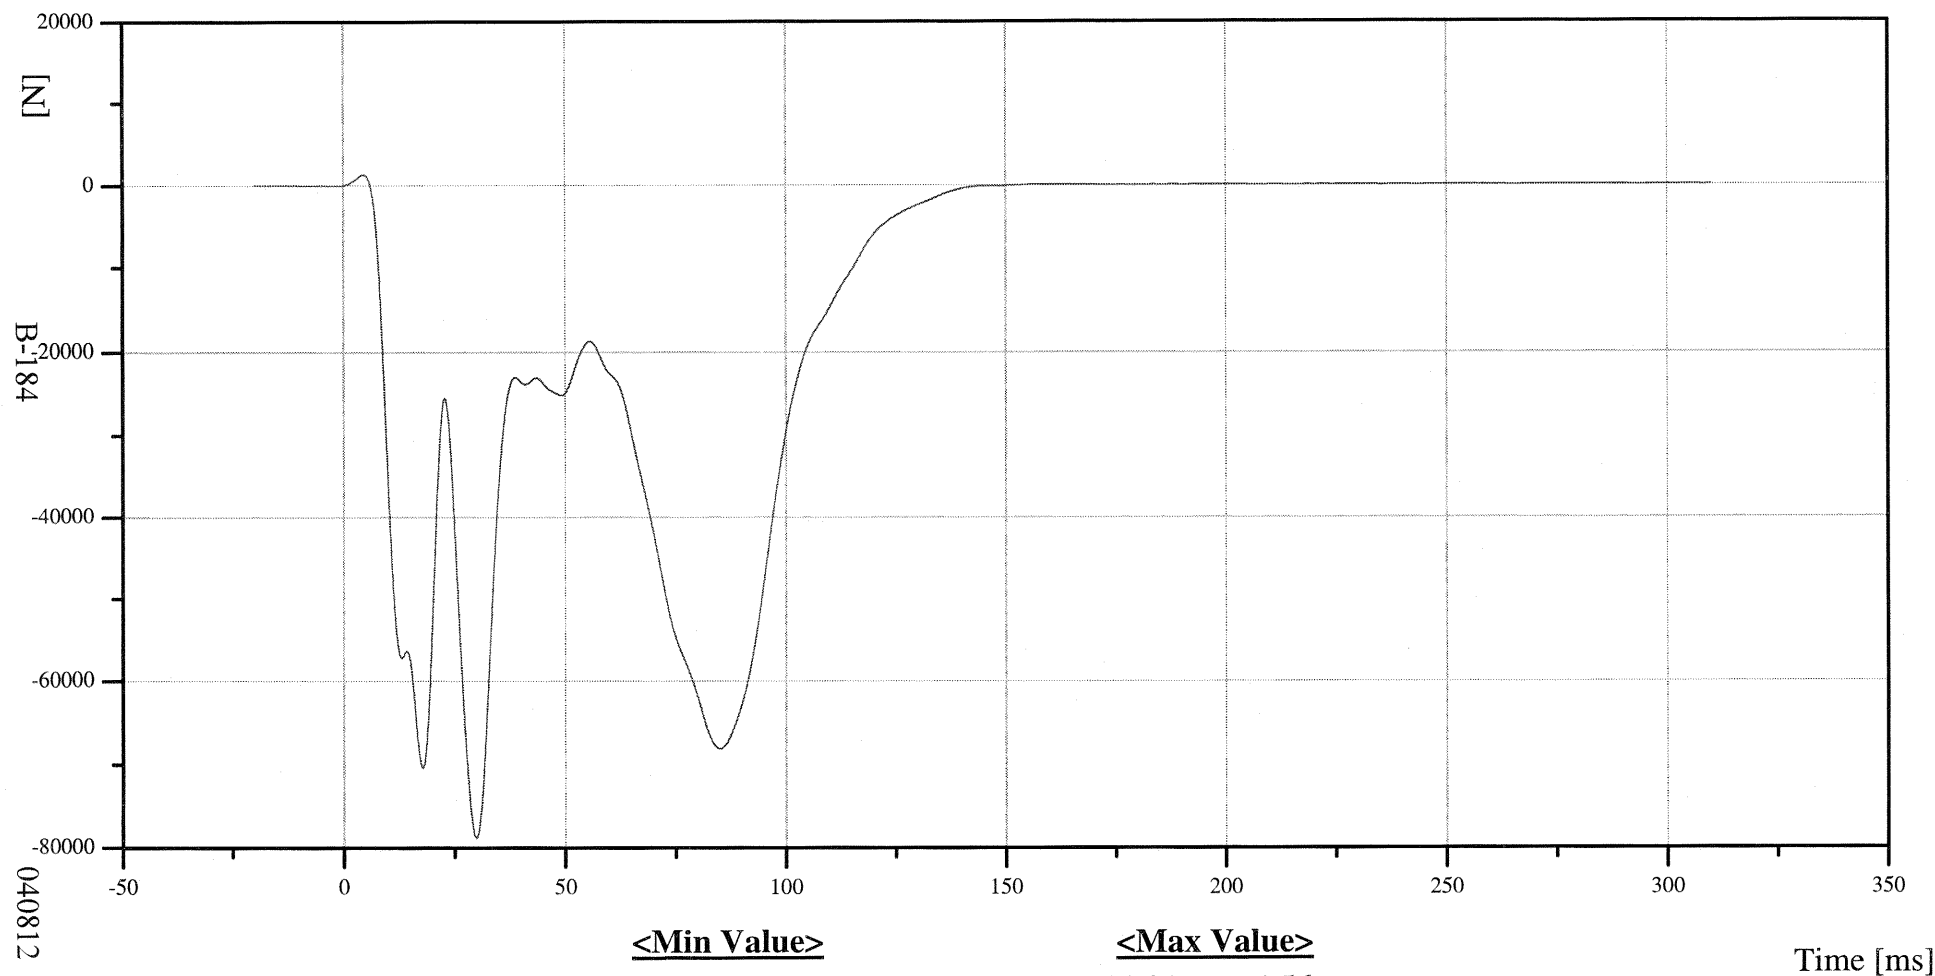

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0306

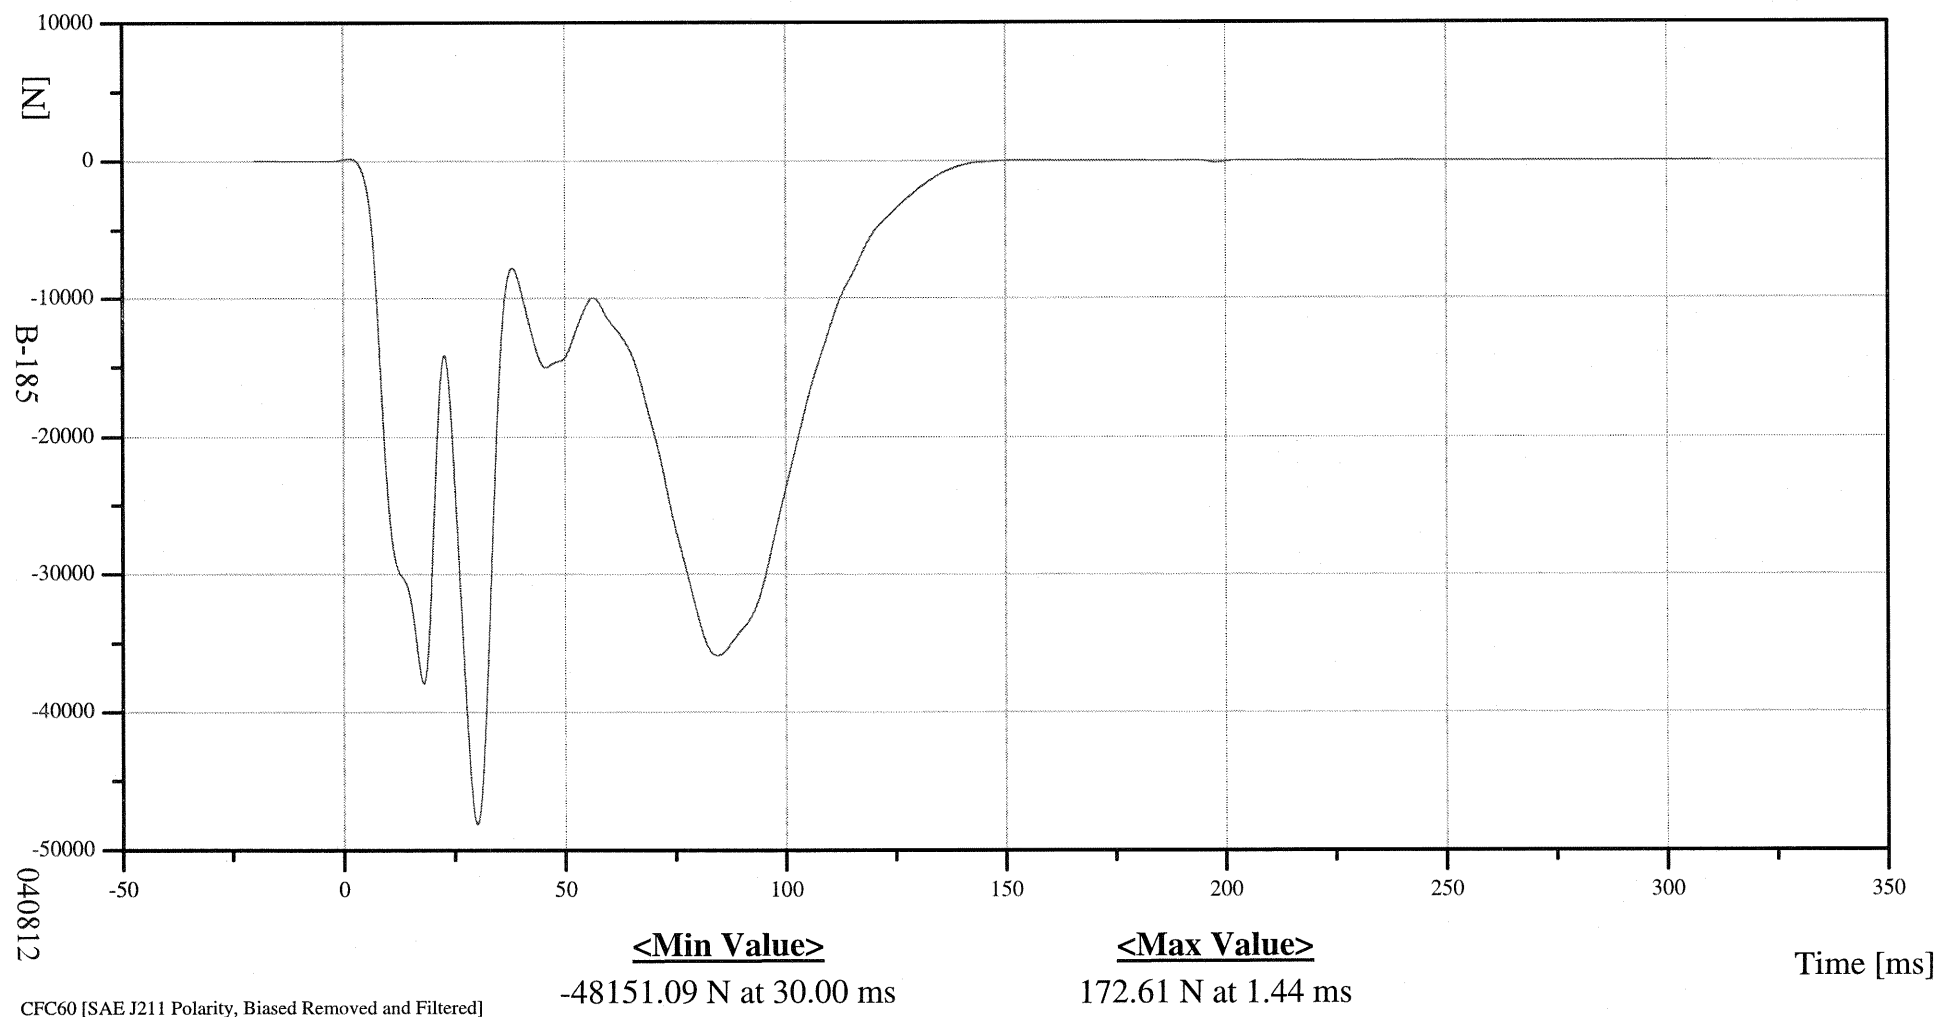



Transportation Research Center, Inc.

ROW 3 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0307

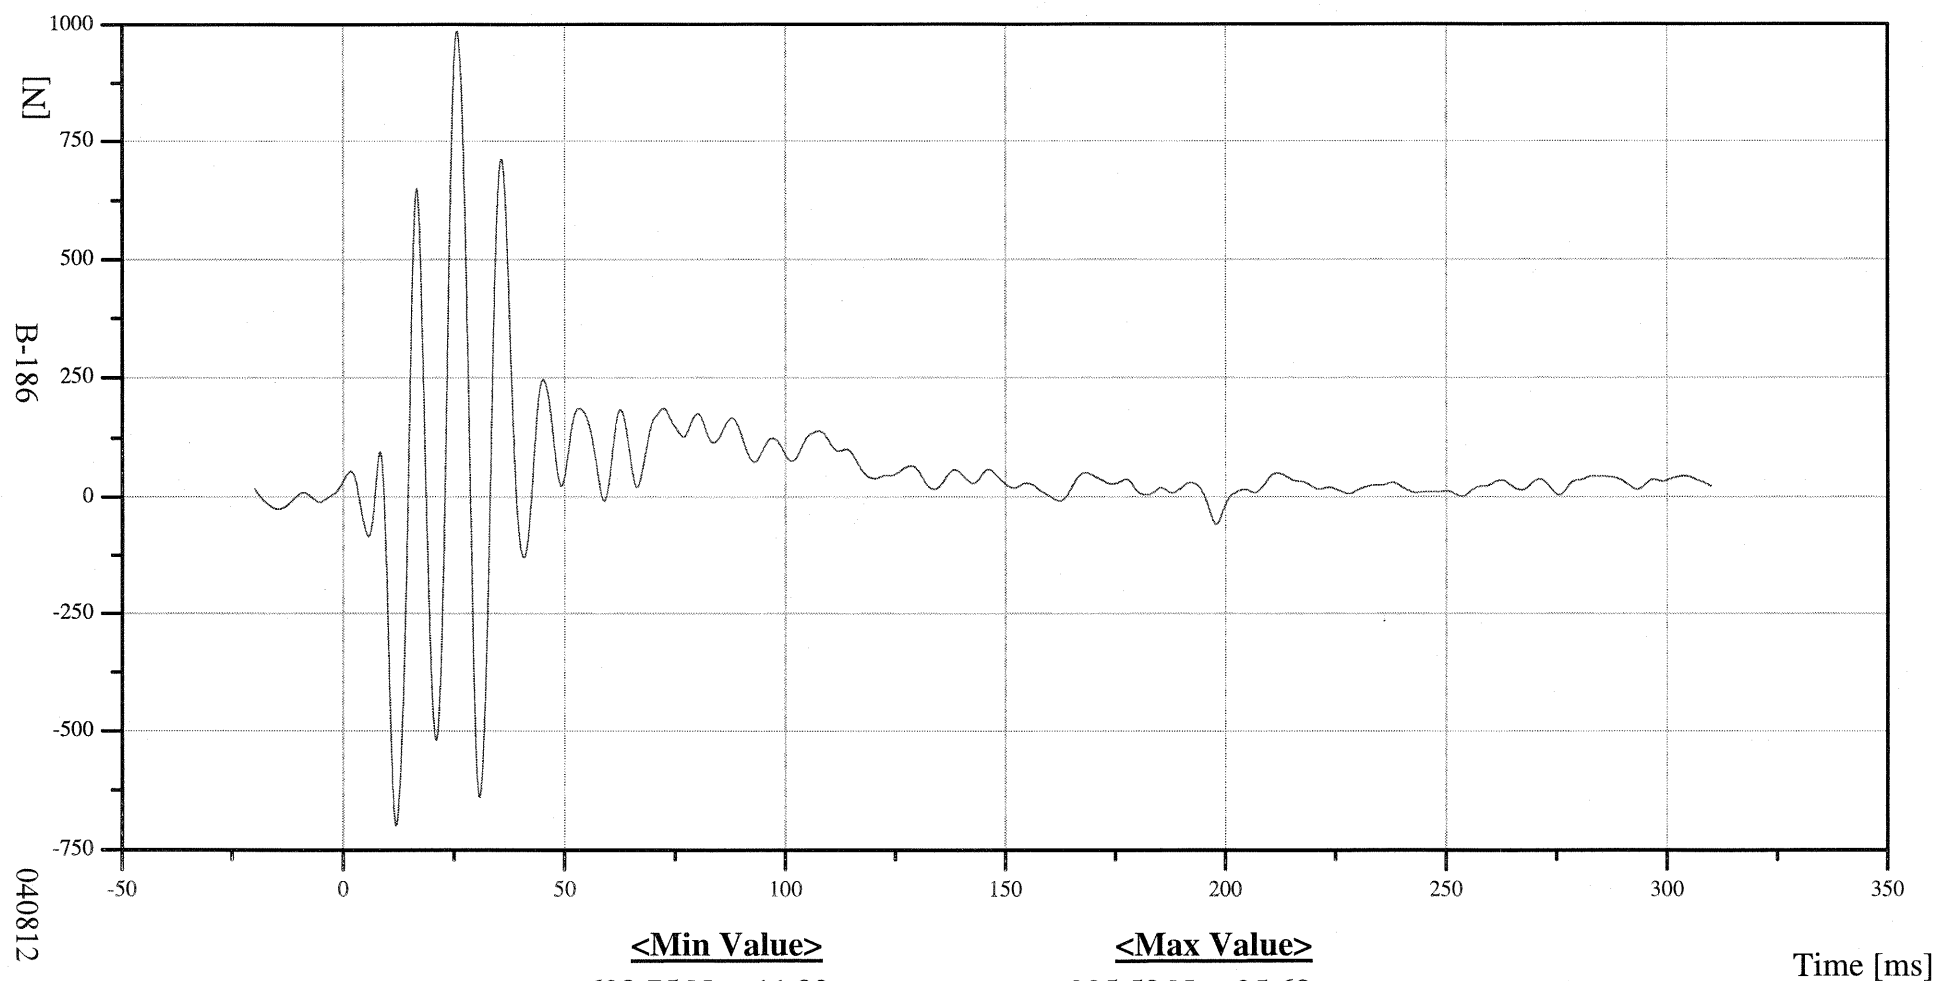

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0308

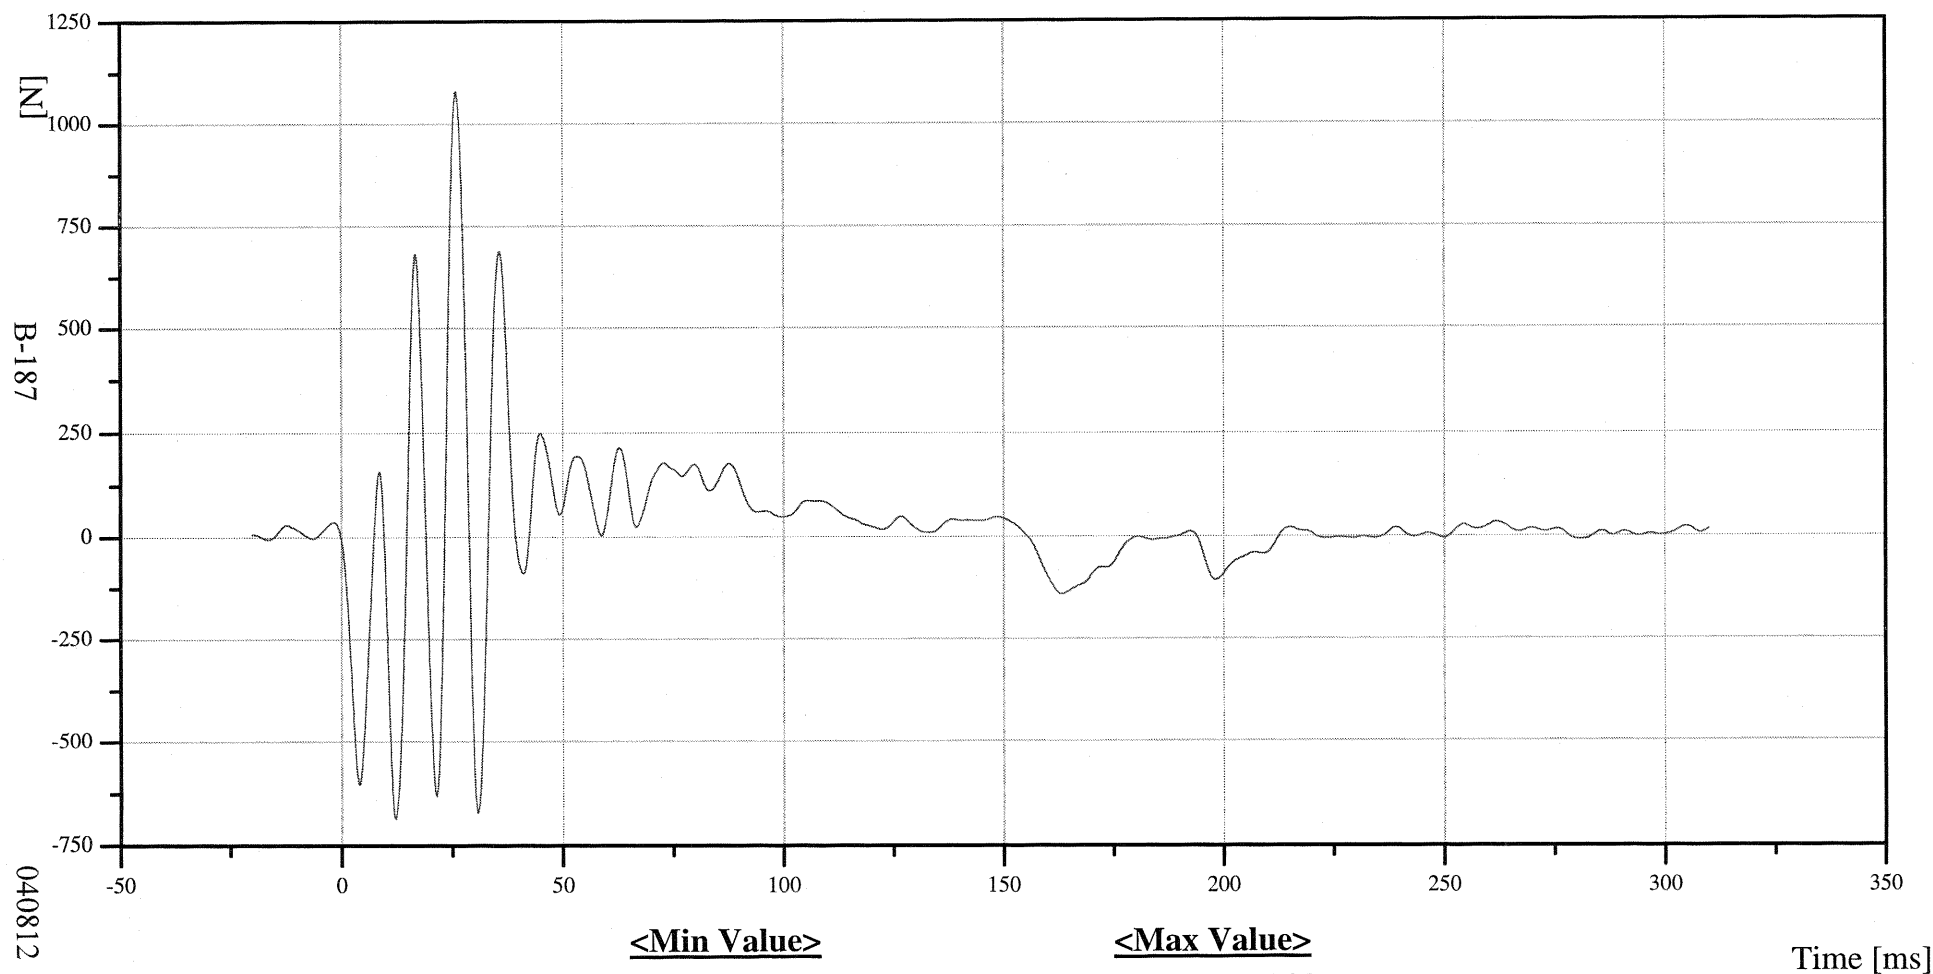

<Min Value>
-686.73 N at 12.08 ms

<Max Value>
1078.87 N at 25.92 ms

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0309

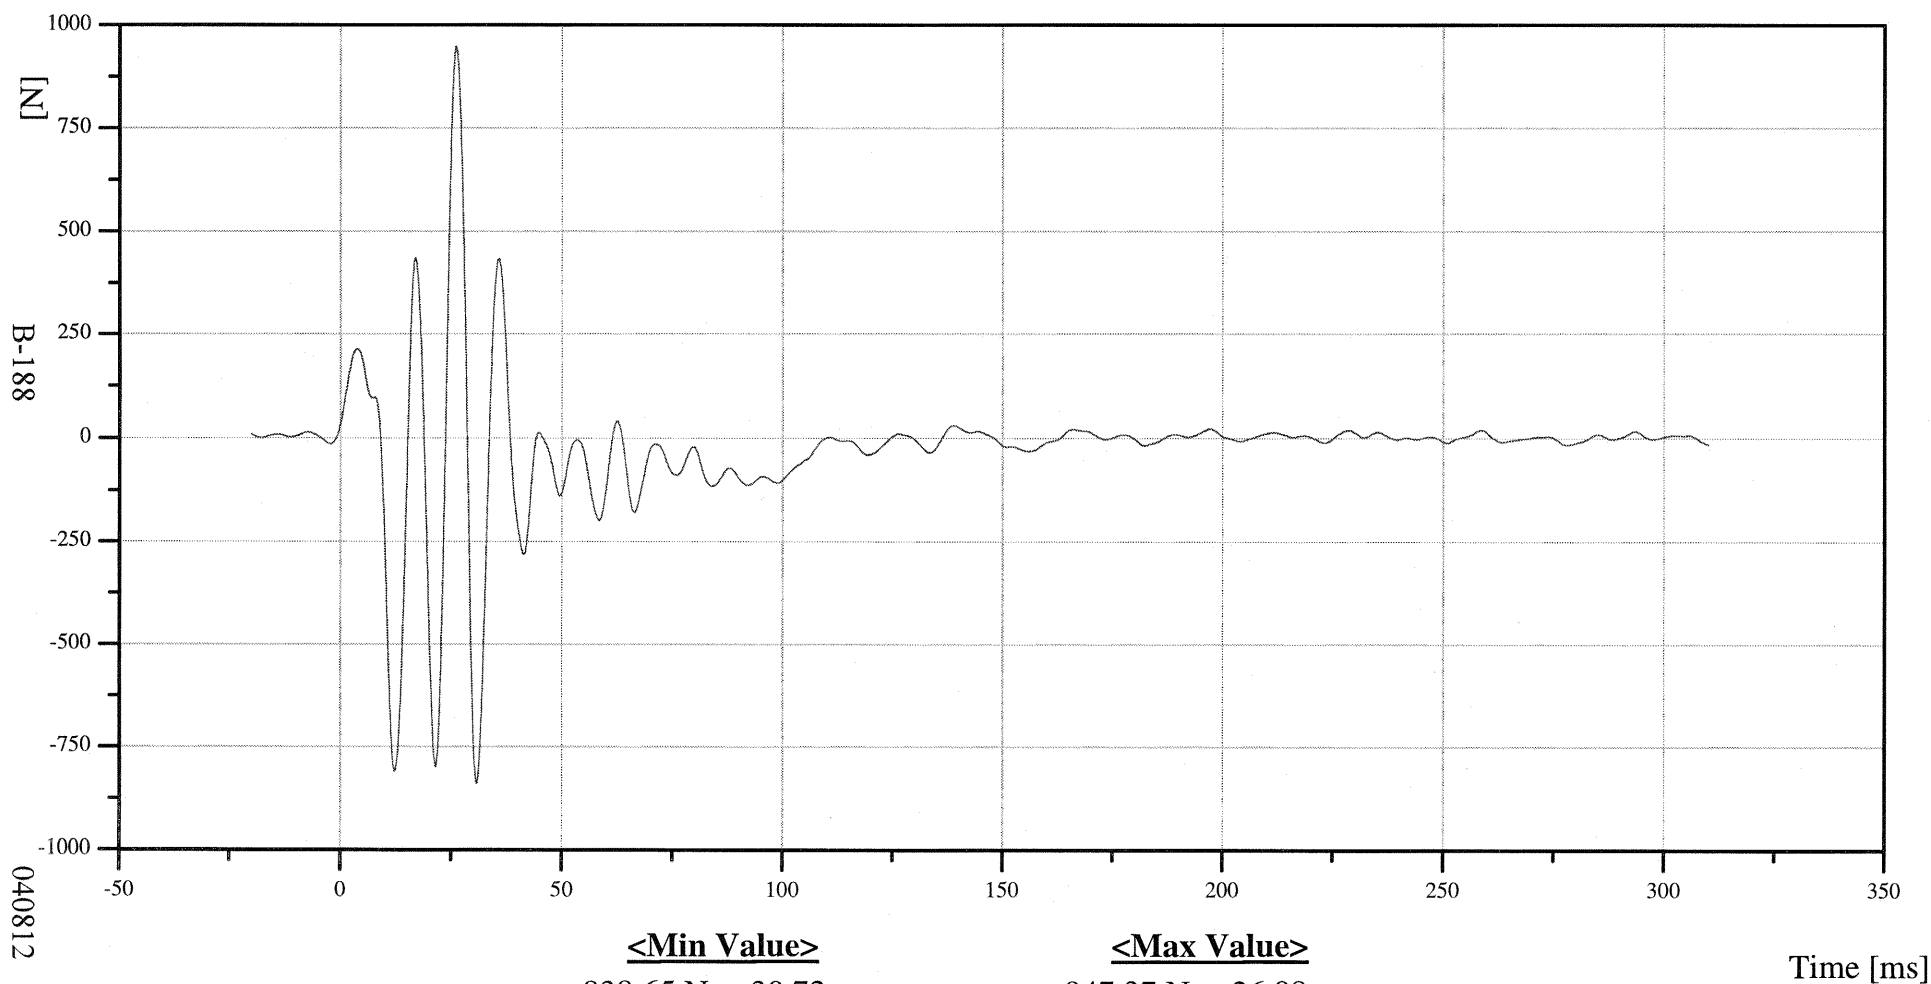

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0310

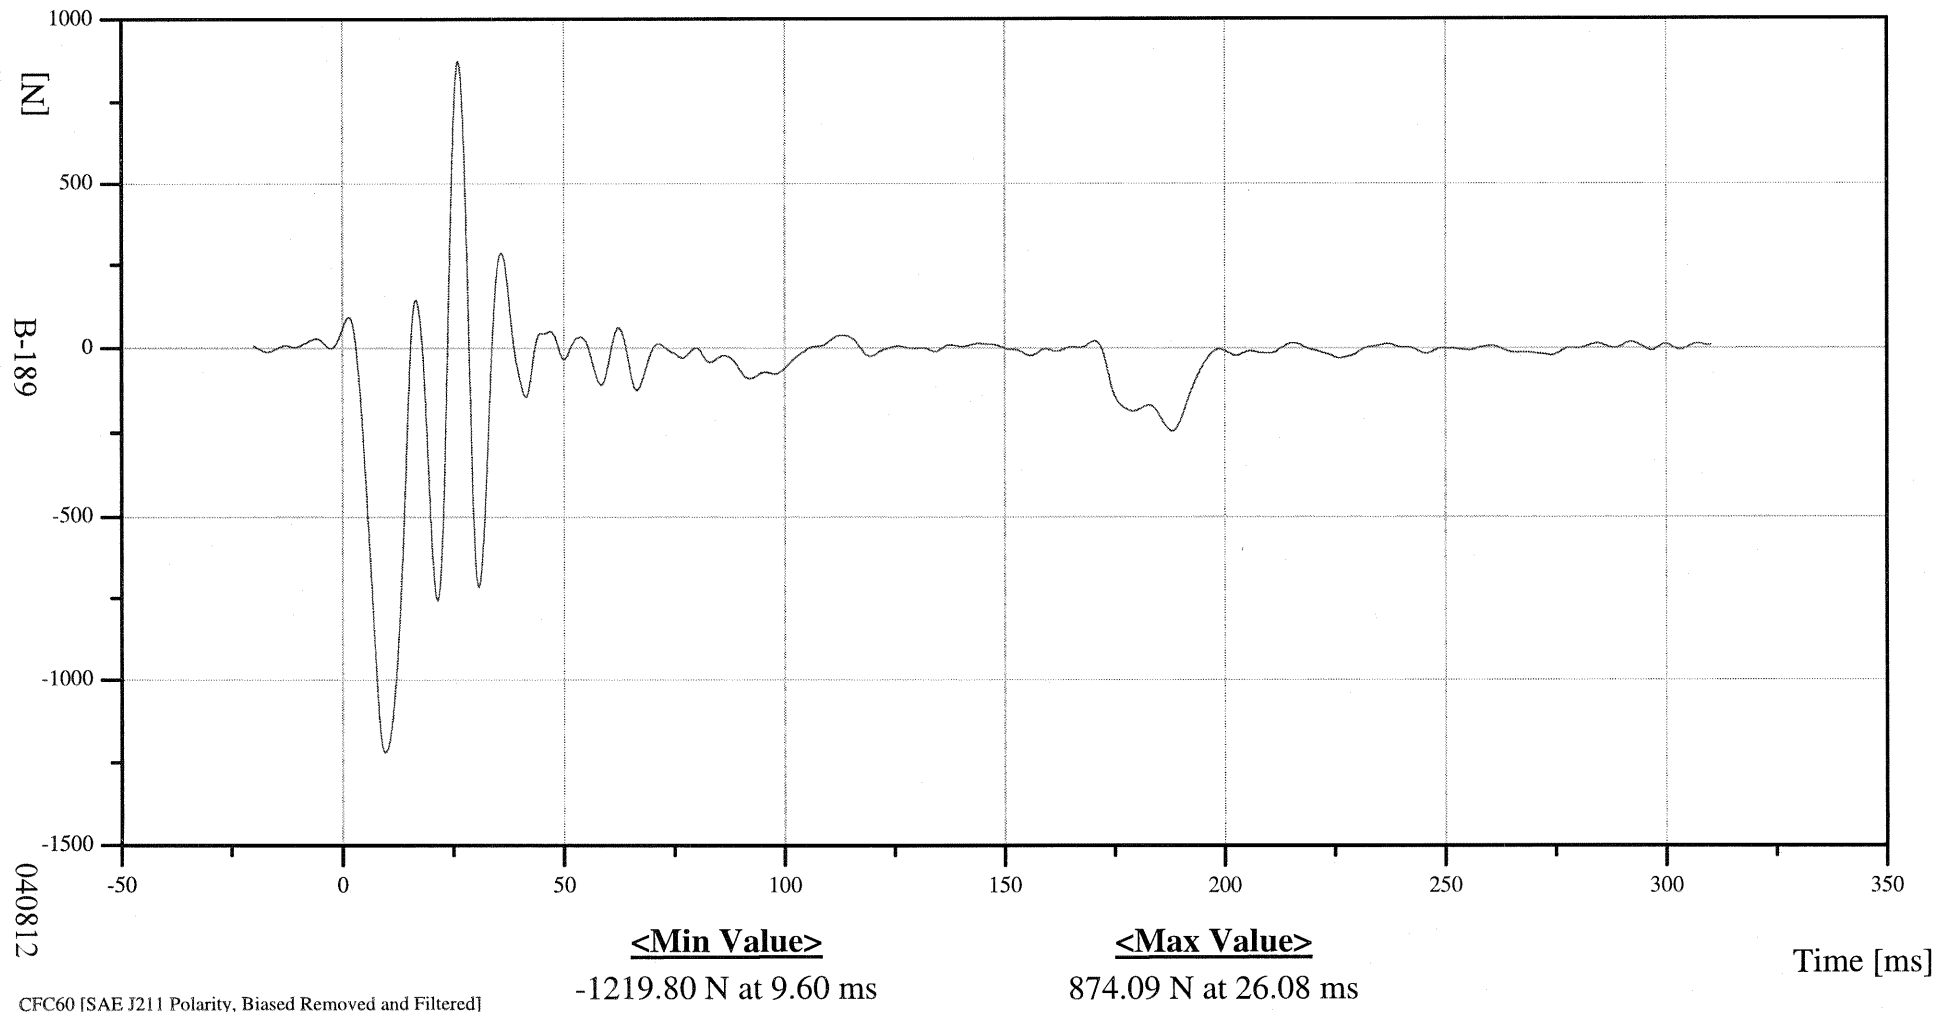



Transportation Research Center, Inc.

ROW 3 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0311

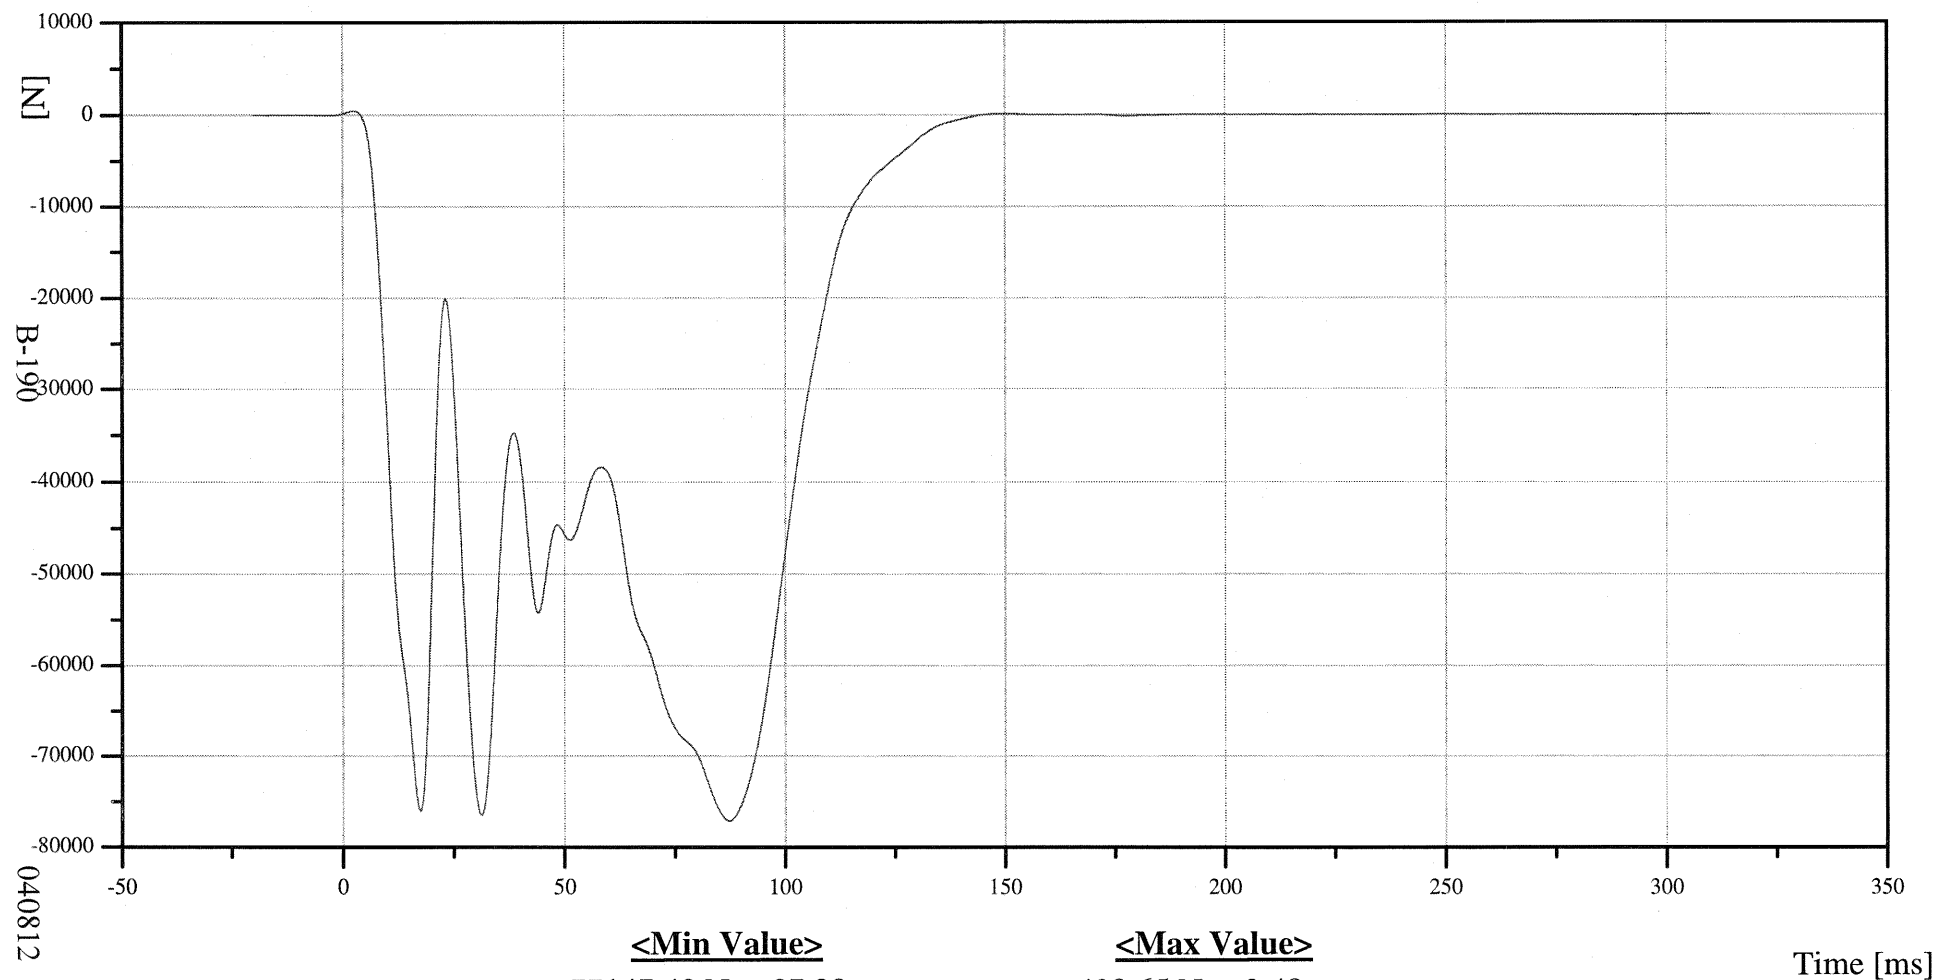

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0312

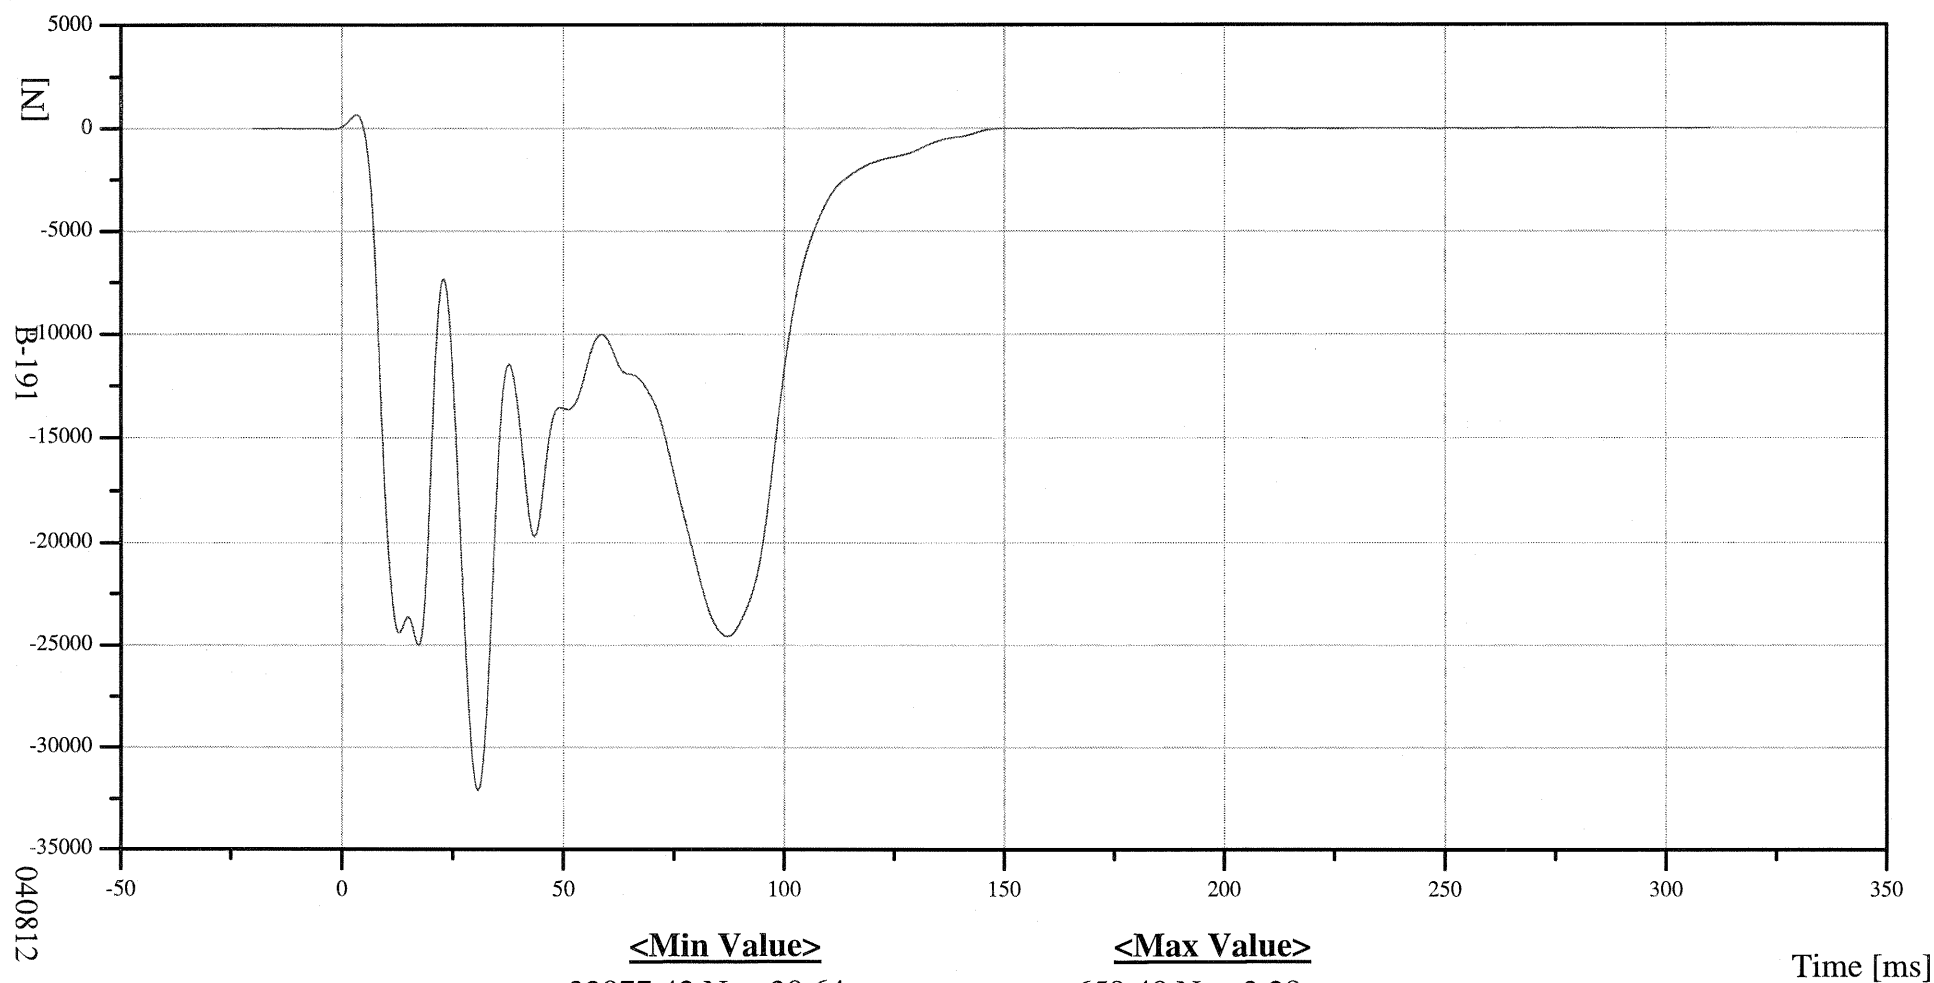

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0313

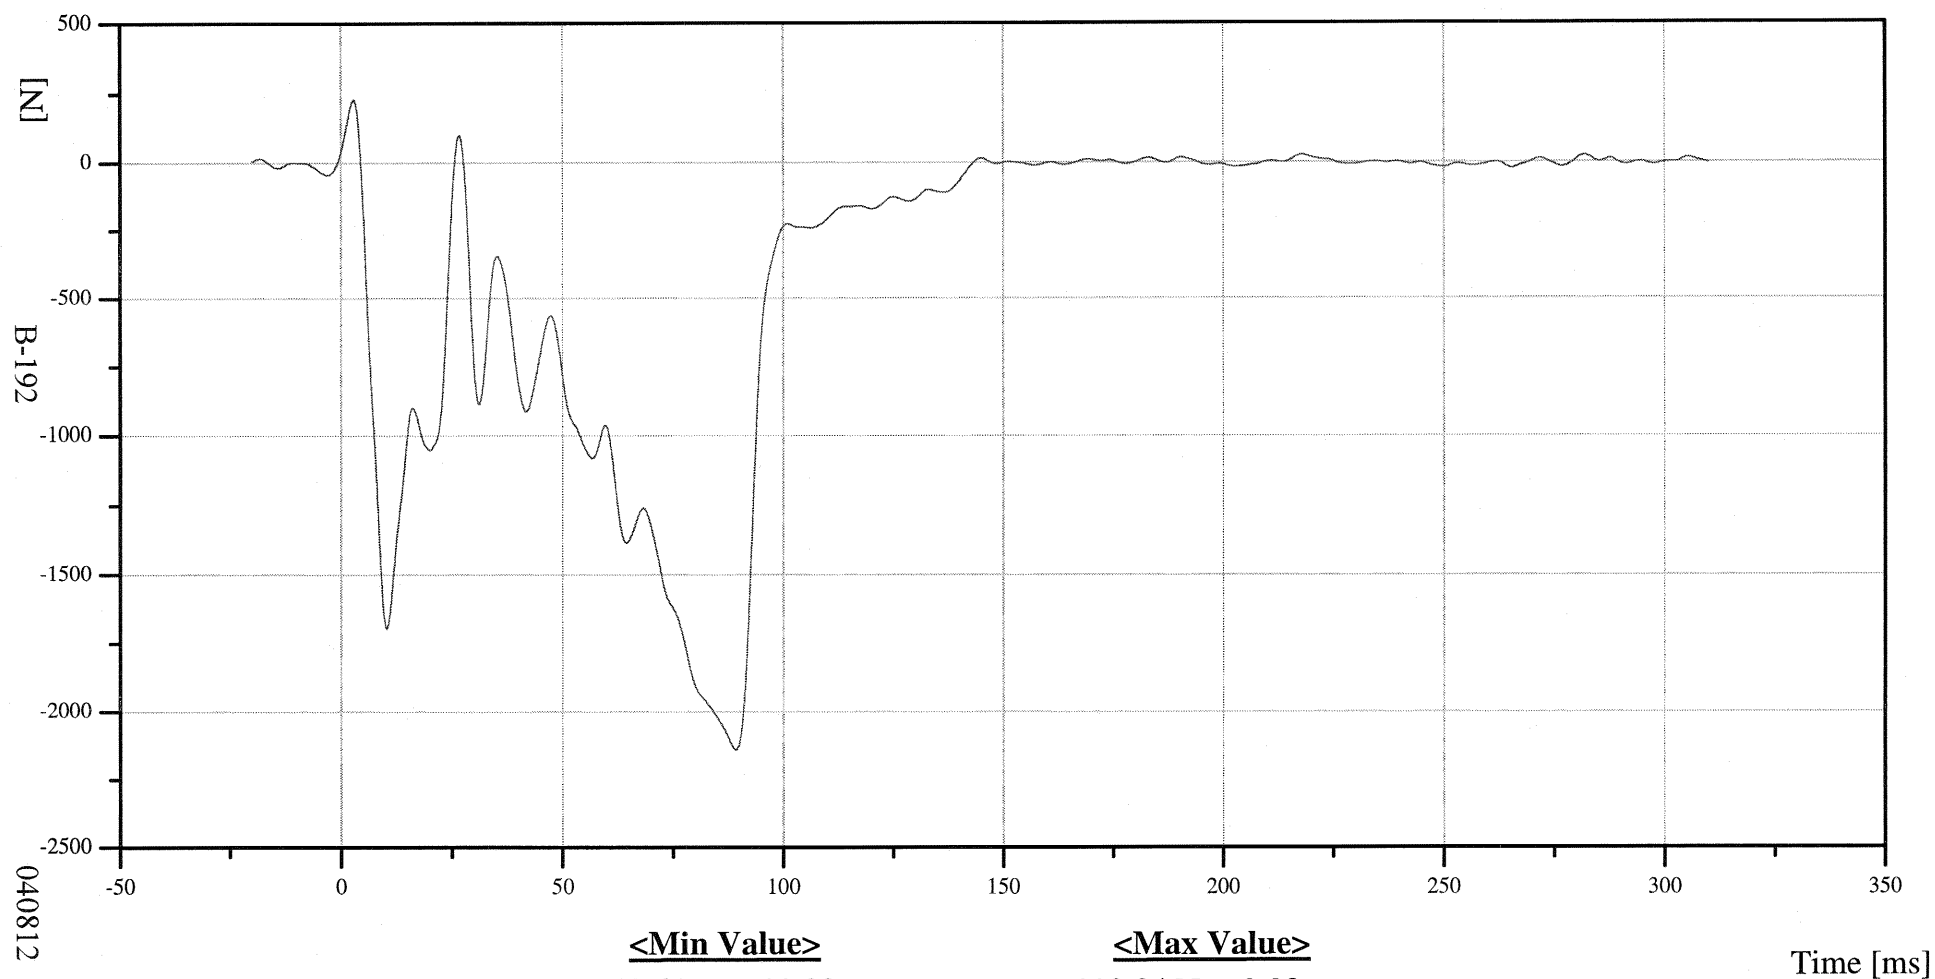

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0314

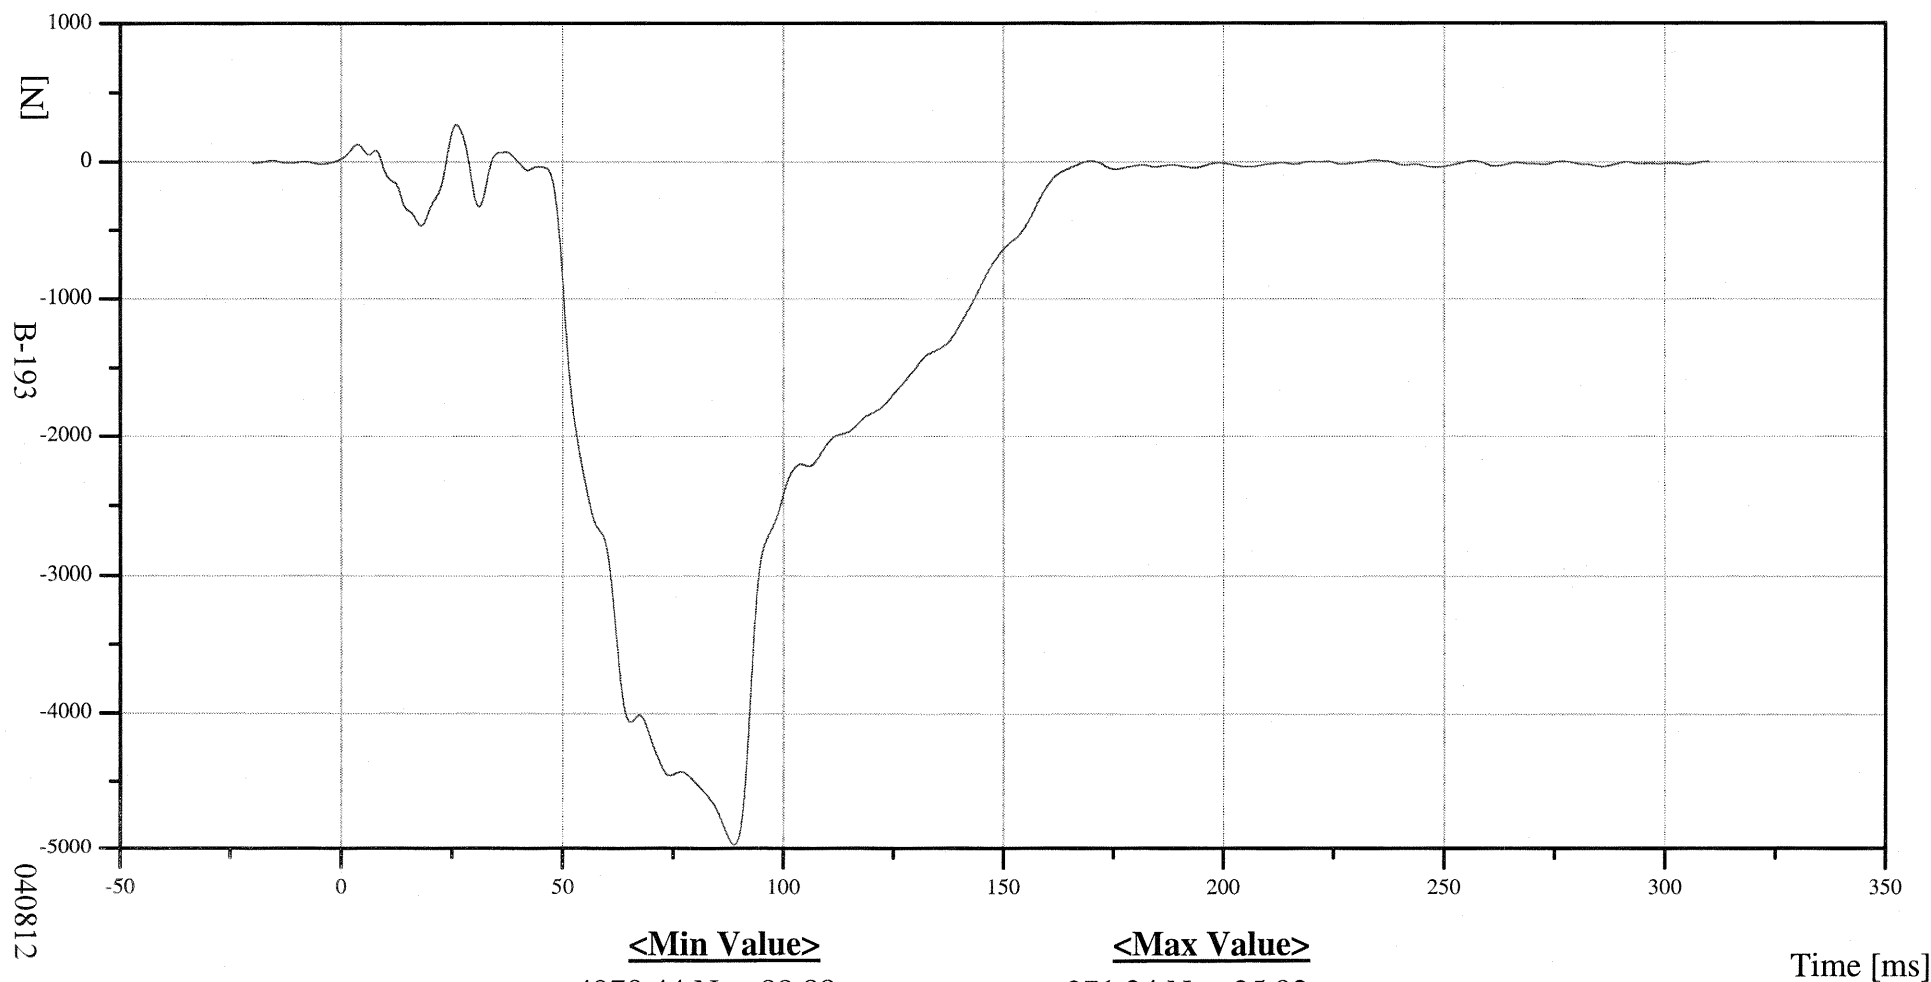

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0315

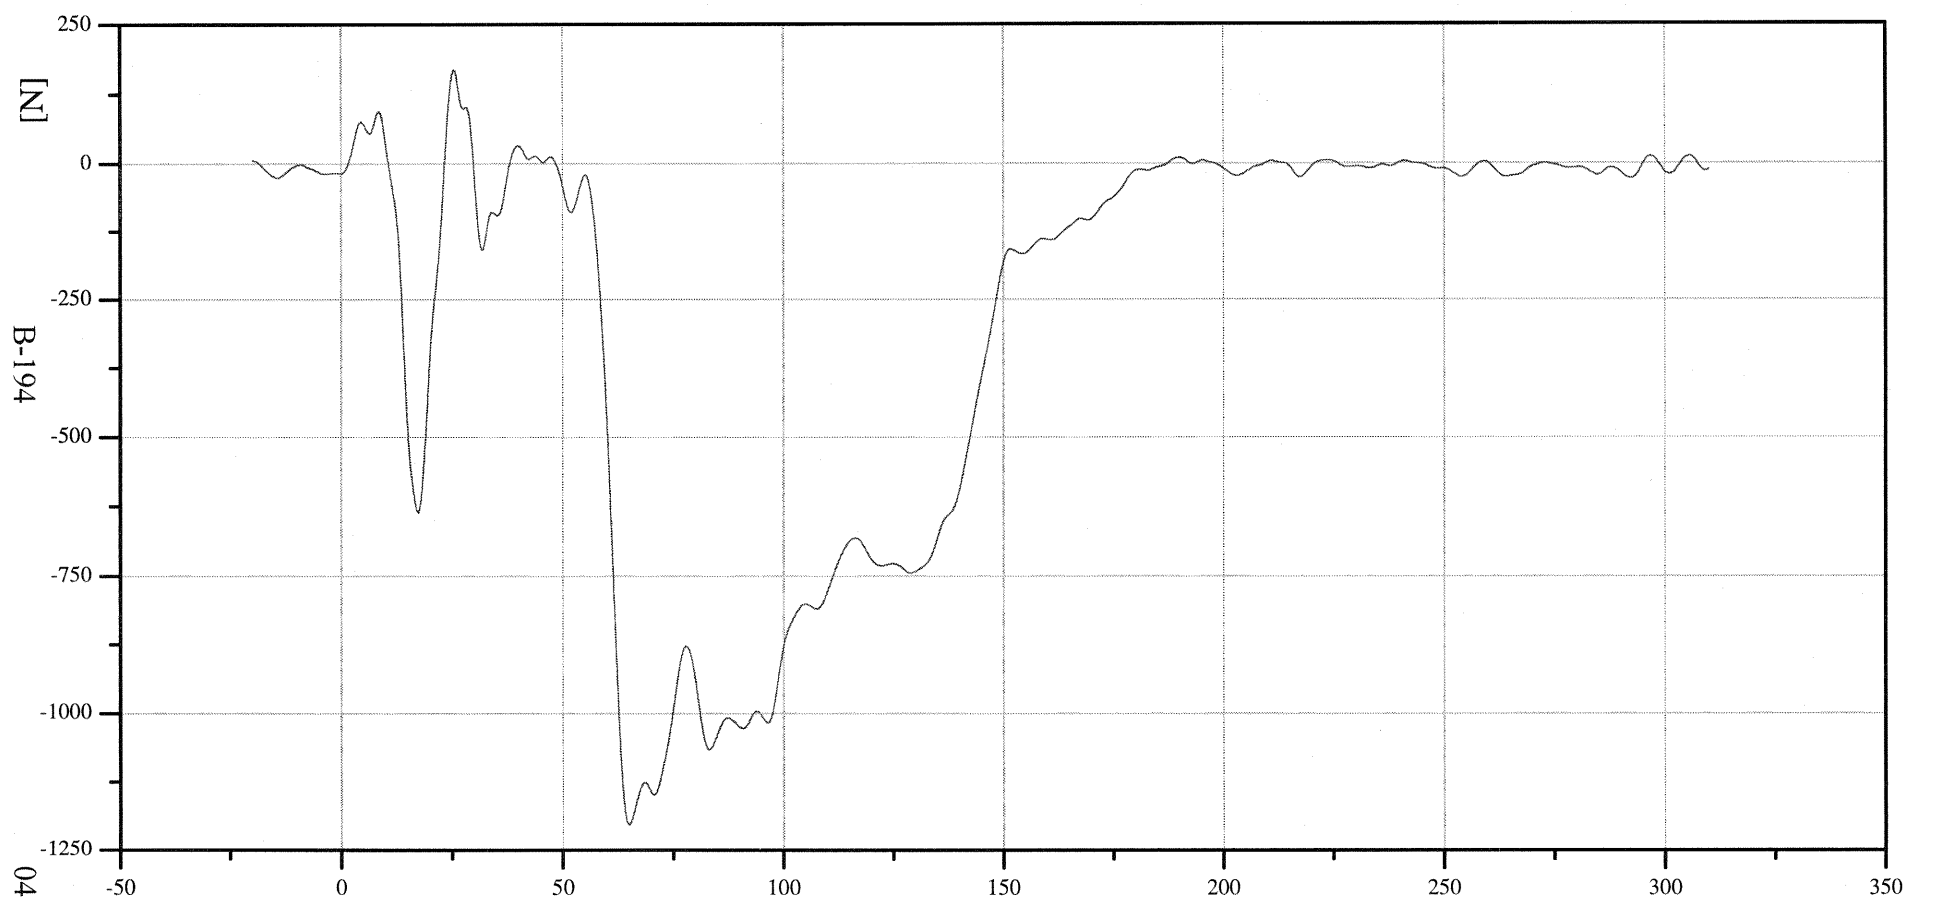

<Min Value>

-1202.16 N at 64.96 ms

<Max Value>

168.27 N at 25.52 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 3 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0316

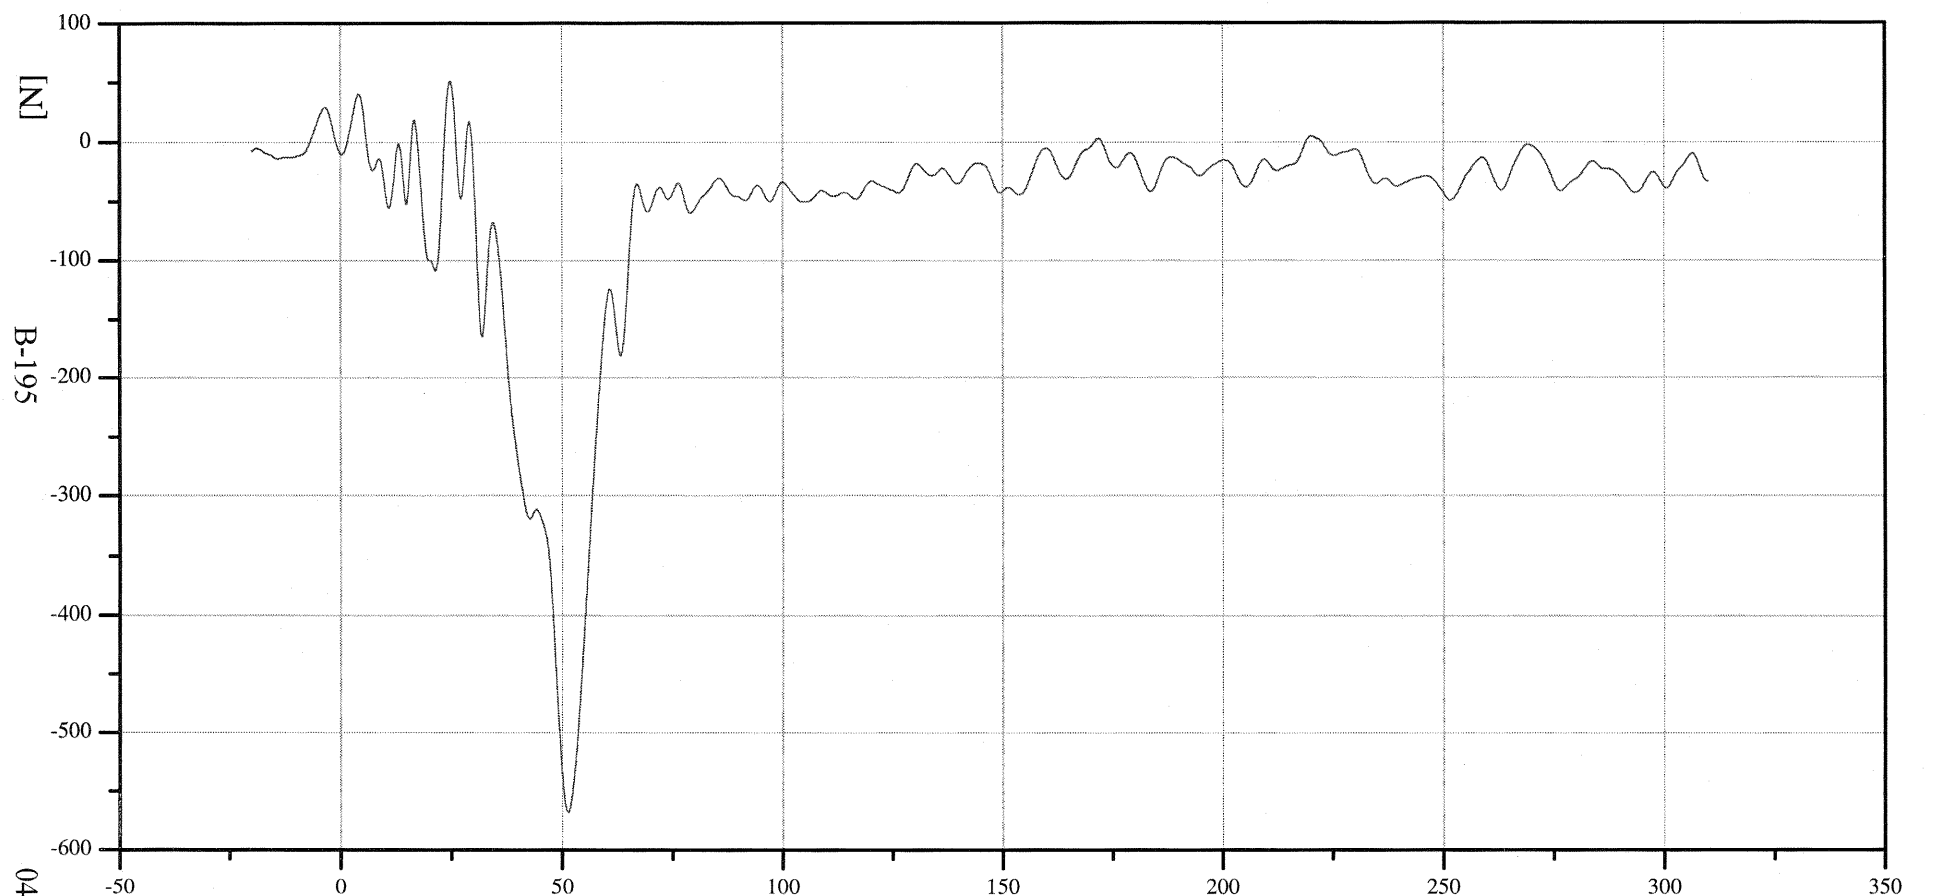

<Min Value>

<Max Value>

Time [ms]

-567.97 N at 51.28 ms

50.85 N at 24.72 ms

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0401

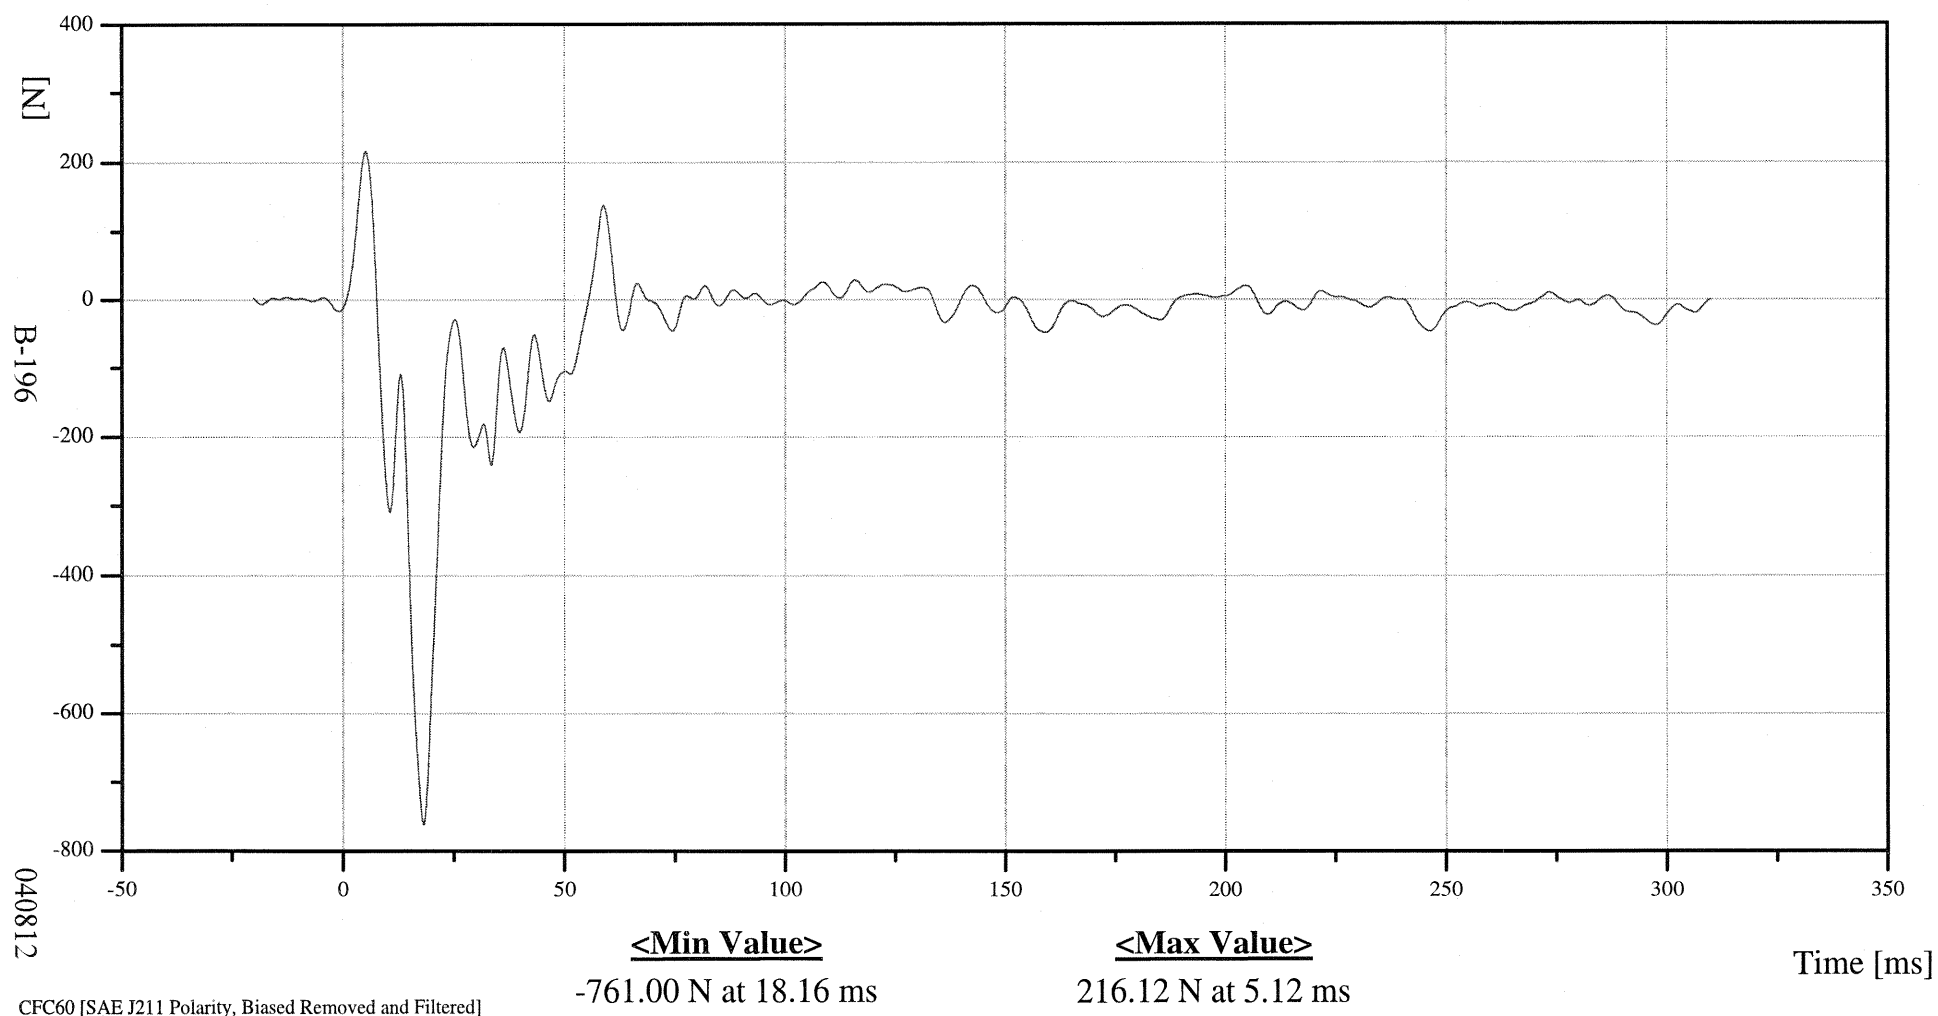



Transportation Research Center, Inc.

ROW 4 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0402

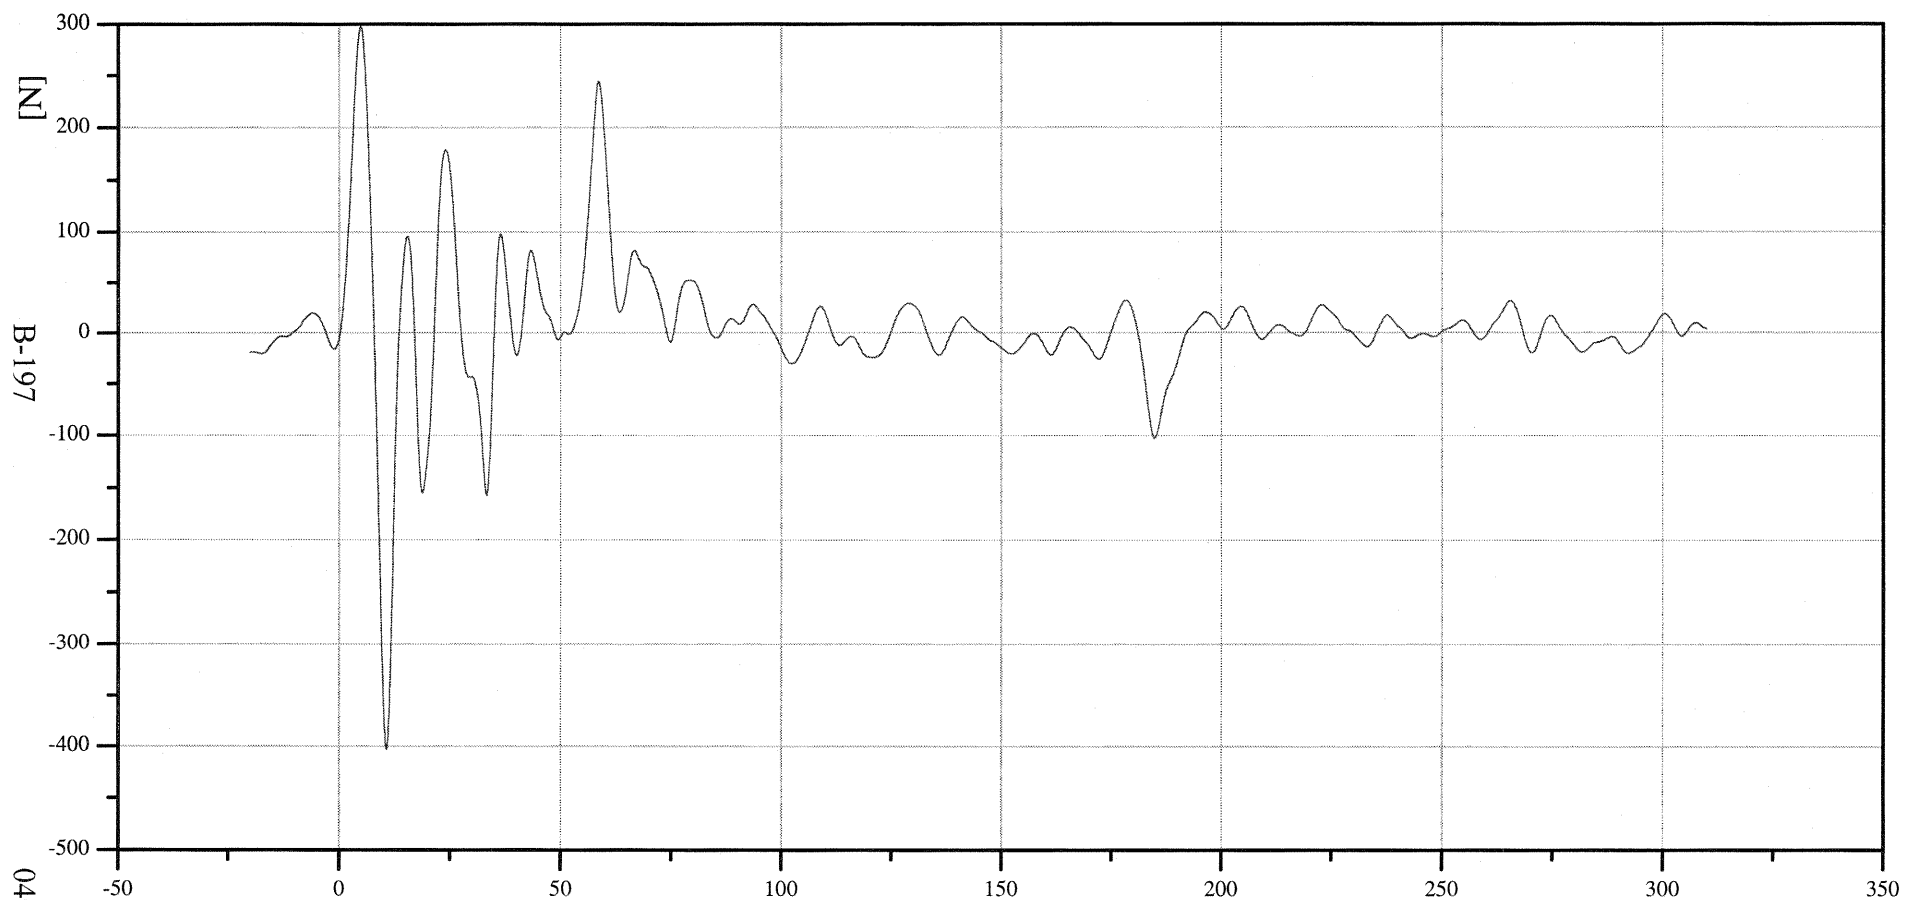

<Min Value>

-403.03 N at 10.72 ms

<Max Value>

297.27 N at 4.88 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0403

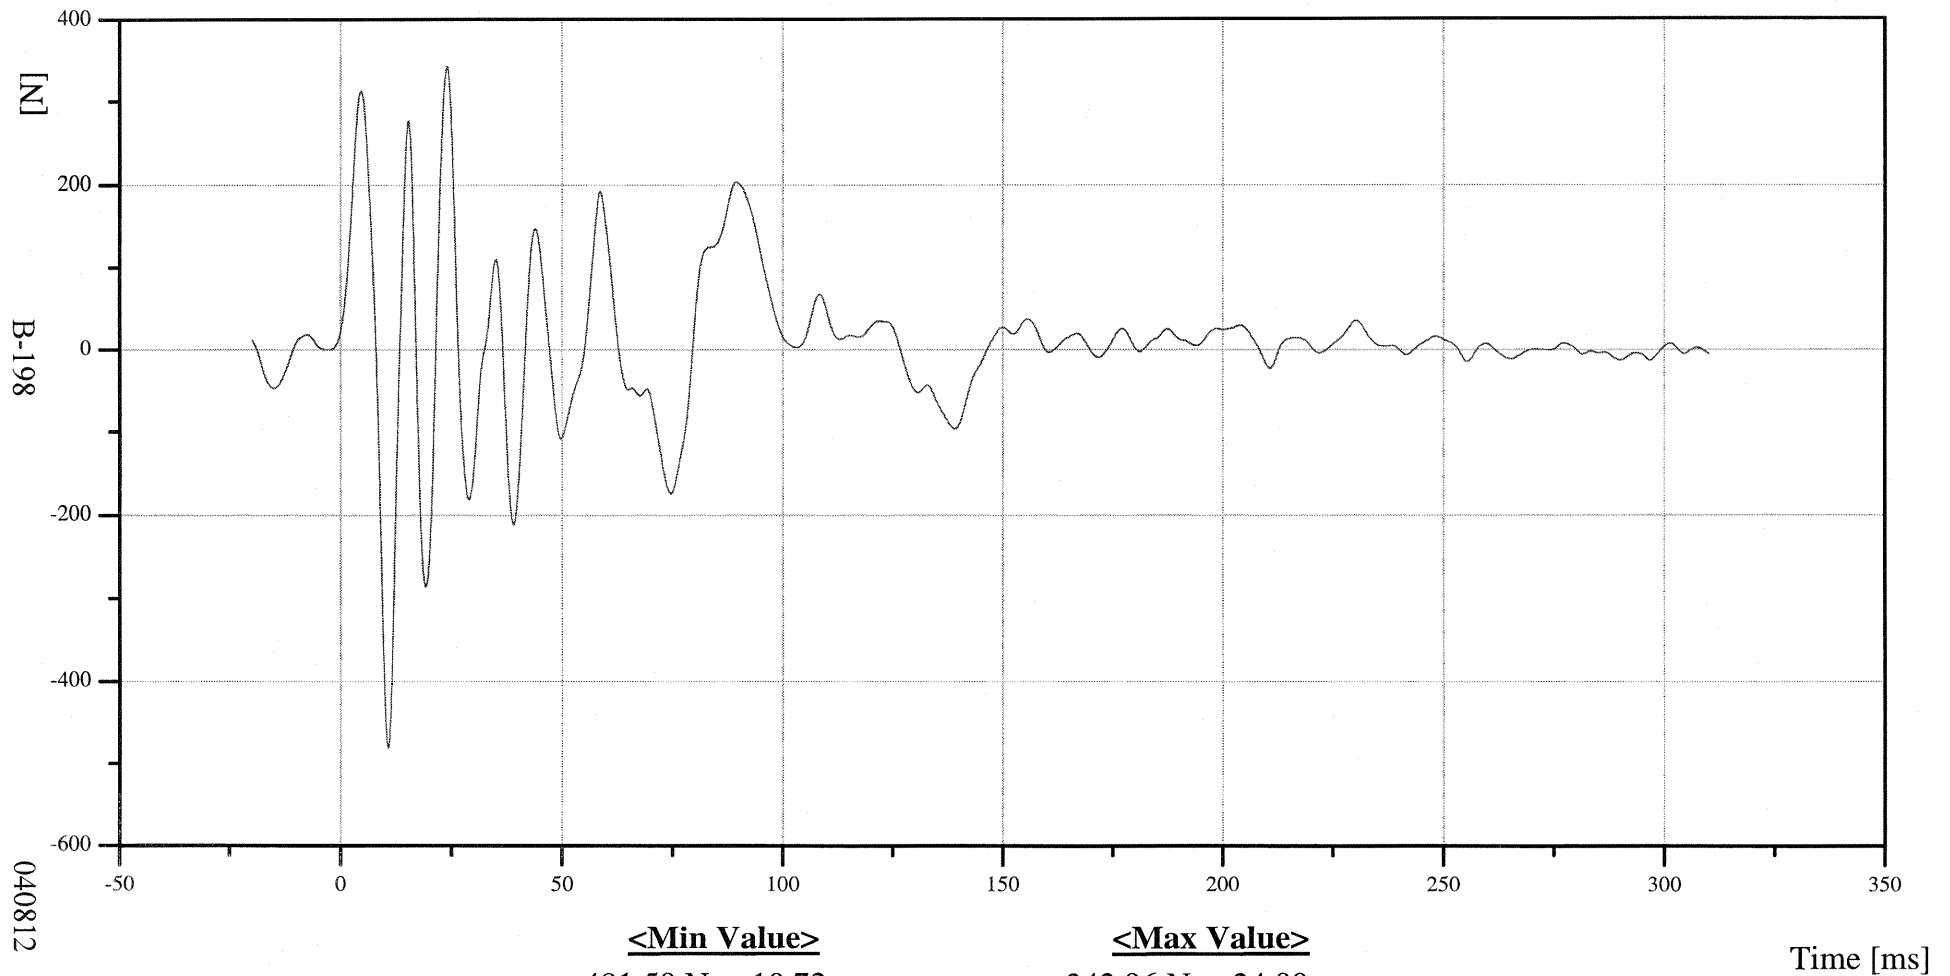

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0404

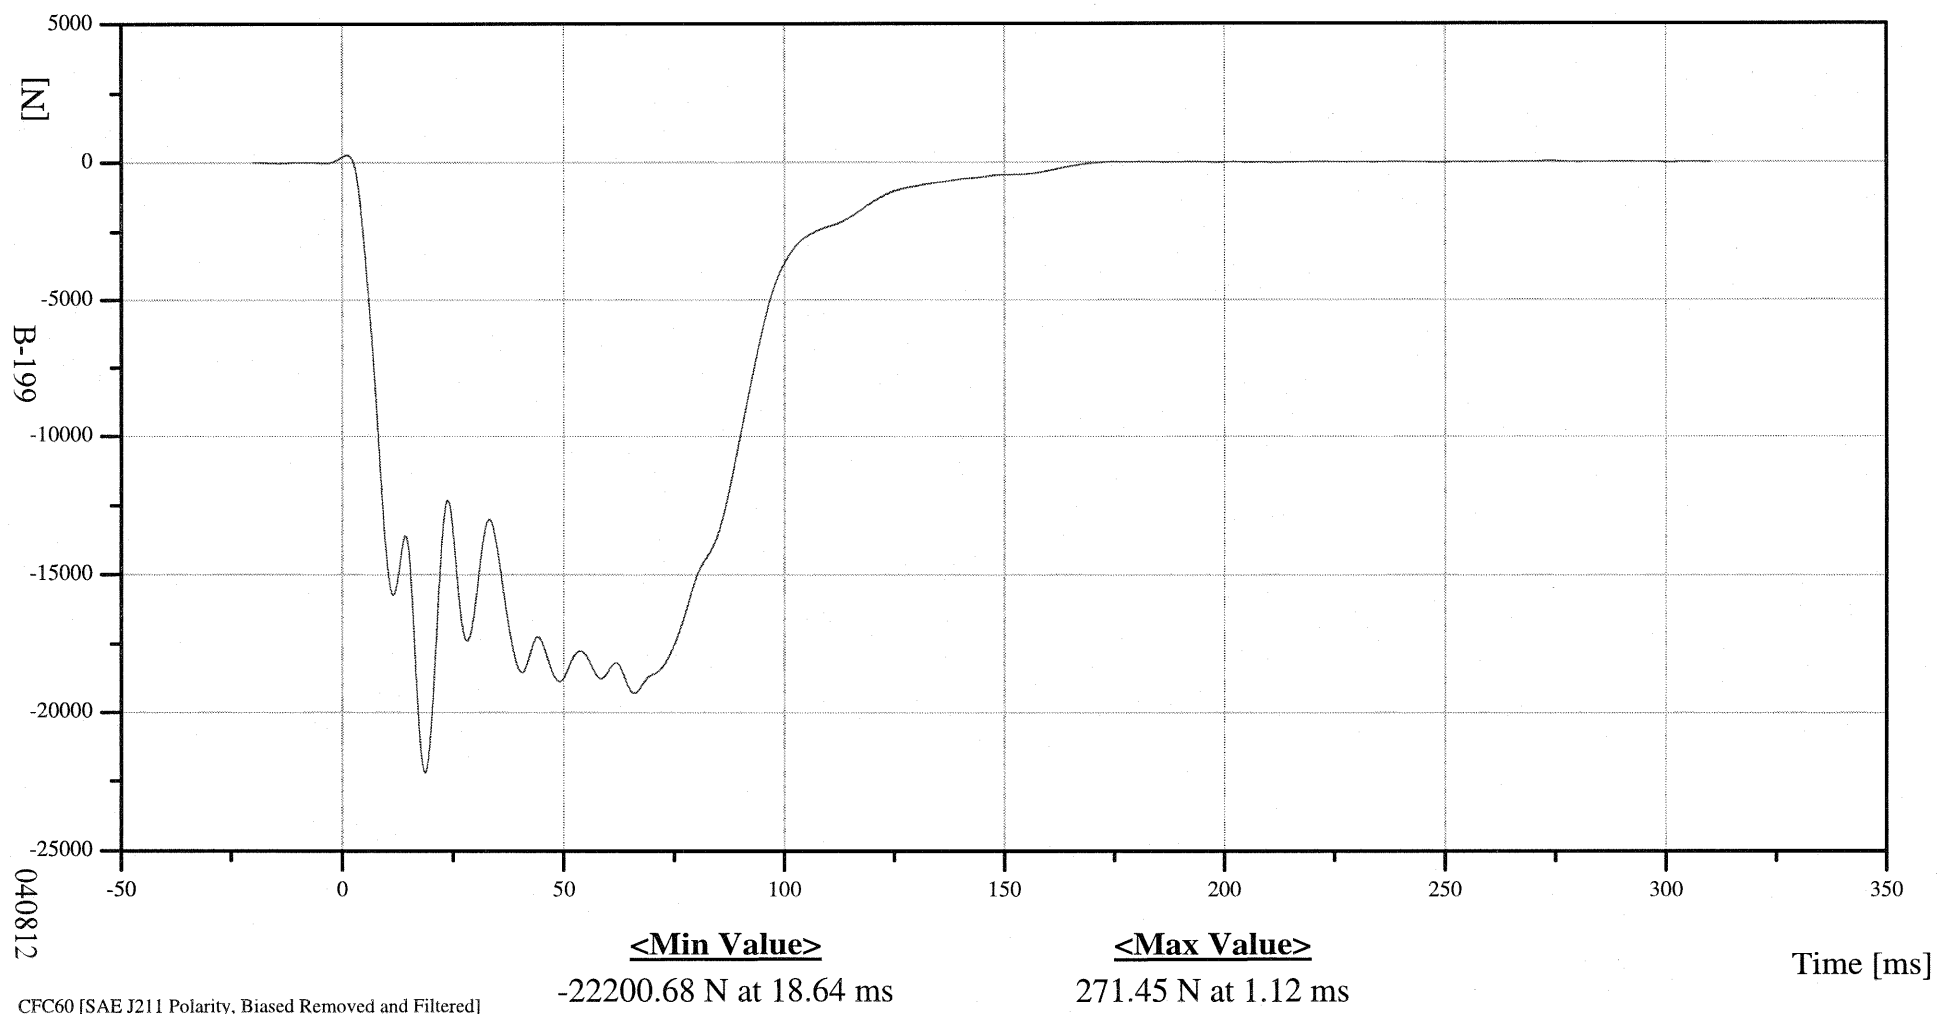



Transportation Research Center, Inc.

ROW 4 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0405

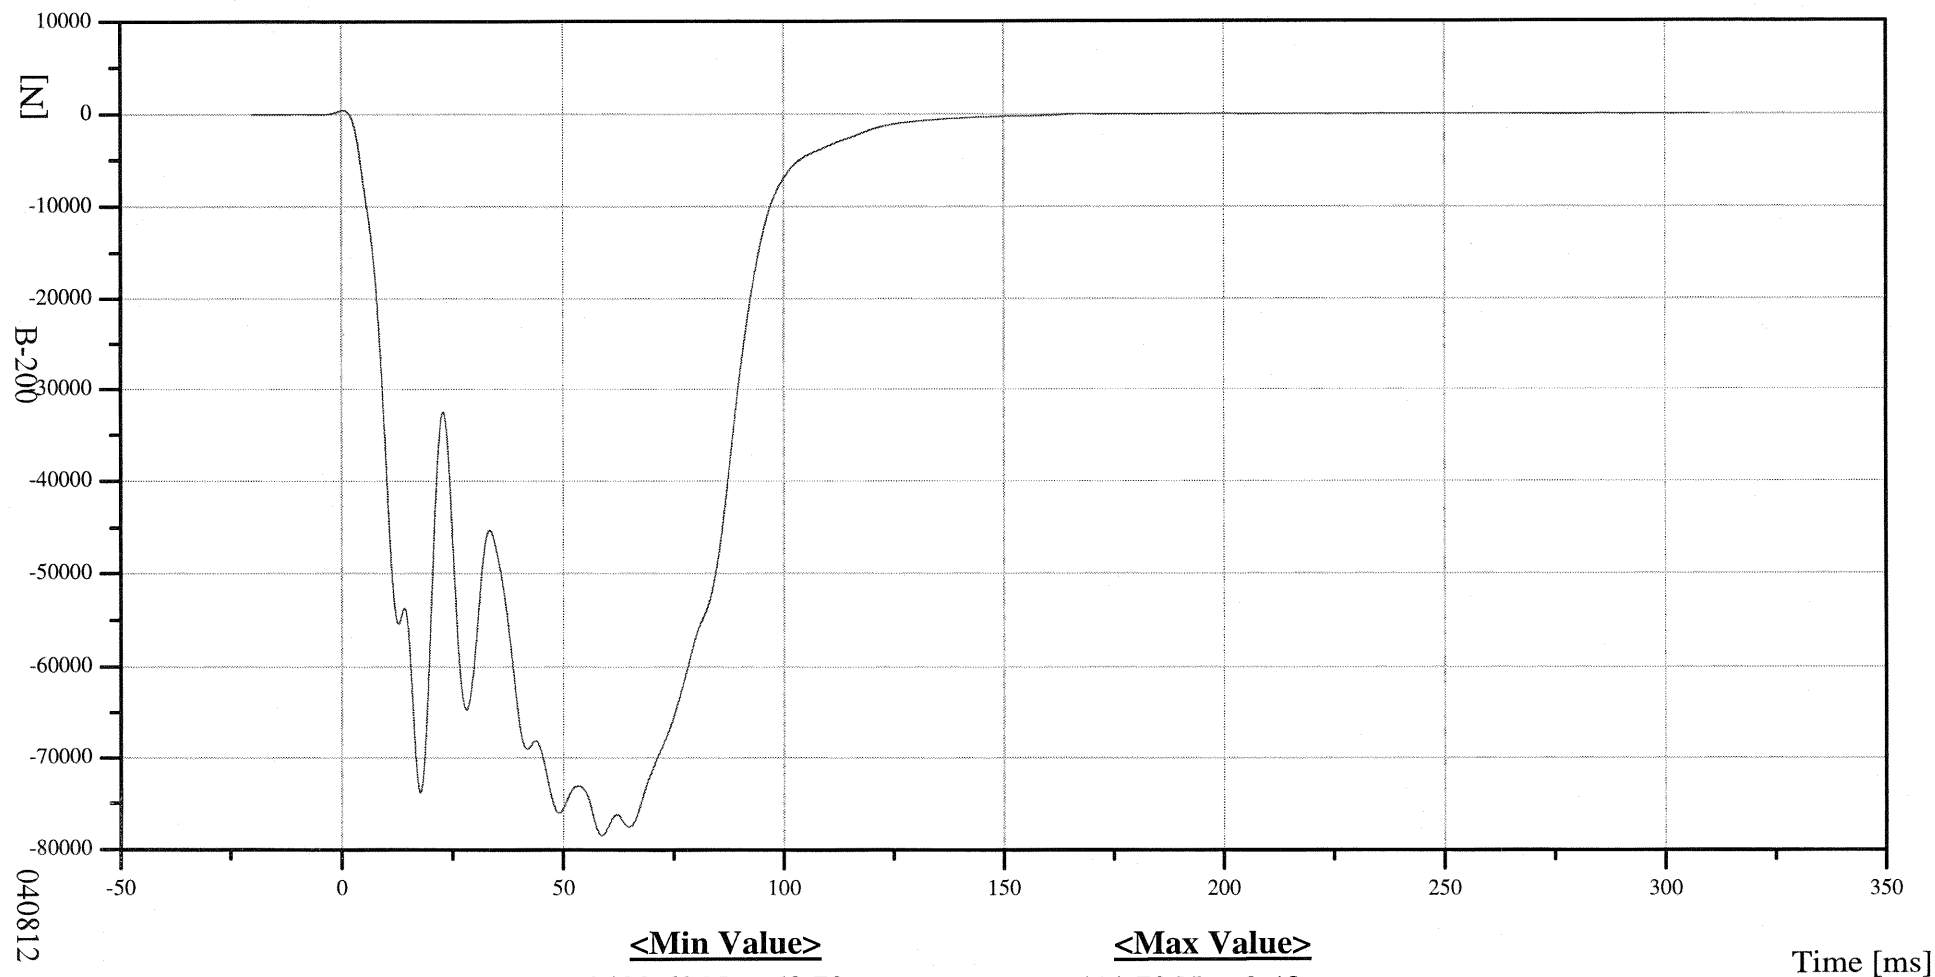

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 6

Date: 08/12/2004
Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0406

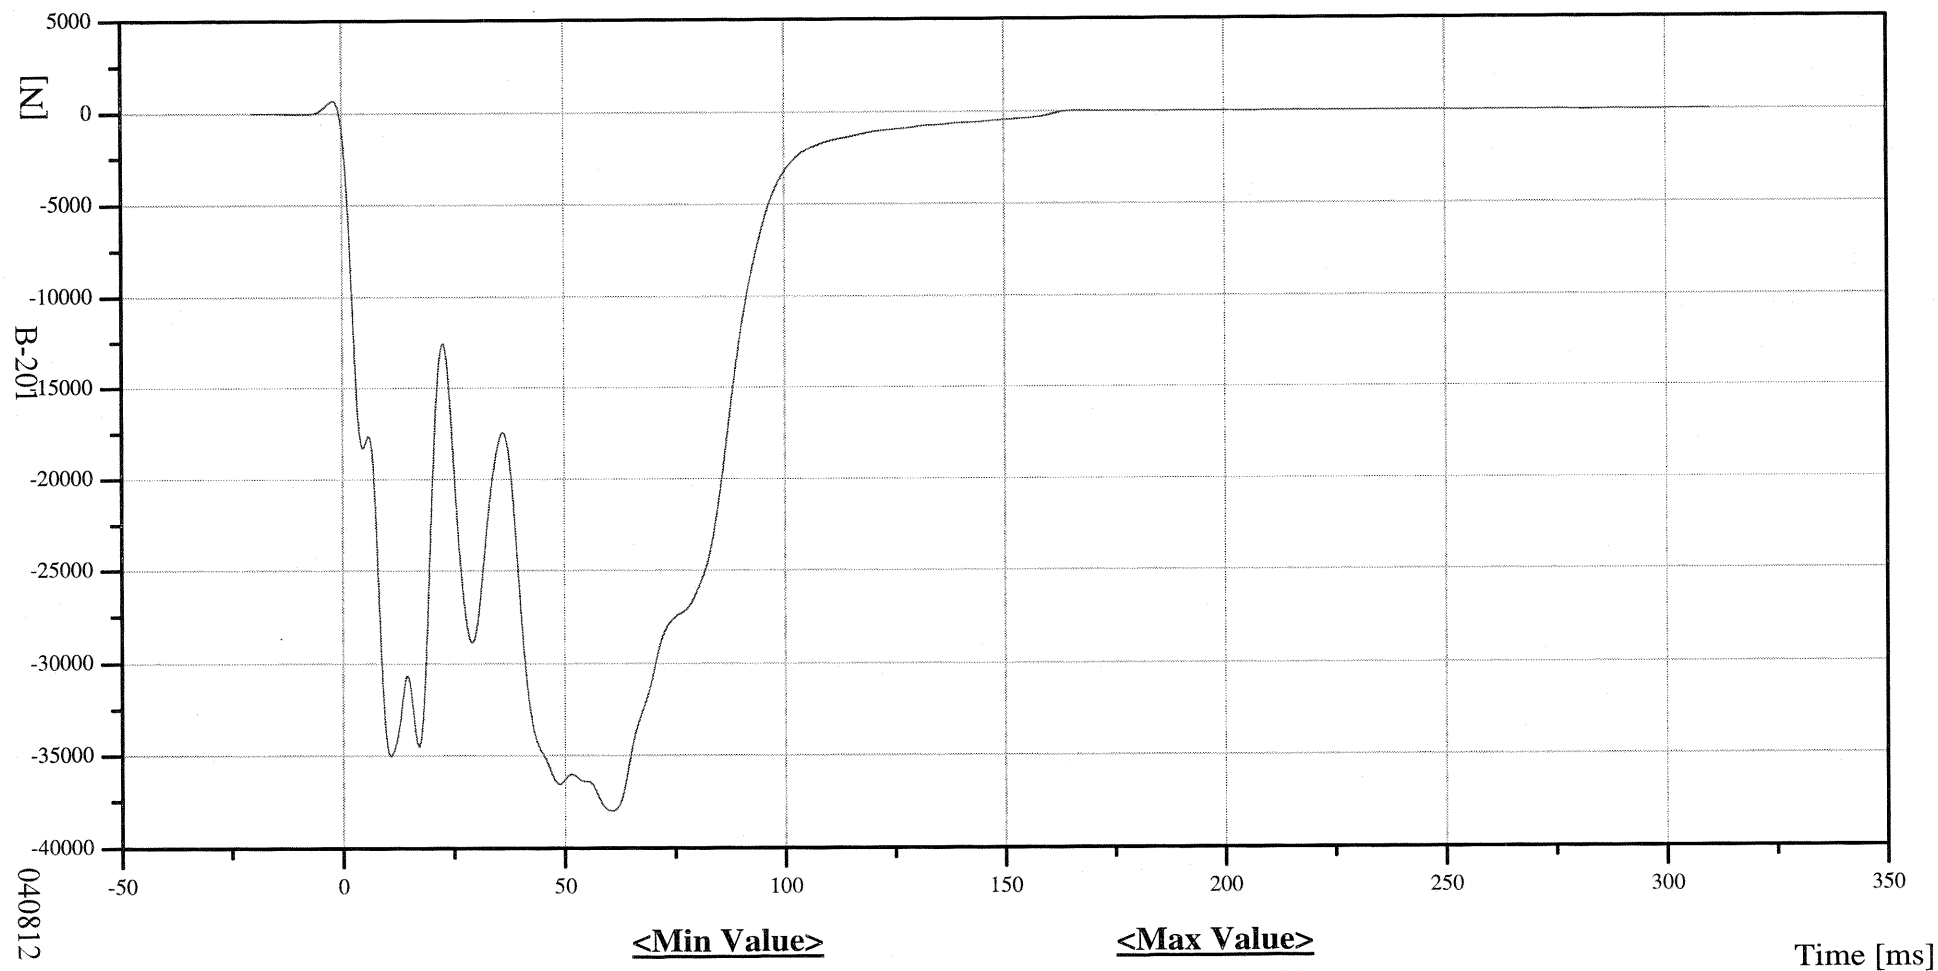

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0407

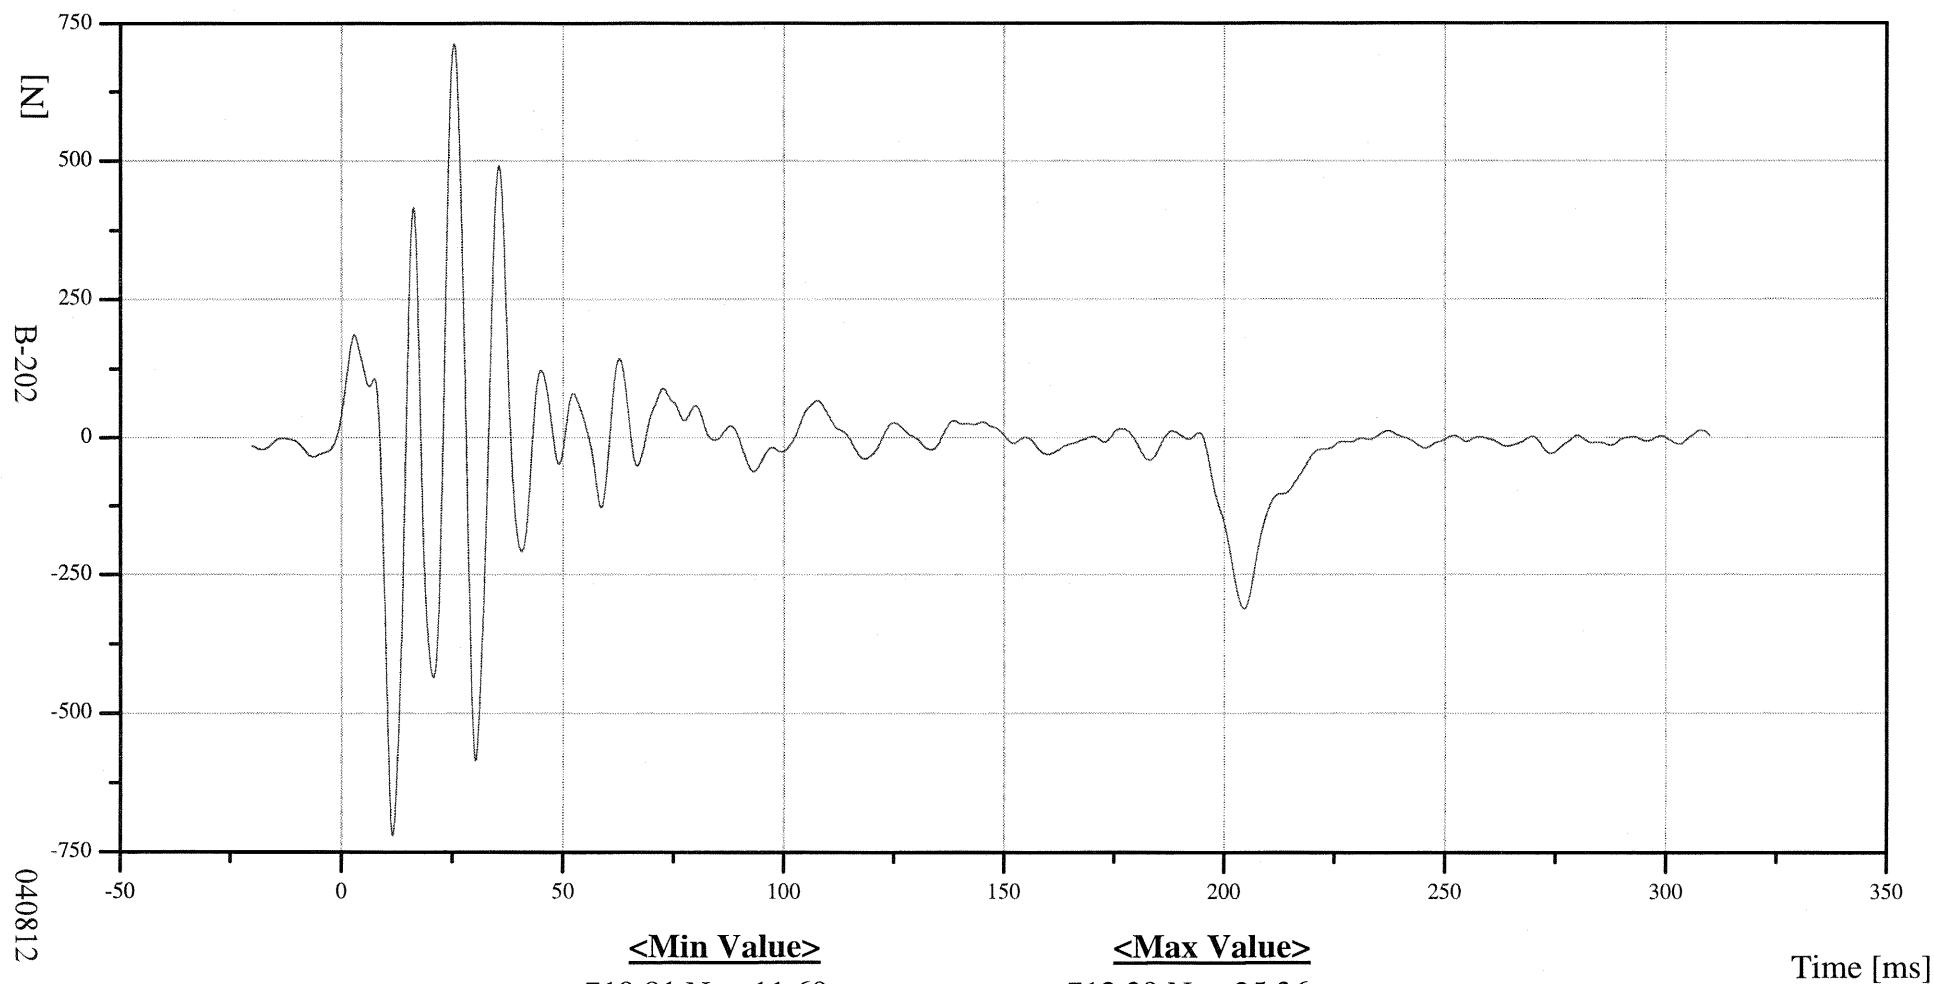

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]

-719.81 N at 11.60 ms

712.39 N at 25.36 ms



Transportation Research Center, Inc.

ROW 4 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0408

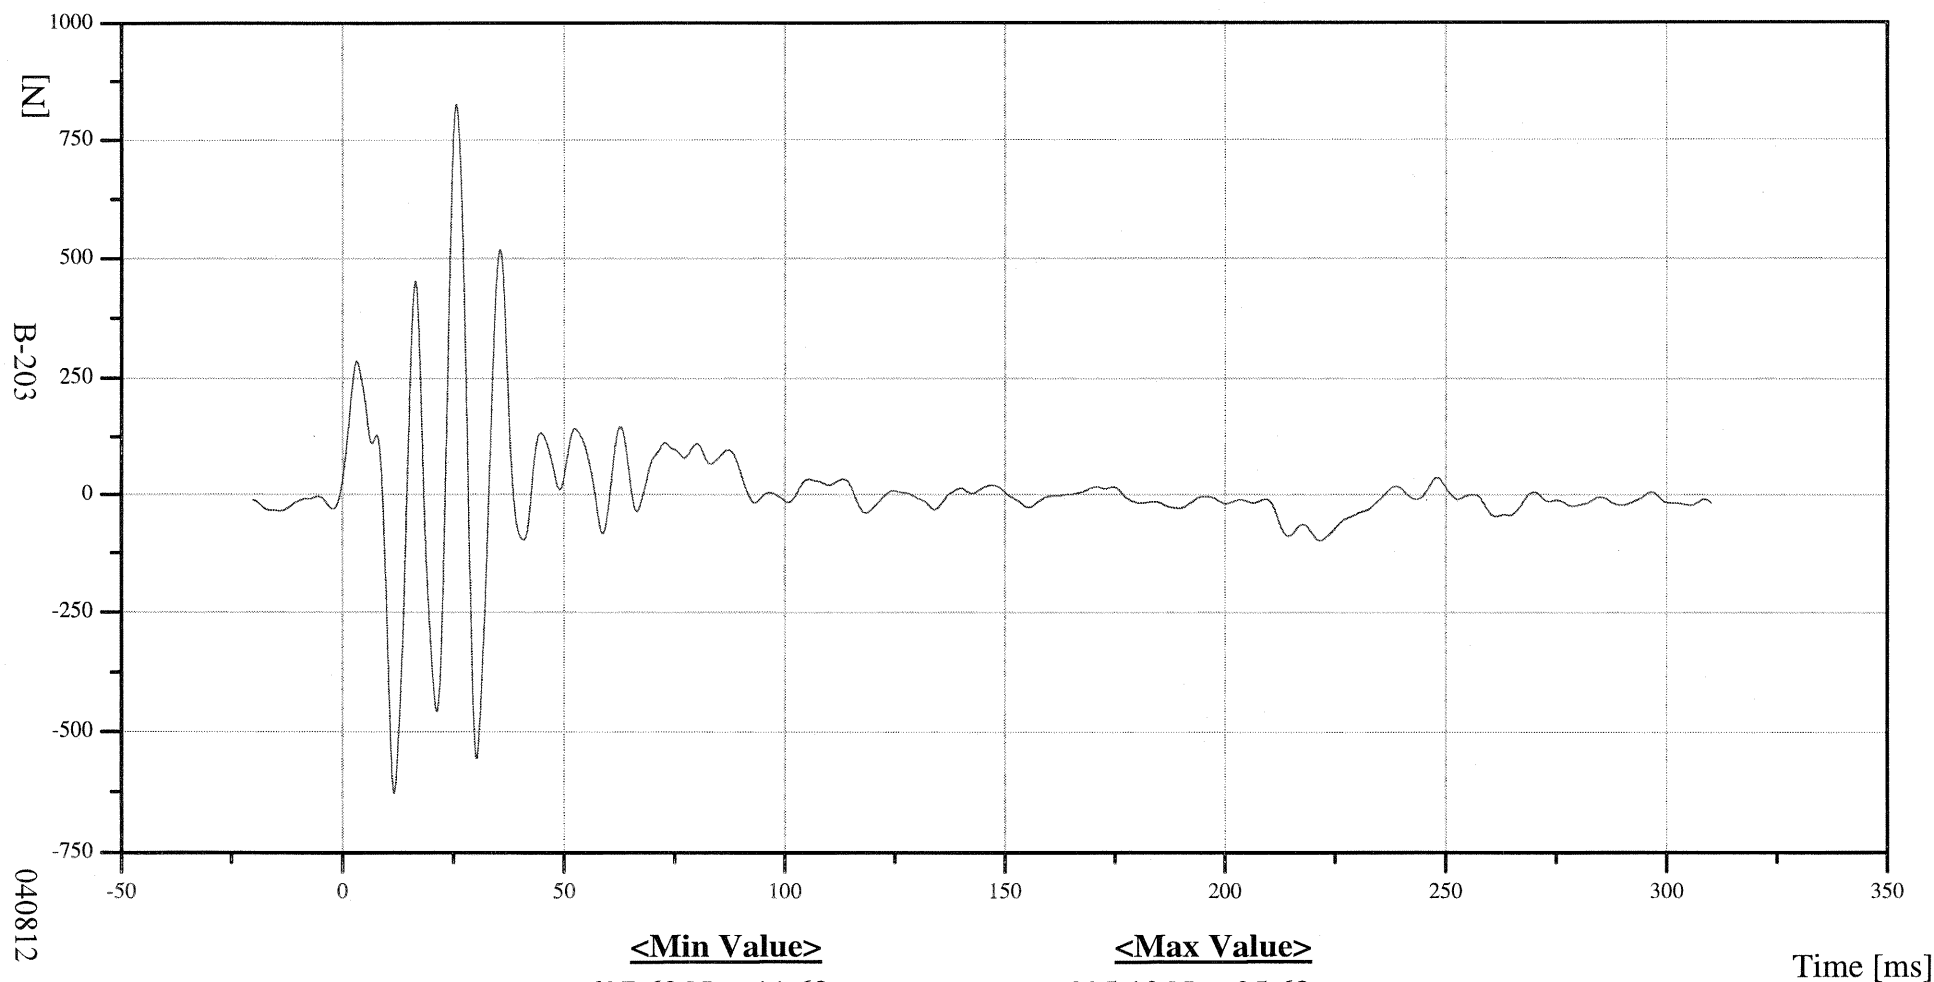

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0409

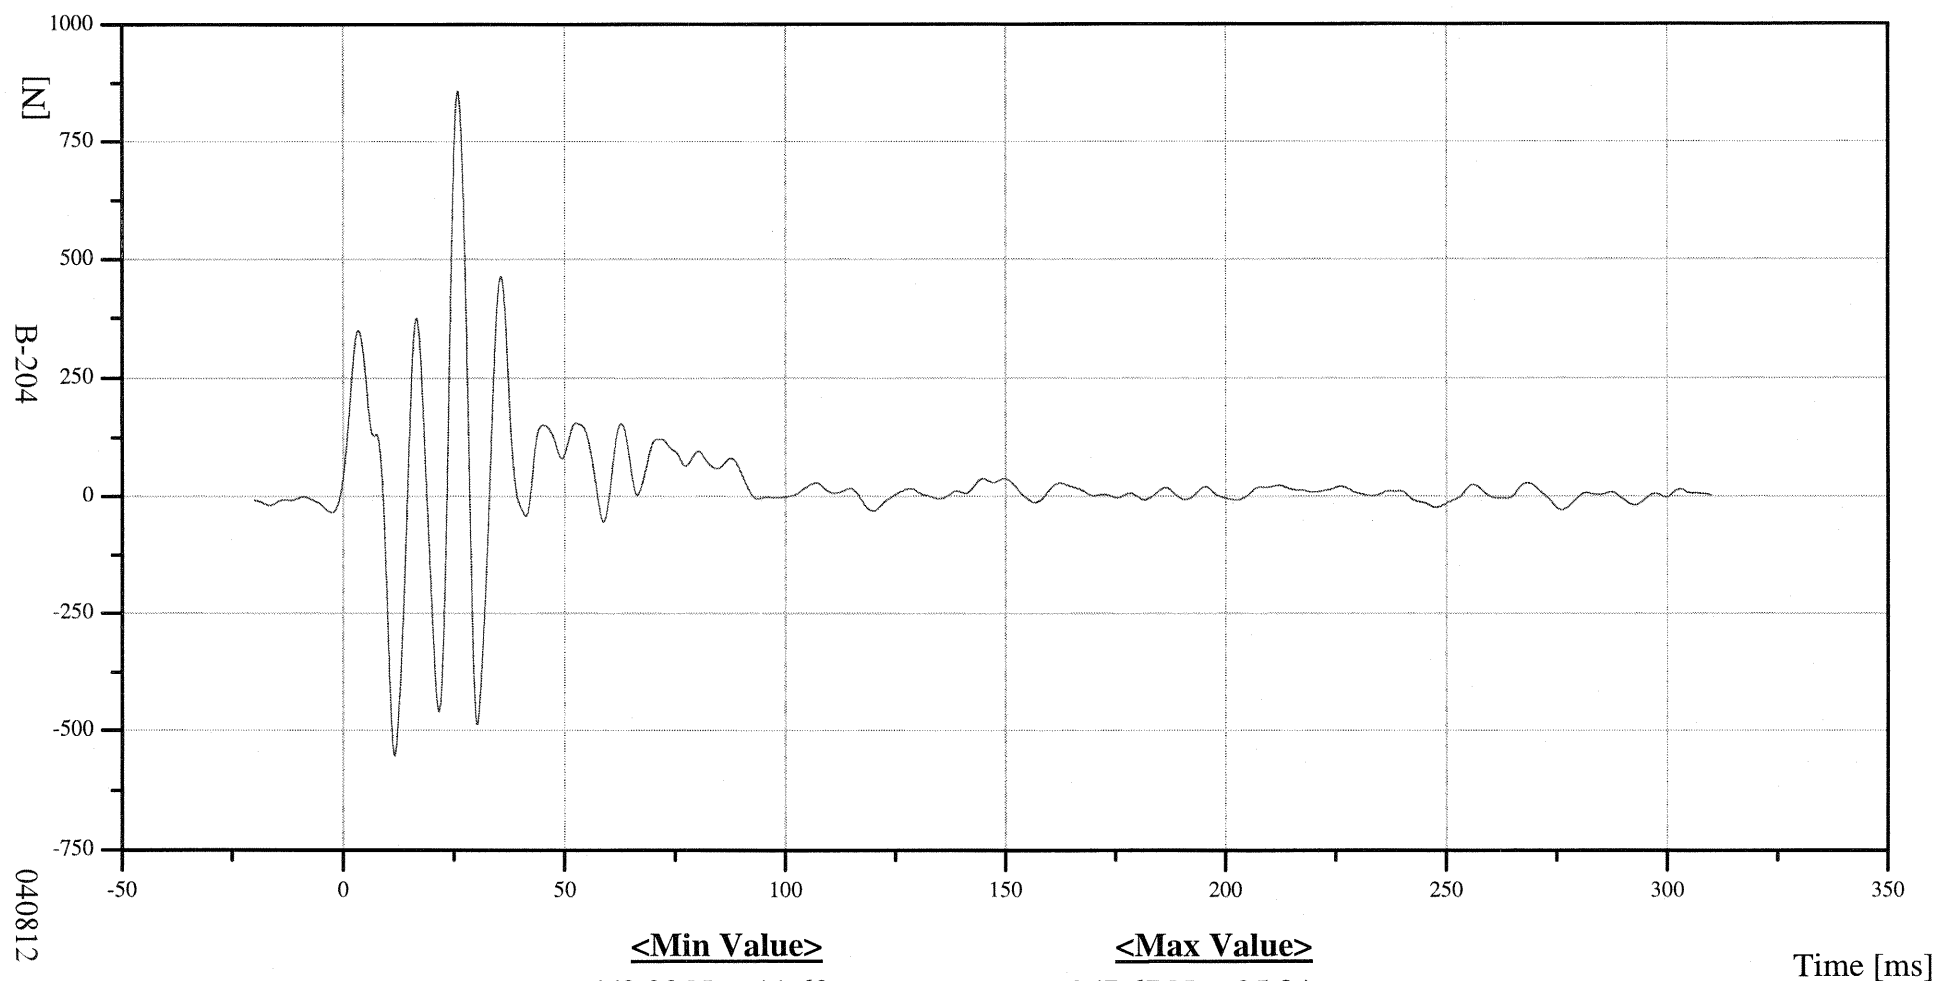

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0410

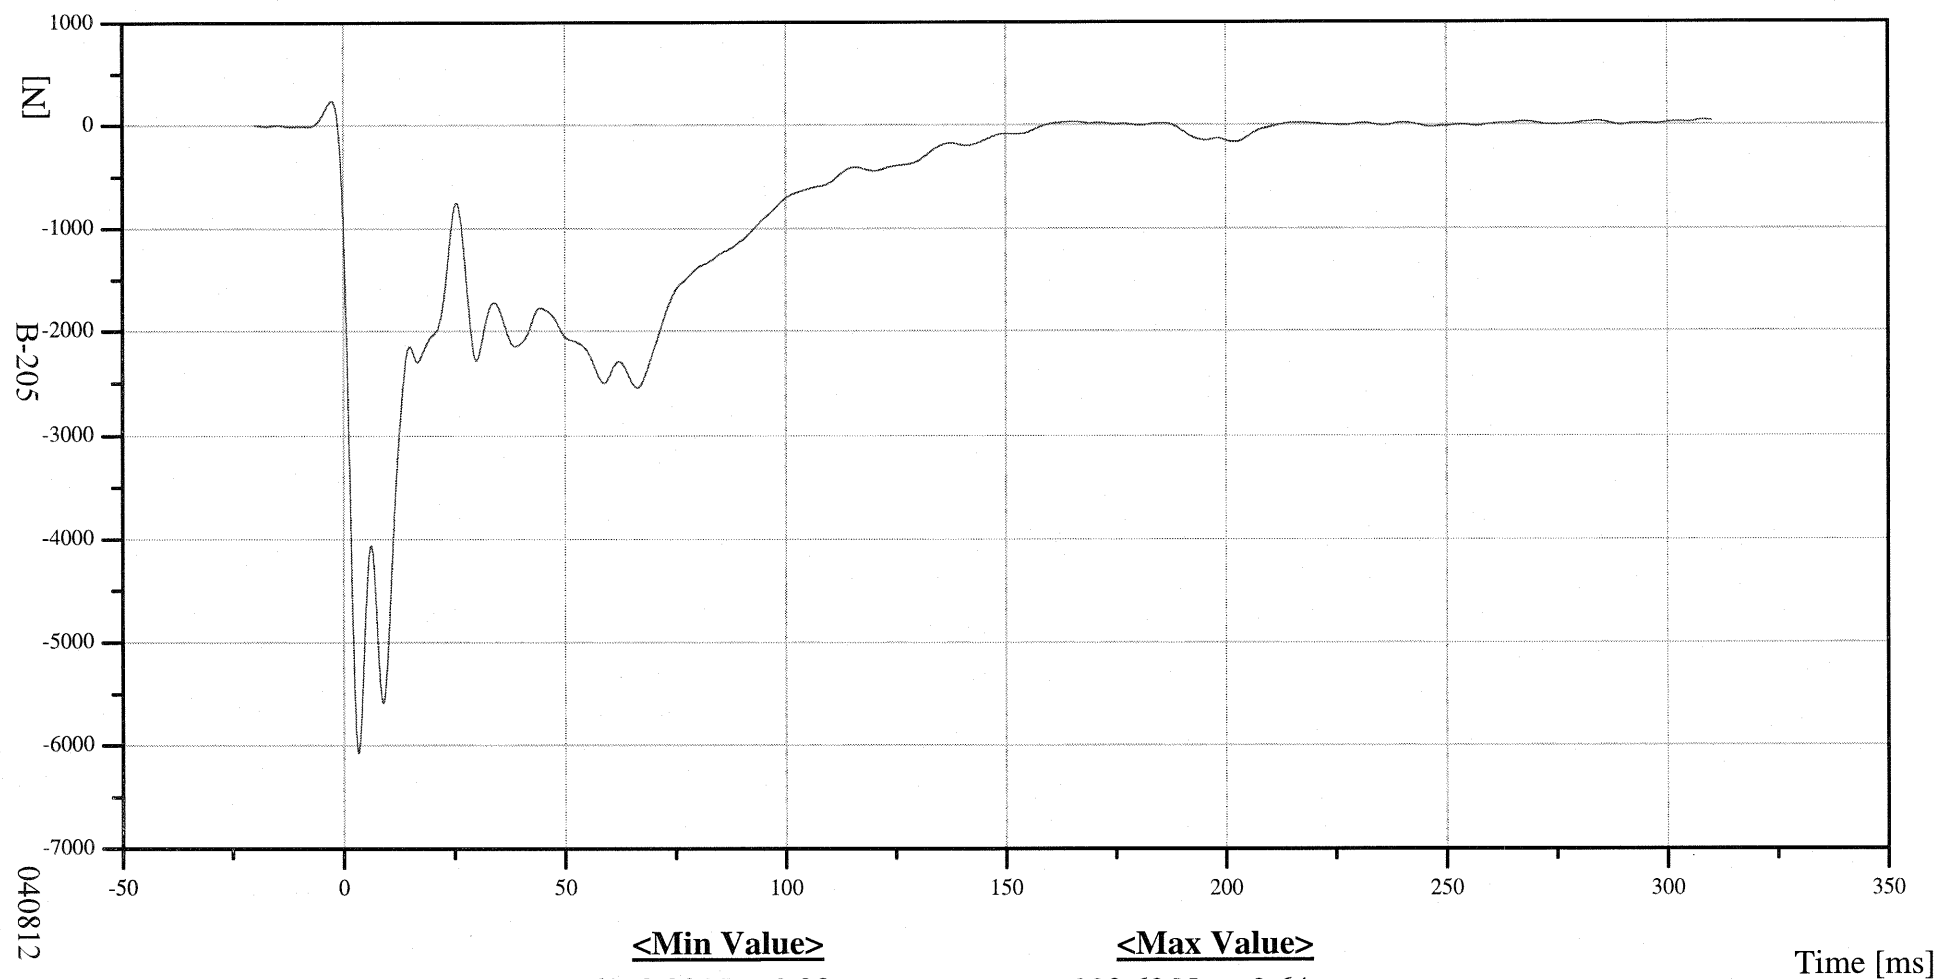

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0411

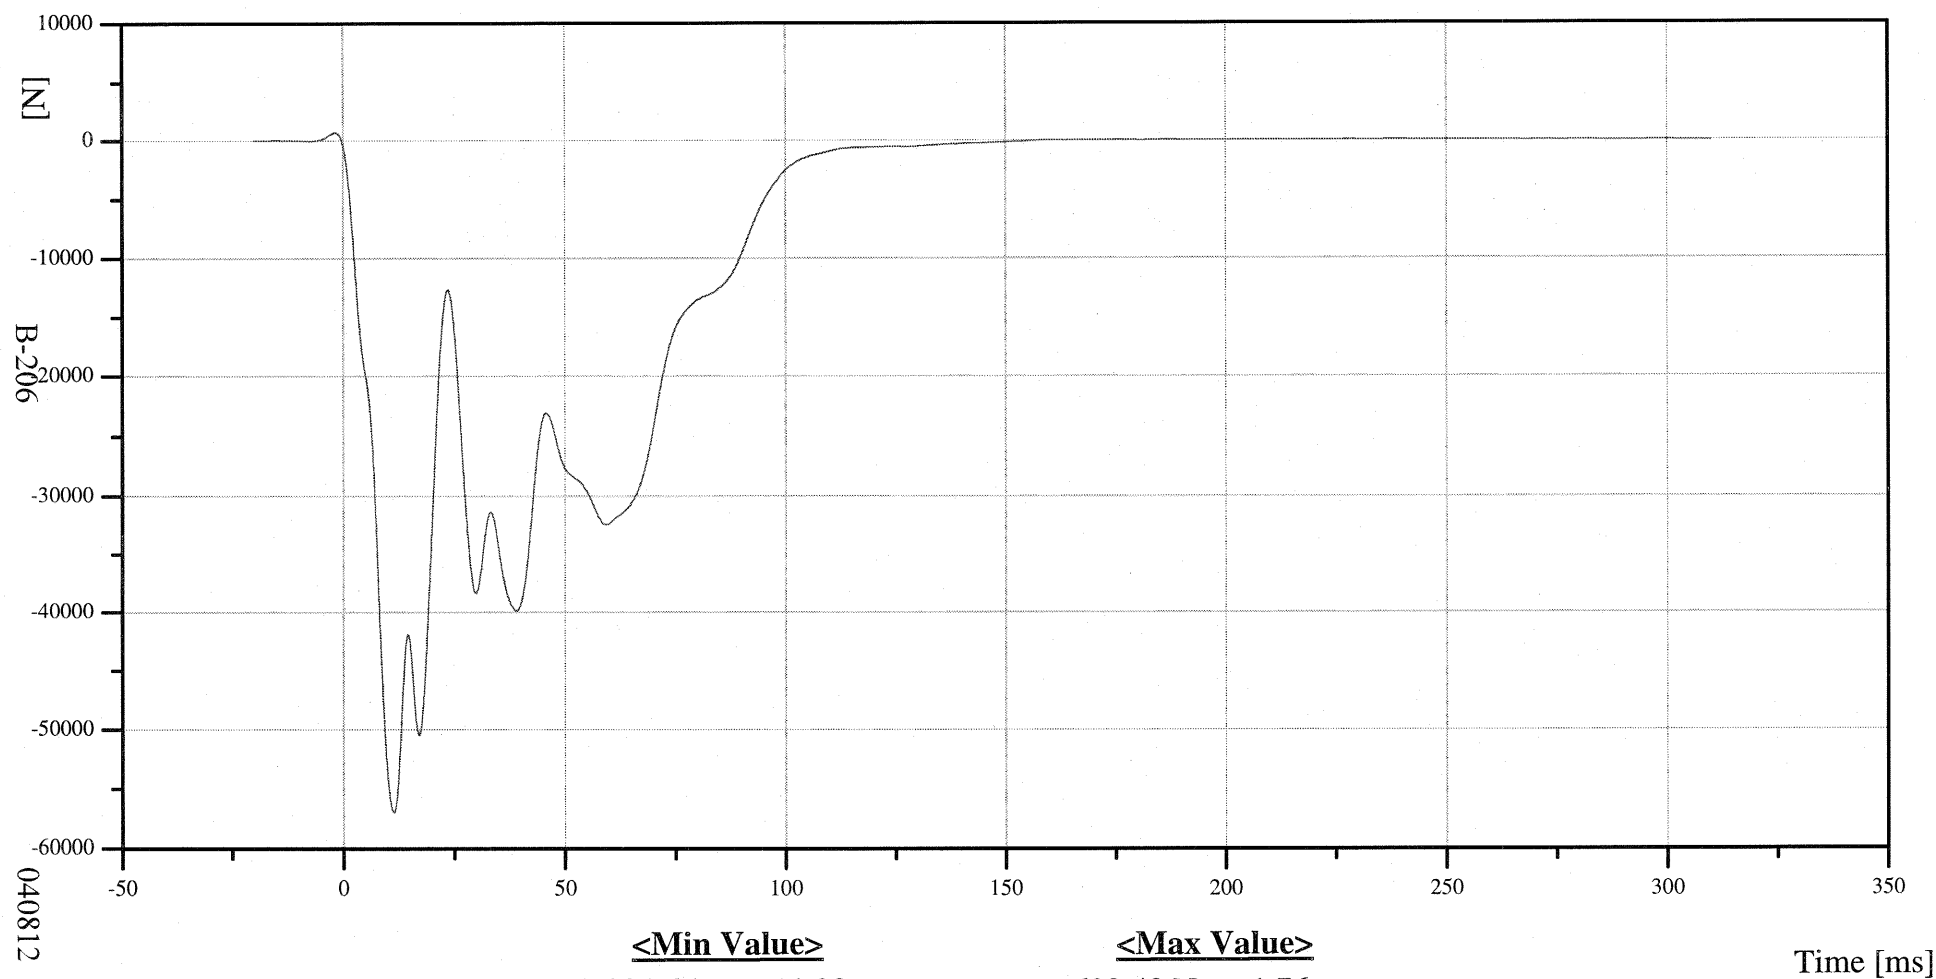

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0412

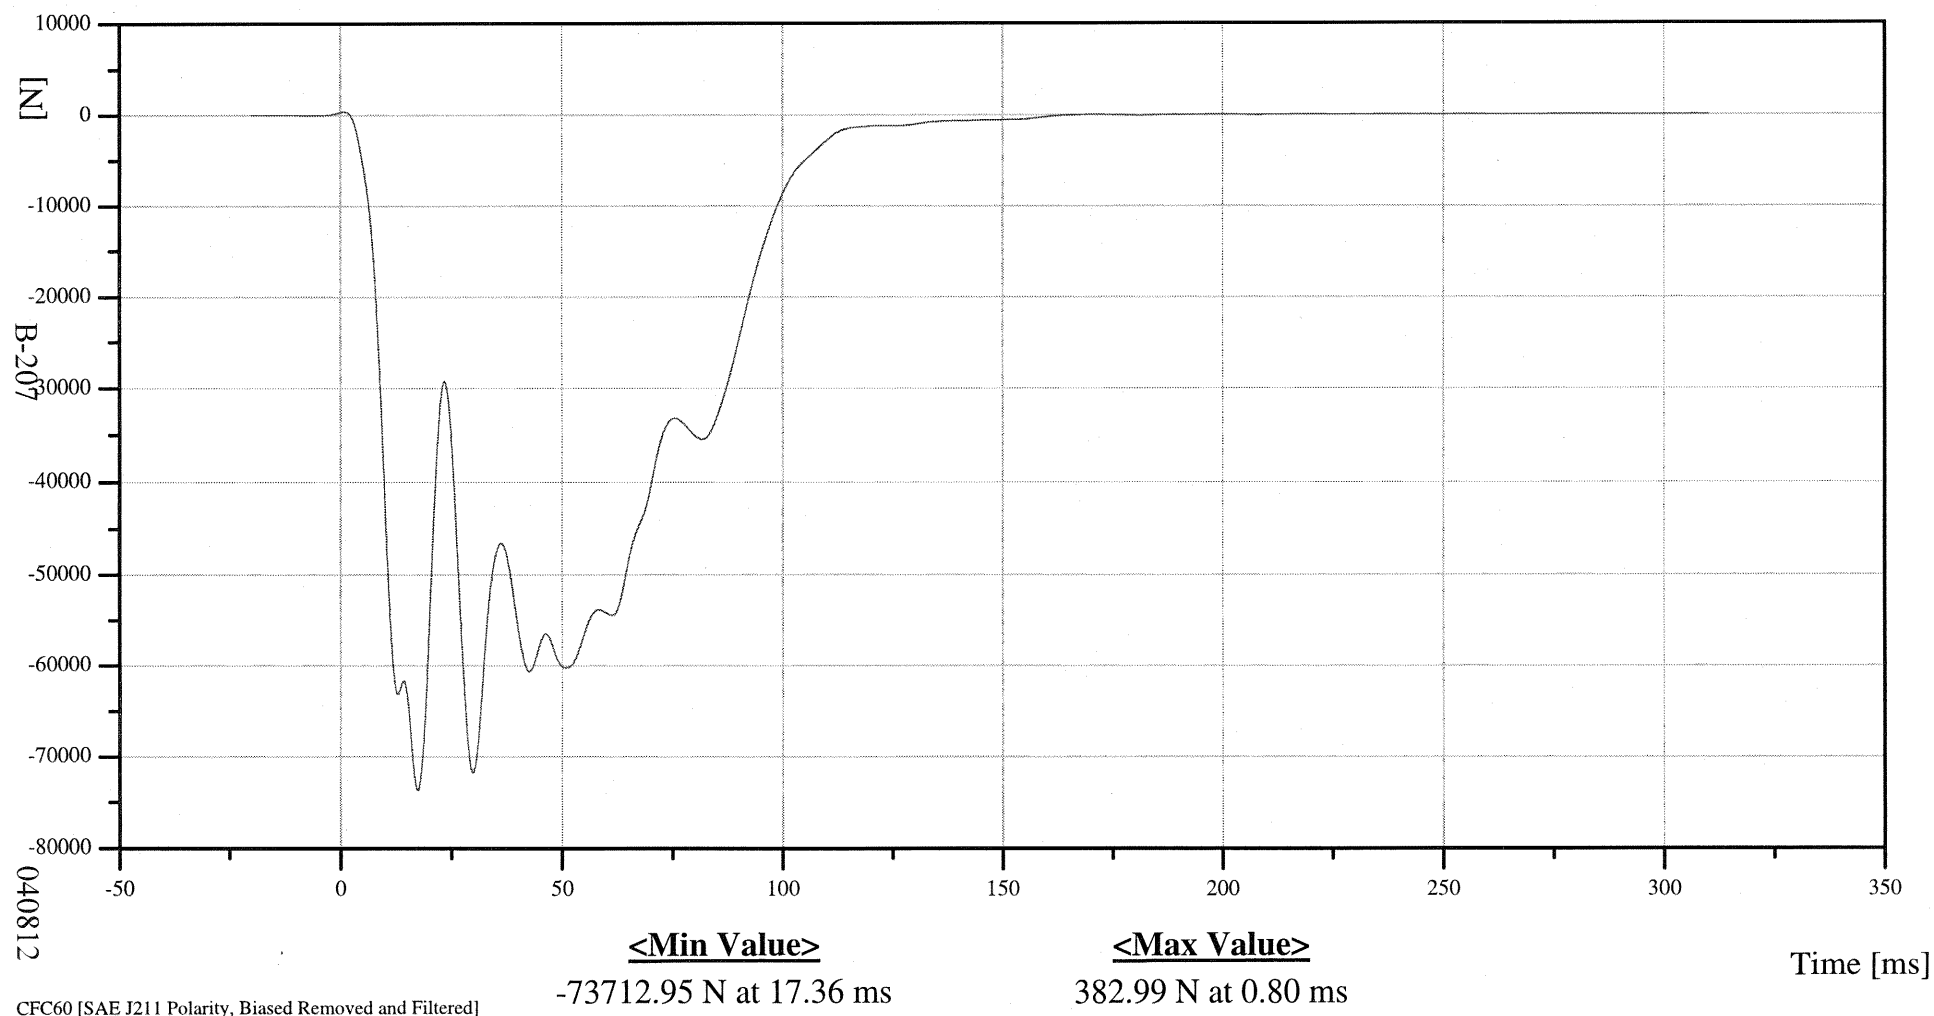



Transportation Research Center, Inc.

ROW 4 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0413

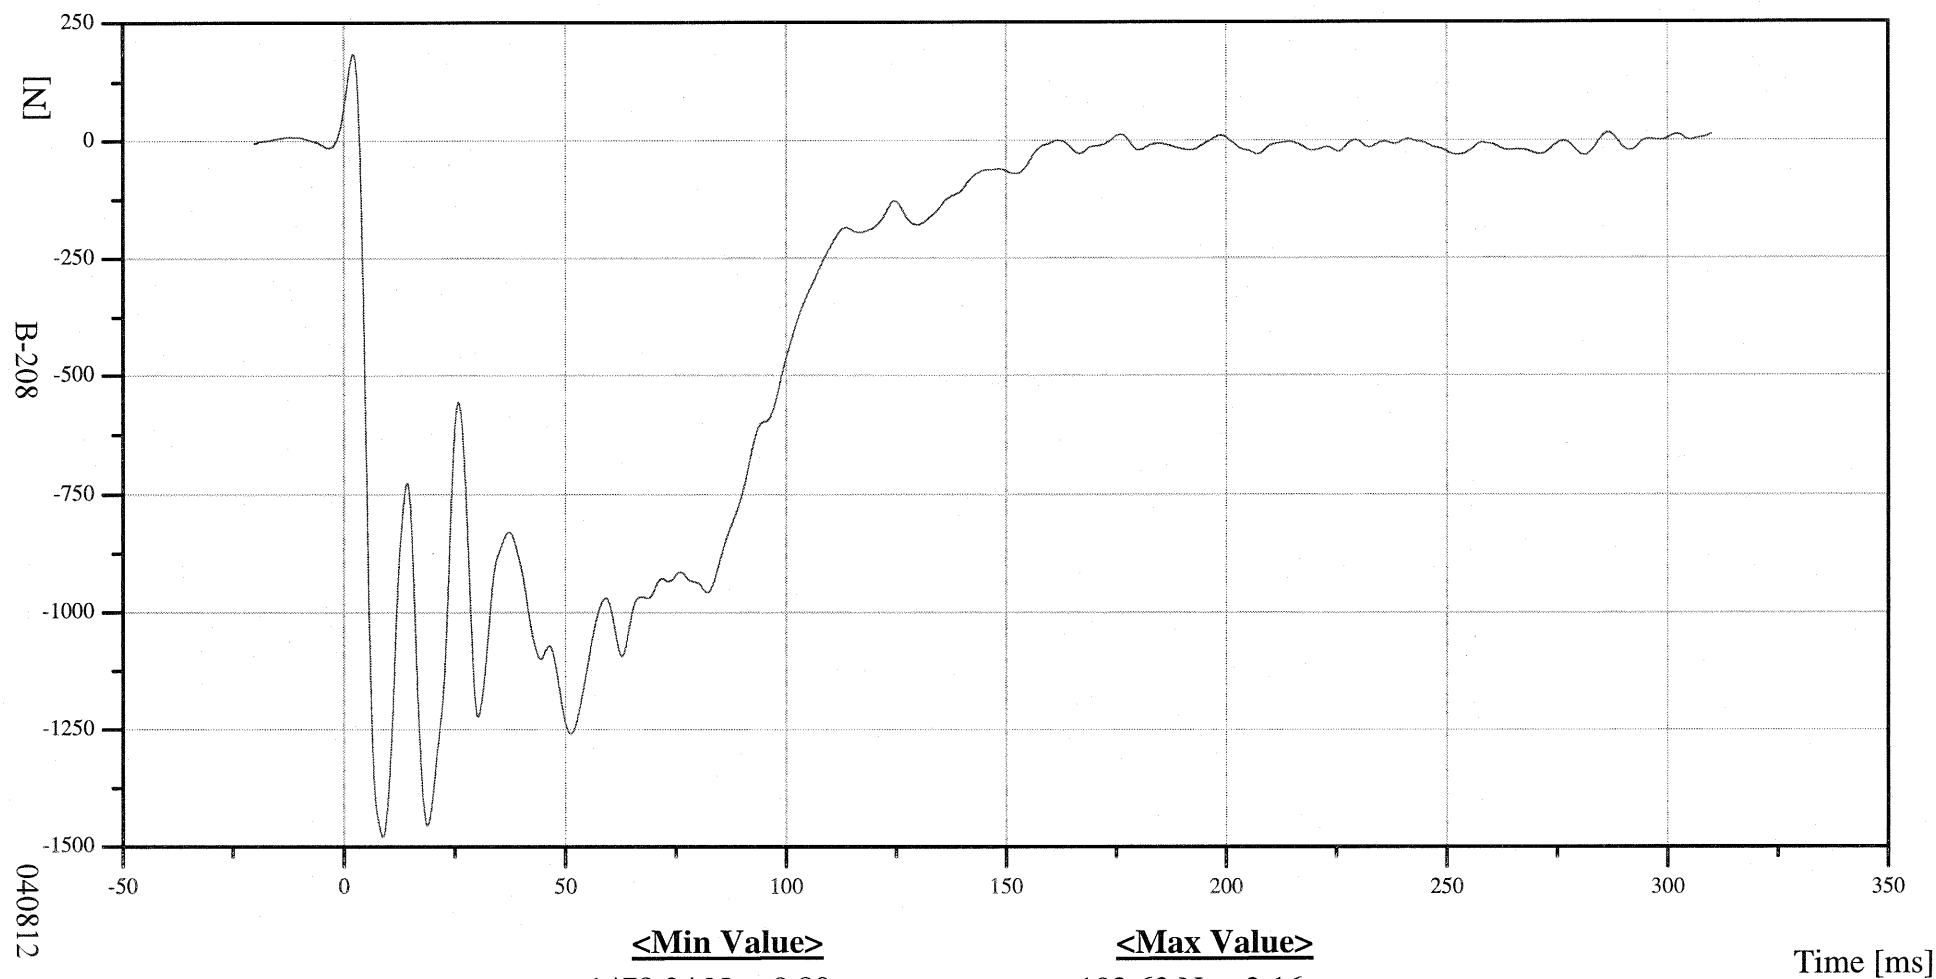

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0414

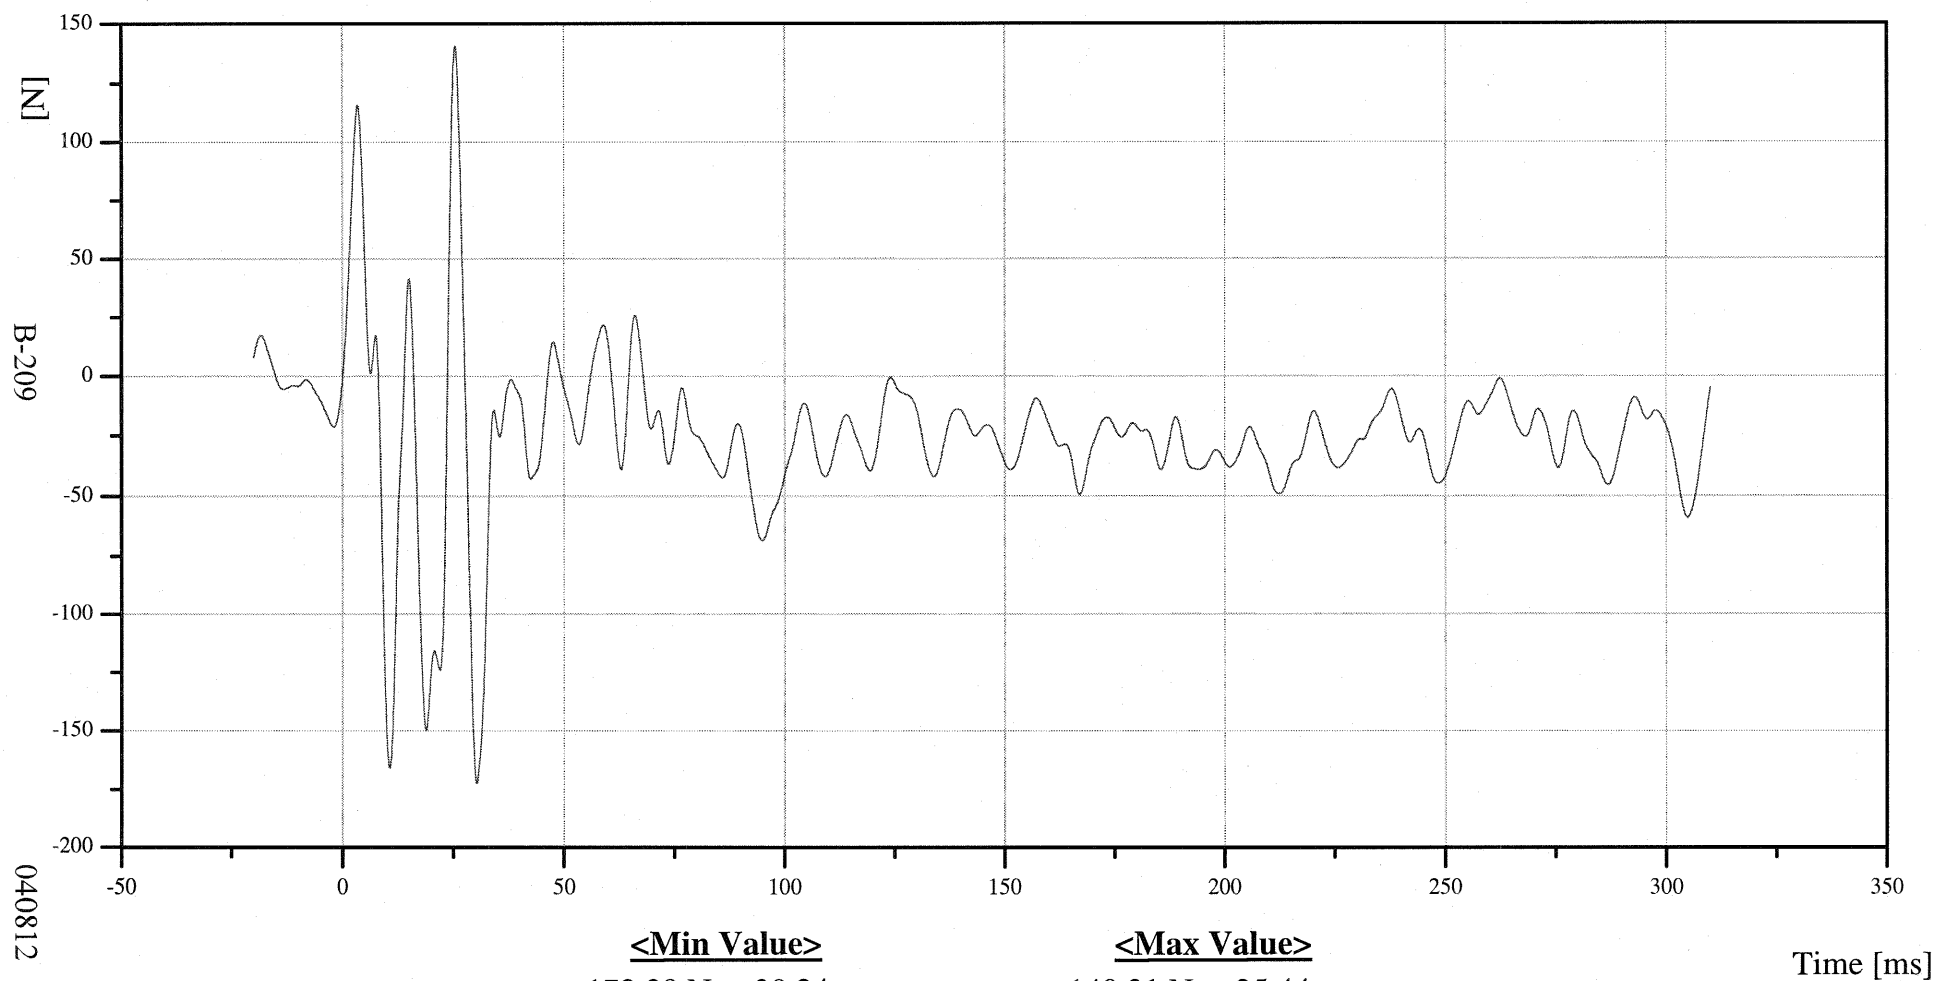

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 4 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0415

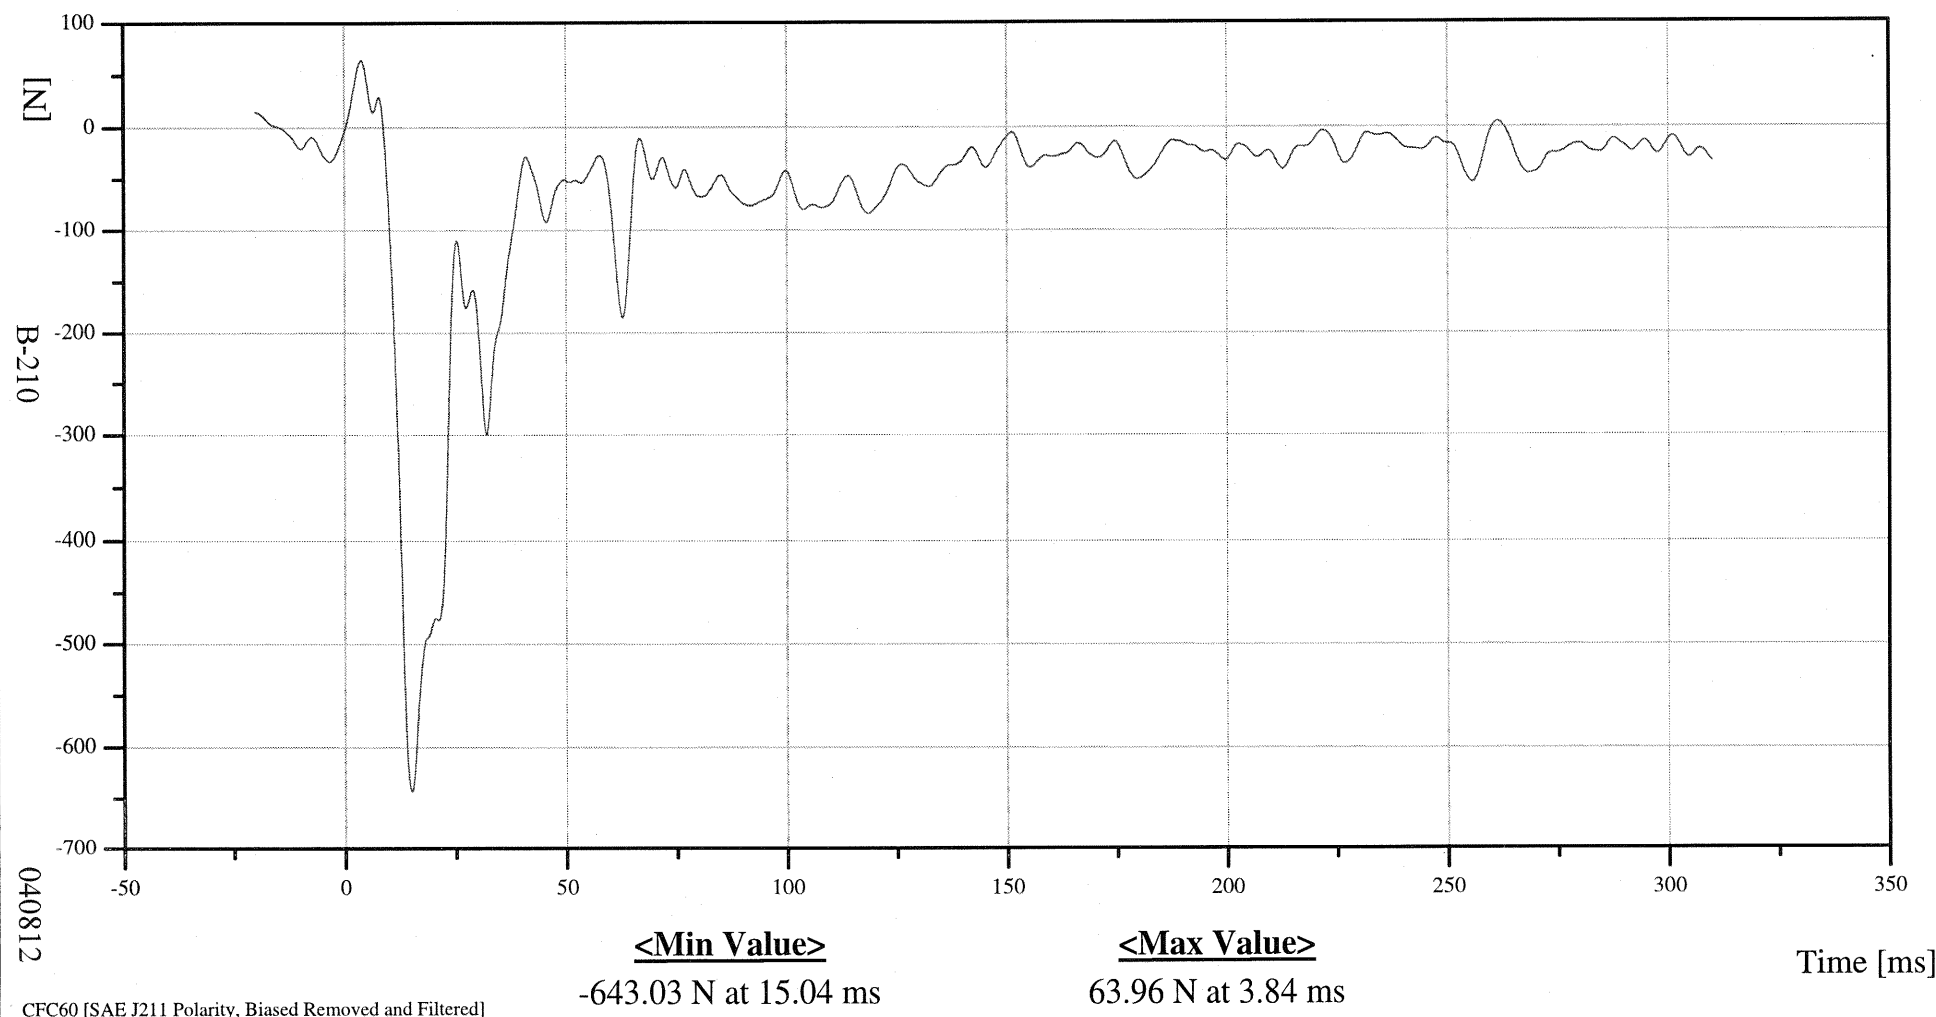



Transportation Research Center, Inc.

ROW 4 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0416

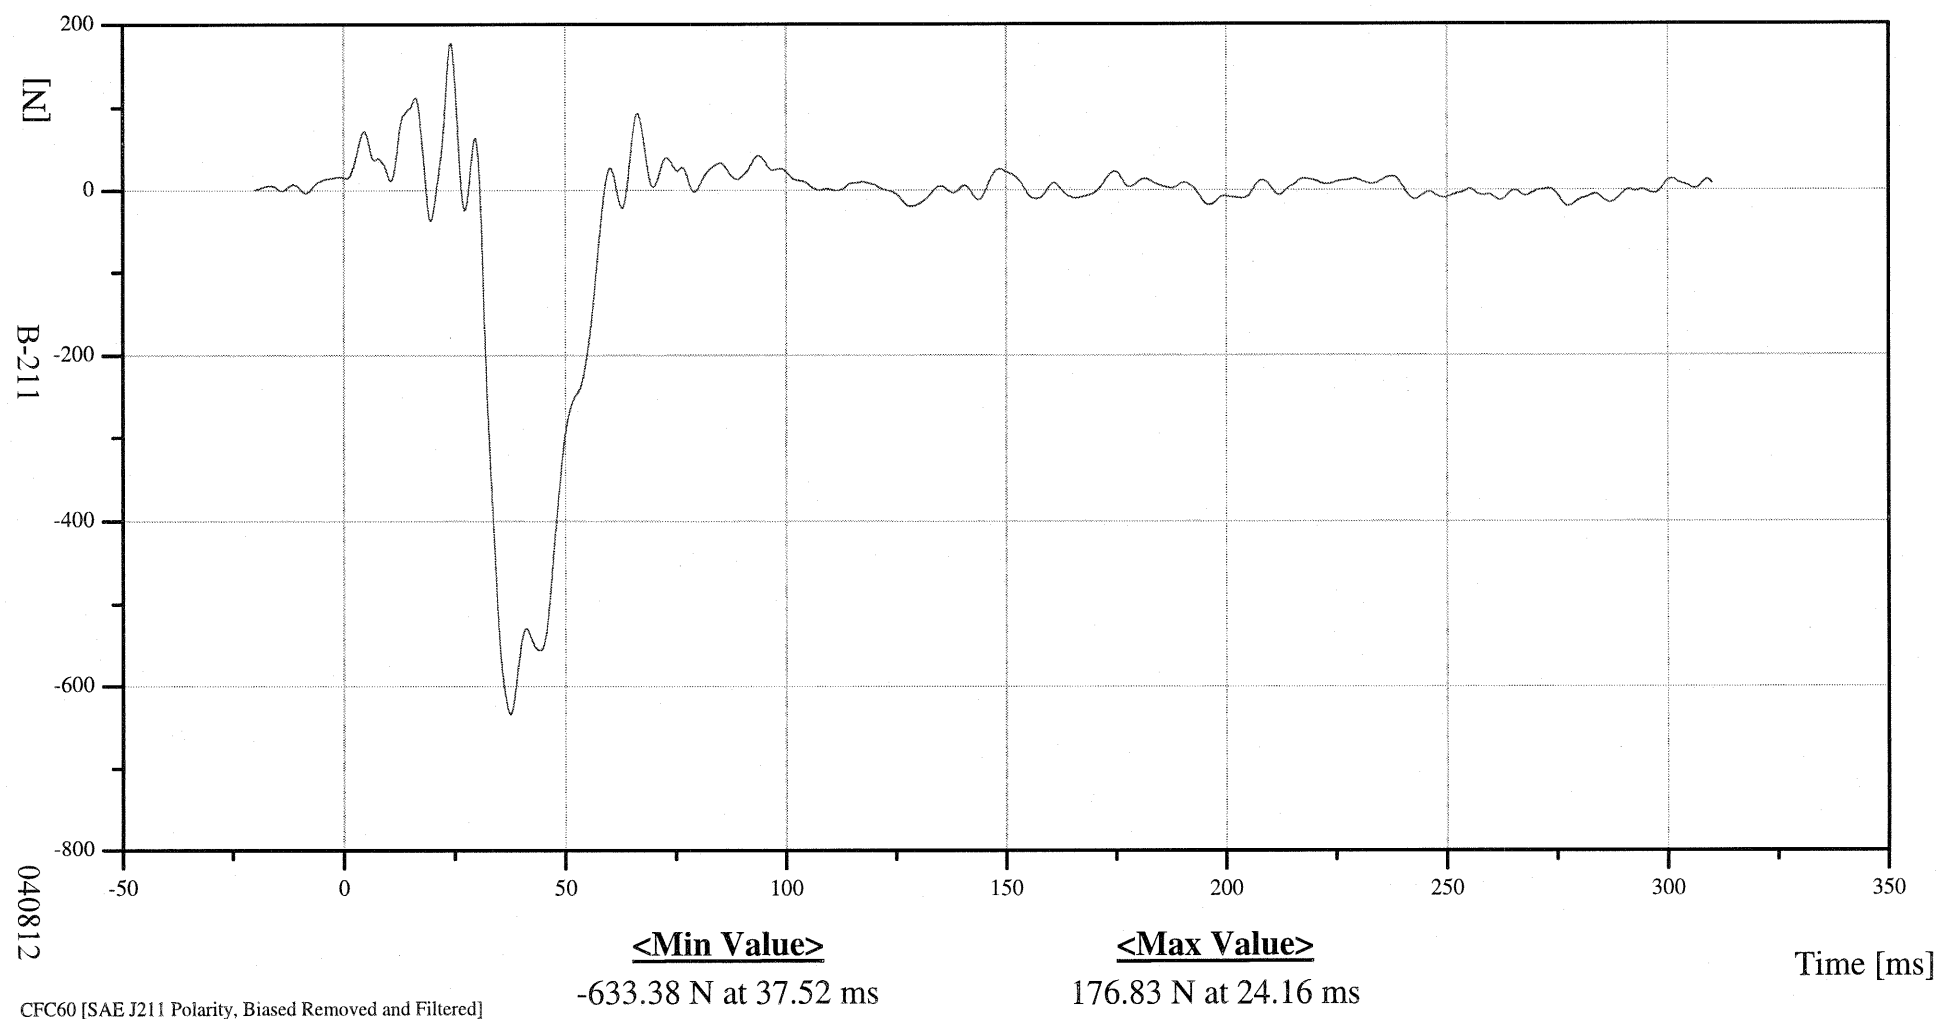



Transportation Research Center, Inc.

ROW 5 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0501

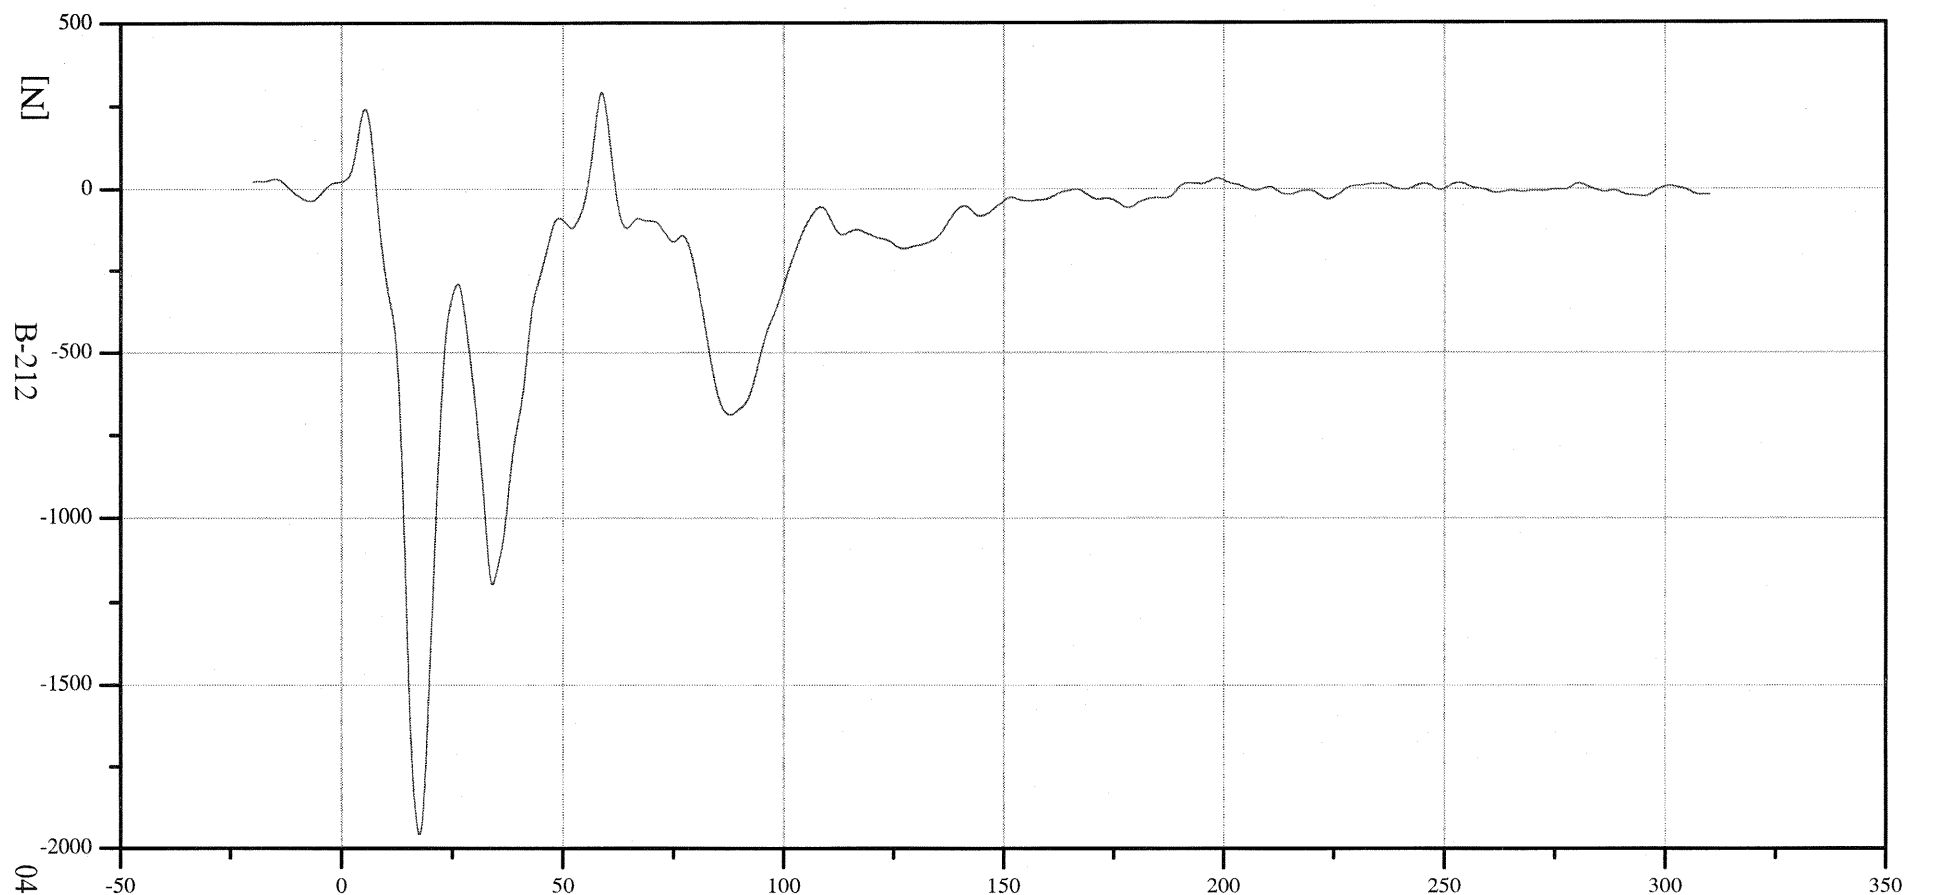

<Min Value>

-1956.81 N at 17.60 ms

<Max Value>

288.71 N at 58.72 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0502

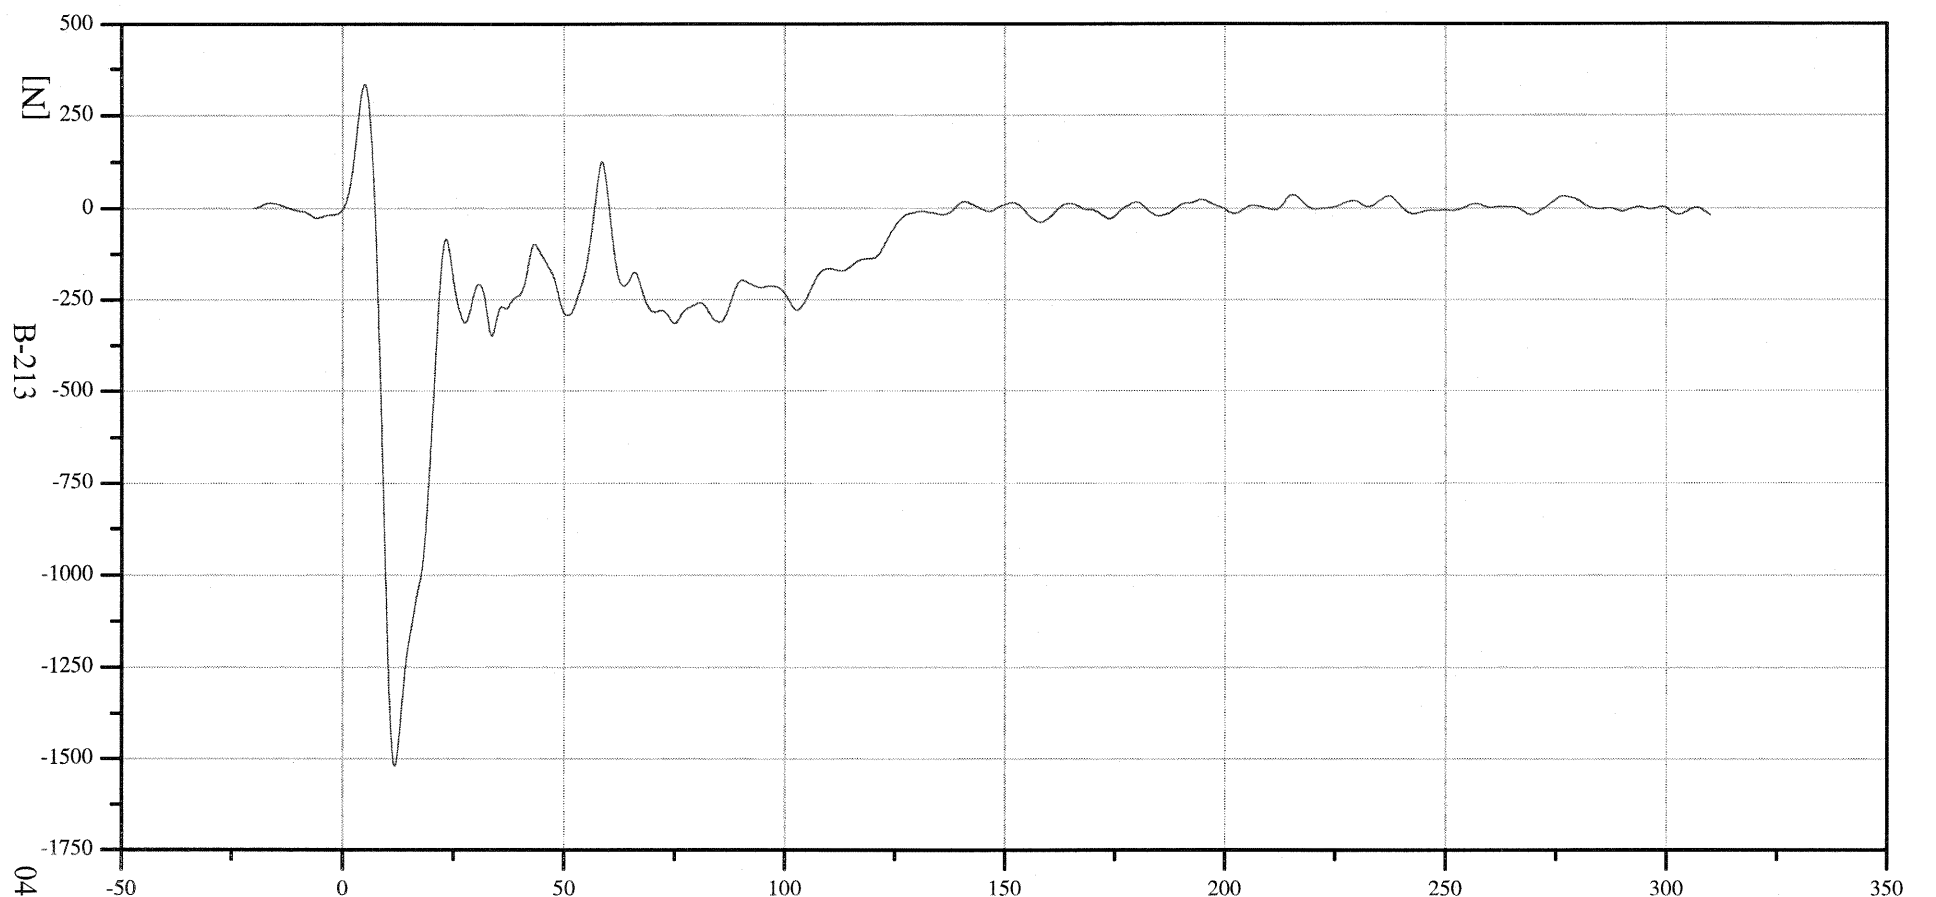

<Min Value>

-1520.83 N at 11.76 ms

<Max Value>

332.91 N at 5.04 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0503

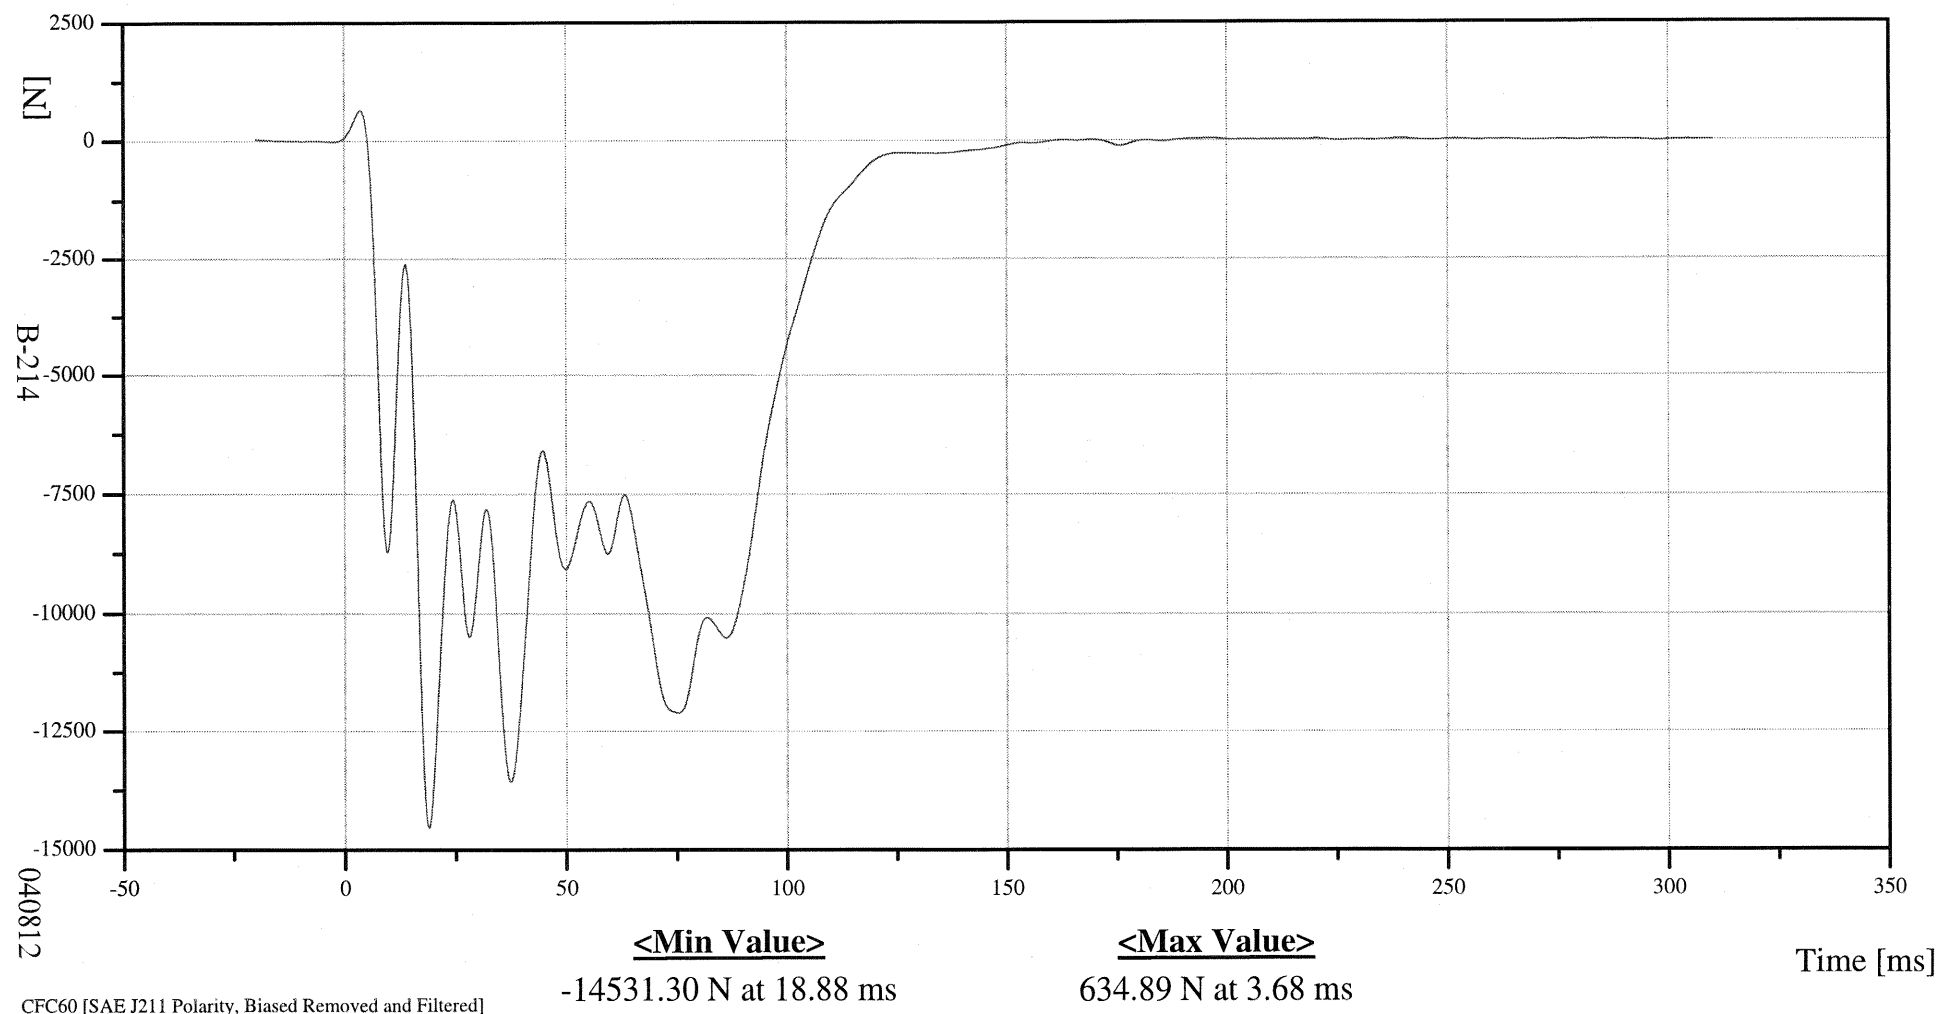



Transportation Research Center, Inc.

ROW 5 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0504

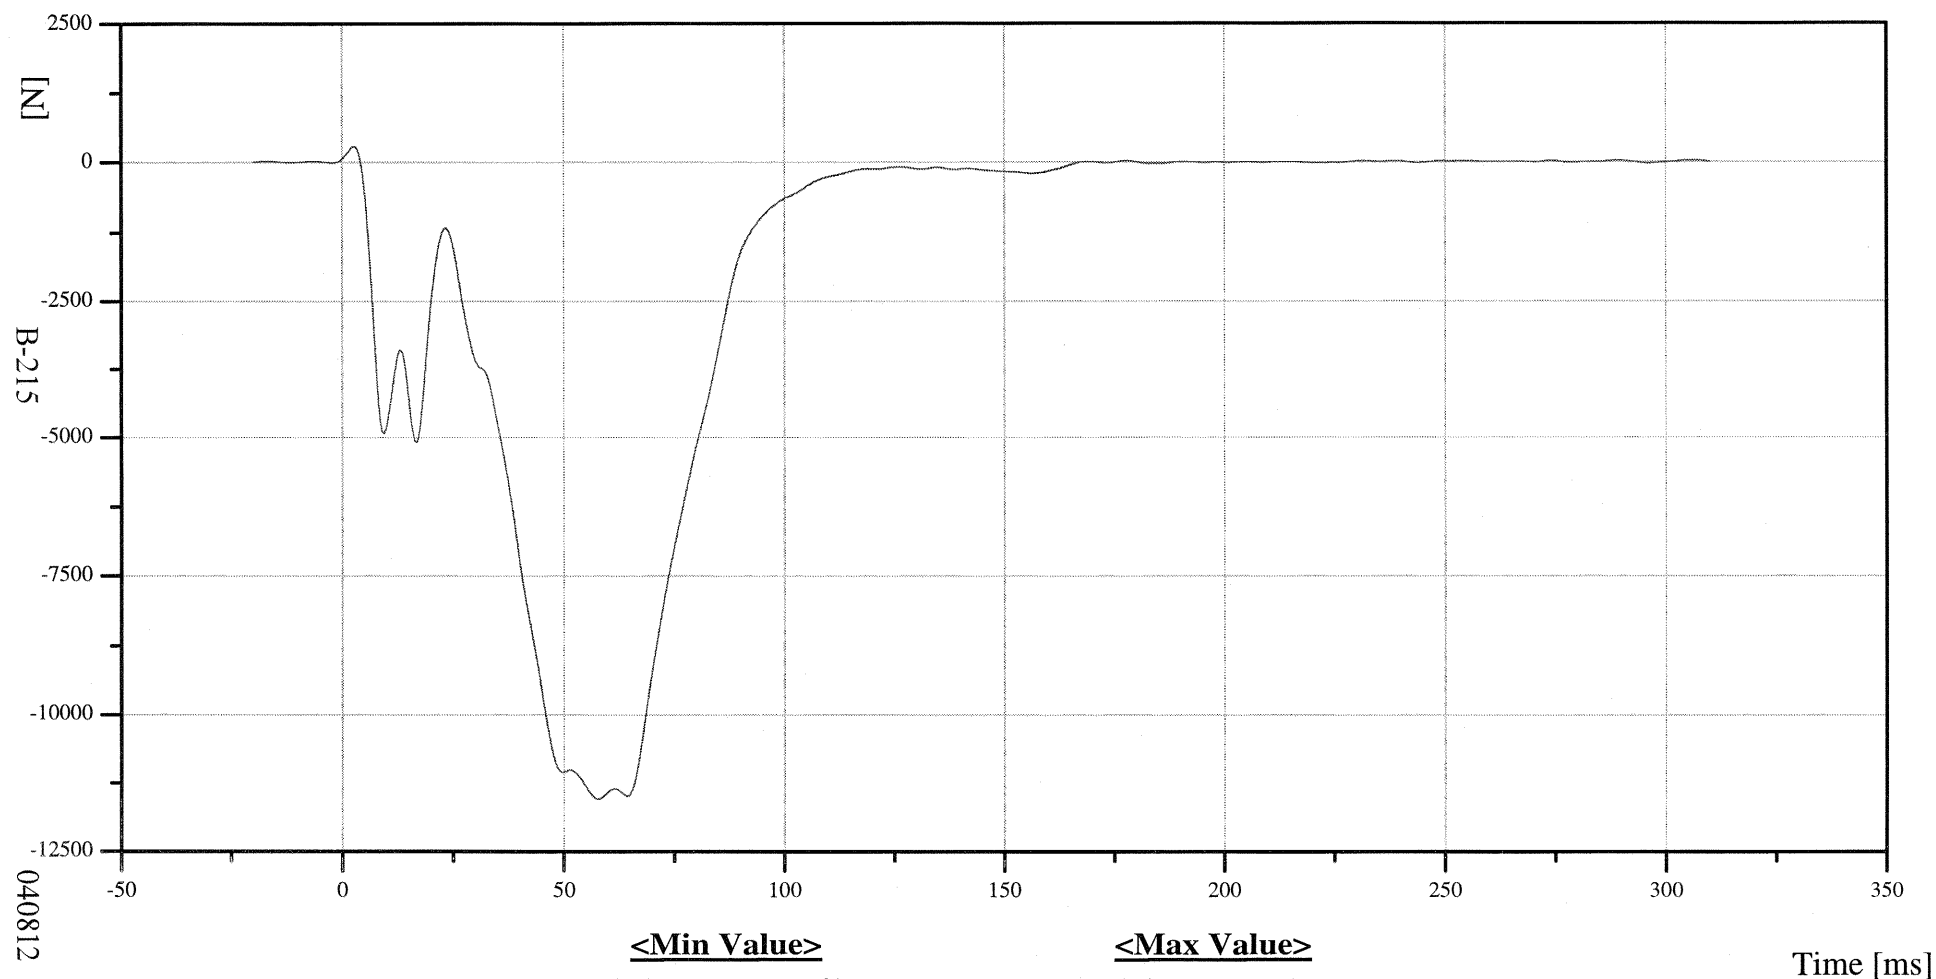

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0505

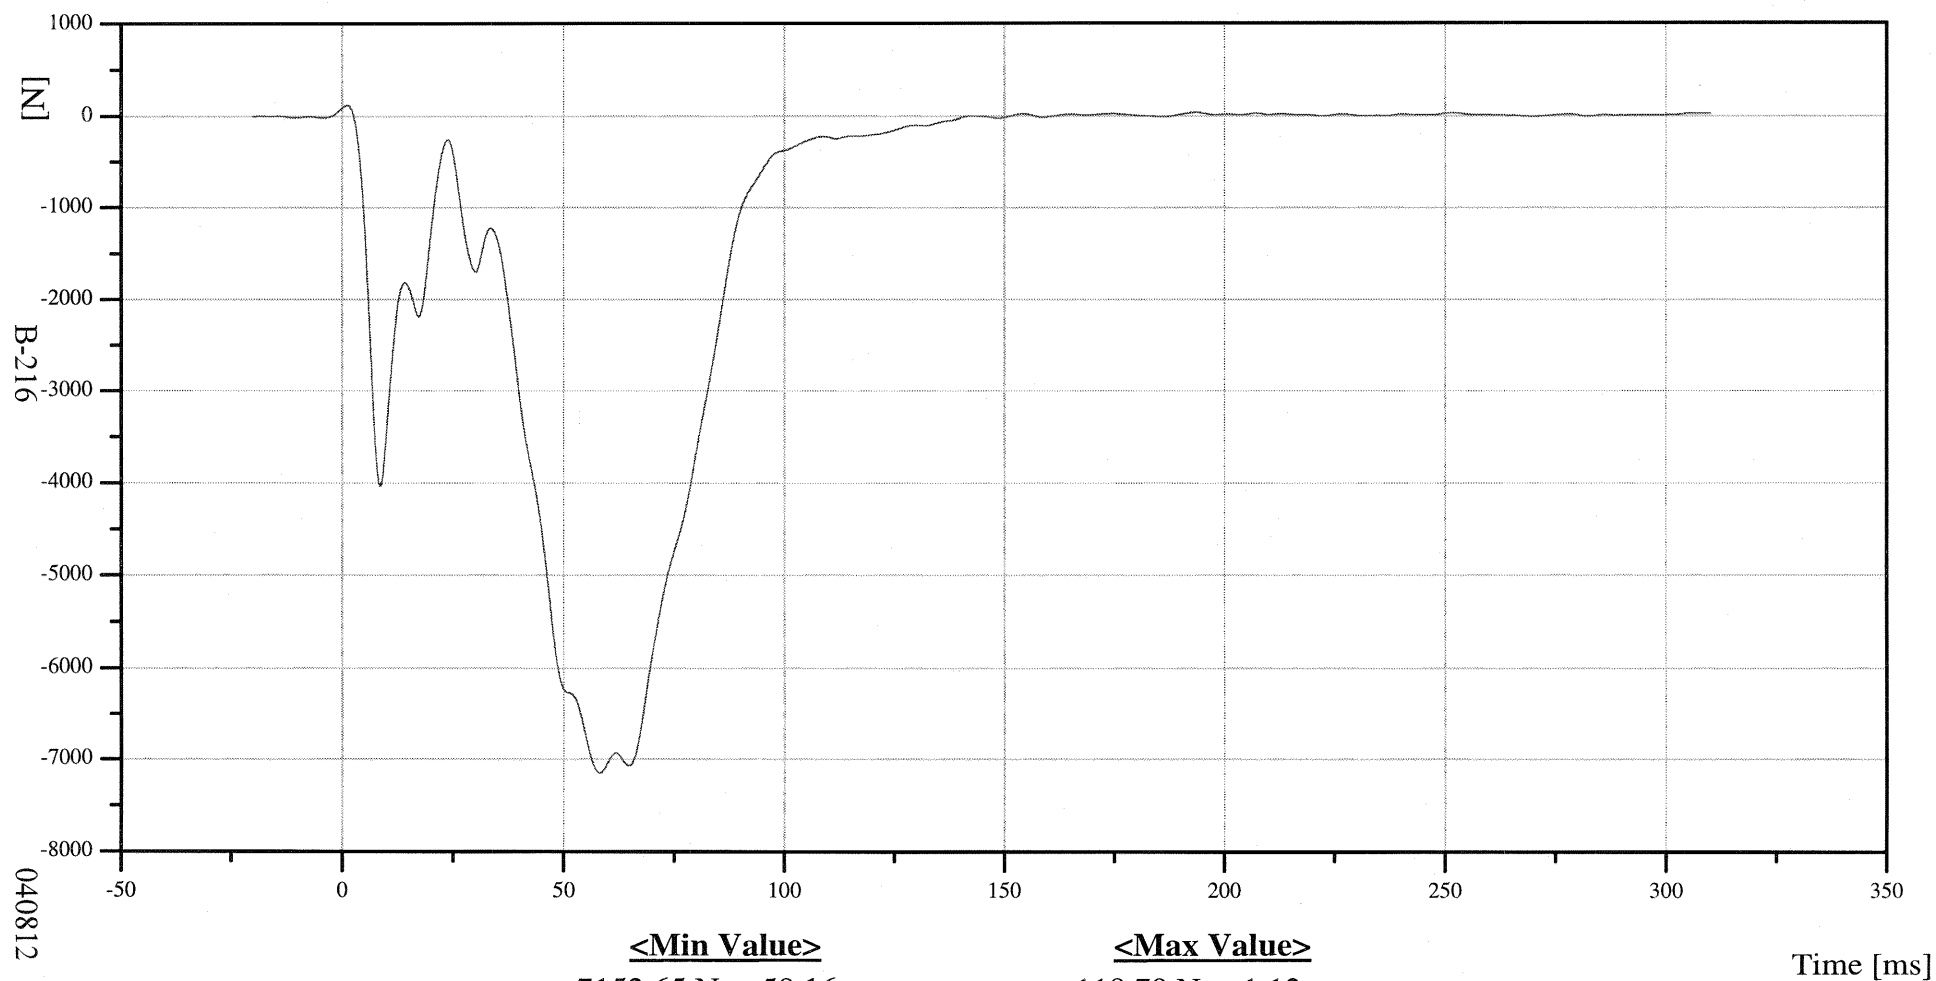

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0506

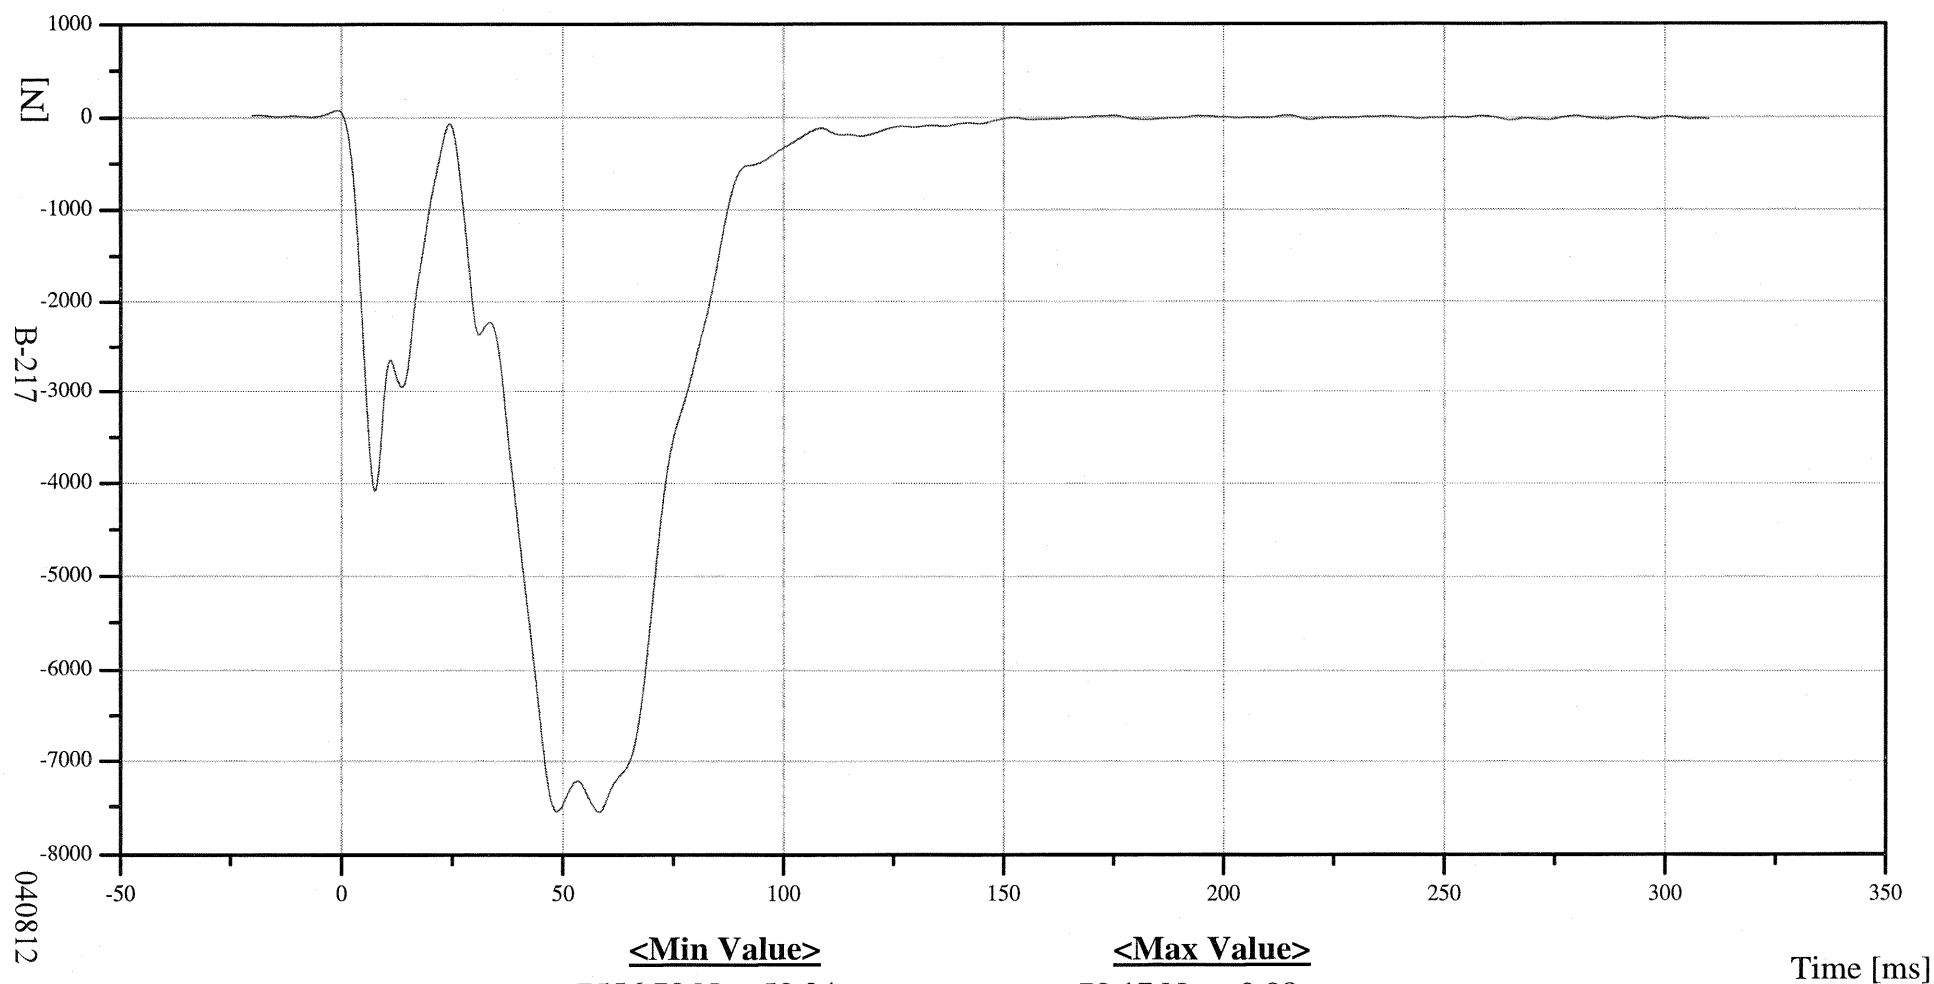

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0507

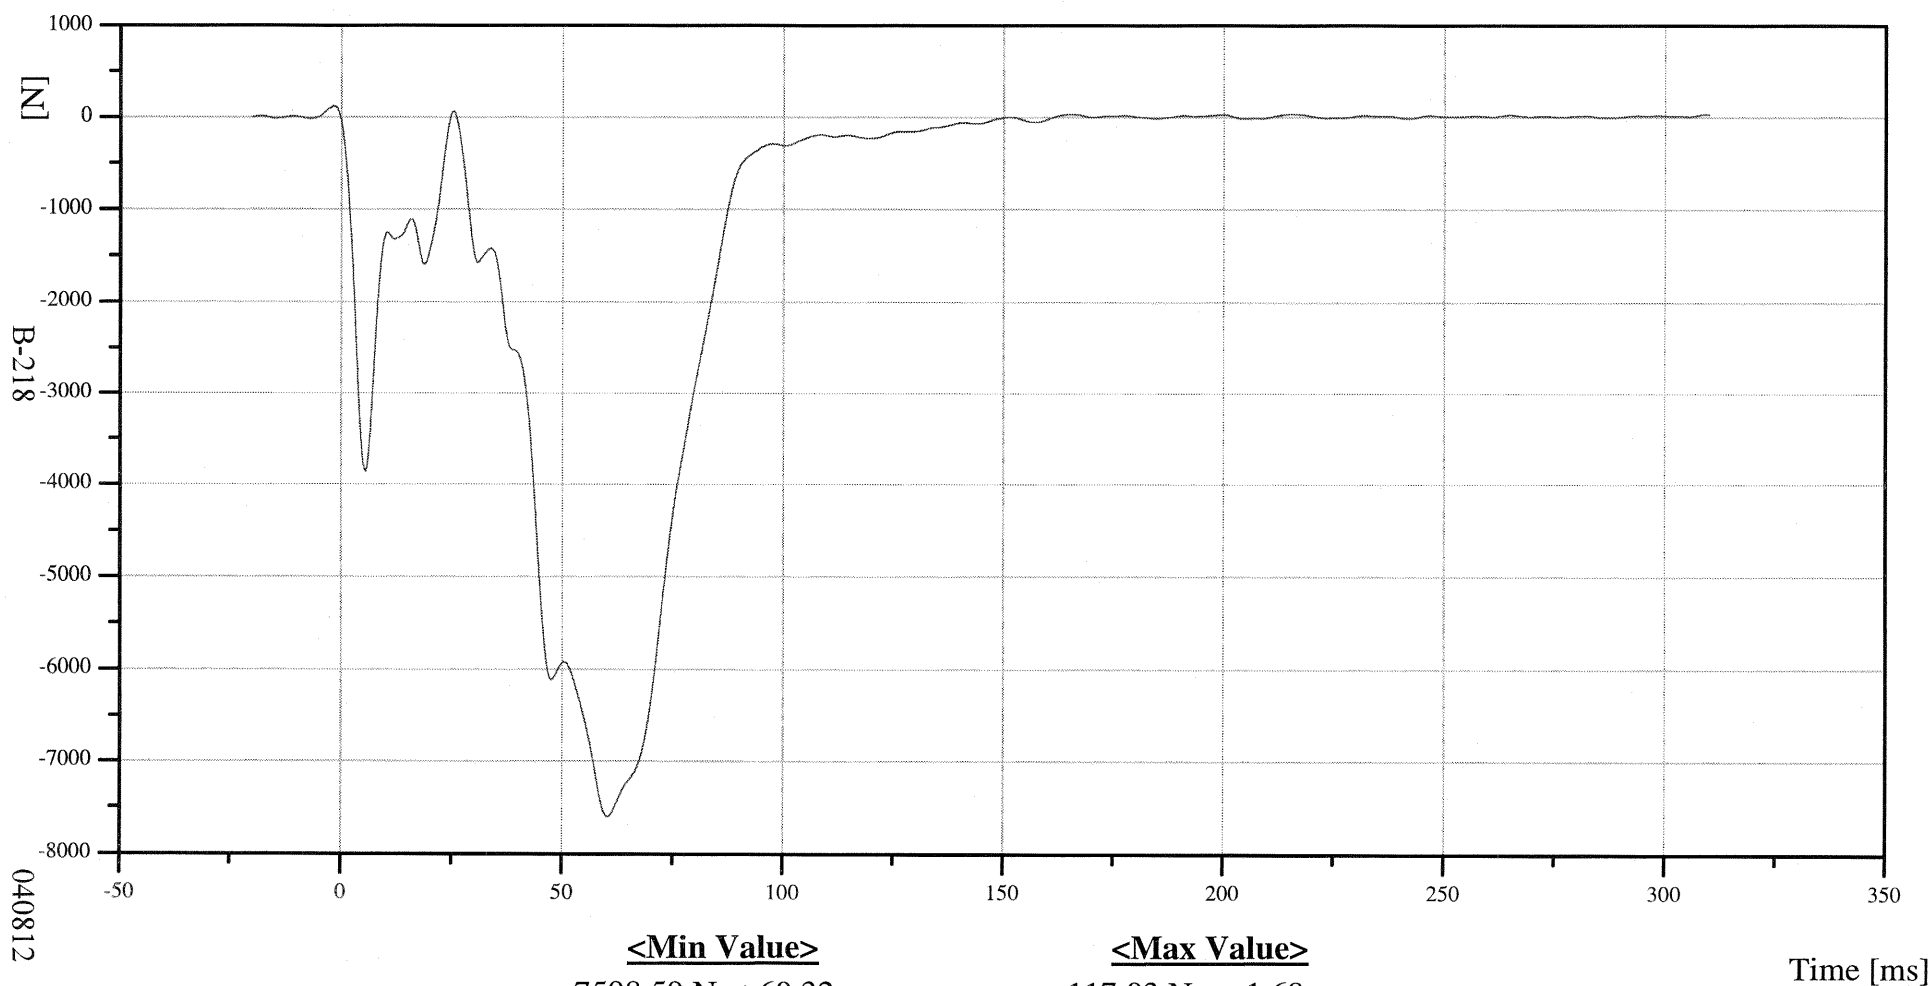

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0508

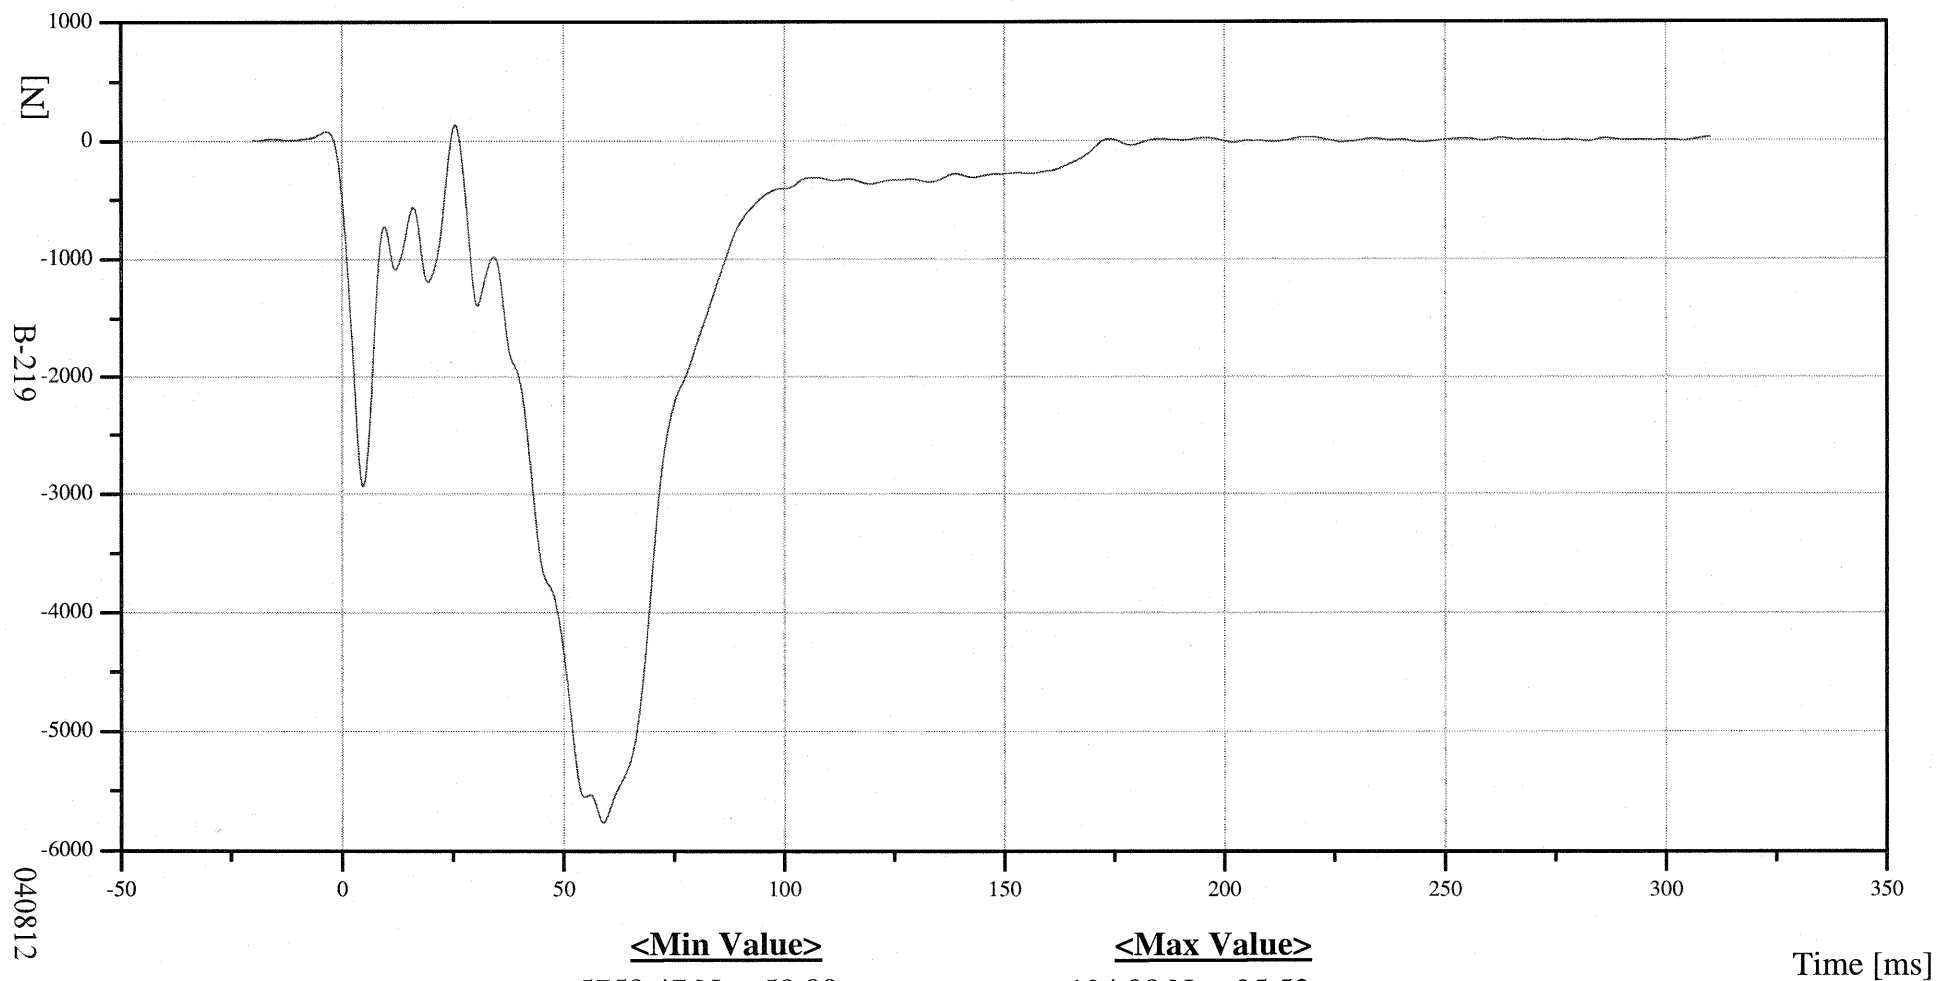

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0509

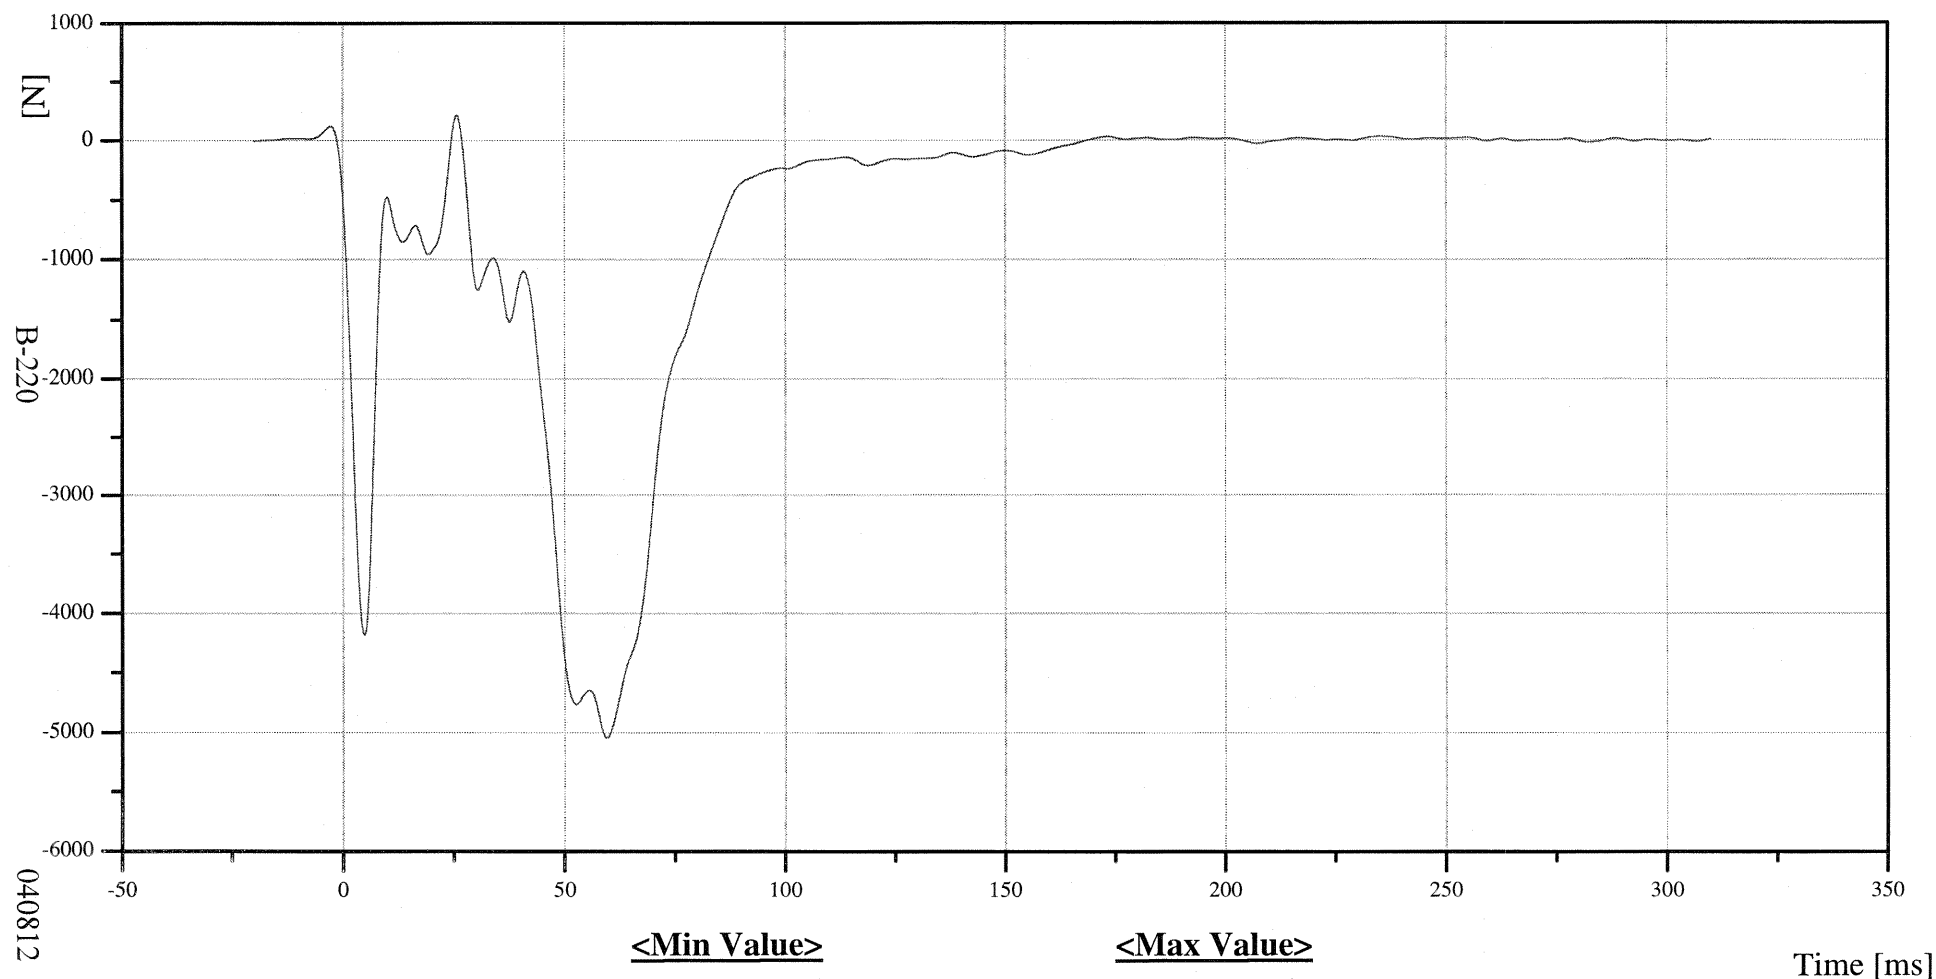

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0510

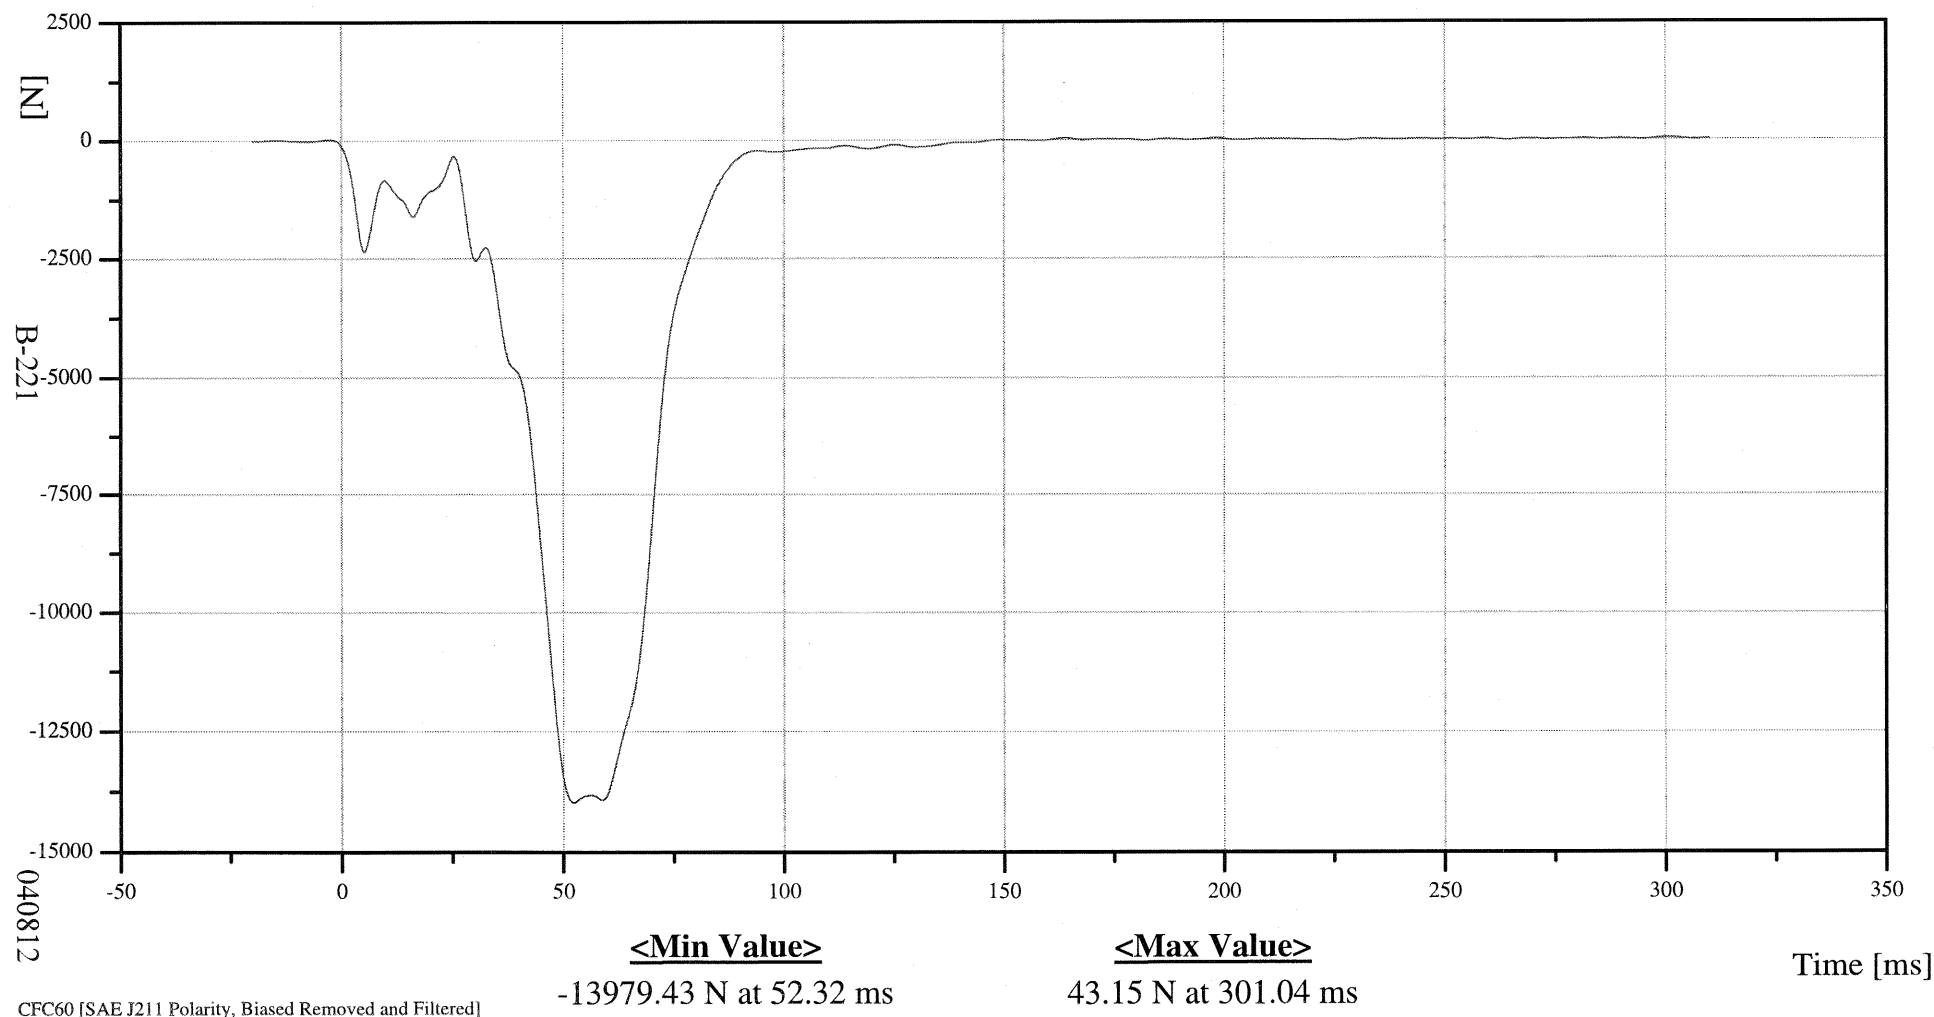



Transportation Research Center, Inc.

ROW 5 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0511

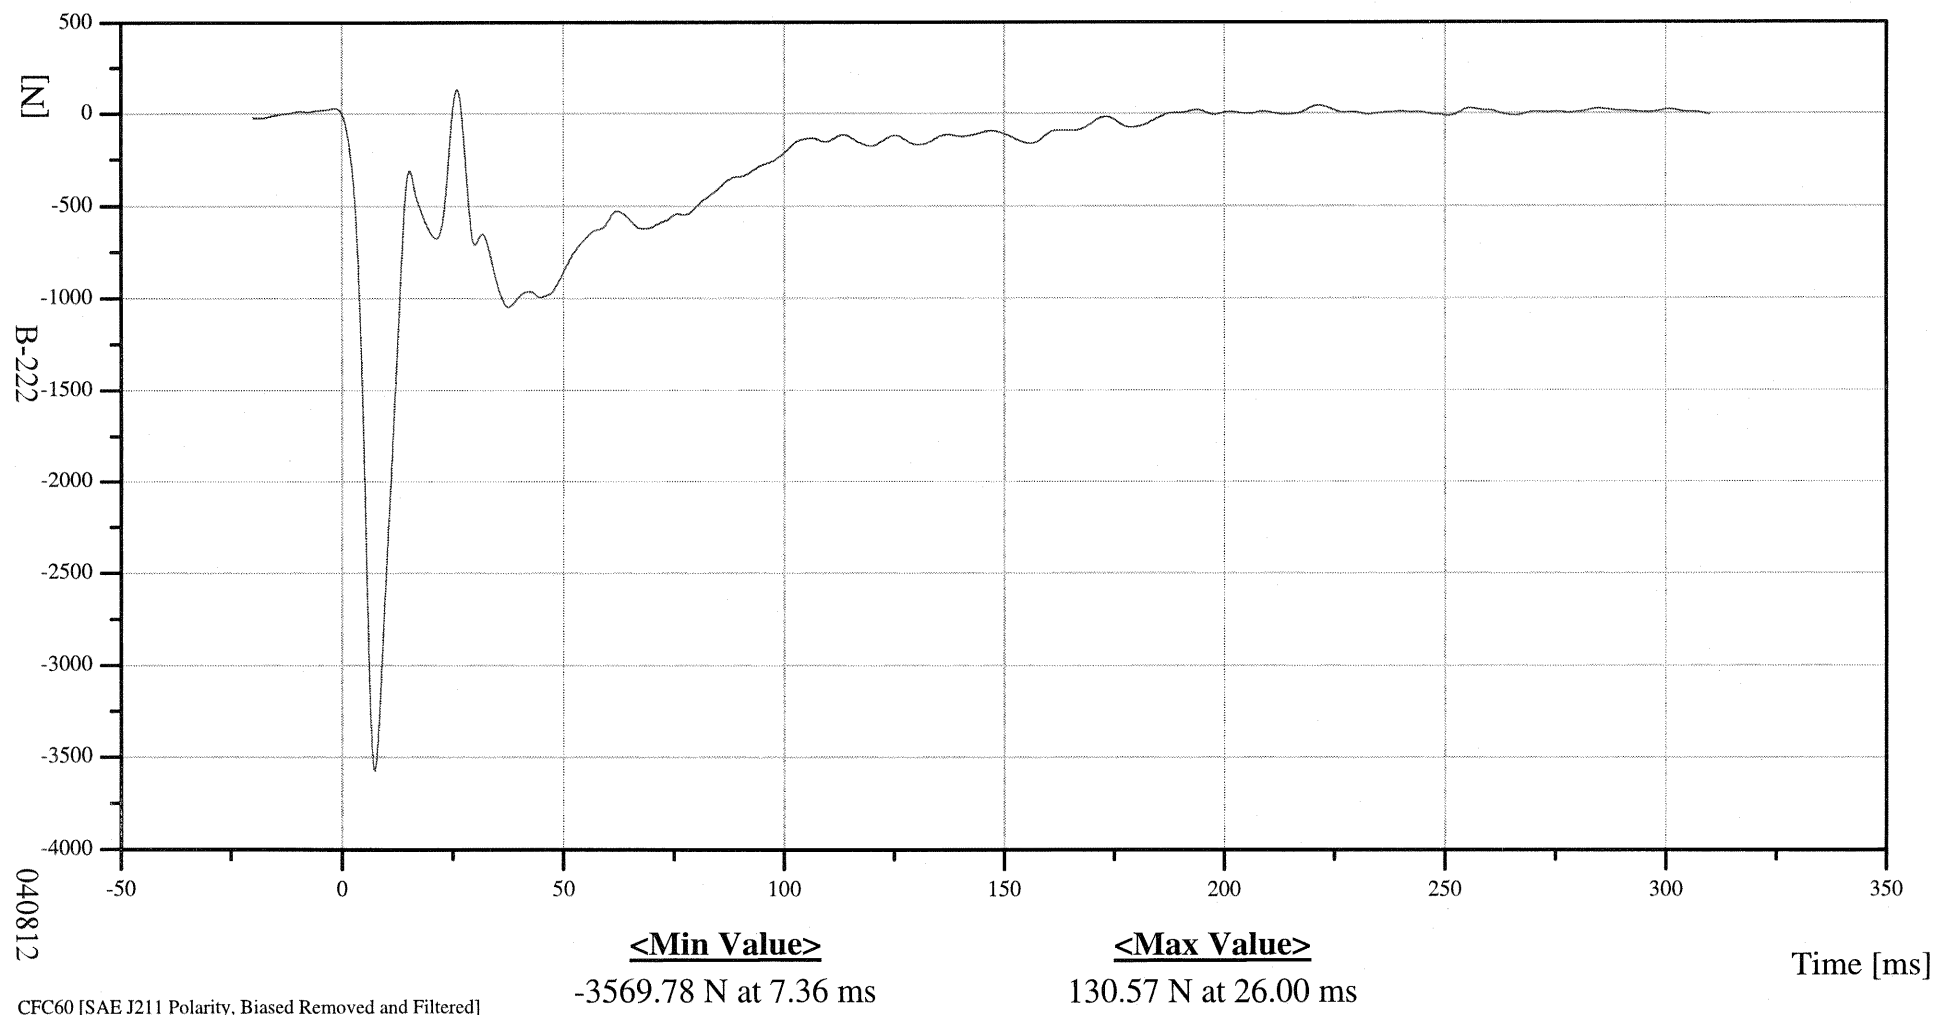



Transportation Research Center, Inc.

ROW 5 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0512

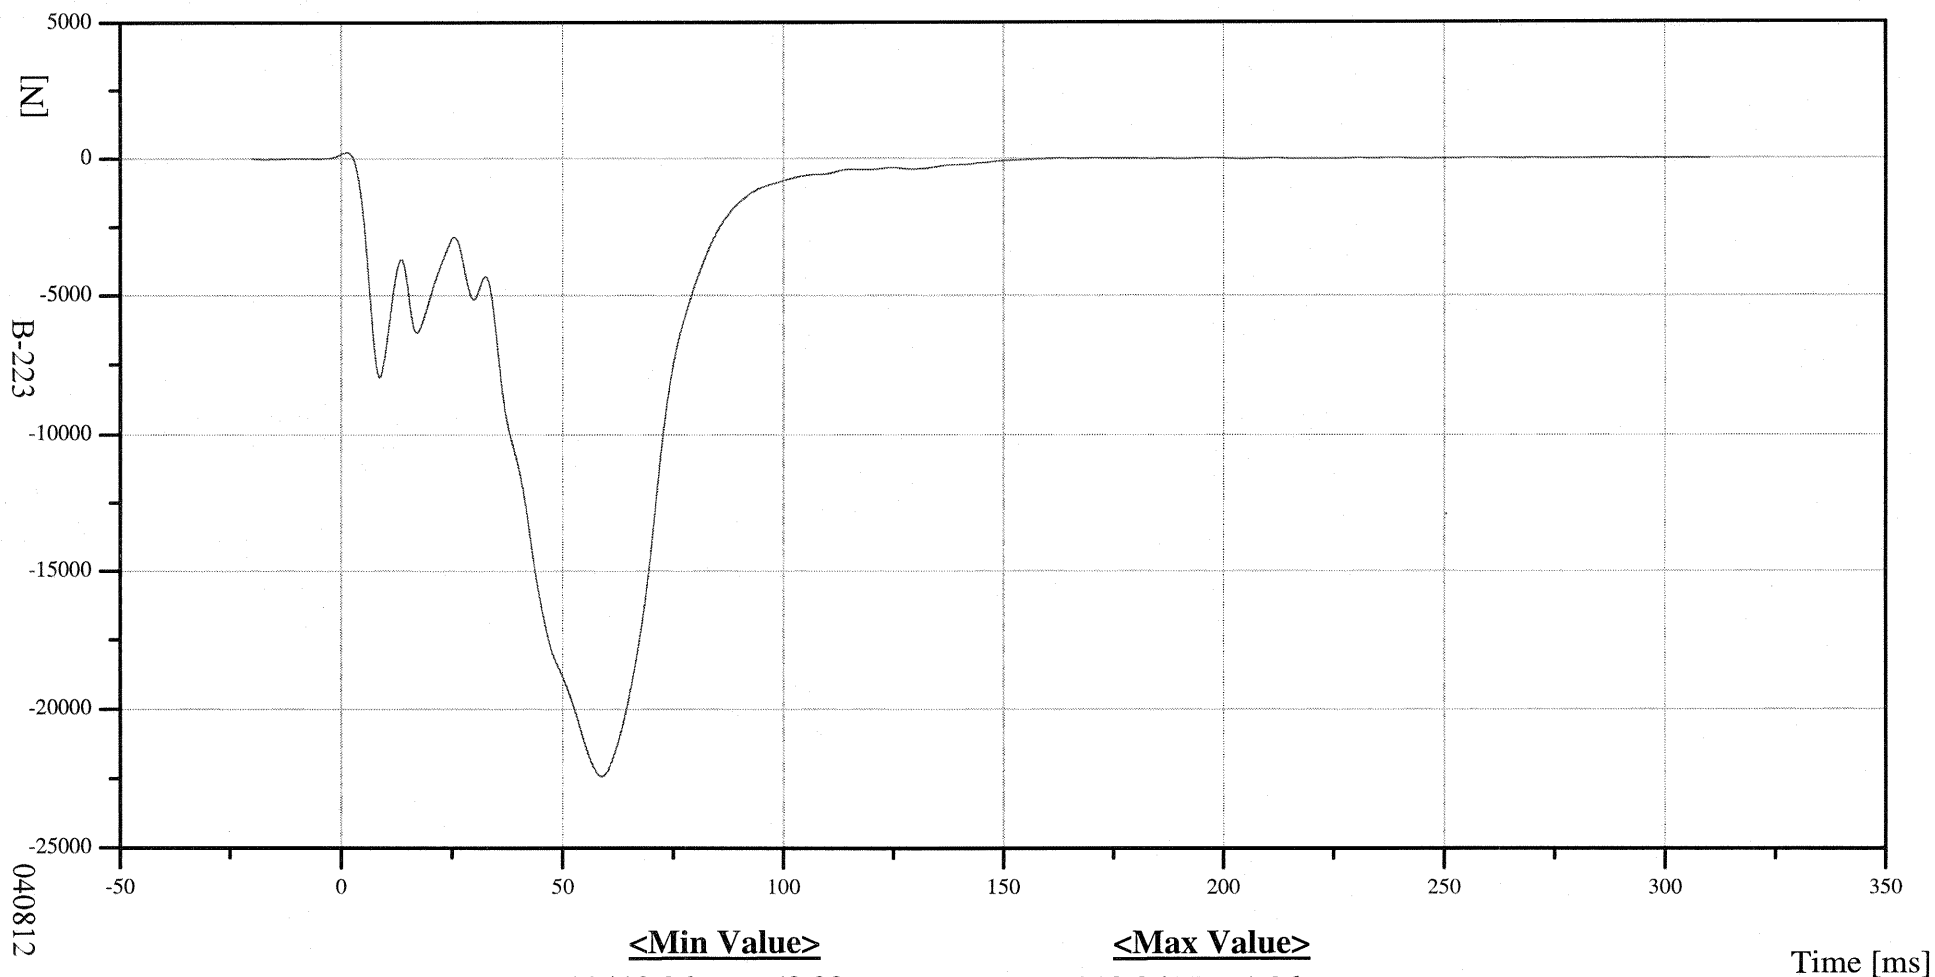

040812

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0513

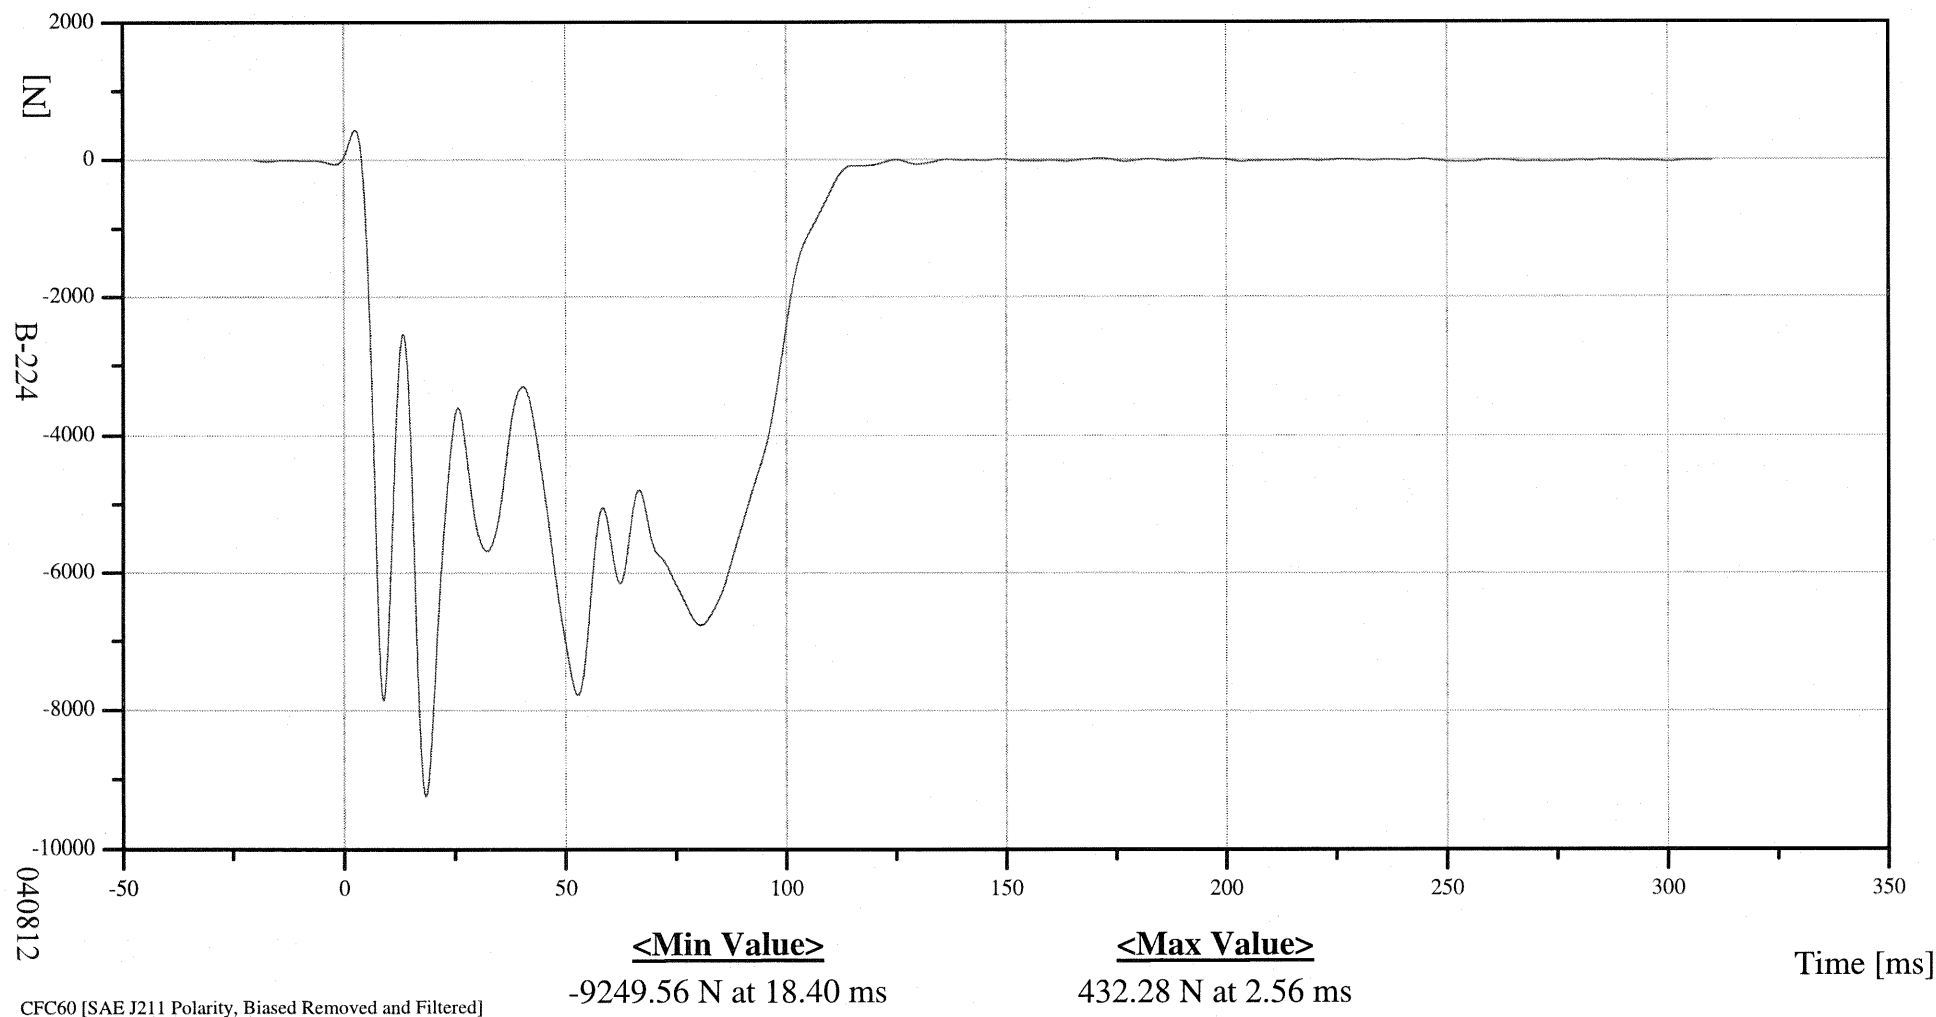



Transportation Research Center, Inc.

ROW 5 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0514

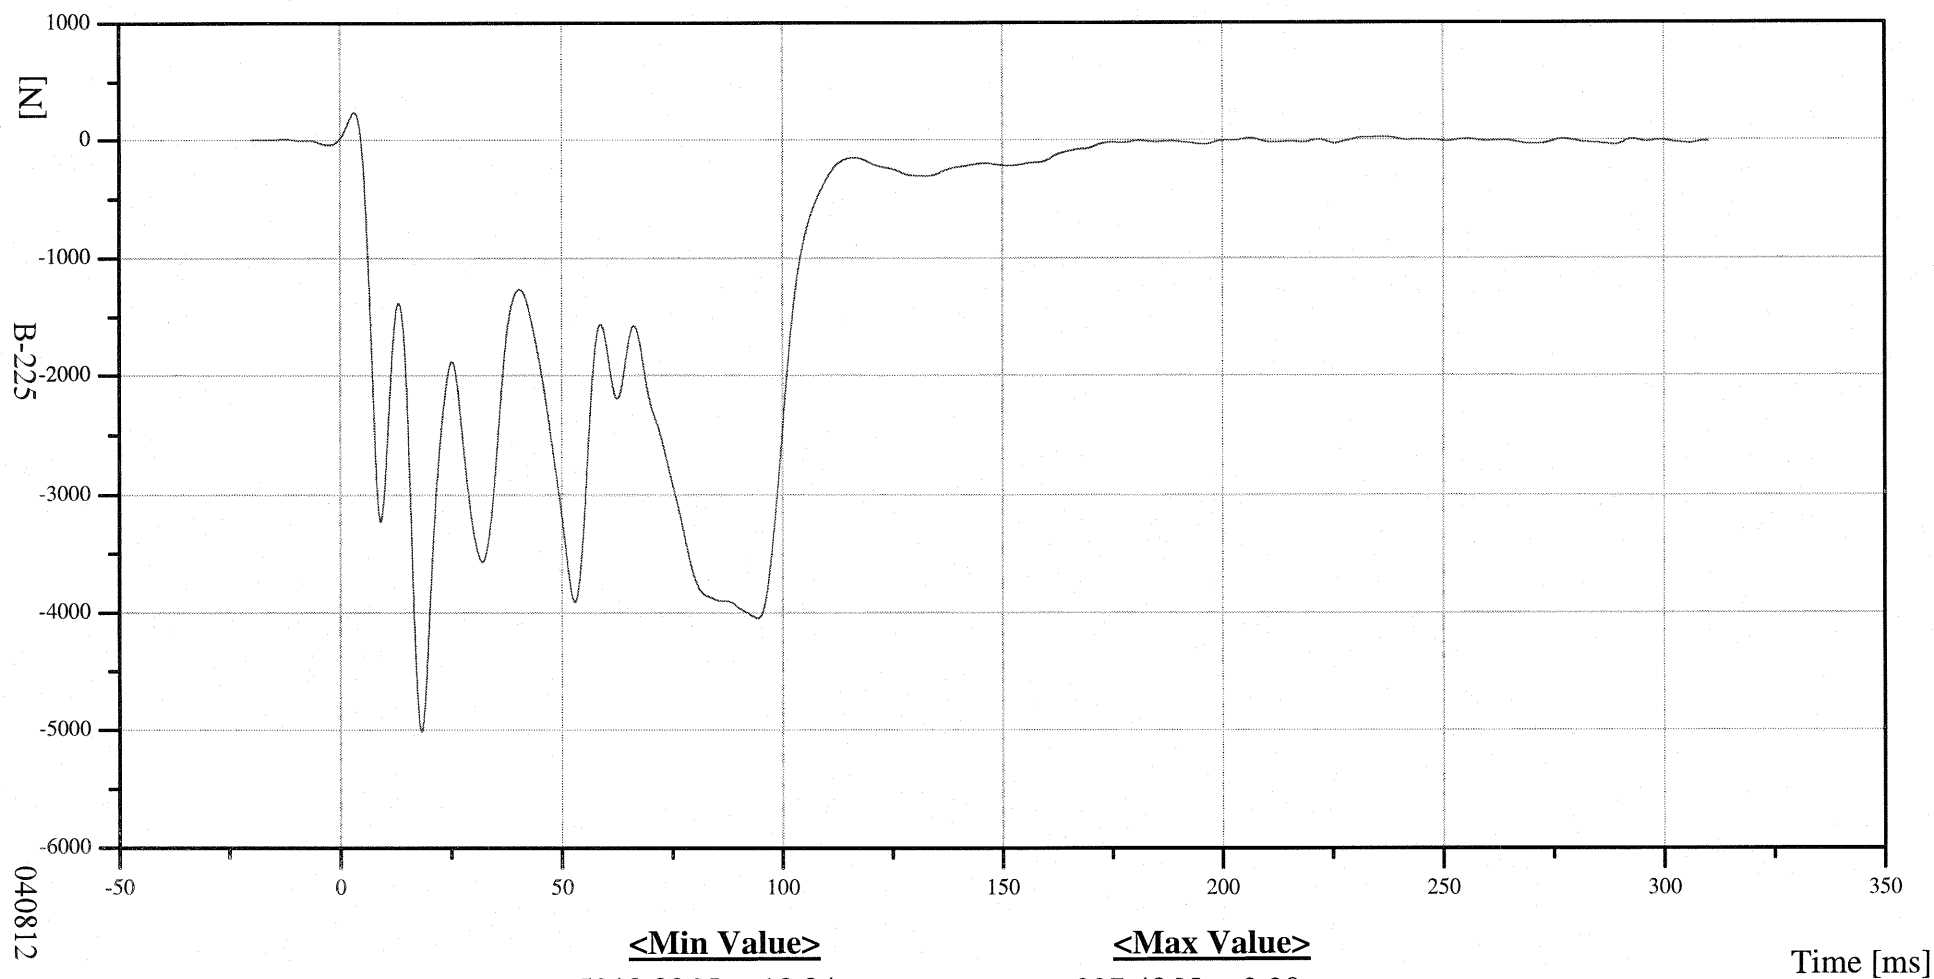

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0515

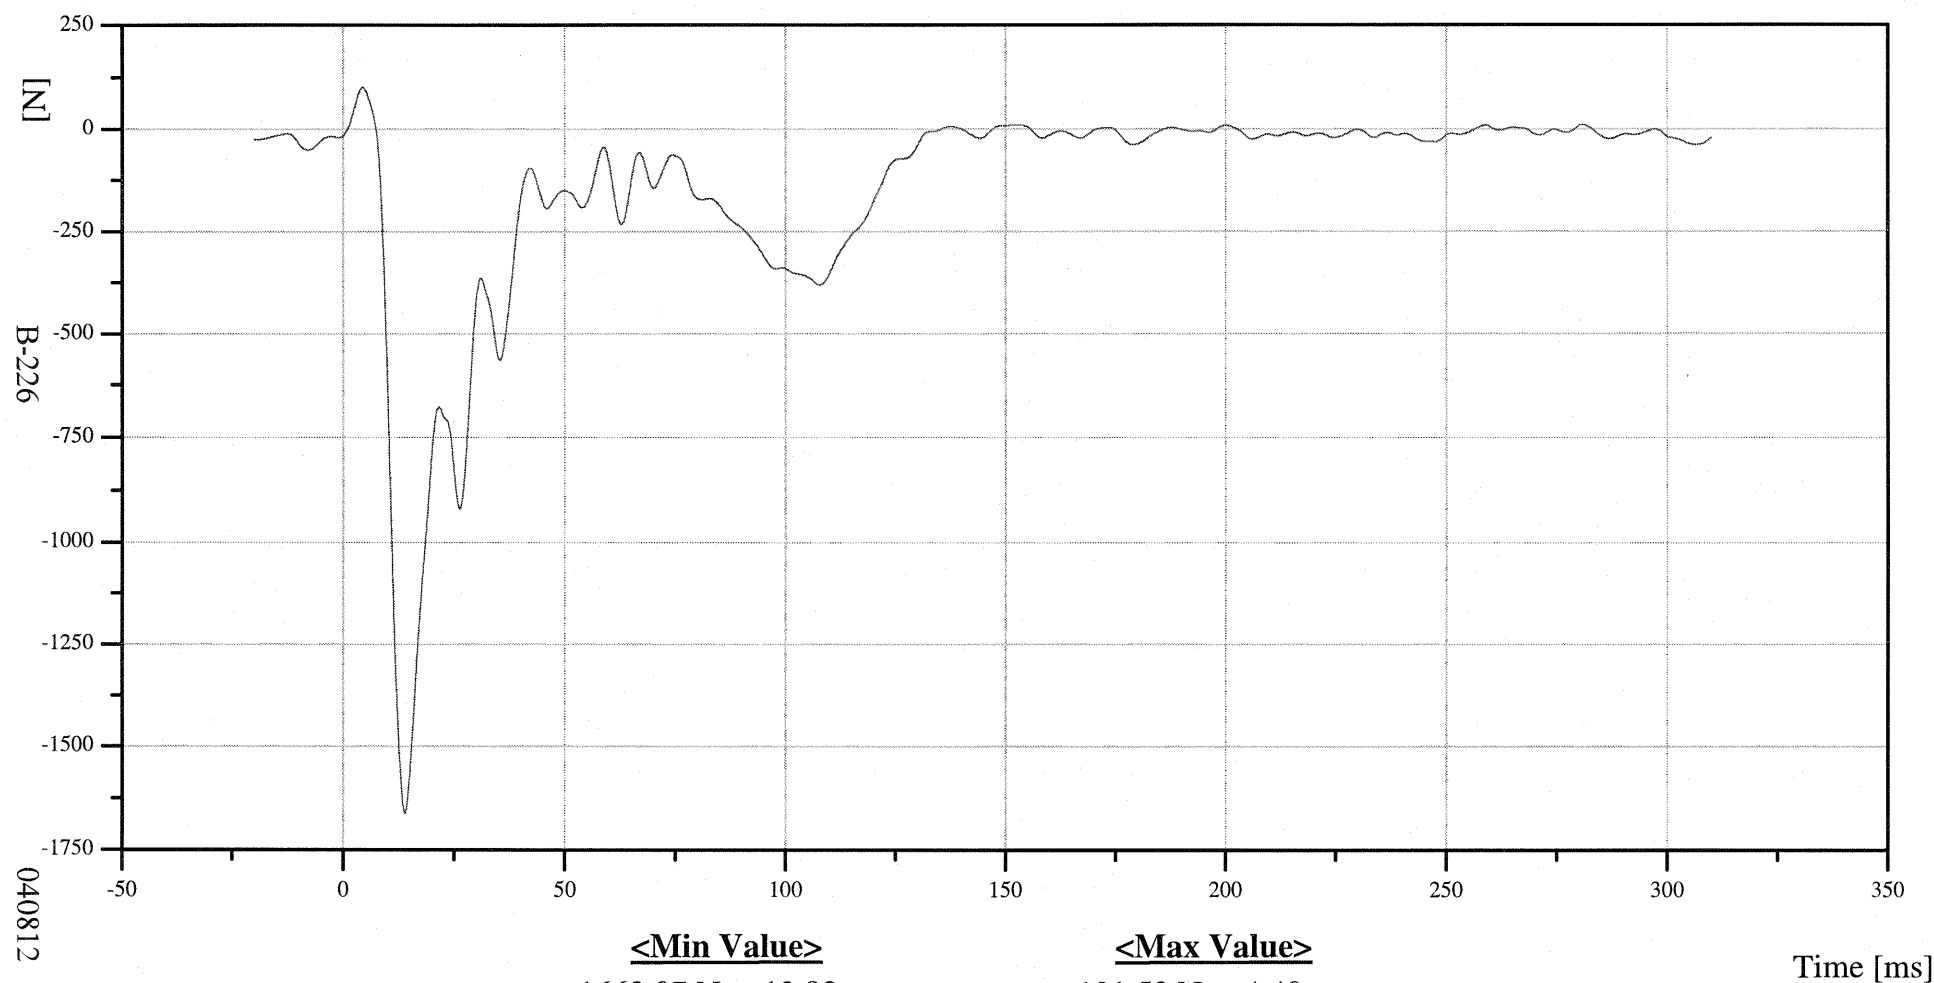

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 5 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0516

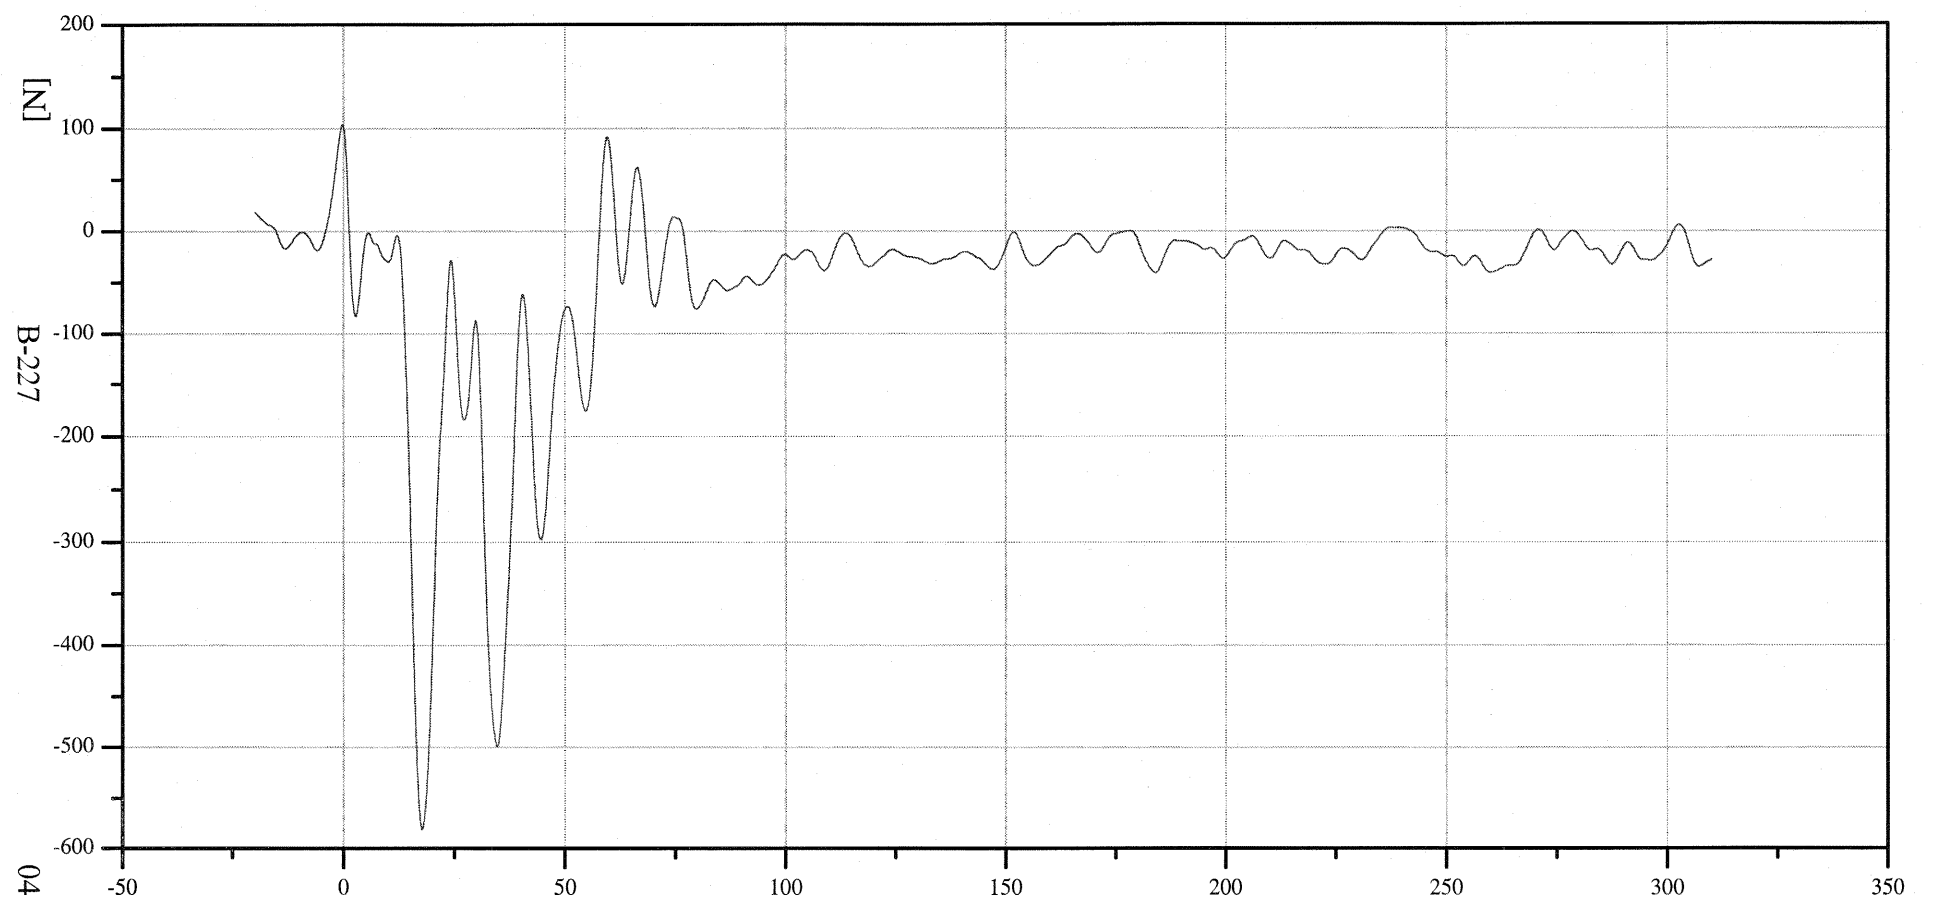

<Min Value>

-582.10 N at 17.76 ms

<Max Value>

103.63 N at -0.16 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0601

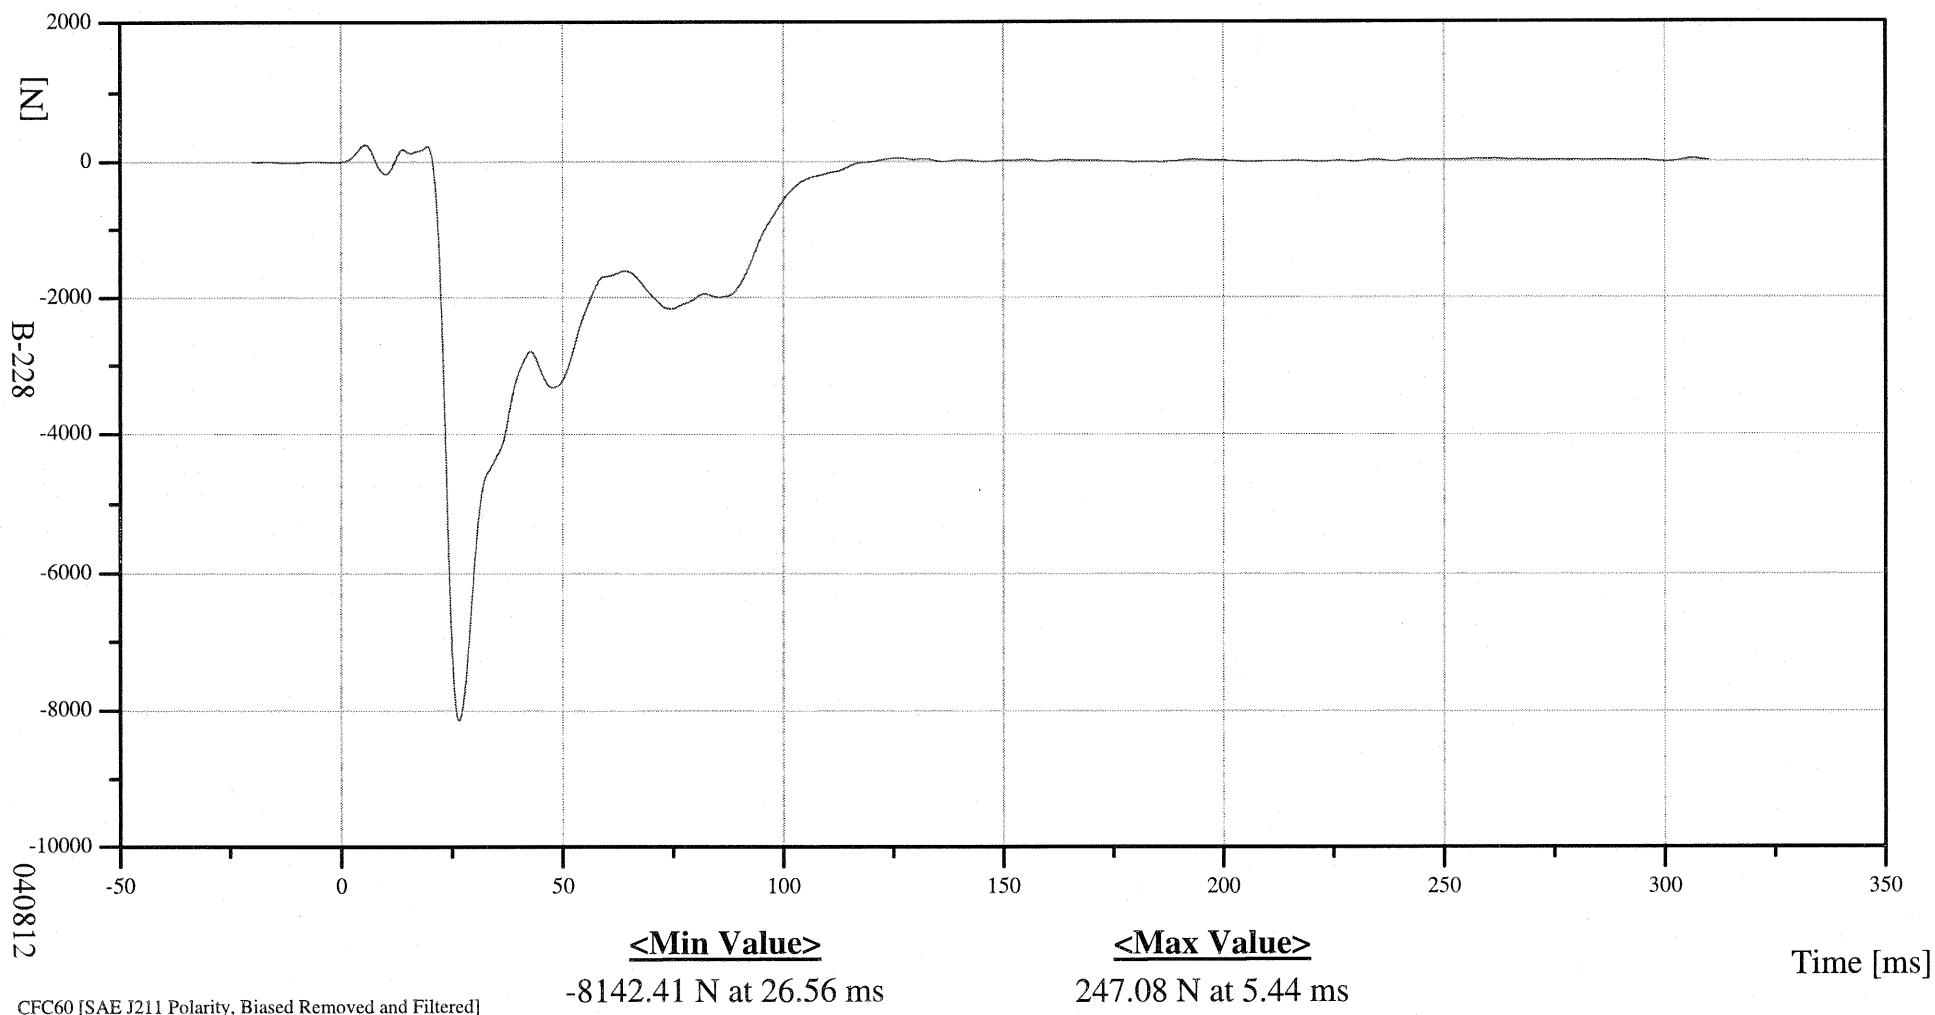



Transportation Research Center, Inc.

ROW 6 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0602

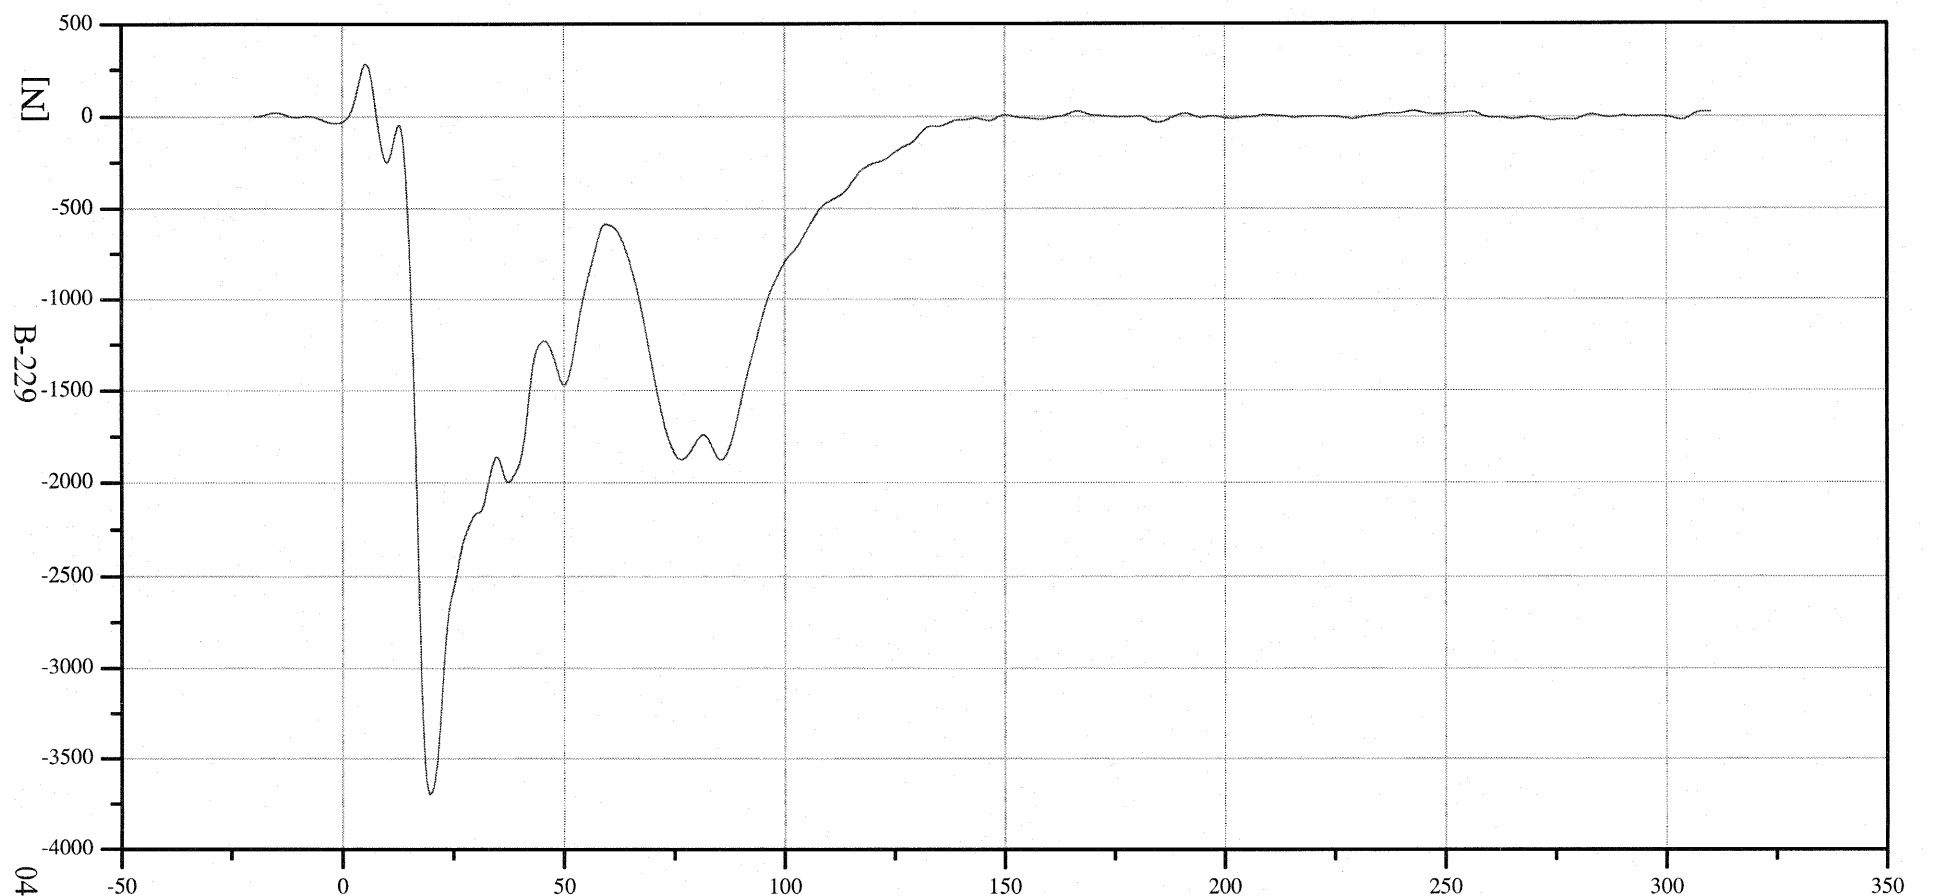

<Min Value>

-3695.70 N at 19.76 ms

<Max Value>

280.48 N at 5.36 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0603

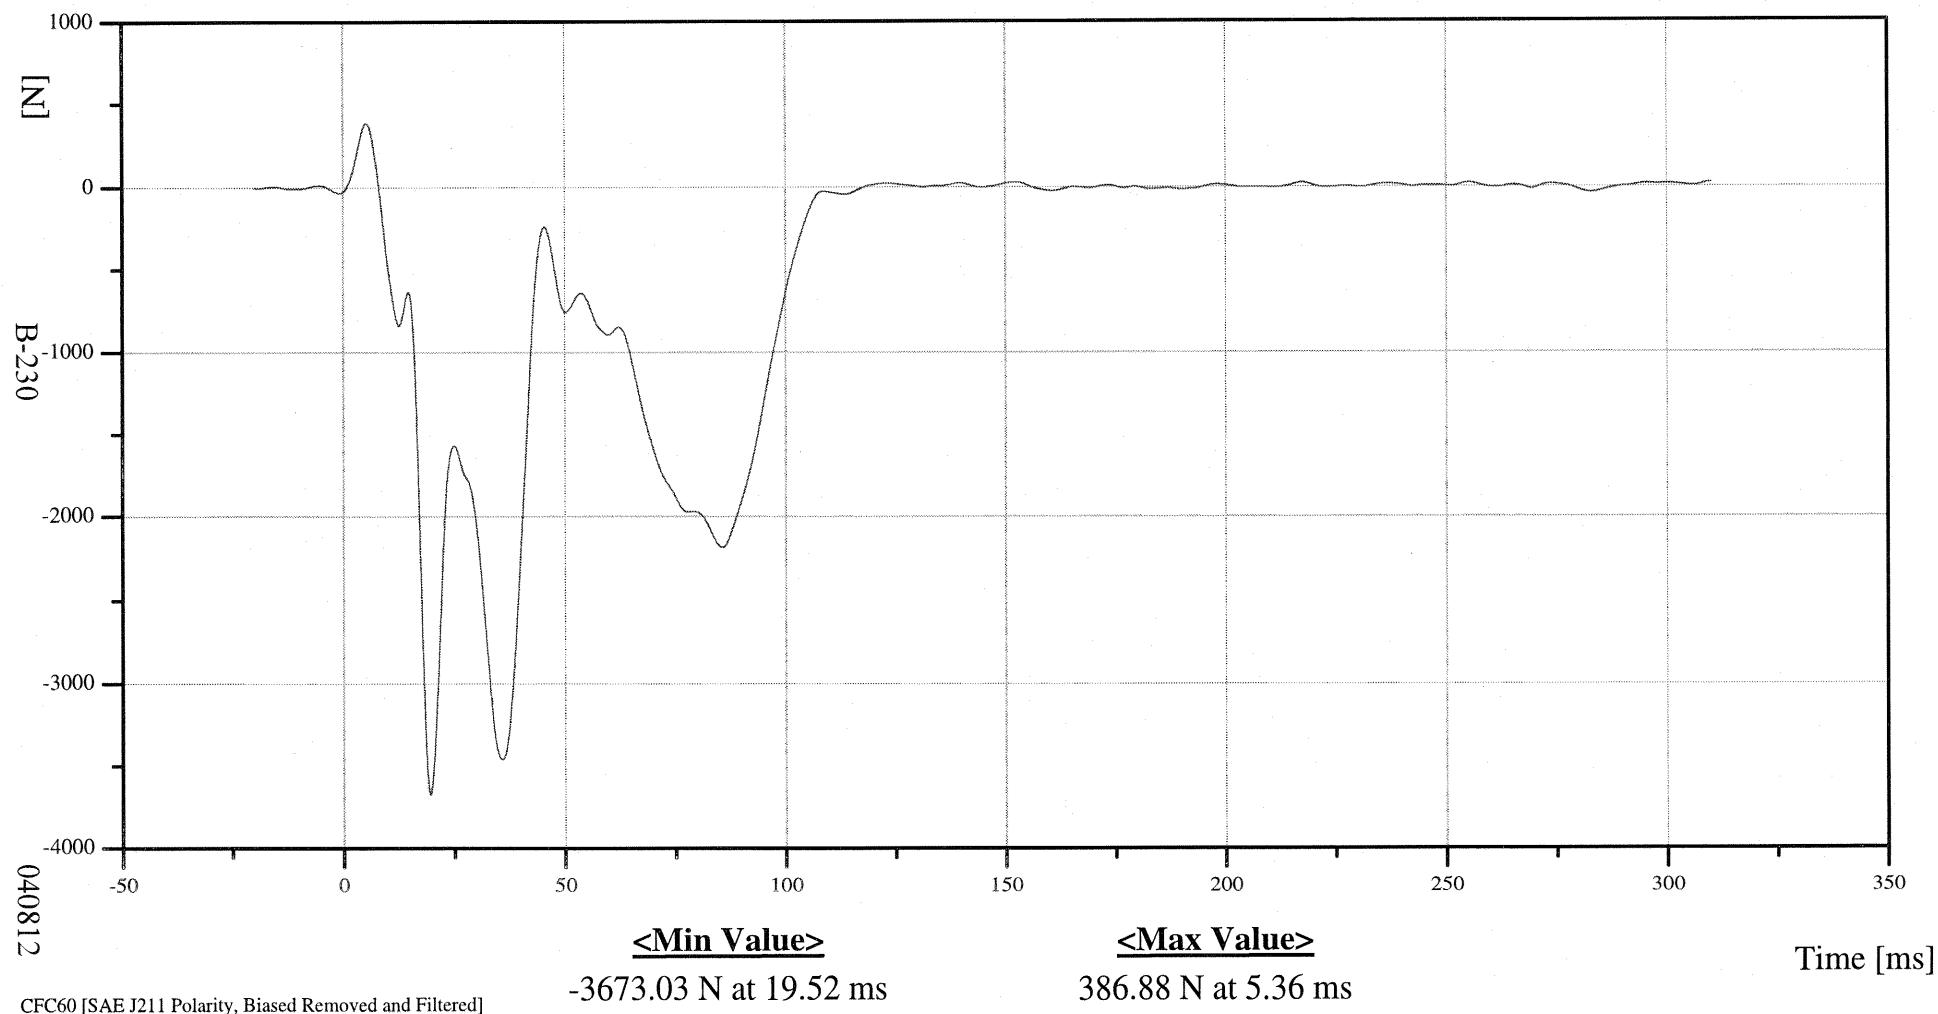



Transportation Research Center, Inc.

ROW 6 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0604

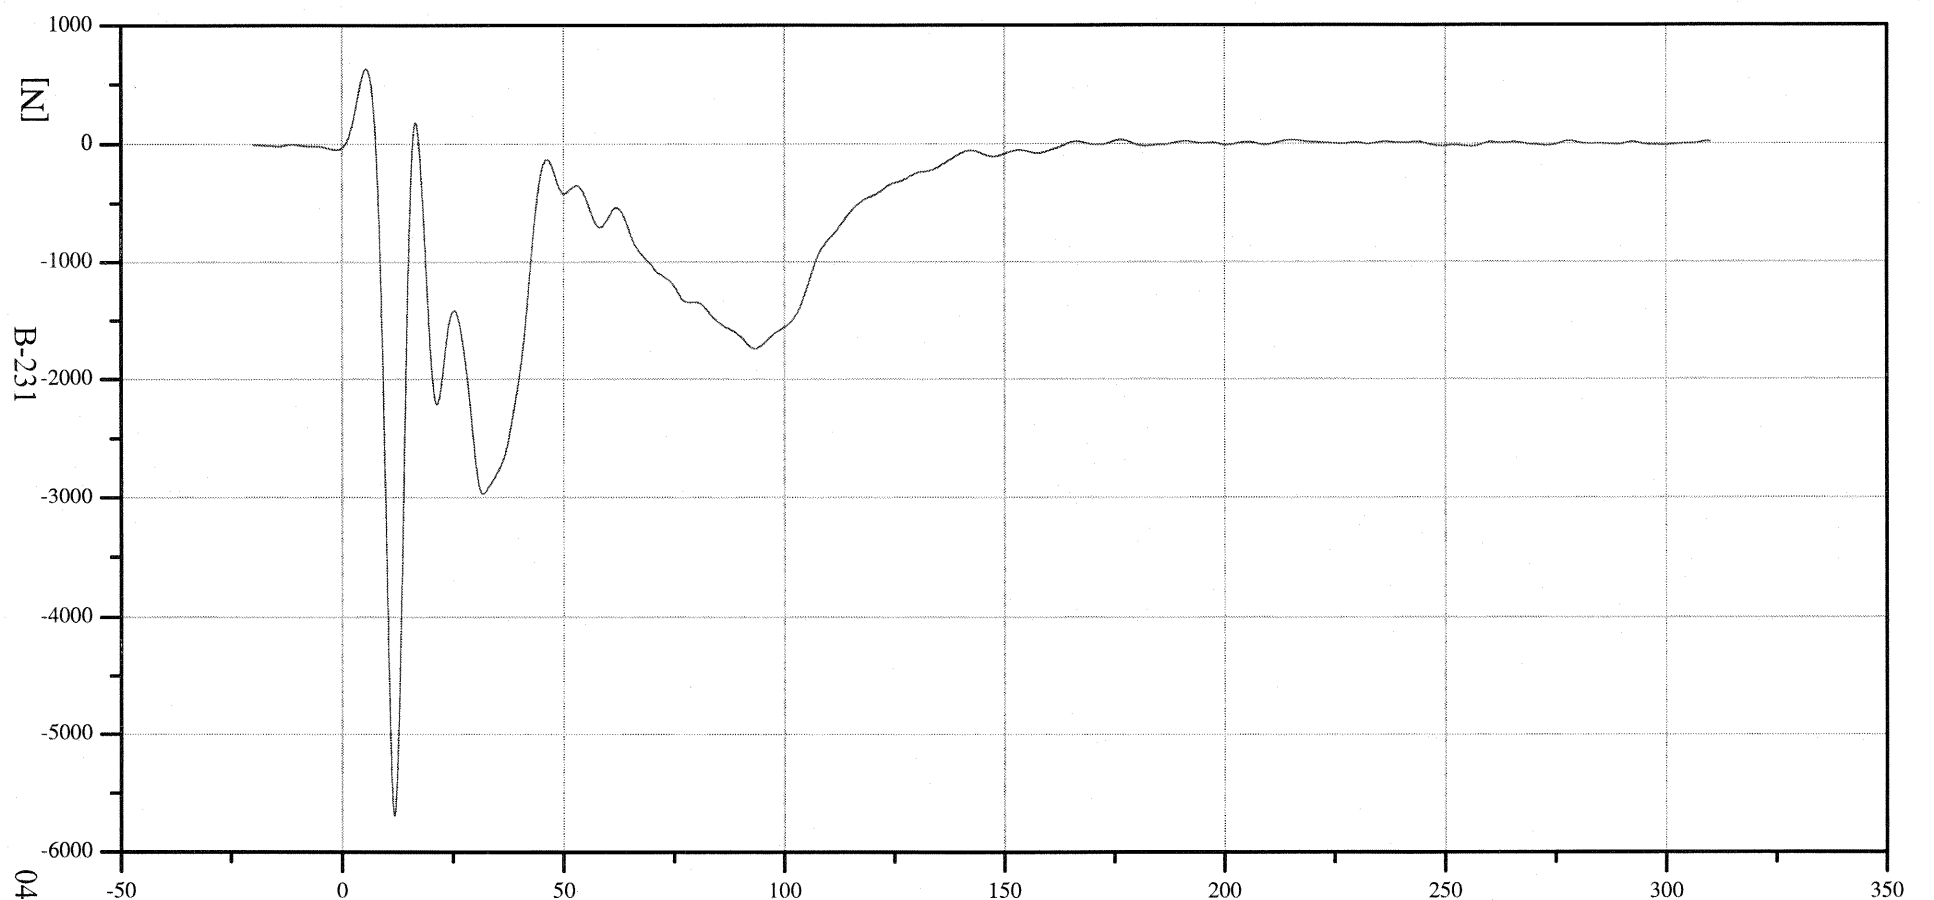

<Min Value>

-5691.03 N at 11.76 ms

<Max Value>

628.11 N at 5.44 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0605

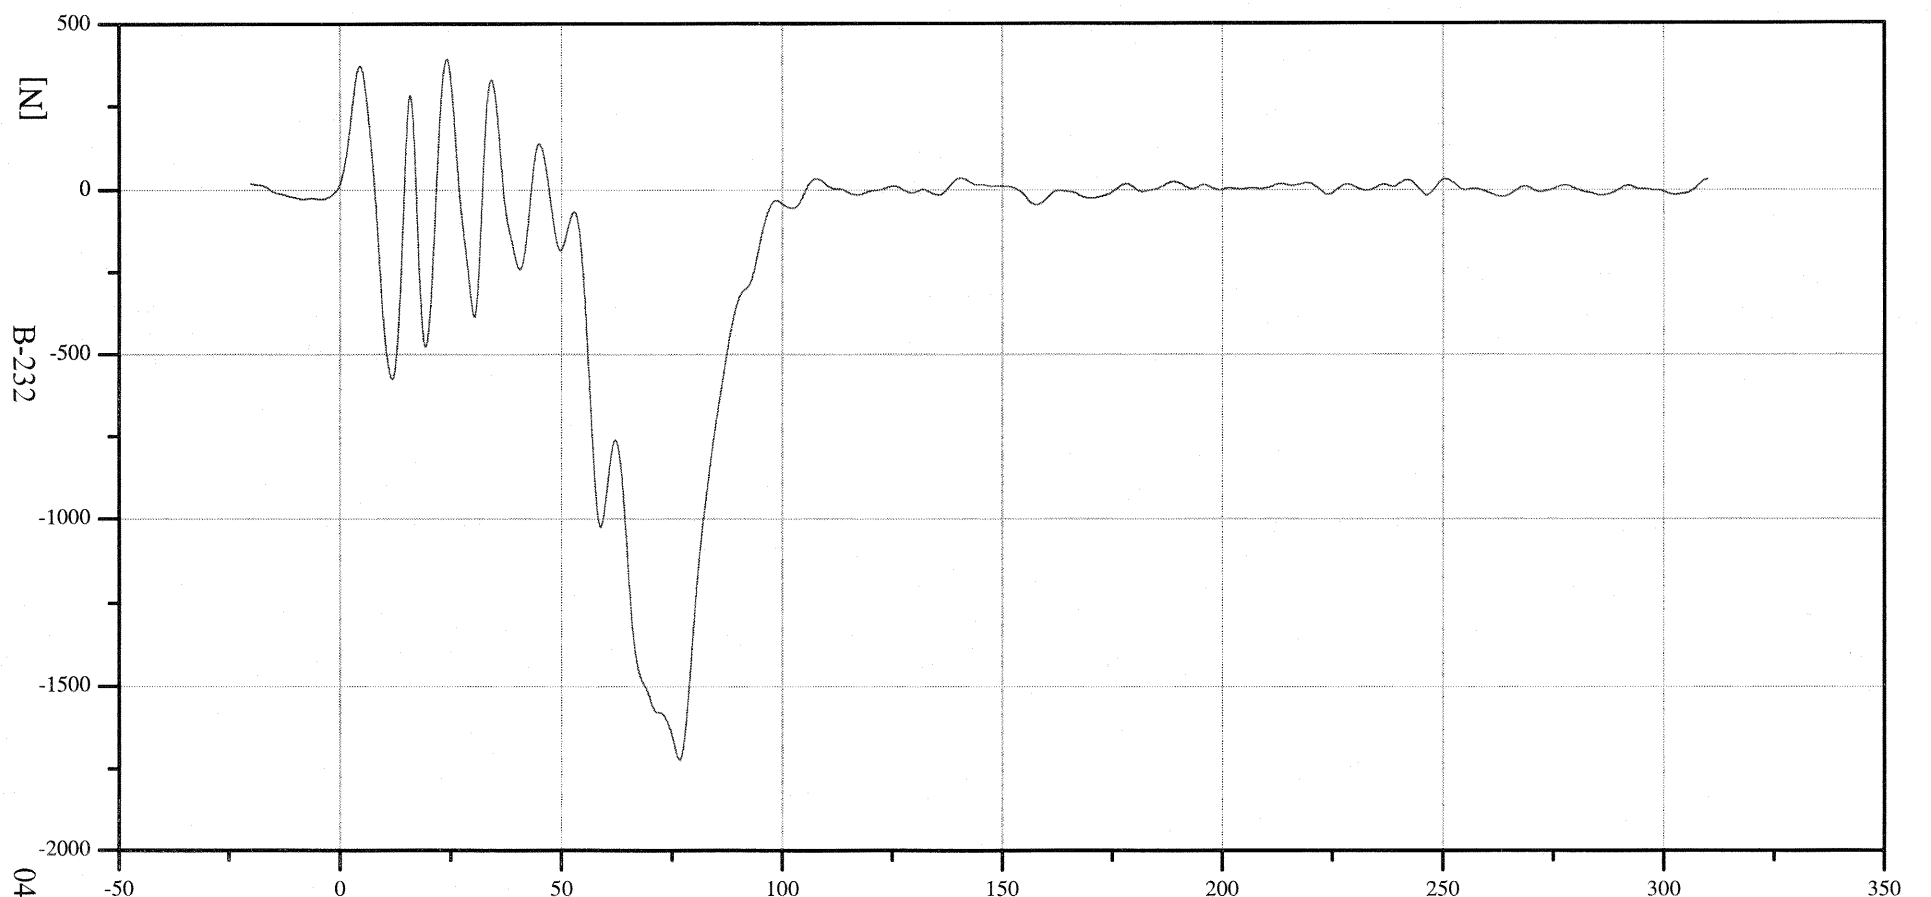

<Min Value>

-1722.69 N at 76.72 ms

<Max Value>

393.48 N at 24.08 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0606

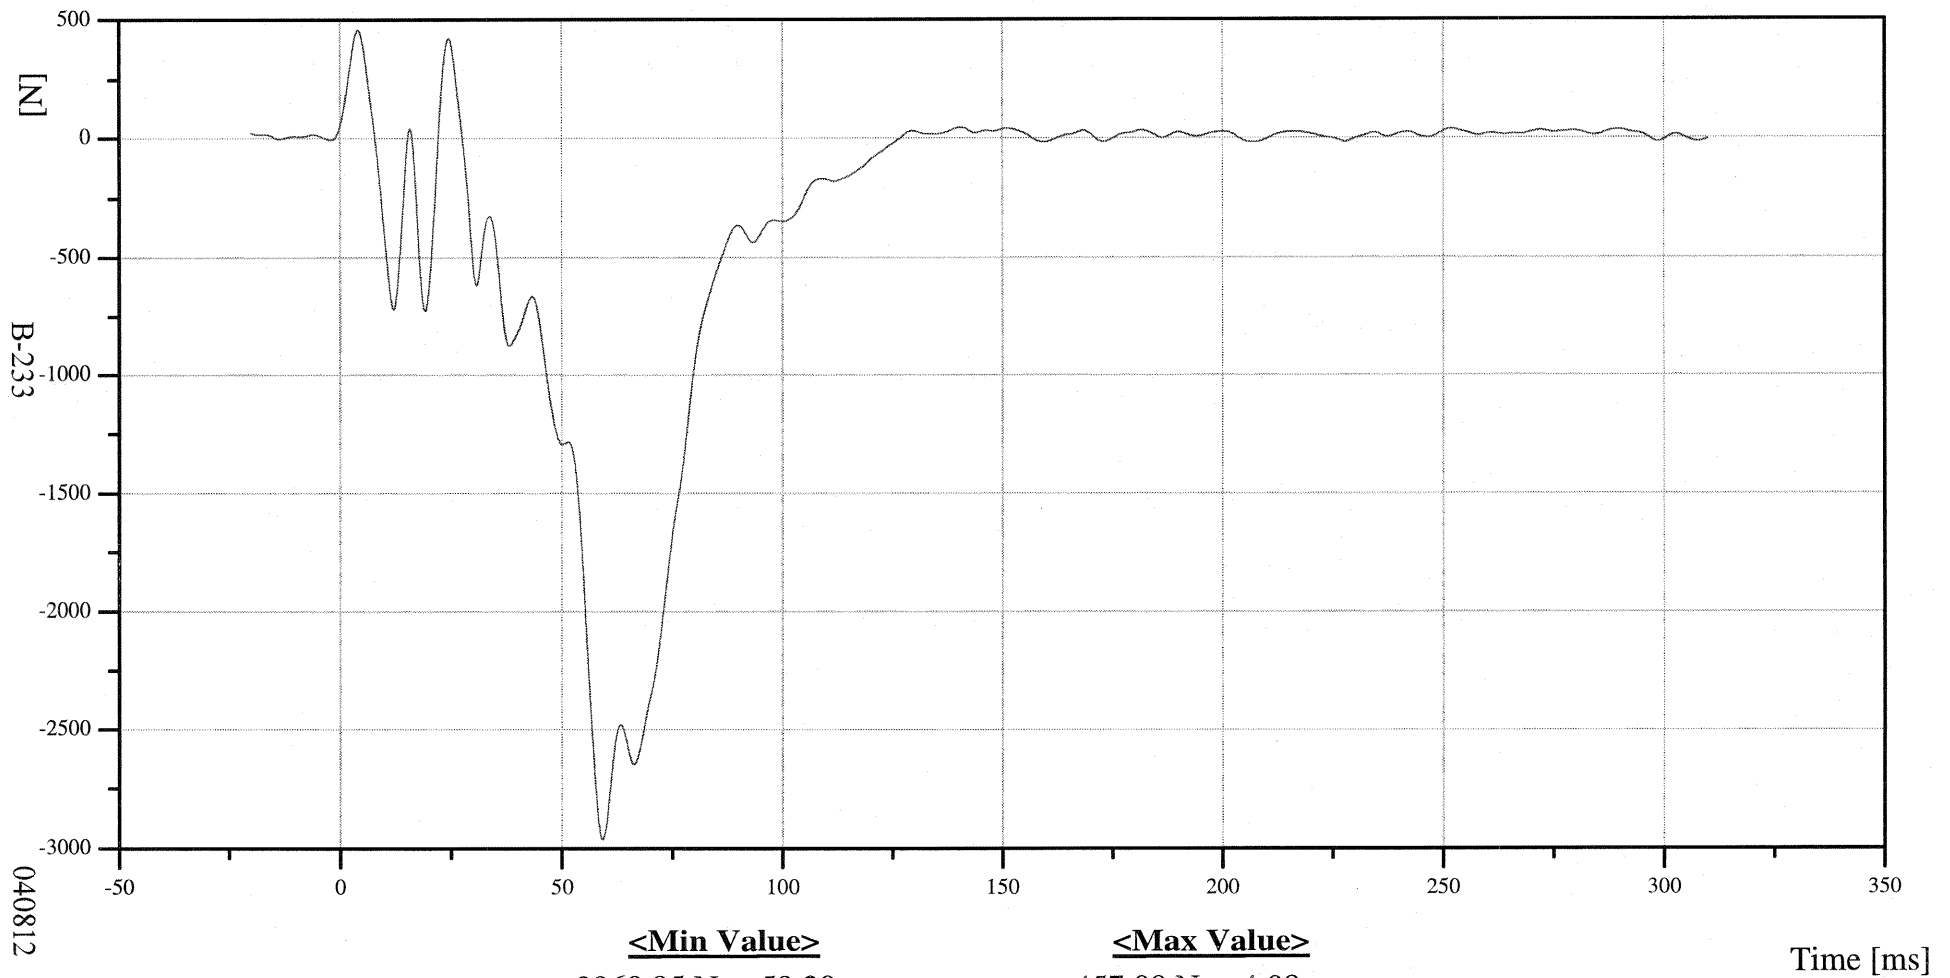

040812

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0607

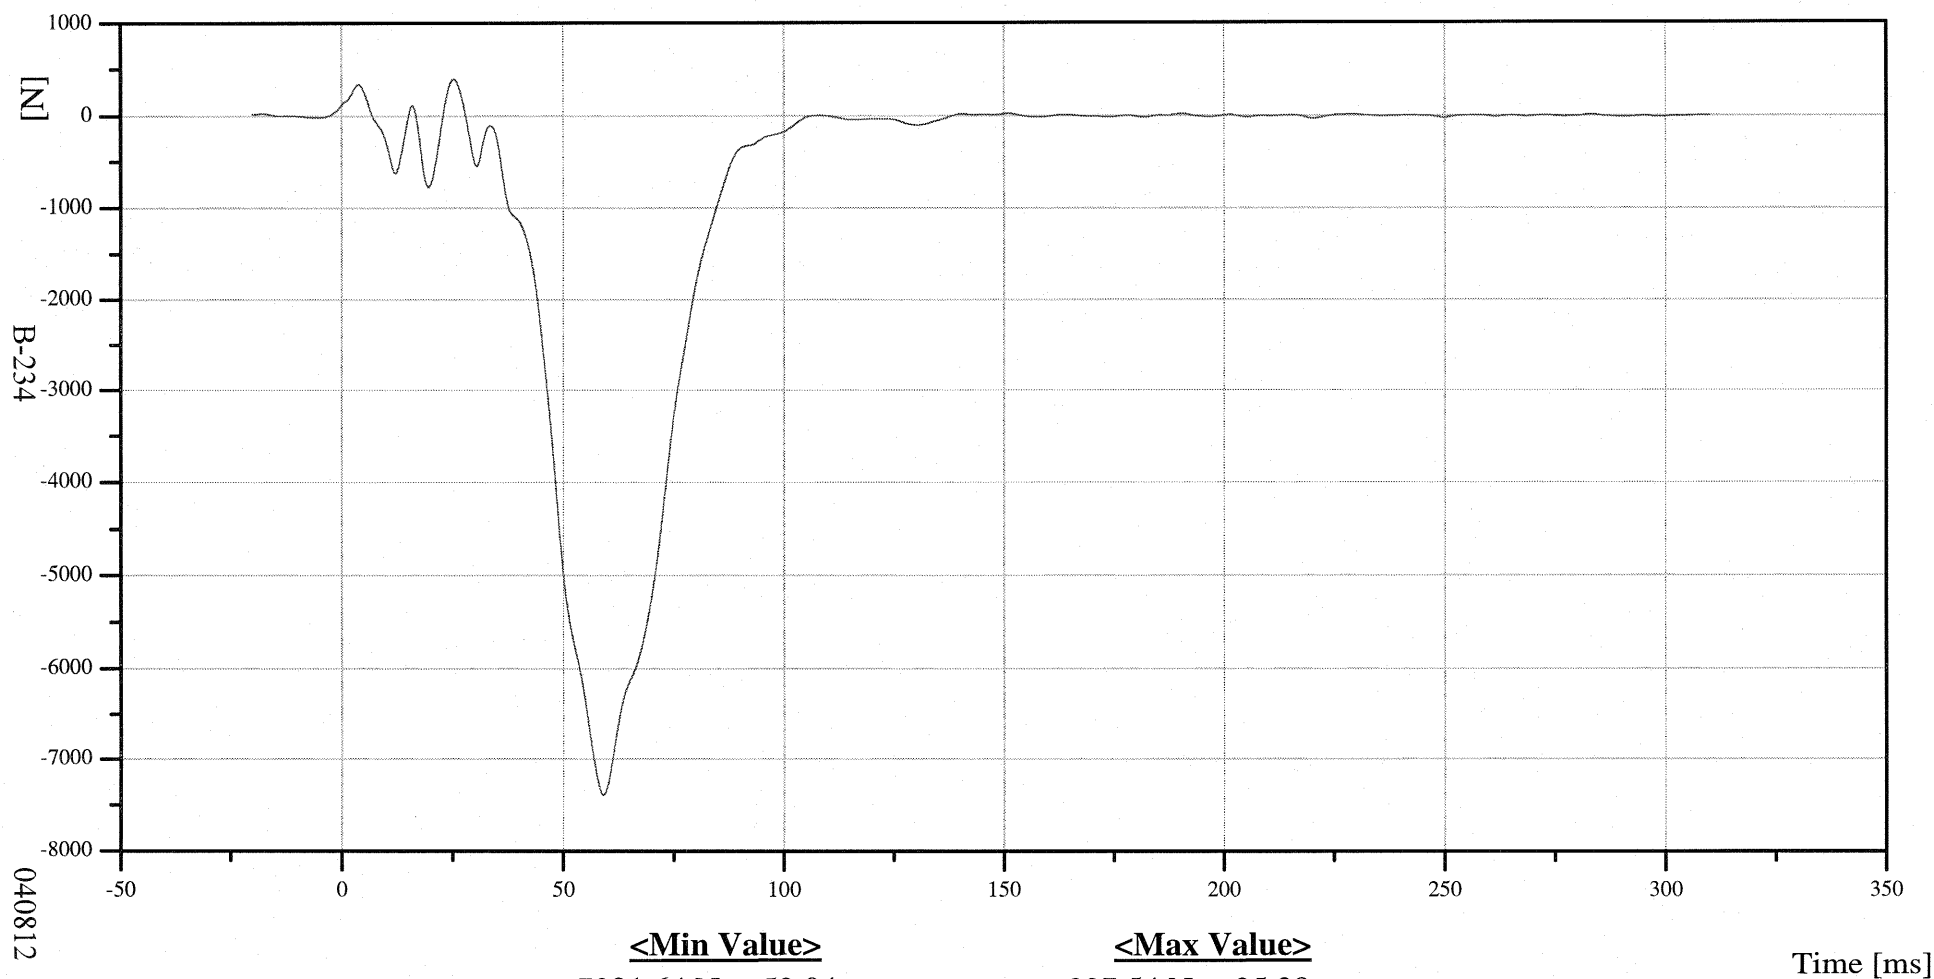

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0608

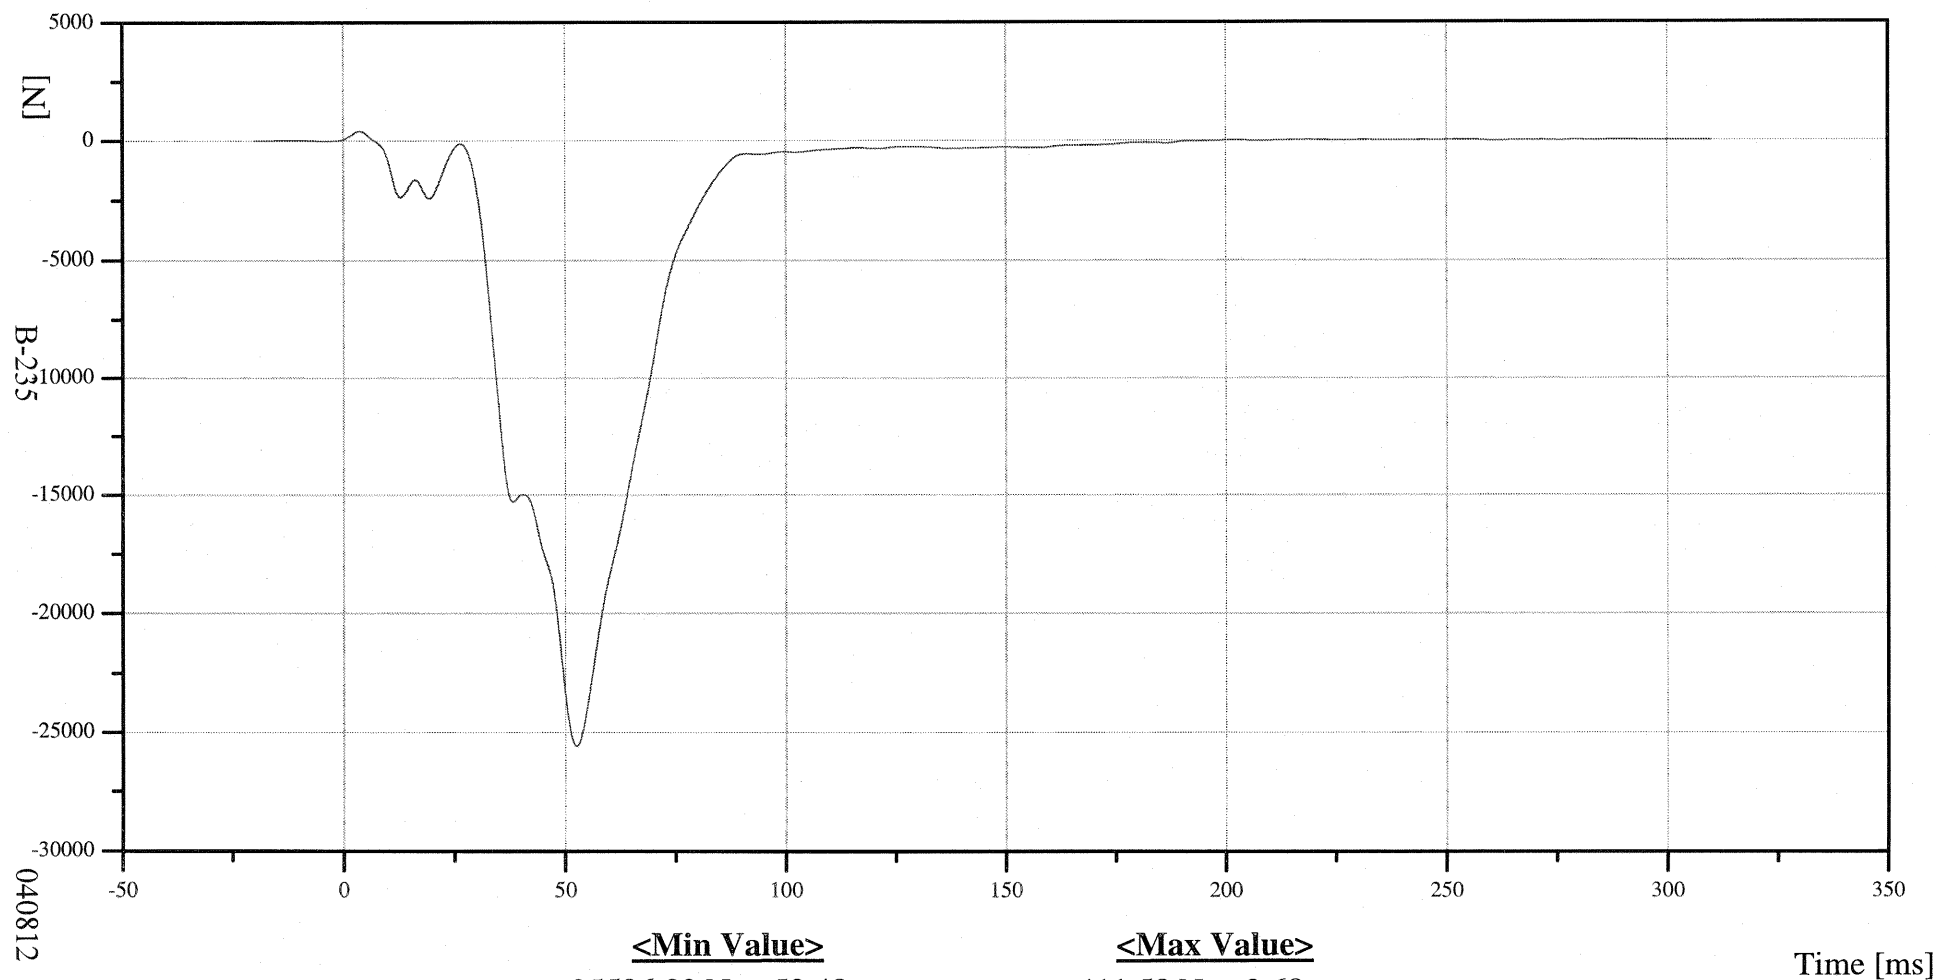

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0609

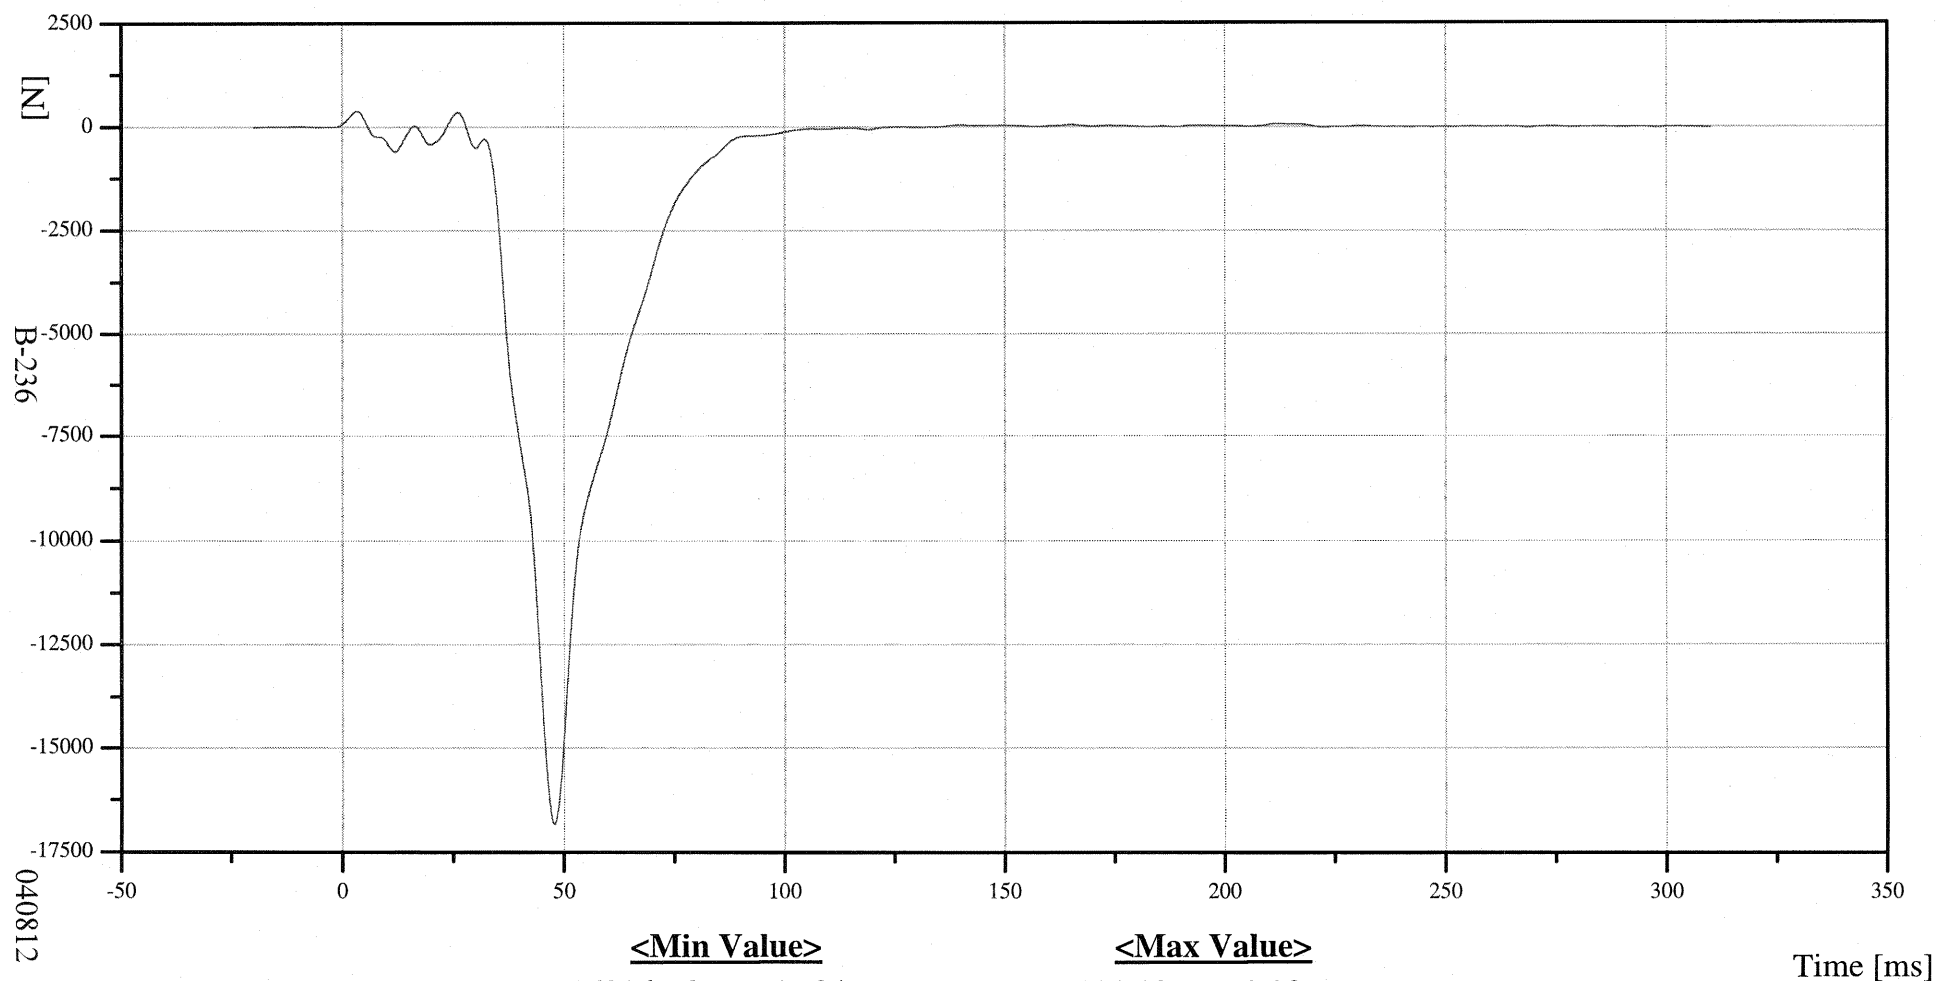

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0610

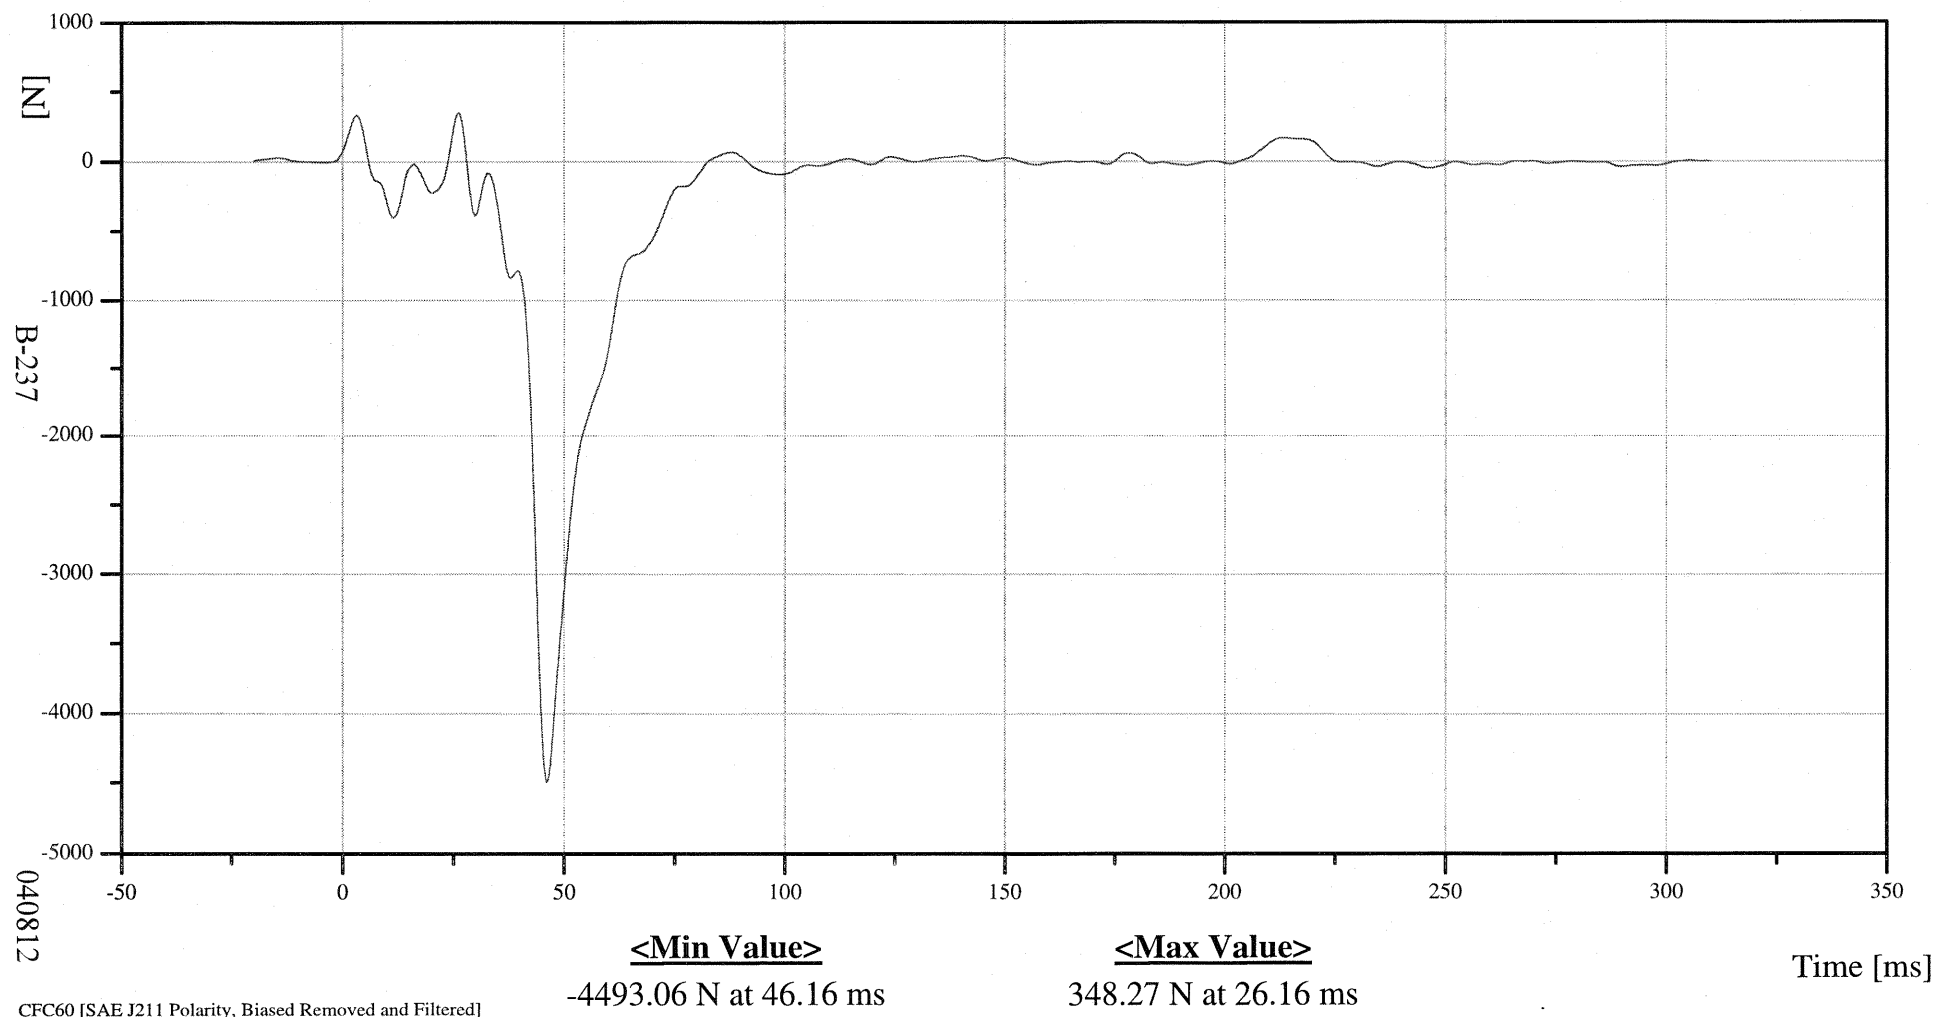



Transportation Research Center, Inc.

ROW 6 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0611

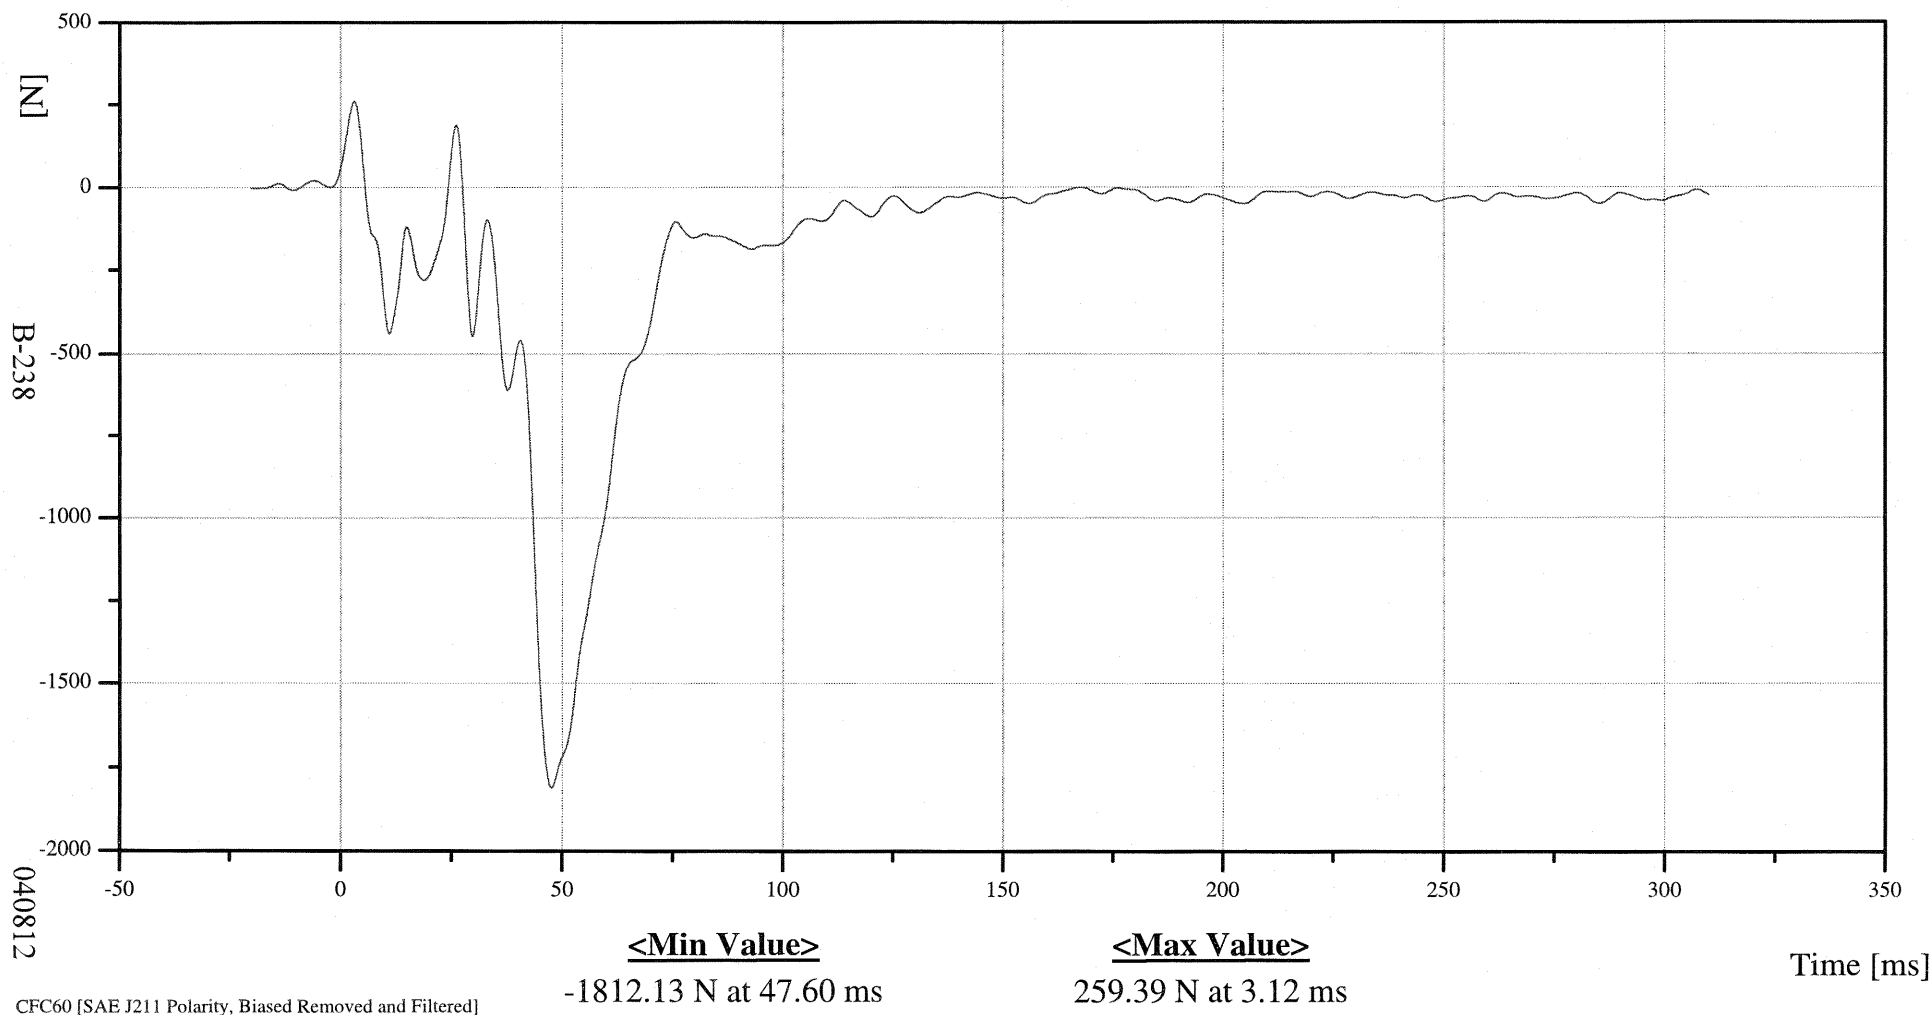



Transportation Research Center, Inc.

ROW 6 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0612

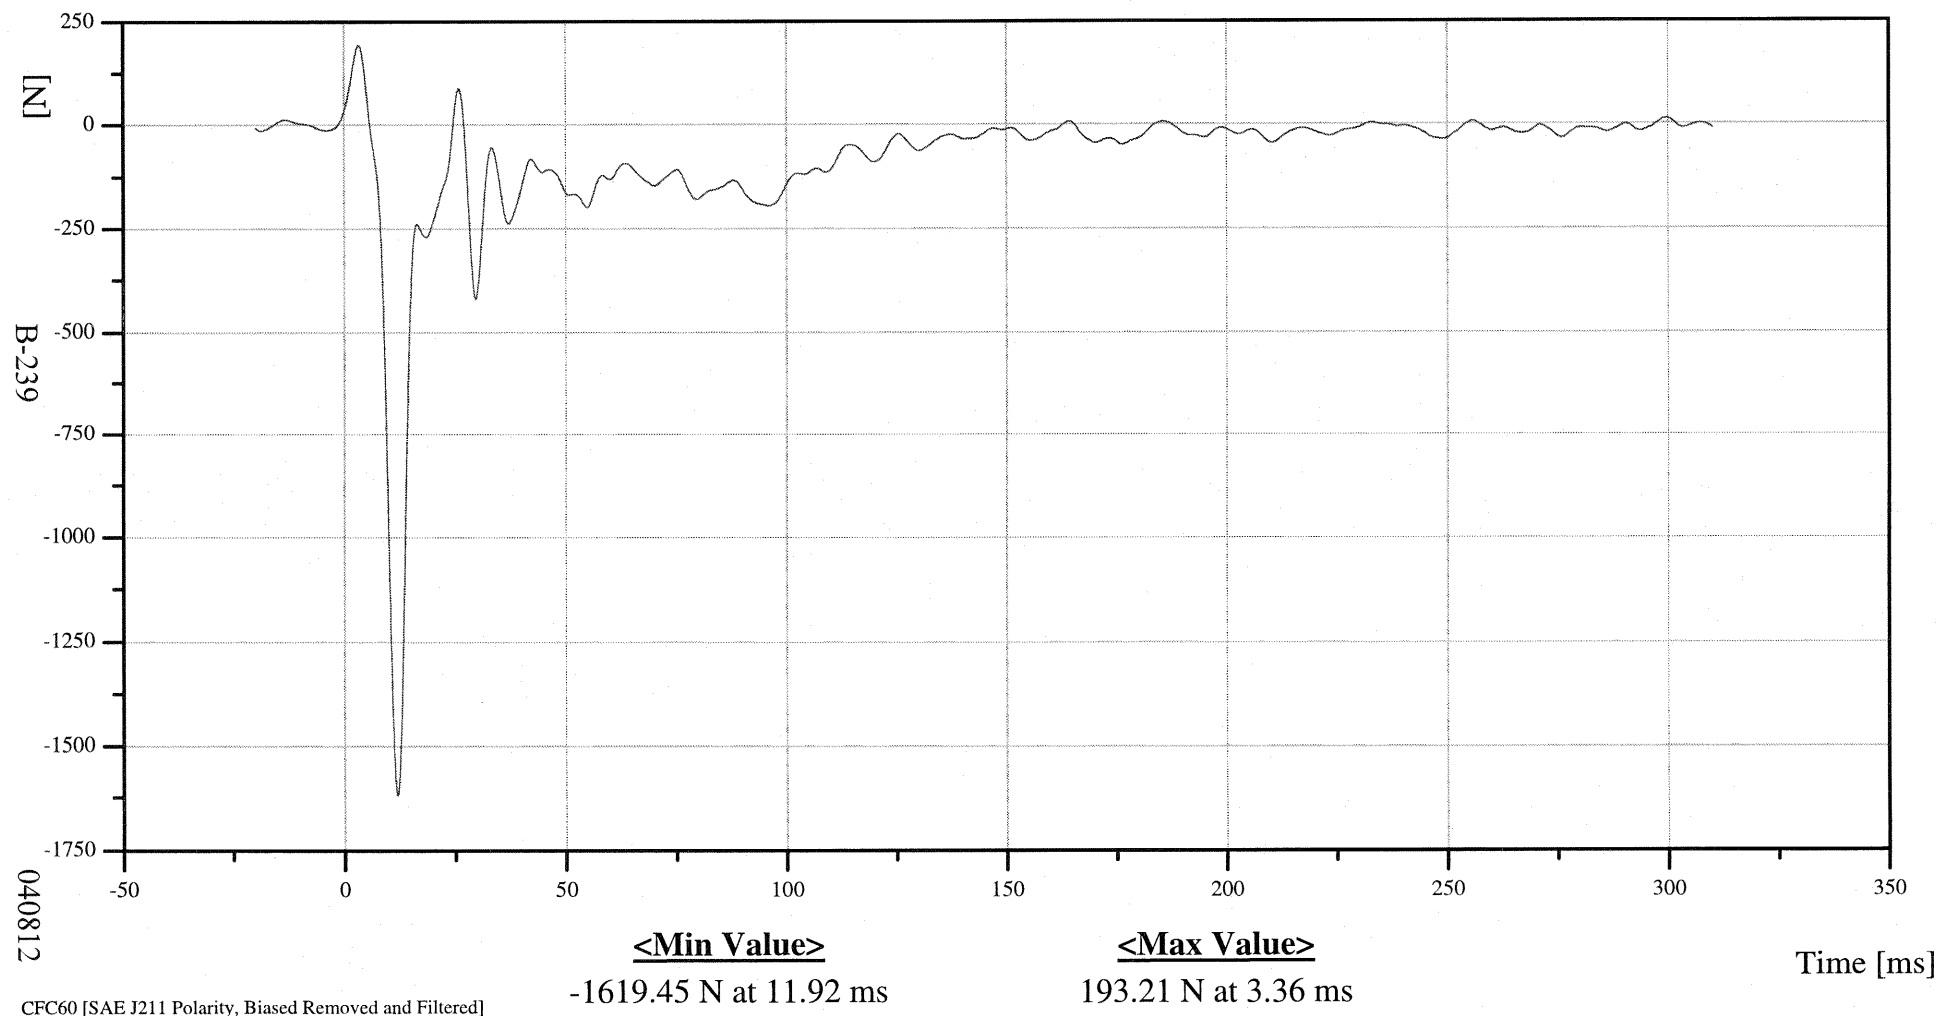



Transportation Research Center, Inc.

ROW 6 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0613

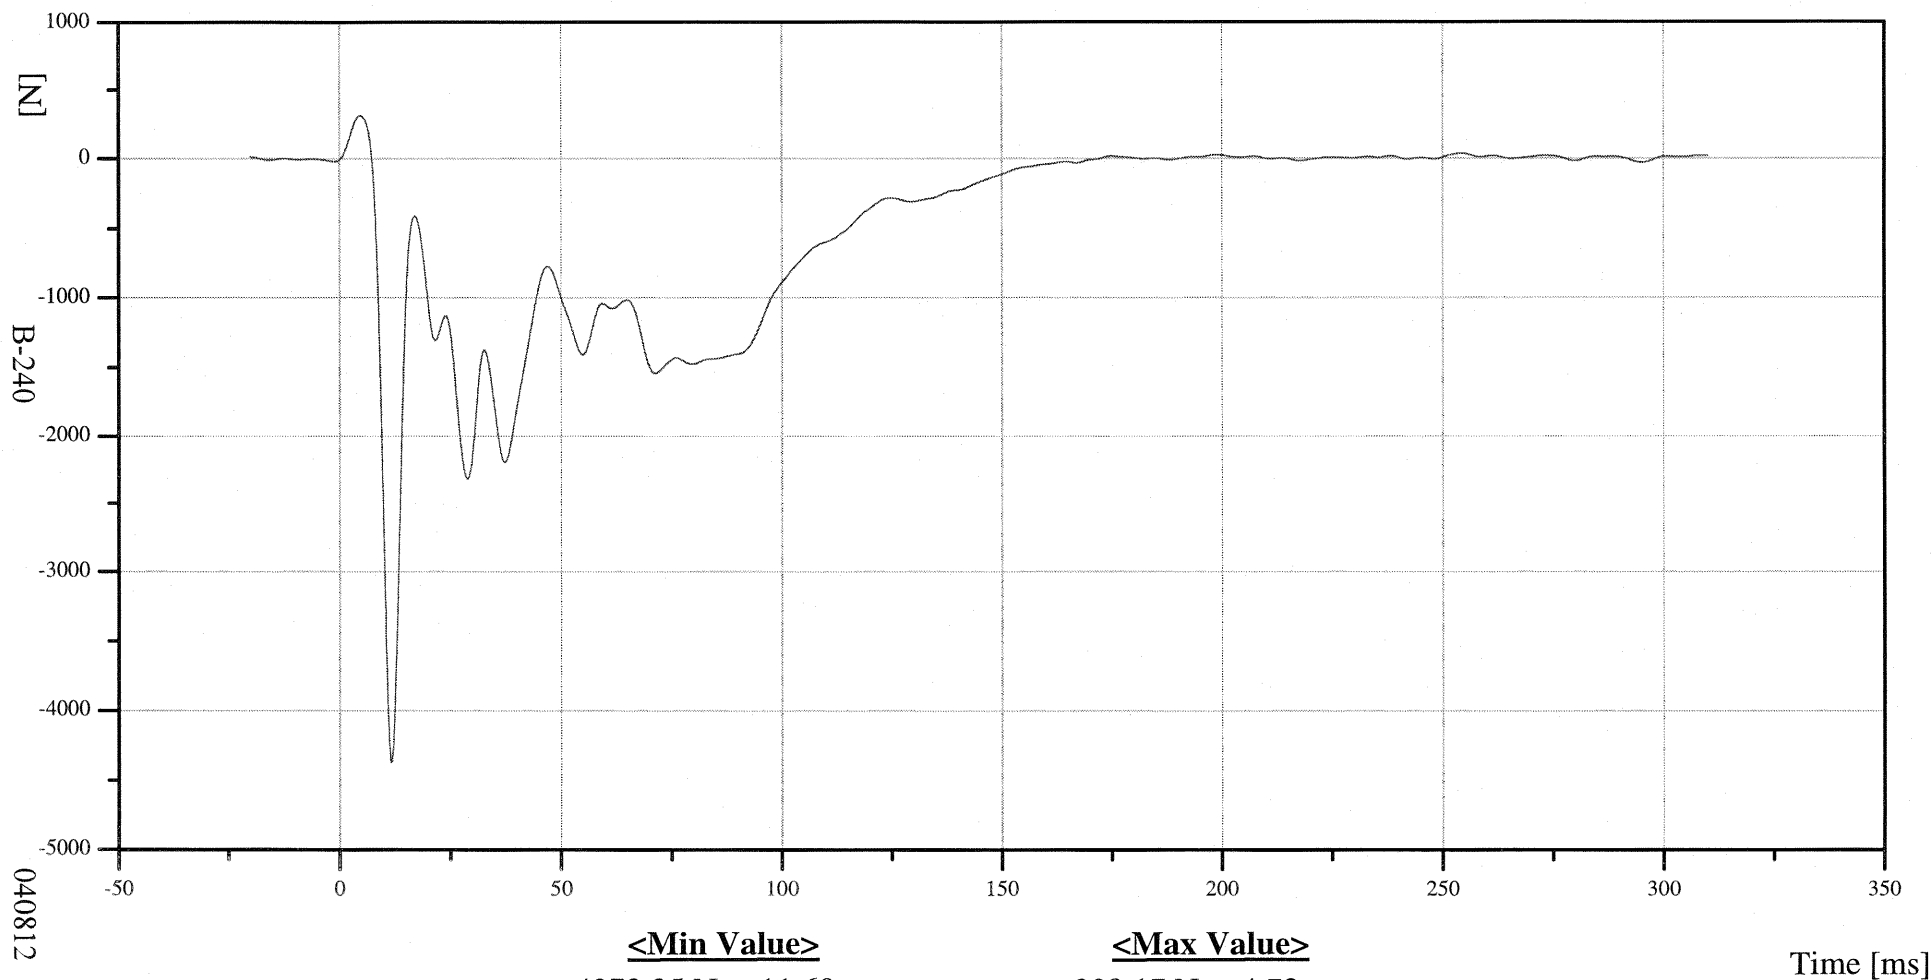

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.


ROW 6 COLUMN 14

Date: 08/12/2004
Time: 12:06:33

Test Lab: CTF
Customer: VRTC
Test Number: 040812

Position #1 - HIII 5th Female (416)
Position #2 - HIII 5th Female (048)
Position #3 - HIII 5th Female (070)

LC0614

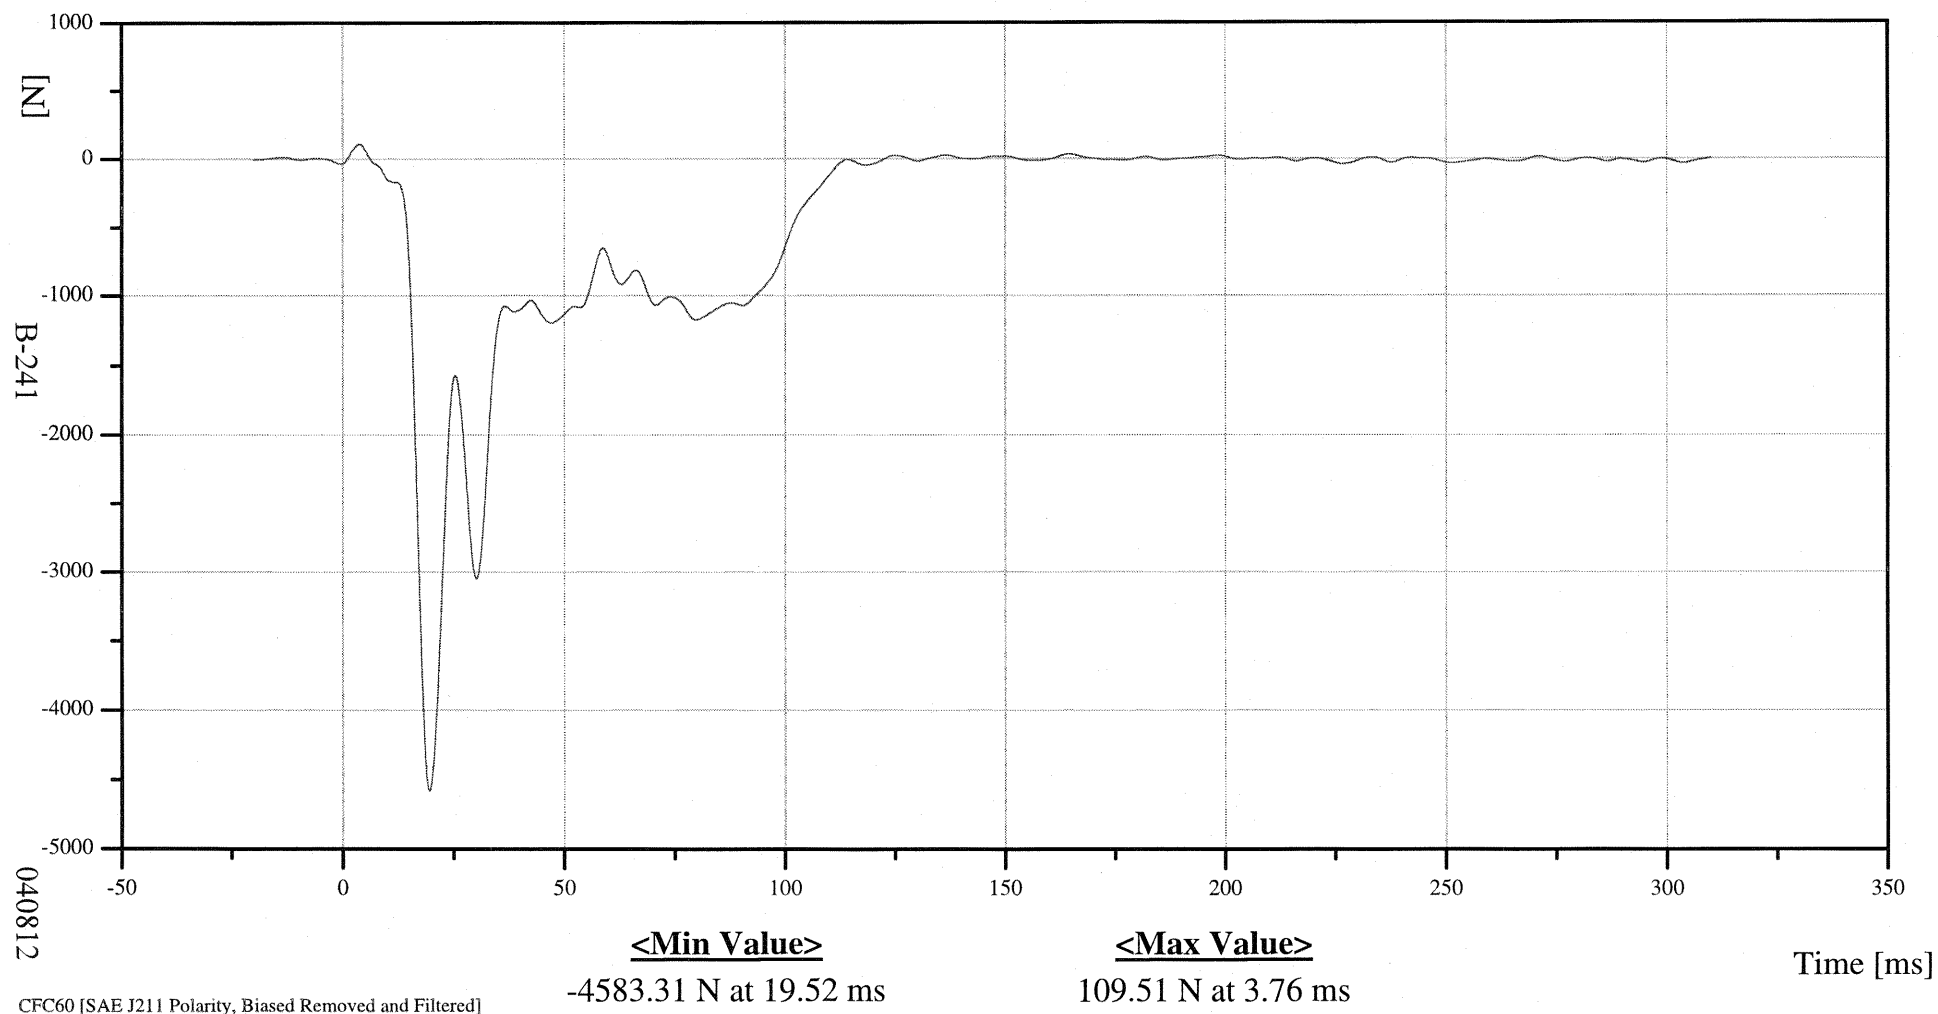



Transportation Research Center, Inc.

ROW 6 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0615

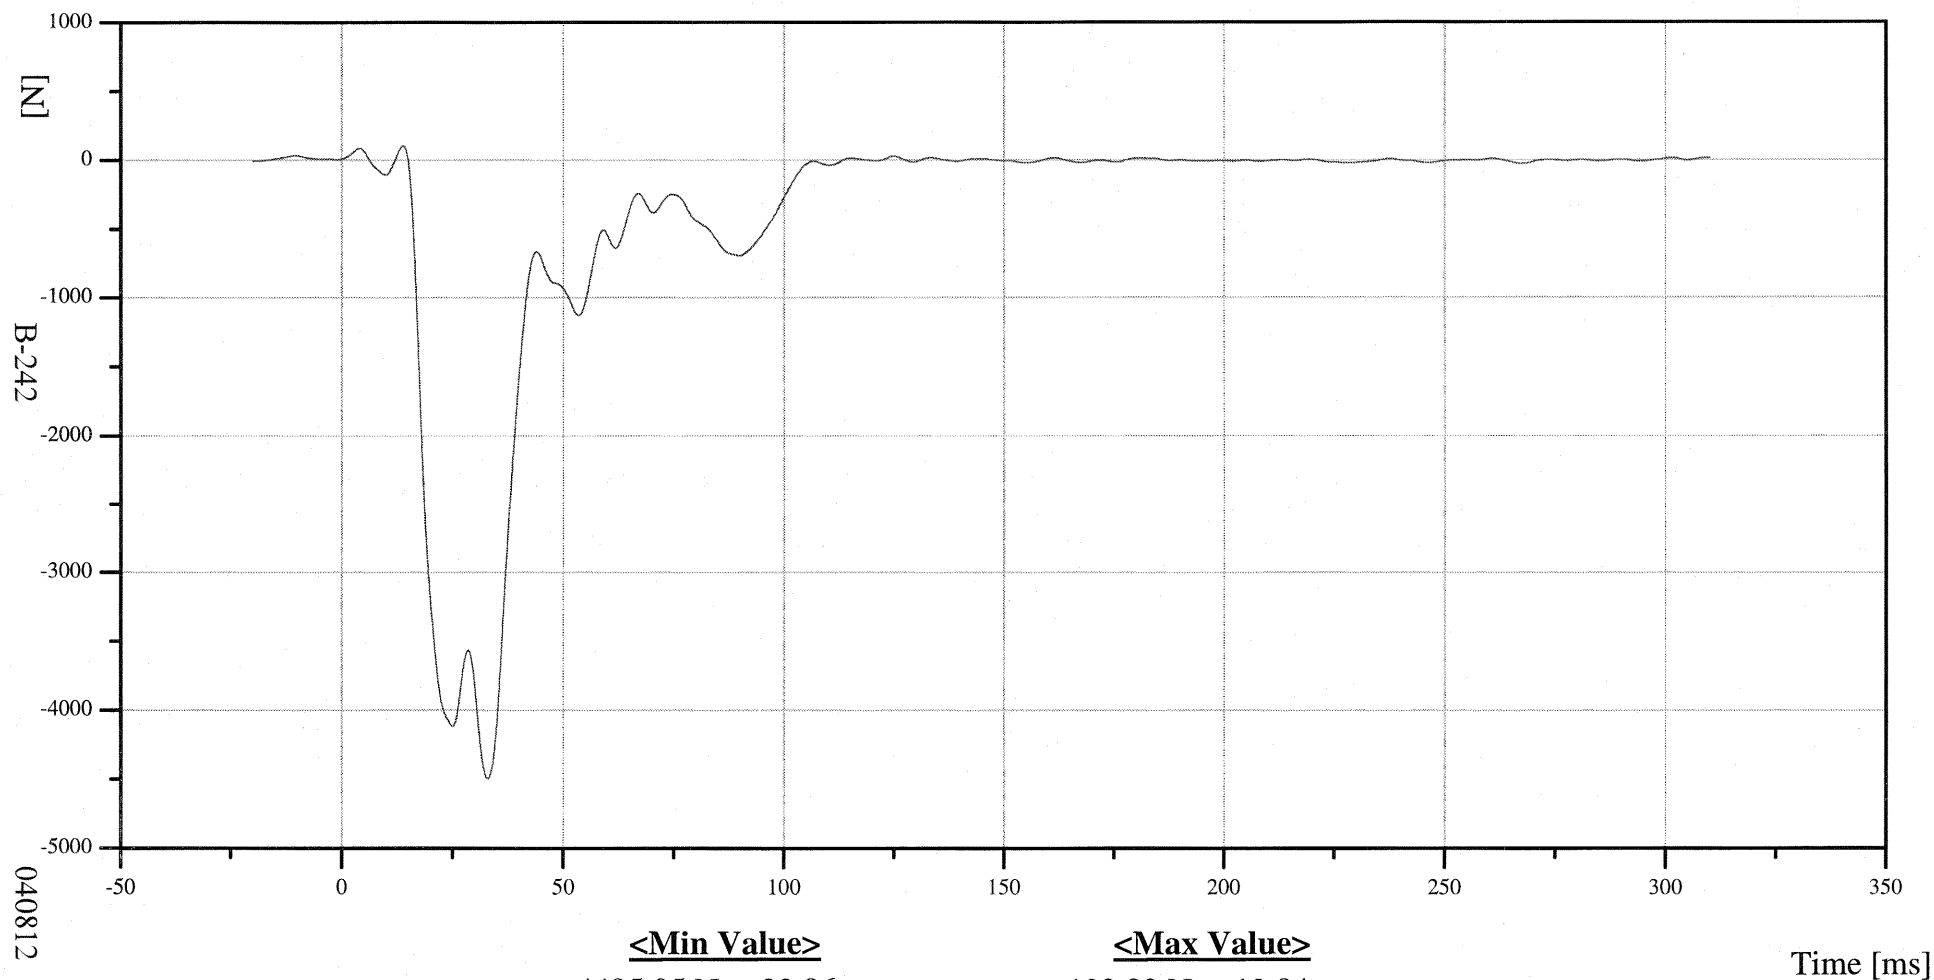

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 6 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0616

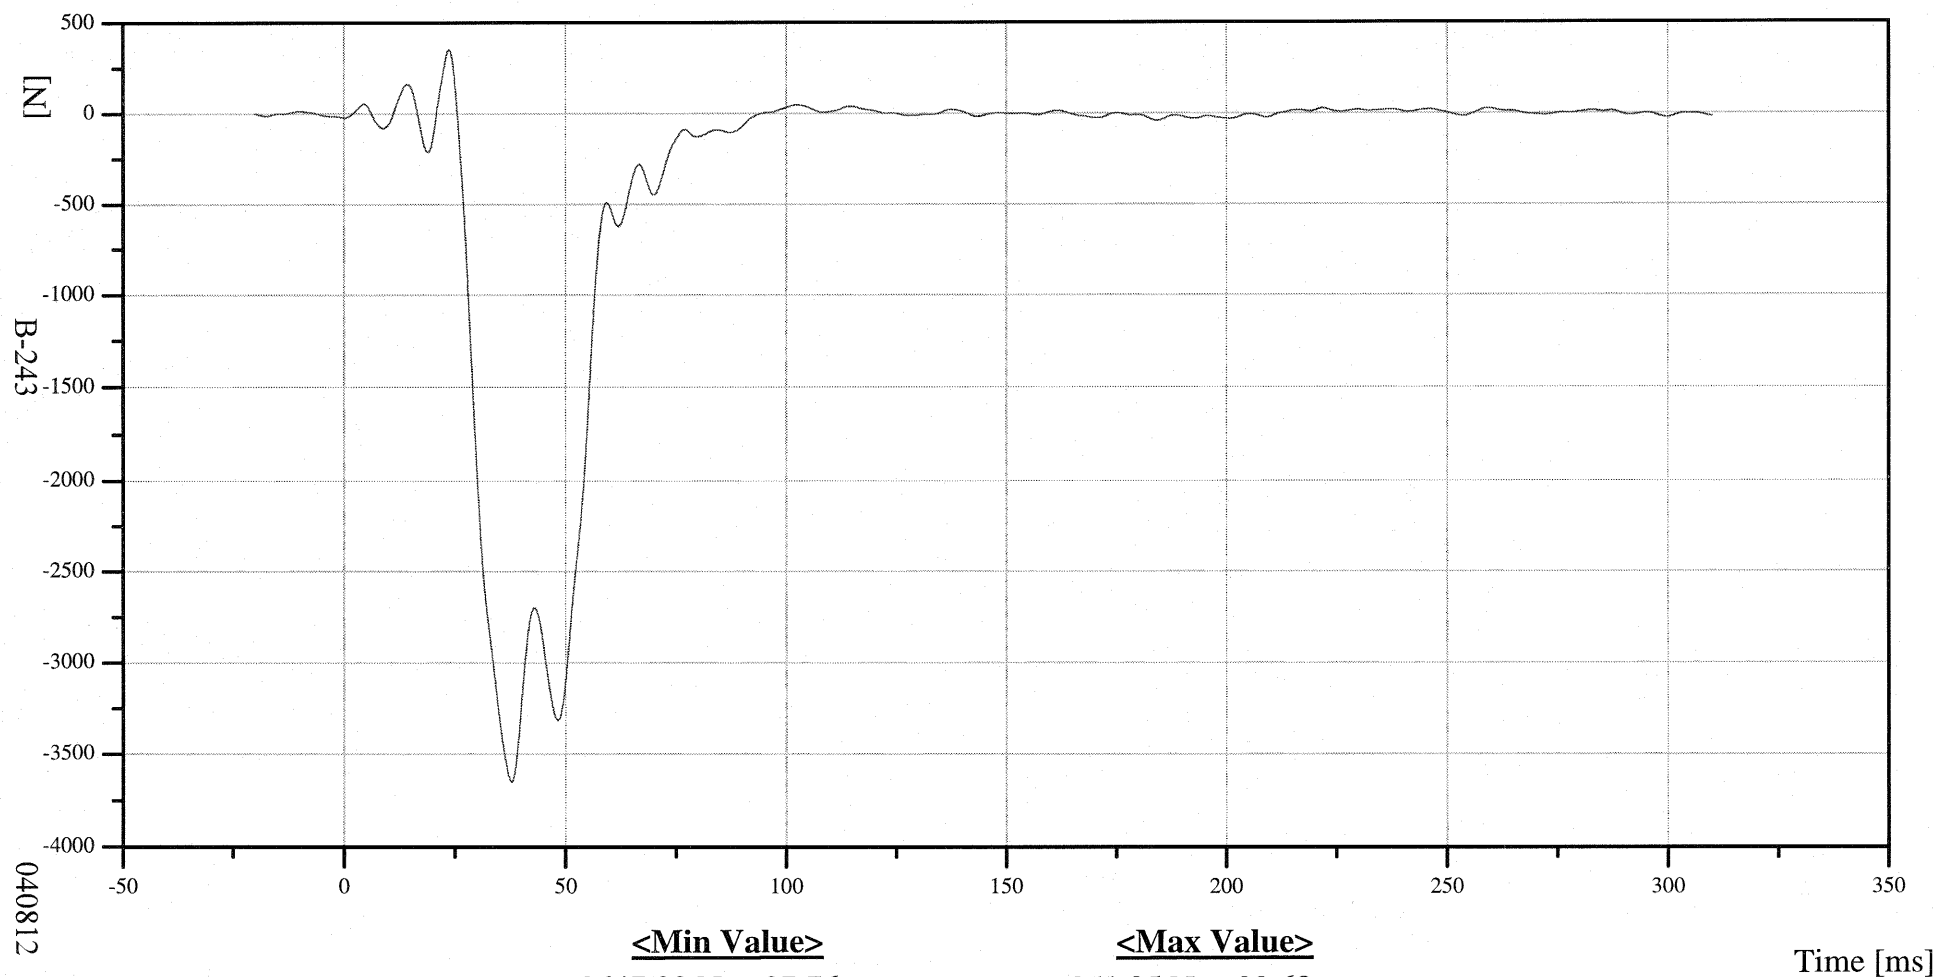

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0701

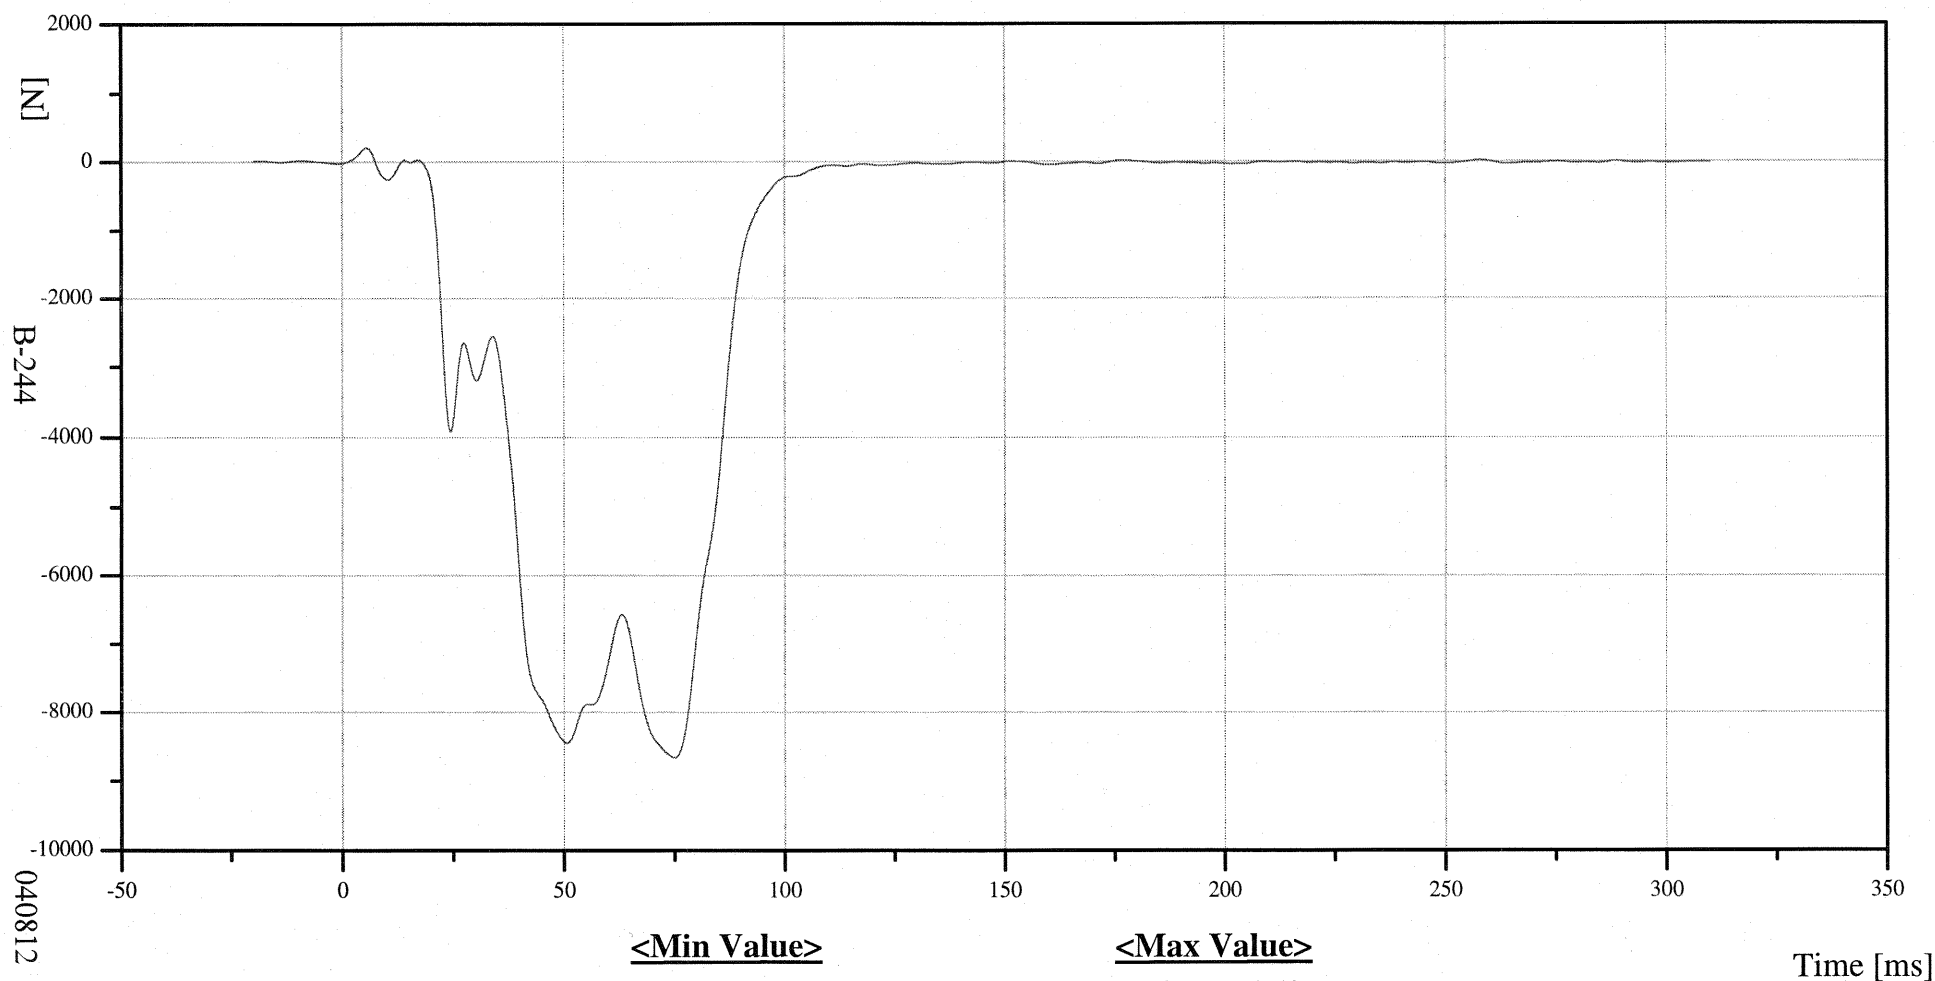

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0702

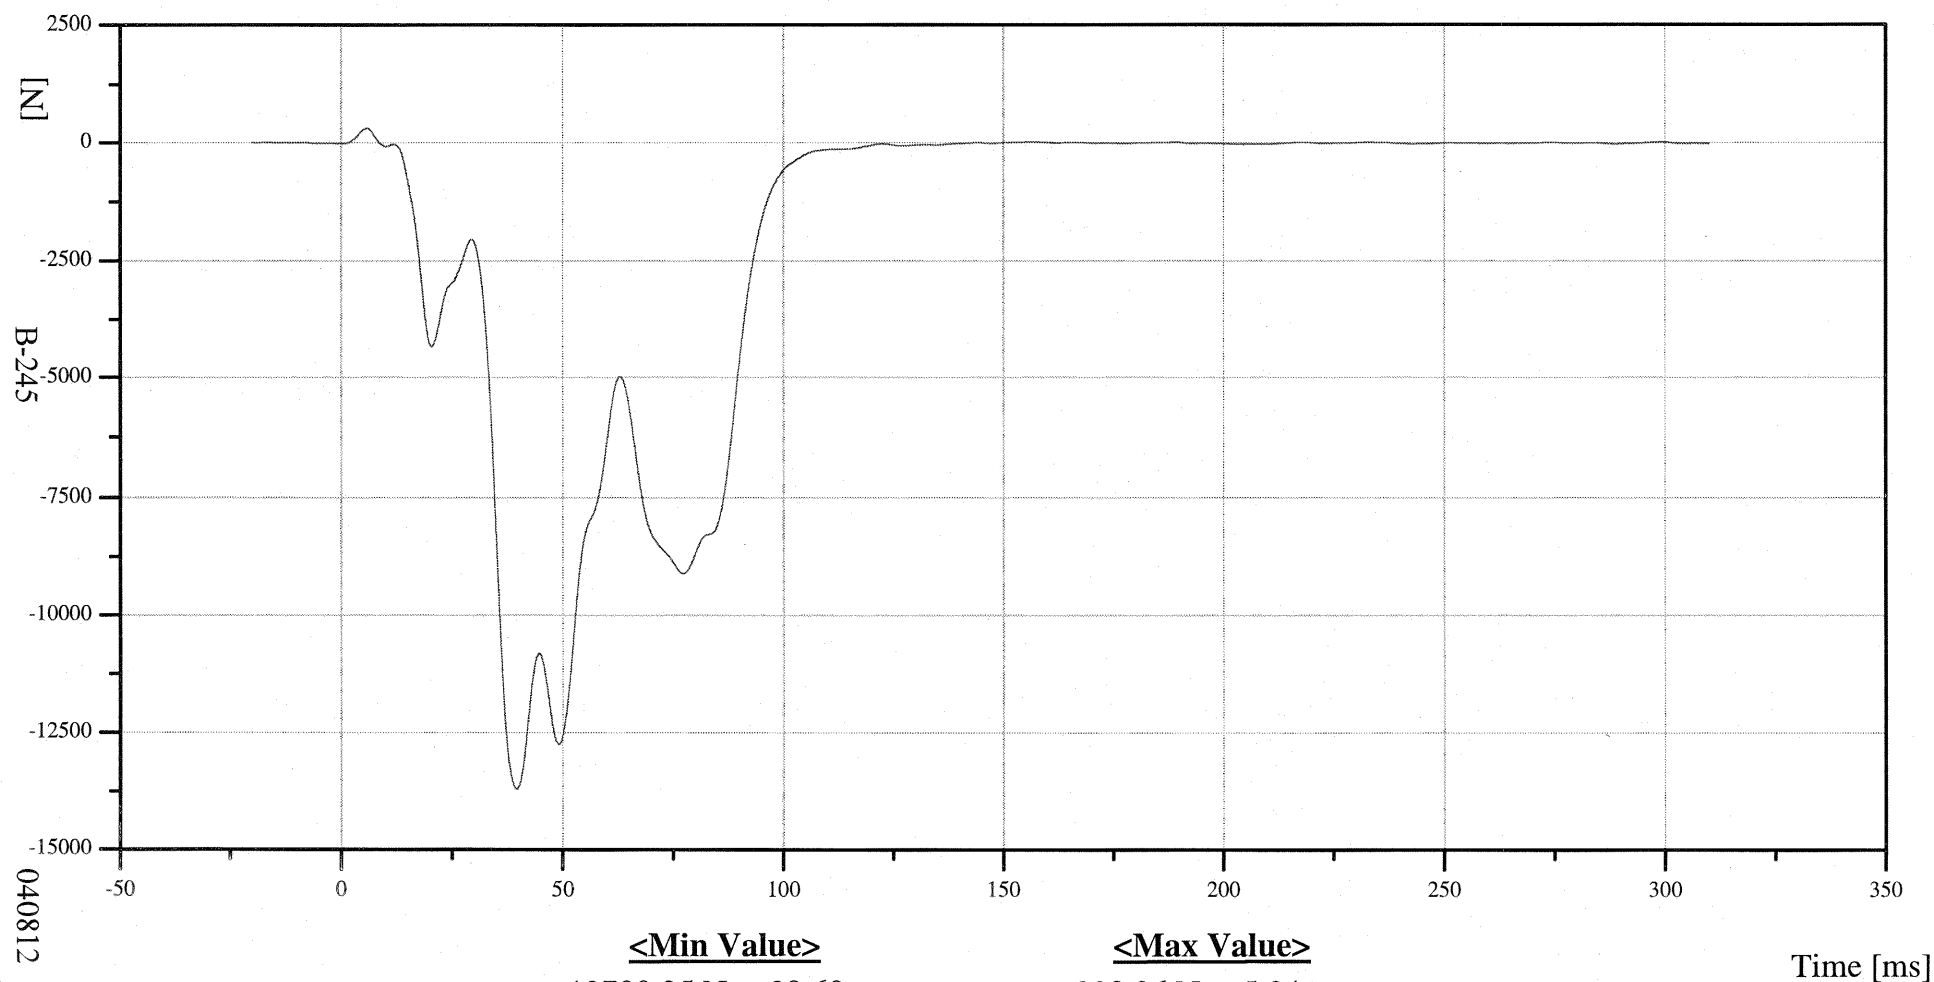

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0703

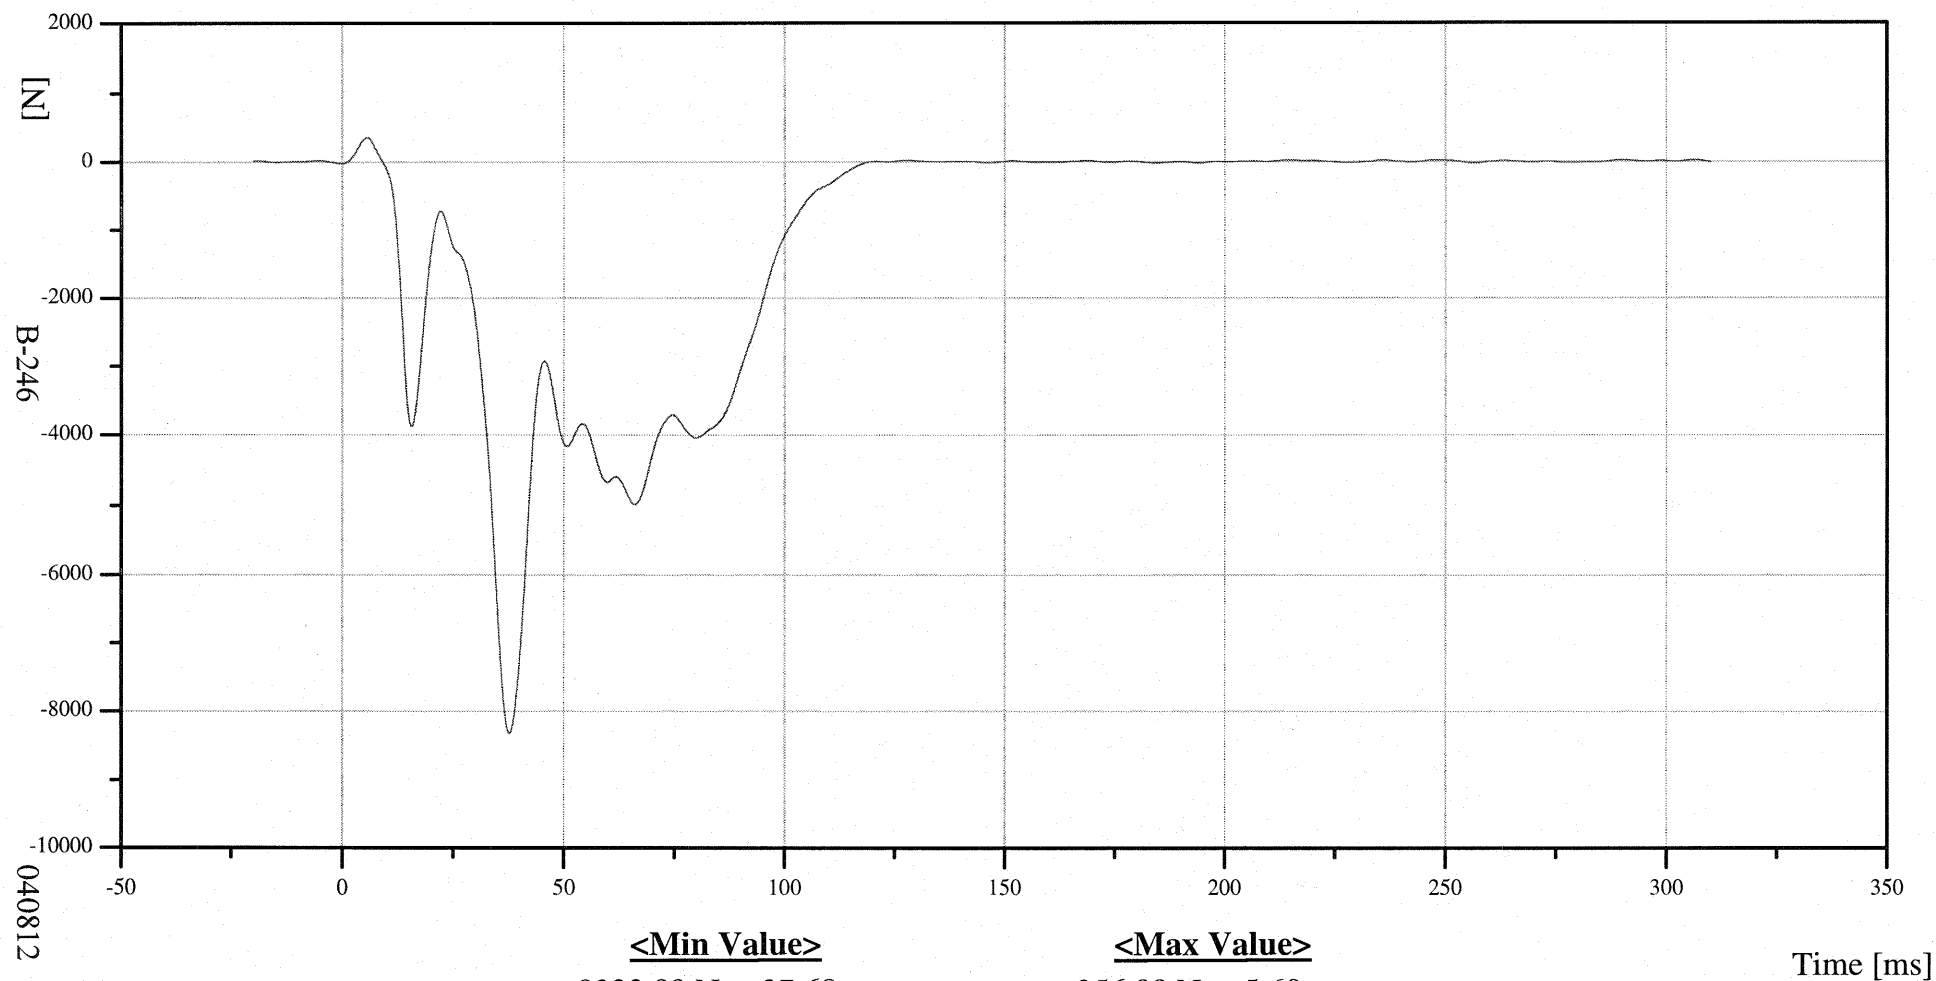

<Min Value>

-8323.89 N at 37.68 ms

<Max Value>

356.99 N at 5.60 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0704

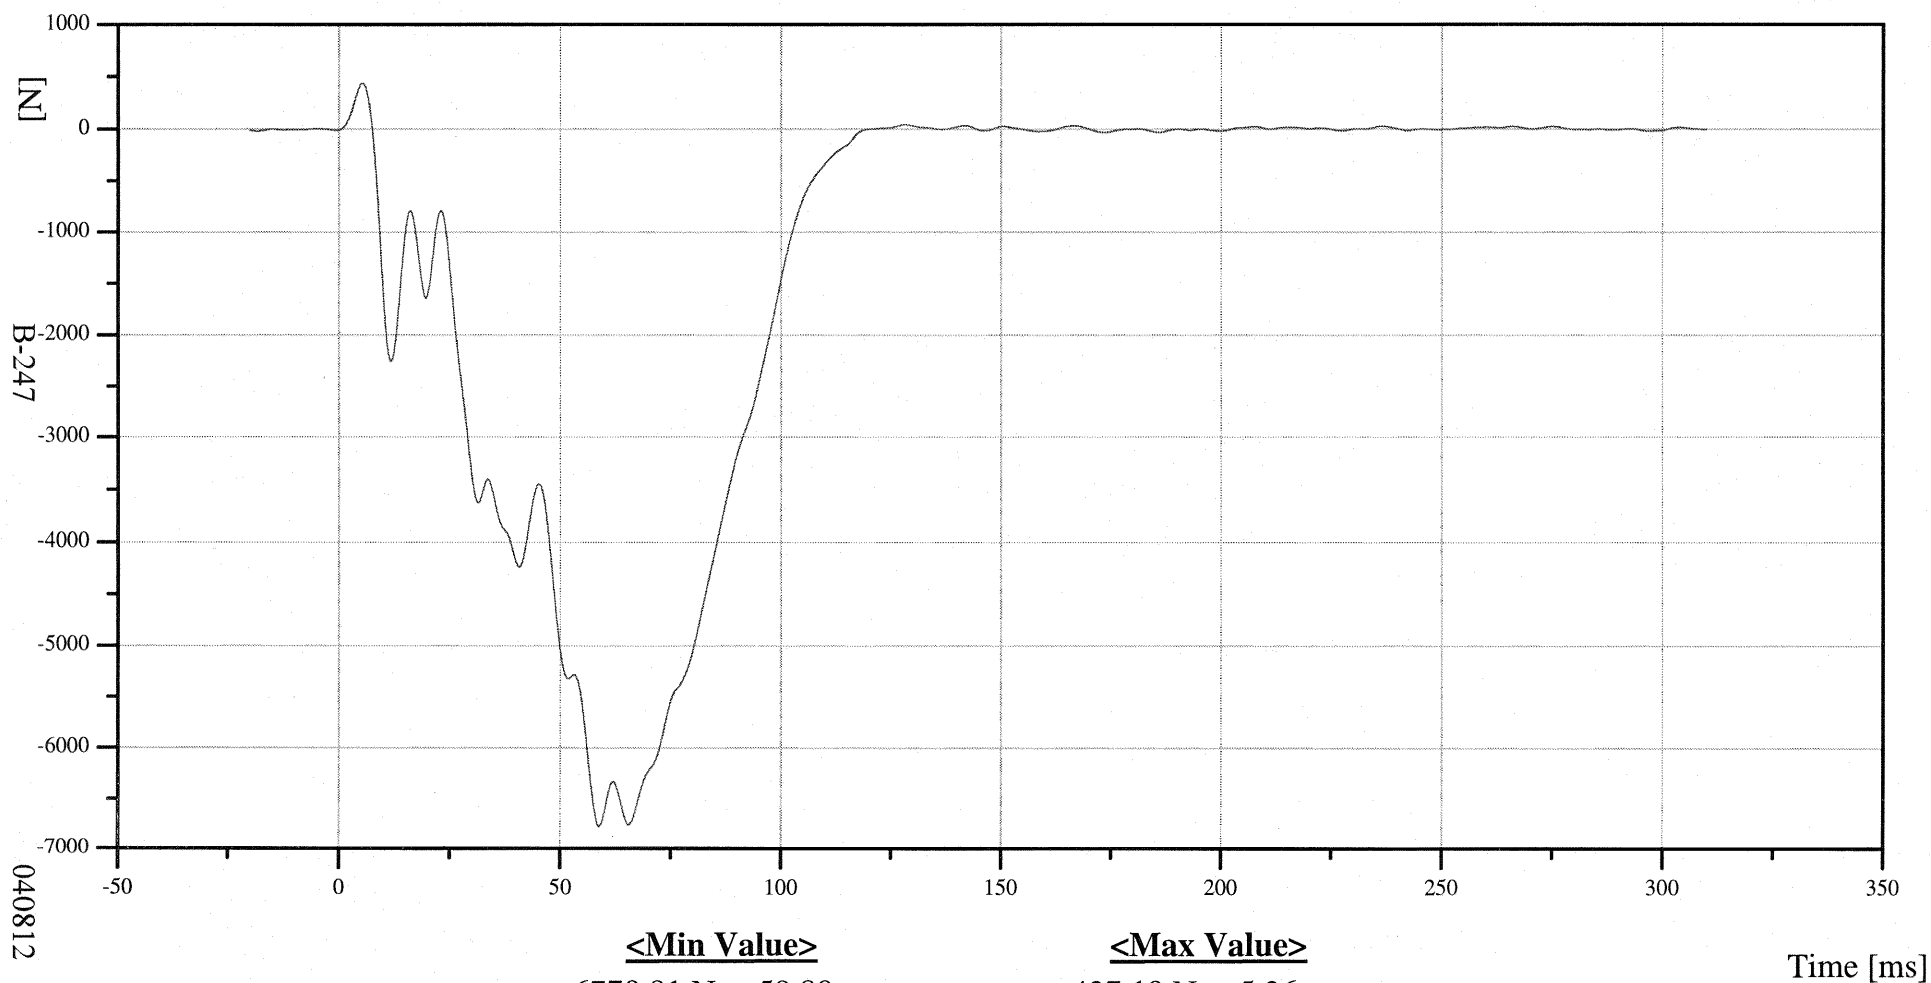

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0705

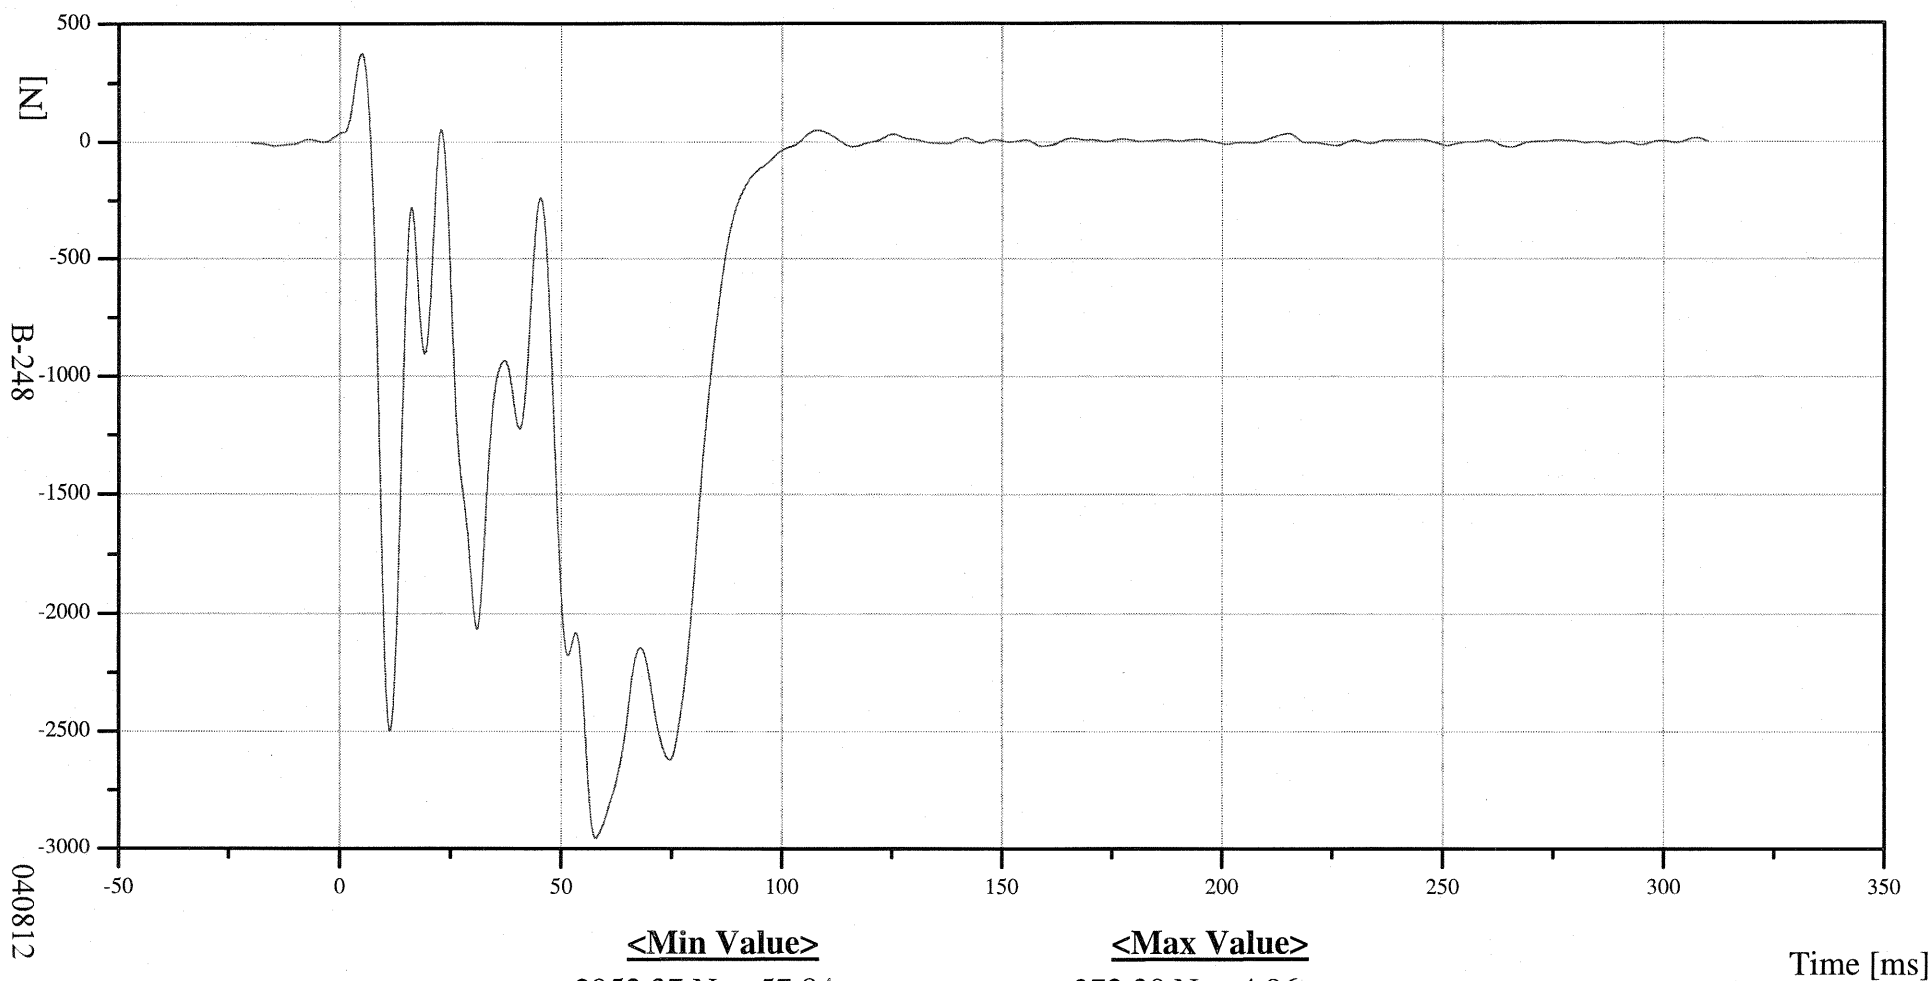

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0706

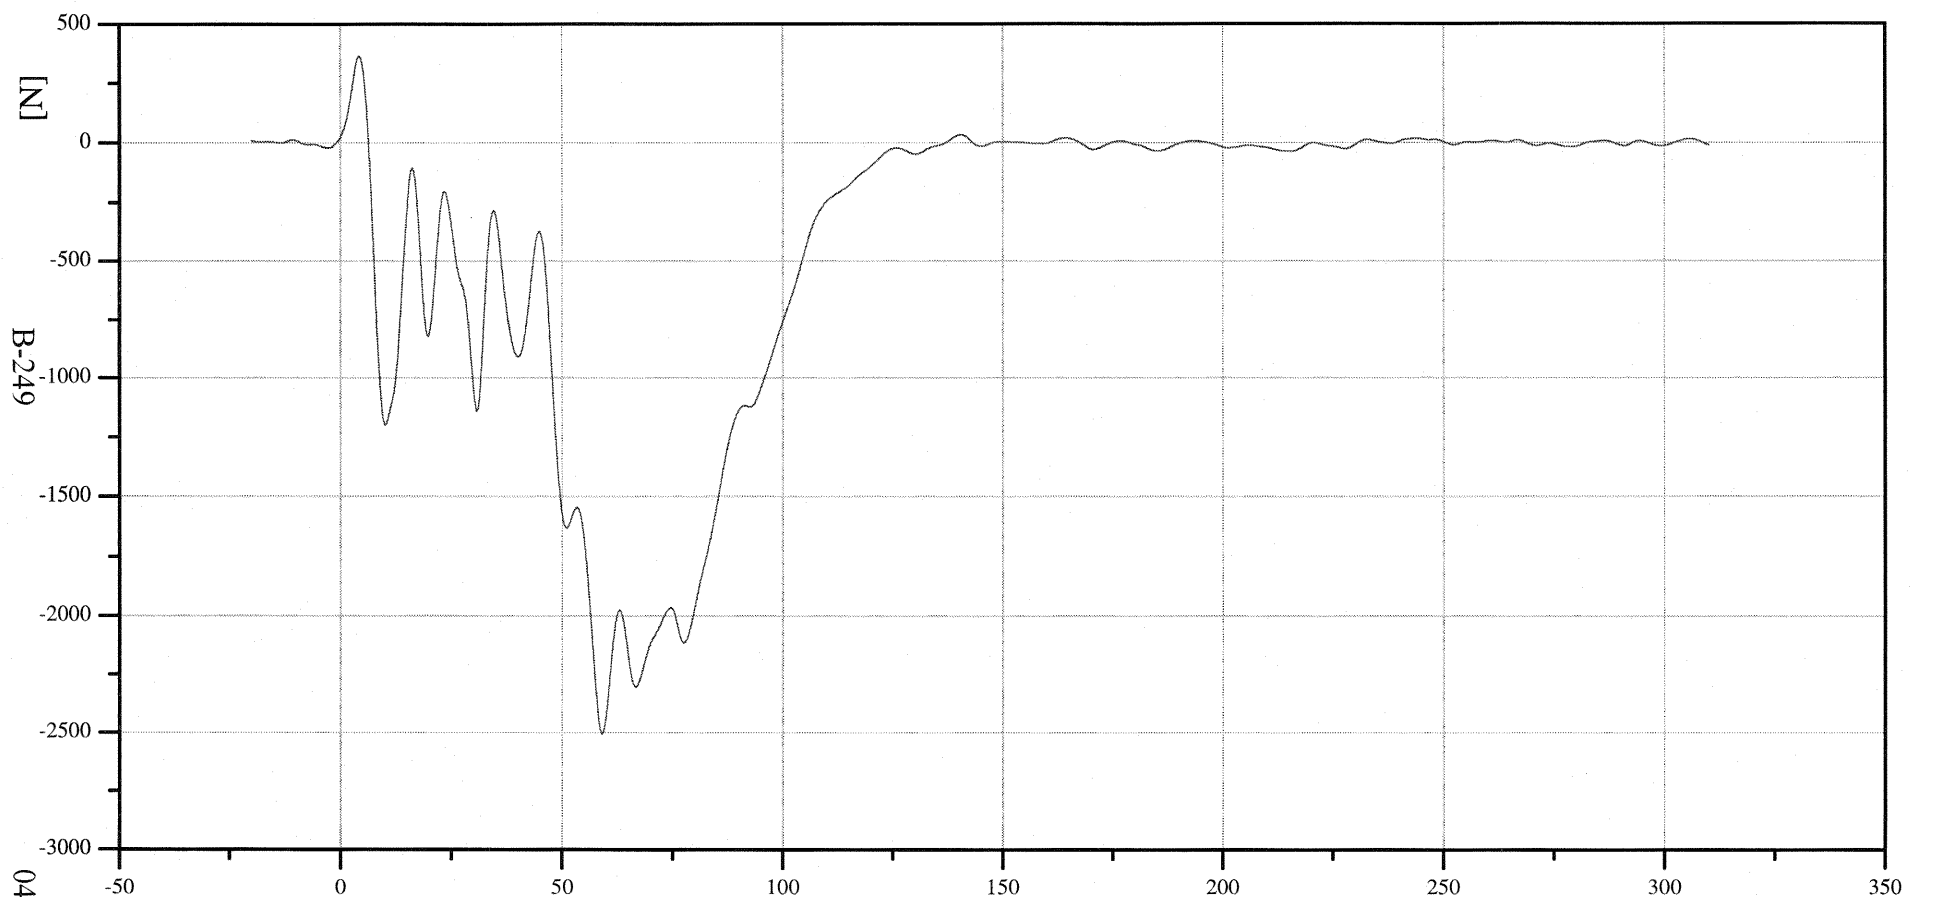

<Min Value>

-2505.04 N at 59.04 ms

<Max Value>

361.93 N at 4.24 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.


ROW 7 COLUMN 7

Date: 08/12/2004
Time: 12:06:33

Test Lab: CTF
Customer: VRTC
Test Number: 040812

Position #1 - HIII 5th Female (416)
Position #2 - HIII 5th Female (048)
Position #3 - HIII 5th Female (070)

LC0707

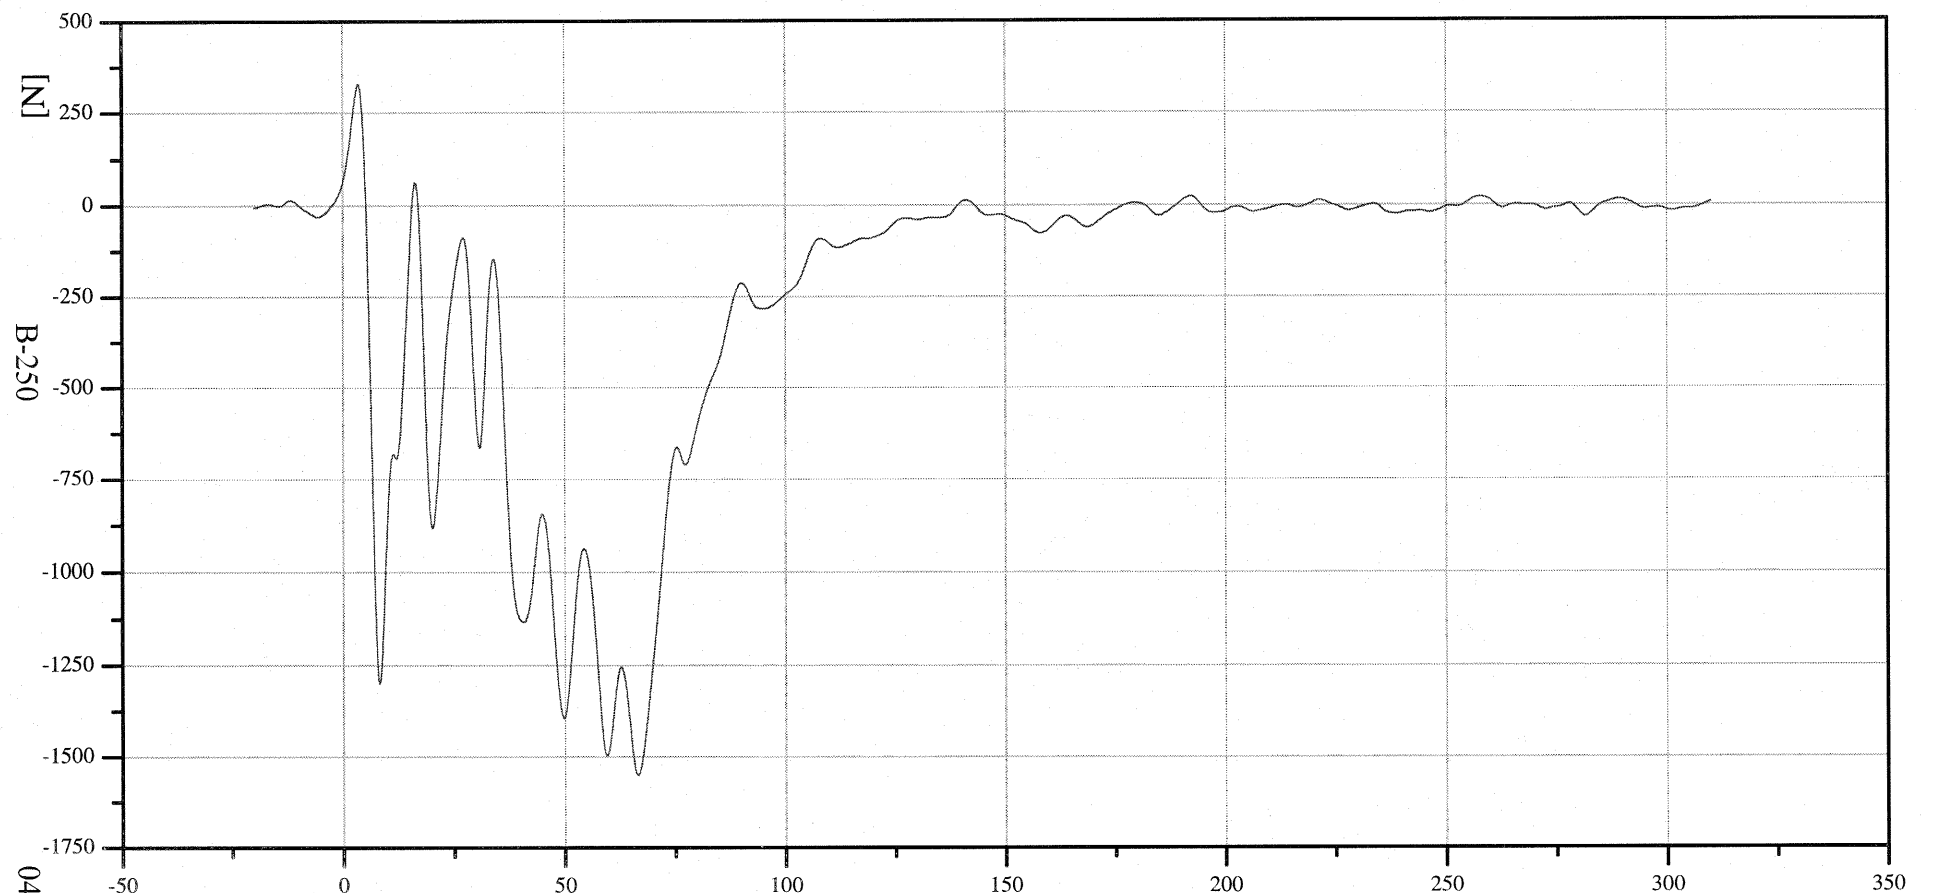

<Min Value>

-1551.30 N at 66.48 ms

<Max Value>

326.92 N at 3.52 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0708

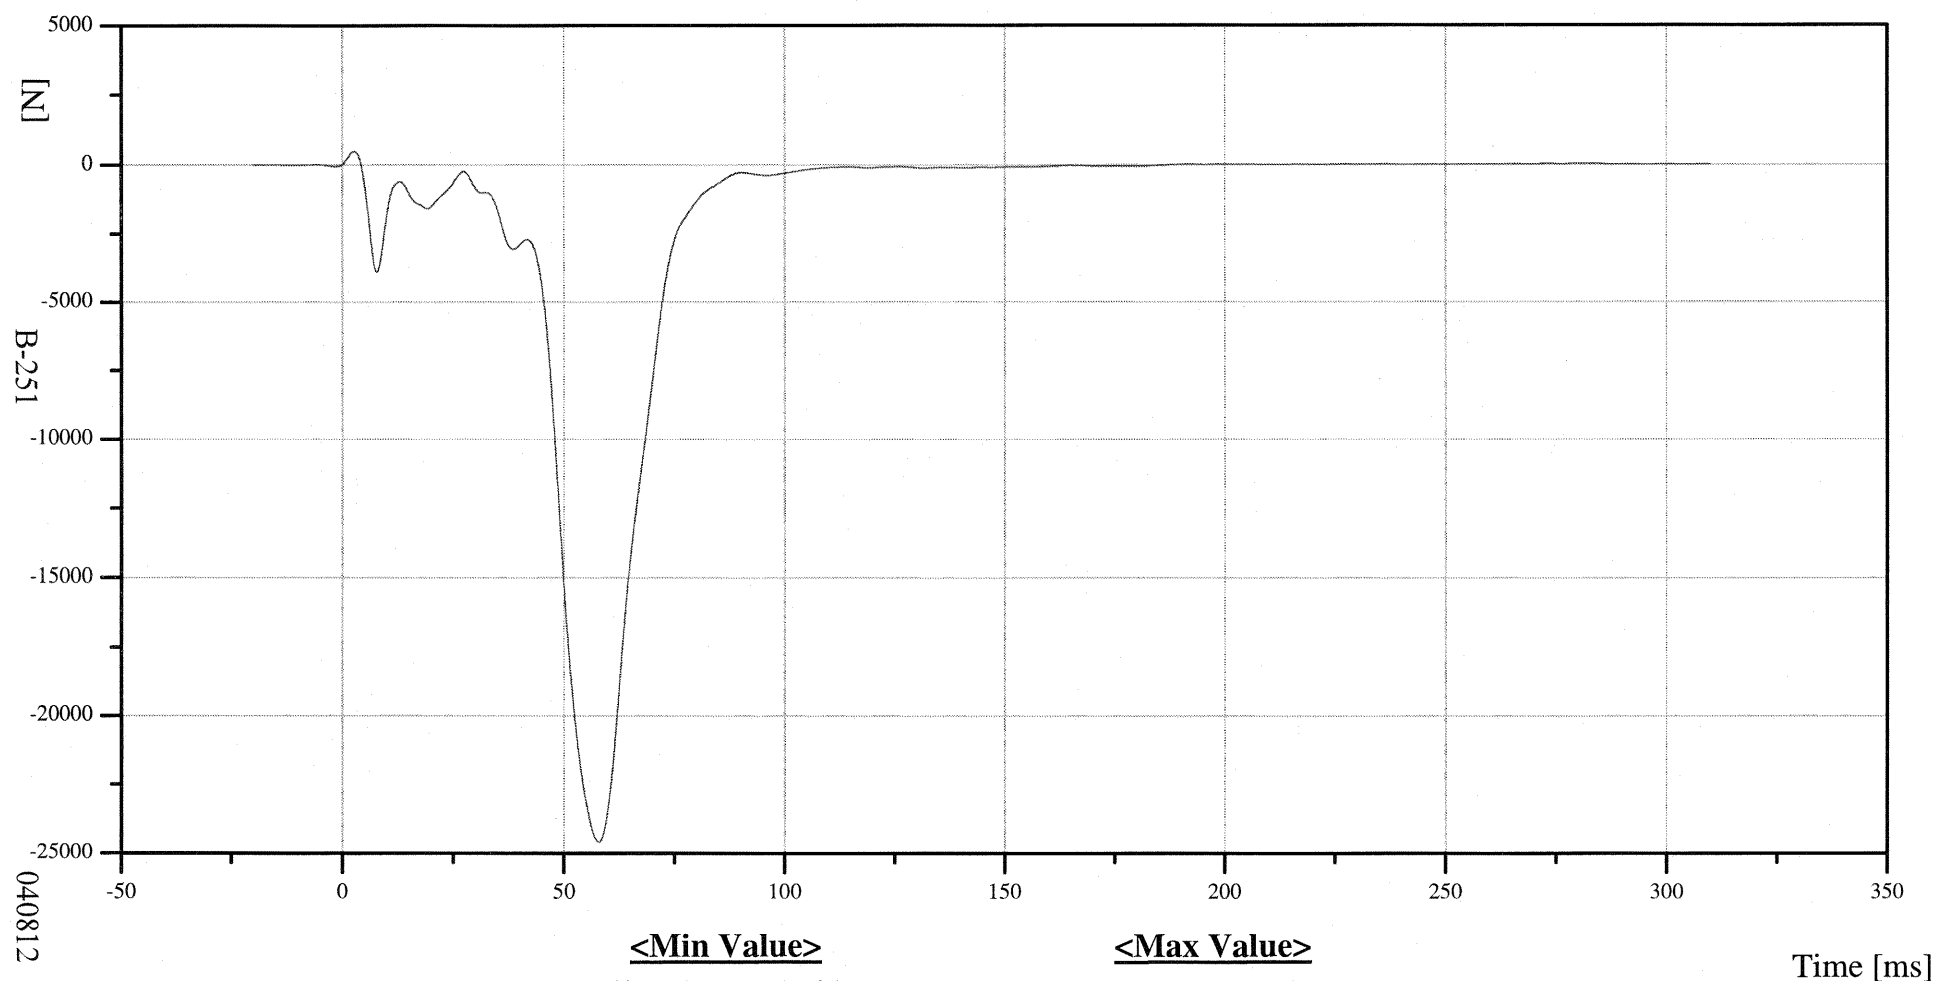

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0709

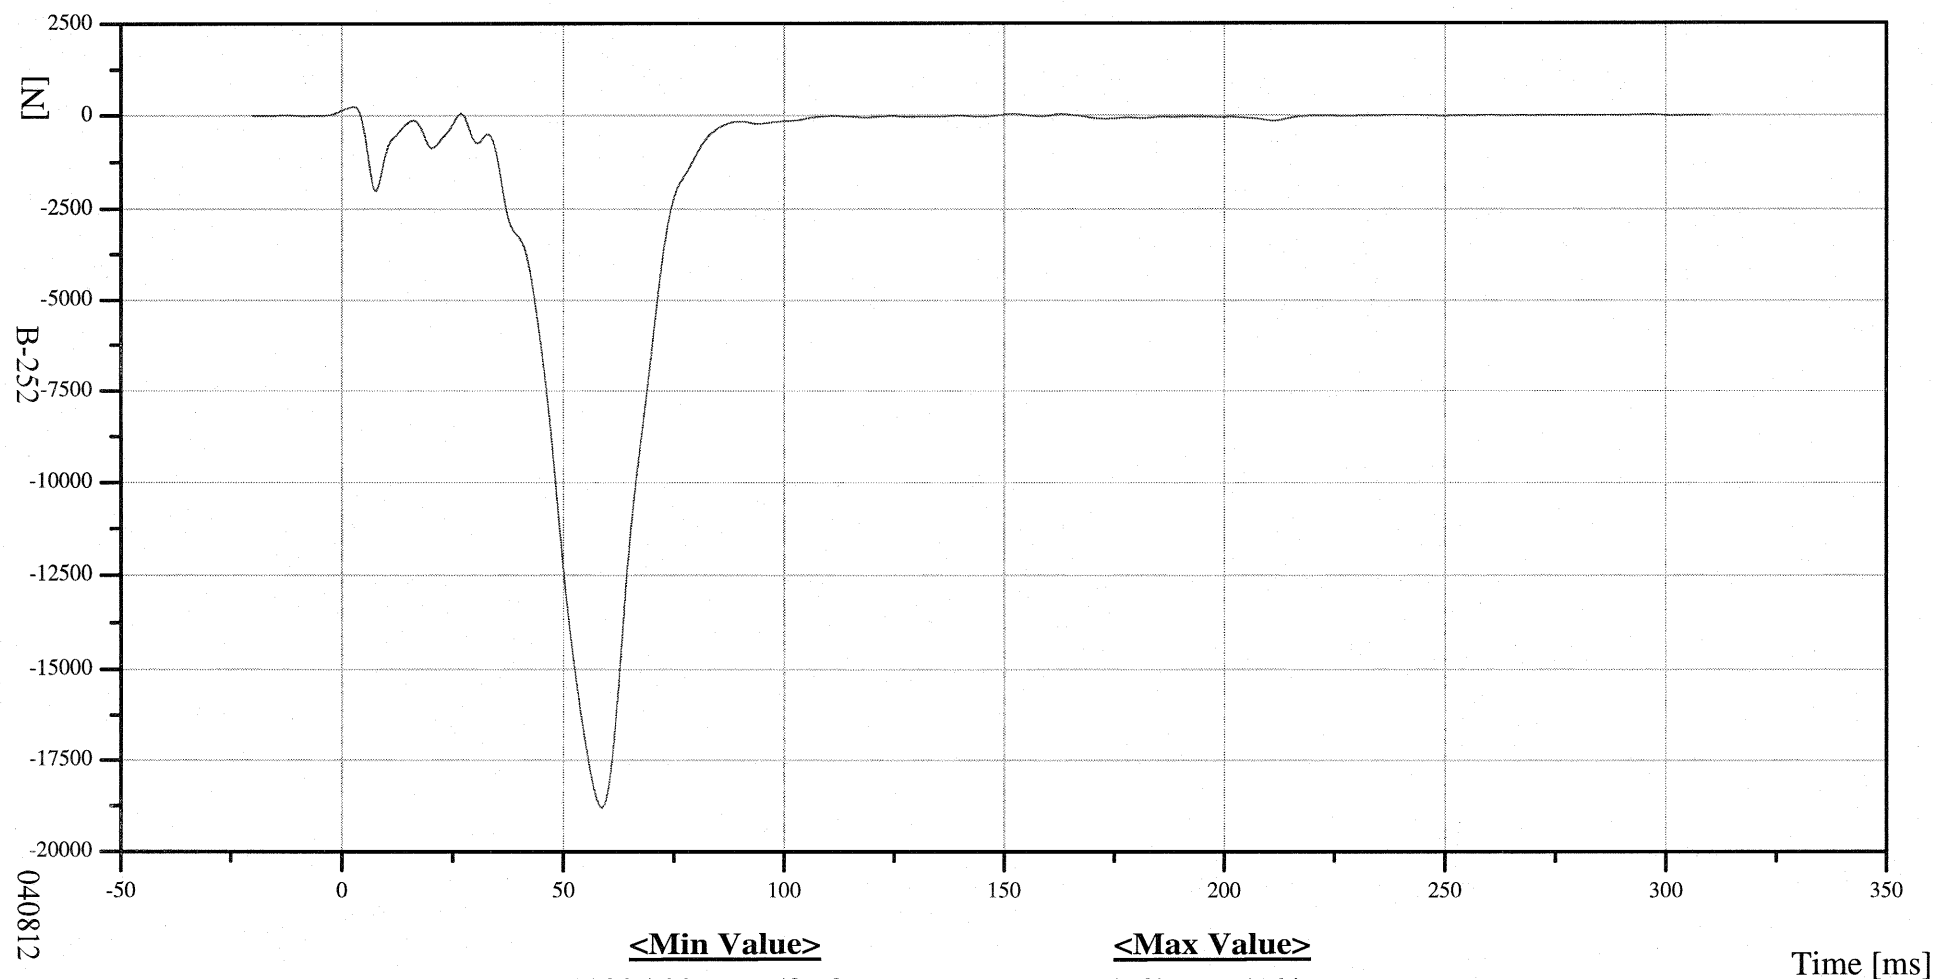

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0710

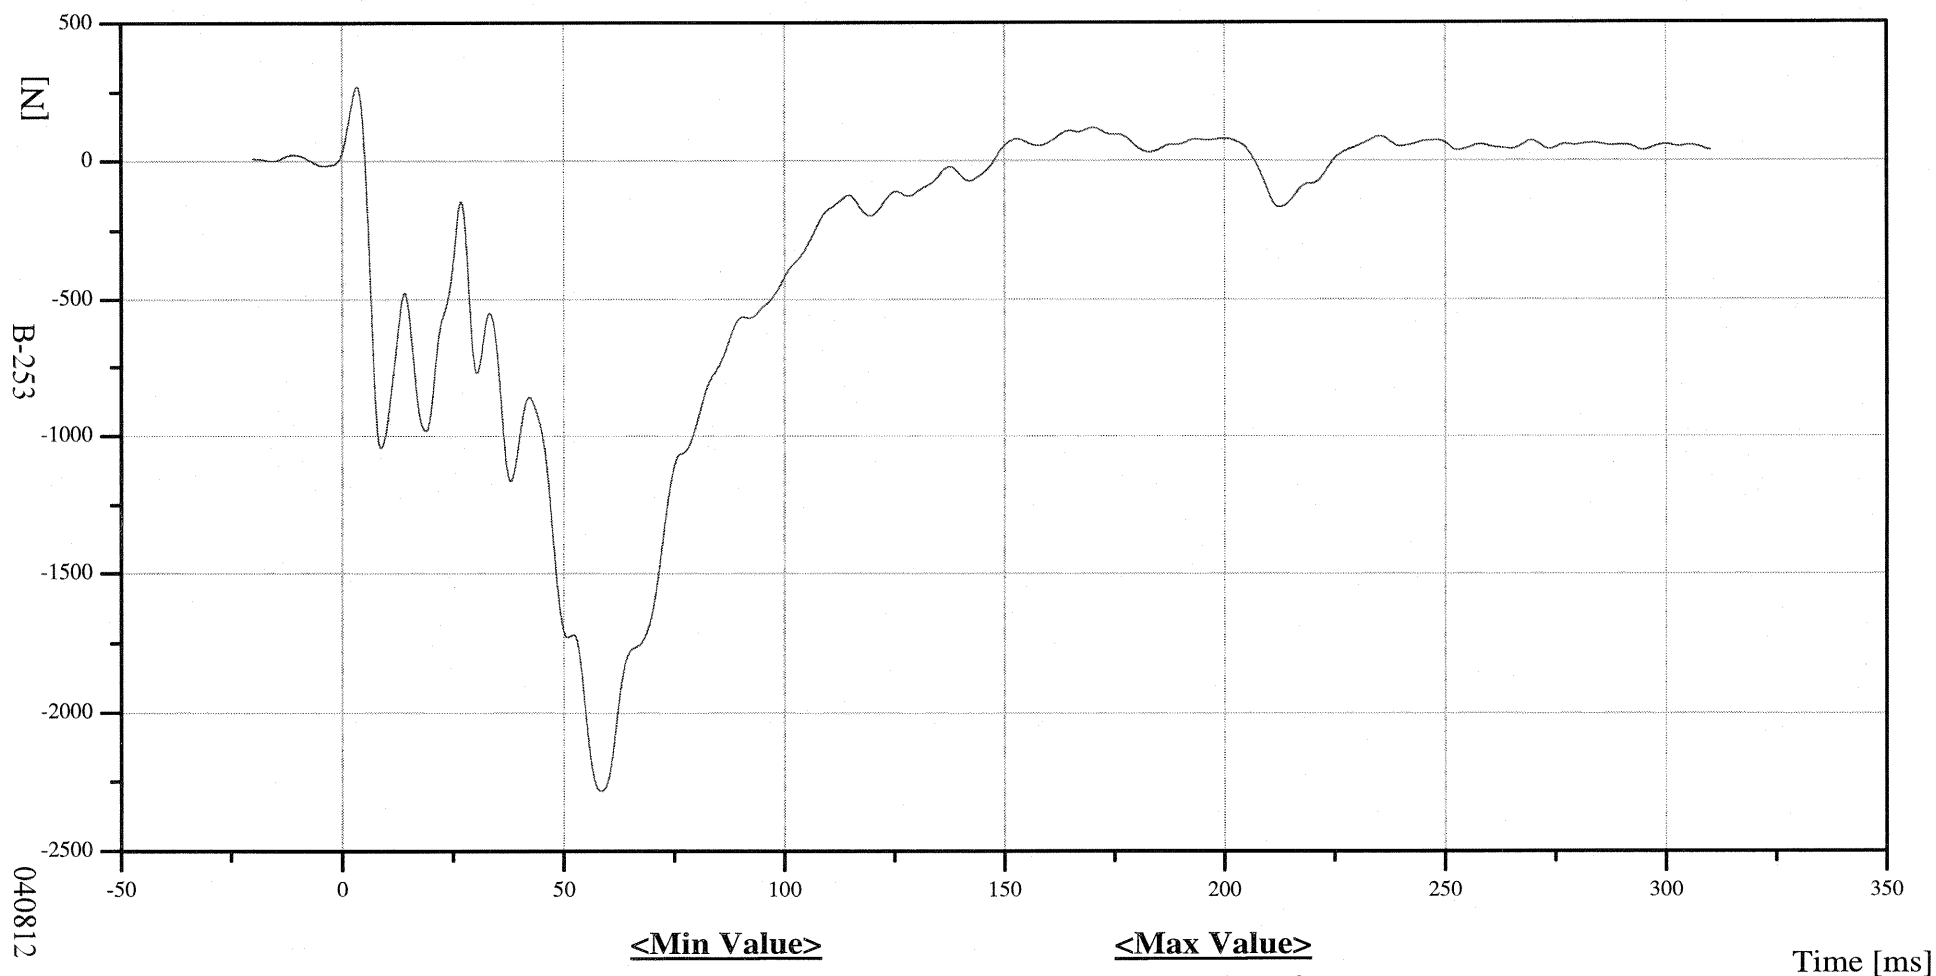

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0711

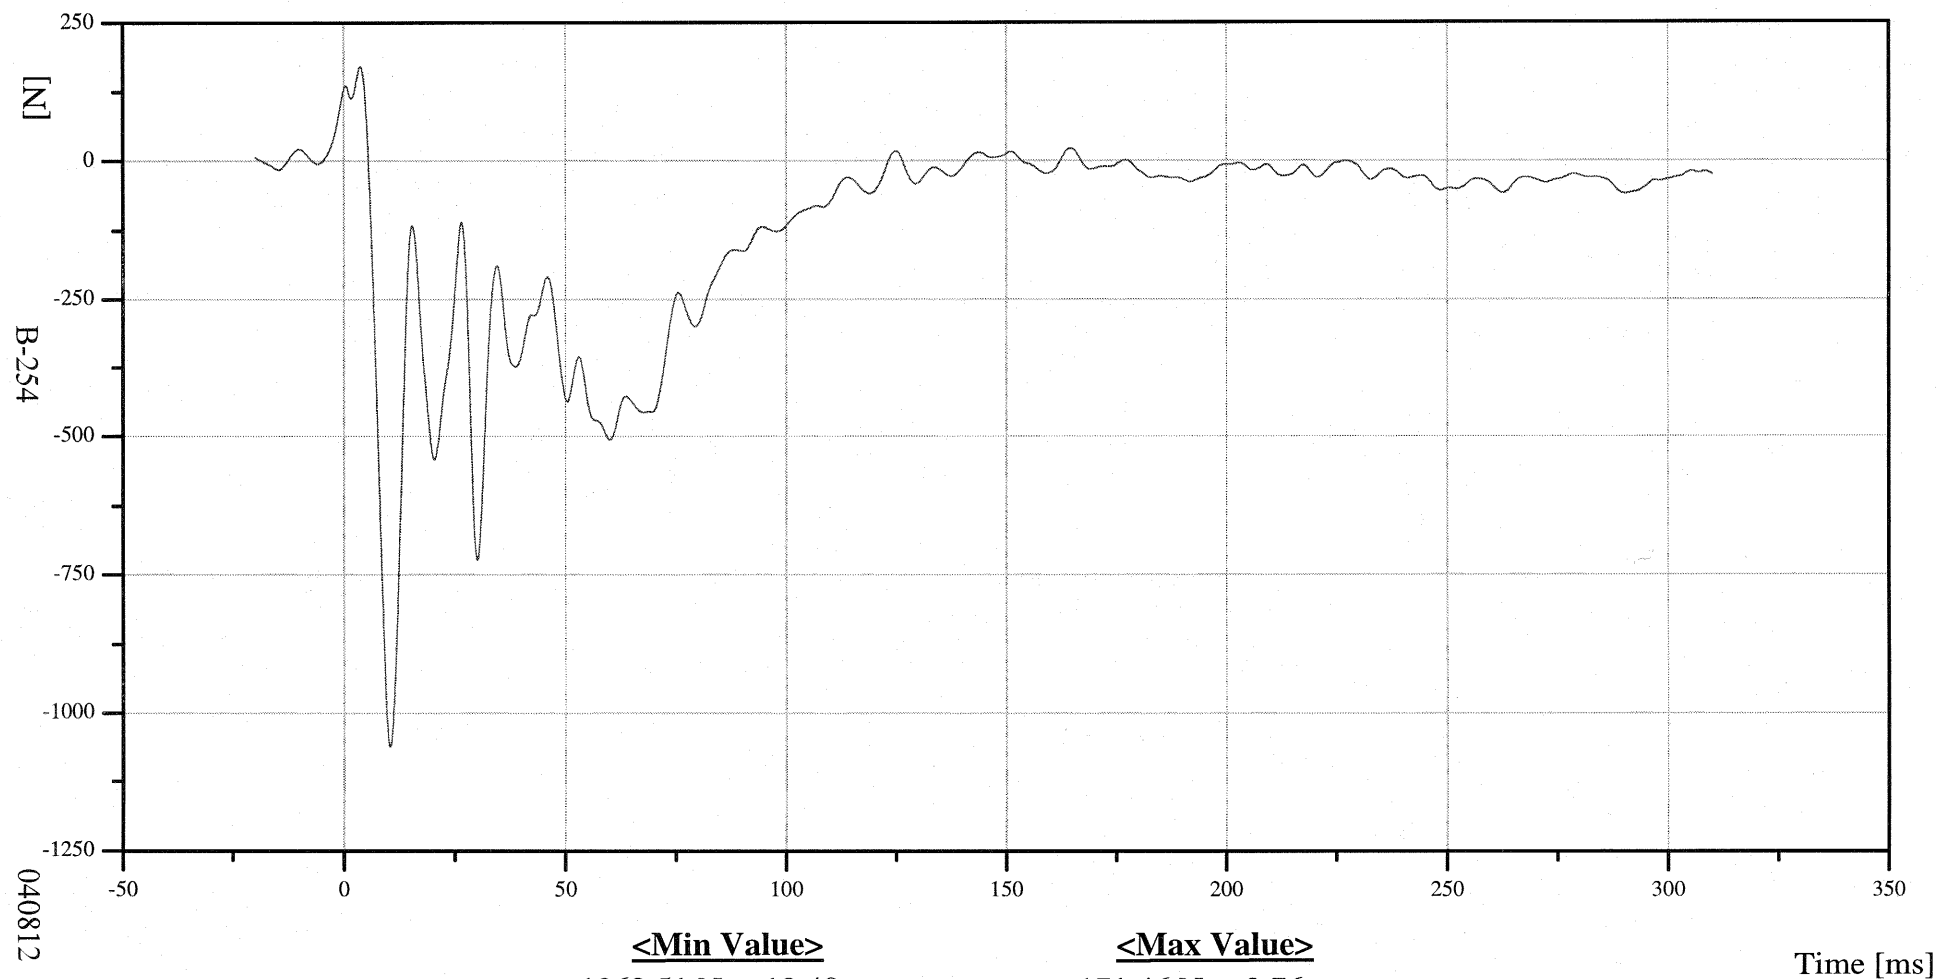

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0712

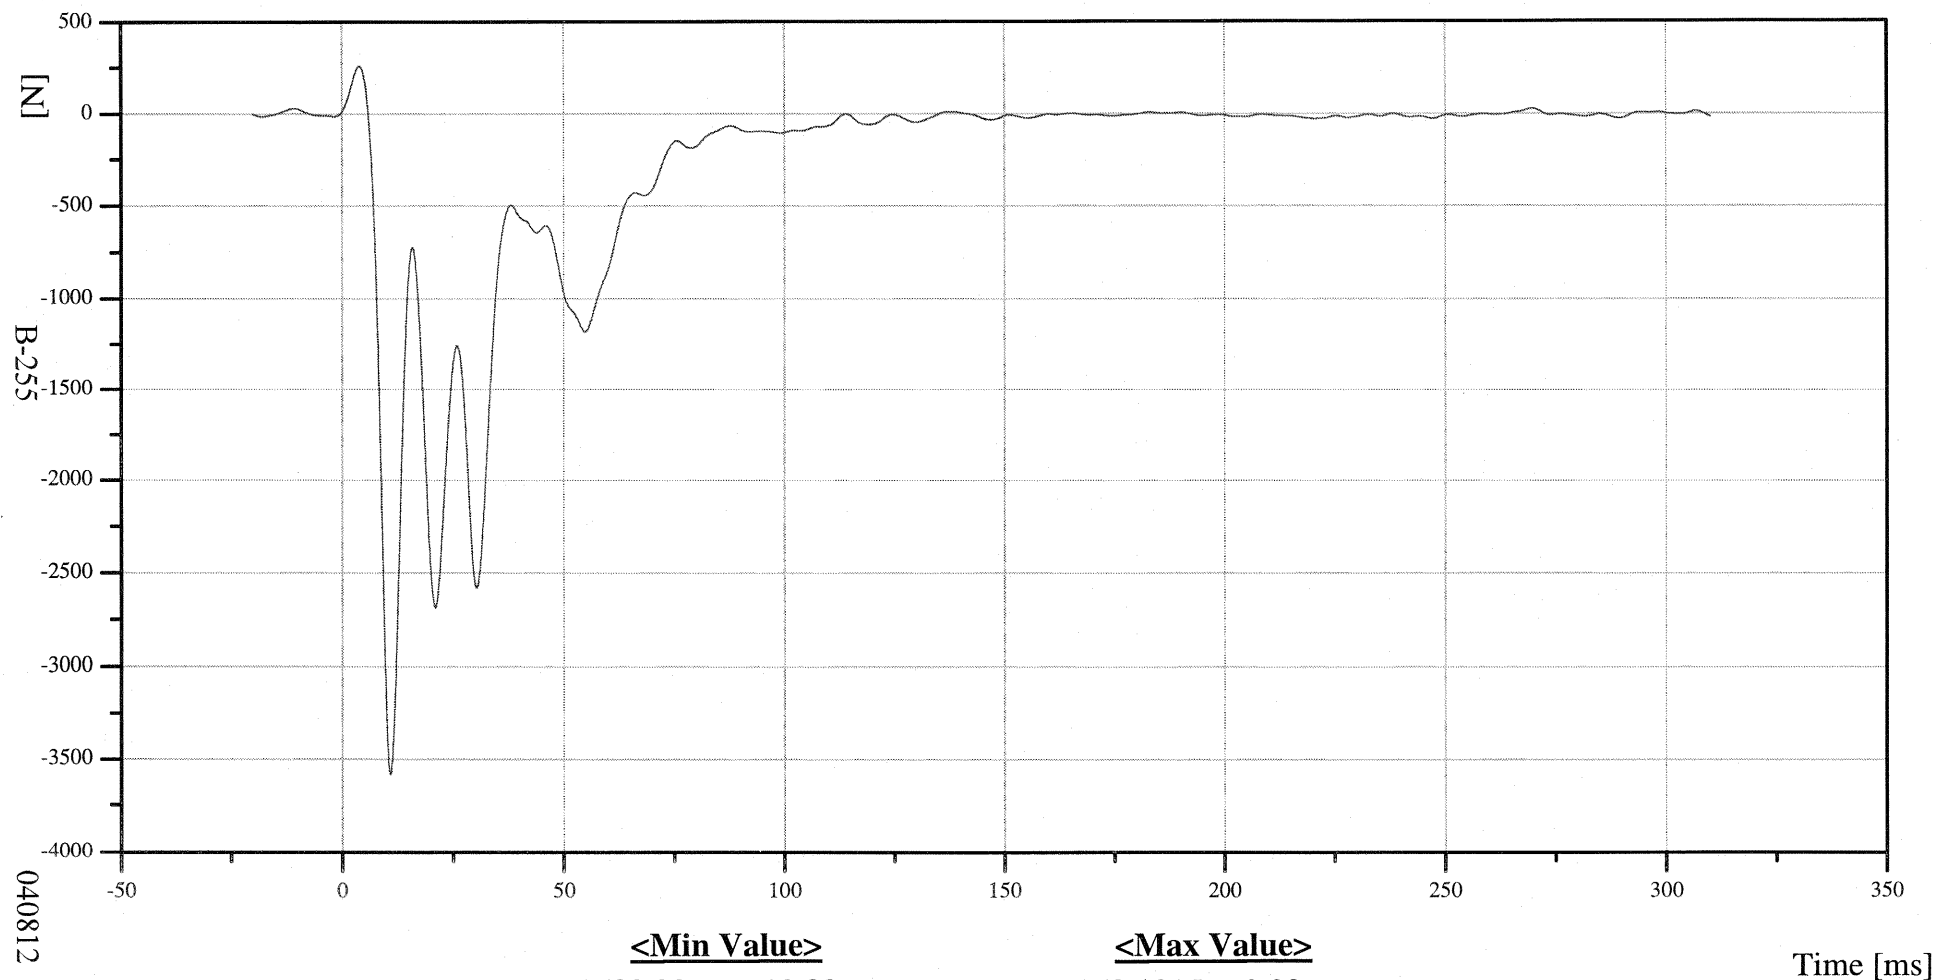

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0713

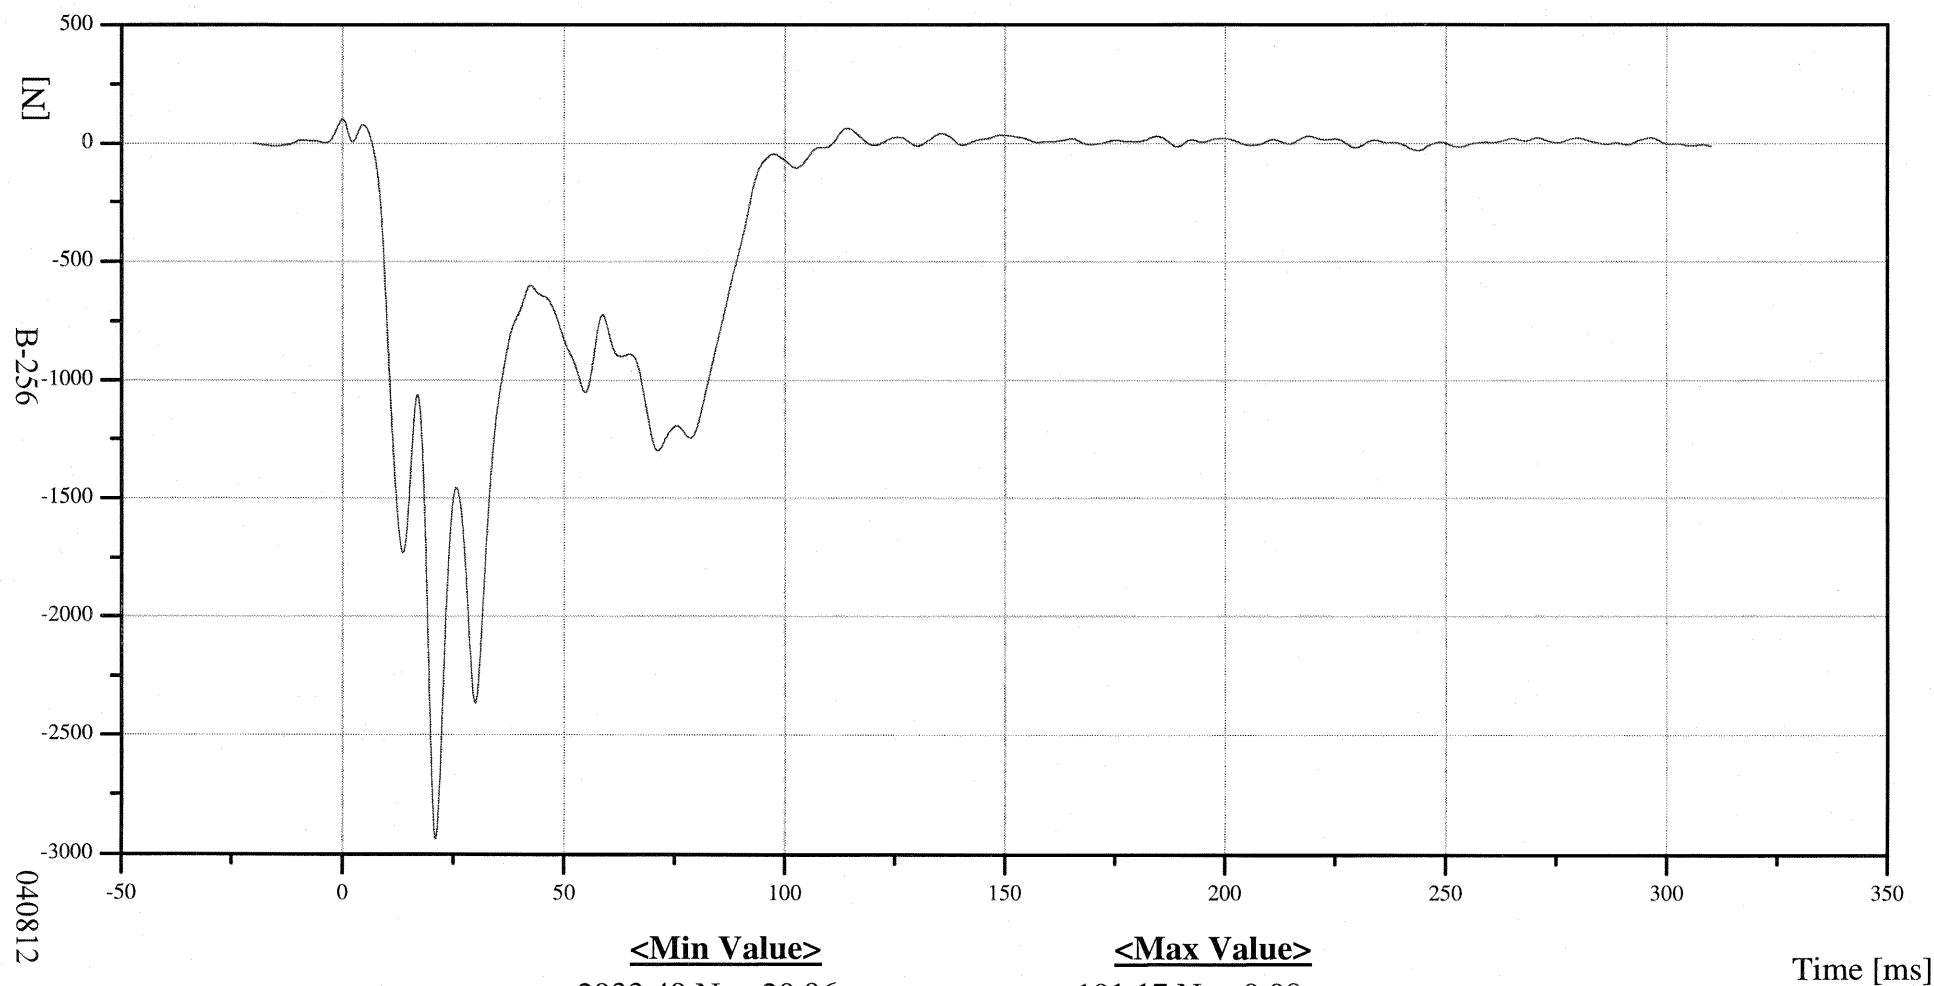

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0714

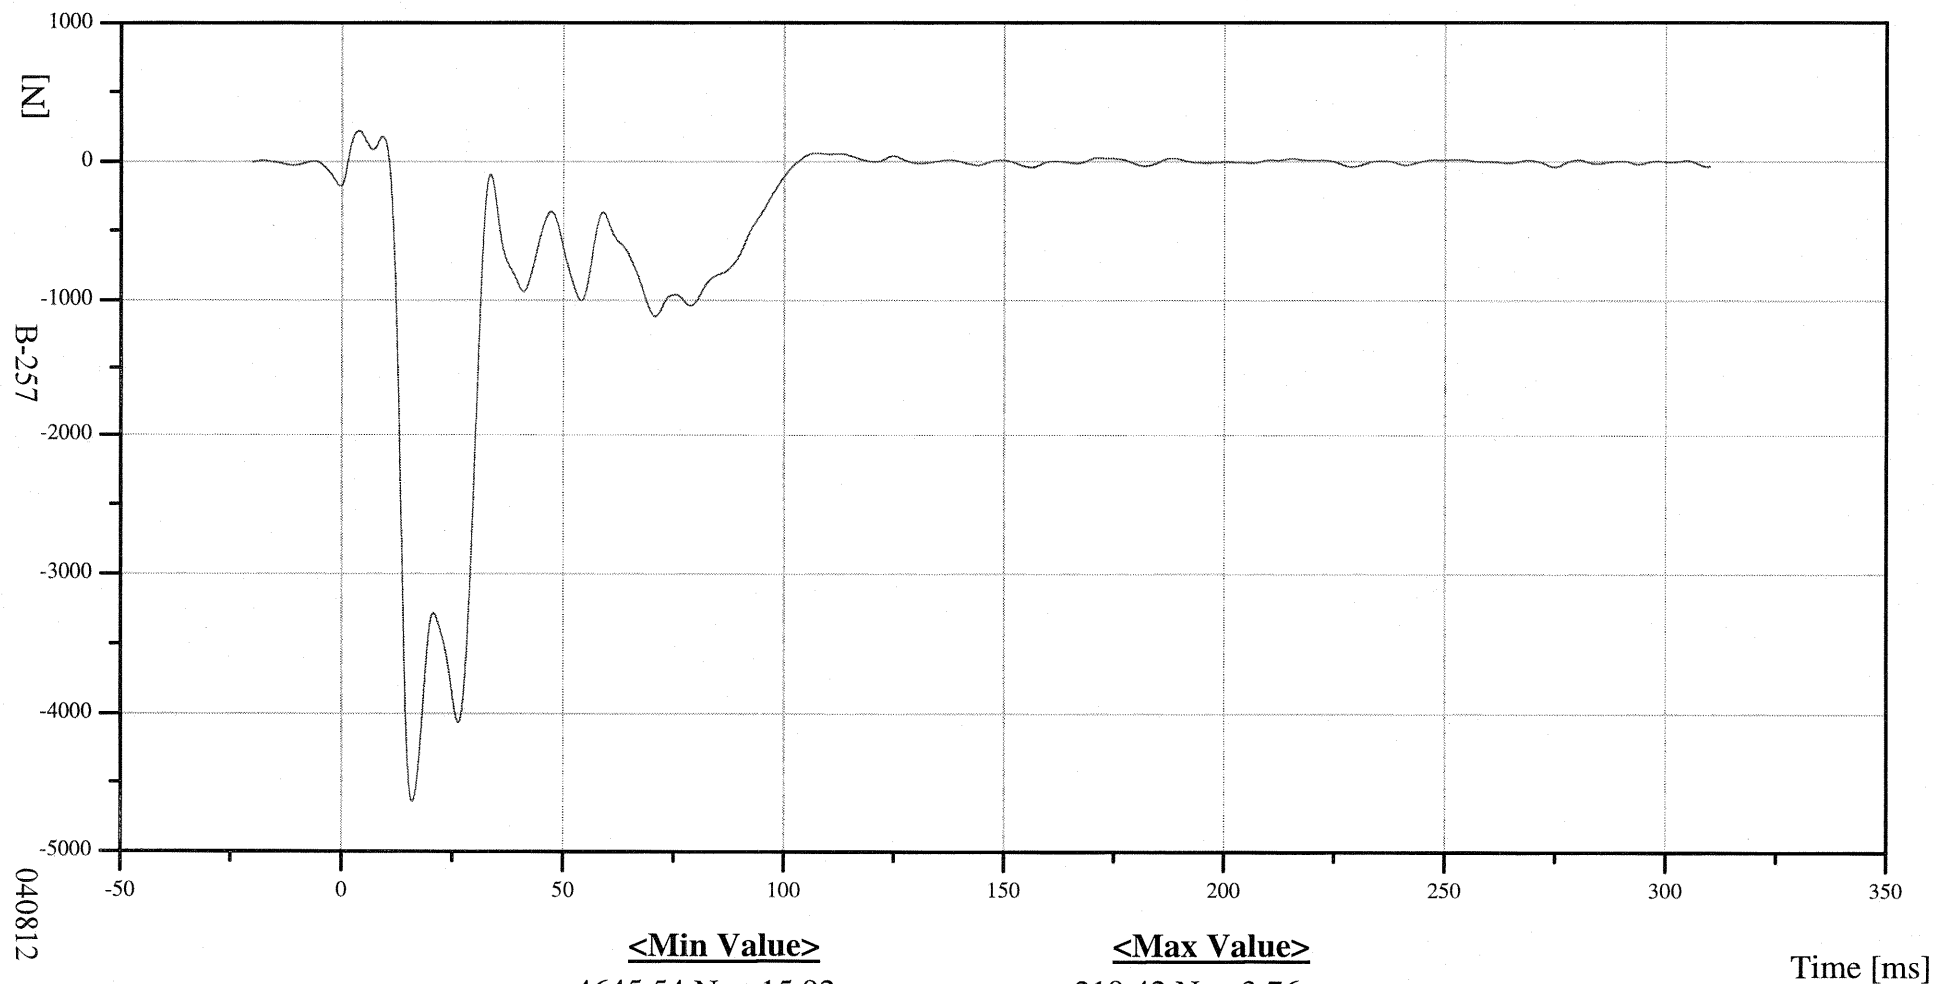

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 7 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0715

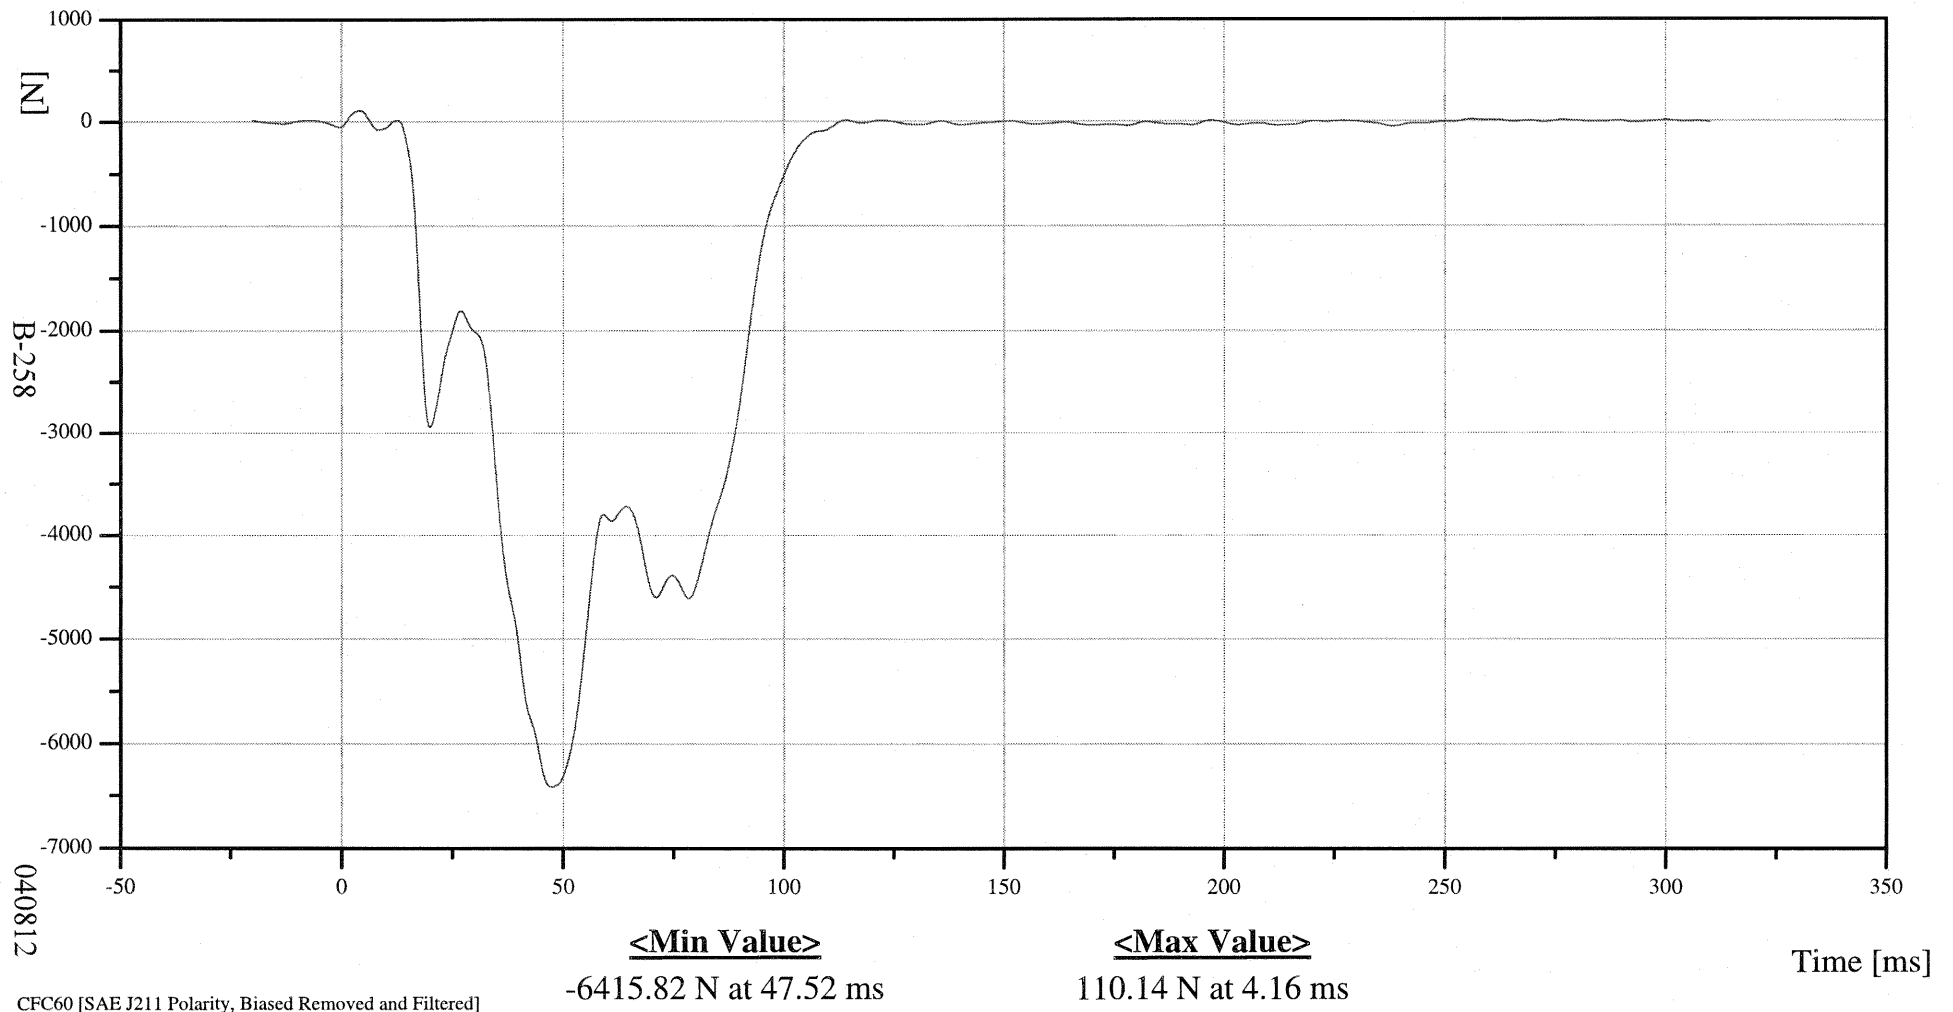



Transportation Research Center, Inc.

ROW 7 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0716

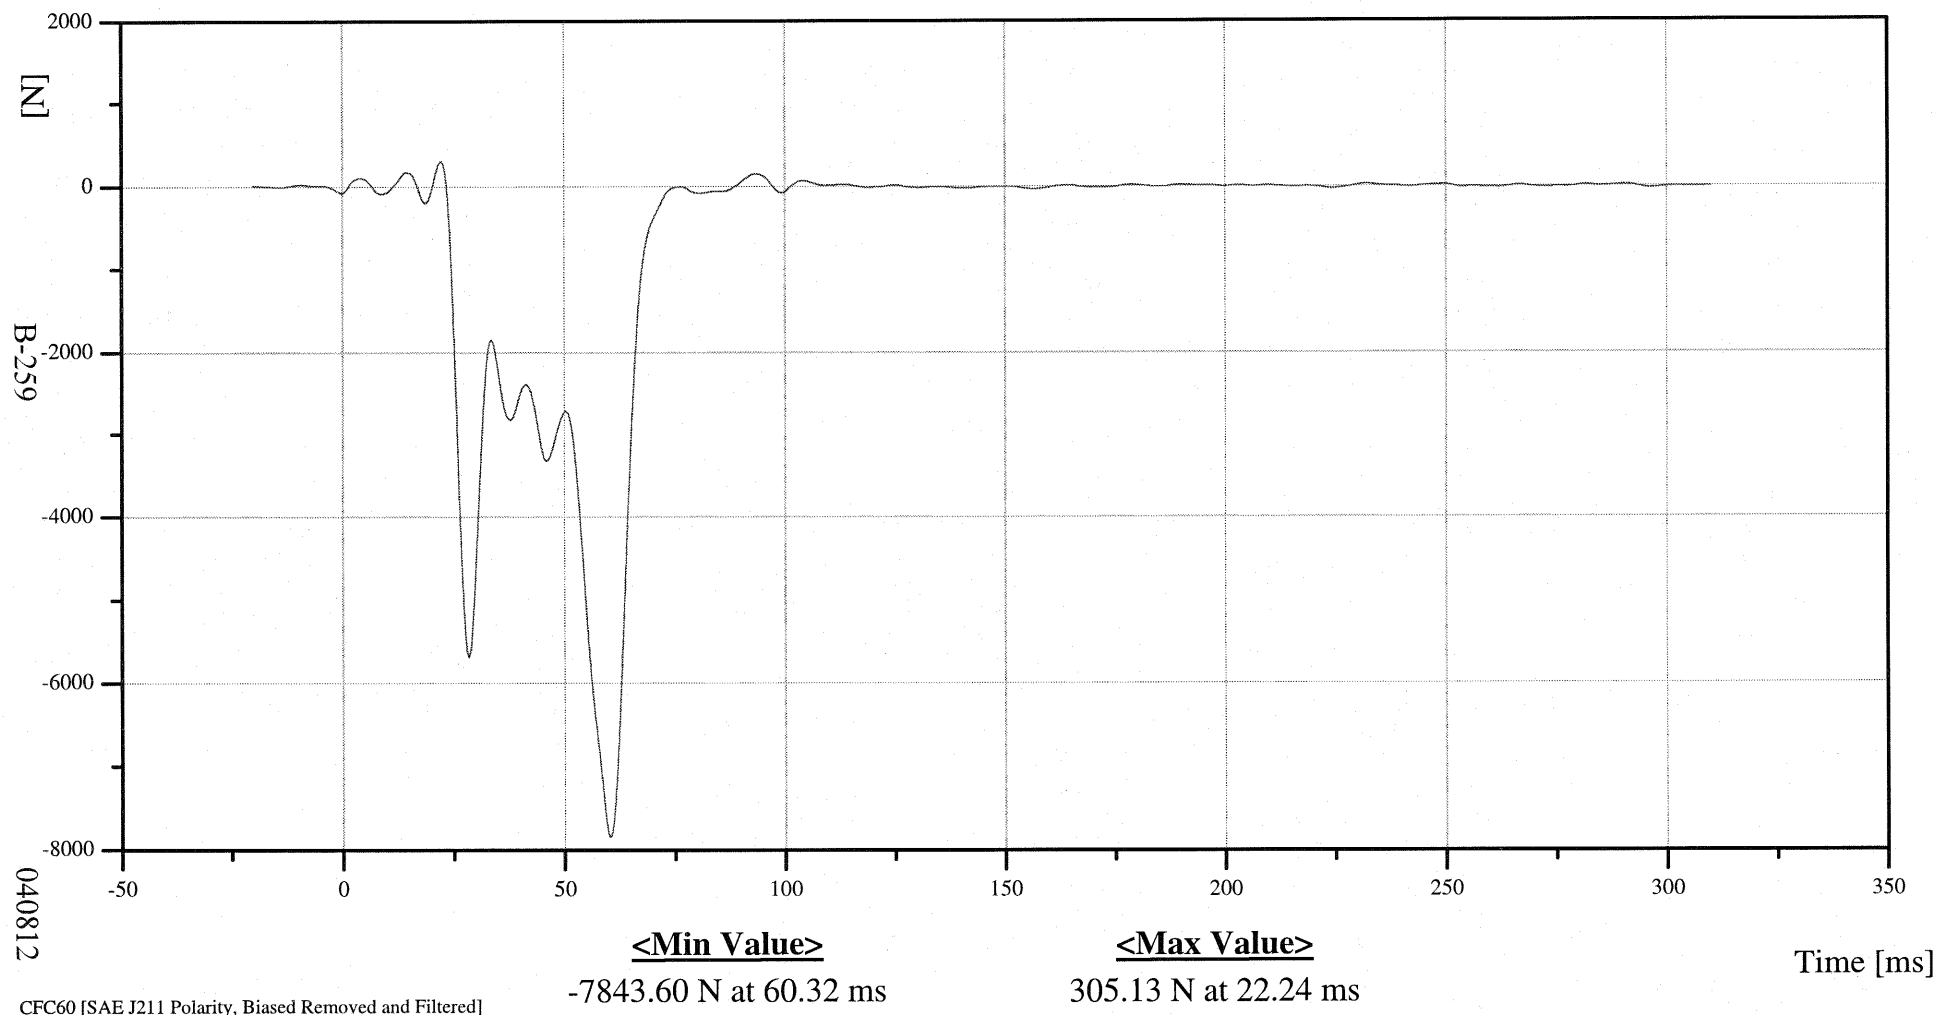



Transportation Research Center, Inc.

ROW 8 COLUMN 1

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0801

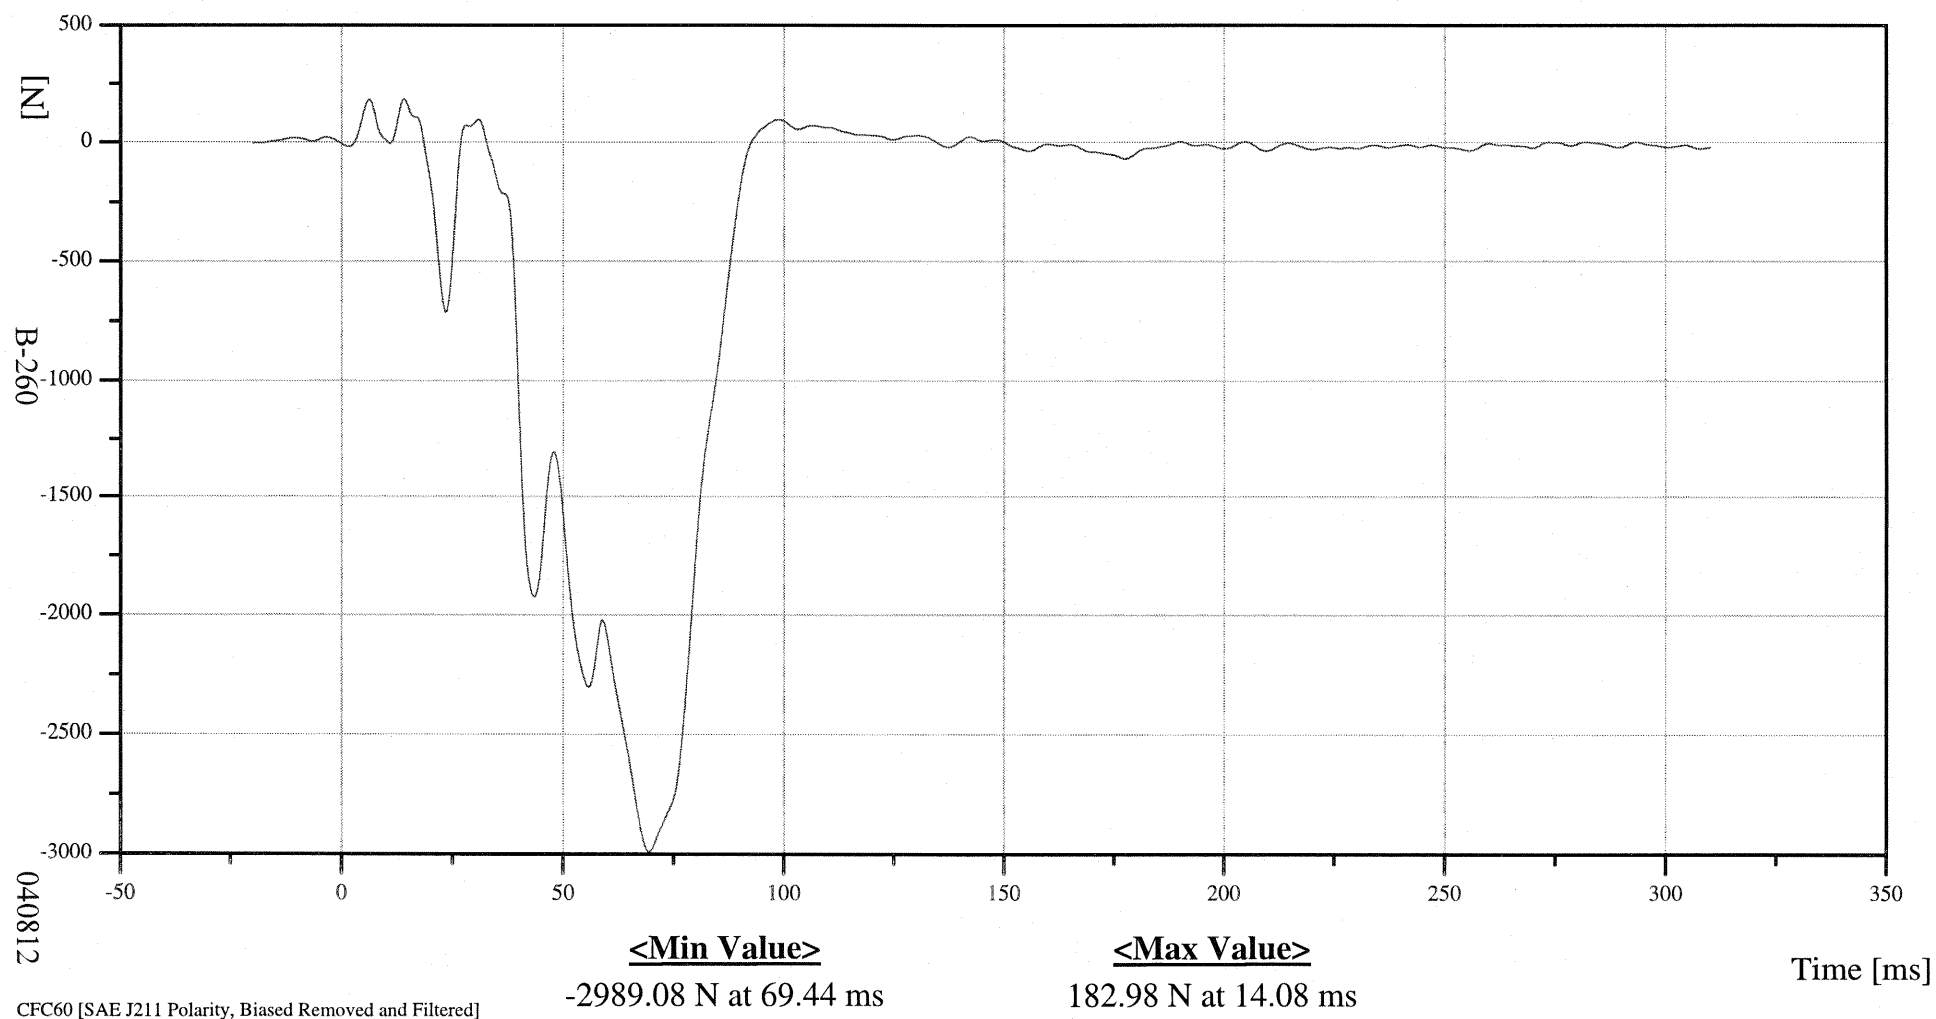



Transportation Research Center, Inc.

ROW 8 COLUMN 2

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0802

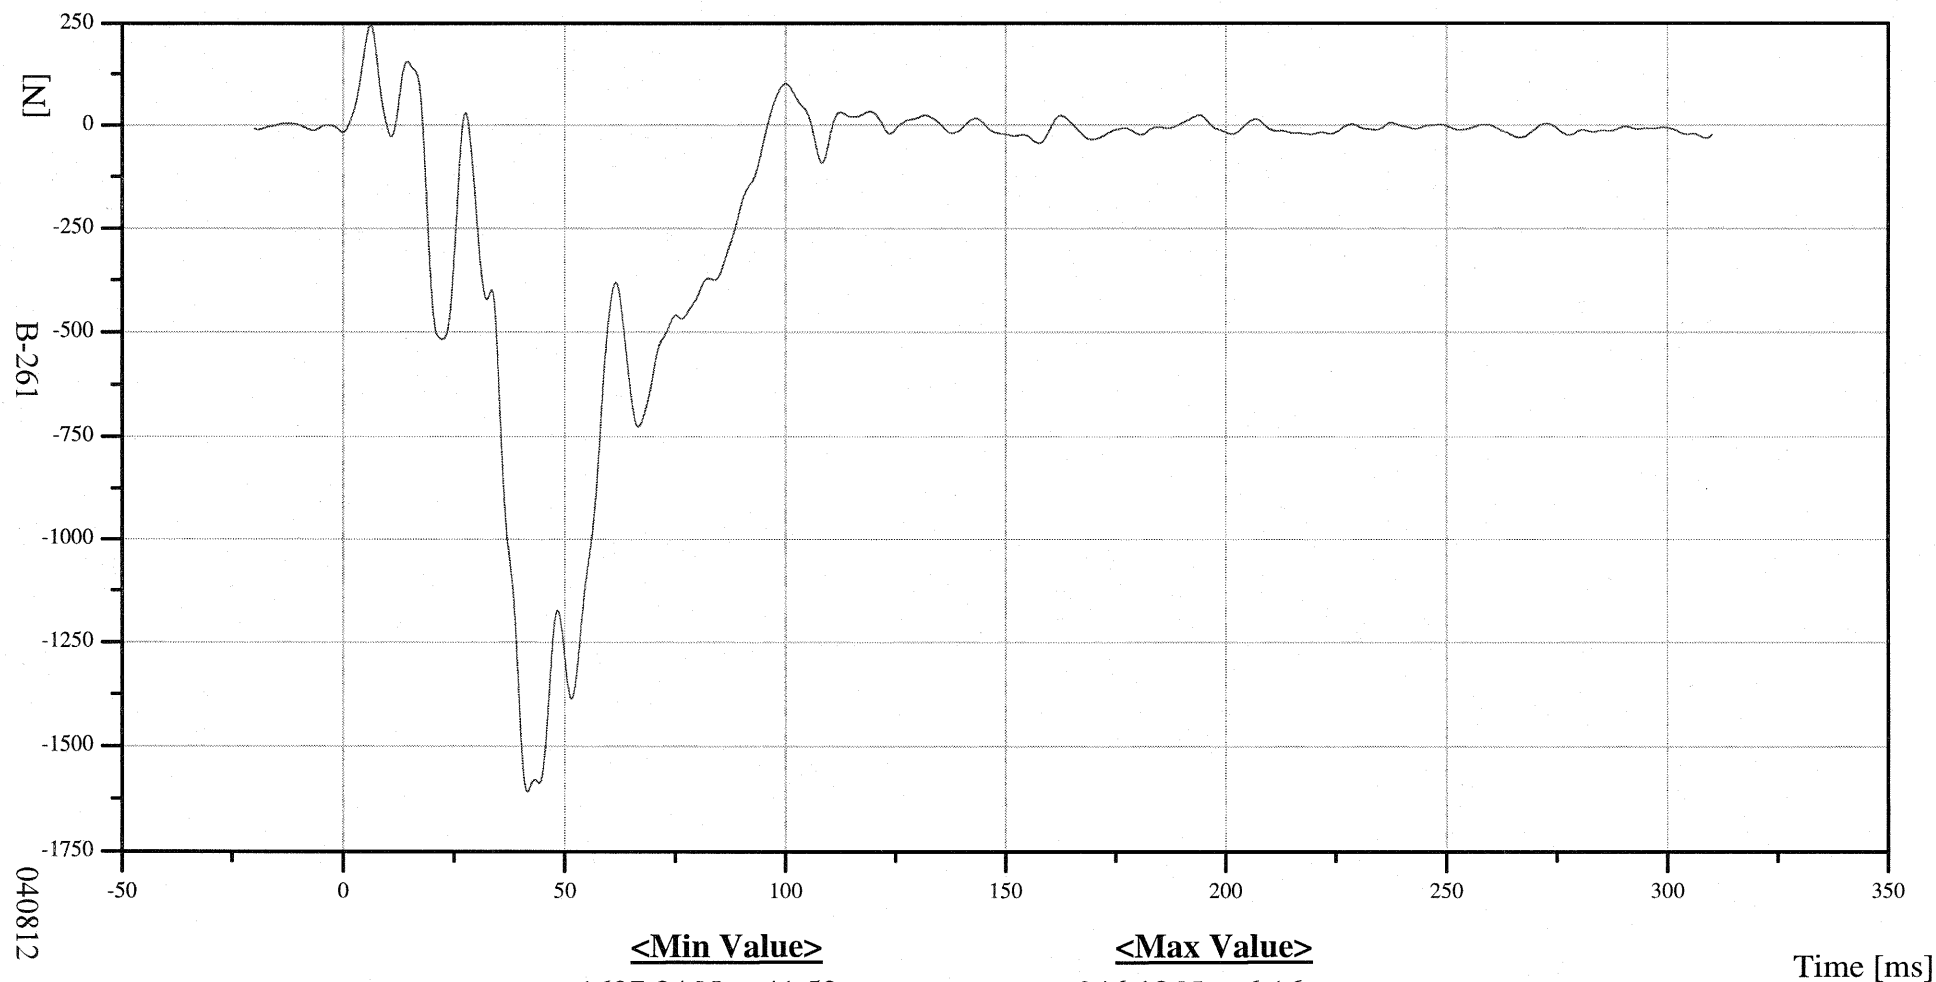

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 3

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0803

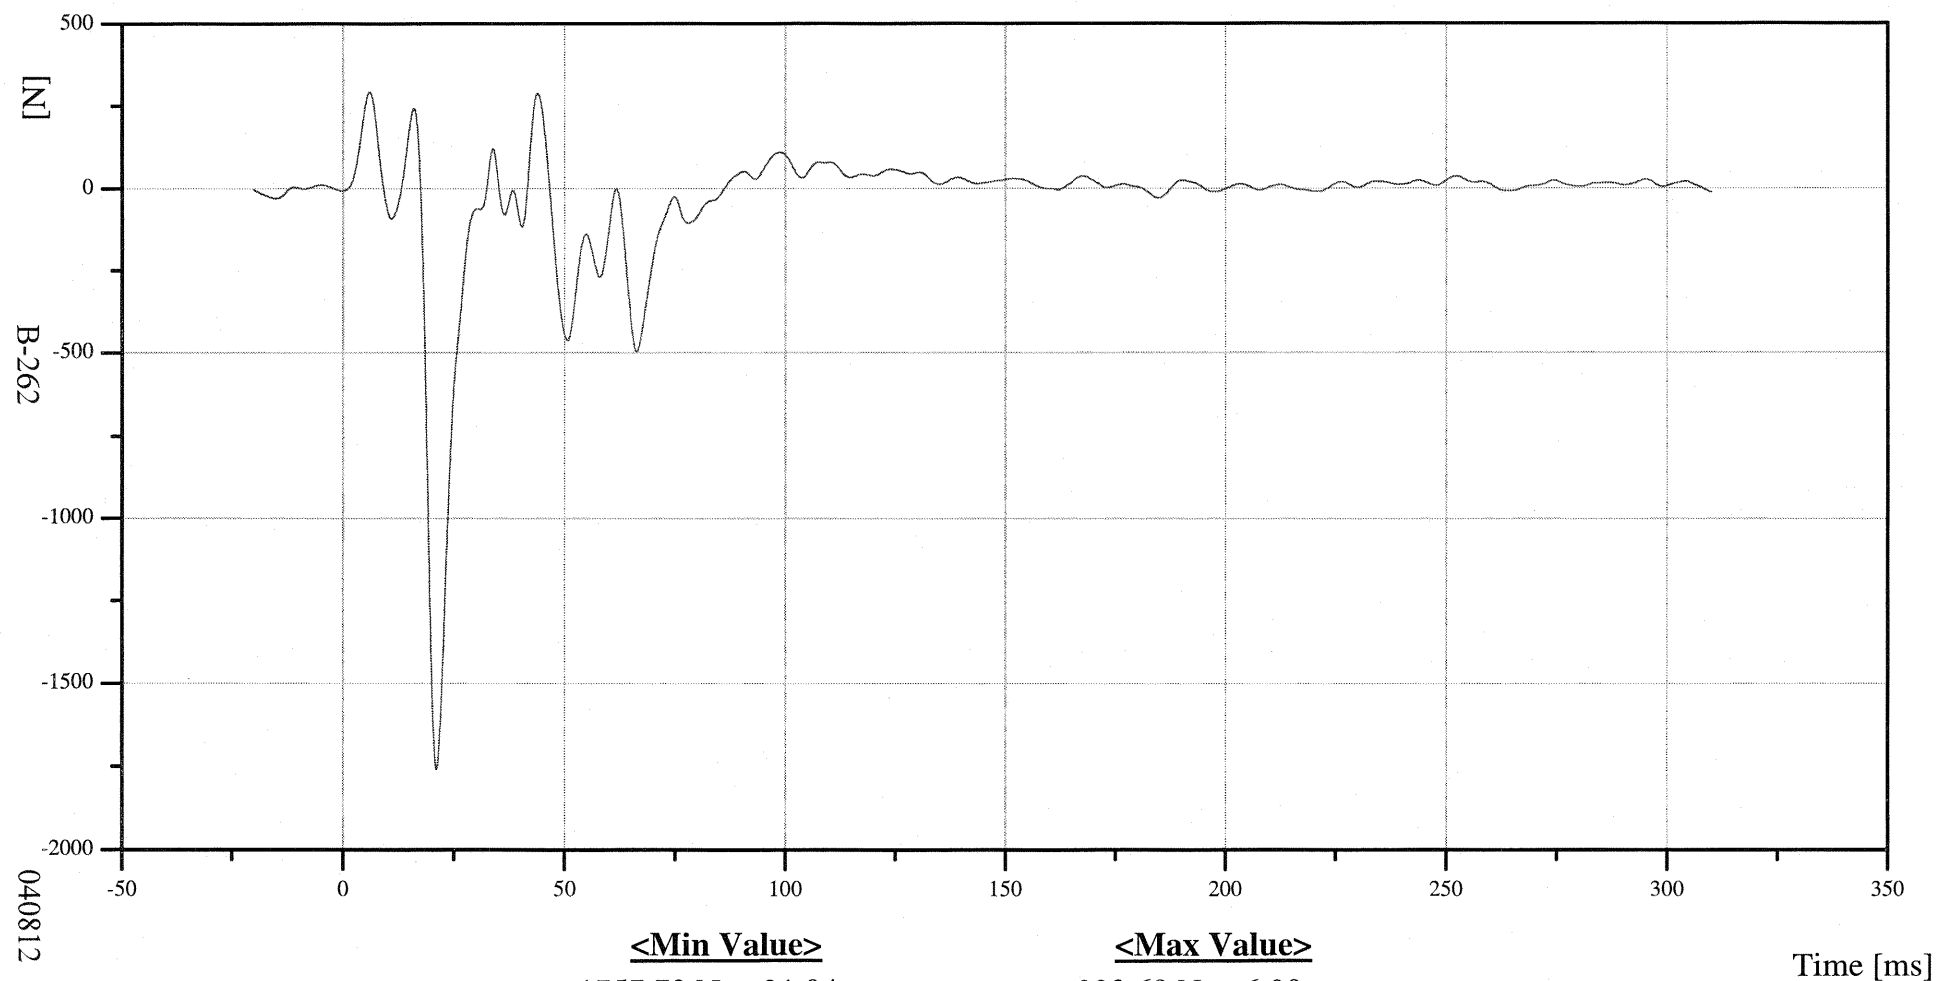

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 4

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0804

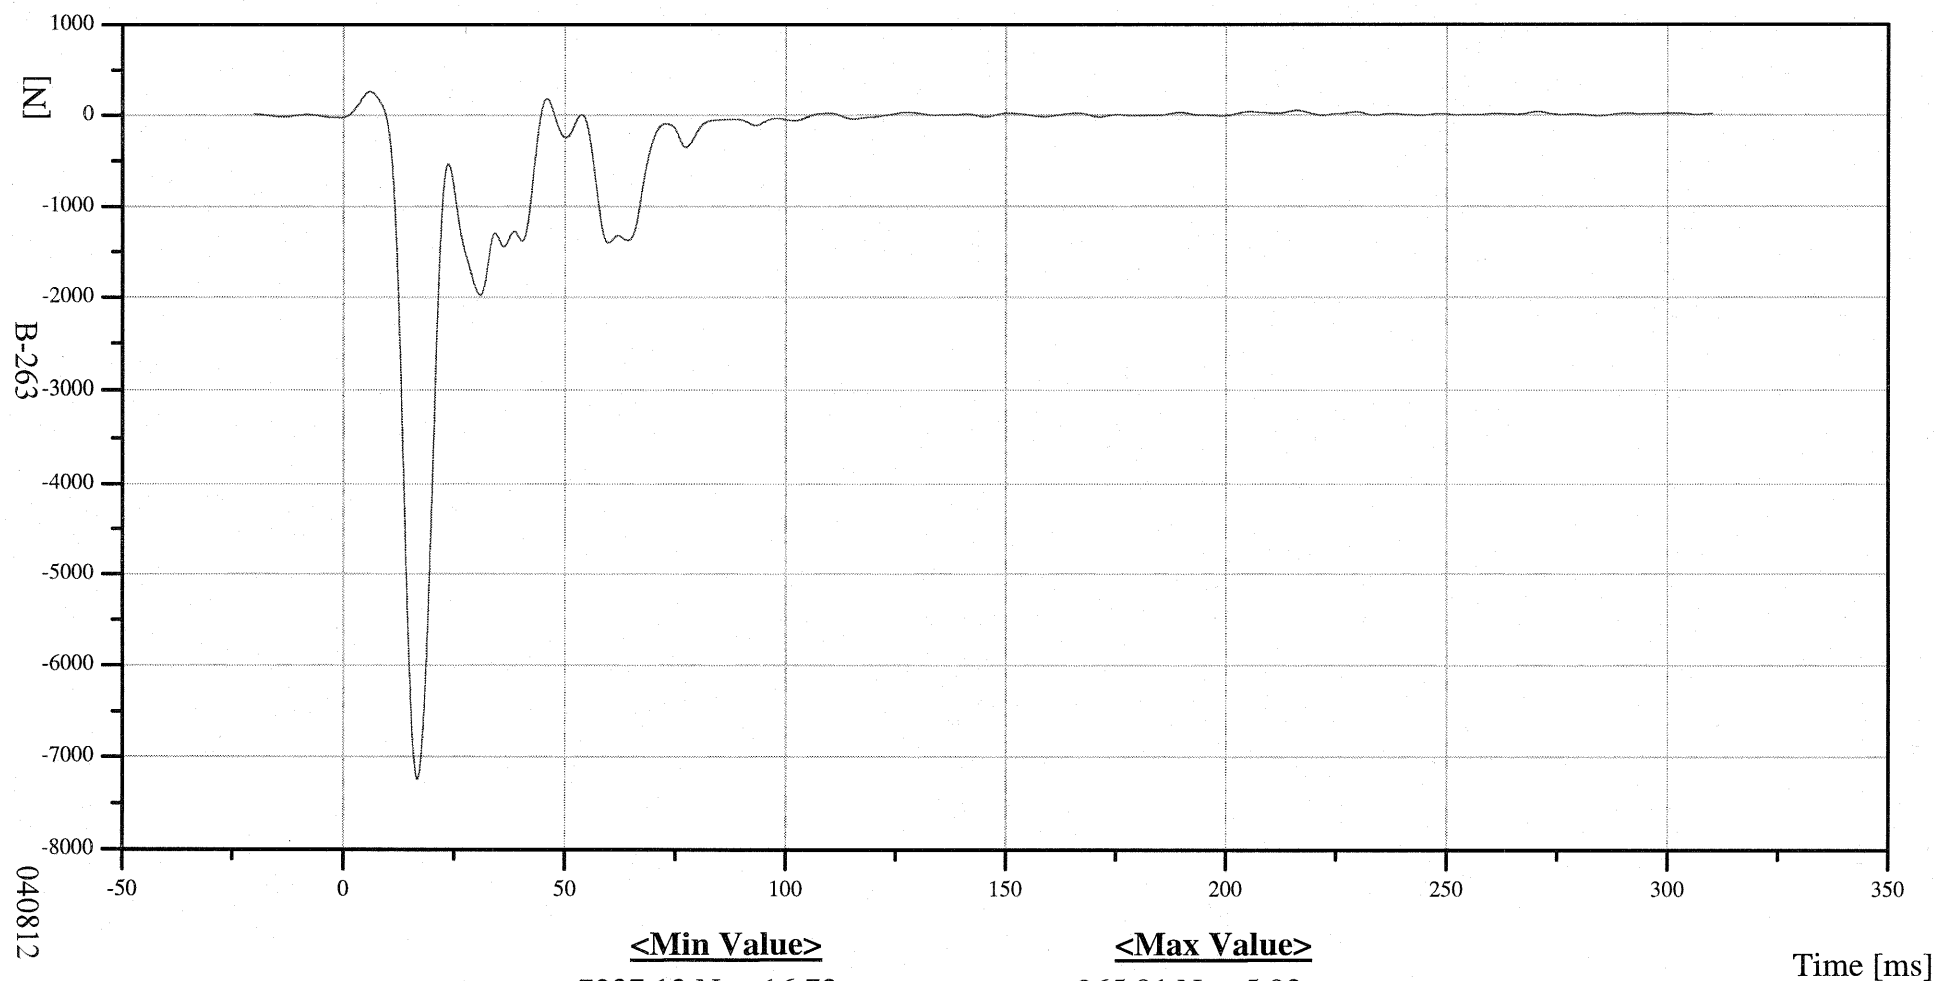

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 5

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0805

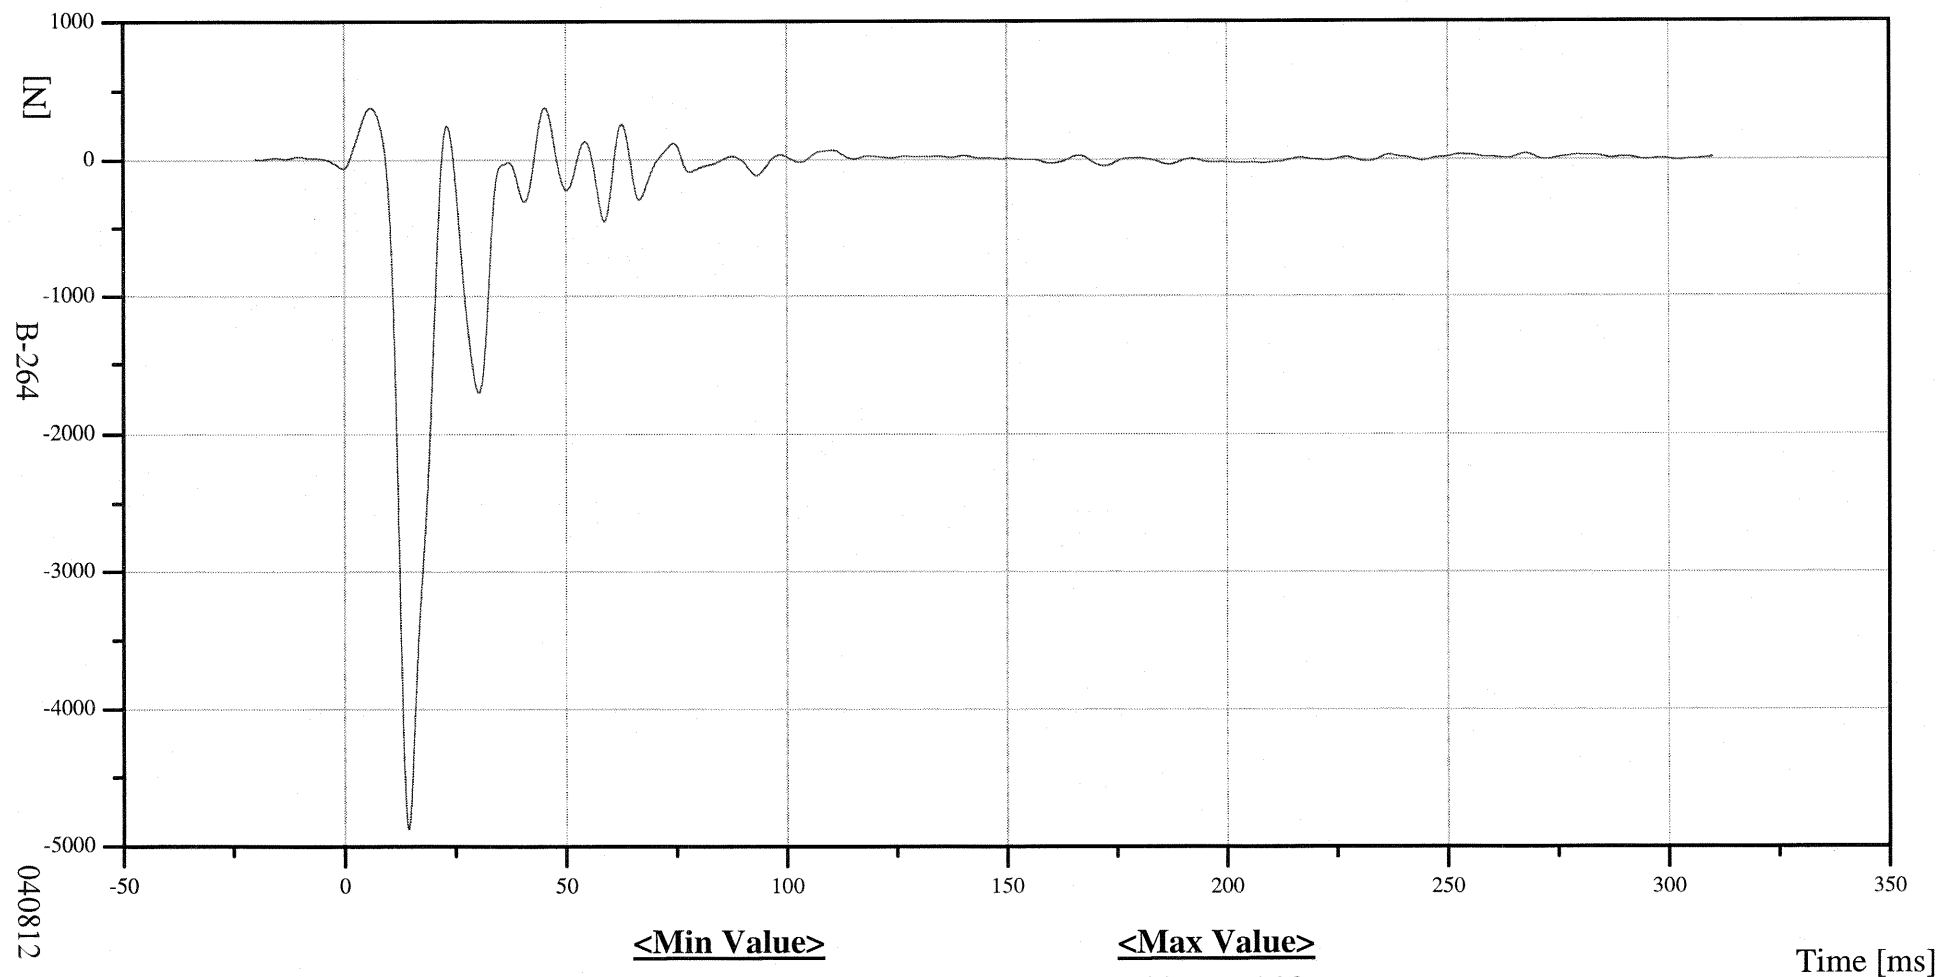

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0806

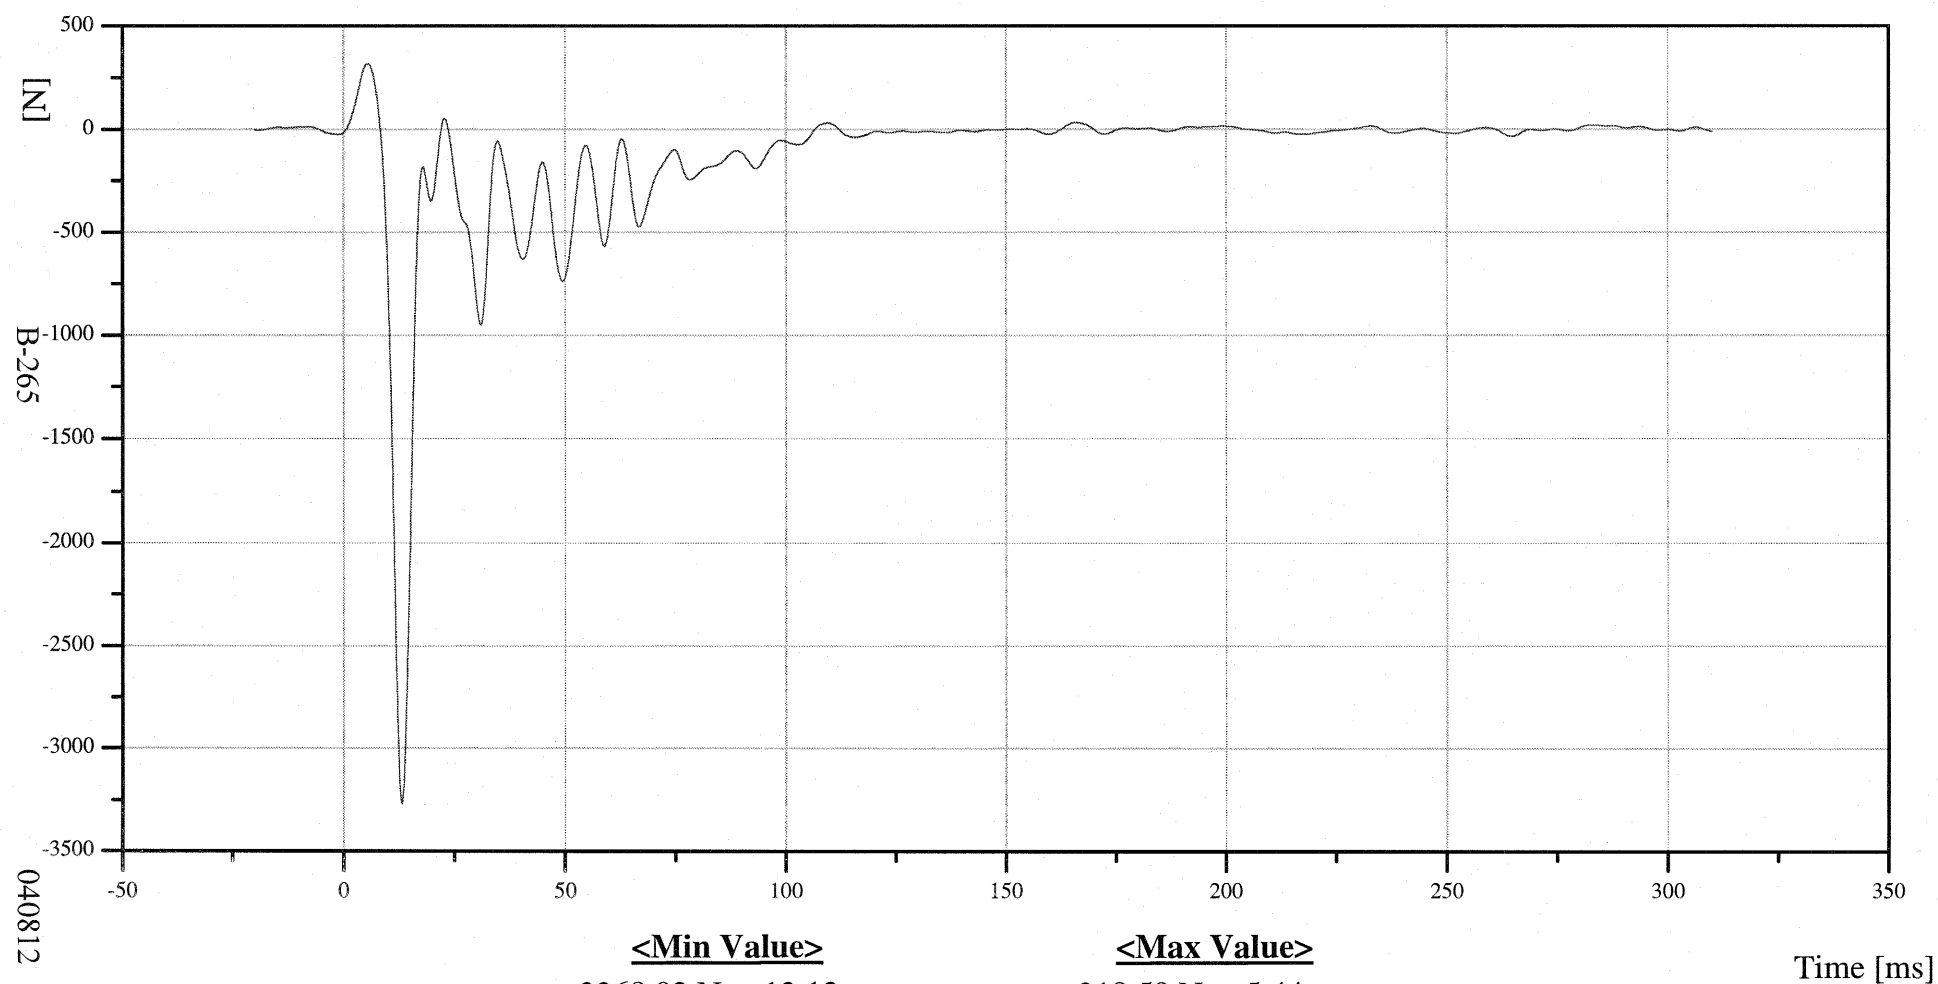

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0807

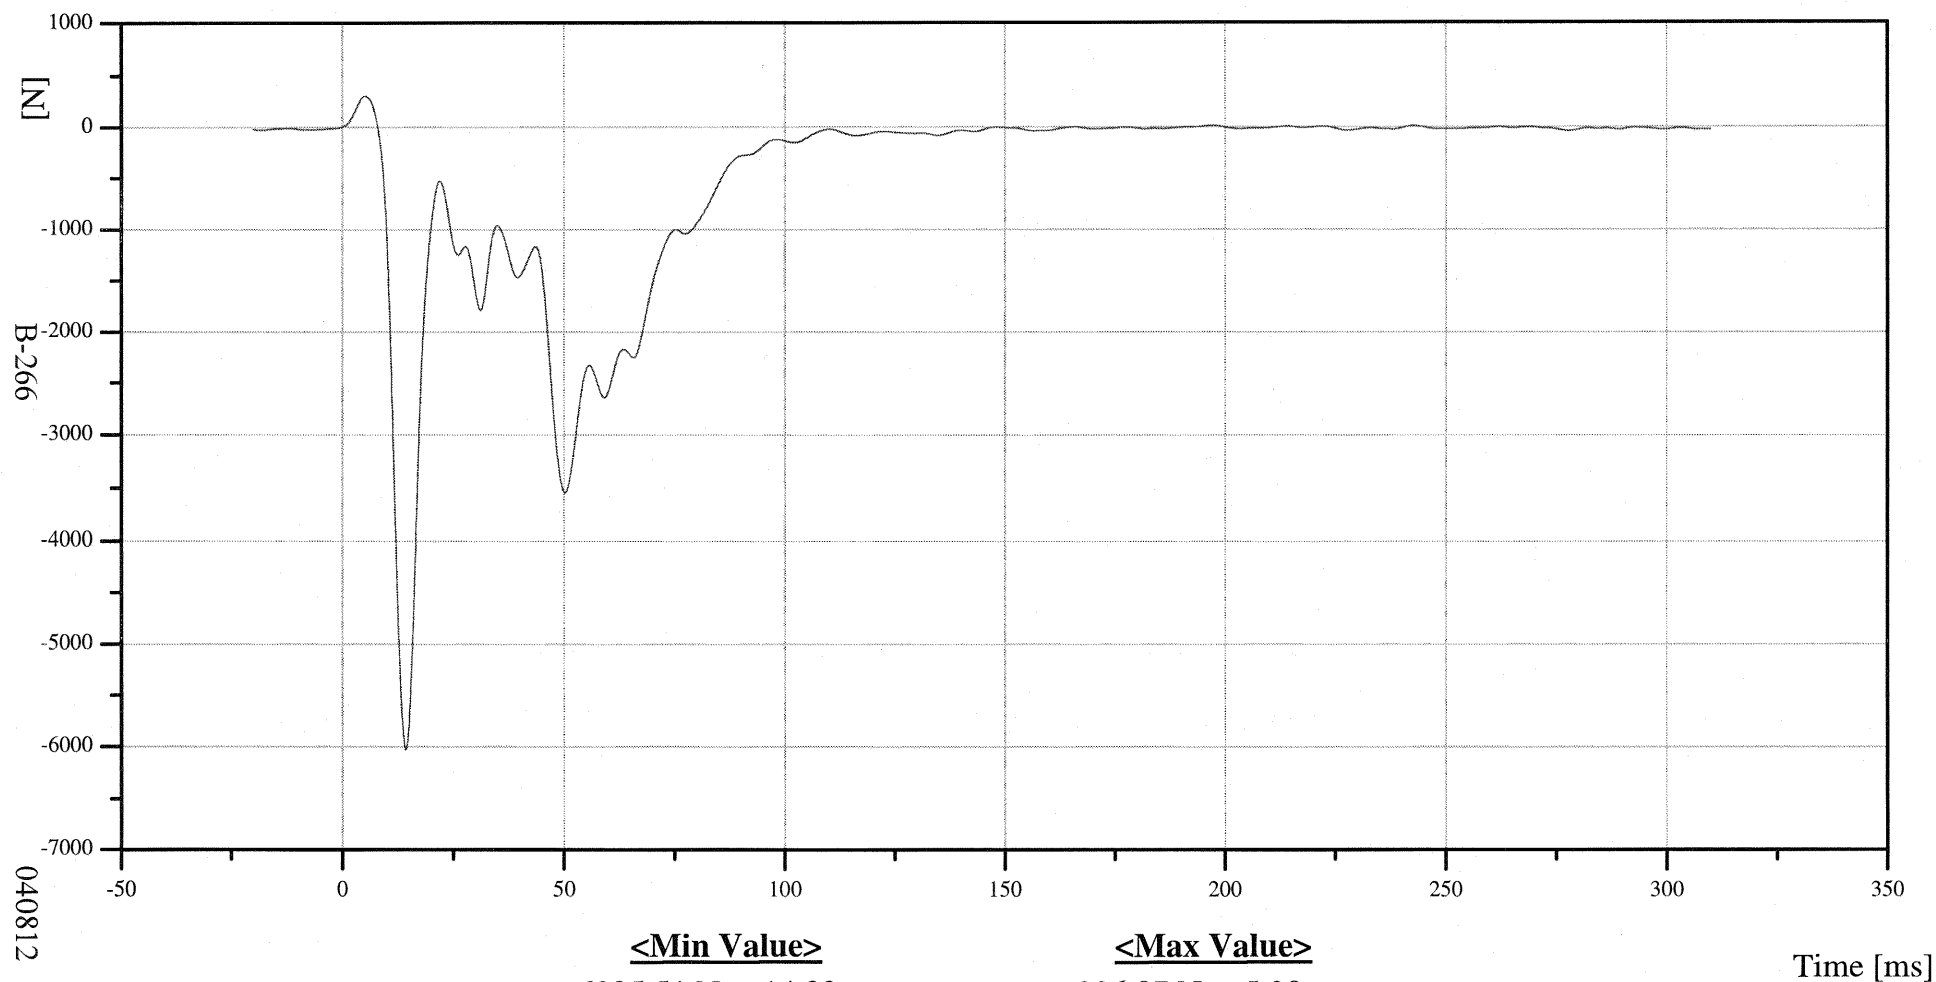

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0808

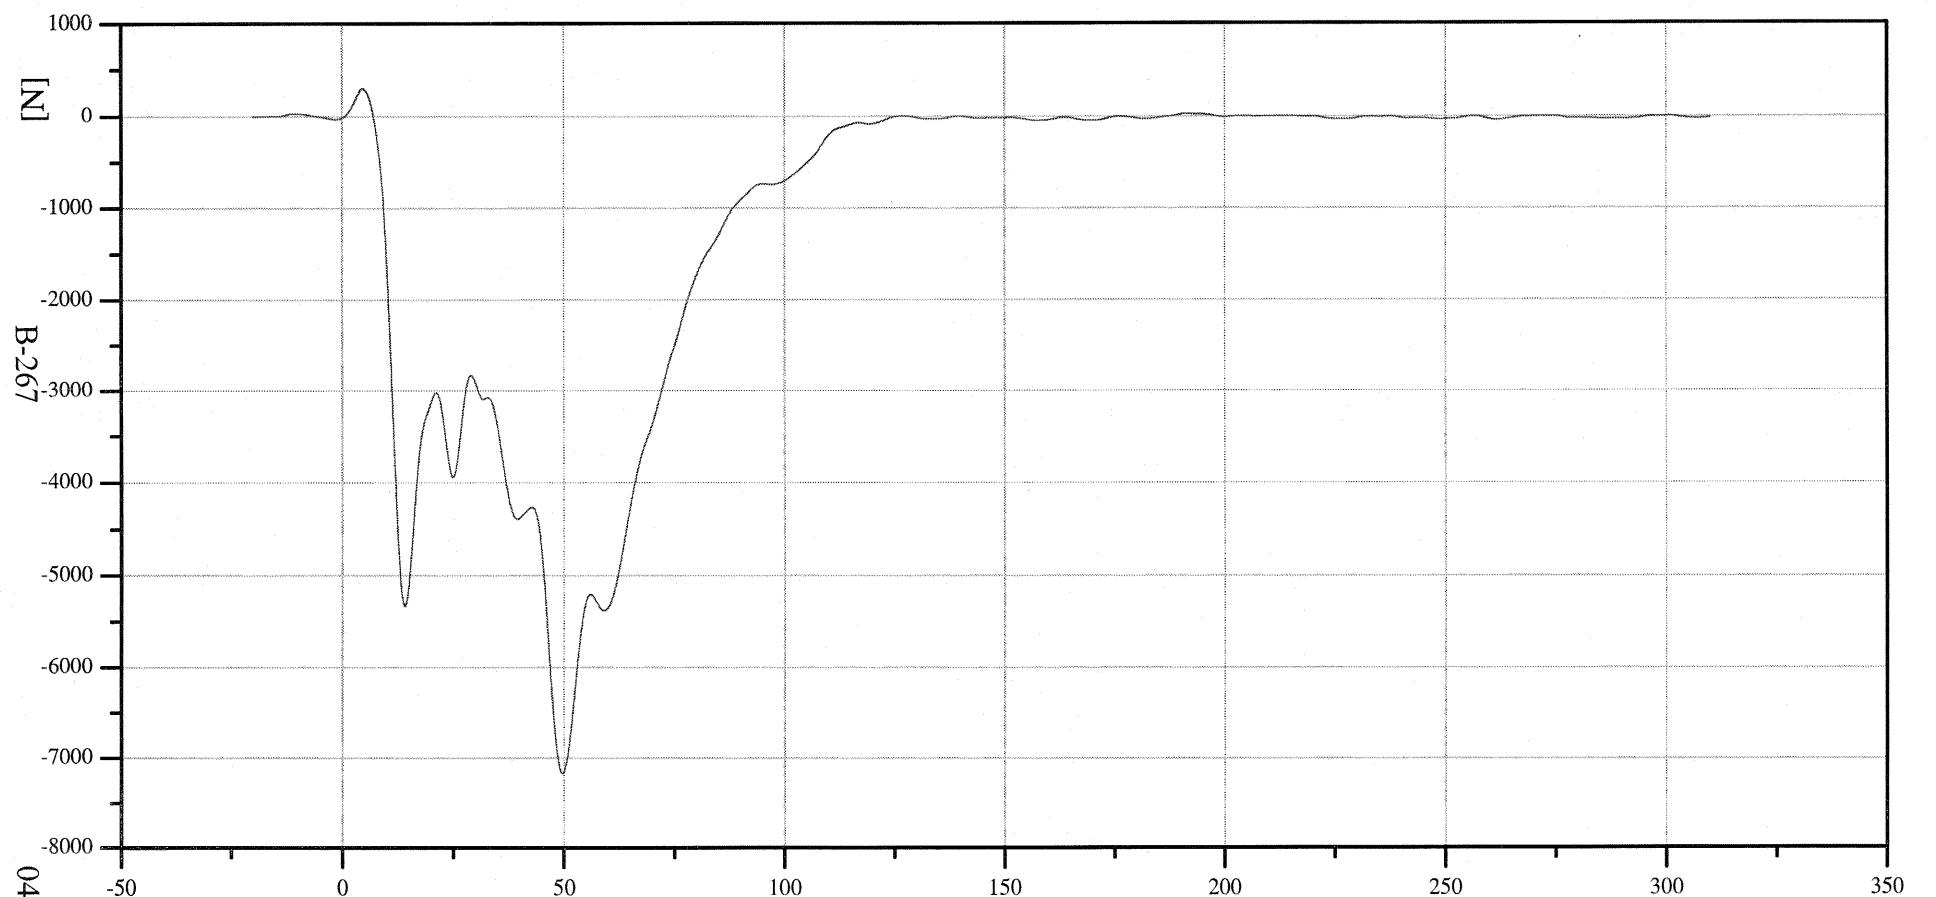

<Min Value>

-7164.45 N at 49.68 ms

<Max Value>

304.86 N at 4.72 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0809

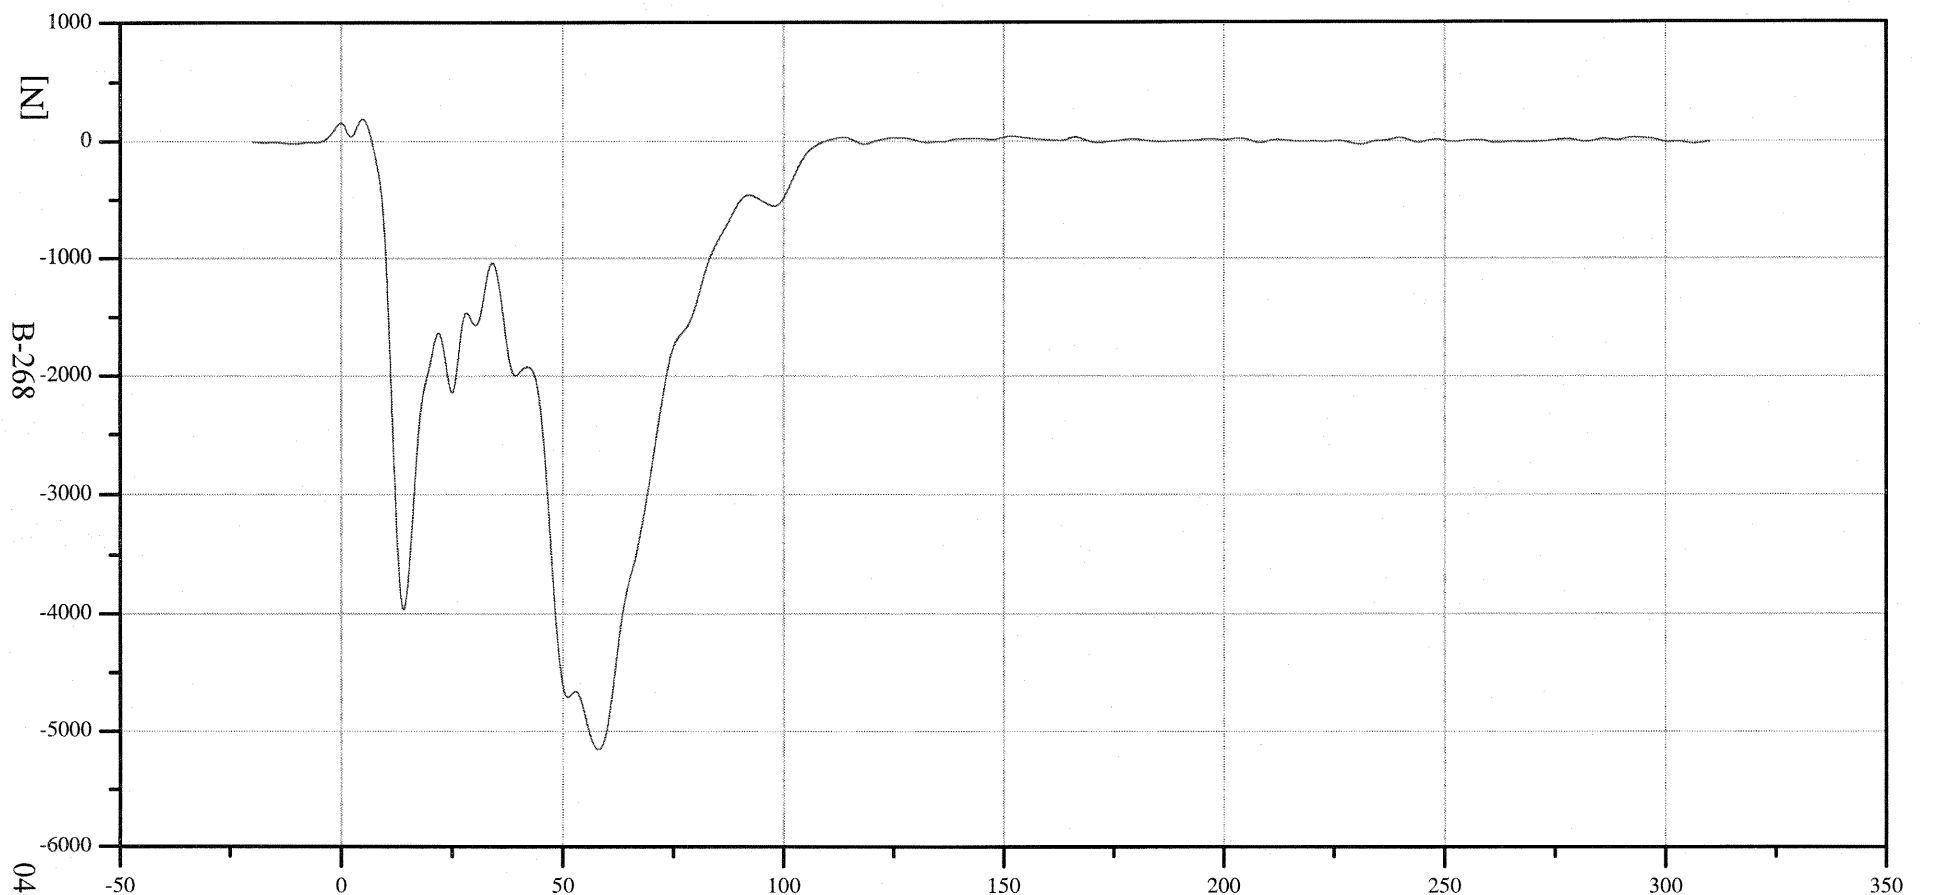

<Min Value>

-5155.87 N at 58.00 ms

<Max Value>

188.89 N at 4.80 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0810

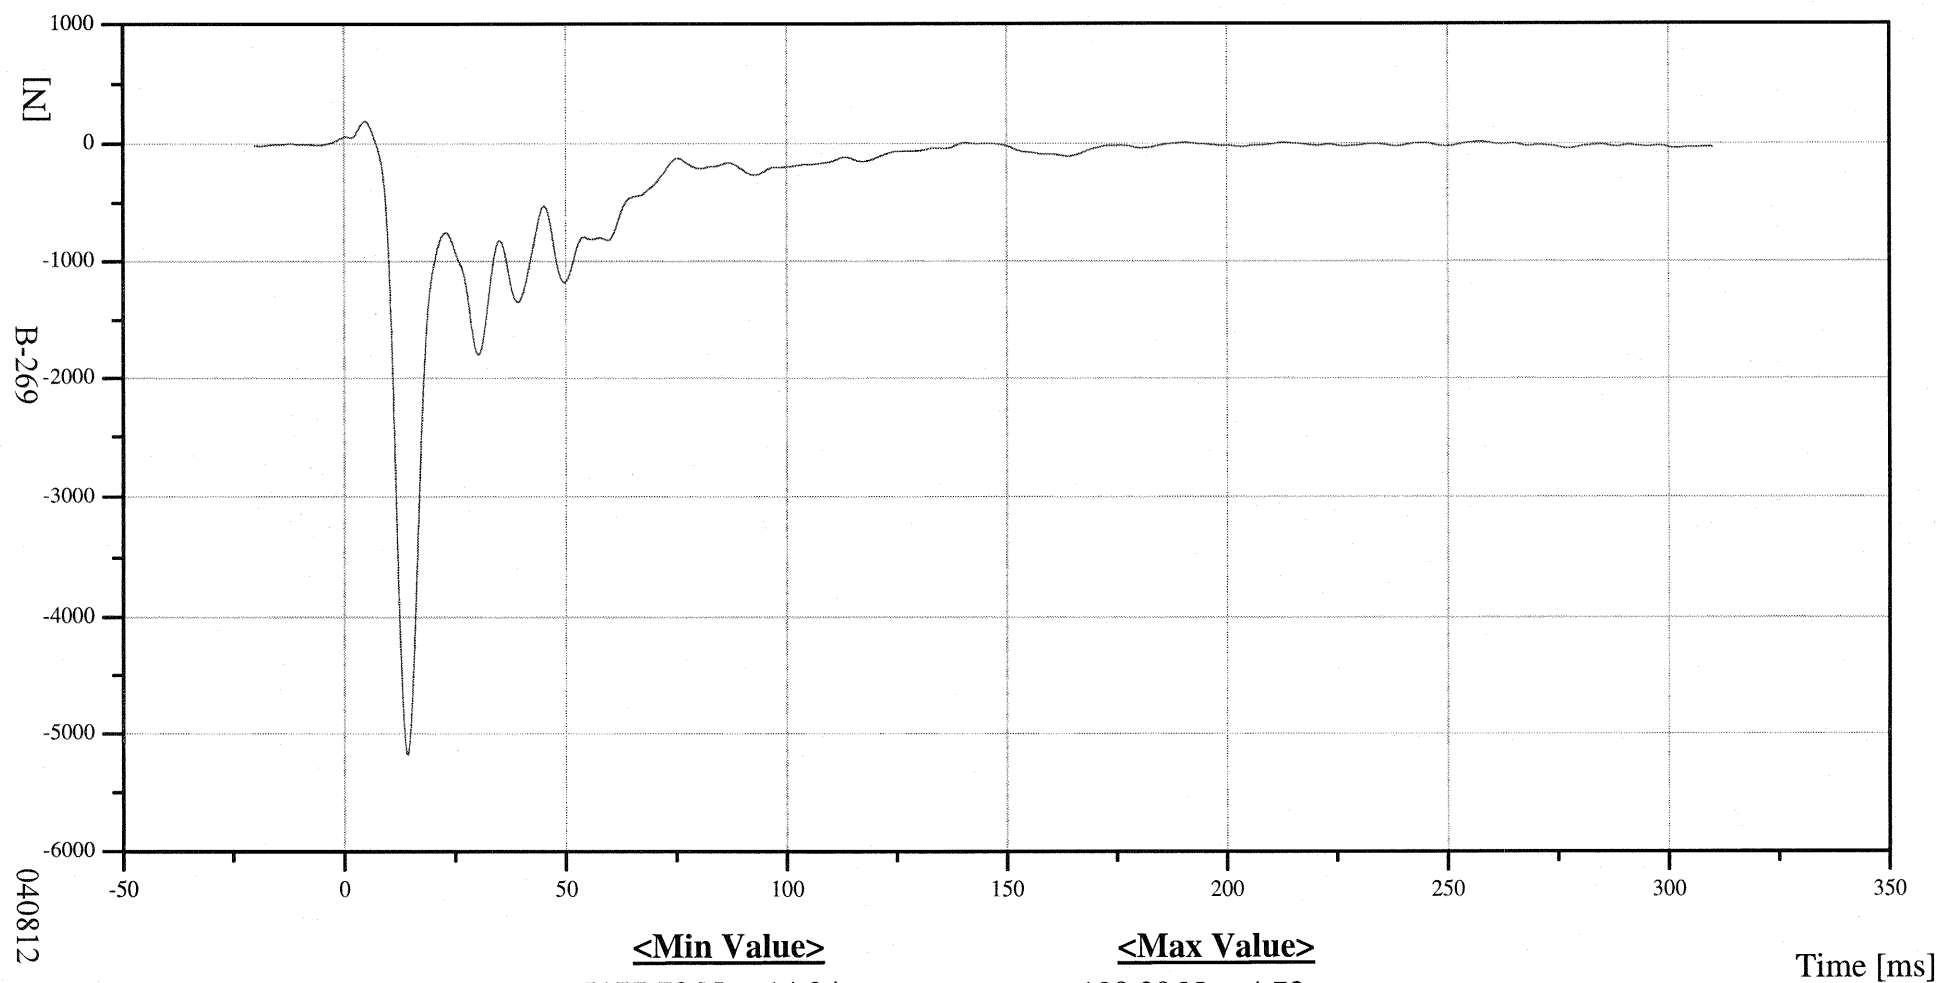

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0811

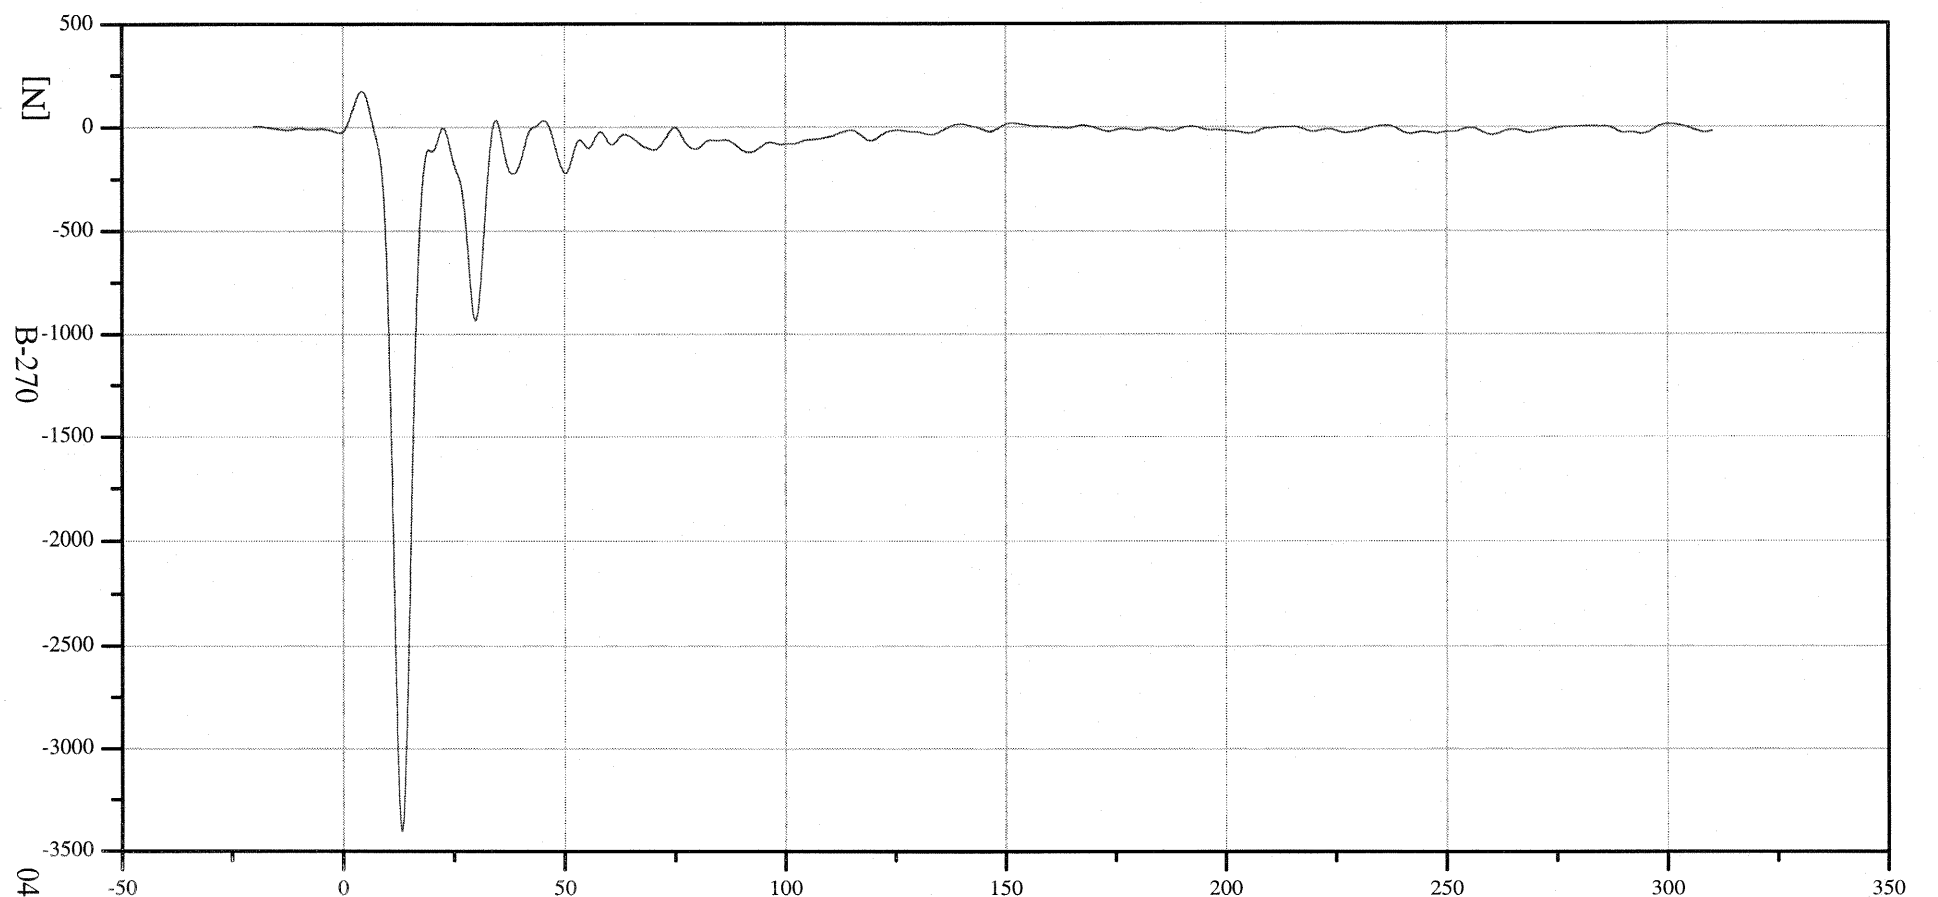

<Min Value>

-3399.82 N at 13.20 ms

<Max Value>

173.53 N at 4.24 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 12

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0812

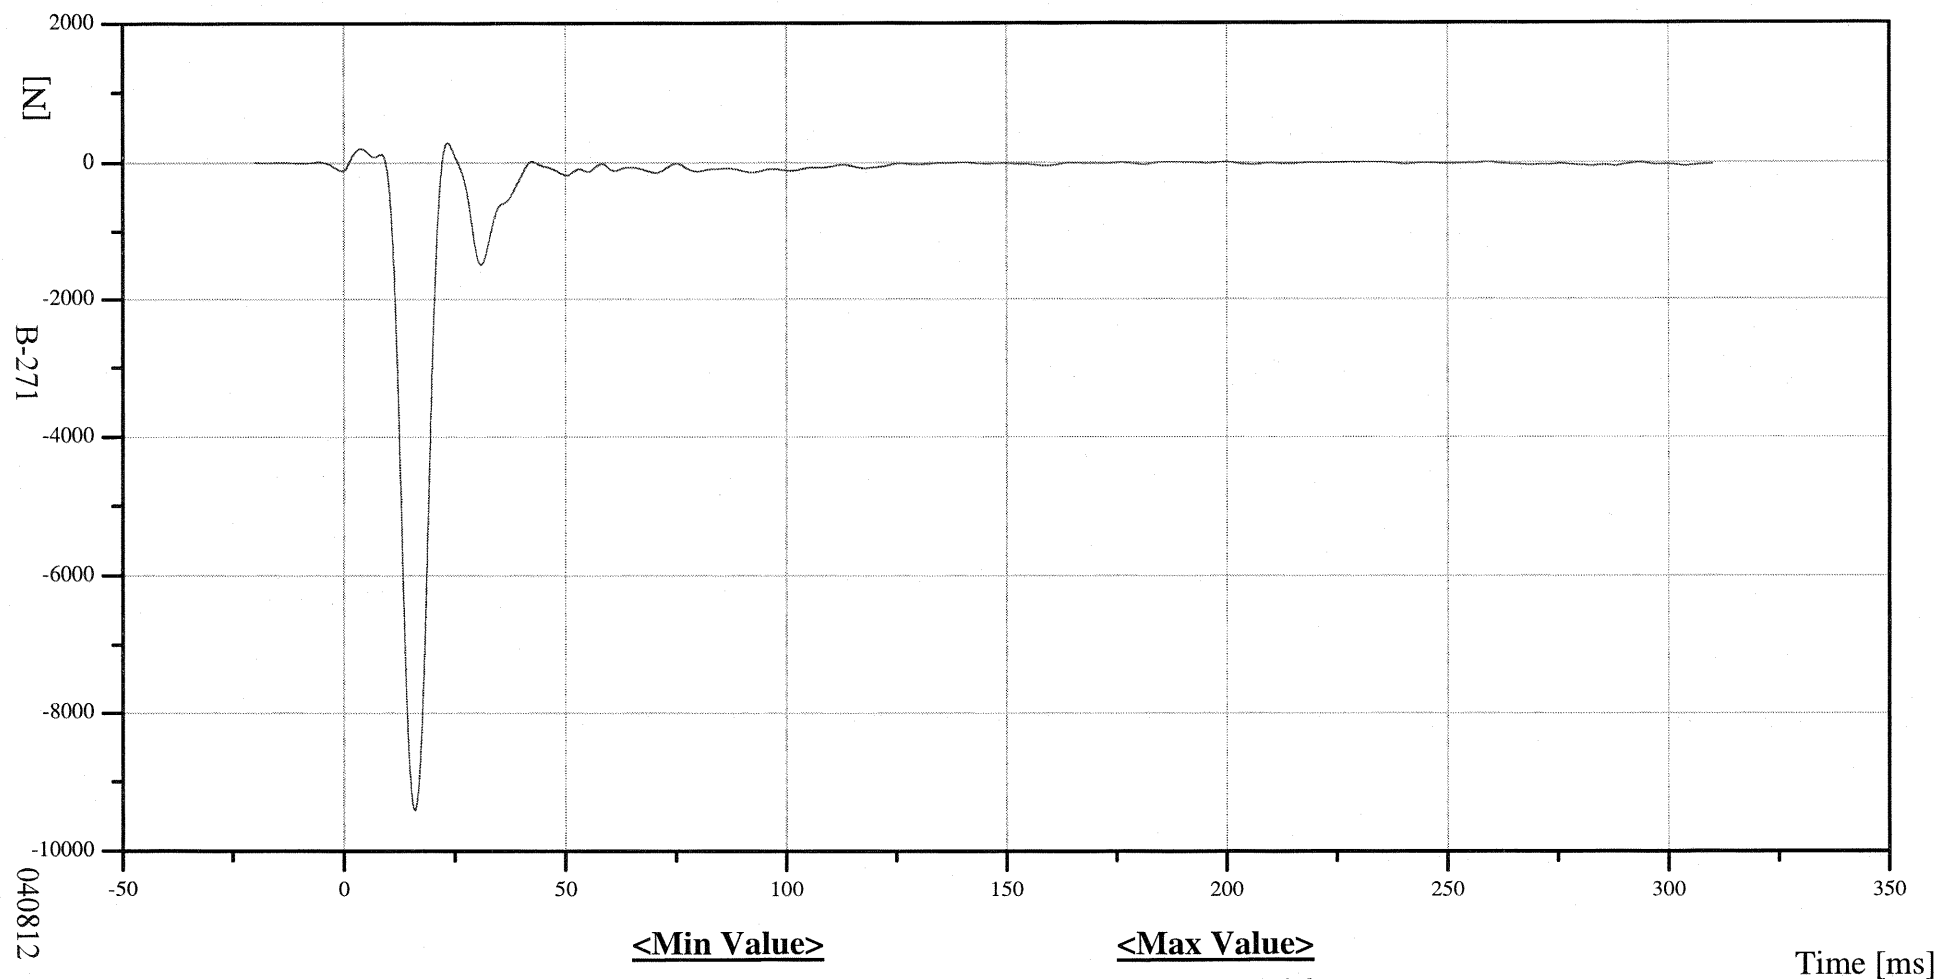

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]

-9411.76 N at 15.92 ms

283.07 N at 23.36 ms

Time [ms]



Transportation Research Center, Inc.

ROW 8 COLUMN 13

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0813

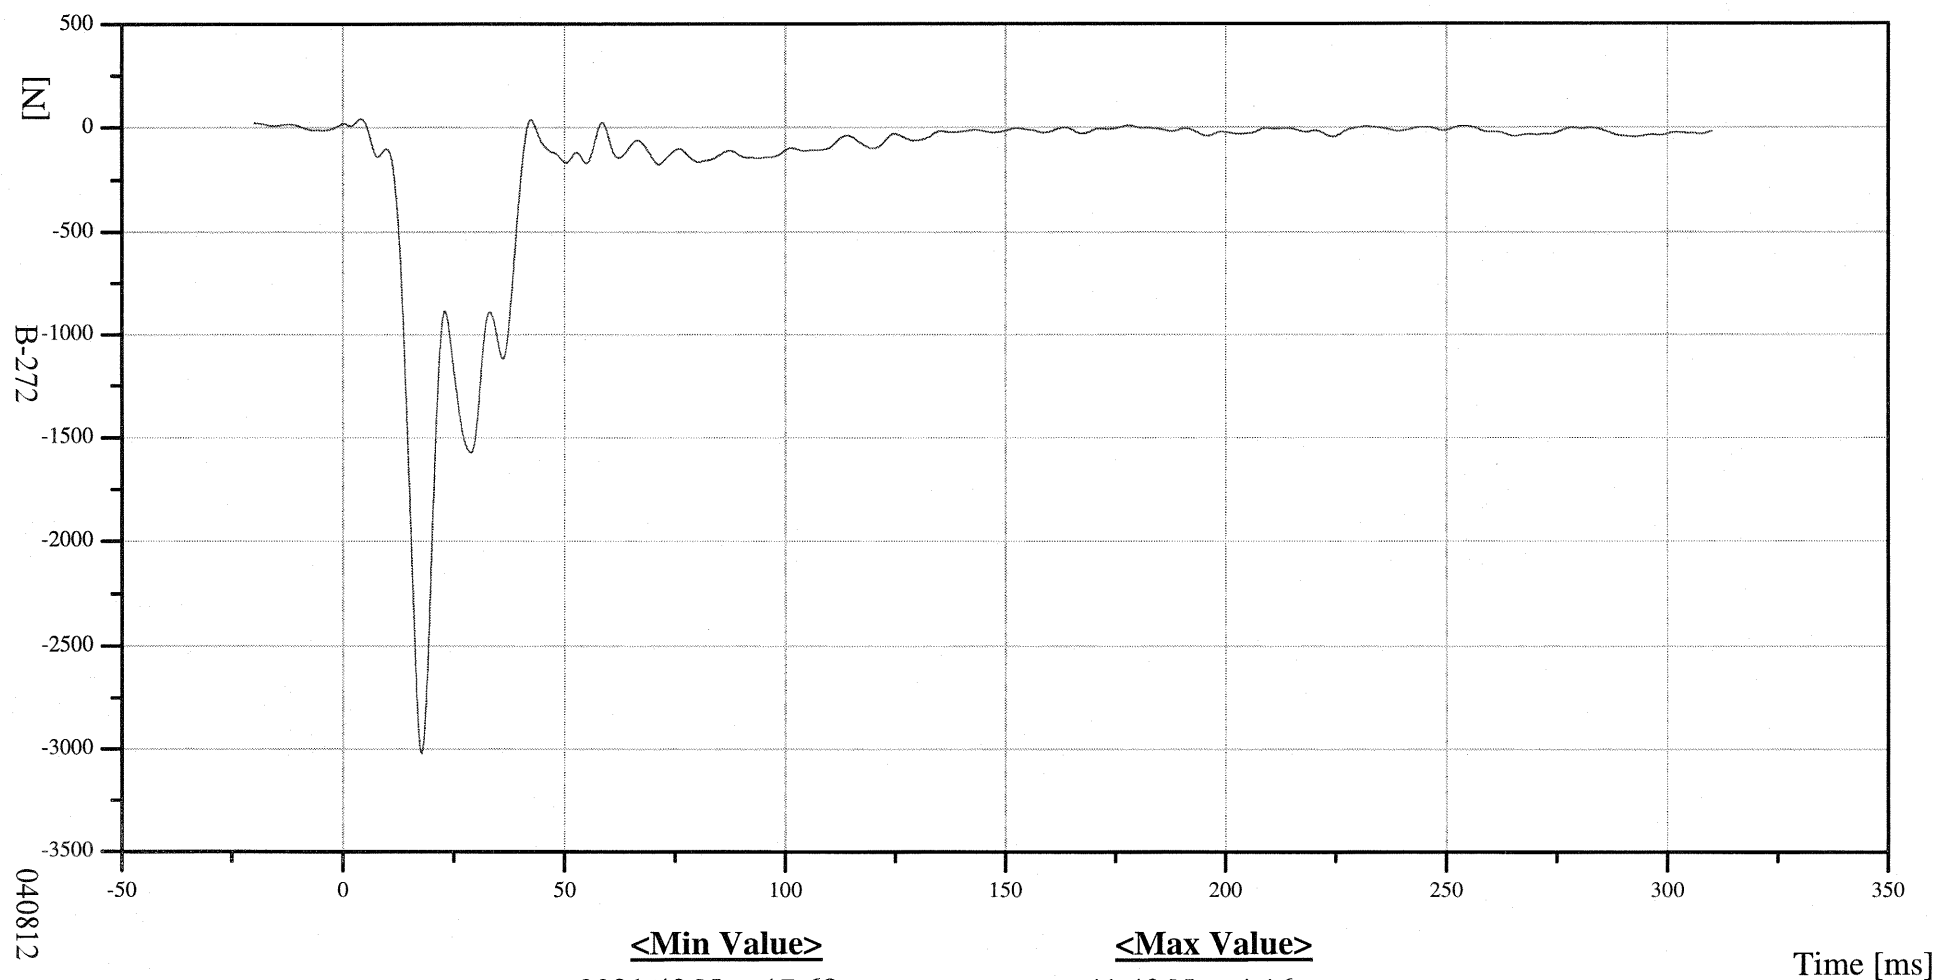

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 14

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0814

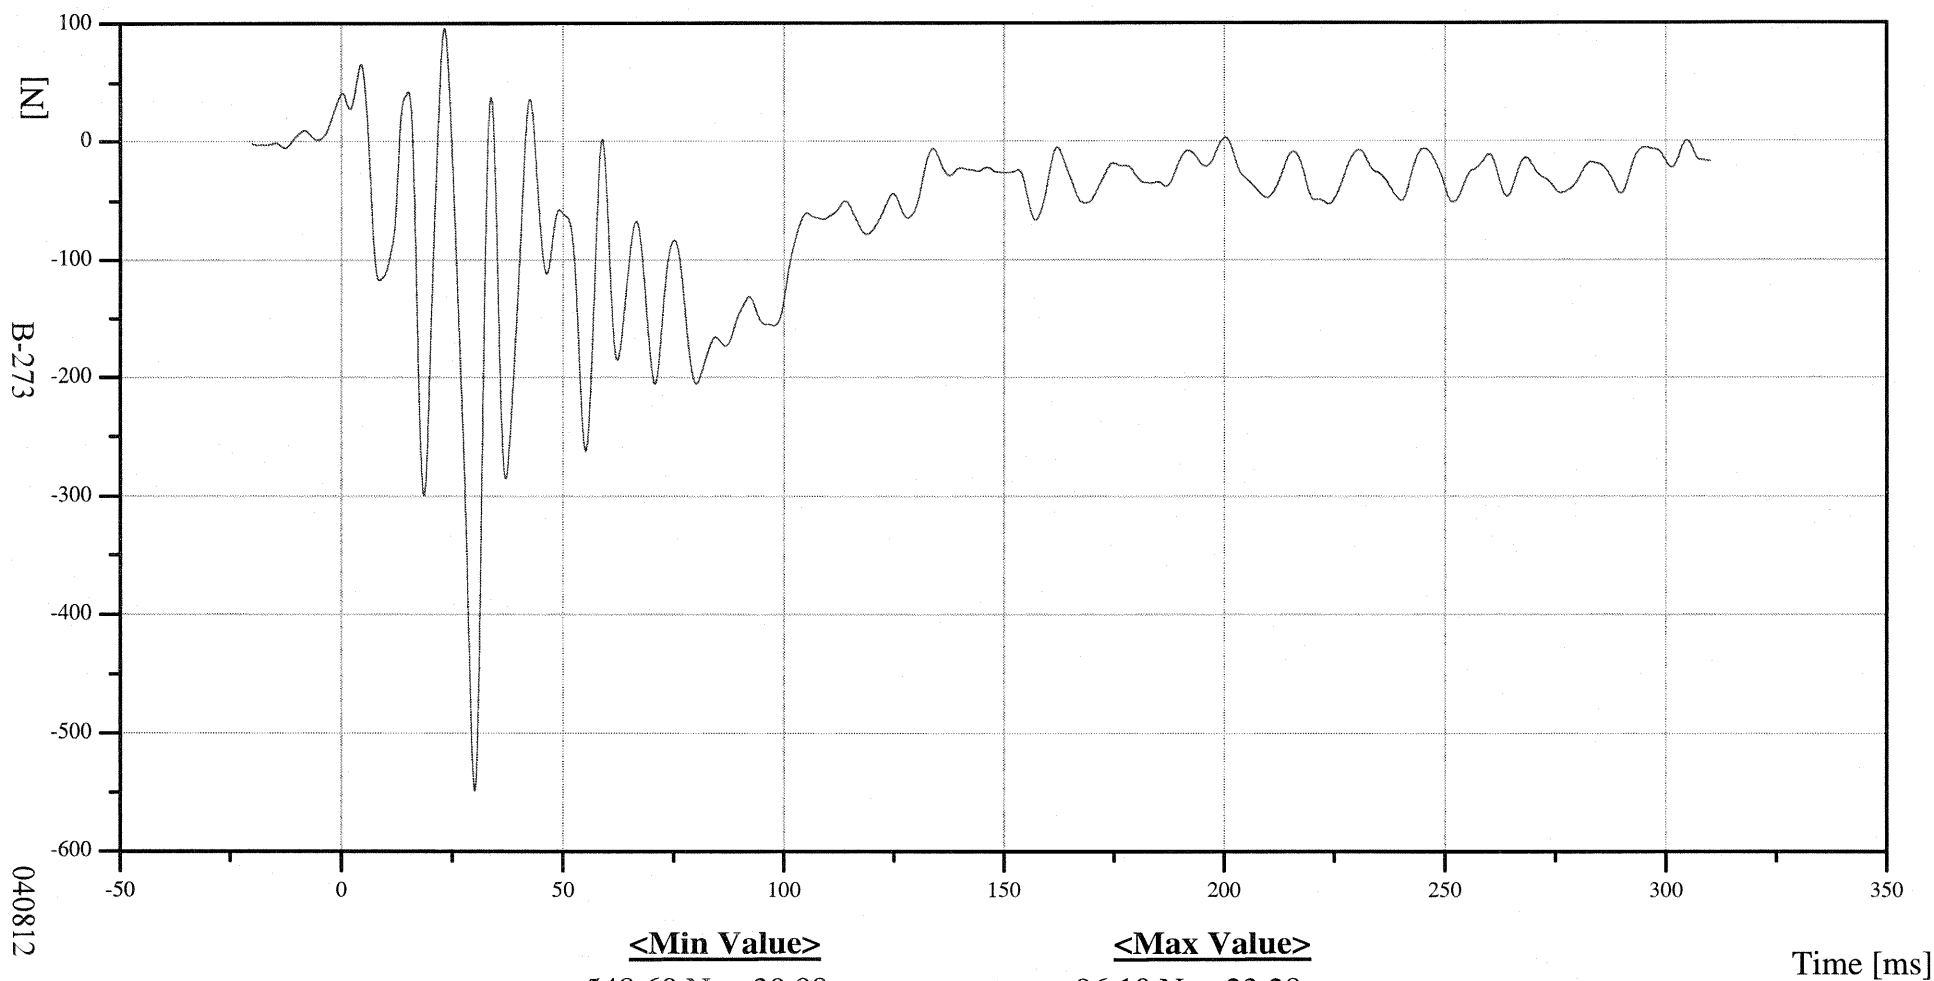

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 15

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0815

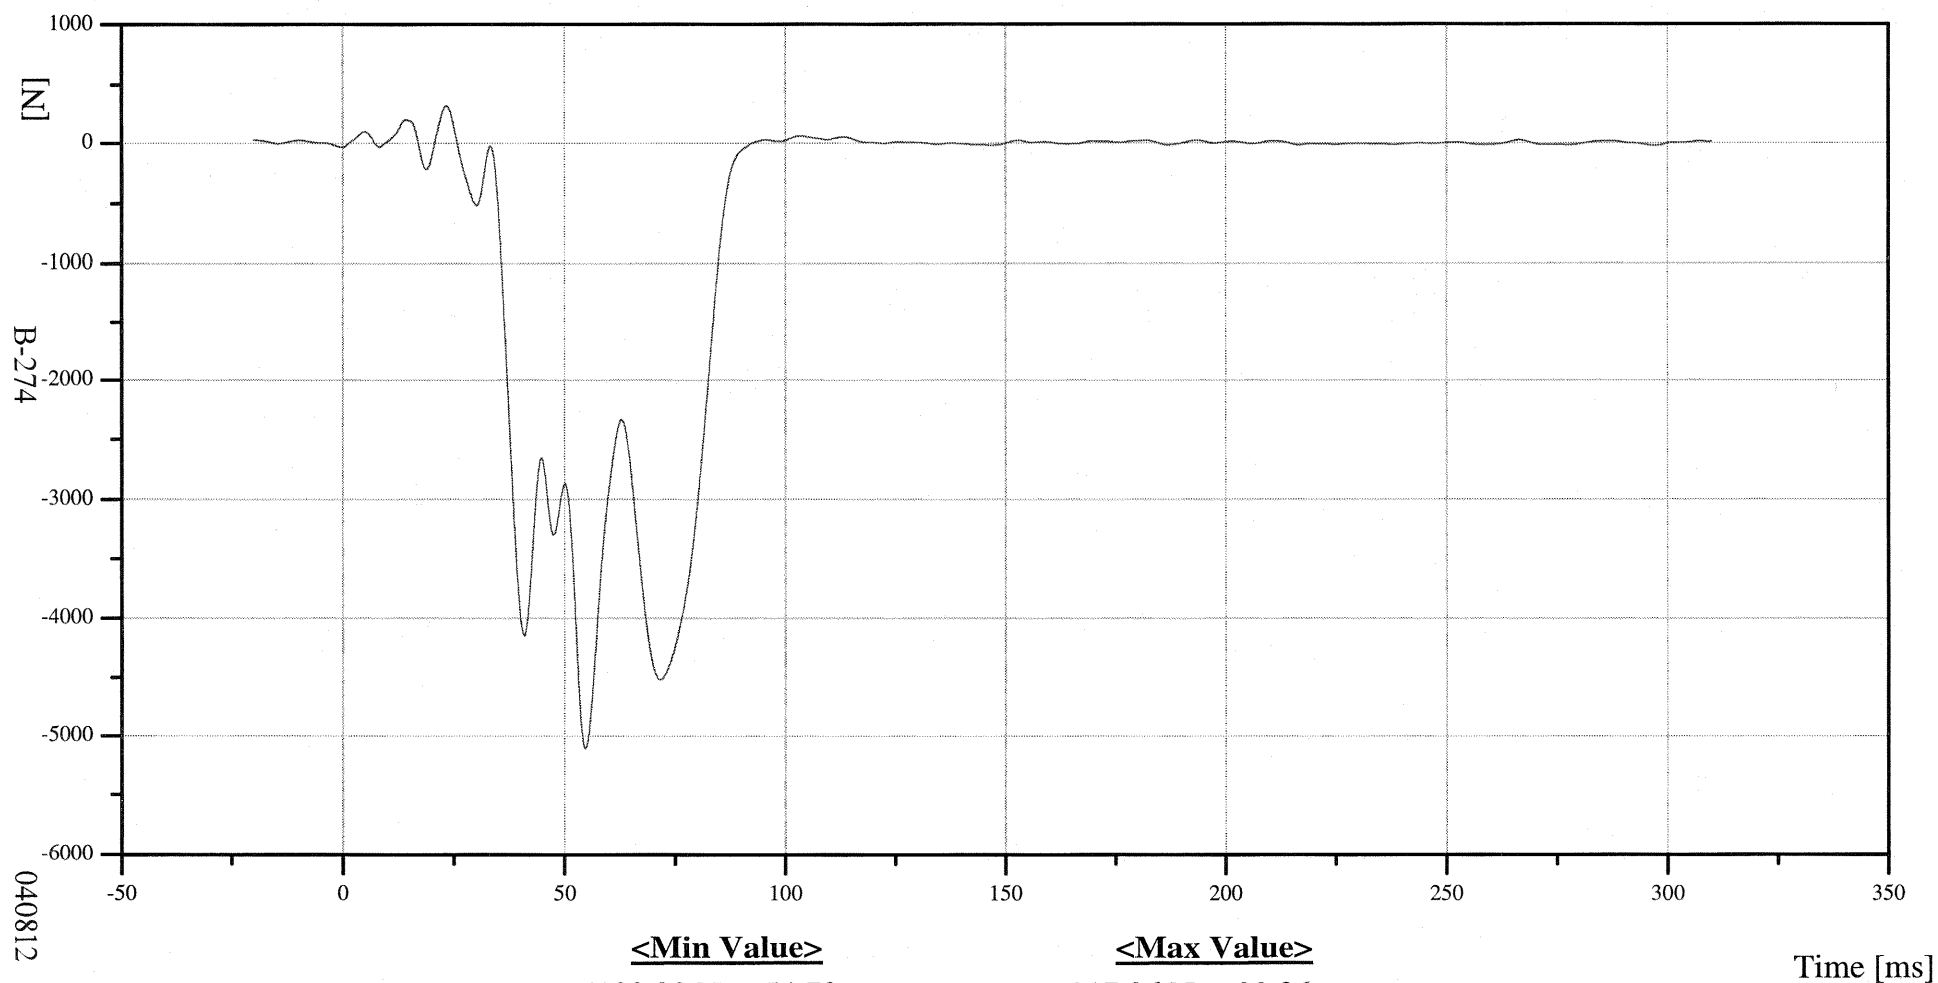

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 8 COLUMN 16

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0816

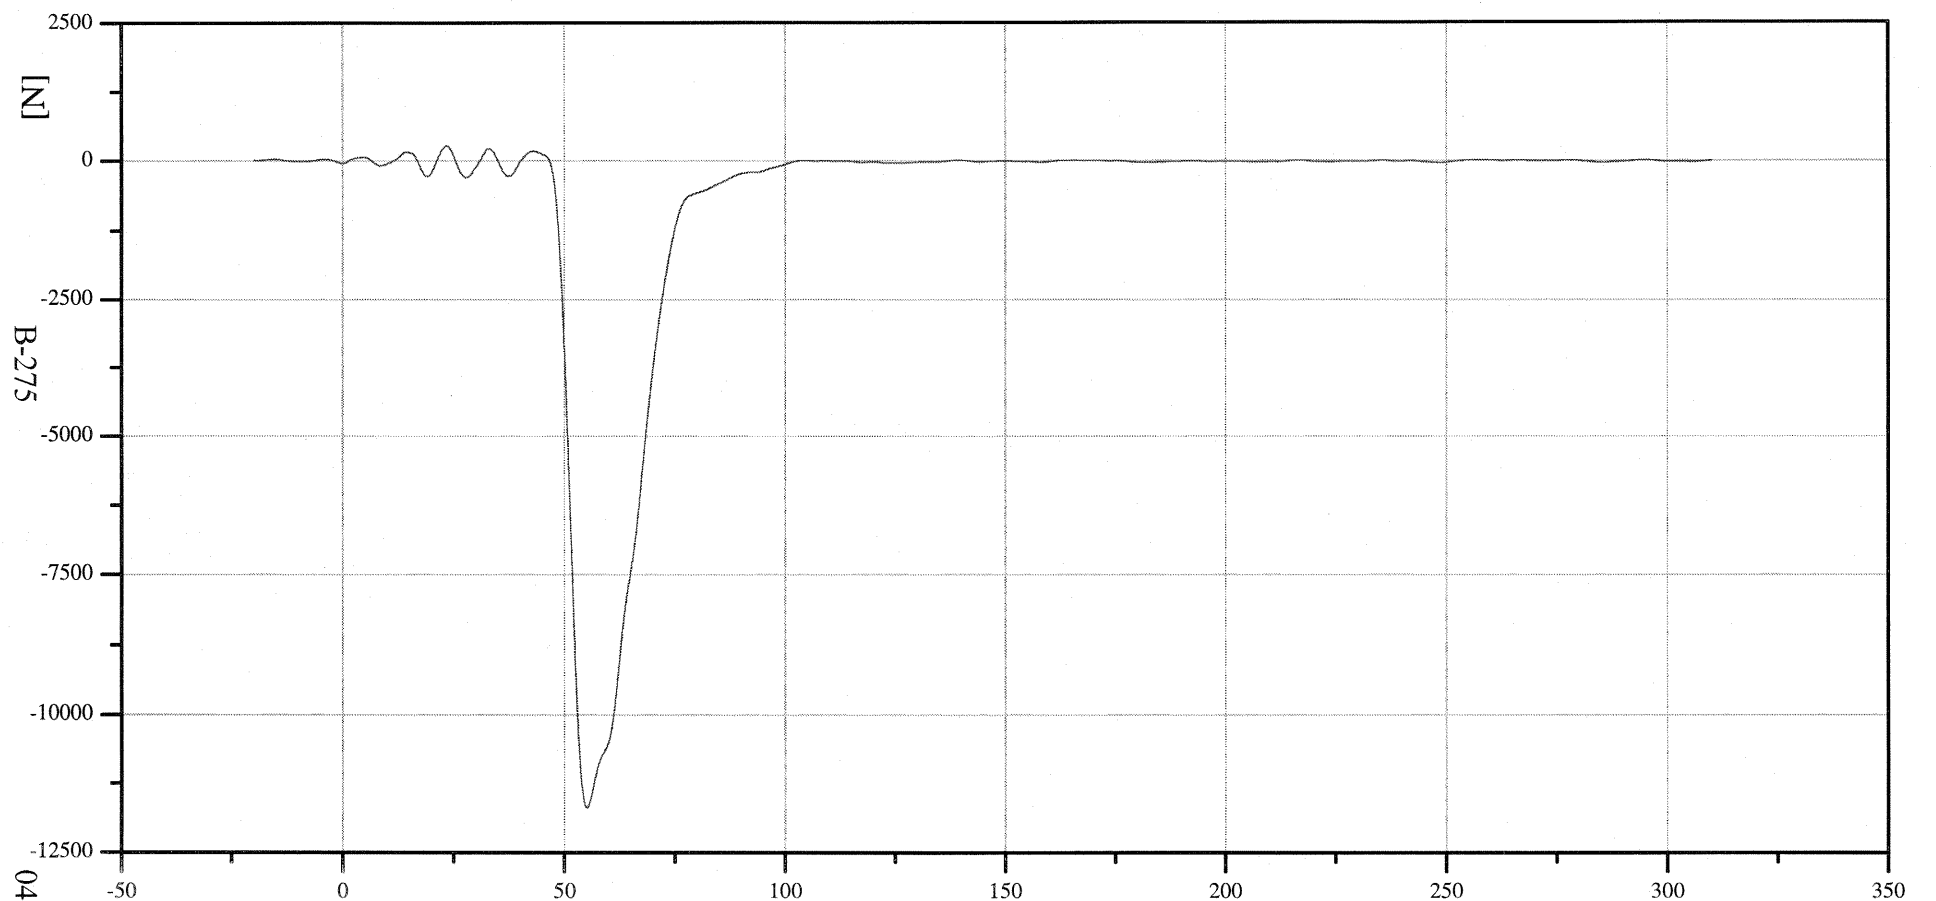

<Min Value>

-11691.03 N at 55.04 ms

<Max Value>

267.73 N at 23.44 ms

Time [ms]

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 9 COLUMN 6

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0906

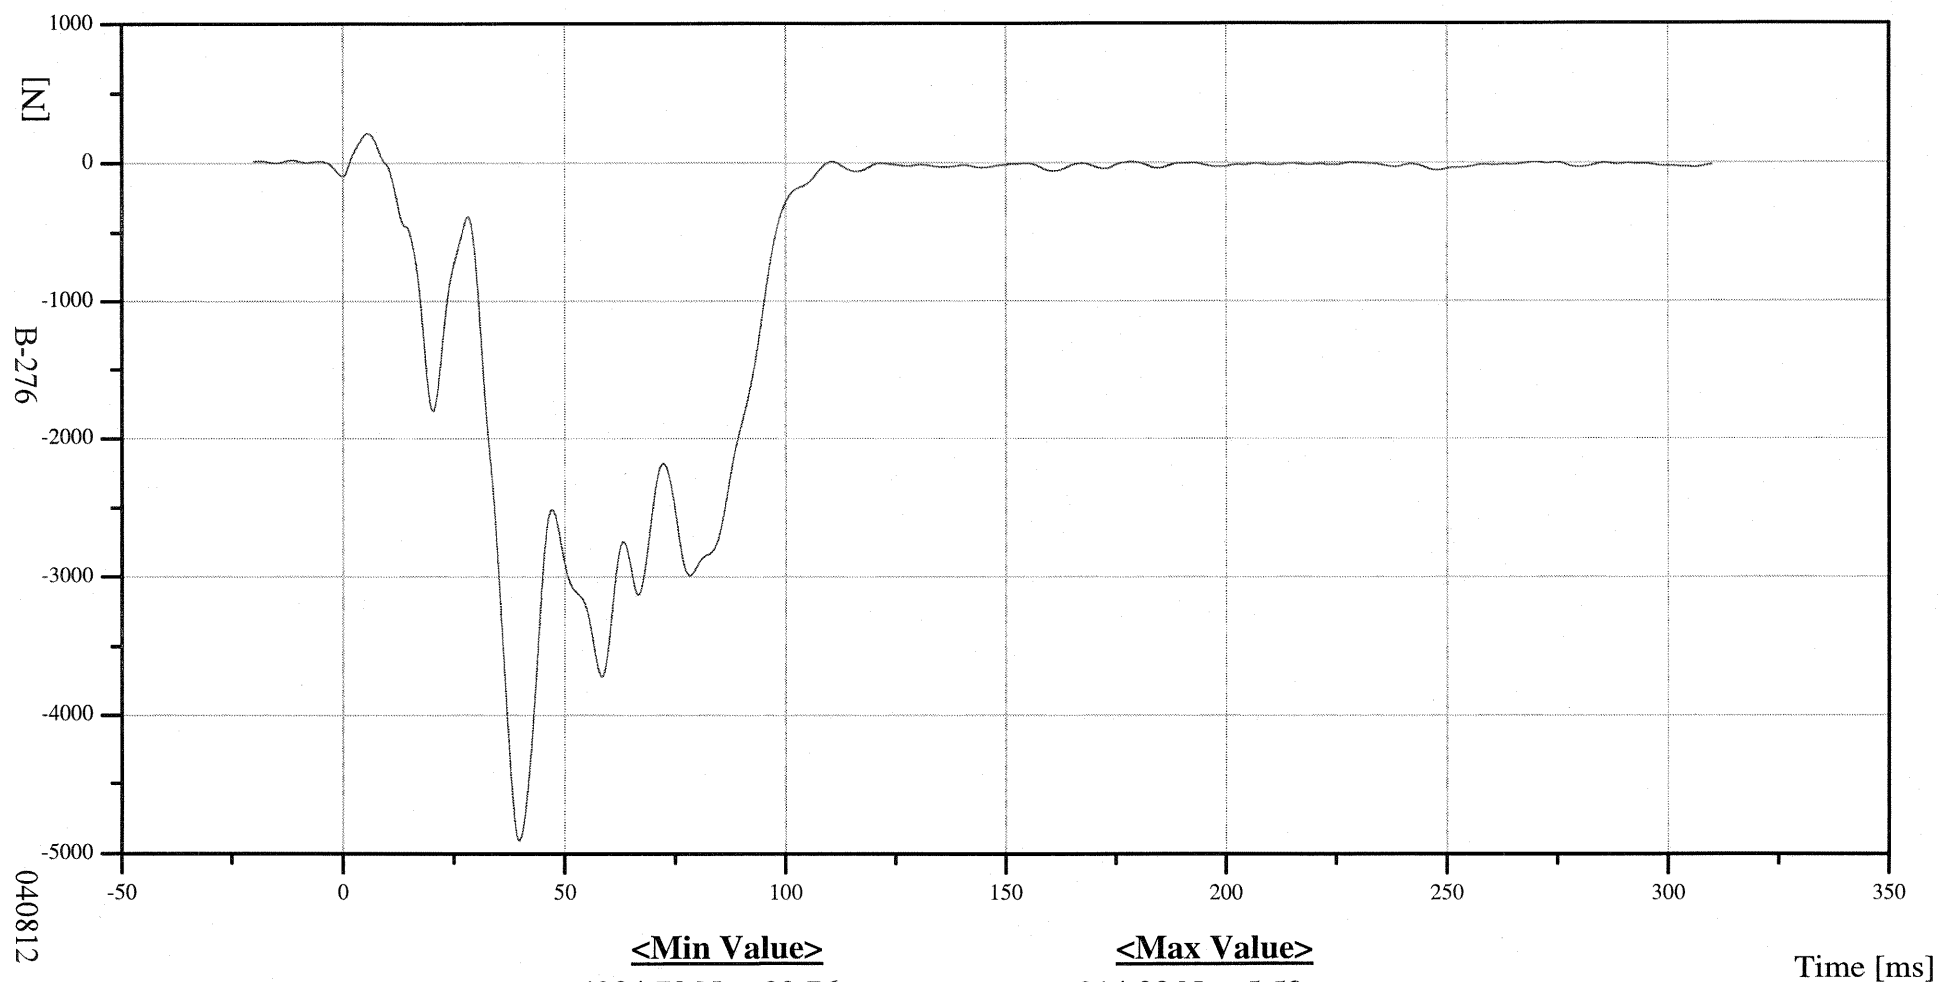

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 9 COLUMN 7

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0907

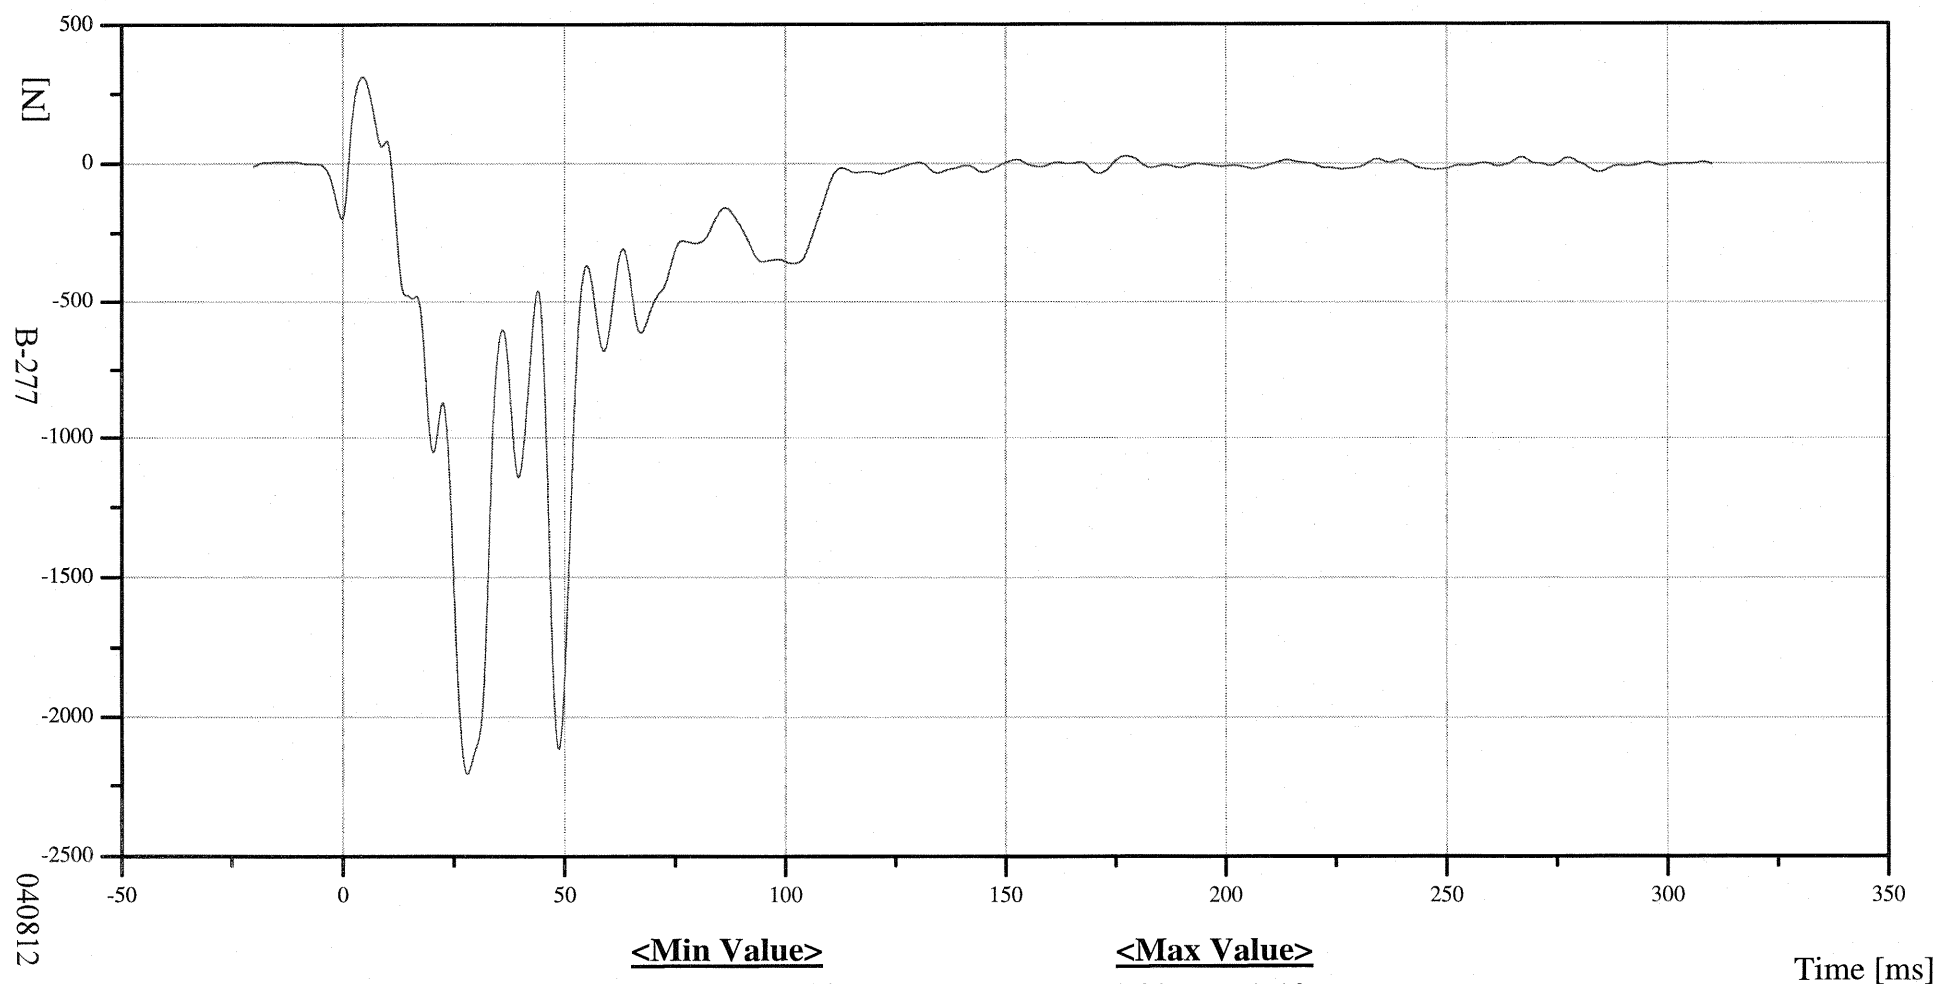

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 9 COLUMN 8

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0908

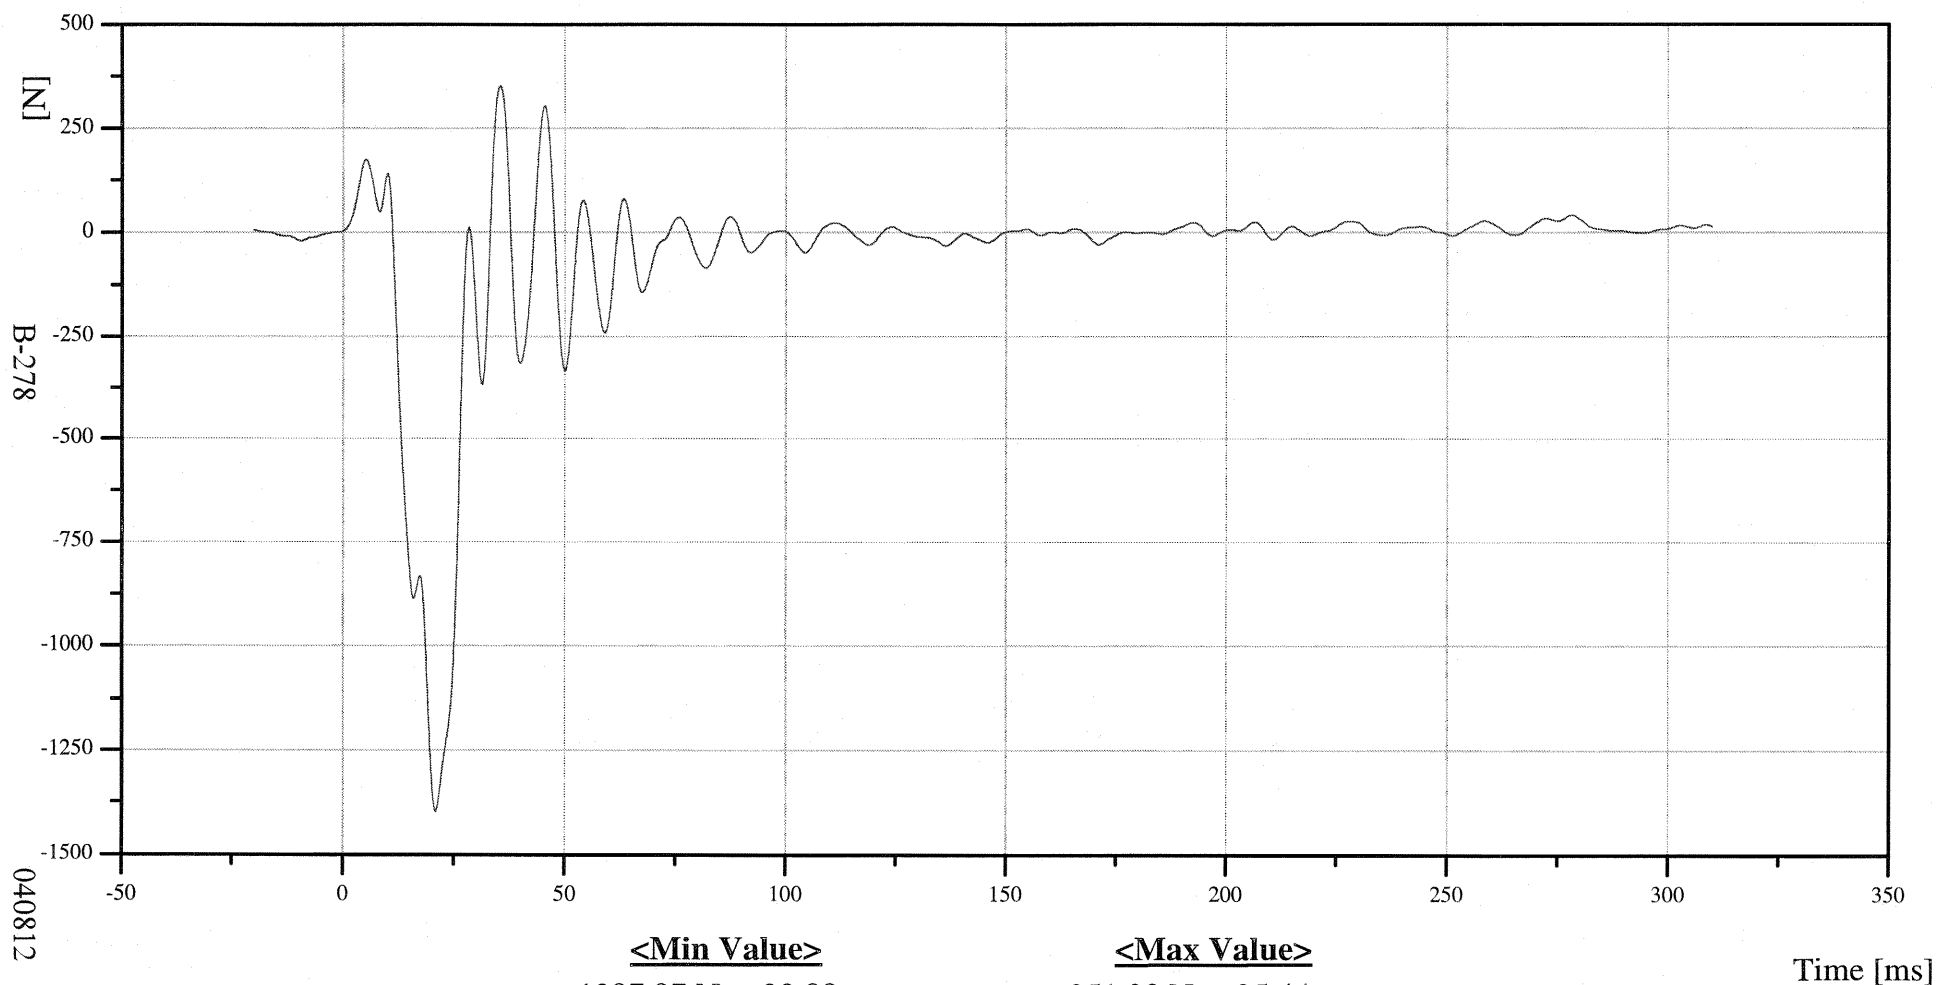

040812

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]

<Min Value>
-1397.97 N at 20.88 ms

<Max Value>
351.28 N at 35.44 ms

Time [ms]



Transportation Research Center, Inc.

ROW 9 COLUMN 9

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0909

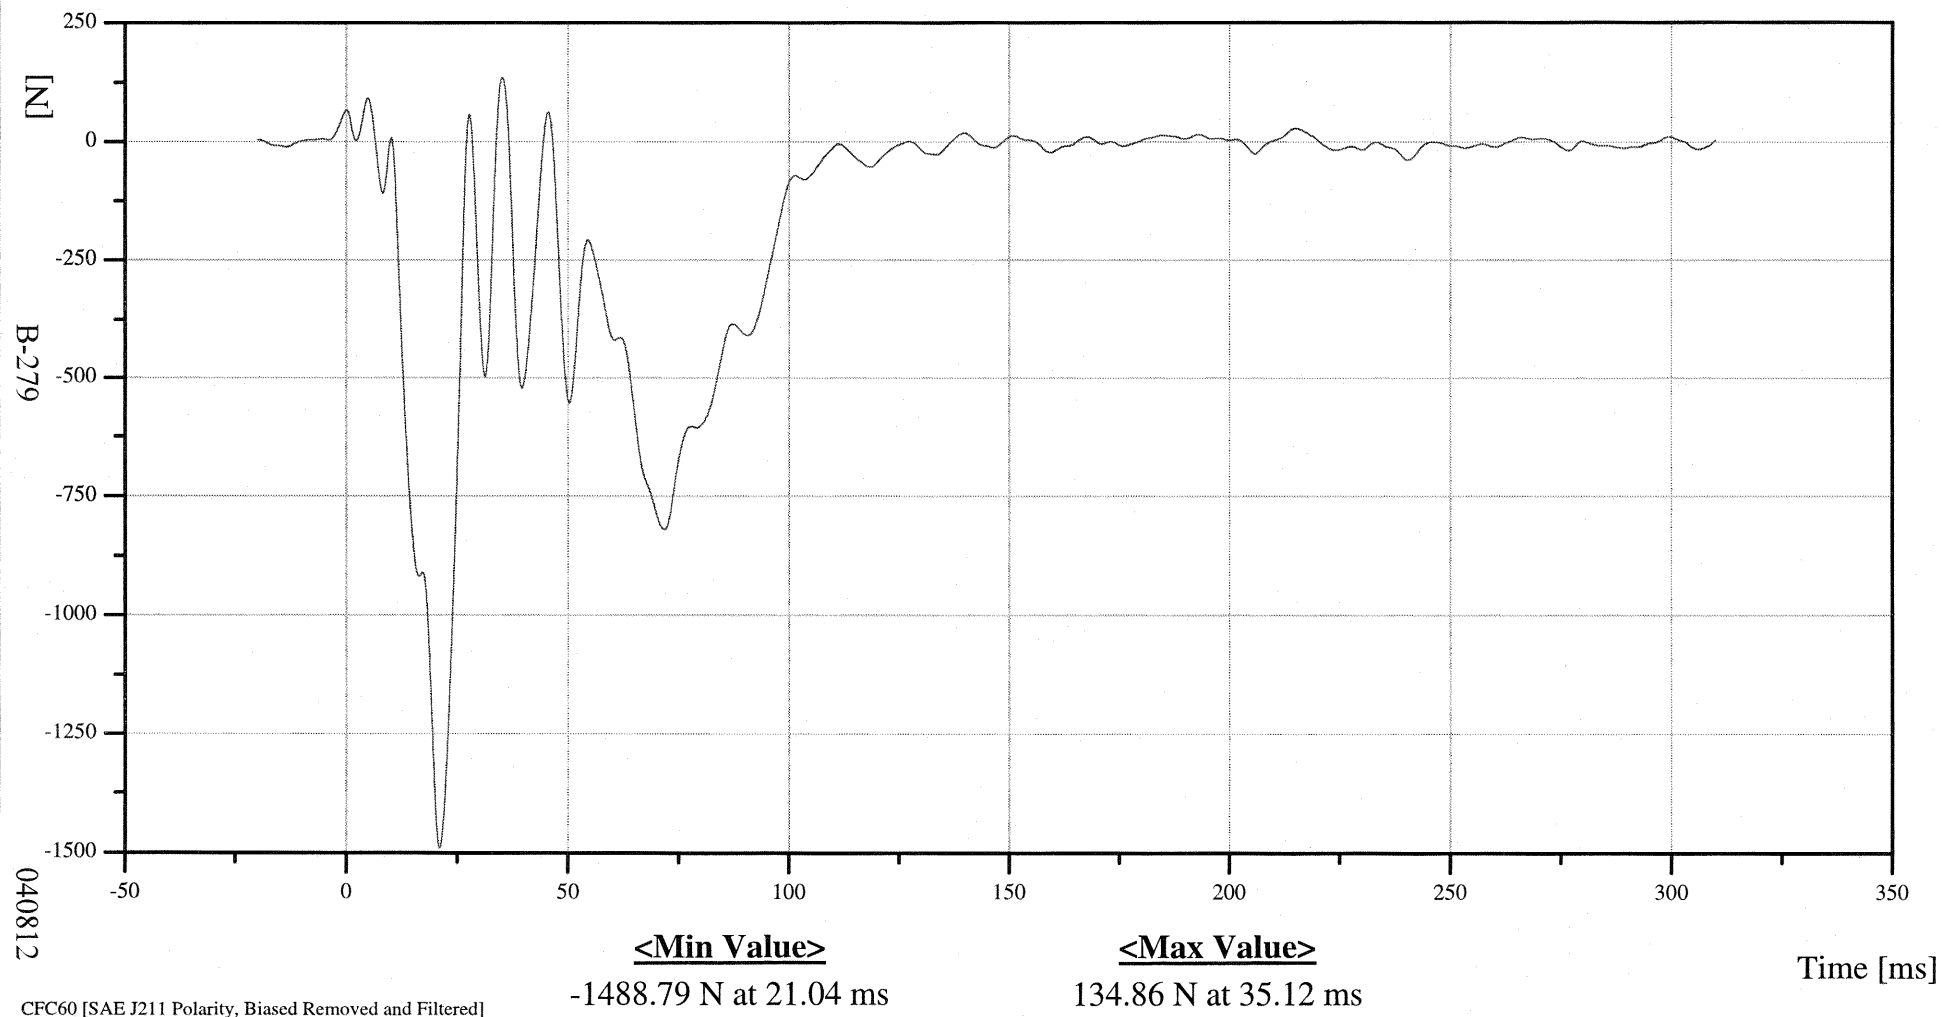



Transportation Research Center, Inc.

ROW 9 COLUMN 10

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0910

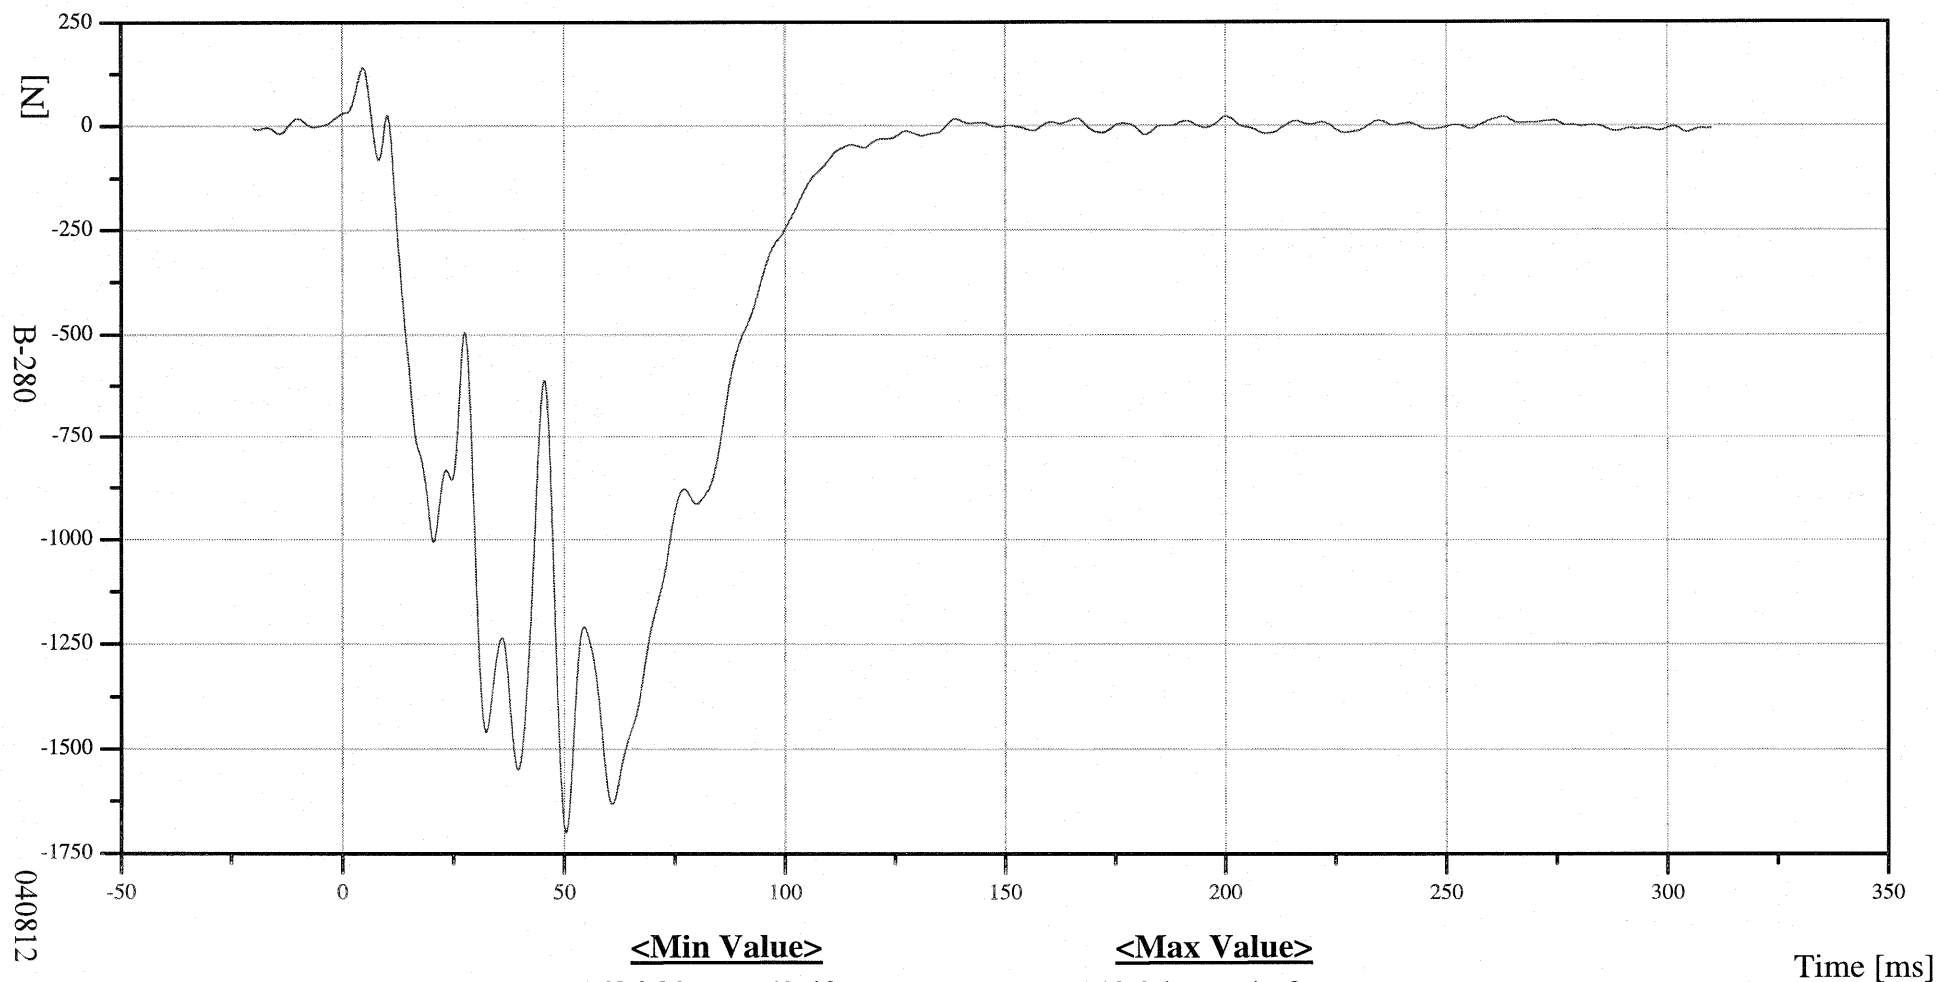

040812
CFC60 [SAE J211 Polarity, Biased Removed and Filtered]



Transportation Research Center, Inc.

ROW 9 COLUMN 11

Date: 08/12/2004

Time: 12:06:33

Test Lab: CTF

Customer: VRTC


Test Number: 040812

Position #1 - HIII 5th Female (416)

Position #2 - HIII 5th Female (048)

Position #3 - HIII 5th Female (070)

LC0911

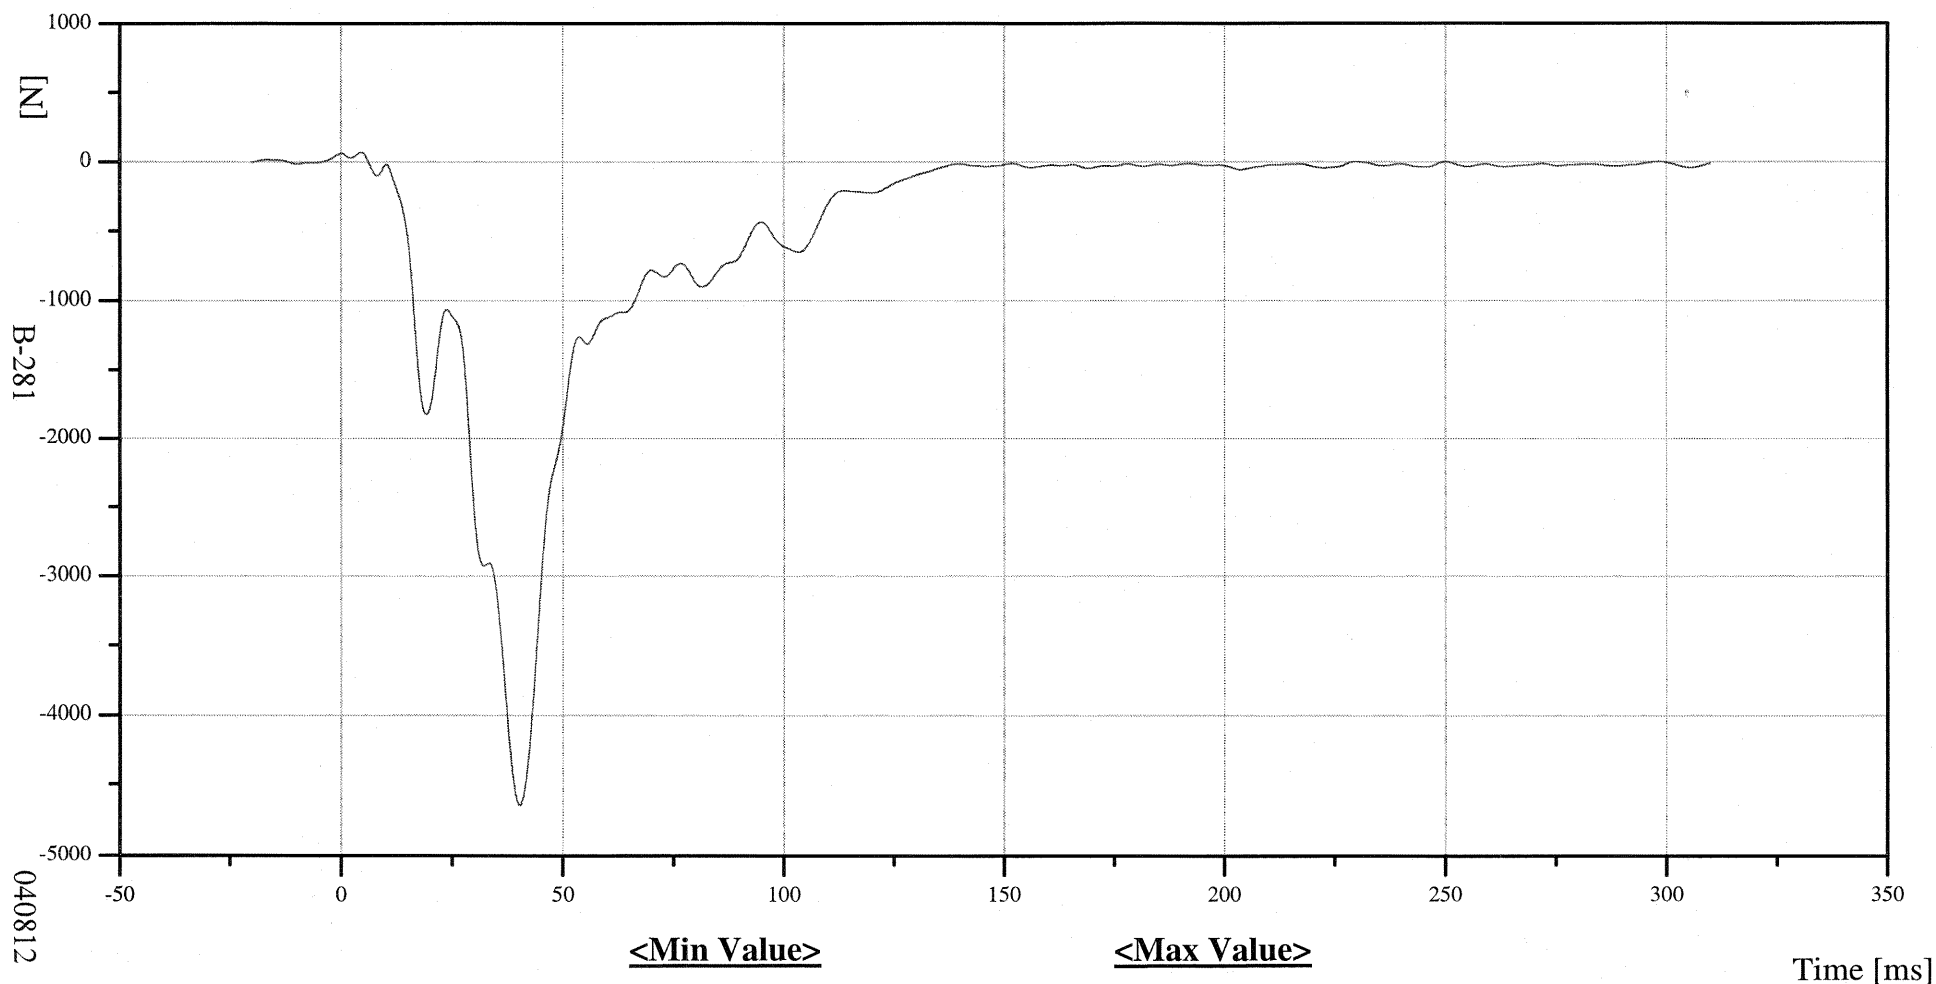

CFC60 [SAE J211 Polarity, Biased Removed and Filtered]

Appendix C

Dummy Certification Data

Pre-Test Calibration

Driver Dummy S/N 416

Transportation Research Center Inc.
5720 HIII 5th Female Dummy
External Dimensions
Serial No. 416 Calibration No. 26

Symbol	Description	Specification	Results	Pass
		mm	mm	
A	Total Sitting Height	774.7 - 800.1	784	Yes
B	Shoulder Pivot Height	431.8 - 457.2	449	Yes
C	Hip Pivot Height	81.3 - 86.3	85	Yes
D	Hip Pivot from Backline	144.8 - 149.8	146	Yes
E	Shoulder Pivot from Backline	68.6 - 83.8	82	Yes
F	Thigh Clearance	119.4 - 134.6	125	Yes
G	Back of Elbow to Wrist Pivot	243.9 - 259.1	249	Yes
H	Head Back to Backline	43.2 - 48.2	47	Yes
I	Shoulder to Elbow Length	276.8 - 297.2	281	Yes
J	Elbow Rest Height	182.8 - 203.2	195	Yes
K	Buttock Knee Length	520.7 - 546.1	540	Yes
L	Popliteal Height	355.6 - 376.0	356	Yes
M	Knee Pivot Height	393.7 - 419.1	407	Yes
N	Buttock Popliteal Height	414.0 - 439.4	429	Yes
O	Chest Depth without Jacket	175.3 - 190.5	180	Yes
P	Foot Length	218.5 - 233.7	222	Yes
R	Buttock to Knee Pivot Length	457.2 - 482.6	476	Yes
S	Head Breadth	137.1 - 147.3	144	Yes
T	Head Depth	177.8 - 188.0	182	Yes
U	Hip Breadth	299.7 - 314.9	300	Yes
V	Shoulder Breadth	350.5 - 365.7	360	Yes
W	Foot Breadth	78.8 - 94.0	85	Yes
X	Head Circumference	528.3 - 548.7	543	Yes
Y	Chest Circumference with Jacket	850.9 - 881.3	873	Yes
Z	Waist Circumference	759.5 - 789.9	771	Yes
AA	Reference Location for Chest Circumference	332.7 - 358.1	340	Yes
BB	Reference Location for Waist Circumference	160.0 - 170.2	165	Yes

Technician



Approved



Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 2

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	56 %	Yes
Peak Resultant Acceleration	250 - 300 g	290.4 g	Yes
Peak Lateral Acceleration	15 g Max	-5.0 g	Yes
Oscillations After Main Pulse	Less Than 10% of Peak Resultant Acceleration?	Yes	Yes

Test meets specifications.

Comments:

Technician

Vincent D. King

Approved

Paul K. Stevens

08.09.2004 13:44:39 607







Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 2

Test Date 08/09/2004

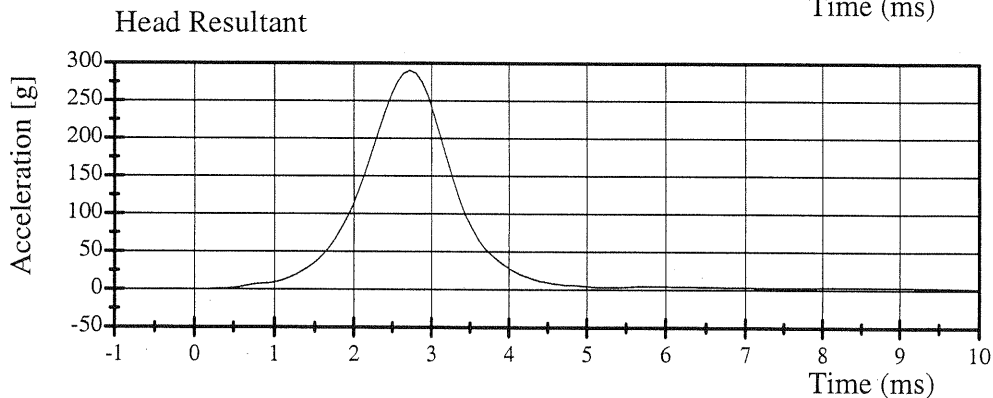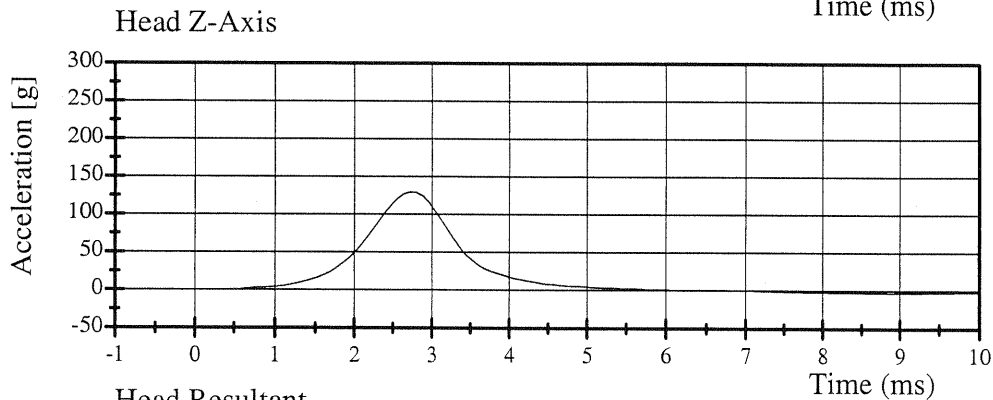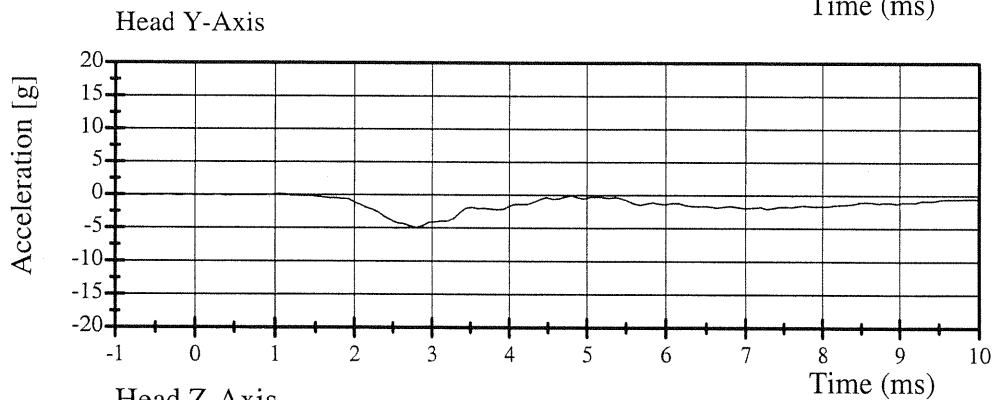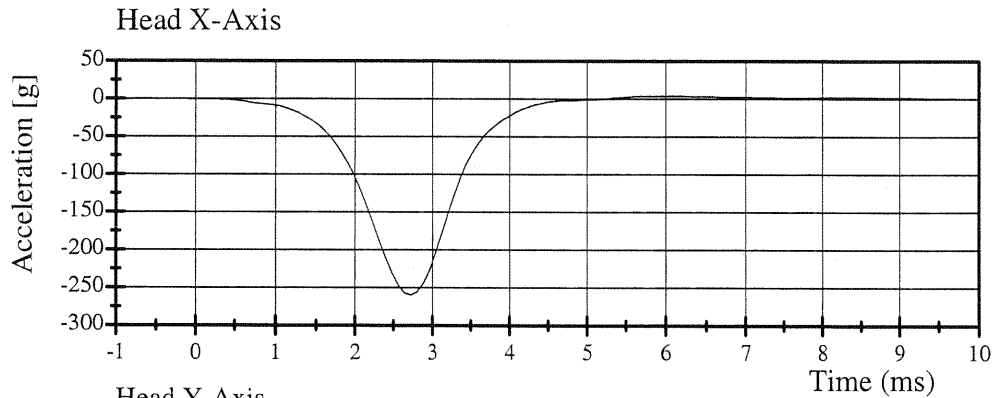

08.09.2004 13:44:40 607



Transportation Research Center Inc.

5720 Neck Flexion Test - 6 Channel Transducer

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	22.0 °C	Yes
Relative Humidity	10 - 70 %	49 %	Yes
Impact Velocity	6.89 - 7.13 m/s	7.10 m/s	Yes
Integrated Pendulum Velocity			
10 ms	2.10 - 2.50 m/s	2.36 m/s	Yes
20 ms	4.00 - 5.00 m/s	4.60 m/s	Yes
30 ms	5.80 - 7.00 m/s	6.62 m/s	Yes
Peak D Plane Rotation	77 - 91 °	80.4 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	69.0 - 83.0 N·m	73.60 N·m	Yes
Positive Moment Decay Time To 10 N·m	80 - 100 ms	87.28 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 07:45:27 509




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Integrated Pendulum Velocity

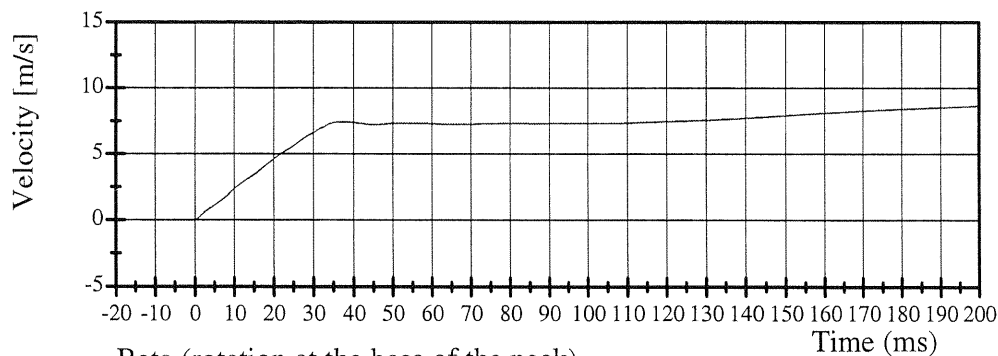


Filter Class: 180

Max: 9.3 m/s at 959.3 ms

Min: -0.0 m/s at -0.6 ms

Beta (rotation at the base of the neck)

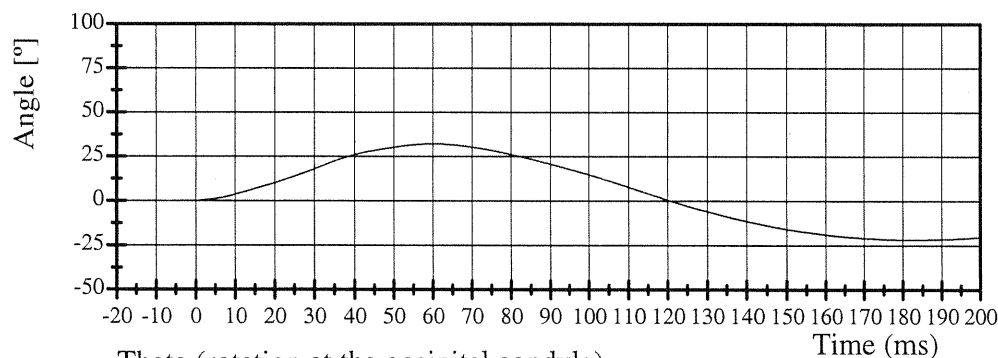


Filter Class: 60

Max: 32.3 ° at 60.1 ms

Min: -21.8 ° at 182.4 ms

Theta (rotation at the occipital condyle)

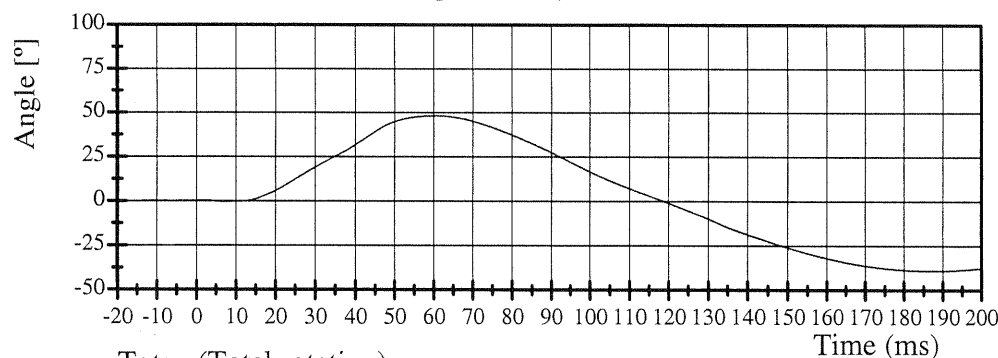


Filter Class: 60

Max: 48.2 ° at 60.3 ms

Min: -39.0 ° at 187.7 ms

Totan (Total rotation)

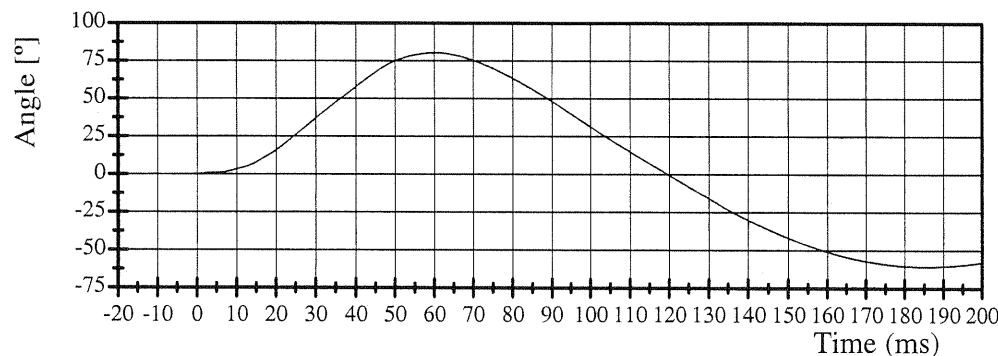

Filter Class: 60

Max: 80.4 ° at 60.2 ms

Min: -60.7 ° at 185.6 ms

08.09.2004 07:45:28 509




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Neck X-Axis Force

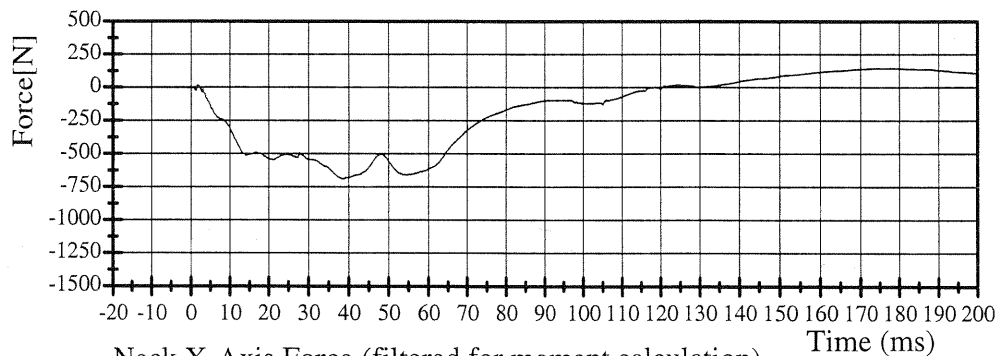


Filter Class: 1000

Max: 145.0 N at 178.0 ms

Min: -687.9 N at 38.6 ms

Neck X-Axis Force (filtered for moment calculation)

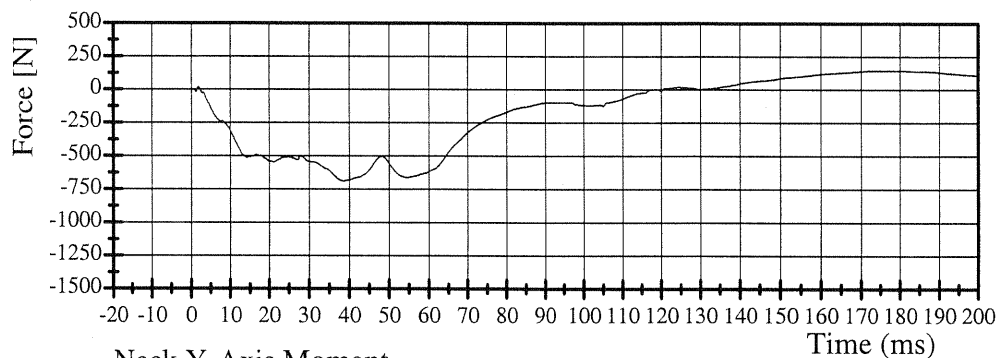


Filter Class: 600

Max: 144.2 N at 179.8 ms

Min: -687.9 N at 38.6 ms

Neck Y-Axis Moment

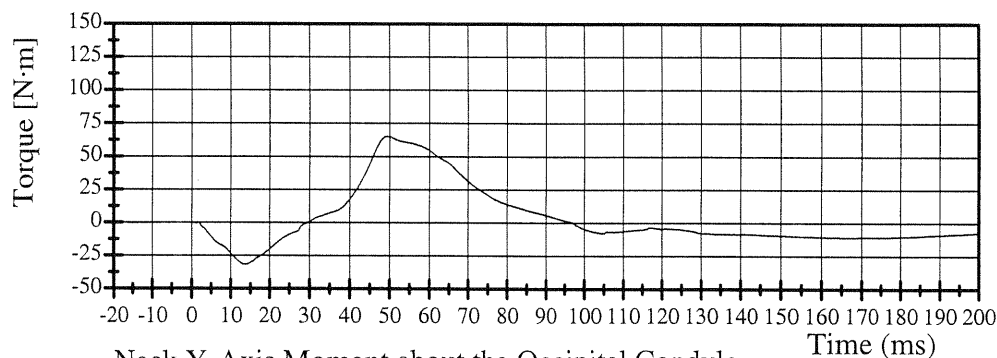


Filter Class: 600

Max: 65.3 N·m at 49.4 ms

Min: -31.5 N·m at 13.8 ms

Neck Y-Axis Moment about the Occipital Condyle

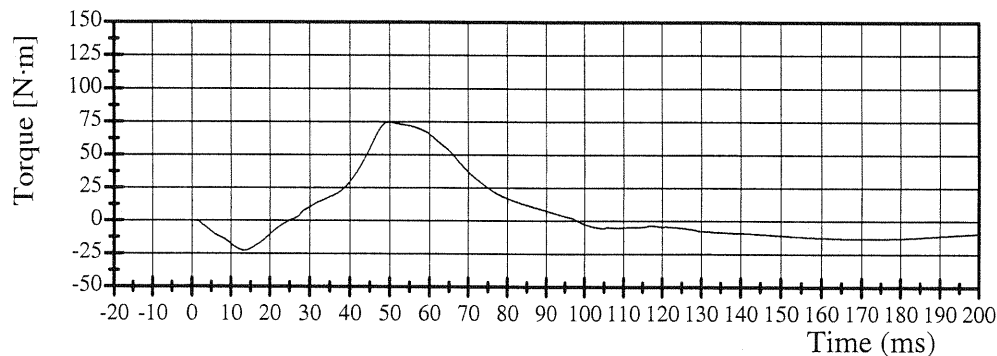

Filter Class: 600

Max: 74.9 N·m at 49.9 ms

Min: -22.6 N·m at 13.4 ms

08.09.2004 07:45:30 509



Transportation Research Center Inc.

5720 Neck Extension Test - 6 Channel Transducer

HIII 5th Female Serial No. 416 Calibration No. 26 - 1


Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	50 %	Yes
Impact Velocity	5.95 - 6.19 m/s	6.08 m/s	Yes
Integrated Pendulum Velocity			
10 ms	1.50 - 1.90 m/s	1.89 m/s	Yes
20 ms	3.10 - 3.90 m/s	3.64 m/s	Yes
30 ms	4.60 - 5.60 m/s	5.26 m/s	Yes
Peak D Plane Rotation	99 - 114 °	105.8 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	-65.0 - (-53.0) N·m	-60.79 N·m	Yes
Negative Moment Decay Time To -10 N·m	94 - 114 ms	103.28 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 08:31:42 597




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Integrated Pendulum Velocity

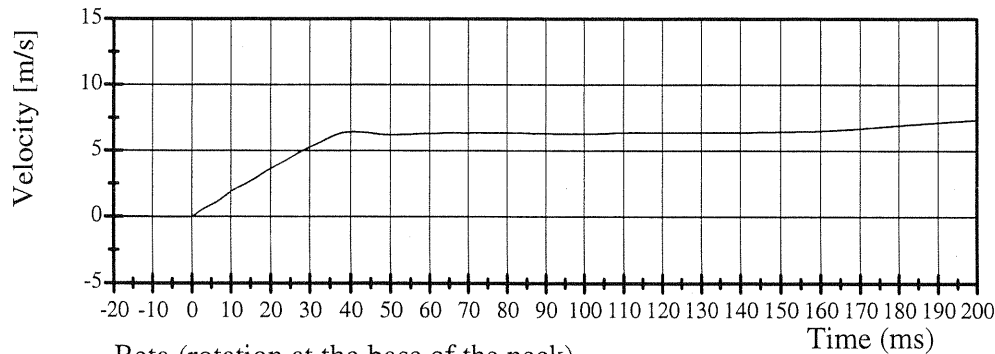


Filter Class: 180

Max: 8.0 m/s at 952.2 ms

Min: -0.0 m/s at -0.8 ms

Beta (rotation at the base of the neck)

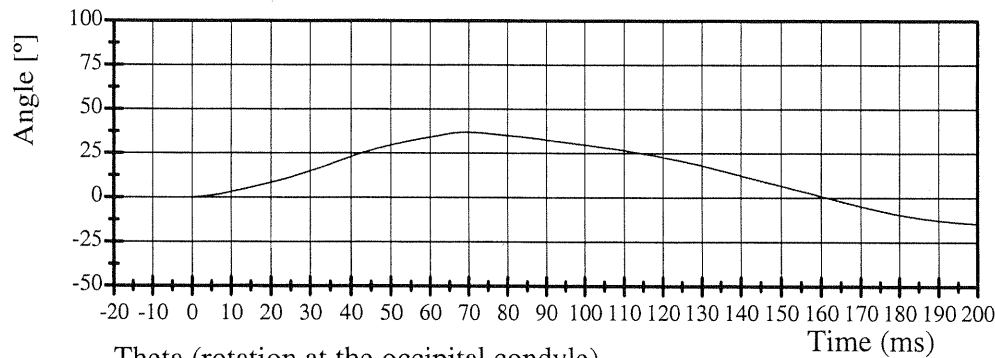


Filter Class: 60

Max: 36.8 ° at 69.0 ms

Min: -14.8 ° at 206.4 ms

Theta (rotation at the occipital condyle)

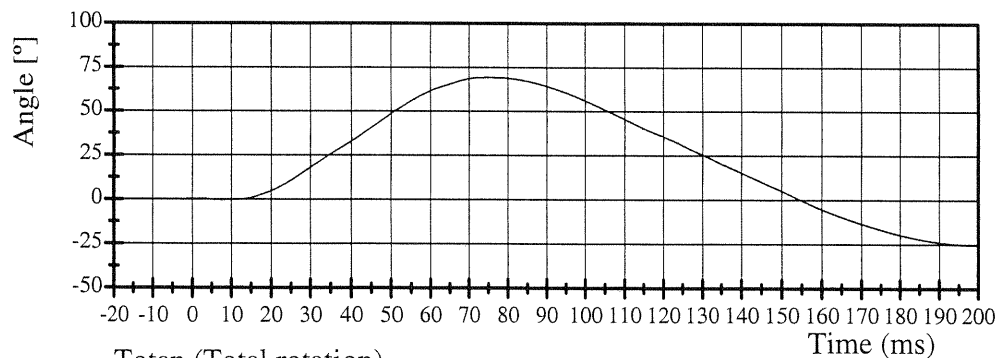


Filter Class: 60

Max: 69.3 ° at 75.1 ms

Min: -25.5 ° at 202.8 ms

Totan (Total rotation)

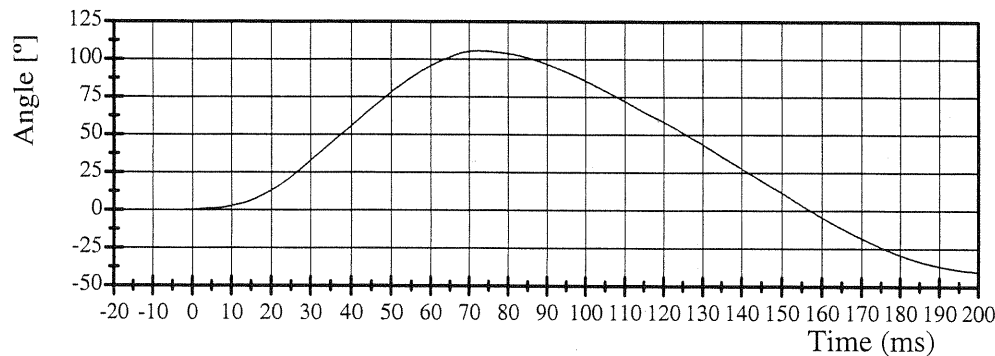

Filter Class: 60

Max: 105.8 ° at 72.5 ms

Min: -40.3 ° at 204.2 ms

08.09.2004 08:31:43 597




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Neck X-Axis Force

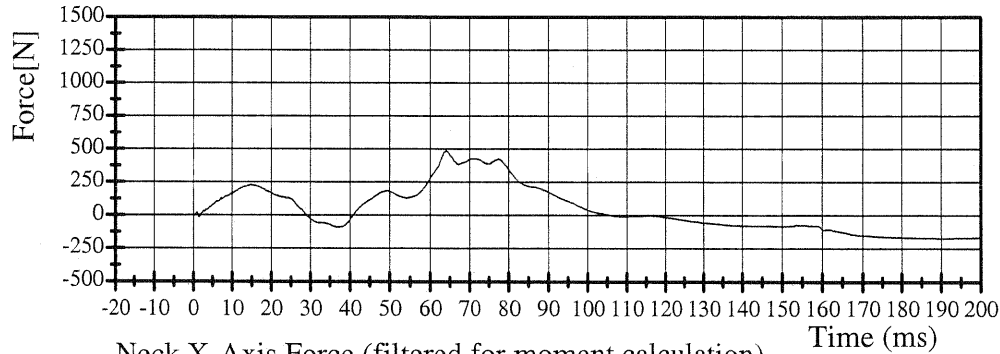


Filter Class: 1000

Max: 484.3 N at 64.1 ms

Min: -172.1 N at 191.6 ms

Neck X-Axis Force (filtered for moment calculation)

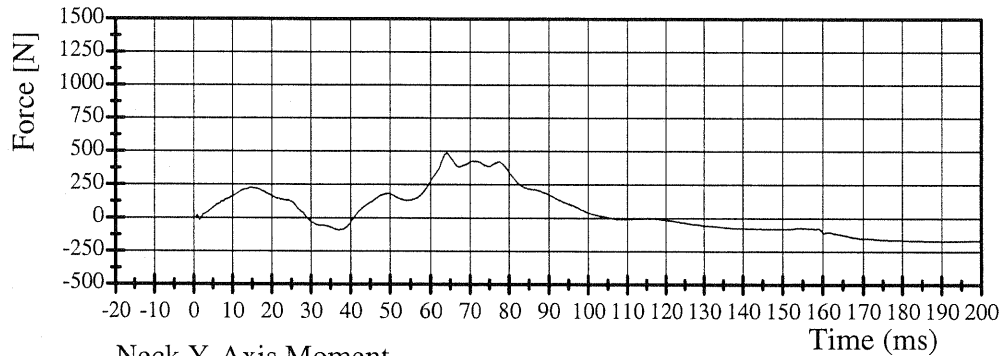


Filter Class: 600

Max: 484.0 N at 64.2 ms

Min: -171.7 N at 191.5 ms

Neck Y-Axis Moment

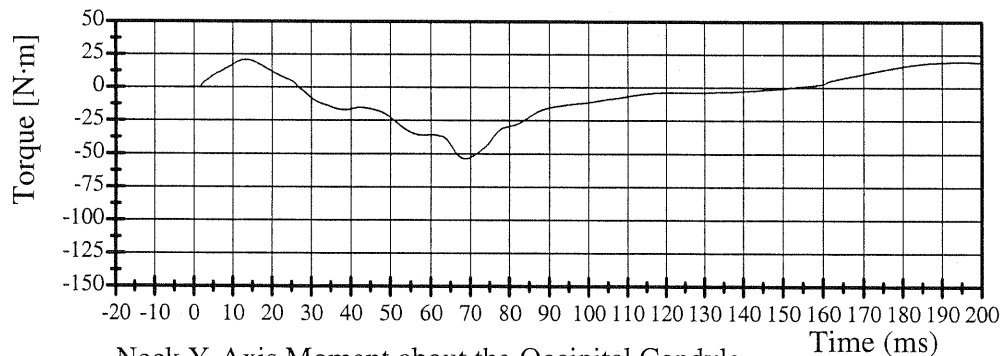


Filter Class: 600

Max: 20.9 N·m at 13.0 ms

Min: -53.6 N·m at 68.9 ms

Neck Y-Axis Moment about the Occipital Condyle

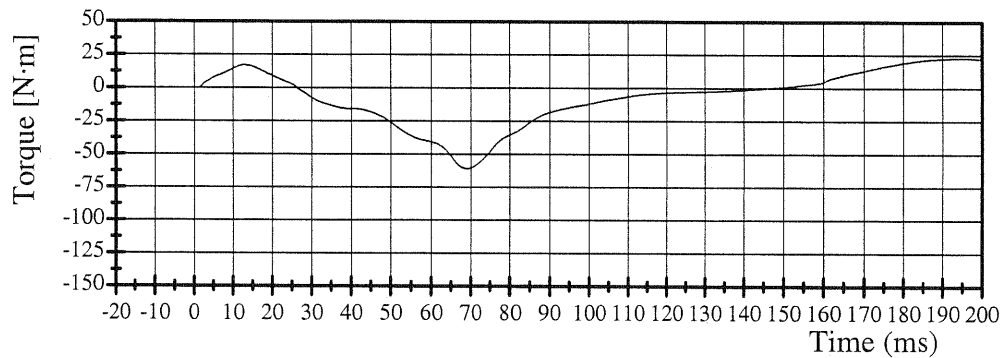

Filter Class: 600

Max: 22.7 N·m at 195.3 ms

Min: -60.8 N·m at 69.0 ms

08.09.2004 08:31:44 597



Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/10/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	57 %	Yes
Pendulum Velocity	6.59 - 6.83 m/s	6.60 m/s	Yes
Maximum Chest Deflection	-58.0 - (-50.0) mm	-52.7 mm	Yes
Peak Impact Probe Force Within Compression Corridor	3900 - 4400 N	4279 N	Yes
Peak Force Between 18 mm and 50 mm	4600 N	4266 N	Yes
Internal Hysteresis	69 - 85 %	71 %	Yes

Test meets specifications.

Comments:

Technician

Vincent Oliver

Approved

Paul A. Kenna

08.10.2004 10:45:47 1011




Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/10/2004

Pendulum Deceleration

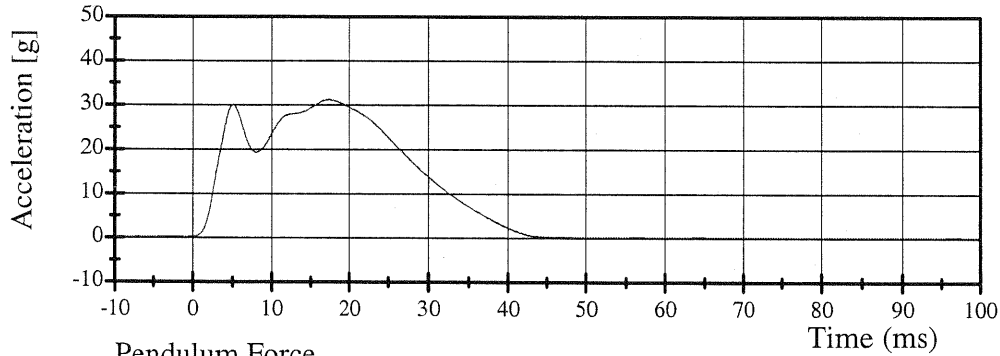


Filter Class: 180

Max: 31.2 g at 17.3 ms

Min: -1.5 g at 444.6 ms

Pendulum Force

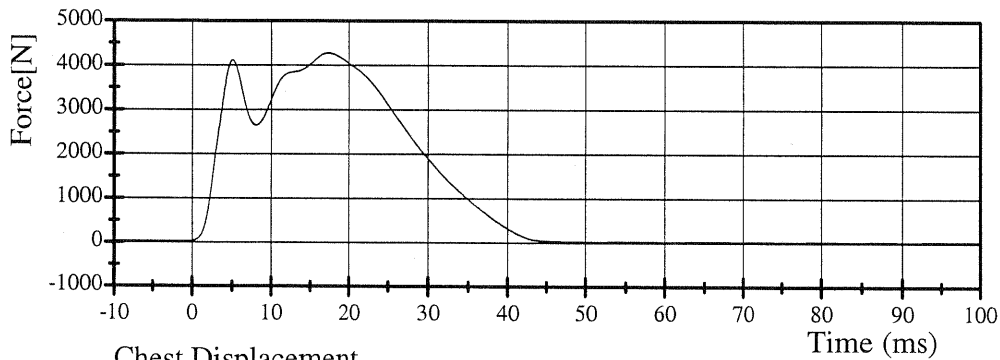


Filter Class: 180

Max: 4279.1 N at 17.3 ms

Min: -200.2 N at 444.6 ms

Chest Displacement

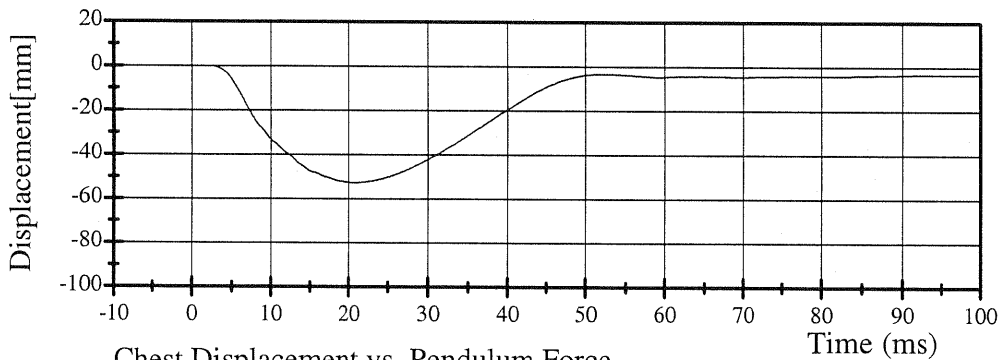


Filter Class: 600

Max: 0.0 mm at -63.8 ms

Min: -52.7 mm at 20.9 ms

Chest Displacement vs. Pendulum Force

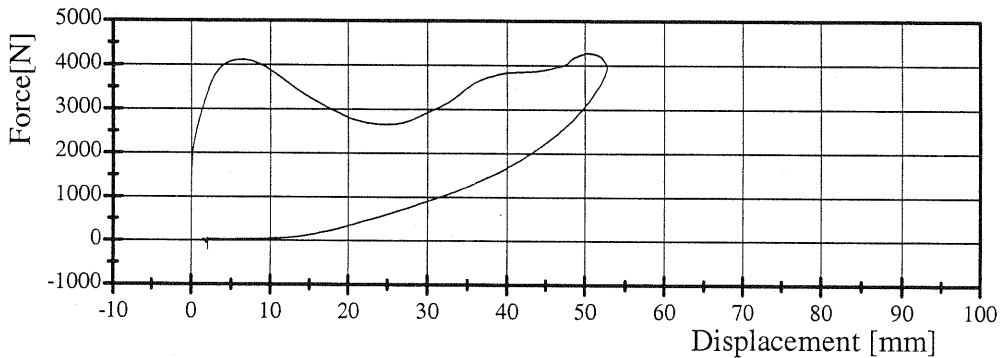

08.10.2004 10:45:48 1011



TRANSPORTATION RESEARCH CENTER INC.

TORSO FLEXION TEST

HYBRID III SMALL FEMALE

CAL DATE: 10-Aug-04

TRC, INC.

TEST NO: 416C26TF1

572 O SN416 TORSO FLEX CAL 26

TEST PARAMETER	SPECIFICATION	TEST RESULTS
TEMPERATURE	20.6 – 22.2° C	21.6 ° C
RELATIVE HUMIDITY	10 – 70 %	59 %
INITIAL ANGLE OF UNSUPPORTRED DUMMY	$\leq 20^{\circ}$ REFERENCED TO VERTICAL	17.8°
MAXIMUM FORCE AT 45 DEG. DURING 10 SECOND PERIOD	320 – 390 N	387.8N
RETURN ANGLE		22.5°
DIFFERENCE BETWEEN RETURN ANGLE & INTIAL ANGLE	$\pm 8^{\circ}$ OF INTIAL ANGLE	4.7 °
RATE	0.5° - 1.5°/sec	0.98 °/sec

TEST MEETS SPECIFICATIONS

Comments:

TECHNICIAN



Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1


Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	52 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.08 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3625 N	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 13:31:19 1848





Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

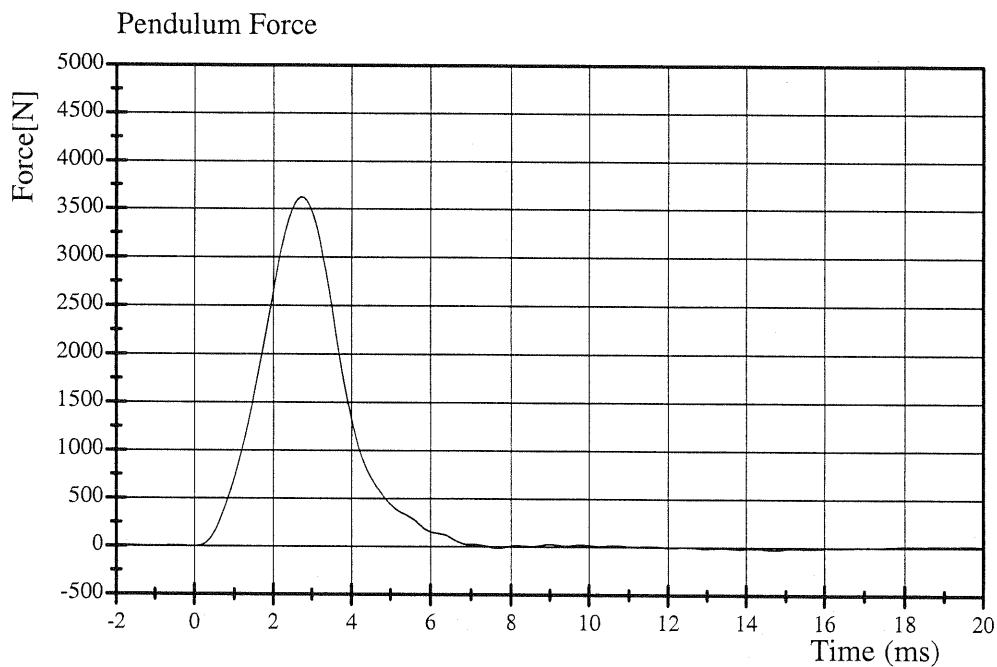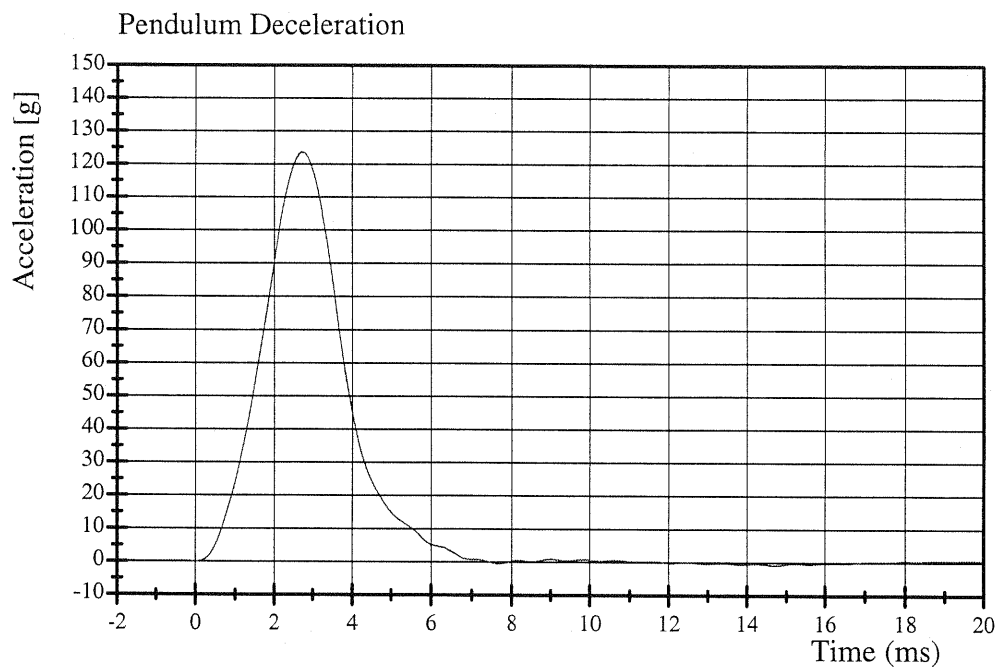

08.09.2004 13:31:20 1848



Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	53 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.08 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3578 N	Yes

Test meets specifications.

Comments:

Technician

Vincent Oliver

Approved

David A. Brown

08.09.2004 13:39:07 1850




Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/09/2004

Pendulum Deceleration

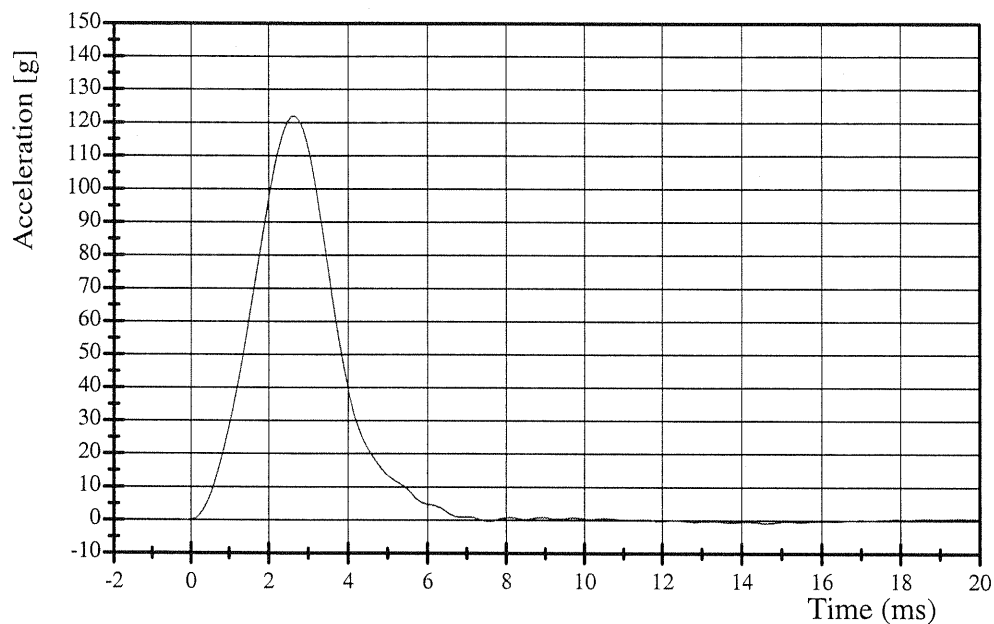


Filter Class: 600

Max: 122.0 g at 2.6 ms

Min: -0.8 g at 14.6 ms

Pendulum Force

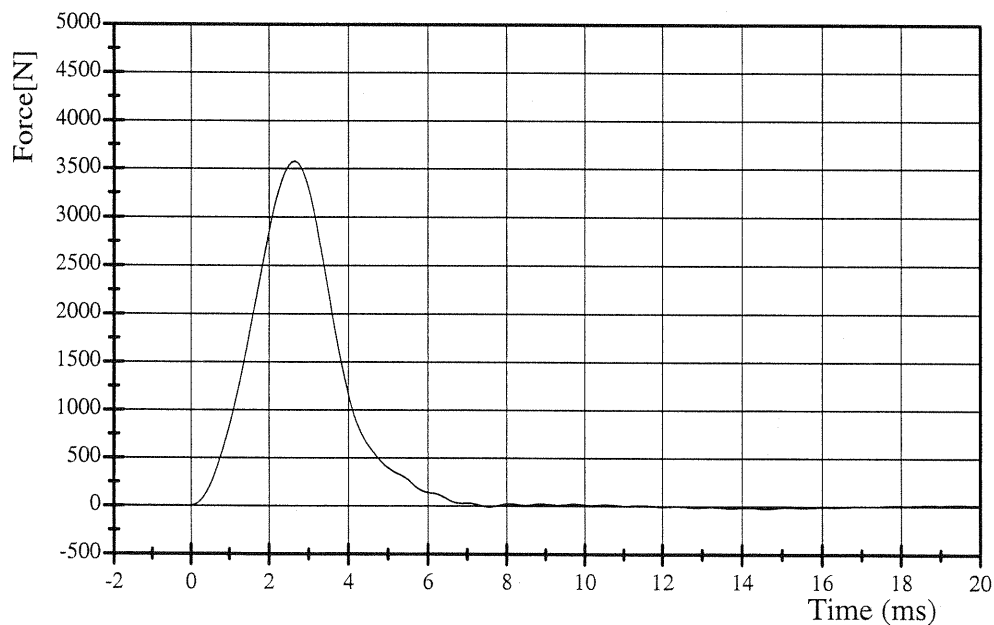

Filter Class: 600

Max: 3578.3 N at 2.6 ms

Min: -24.6 N at 14.6 ms

08.09.2004 13:39:08 1850



Transportation Research Center Inc.

5720 Thor Left Knee Slider Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 2


Test Date 08/10/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	55 %	Yes
Pendulum Velocity	2.70 - 2.80 m/s	2.78 m/s	Yes
Knee Displacement	-15.5 - (-12.7) mm	-13.7 mm	Yes


Test meets specifications.

Comments:

Technician



Approved



08.10.2004 07:48:17 1182




Transportation Research Center Inc.

5720 Thor Left Knee Slider Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 2

Test Date 08/10/2004

Femur Force

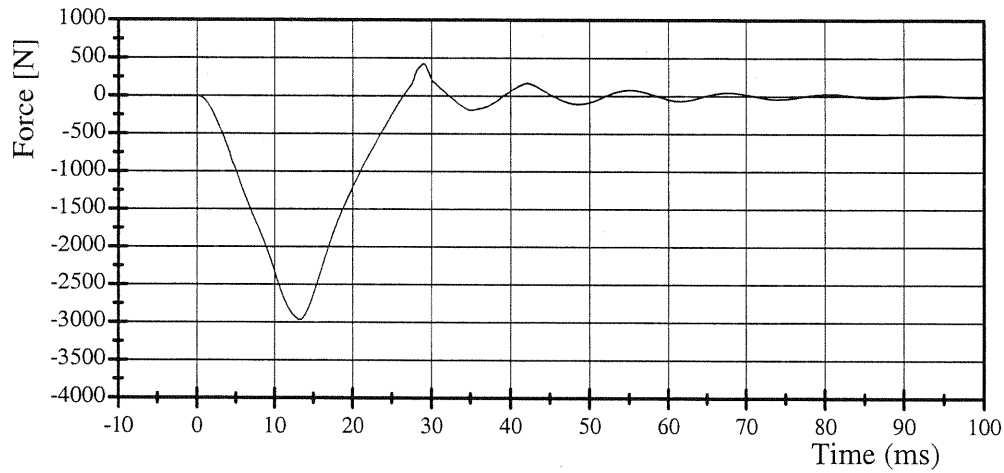


Filter Class: 600

Max: 425.8 N at 29.0 ms

Min: -2969.4 N at 13.2 ms

Tibia Displacement

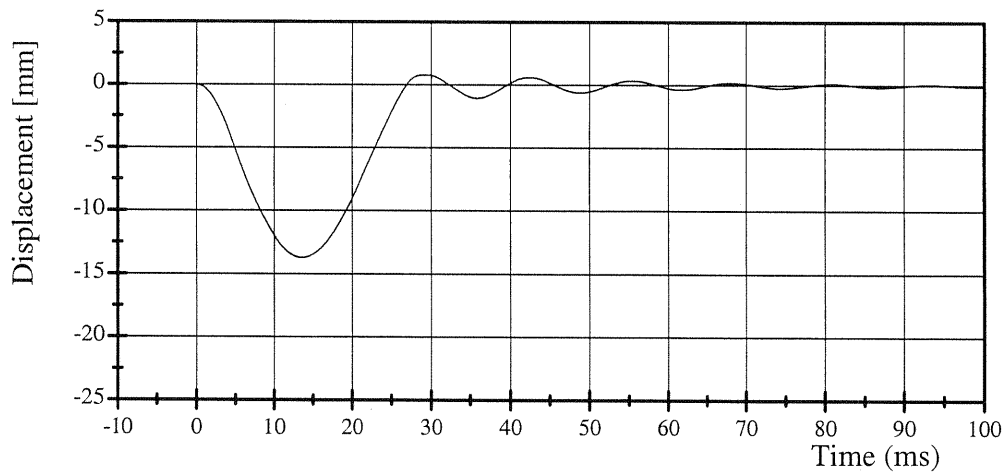


Filter Class: 180

Max: 0.8 mm at 29.3 ms

Min: -13.7 mm at 13.5 ms

Femur Force vs Tibia Displacement

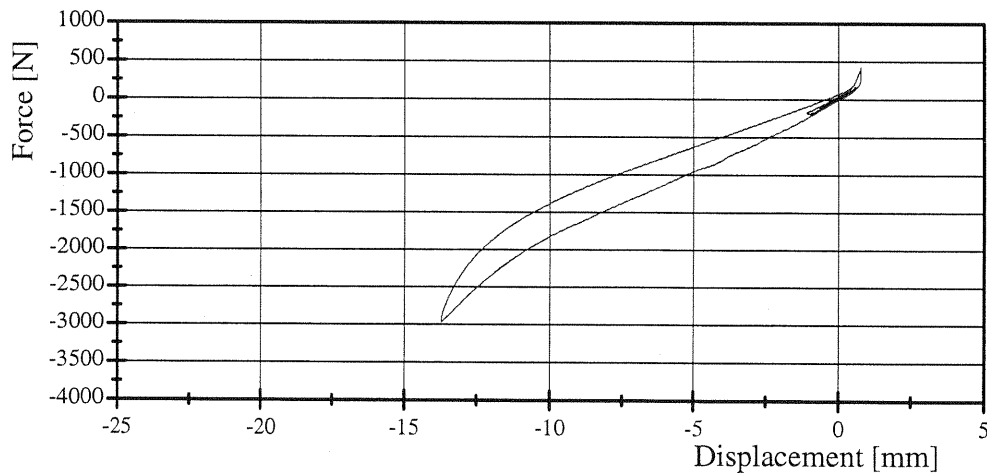

08.10.2004 07:48:18 1182



Transportation Research Center Inc.

5720 Thor Right Knee Slider Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/10/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.5 °C	Yes
Relative Humidity	10 - 70 %	55 %	Yes
Pendulum Velocity	2.70 - 2.80 m/s	2.78 m/s	Yes
Knee Displacement	-15.5 - (-12.7) mm	-13.2 mm	Yes


Test meets specifications.

Comments:

Technician



Approved



08.10.2004 08:23:02 1181






Transportation Research Center Inc.

5720 Thor Right Knee Slider Test

HIII 5th Female Serial No. 416 Calibration No. 26 - 1

Test Date 08/10/2004

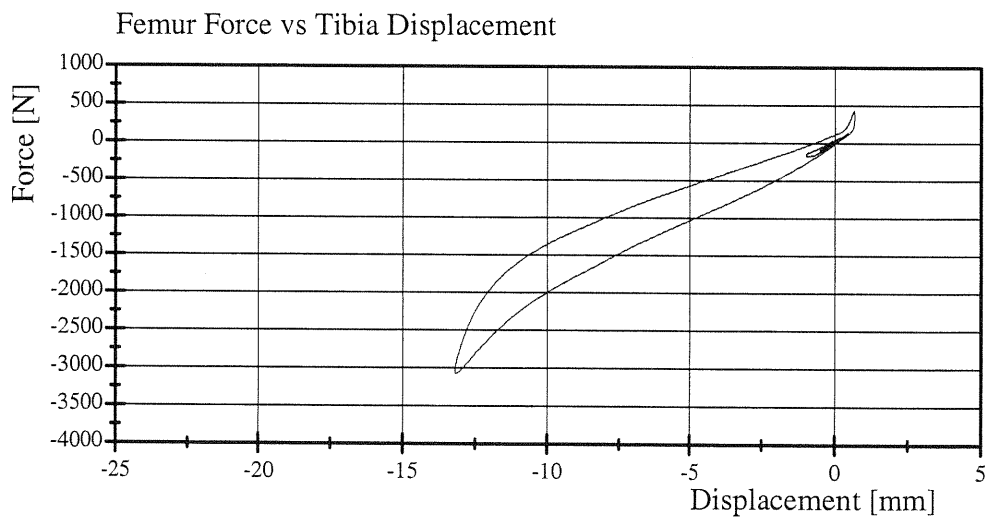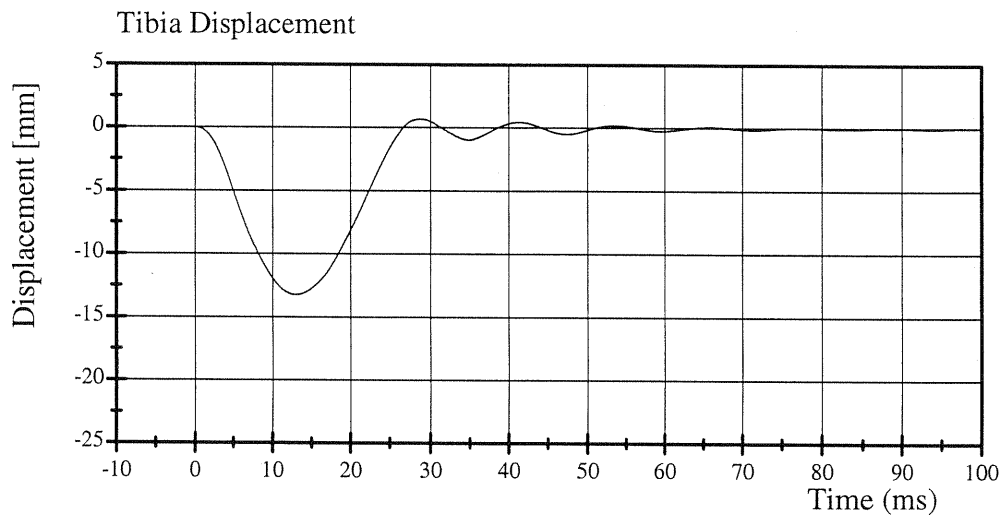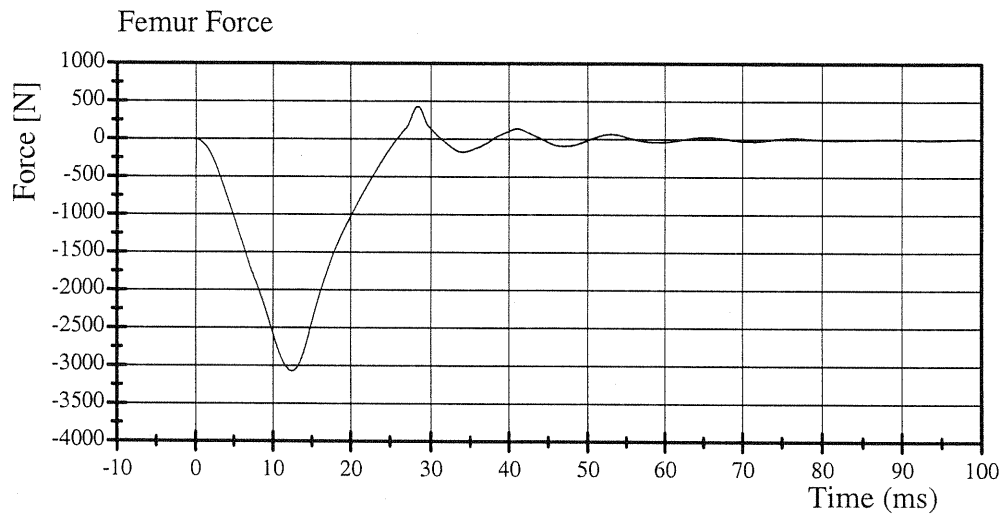

08.10.2004 08:23:03 1181




Pre-Test Calibration

Front Passenger Dummy S/N 048


Transportation Research Center Inc.
5720 HIII 5th Dummy
External Dimensions
Serial No. 048 Calibration No. 16

Symbol	Description	Specification	Results	Pass
		mm	mm	
A	Total Sitting Height	774.7 - 800.1	784	Yes
B	Shoulder Pivot Height	431.8 - 457.2	450	Yes
C	Hip Pivot Height	81.3 - 86.3	84	Yes
D	Hip Pivot from Backline	144.8 - 149.8	145	Yes
E	Shoulder Pivot from Backline	68.6 - 83.8	78	Yes
F	Thigh Clearance	119.4 - 134.6	126	Yes
G	Back of Elbow to Wrist Pivot	243.9 - 259.1	247	Yes
H	Head Back to Backline	43.2 - 48.2	44	Yes
I	Shoulder to Elbow Length	276.8 - 297.2	284	Yes
J	Elbow Rest Height	182.8 - 203.2	192	Yes
K	Buttock Knee Length	520.7 - 546.1	543	Yes
L	Popliteal Height	355.6 - 376.0	357	Yes
M	Knee Pivot Height	393.7 - 419.1	396	Yes
N	Buttock Popliteal Length	414.0 - 439.4	428	Yes
O	Chest Depth without Jacket	175.3 - 190.5	184	Yes
P	Foot Length	218.5 - 233.7	220	Yes
R	Buttock to Knee Pivot Length	457.2 - 482.6	482	Yes
S	Head Breadth	137.1 - 147.3	140	Yes
T	Head Depth	177.8 - 188.0	184	Yes
U	Hip Breadth	299.7 - 314.9	303	Yes
V	Shoulder Breadth	350.5 - 365.7	360	Yes
W	Foot Breadth	78.8 - 94.0	83	Yes
X	Head Circumference	528.3 - 548.7	543	Yes
Y	Chest Circumference with Jacket	850.9 - 881.3	861	Yes
Z	Waist Circumference	759.5 - 789.9	786	Yes
AA	Reference Location for Chest Circumference	332.7 - 358.1	350	Yes
BB	Reference Location for Waist Circumference	160.0 - 170.2	165	Yes

Technician



Approved



Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.2 °C	Yes
Relative Humidity	10 - 70 %	54 %	Yes
Peak Resultant Acceleration	250 - 300 g	258.5 g	Yes
Peak Lateral Acceleration	15 g Max	-11.3 g	Yes
Oscillations After Main Pulse	Less Than 10% of Peak Resultant Acceleration?	Yes	Yes

Test meets specifications.

Comments:

Technician



Approved



07.28.2004 09:27:40 612







Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

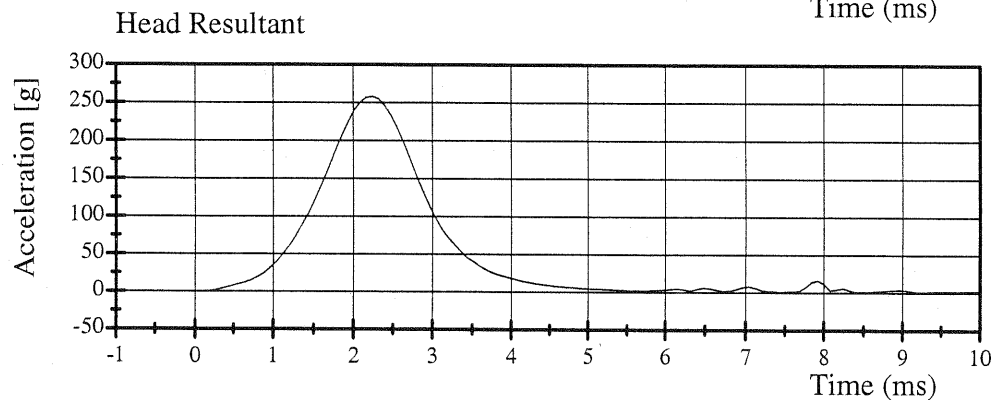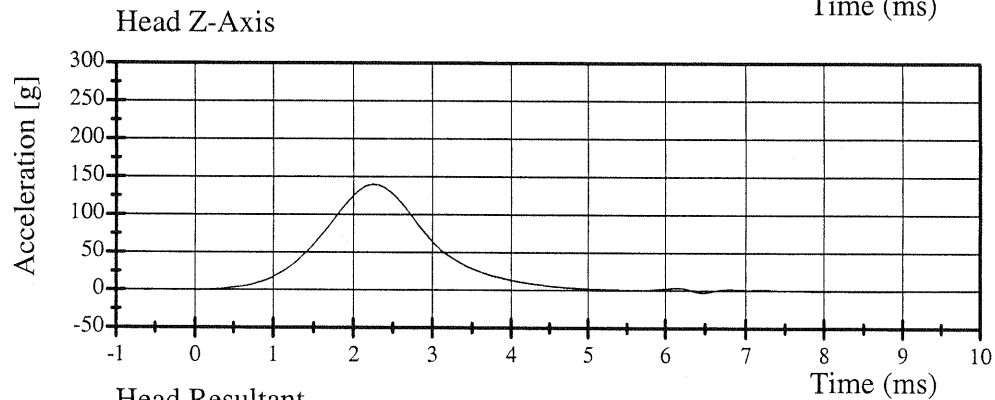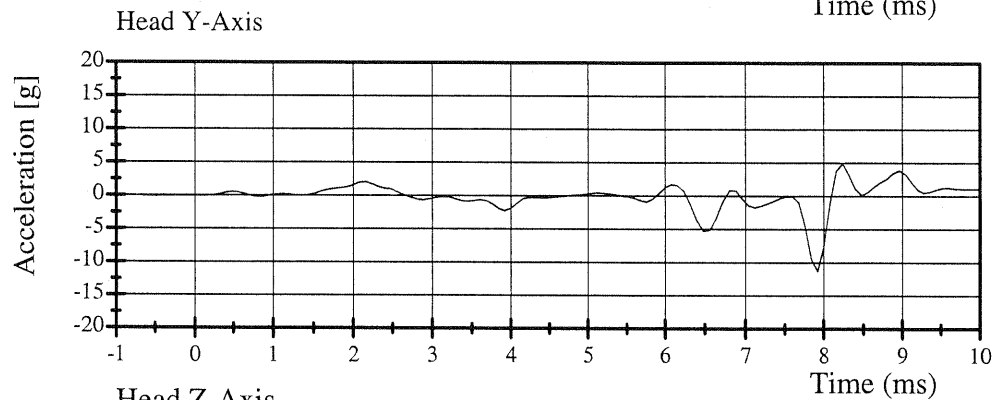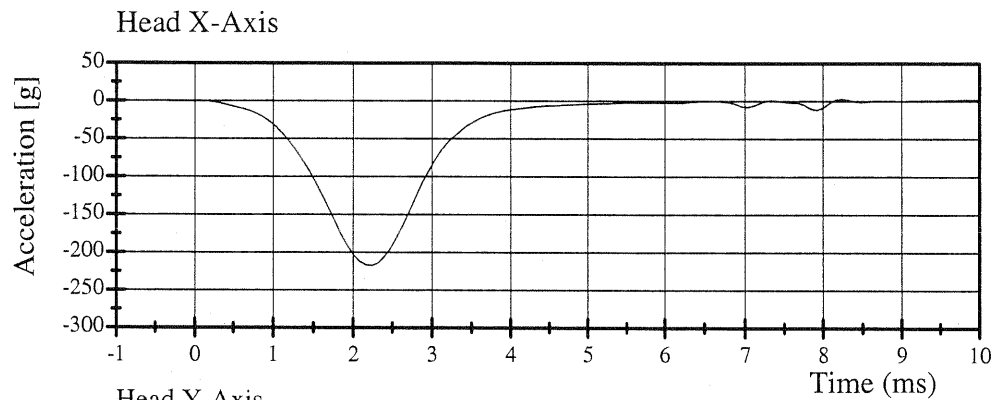

07.28.2004 09:27:41 612



Transportation Research Center Inc.

5720 Neck Flexion Test - 6 Channel Transducer

HIII 5th Female Serial No. 048 Calibration No. 16 - 1


Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	20.8 °C	Yes
Relative Humidity	10 - 70 %	52 %	Yes
Impact Velocity	6.89 - 7.13 m/s	7.06 m/s	Yes
Integrated Pendulum Velocity			
10 ms	2.10 - 2.50 m/s	2.37 m/s	Yes
20 ms	4.00 - 5.00 m/s	4.61 m/s	Yes
30 ms	5.80 - 7.00 m/s	6.54 m/s	Yes
Peak D Plane Rotation	77 - 91 °	79.5 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	69.0 - 83.0 N·m	76.30 N·m	Yes
Positive Moment Decay Time To 10 N·m	80 - 100 ms	89.60 ms	Yes

Test meets specifications.

Comments:

Technician



Approved



07.28.2004 08:30:55 510




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Integrated Pendulum Velocity

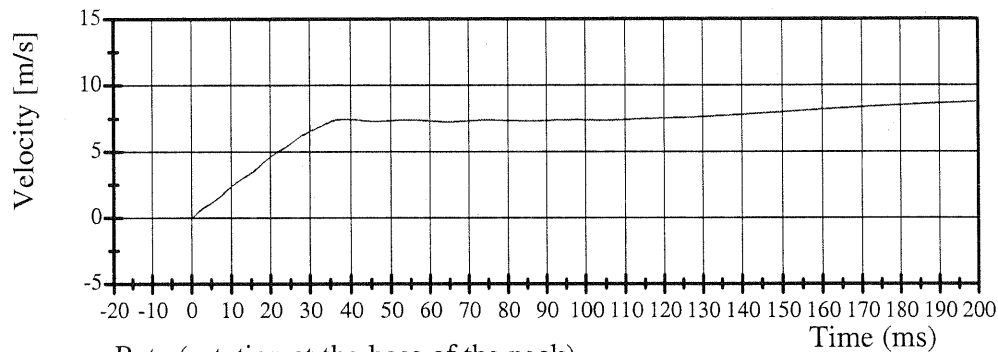


Filter Class: 180

Max: 9.6 m/s at 959.2 ms

Min: -0.0 m/s at -0.7 ms

Beta (rotation at the base of the neck)

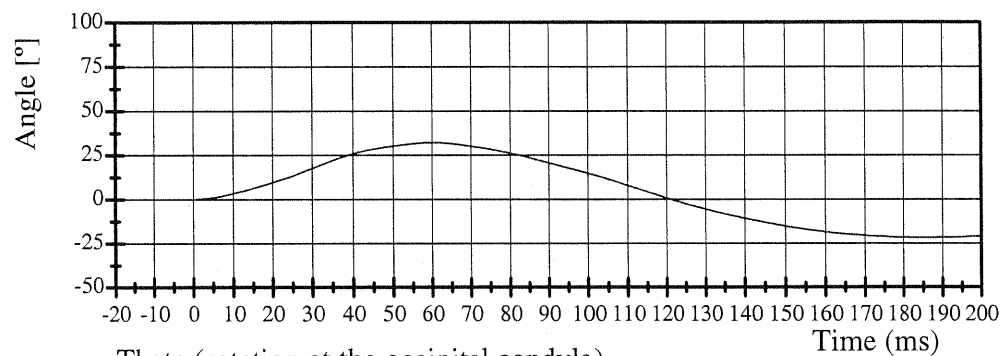


Filter Class: 60

Max: 32.2 ° at 60.1 ms

Min: -21.8 ° at 185.5 ms

Theta (rotation at the occipital condyle)

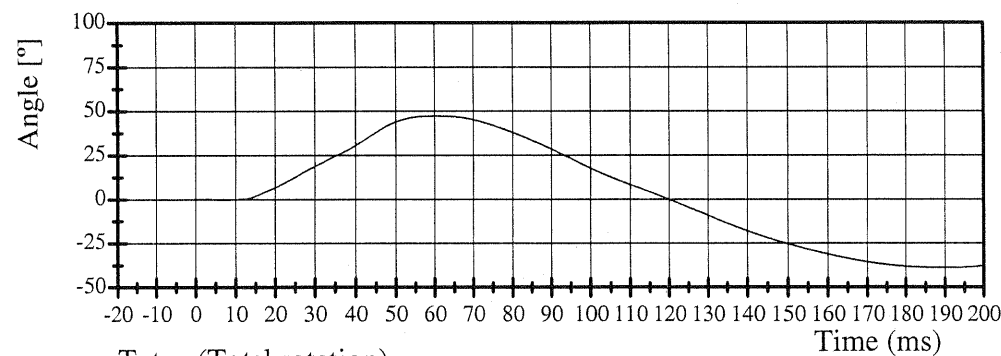


Filter Class: 60

Max: 47.3 ° at 60.4 ms

Min: -38.8 ° at 190.0 ms

Totan (Total rotation)

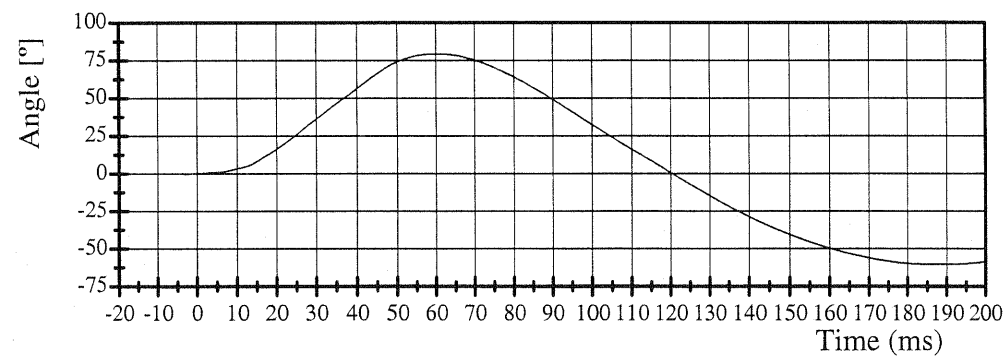

Filter Class: 60

Max: 79.5 ° at 60.2 ms

Min: -60.5 ° at 187.4 ms

07.28.2004 08:30:56 510




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Neck X-Axis Force

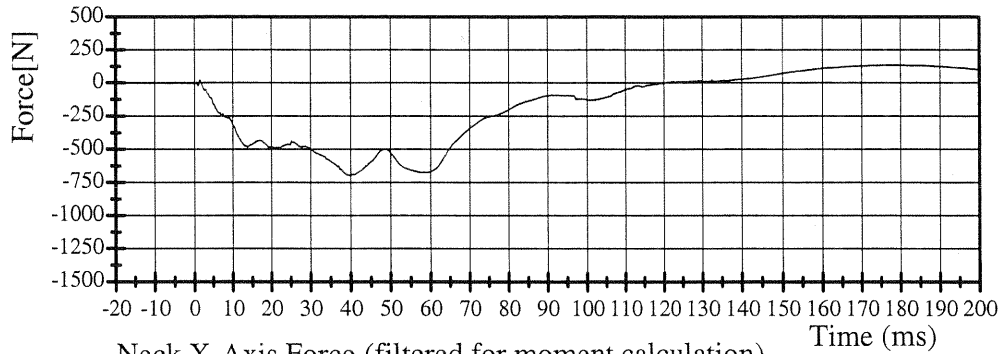


Filter Class: 1000

Max: 135.9 N at 179.0 ms

Min: -695.5 N at 39.7 ms

Neck X-Axis Force (filtered for moment calculation)

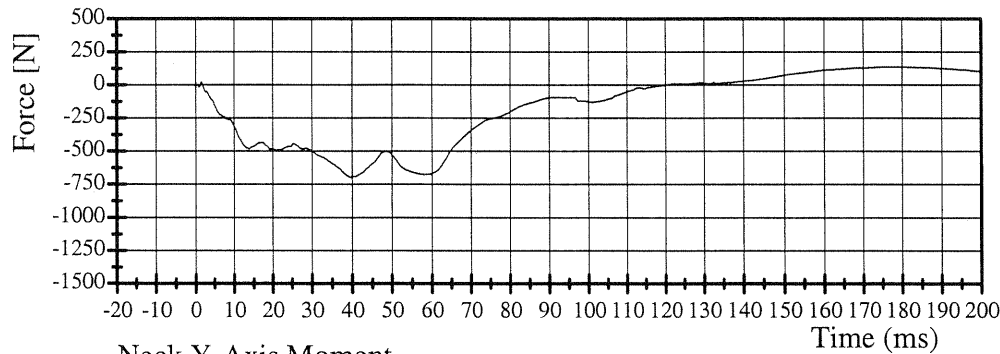


Filter Class: 600

Max: 135.7 N at 179.1 ms

Min: -695.1 N at 39.6 ms

Neck Y-Axis Moment

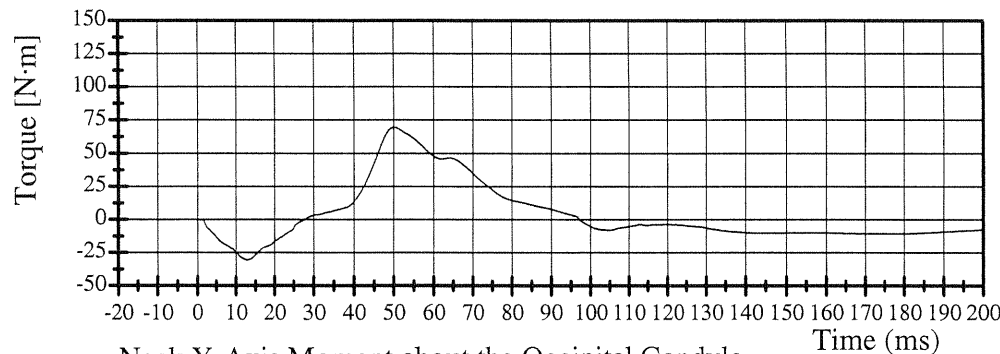


Filter Class: 600

Max: 69.6 N·m at 50.2 ms

Min: -30.4 N·m at 12.8 ms

Neck Y-Axis Moment about the Occipital Condyle

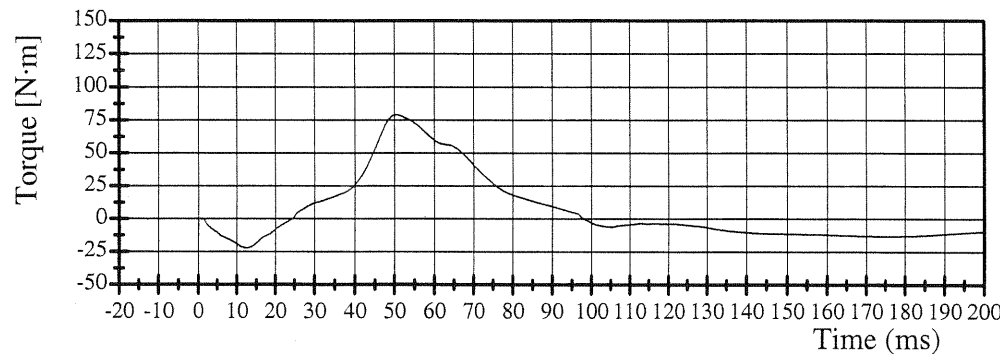

Filter Class: 600

Max: 79.2 N·m at 50.5 ms

Min: -22.1 N·m at 12.6 ms

07.28.2004 08:30:57 510



Transportation Research Center Inc.

5720 Neck Extension Test - 6 Channel Transducer

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.1 °C	Yes
Relative Humidity	10 - 70 %	55 %	Yes
Impact Velocity	5.95 - 6.19 m/s	6.11 m/s	Yes
Integrated Pendulum Velocity			
10 ms	1.50 - 1.90 m/s	1.72 m/s	Yes
20 ms	3.10 - 3.90 m/s	3.39 m/s	Yes
30 ms	4.60 - 5.60 m/s	5.04 m/s	Yes
Peak D Plane Rotation	99 - 114 °	107.8 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	-65.0 - (-53.0) N·m	-53.80 N·m	Yes
Negative Moment Decay Time To -10 N·m	94 - 114 ms	108.96 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



07.28.2004 09:01:17 594




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Integrated Pendulum Velocity

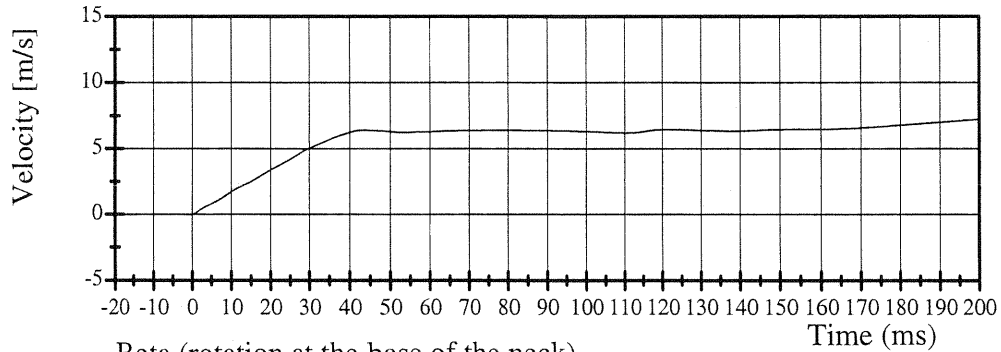


Filter Class: 180

Max: 8.1 m/s at 952.5 ms

Min: -0.0 m/s at -0.6 ms

Beta (rotation at the base of the neck)

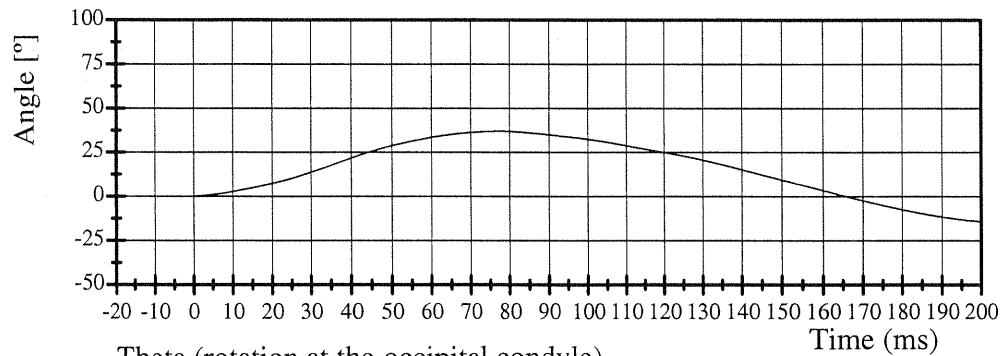


Filter Class: 60

Max: 37.0 ° at 77.3 ms

Min: -15.5 ° at 213.0 ms

Theta (rotation at the occipital condyle)

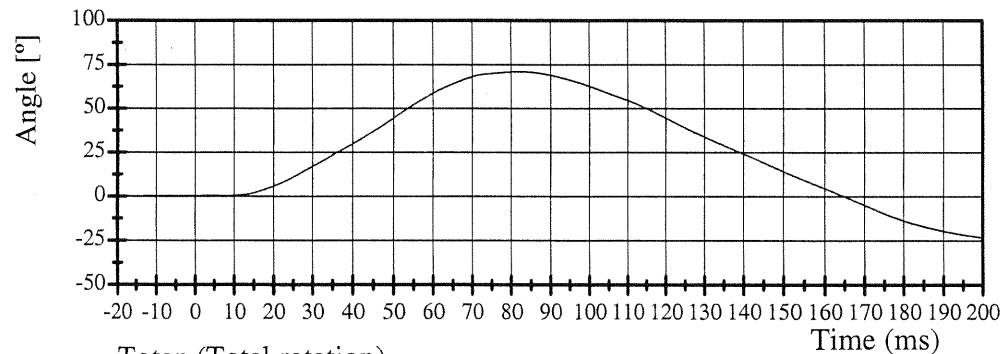


Filter Class: 60

Max: 71.0 ° at 82.2 ms

Min: -24.6 ° at 211.2 ms

Totan (Total rotation)

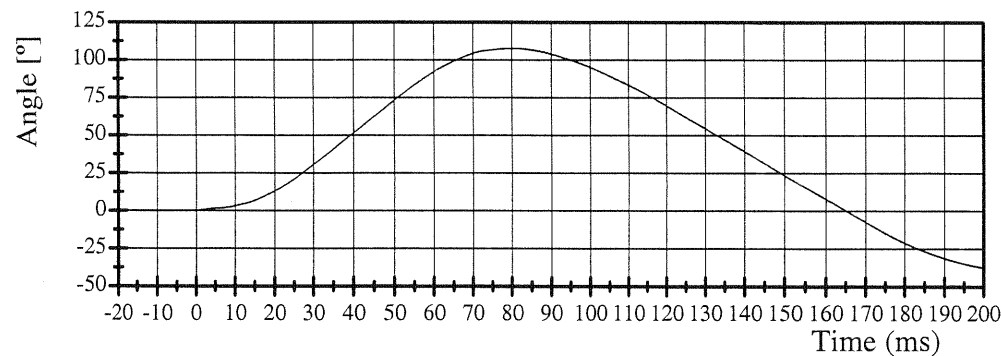

Filter Class: 60

Max: 107.8 ° at 80.2 ms

Min: -40.1 ° at 211.8 ms

07.28.2004 09:01:18 594




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Neck X-Axis Force

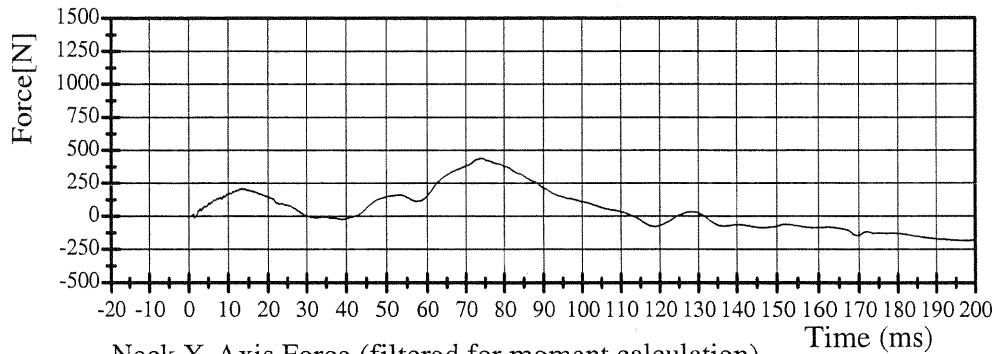


Filter Class: 1000

Max: 438.7 N at 74.0 ms

Min: -182.9 N at 196.8 ms

Neck X-Axis Force (filtered for moment calculation)

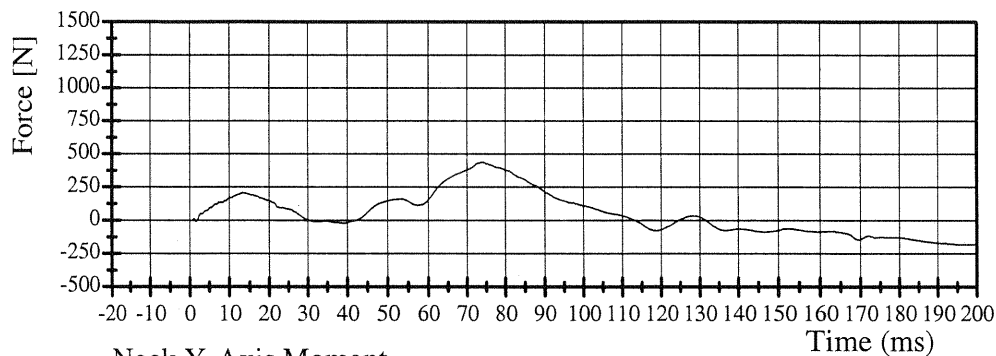


Filter Class: 600

Max: 438.3 N at 74.1 ms

Min: -182.8 N at 196.9 ms

Neck Y-Axis Moment

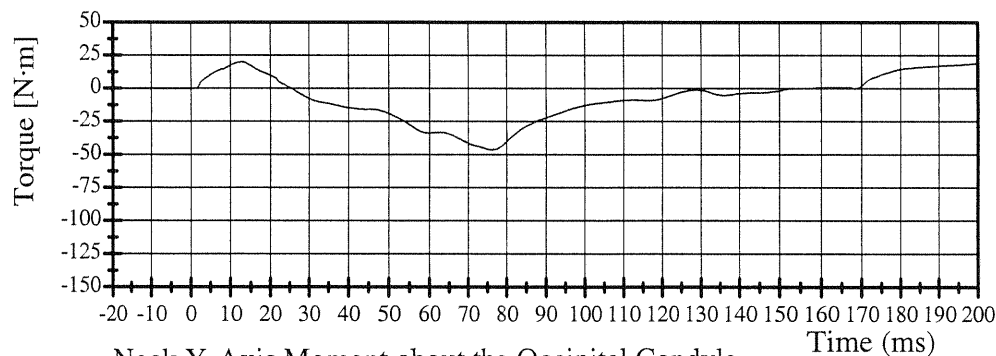


Filter Class: 600

Max: 20.0 N·m at 12.8 ms

Min: -46.3 N·m at 76.0 ms

Neck Y-Axis Moment about the Occipital Condyle

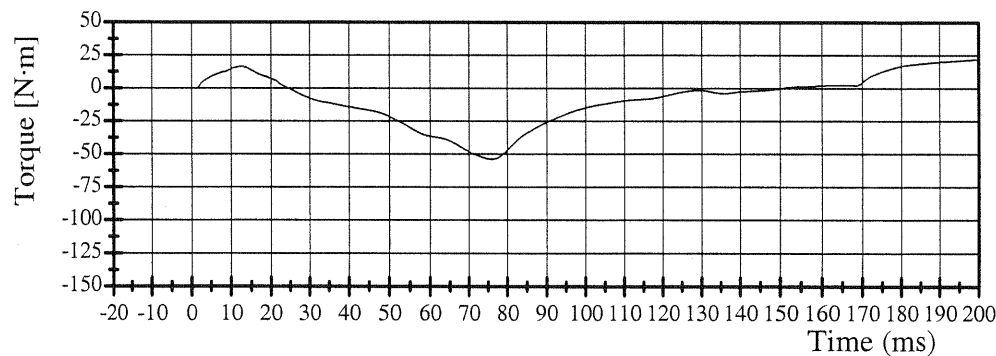

Filter Class: 600

Max: 22.8 N·m at 206.8 ms

Min: -53.8 N·m at 75.8 ms

07.28.2004 09:01:19 594



Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1


Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.1 °C	Yes
Relative Humidity	10 - 70 %	50 %	Yes
Pendulum Velocity	6.59 - 6.83 m/s	6.74 m/s	Yes
Maximum Chest Deflection	-58.0 - (-50.0) mm	-54.9 mm	Yes
Peak Impact Probe Force Within Compression Corridor	3900 - 4400 N	4399 N	Yes
Peak Force Between 18 mm and 50 mm	4600 N	4339 N	Yes
Internal Hysteresis	69 - 85 %	74 %	Yes


Test meets specifications.

Comments:

Technician



Approved



07.28.2004 13:54:28 970




Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Pendulum Deceleration

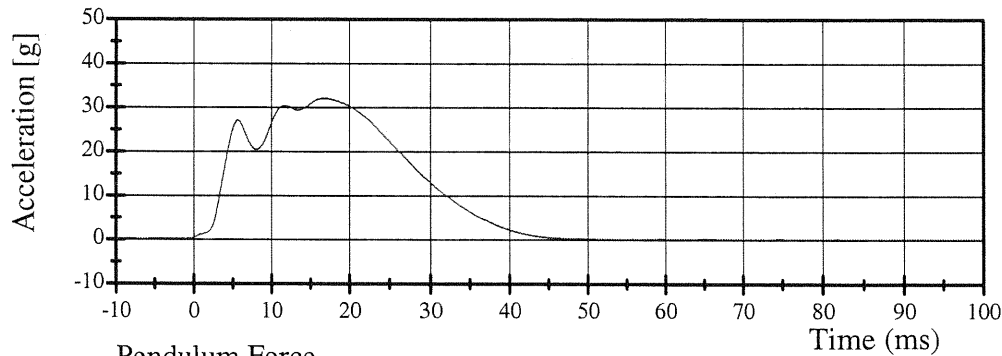


Filter Class: 180

Max: 32.1 g at 16.8 ms

Min: -0.0 g at -67.9 ms

Pendulum Force

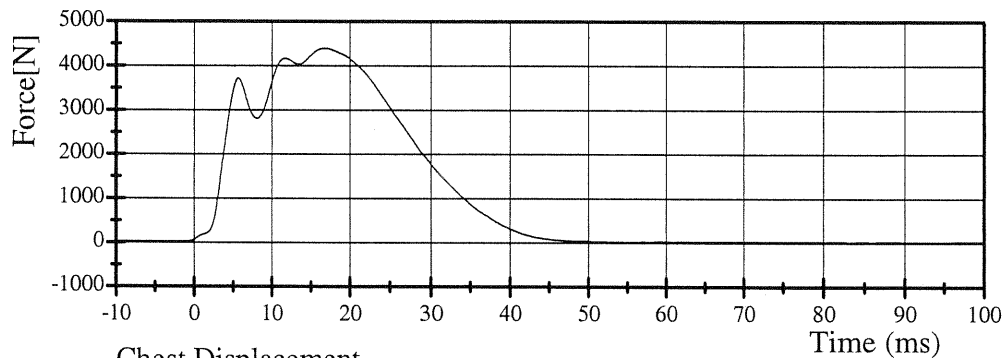


Filter Class: 180

Max: 4399.5 N at 16.8 ms

Min: -6.3 N at -67.9 ms

Chest Displacement

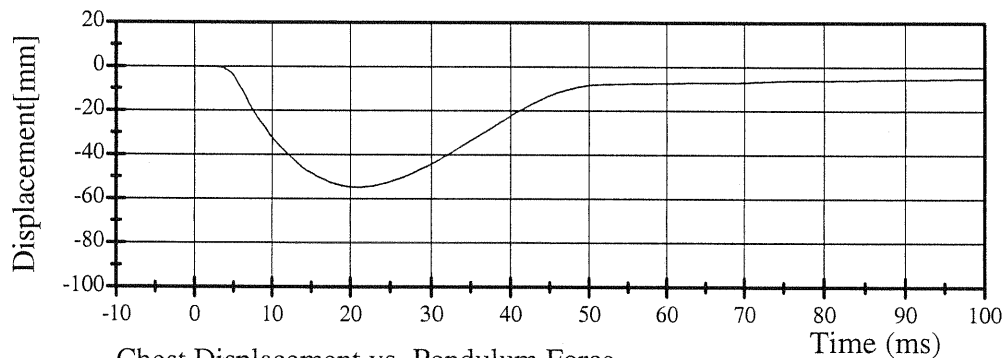


Filter Class: 600

Max: 0.0 mm at -77.5 ms

Min: -54.9 mm at 21.0 ms

Chest Displacement vs. Pendulum Force

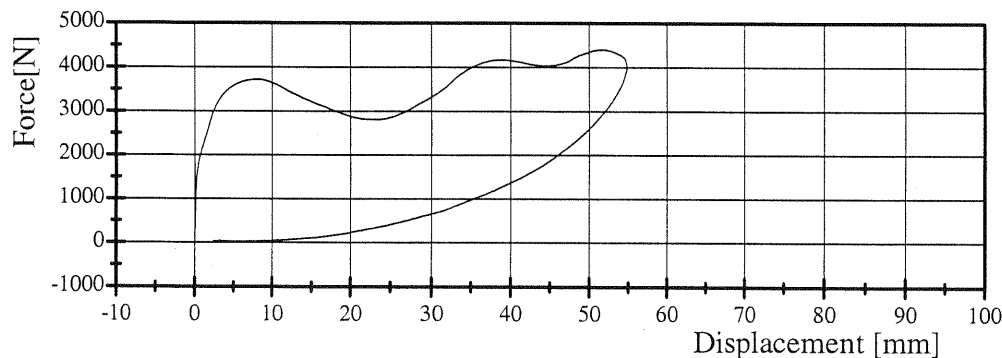

07.28.2004 13:54:29 970



TRANSPORTATION RESEARCH CENTER INC.

TORSO FLEXION TEST

HYBRID III SMALL FEMALE

CAL DATE: 28-Jul-04

TRC, INC. TEST NO: 048C16TF3 572 O SN048 TORSO FLEX CAL 16

TEST PARAMETER	SPECIFICATION	TEST RESULTS
TEMPERATURE	20.6 – 22.2° C	21.1 ° C
RELATIVE HUMIDITY	10 – 70 %	53 %
INITIAL ANGLE OF UNSUPPORTRED DUMMY	<= 20° REFERENCED TO VERTICAL	18.2 °
MAXIMUM FORCE AT 45 DEG. DURING 10 SECOND PERIOD	320 – 390 N	328.8 N
RETURN ANGLE		21.6 °
DIFFERENCE BETWEEN RETURN ANGLE & INTIAL ANGLE	+/- 8 ° OF INTIAL ANGLE	3.4 °
RATE	0.5° - 1.5 °/sec	.98 °/sec

TEST MEETS SPECIFICATIONS

Comments:

Torqued Lumbar Spine to 11 in-lbs

TECHNICIAN



Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	52 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.10 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3551 N	Yes


Test meets specifications.

Comments:

Technician



Approved



07.28.2004 10:24:03 1728




Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Pendulum Deceleration

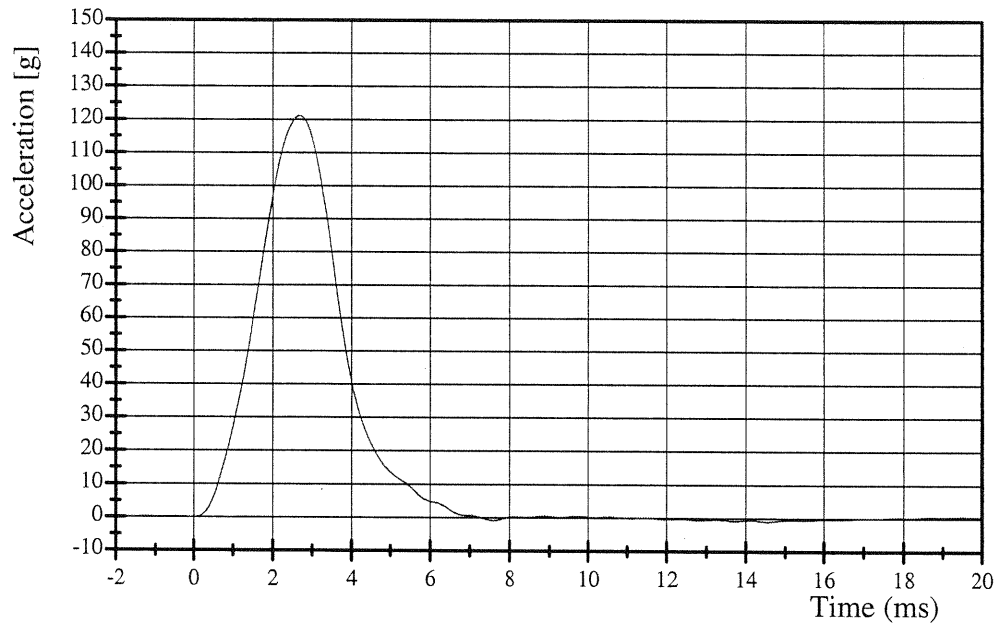


Filter Class: 600

Max: 121.1 g at 2.6 ms

Min: -1.0 g at 14.6 ms

Pendulum Force

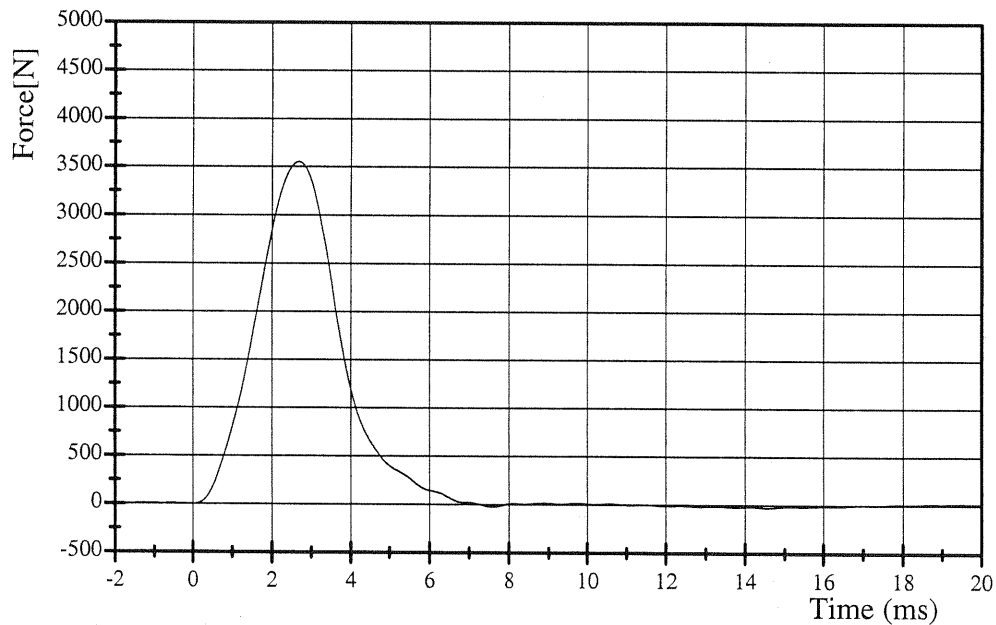

Filter Class: 600

Max: 3551.2 N at 2.6 ms

Min: -28.7 N at 14.6 ms

Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1


Test Date 07/28/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	51 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.10 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3718 N	Yes


Test meets specifications.

Comments:

Technician



Approved



07.28.2004 10:29:32 1733




Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 048 Calibration No. 16 - 1

Test Date 07/28/2004

Pendulum Deceleration

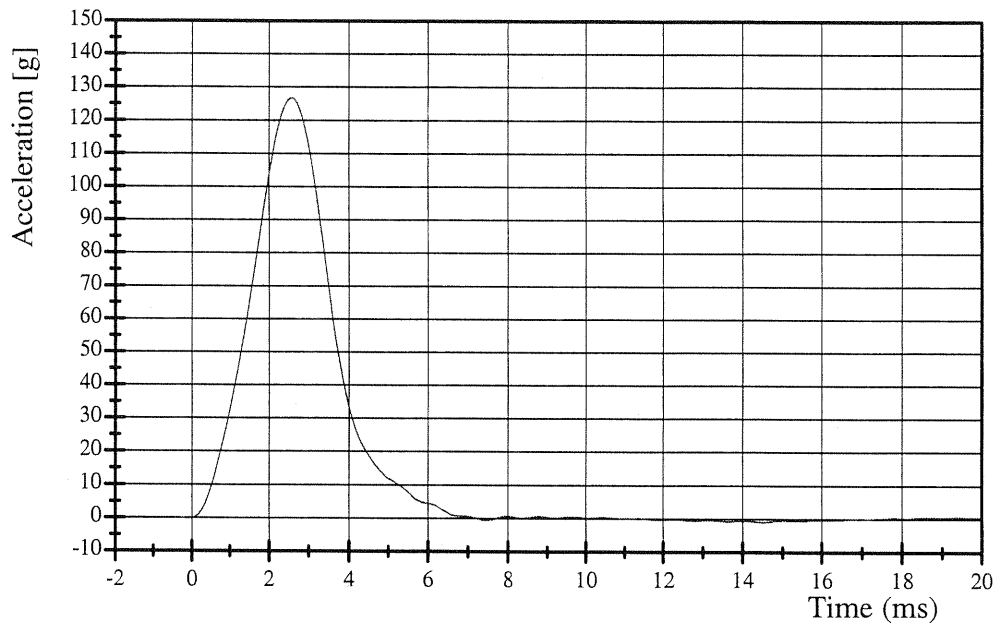


Filter Class: 600

Max: 126.8 g at 2.6 ms

Min: -0.9 g at 14.5 ms

Pendulum Force

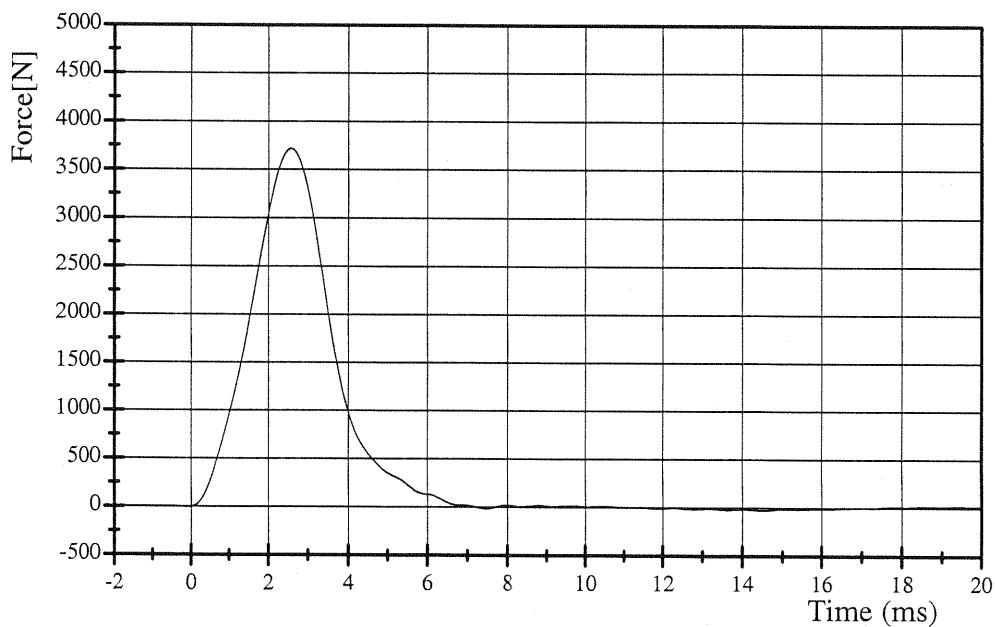

Filter Class: 600

Max: 3717.9 N at 2.6 ms

Min: -27.6 N at 14.5 ms

Pre-Test Calibration

Rear Passenger Dummy S/N 070


Transportation Research Center Inc.
5720 HIII 5th Female Dummy
External Dimensions
Serial No. 070 Calibration No. 05
Date:

Symbol	Description	Specification	Results	Pass
		mm	mm	
A	Total Sitting Height	774.7 - 800.1	786	Yes
B	Shoulder Pivot Height	431.8 - 457.2	449	Yes
C	Hip Pivot Height	81.3 - 86.3	86	Yes
D	Hip Pivot from Backline	144.8 - 149.8	147	Yes
E	Shoulder Pivot from Backline	68.6 - 83.8	77	Yes
F	Thigh Clearance	119.4 - 134.6	128	Yes
G	Back of Elbow to Wrist Pivot	243.9 - 259.1	247	Yes
H	Head Back to Backline	43.2 - 48.2	45	Yes
I	Shoulder to Elbow Length	276.8 - 297.2	280	Yes
J	Elbow Rest Height	182.8 - 203.2	194	Yes
K	Buttock Knee Length	520.7 - 546.1	539	Yes
L	Popliteal Height	355.6 - 376.0	358	Yes
M	Knee Pivot Height	393.7 - 419.1	397	Yes
N	Buttock Popliteal Height	414.0 - 439.4	417	Yes
O	Chest Depth without Jacket	175.3 - 190.5	184	Yes
P	Foot Length	218.5 - 233.7	220	Yes
R	Buttock to Knee Pivot Length	457.2 - 482.6	477	Yes
S	Head Breadth	137.1 - 147.3	140	Yes
T	Head Depth	177.8 - 188.0	181	Yes
U	Hip Breadth	299.7 - 314.9	303	Yes
V	Shoulder Breadth	350.5 - 365.7	360	Yes
W	Foot Breadth	78.8 - 94.0	85	Yes
X	Head Circumference	528.3 - 548.7	542	Yes
Y	Chest Circumference with Jacket	850.9 - 881.3	860	Yes
Z	Waist Circumference	759.5 - 789.9	777	Yes
AA	Reference Location for Chest Circumference	332.7 - 358.1	350	Yes
BB	Reference Location for Waist Circumference	160.0 - 170.2	165	Yes

Technician



Approved



Transportation Research Center Inc.

5720 Head Drop Test

HHH 5th Female Serial No. 070 Calibration No. 05 - 1


Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	52 %	Yes
Peak Resultant Acceleration	250 - 300 g	271.6 g	Yes
Peak Lateral Acceleration	15 g Max	4.0 g	Yes
Oscillations After Main Pulse	Less Than 10% of Peak Resultant Acceleration?	Yes	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 14:03:54 608







Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

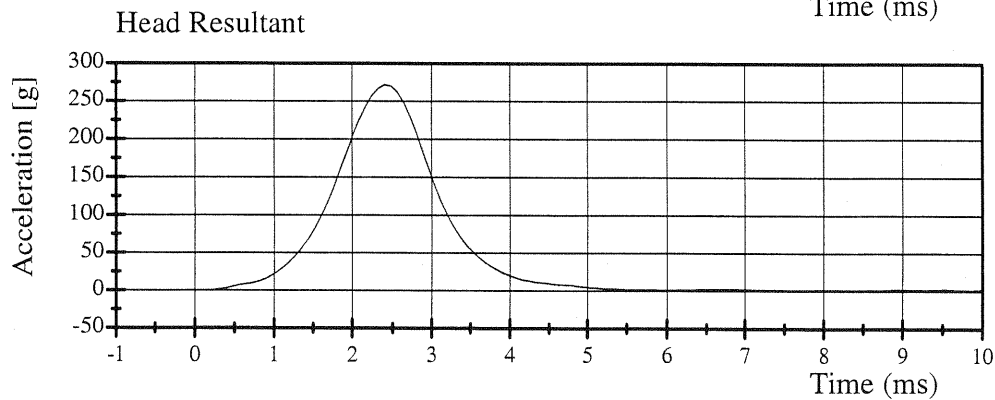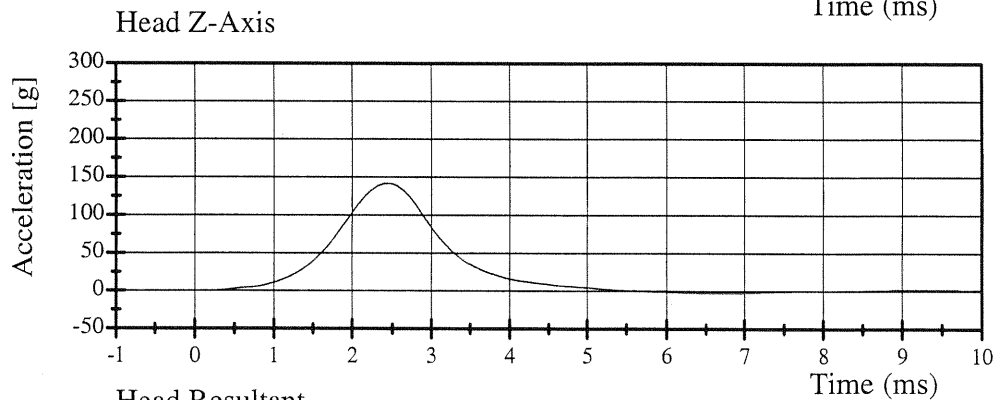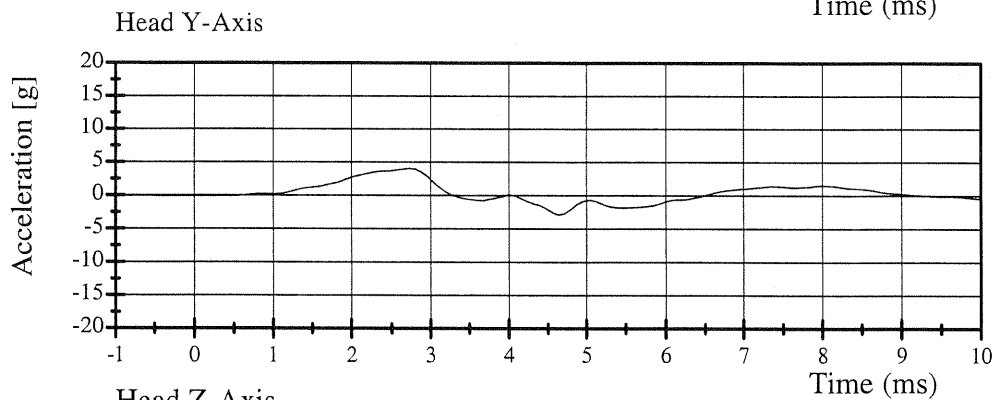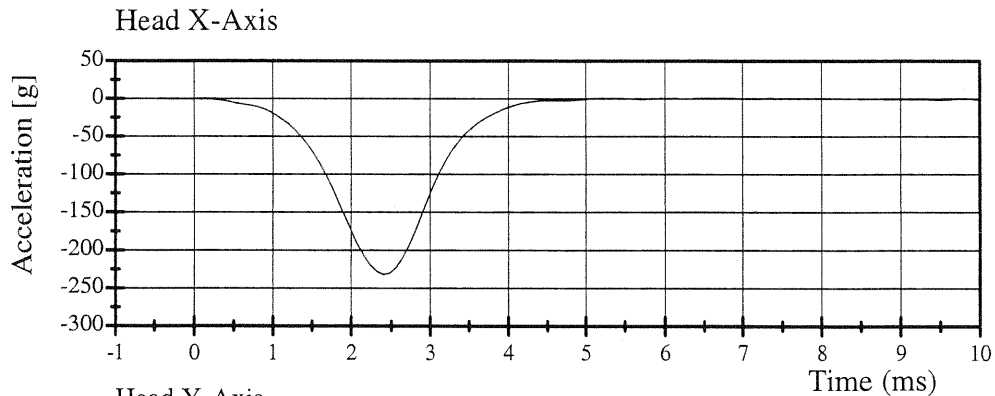

08.09.2004 14:03:55 608



Transportation Research Center Inc.

5720 Neck Flexion Test - 6 Channel Transducer

HIII 5th Female Serial No. 070 Calibration No. 05 - 2

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	53 %	Yes
Impact Velocity	6.89 - 7.13 m/s	7.10 m/s	Yes
Integrated Pendulum Velocity			
10 ms	2.10 - 2.50 m/s	2.46 m/s	Yes
20 ms	4.00 - 5.00 m/s	4.80 m/s	Yes
30 ms	5.80 - 7.00 m/s	6.85 m/s	Yes
Peak D Plane Rotation	77 - 91 °	85.1 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	69.0 - 83.0 N·m	69.10 N·m	Yes
Positive Moment Decay Time To 10 N·m	80 - 100 ms	91.04 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 11:59:04 511




Transportation Research Center Inc.

5720 Neck Flexion Test

HHH 5th Female Serial No. 070 Calibration No. 05 - 2

Test Date 08/09/2004

Integrated Pendulum Velocity

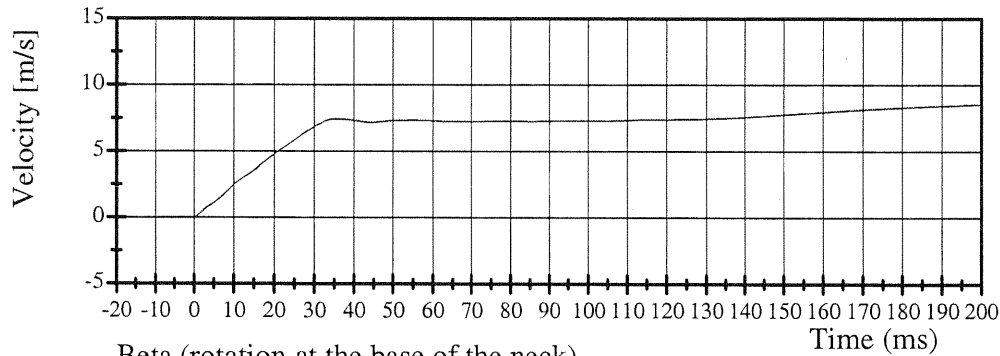


Filter Class: 180

Max: 9.2 m/s at 273.4 ms

Min: -0.0 m/s at -0.6 ms

Beta (rotation at the base of the neck)

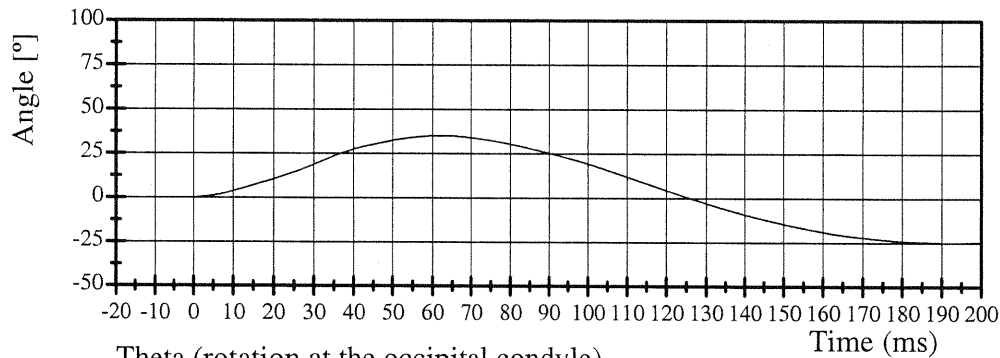


Filter Class: 60

Max: 35.1 ° at 62.2 ms

Min: -25.1 ° at 193.0 ms

Theta (rotation at the occipital condyle)

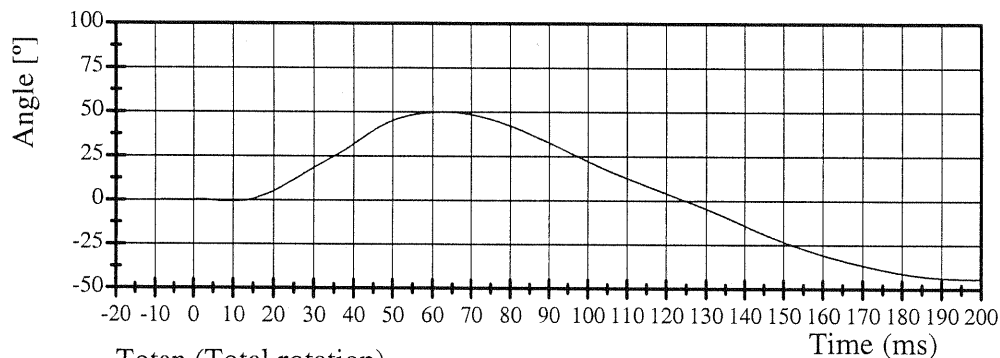


Filter Class: 60

Max: 50.0 ° at 63.1 ms

Min: -44.1 ° at 198.1 ms

Totan (Total rotation)

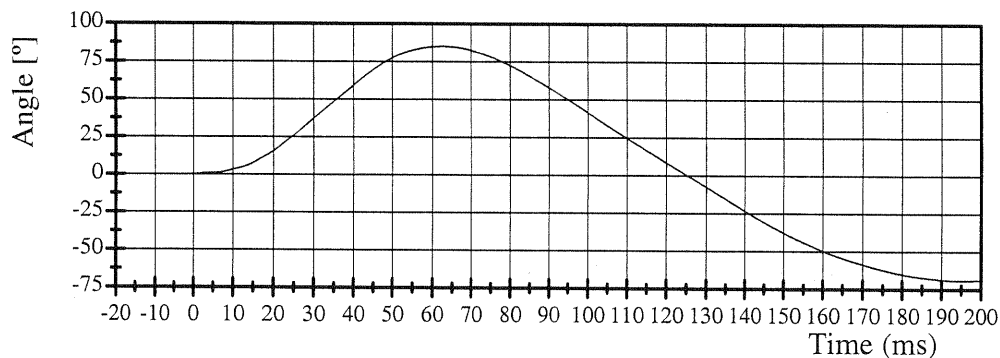

Filter Class: 60

Max: 85.1 ° at 62.7 ms

Min: -69.1 ° at 194.4 ms

08.09.2004 11:59:05 511




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 2

Test Date 08/09/2004

Neck X-Axis Force

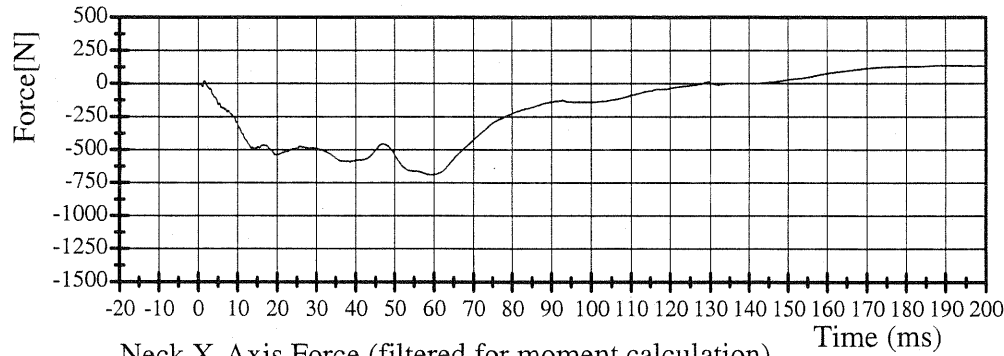


Filter Class: 1000

Max: 138.8 N at 188.9 ms

Min: -688.8 N at 59.4 ms

Neck X-Axis Force (filtered for moment calculation)

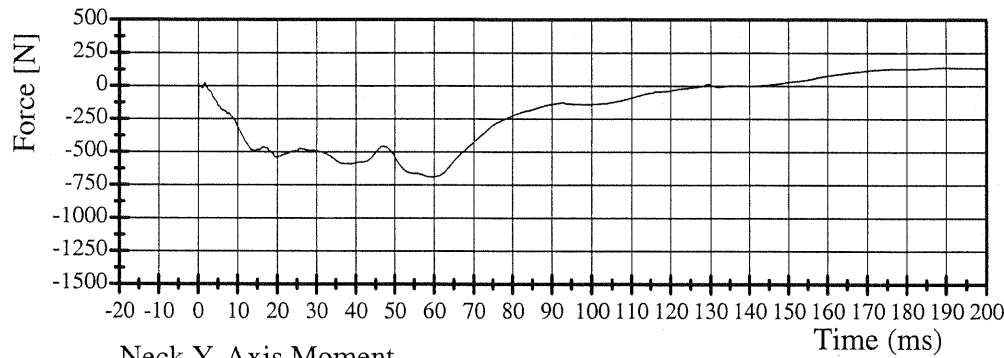


Filter Class: 600

Max: 138.2 N at 188.9 ms

Min: -688.6 N at 59.4 ms

Neck Y-Axis Moment

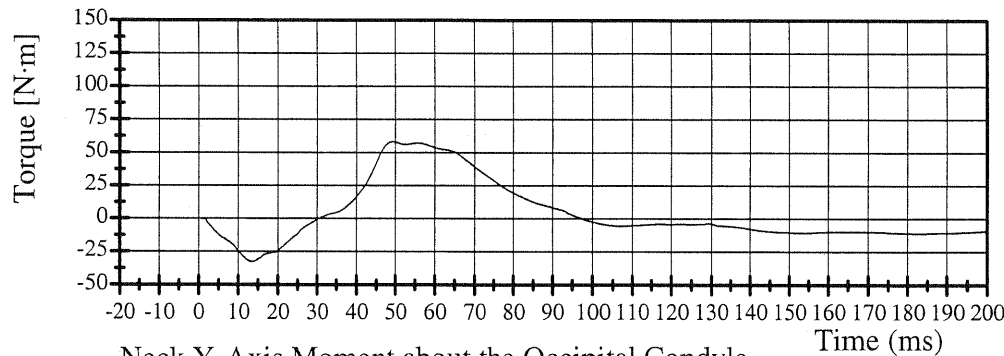


Filter Class: 600

Max: 58.3 N·m at 49.4 ms

Min: -32.7 N·m at 13.4 ms

Neck Y-Axis Moment about the Occipital Condyle

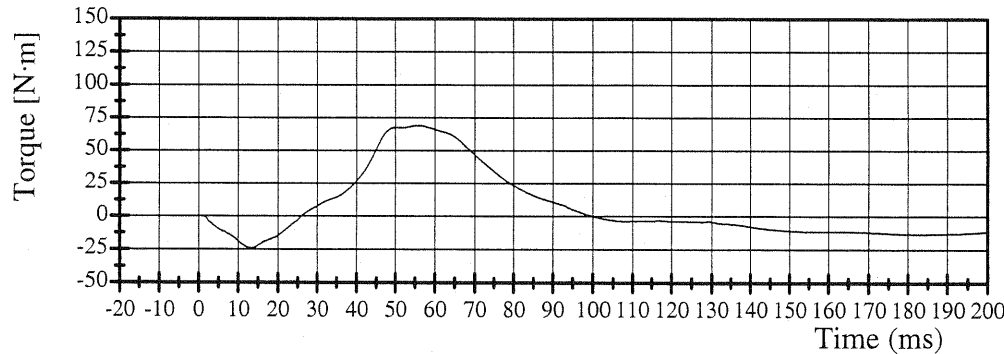

Filter Class: 600

Max: 69.1 N·m at 55.8 ms

Min: -24.1 N·m at 13.3 ms

Transportation Research Center Inc.

5720 Neck Extension Test - 6 Channel Transducer

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	56 %	Yes
Impact Velocity	5.95 - 6.19 m/s	6.11 m/s	Yes
Integrated Pendulum Velocity			
10 ms	1.50 - 1.90 m/s	1.74 m/s	Yes
20 ms	3.10 - 3.90 m/s	3.47 m/s	Yes
30 ms	4.60 - 5.60 m/s	5.15 m/s	Yes
Peak D Plane Rotation	99 - 114 °	113.2 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	-65.0 - (-53.0) N·m	-60.11 N·m	Yes
Negative Moment Decay Time To -10 N·m	94 - 114 ms	111.04 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 12:29:10 592




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

Integrated Pendulum Velocity

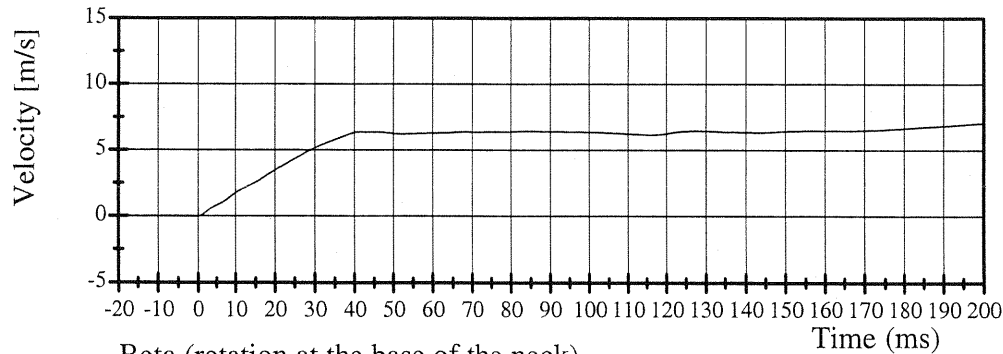


Filter Class: 180

Max: 8.2 m/s at 952.6 ms

Min: -0.0 m/s at -0.2 ms

Beta (rotation at the base of the neck)

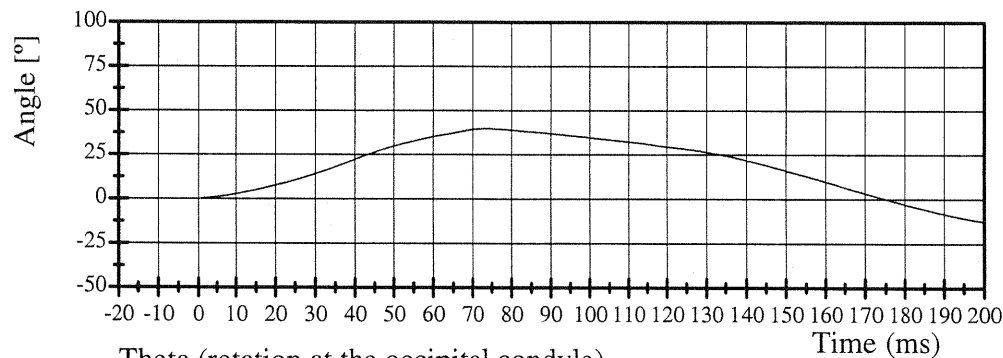


Filter Class: 60

Max: 39.7 ° at 73.8 ms

Min: -16.3 ° at 221.2 ms

Theta (rotation at the occipital condyle)

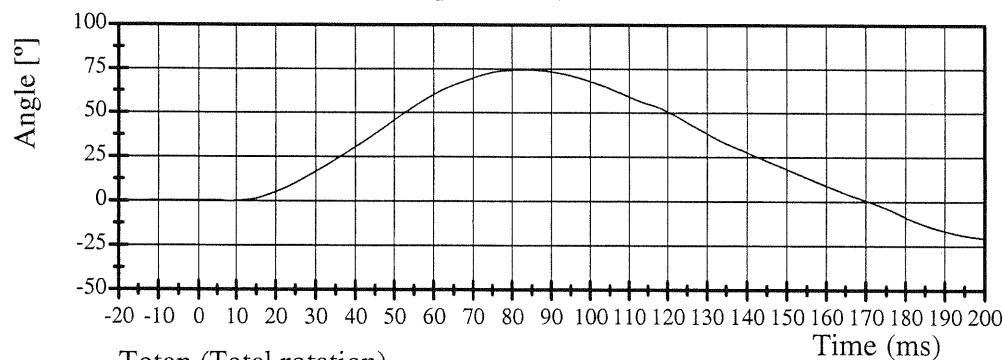


Filter Class: 60

Max: 74.4 ° at 83.2 ms

Min: -24.8 ° at 222.5 ms

Totan (Total rotation)

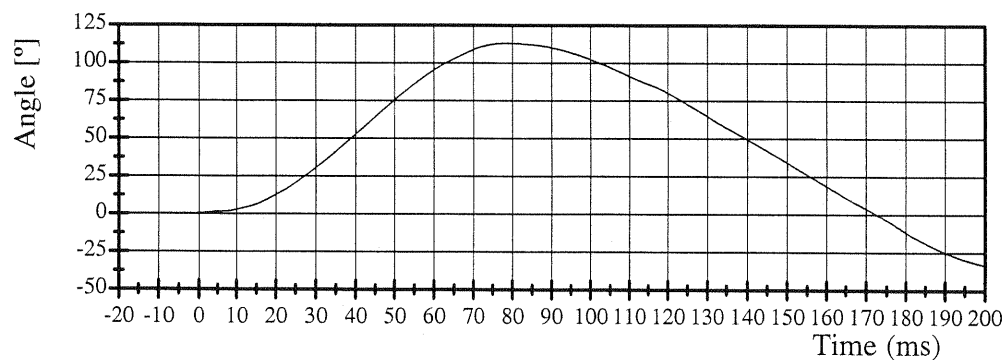

Filter Class: 60

Max: 113.2 ° at 79.1 ms

Min: -41.1 ° at 221.8 ms

08.09.2004 12:29:10 592




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

Neck X-Axis Force

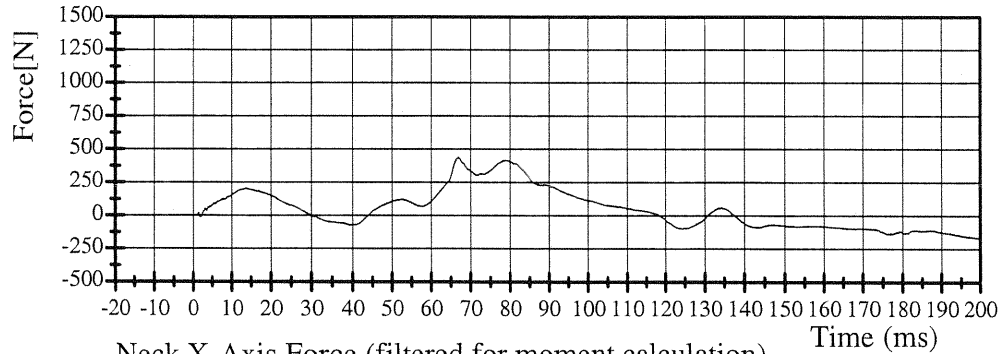


Filter Class: 1000

Max: 436.2 N at 66.9 ms

Min: -176.5 N at 205.8 ms

Neck X-Axis Force (filtered for moment calculation)

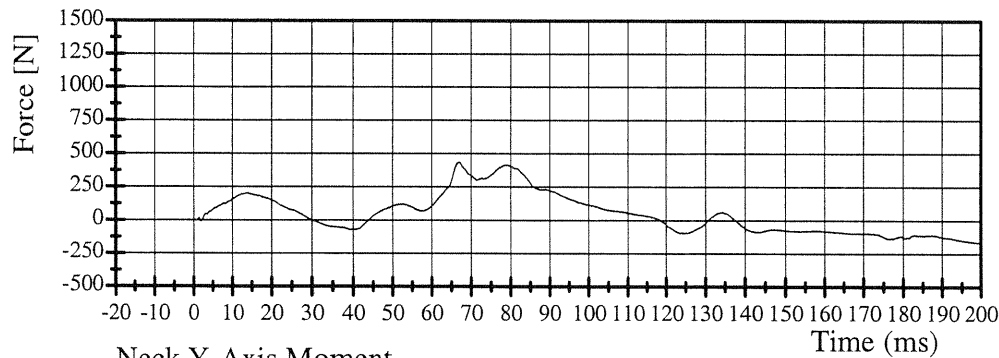


Filter Class: 600

Max: 435.0 N at 66.9 ms

Min: -175.3 N at 205.8 ms

Neck Y-Axis Moment

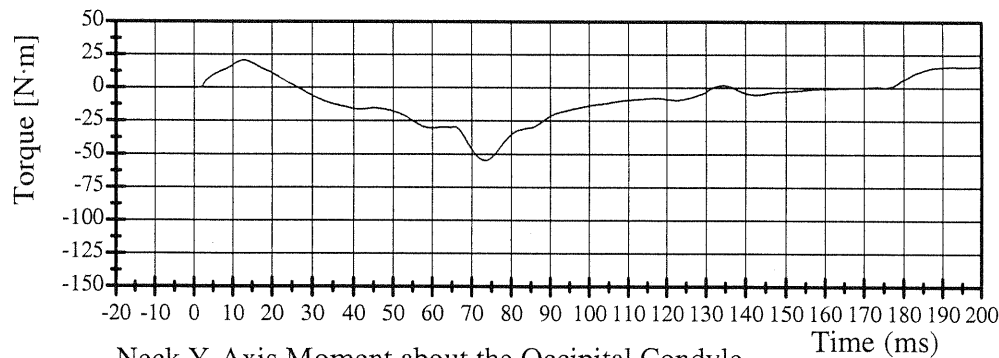


Filter Class: 600

Max: 20.6 N·m at 12.6 ms

Min: -54.5 N·m at 73.4 ms

Neck Y-Axis Moment about the Occipital Condyle

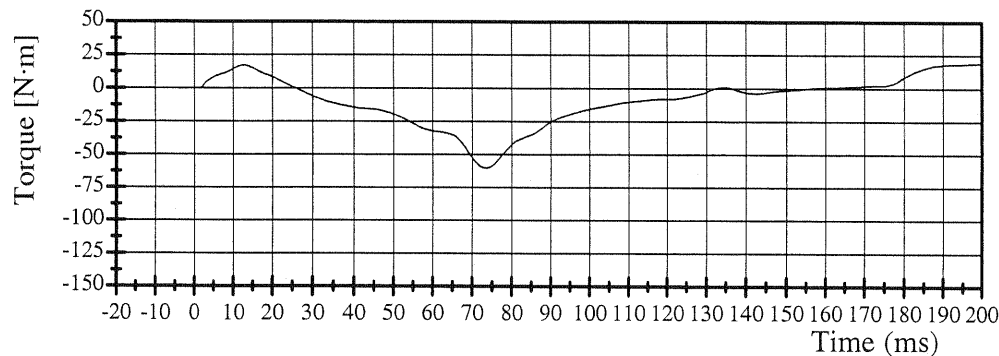

Filter Class: 600

Max: 21.9 N·m at 215.4 ms

Min: -60.1 N·m at 73.5 ms

08.09.2004 12:29:12 592



Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1


Test Date 08/10/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	56 %	Yes
Pendulum Velocity	6.59 - 6.83 m/s	6.74 m/s	Yes
Maximum Chest Deflection	-58.0 - (-50.0) mm	-54.9 mm	Yes
Peak Impact Probe Force Within Compression Corridor	3900 - 4400 N	4274 N	Yes
Peak Force Between 18 mm and 50 mm	4600 N	4225 N	Yes
Internal Hysteresis	69 - 85 %	73 %	Yes


Test meets specifications.

Comments:

Technician



Approved



08.10.2004 07:39:37 1016




Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/10/2004

Pendulum Deceleration

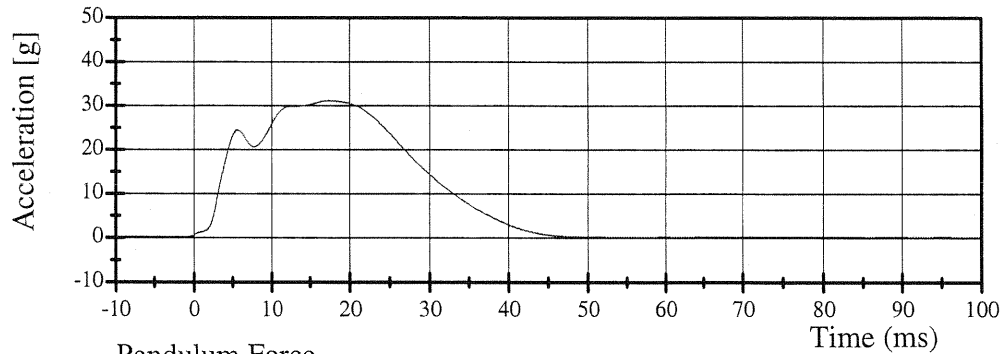


Filter Class: 180

Max: 31.2 g at 17.4 ms

Min: -0.2 g at 245.1 ms

Pendulum Force

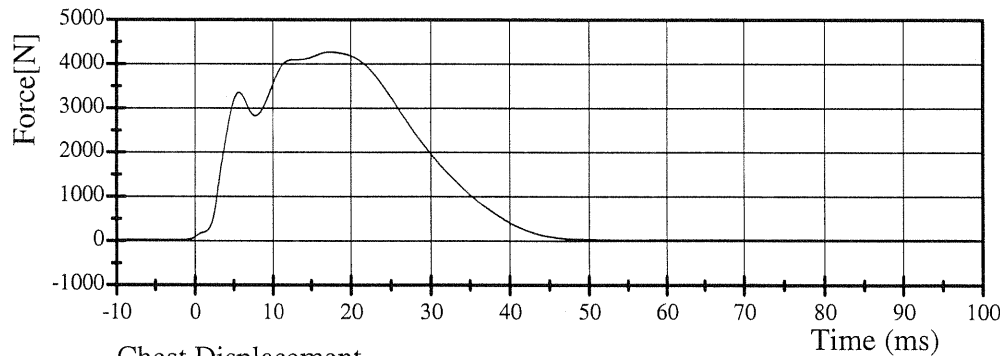


Filter Class: 180

Max: 4273.5 N at 17.4 ms

Min: -29.0 N at 245.1 ms

Chest Displacement

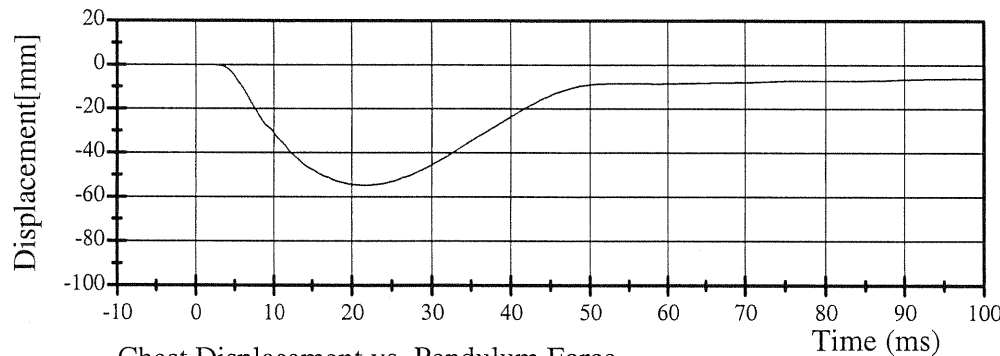


Filter Class: 600

Max: 0.0 mm at -45.4 ms

Min: -54.9 mm at 21.8 ms

Chest Displacement vs. Pendulum Force

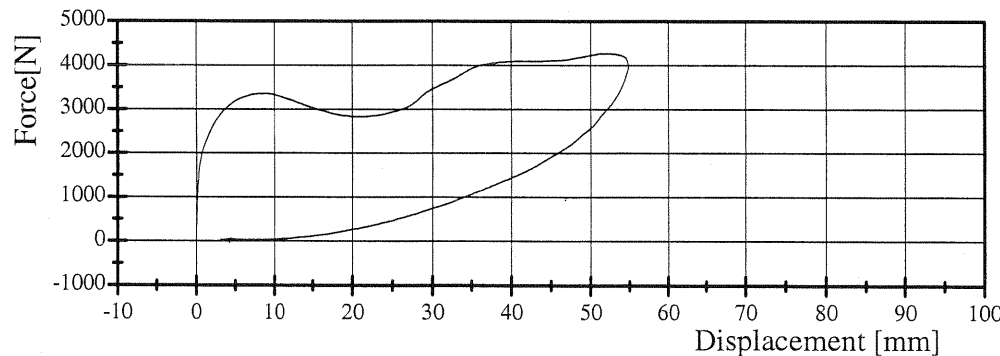

08.10.2004 07:39:38 1016



TRANSPORTATION RESEARCH CENTER INC.

TORSO FLEXION TEST

HYBRID III SMALL FEMALE

CAL DATE: 09-Aug-04

TRC, INC.

TEST NO: 070C05TF2

572 O SN070 TORSO FLEX CAL 05

TEST PARAMETER	SPECIFICATION	TEST RESULTS
TEMPERATURE	20.6 – 22.2° C	21.4° C
RELATIVE HUMIDITY	10 – 70 %	52 %
INITIAL ANGLE OF UNSUPPORTRED DUMMY	<= 20° REFERENCED TO VERTICAL	19.0 °
MAXIMUM FORCE AT 45 DEG. DURING 10 SECOND PERIOD	320 – 390 N	330.6 N
RETURN ANGLE		23.6 °
DIFFERENCE BETWEEN RETURN ANGLE & INTIAL ANGLE	+/- 8 ° OF INTIAL ANGLE	4.6 °
RATE	0.5° - 1.5°/sec	0.96 °/sec

TEST MEETS SPECIFICATIONS

Comments:

TECHNICIAN

Vincent Oliveri

Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1


Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	54 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.07 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3714 N	Yes


Test meets specifications.

Comments:

Technician



Approved



08.09.2004 13:22:26 1850





Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

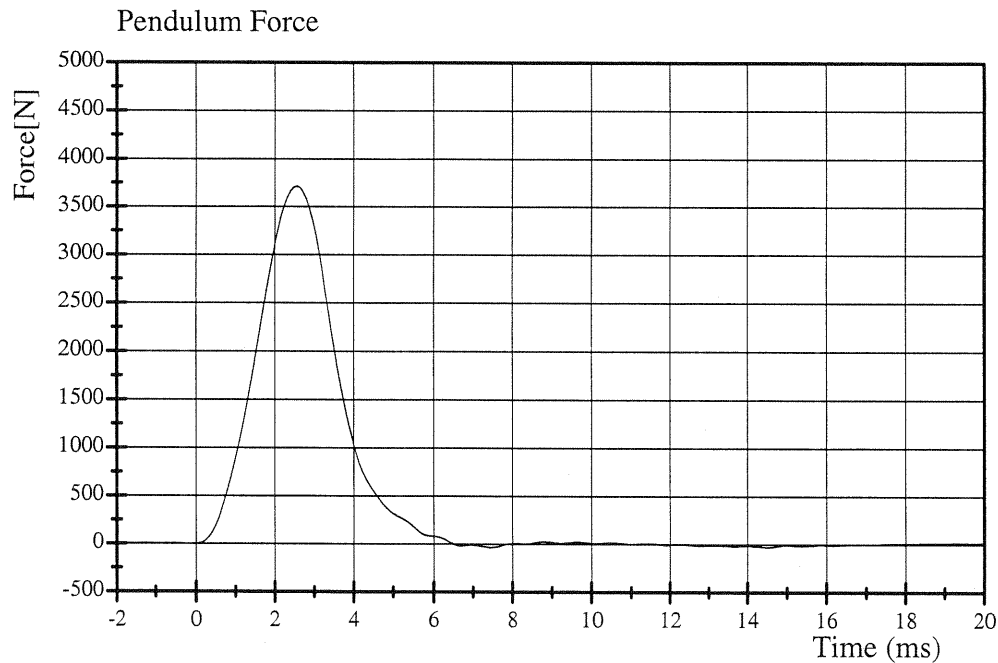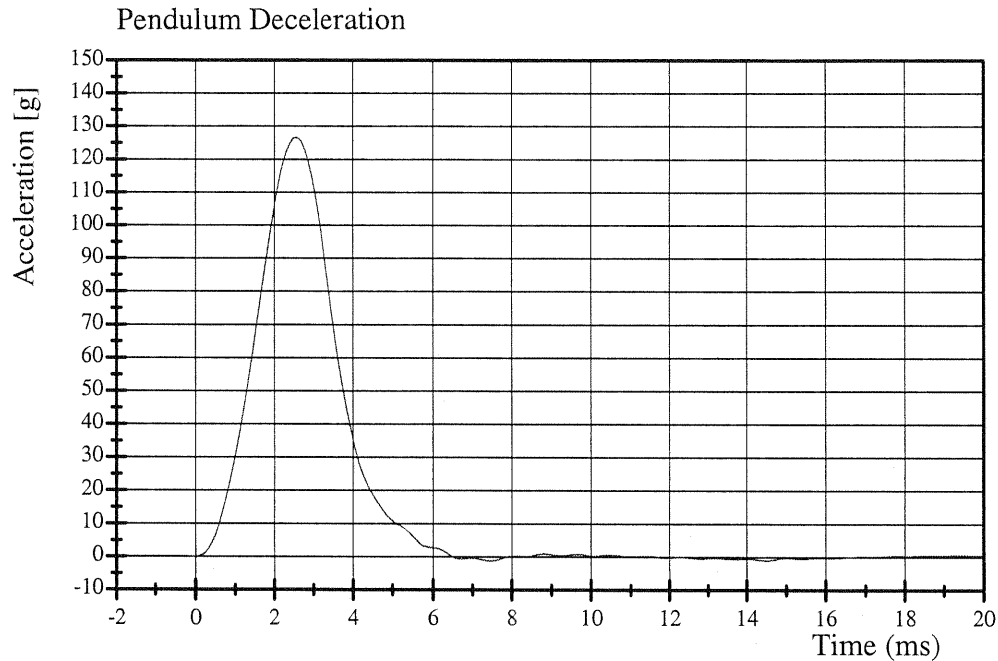

08.09.2004 13:22:27 1850



Transportation Research Center Inc.

5720 Left Knee Test

HHH 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.7 °C	Yes
Relative Humidity	10 - 70 %	55 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.08 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3661 N	Yes

Test meets specifications.

Comments:

Technician

Vincent Oliver

Approved

David K. [Signature]

08.11.2004 14:31:31 1848




Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 070 Calibration No. 05 - 1

Test Date 08/09/2004

Pendulum Deceleration

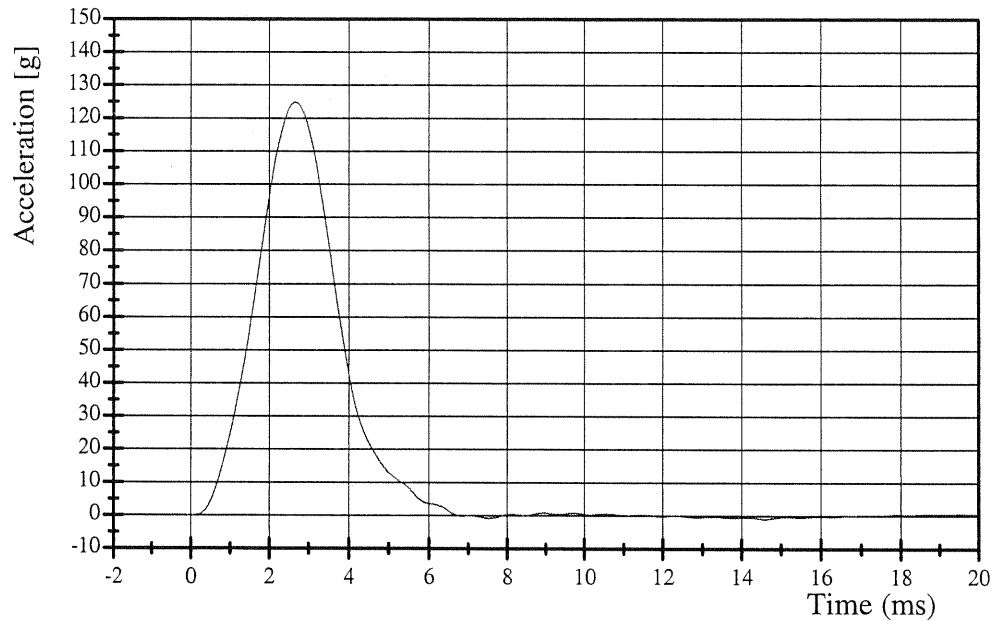


Filter Class: 600

Max: 124.9 g at 2.6 ms

Min: -1.0 g at 14.6 ms

Pendulum Force

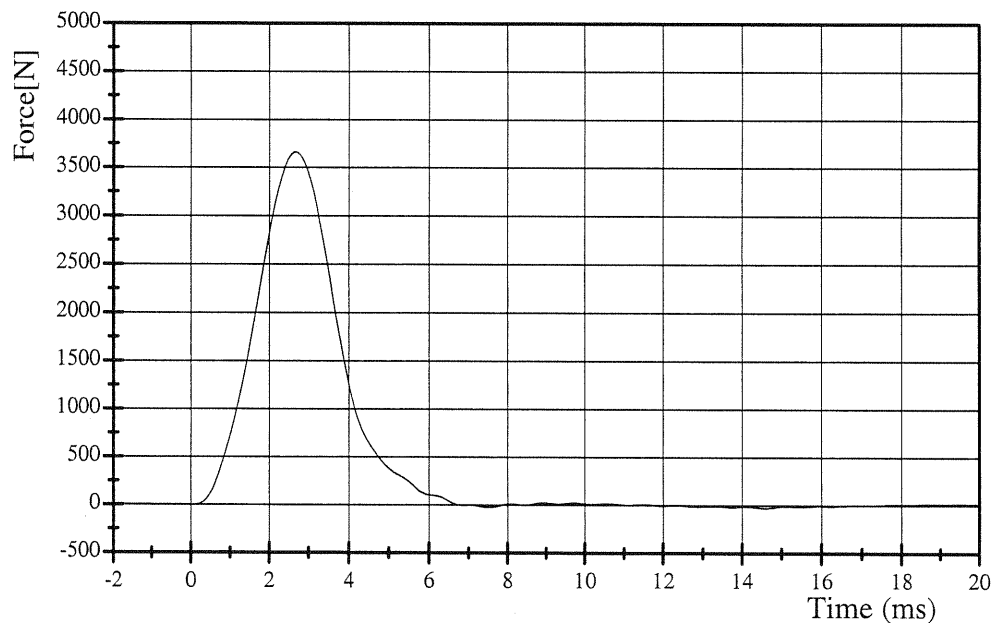

Filter Class: 600

Max: 3661.2 N at 2.6 ms

Min: -29.3 N at 14.6 ms

08.11.2004 14:31:32 1848




Post-Test Calibration

Front Passenger Dummy S/N 048


Transportation Research Center Inc.
5720 HIII 5th Dummy
External Dimensions
Serial No. 048 Calibration No. 17

Symbol	Description	Specification	Results	Pass
		mm	mm	
A	Total Sitting Height	774.7 - 800.1	786	Yes
B	Shoulder Pivot Height	431.8 - 457.2	448	Yes
C	Hip Pivot Height	81.3 - 86.3	85	Yes
D	Hip Pivot from Backline	144.8 - 149.8	146	Yes
E	Shoulder Pivot from Backline	68.6 - 83.8	78	Yes
F	Thigh Clearance	119.4 - 134.6	127	Yes
G	Back of Elbow to Wrist Pivot	243.9 - 259.1	247	Yes
H	Head Back to Backline	43.2 - 48.2	44	Yes
I	Shoulder to Elbow Length	276.8 - 297.2	284	Yes
J	Elbow Rest Height	182.8 - 203.2	192	Yes
K	Buttock Knee Length	520.7 - 546.1	543	Yes
L	Popliteal Height	355.6 - 376.0	357	Yes
M	Knee Pivot Height	393.7 - 419.1	396	Yes
N	Buttock Popliteal Length	414.0 - 439.4	428	Yes
O	Chest Depth without Jacket	175.3 - 190.5	184	Yes
P	Foot Length	218.5 - 233.7	220	Yes
R	Buttock to Knee Pivot Length	457.2 - 482.6	482	Yes
S	Head Breadth	137.1 - 147.3	140	Yes
T	Head Depth	177.8 - 188.0	184	Yes
U	Hip Breadth	299.7 - 314.9	303	Yes
V	Shoulder Breadth	350.5 - 365.7	360	Yes
W	Foot Breadth	78.8 - 94.0	83	Yes
X	Head Circumference	528.3 - 548.7	543	Yes
Y	Chest Circumference with Jacket	850.9 - 881.3	860	Yes
Z	Waist Circumference	759.5 - 789.9	786	Yes
AA	Reference Location for Chest Circumference	332.7 - 358.1	350	Yes
BB	Reference Location for Waist Circumference	160.0 - 170.2	165	Yes

Technician



Approved



Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1

Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.8 °C	Yes
Relative Humidity	10 - 70 %	51 %	Yes
Peak Resultant Acceleration	250 - 300 g	260.4 g	Yes
Peak Lateral Acceleration	15 g Max	2.6 g	Yes
Oscillations After Main Pulse	Less Than 10% of Peak Resultant Acceleration?	Yes	Yes


Test meets specifications.

Comments:

Technician



Approved



08.13.2004 09:27:09 611




Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1


Test Date 08/13/2004

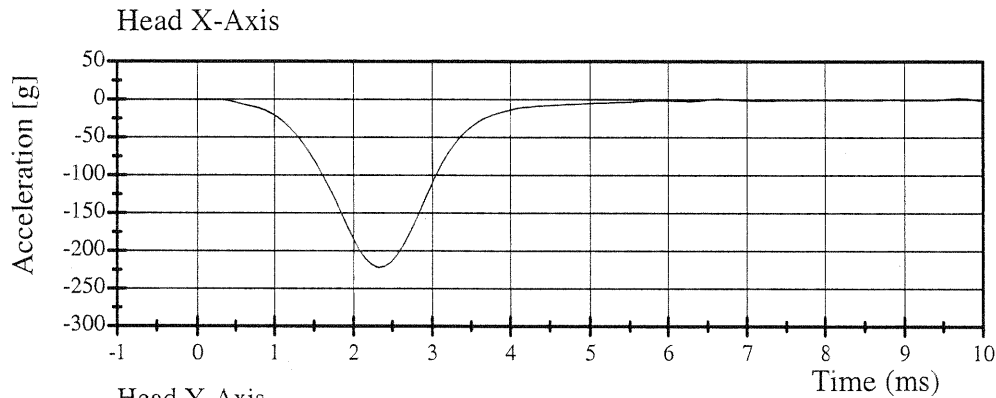

Filter Class: 1000

Max: 2.0 g at 9.7 ms


Min: -221.9 g at 2.3 ms

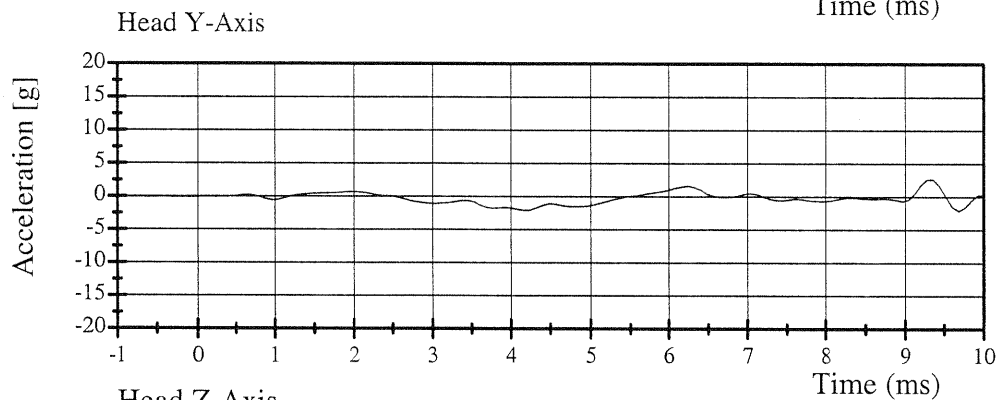

Filter Class: 1000

Max: 2.6 g at 9.4 ms


Min: -2.1 g at 9.7 ms

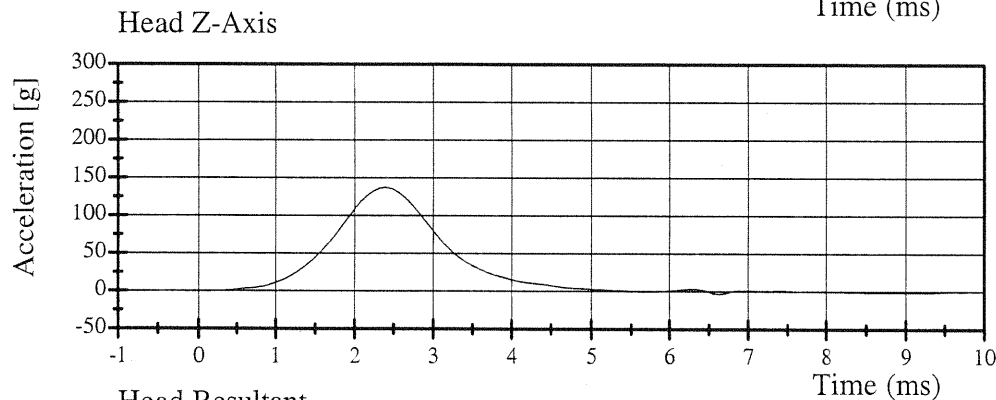

Filter Class: 1000

Max: 137.2 g at 2.4 ms

Min: -3.5 g at 6.6 ms

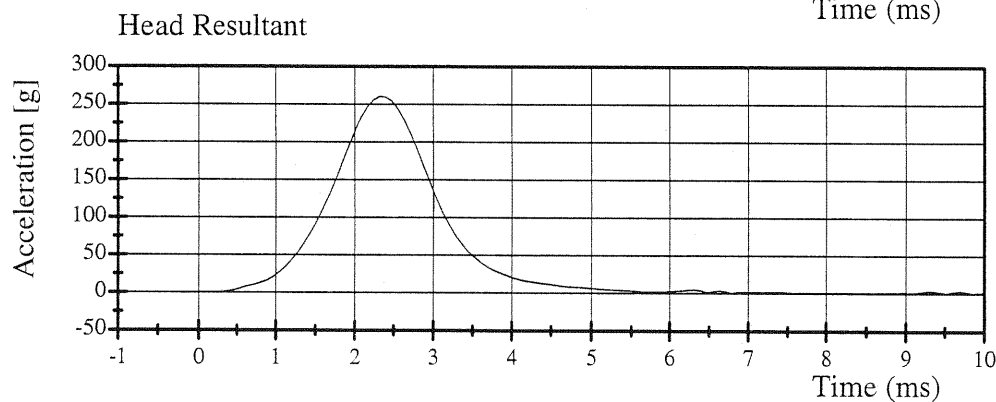

Filter Class: 1000

Max: 260.4 g at 2.3 ms

Min: 0.0 g at 3.5 ms

08.13.2004 09:27:10 611



Transportation Research Center Inc.

5720 Neck Flexion Test - 6 Channel Transducer

HIII 5th Female Serial No. 048 Calibration No. 17 - 2


Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.7 °C	Yes
Relative Humidity	10 - 70 %	55 %	Yes
Impact Velocity	6.89 - 7.13 m/s	7.10 m/s	Yes
Integrated Pendulum Velocity			
10 ms	2.10 - 2.50 m/s	2.49 m/s	Yes
20 ms	4.00 - 5.00 m/s	4.86 m/s	Yes
30 ms	5.80 - 7.00 m/s	6.98 m/s	Yes
Peak D Plane Rotation	77 - 91 °	82.0 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	69.0 - 83.0 N·m	79.09 N·m	Yes
Positive Moment Decay Time To 10 N·m	80 - 100 ms	87.76 ms	Yes


Test meets specifications.

Comments:

Technician



Approved



08.13.2004 11:20:46 508




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 2

Test Date 08/13/2004

Integrated Pendulum Velocity

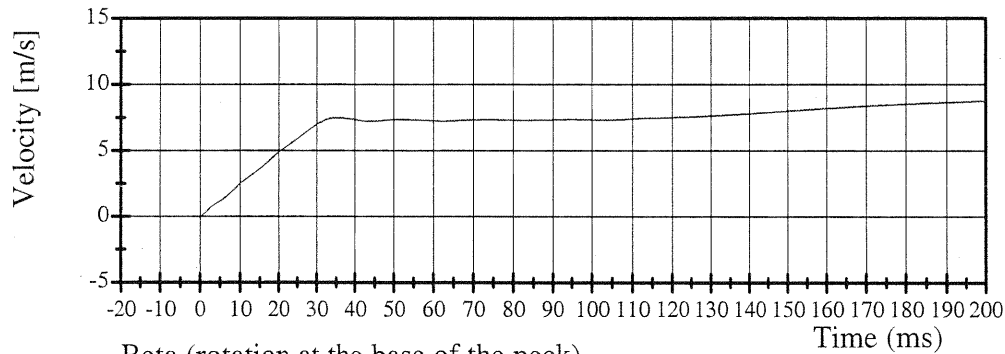


Filter Class: 180

Max: 9.5 m/s at 959.4 ms

Min: -0.0 m/s at -0.6 ms

Beta (rotation at the base of the neck)

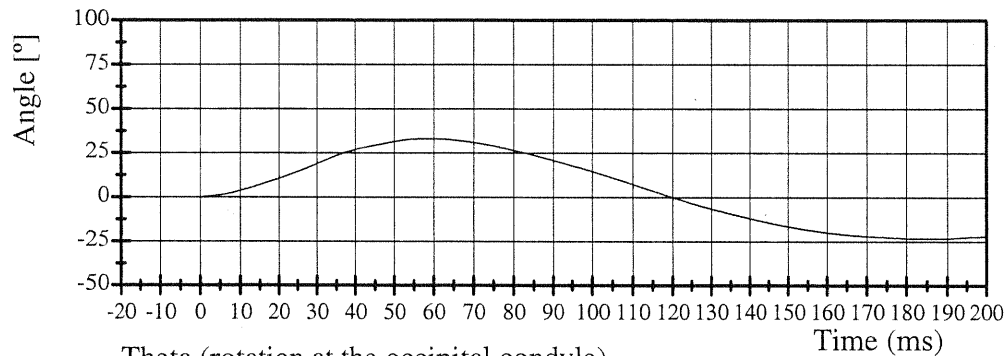


Filter Class: 60

Max: 33.1 ° at 58.5 ms

Min: -23.3 ° at 185.0 ms

Theta (rotation at the occipital condyle)

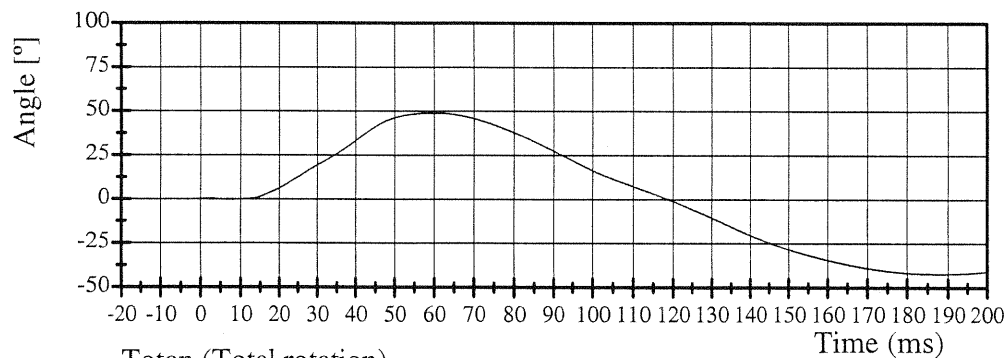


Filter Class: 60

Max: 48.9 ° at 59.8 ms

Min: -42.2 ° at 188.1 ms

Totan (Total rotation)

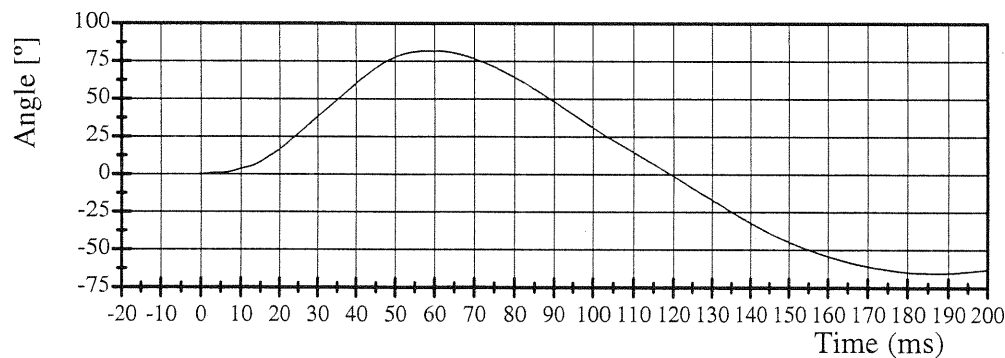

Filter Class: 60

Max: 82.0 ° at 59.2 ms

Min: -65.5 ° at 187.3 ms

08.13.2004 11:20:47 508




Transportation Research Center Inc.

5720 Neck Flexion Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 2

Test Date 08/13/2004

Neck X-Axis Force

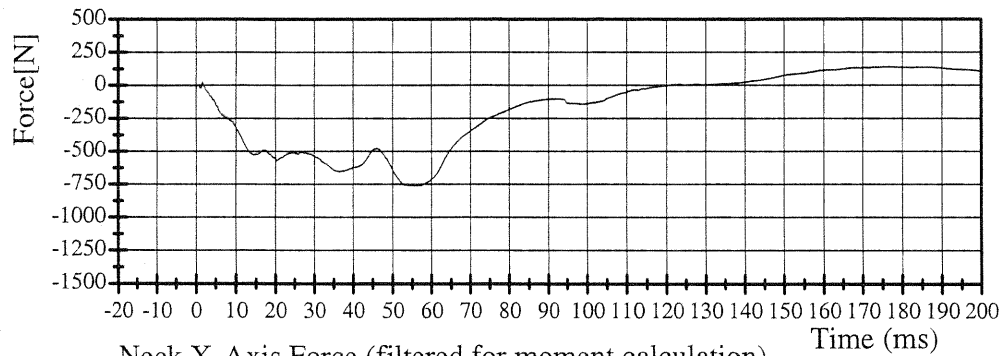


Filter Class: 1000

Max: 140.4 N at 176.0 ms

Min: -759.2 N at 56.6 ms

Neck X-Axis Force (filtered for moment calculation)

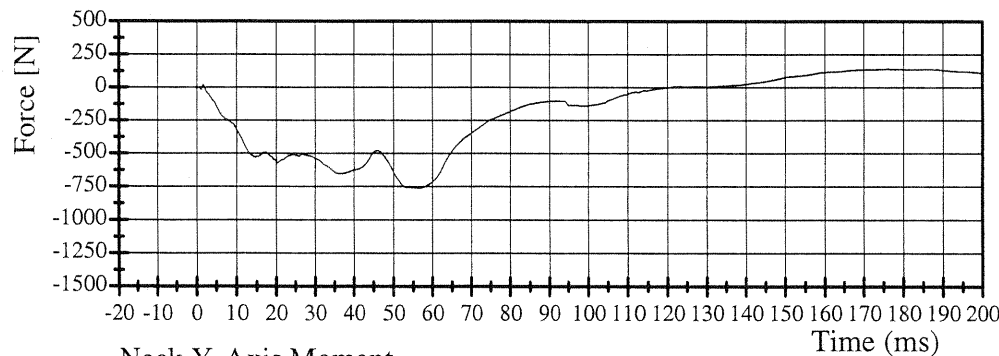


Filter Class: 600

Max: 140.3 N at 176.2 ms

Min: -759.0 N at 56.6 ms

Neck Y-Axis Moment

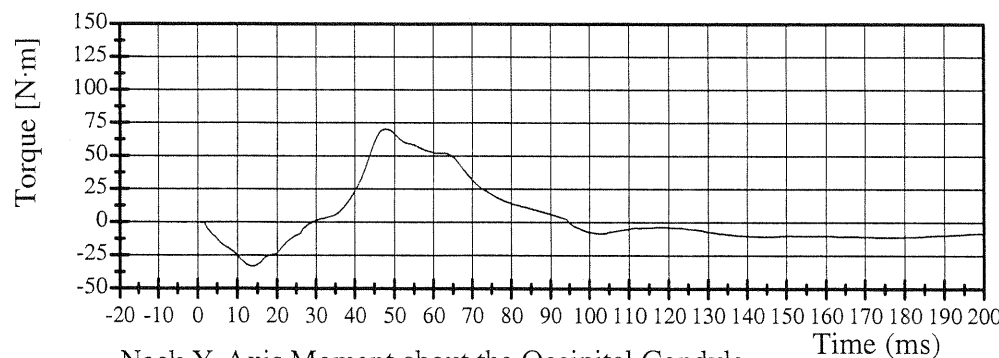


Filter Class: 600

Max: 70.3 N·m at 47.8 ms

Min: -33.1 N·m at 13.6 ms

Neck Y-Axis Moment about the Occipital Condyle

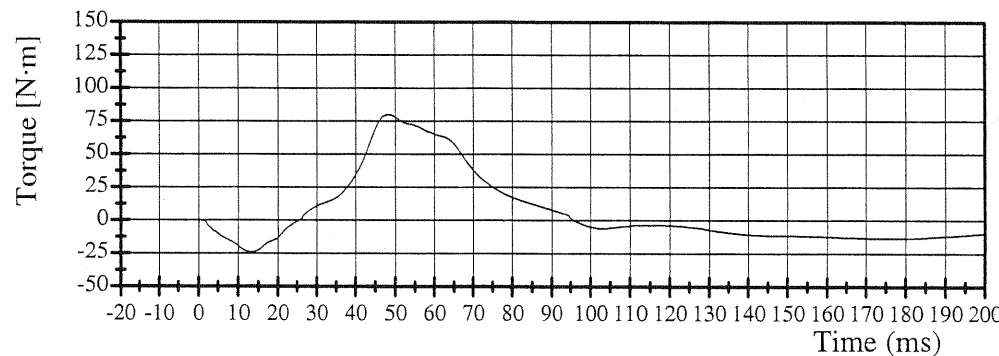

Filter Class: 600

Max: 79.9 N·m at 48.3 ms

Min: -24.0 N·m at 13.3 ms

08.13.2004 11:20:48 508



Transportation Research Center Inc.

5720 Neck Extension Test - 6 Channel Transducer

HIII 5th Female Serial No. 048 Calibration No. 17 - 4

Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	54 %	Yes
Impact Velocity	5.95 - 6.19 m/s	6.08 m/s	Yes
Integrated Pendulum Velocity			
10 ms	1.50 - 1.90 m/s	1.75 m/s	Yes
20 ms	3.10 - 3.90 m/s	3.41 m/s	Yes
30 ms	4.60 - 5.60 m/s	4.98 m/s	Yes
Peak D Plane Rotation	99 - 114 °	109.0 °	Yes
Peak Moment About Occipital Condyles (During time interval rotation is within specified corridors)	-65.0 - (-53.0) N·m	-61.40 N·m	Yes
Negative Moment Decay Time To -10 N·m	94 - 114 ms	109.92 ms	Yes

Test meets specifications.

Comments:

Technician



Approved



08.13.2004 13:56:55 595




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 4

Test Date 08/13/2004

Integrated Pendulum Velocity

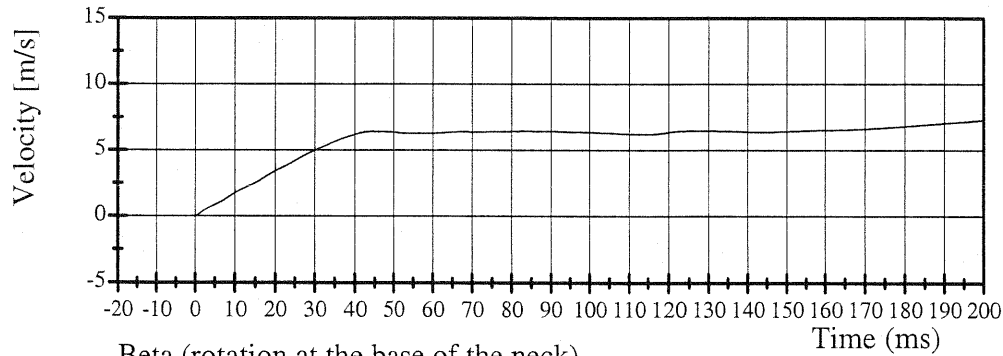


Filter Class: 180

Max: 8.2 m/s at 952.4 ms

Min: -0.0 m/s at -20.4 ms

Beta (rotation at the base of the neck)

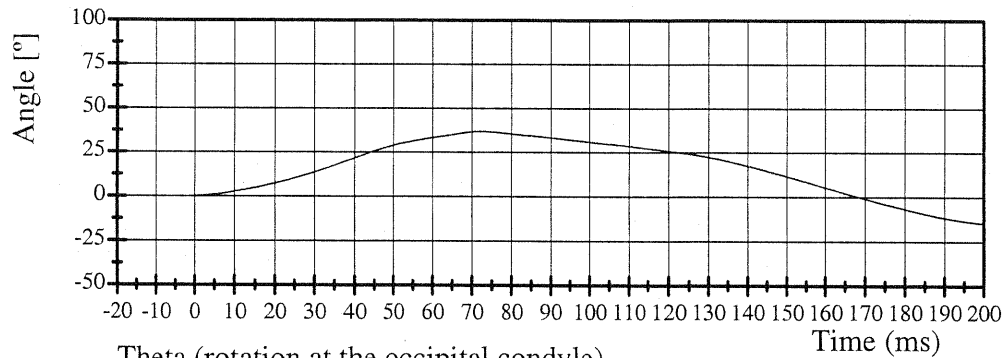


Filter Class: 60

Max: 36.9 ° at 72.0 ms

Min: -16.2 ° at 213.1 ms

Theta (rotation at the occipital condyle)

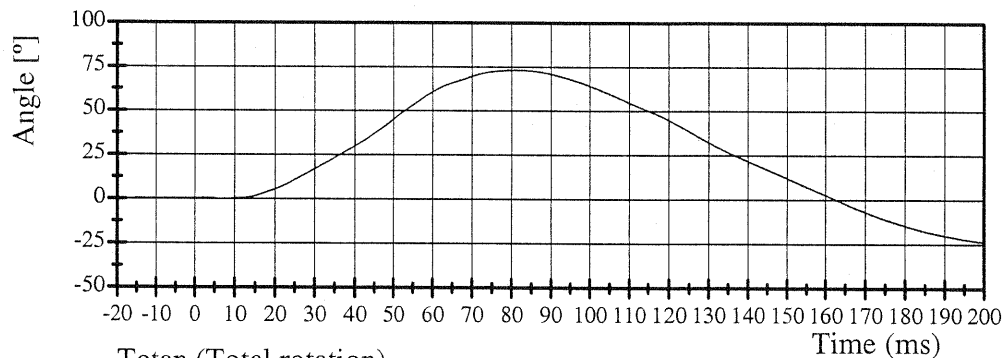


Filter Class: 60

Max: 73.1 ° at 81.4 ms

Min: -25.2 ° at 211.6 ms

Totan (Total rotation)

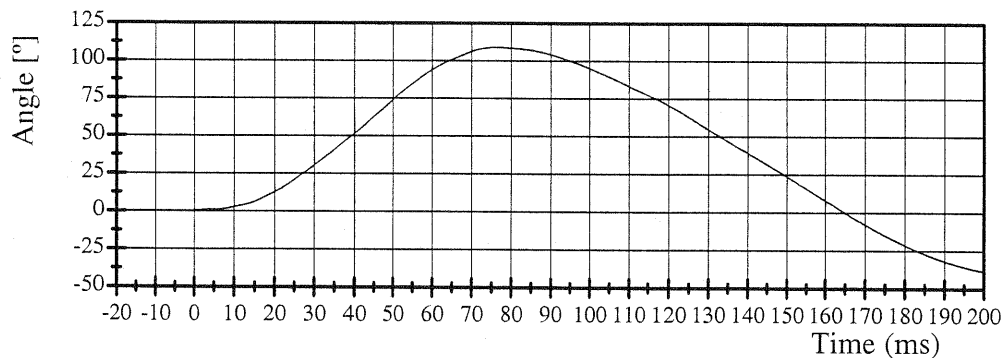

Filter Class: 60

Max: 109.0 ° at 76.2 ms

Min: -41.4 ° at 212.1 ms

08.13.2004 13:56:56 595




Transportation Research Center Inc.

5720 Neck Extension Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 4

Test Date 08/13/2004

Neck X-Axis Force

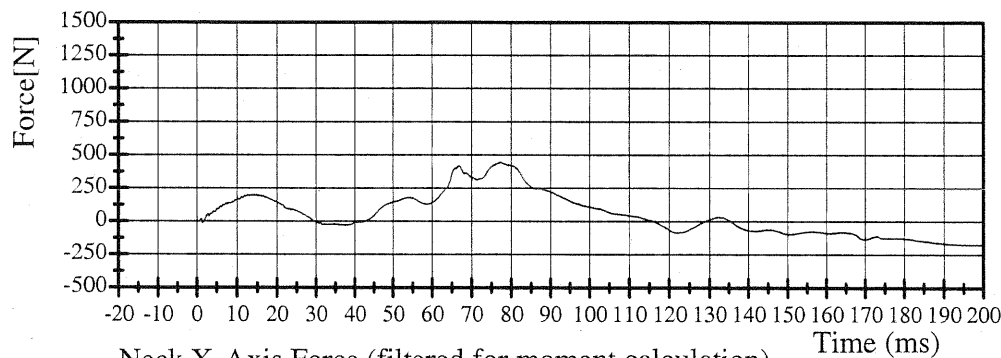


Filter Class: 1000

Max: 446.9 N at 77.4 ms

Min: -176.1 N at 199.0 ms

Neck X-Axis Force (filtered for moment calculation)

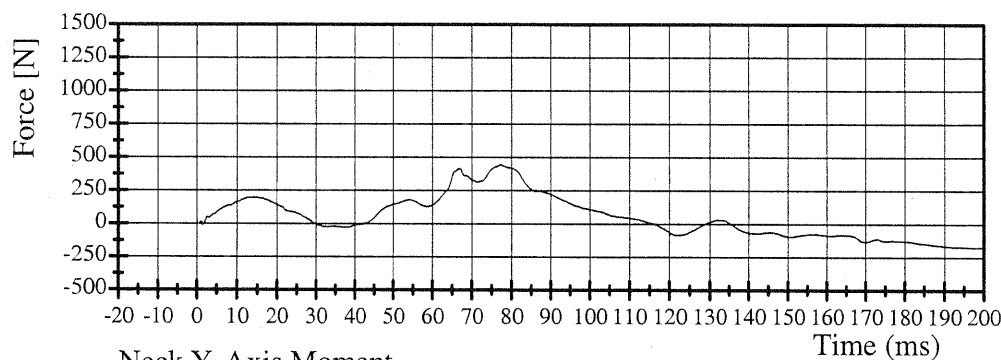


Filter Class: 600

Max: 445.4 N at 77.4 ms

Min: -175.1 N at 199.1 ms

Neck Y-Axis Moment

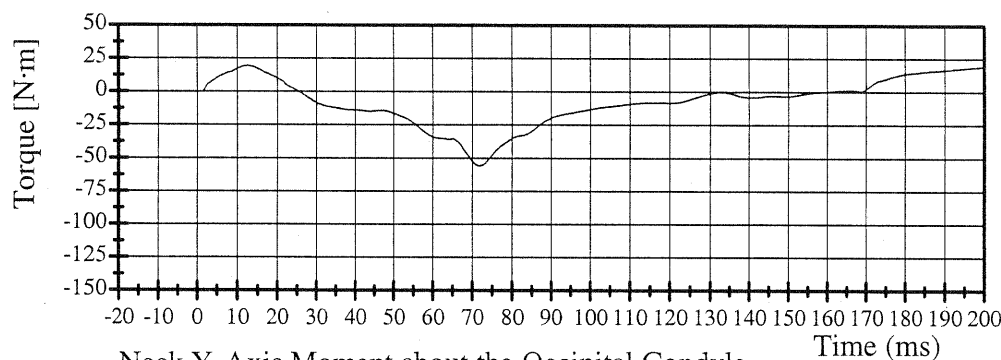


Filter Class: 600

Max: 19.9 N·m at 205.3 ms

Min: -55.7 N·m at 71.8 ms

Neck Y-Axis Moment about the Occipital Condyle

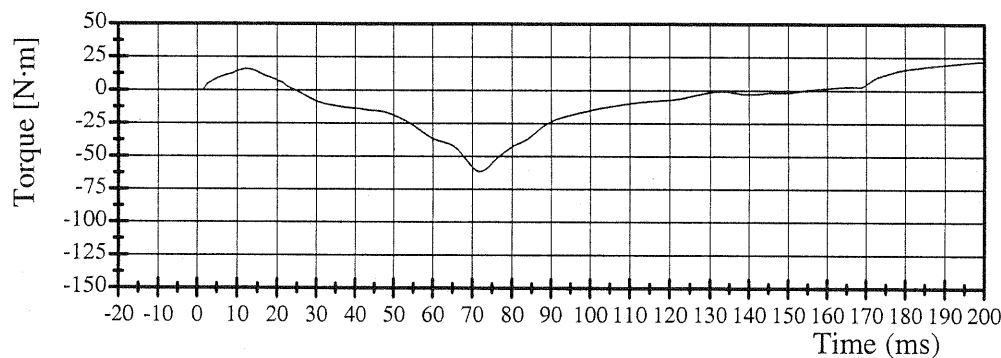

Filter Class: 600

Max: 22.9 N·m at 205.2 ms

Min: -61.4 N·m at 71.8 ms

08.13.2004 13:56:57 595



Transportation Research Center Inc.

5720 Thorax Test

HIH 5th Female Serial No. 048 Calibration No. 17 - 2


Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	48 %	Yes
Pendulum Velocity	6.59 - 6.83 m/s	6.71 m/s	Yes
Maximum Chest Deflection	-58.0 - (-50.0) mm	-56.2 mm	Yes
Peak Impact Probe Force Within Compression Corridor	3900 - 4400 N	4374 N	Yes
Peak Force Between 18 mm and 50 mm	4600 N	4265 N	Yes
Internal Hysteresis	69 - 85 %	74 %	Yes


Test meets specifications.

Comments:

Technician



Approved



08.13.2004 08:50:40 988




Transportation Research Center Inc.

5720 Thorax Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 2

Test Date 08/13/2004

Pendulum Deceleration

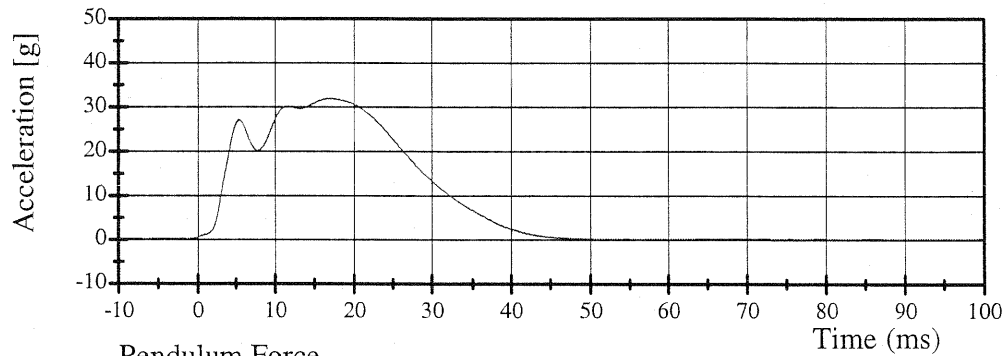


Filter Class: 180

Max: 31.9 g at 17.0 ms

Min: -0.3 g at 205.3 ms

Pendulum Force

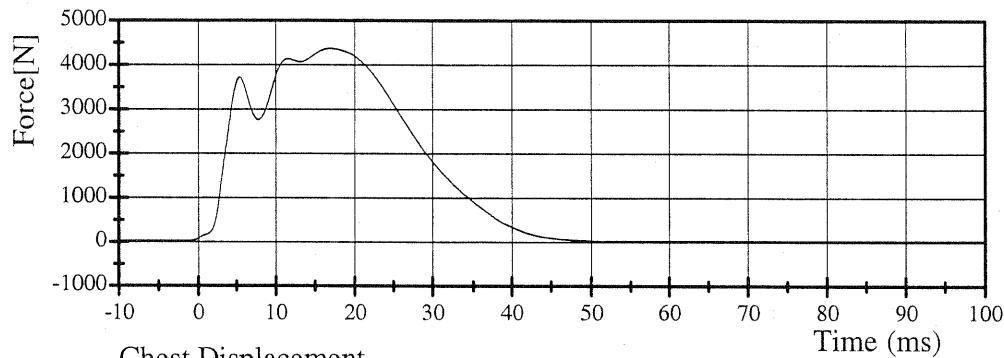


Filter Class: 180

Max: 4373.8 N at 17.0 ms

Min: -46.2 N at 205.3 ms

Chest Displacement

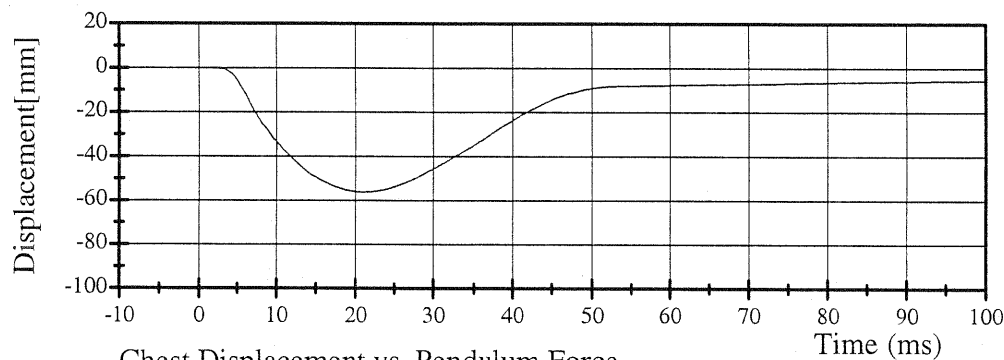


Filter Class: 600

Max: 0.0 mm at -64.4 ms

Min: -56.2 mm at 21.0 ms

Chest Displacement vs. Pendulum Force

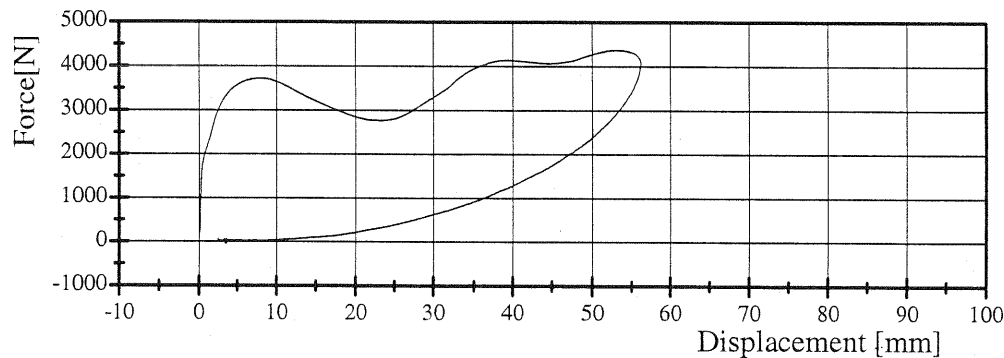

08.13.2004 08:50:41 988



TRANSPORTATION RESEARCH CENTER INC.

TORSO FLEXION TEST

HYBRID III SMALL FEMALE

CAL DATE: 12-Aug-04

TRC, INC.

TEST NO: 048C17TF1


572 O SN048 TORSO FLEX CAL 17

TEST PARAMETER	SPECIFICATION	TEST RESULTS
TEMPERATURE	20.6 – 22.2° C	21.4 ° C
RELATIVE HUMIDITY	10 – 70 %	47 %
INITIAL ANGLE OF UNSUPPORTTED DUMMY	<= 20° REFERENCED TO VERTICAL	15.9 °
MAXIMUM FORCE AT 45 DEG. DURING 10 SECOND PERIOD	320 – 390 N	339.0 N
RETURN ANGLE		22.1 °
DIFFERENCE BETWEEN RETURN ANGLE & INTIAL ANGLE	+/- 8 ° OF INTIAL ANGLE	6.2 °
RATE	0.5° - 1.5 °/sec	0.98°/sec

TEST MEETS SPECIFICATIONS

Comments:

TECHNICIAN

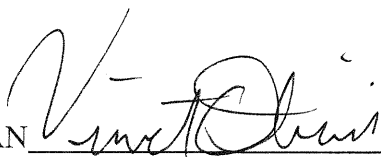

Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1


Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.1 °C	Yes
Relative Humidity	10 - 70 %	48 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.11 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3470 N	Yes

Test meets specifications.

Comments:

Technician



Approved



08.13.2004 12:58:34 1774




Transportation Research Center Inc.

5720 Left Knee Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1


Test Date 08/13/2004

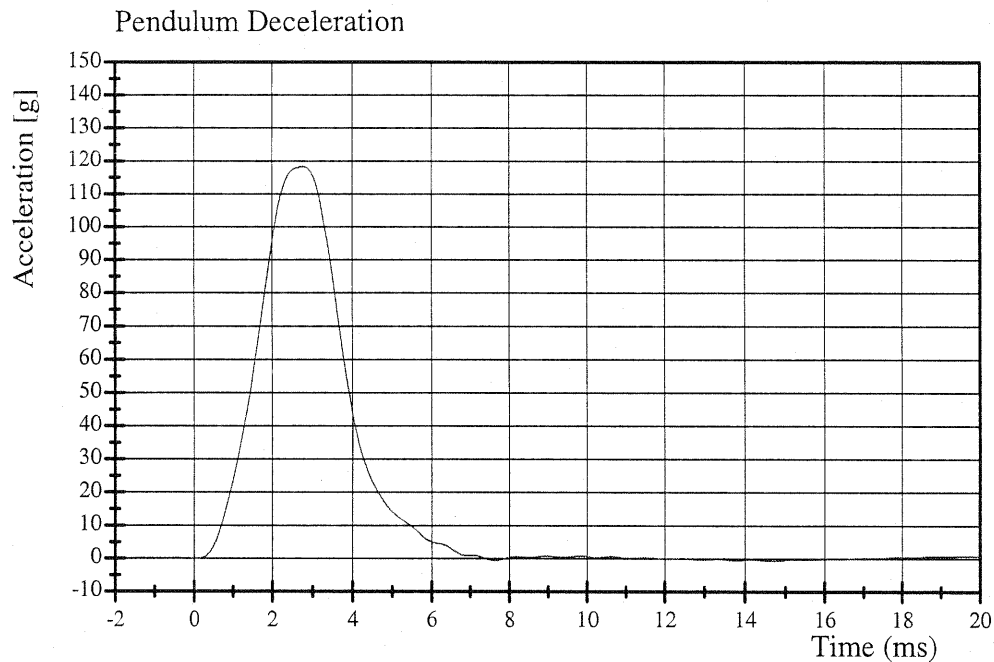

Filter Class: 600

Max: 118.3 g at 2.8 ms

Min: -0.6 g at 14.7 ms

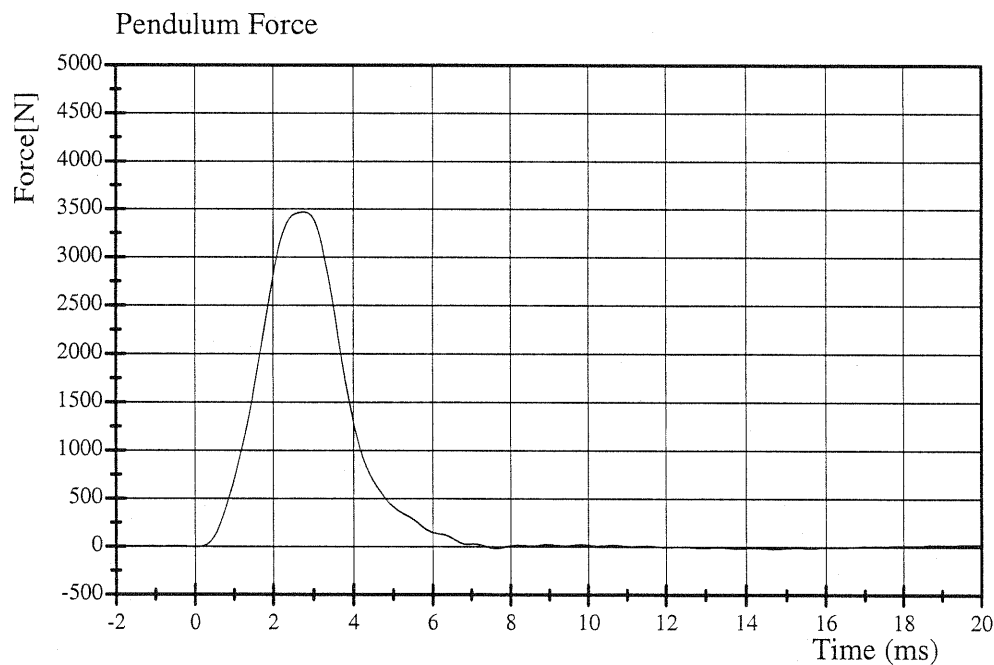

Filter Class: 600

Max: 3469.8 N at 2.8 ms

Min: -18.6 N at 14.7 ms

08.13.2004 12:58:35 1774



Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1

Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.6 °C	21.0 °C	Yes
Relative Humidity	10 - 70 %	52 %	Yes
Pendulum Velocity	2.07 - 2.13 m/s	2.11 m/s	Yes
Maximum Pendulum Force	3450 - 4060 N	3662 N	Yes

Test meets specifications.

Comments:

Technician

Vincent Oliveri

Approved

David K. Hunter

08.13.2004 13:02:30 1775




Transportation Research Center Inc.

5720 Right Knee Test

HIII 5th Female Serial No. 048 Calibration No. 17 - 1

Test Date 08/13/2004

Pendulum Deceleration

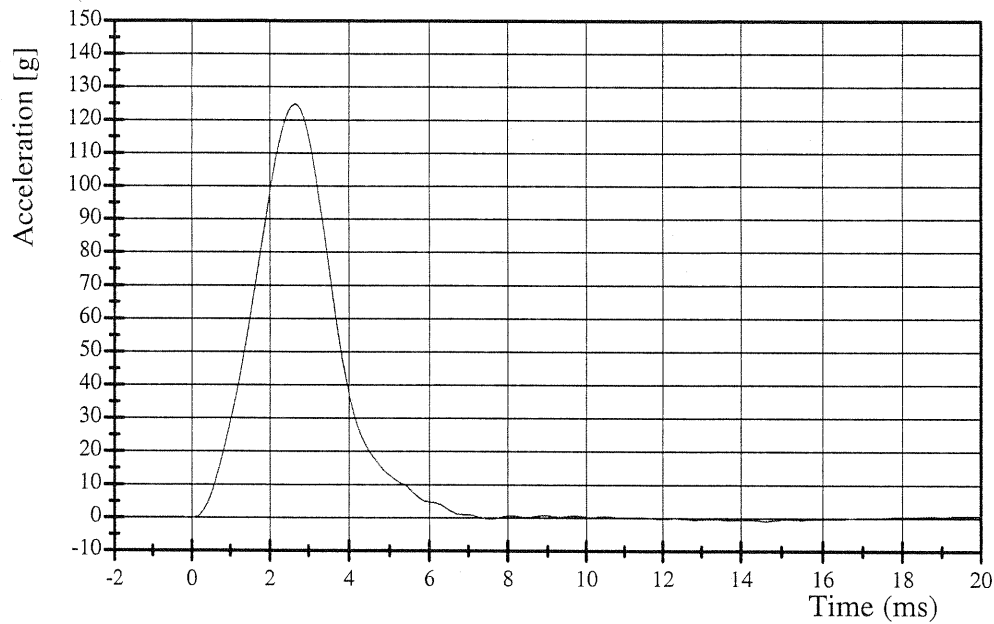


Filter Class: 600

Max: 124.9 g at 2.6 ms

Min: -0.8 g at 14.6 ms

Pendulum Force

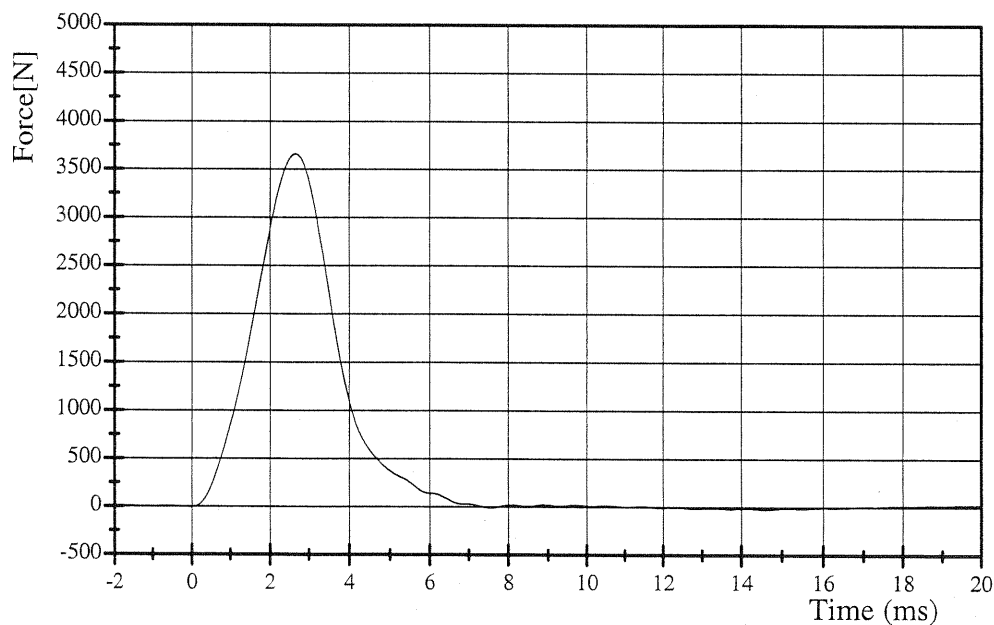

Filter Class: 600

Max: 3662.2 N at 2.6 ms

Min: -24.2 N at 14.6 ms

08.13.2004 13:02:31 1775



Post-Test Calibration

Rear Passenger Dummy S/N 070

Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 070 Calibration No. 06 - 1

Test Date 08/13/2004

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	49 %	Yes
Peak Resultant Acceleration	250 - 300 g	253.7 g	Yes
Peak Lateral Acceleration	15 g Max	5.4 g	Yes
Oscillations After Main Pulse	Less Than 10% of Peak Resultant Acceleration?	Yes	Yes

Test meets specifications.

Comments:

Technician

Vincent Oliveri

Approved

Paul W. Hume

08.13.2004 11:34:57 611







Transportation Research Center Inc.

5720 Head Drop Test

HIII 5th Female Serial No. 070 Calibration No. 06 - 1

Test Date 08/13/2004

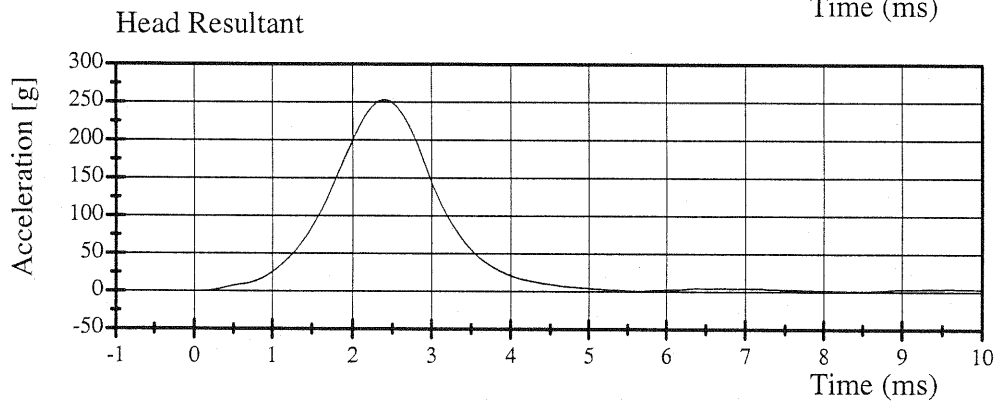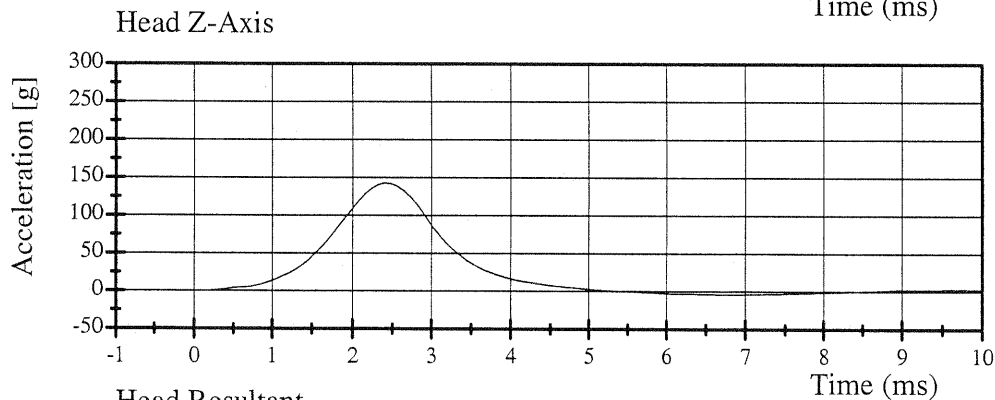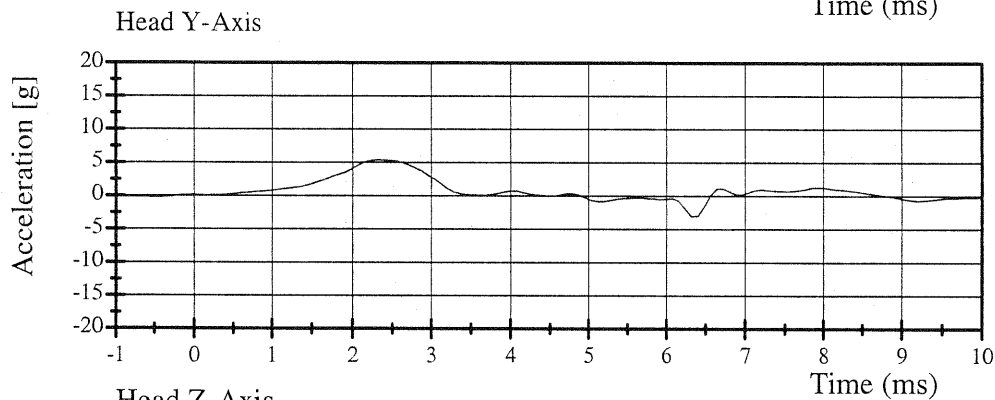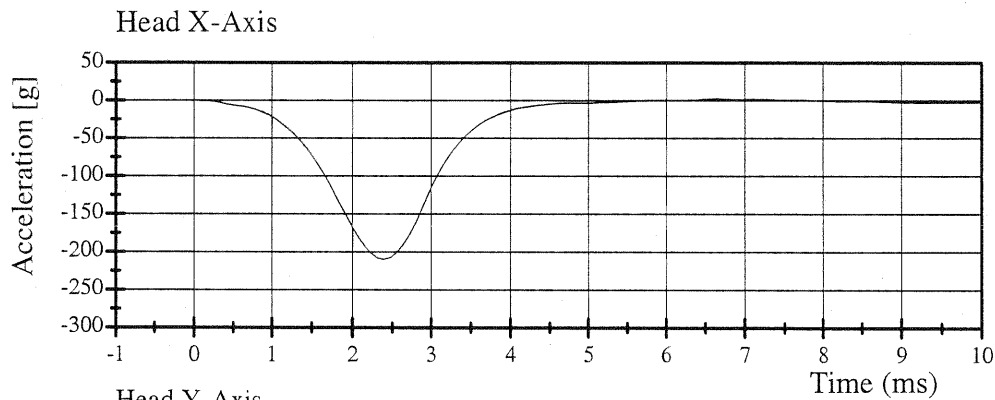

08.13.2004 11:34:58 611



Appendix D

Miscellaneous Test Information

Channel Report

8/12/2004 7:49:46 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAU8

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
8001	03E03E20-N20	HEDXG1	Head Accel X	Fwd	1185.0024 g	+	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8002	02A18-N10	HEDYG1	Head Accel Y	Lft	1189.6176 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8003	02A09-F15	HEDZG1	Head Accel Z	Up	1203.9580 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8004	01L26-F02	HEDXR1	Head Accel Red X	Rwd	1212.6207 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8005	02A09-F13	HEDYR1	Head Accel Red Y	Lft	1197.6681 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8006	02A16-A06	HEDZR1	Head Accel Red Z	Up	1202.5322 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8007	IF-205-161-FX	NEKXF1	Neck Force X	Hd	13342.908 N	-	1/8/2004	OK 416v	FTSS	IF-205
8008	IF-205-161-FY	NEKYF1	Neck Force Y	Hd	13322.883 N	+	1/8/2004	OK 416v	FTSS	IF-205
8009	IF-205-161-FZ	NEKZF1	Neck Force Z	Hd	20037.217 N	+	1/8/2004	OK 416v	FTSS	IF-205
8010	IF-205-161-MX	NEKXM1	Neck Moment X	Rt Ear	423.35854 N·m	-	1/8/2004	OK 416v	FTSS	IF-205
8011	IF-205-161-MY	NEKYM1	Neck Moment Y	Chin	424.87566 N·m	+	1/8/2004	OK 416v	FTSS	IF-205
8012	IF-205-161-MZ	NEKZM1	Neck Moment Z	Chn	423.27097 N·m	+	1/8/2004	OK 416v	FTSS	IF-205
D-2 8013	3251-108-FX	NKLXF1	Neck Lwr Force X	Hd	13349.505 N	-	1/7/2004	OK 416v	Denton	3251
8014	3251-108-FY	NKLYF1	Neck Lwr Force Y	Hd	13370.705 N	+	1/7/2004	OK 416v	Denton	3251
8015	3251-108-FZ	NKLZF1	Neck Lwr Force Z	Hd	20002.203 N	+	1/7/2004	OK 416v	Denton	3251
8016	3251-108-MX	NKLXM1	Neck Lwr Moment X	Rt Ear	423.32409 N·m	-	1/7/2004	OK 416v	Denton	3251
8017	3251-108-MY	NKLYM1	Neck Lwr Moment Y	Chn	423.92659 N·m	+	1/7/2004	OK 416v	Denton	3251
8018	3251-108-MZ	NKLZM1	Neck Lwr Moment Z	Chn	423.28812 N·m	+	1/7/2004	OK 416v	Denton	3251
8019	02A16-A04	CSTXG1	Chest Accel X	Fwd	597.41687 g	+	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8020	C02B19-F02	CSTYG1	Chest Accel Y	Lft	594.09529 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8021	C02B19-F06	CSTZG1	Chest Accel Z	Up	603.36517 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8022	B02A25-N08	CSTXR1	Chest Accel Red X	Rwd	596.85290 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8023	03E03E19-N02	CSTYR1	Chest Accel Red Y	Lft	602.06281 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8024	C02B19-F04	CSTZR1	Chest Accel Red Z	Up	594.40801 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8025	14CB1-2897-416	CSTXD1	Chest Deflection X 516	Strnm	99.386887 mm	+	1/8/2004	OK 416v	Servo	14CB1-2897
8026	C02B19-F03	PEVXG1	Pelvis Accel X	Rwd	604.16536 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8027	02A16-A27	PEVYG1	Pelvis Accel Y	Lft	603.51452 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8028	C02B19-F01	PEVZG1	Pelvis Accel Z	Up	602.46152 g	-	7/7/2004	OK 416v	Entran	EGE-73B6Q-200
8029	2430-736	LFMZFI	Left Femur Force Z #8	Knee	33358.582 N	+	1/8/2004	OK 416v	GSE	2430
8030	150-121VR-0226	KNLXD1	Left Knee Displacement	Tib	39.857385 mm	+	5/29/2003	--- 416v	Space Age	150-0121VR
040812 8031	4825J-91-FX	TBLXF1	Left Upr Tibia Force X	Tib	11089.730 N	+	9/4/2003	OK 416v	Denton	4825J
8032	4825J-91-FZ	TBLZF1	Left Upr Tibia Force Z	Tib	11122.449 N	+	9/4/2003	OK 416v	Denton	4825J

Channel Report

8/12/2004 7:49:46 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAU9

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
9001	4825J-91-MX	TBLXM1	Left Upr Tibia Moment X	Ank	394.68354 N·m	+	9/4/2003	OK 416v	Denton	4825J
9002	4825J-91-MY	TBLYM1	Left Upr Tibia Moment Y	Ank	395.93577 N·m	+	9/4/2003	OK 416v	Denton	4825J
9003	99H30-Z01	TBLXG1	Left Tibia Accel X	Fwd	1178.0918 g	+	7/12/2004	OK 416v	Entran	EGE-73BQE0-20
9004	99108-F26	TBLYG1	Left Tibia Accel Y	Rt	1206.2800 g	+	7/12/2004	OK 416v	Entran	EGE-73BQE0-20
9005	4826J-92-FX	ANLXF1	Left Lwr Tibia Force X	Ank	11120.247 N	+	9/4/2003	OK 416v	Denton	4826J
9006	4826J-92-FY	ANLYF1	Left Lwr Tibia Force Y	Ank	11113.246 N	+	9/4/2003	OK 416v	Denton	4826J
9007	4826J-92-FZ	ANLZF1	Left Lwr Tibia Force Z	Ank	11117.123 N	+	9/4/2003	OK 416v	Denton	4826J
9008	4826J-92-MX	ANLXM1	Left Lwr Tibia Moment X	Ank	394.88912 N·m	+	9/4/2003	OK 416v	Denton	4826J
9009	4826J-92-MY	ANLYM1	Left Lwr Tibia Moment Y	Ank	397.10098 N·m	+	9/4/2003	OK 416v	Denton	4826J
9010	00L13-F29	FTLXG1	Left Foot Accel X	Fwd	1205.9032 g	+	7/9/2004	OK 416v	Entran	EGE-73B6Q-200
9011	01G25-N08	FTLYG1	Left Foot Accel Y	Rt	1216.4583 g	+	7/9/2004	OK 416v	Entran	EGE-73B6Q-200
9012	BD88J	FTLZG1	Left Foot Accel Z	Dn	1179.0812 g	+	7/20/2004	OK 416v	Endevco	7264-2KM5T
9013	2430-742	RFMZF1	Right Femur Force Z 507	Knee	33376.618 N	+	1/8/2004	OK 416v	GSE	2430
9014	150-121VL-0205	KNRDX1	Right Knee Displacement	Tib	39.915491 mm	+	5/29/2003	--- 416v	Space Age	150-0121VL
9015	4825J-90-FX	TBRXF1	Right Upr Tibia Force X	Tib	11127.487 N	+	9/3/2003	OK 416v	Denton	4825J
9016	4825J-90-FZ	TBRZF1	Right Upr Tibia Force Z	Tib	11114.040 N	+	9/3/2003	OK 416v	Denton	4825J
9017	4825J-90-MX	TBRXM1	Right Upr Tibia Moment X	Ank	394.78389 N·m	+	9/3/2003	OK 416v	Denton	4825J
9018	4825J-90-MY	TBRYM1	Right Upr Tibia Moment Y	Ank	396.99520 N·m	+	9/3/2003	OK 416v	Denton	4825J
9019	02102110-N18	TBRXG1	Right Tibia Accel X	Fwd	1201.5377 g	+	7/8/2004	OK 416v	Entran	EGE-73B6Q-200
9020	98H10-F05	TBRYG1	Right Tibia Accel Y	Rt	1199.9110 g	+	6/30/2004	OK 416v	Entran	EGE-73BQ-2000
9021	4826J-93-FX	ANRXF1	Right Lwr Tibia Force X	Ank	11108.760 N	+	9/4/2003	OK 416v	Denton	4826J
9022	4826J-93-FY	ANRYF1	Right Lwr Tibia Force Y	Ank	11106.480 N	+	9/4/2003	OK 416v	Denton	4826J
9023	4826J-93-FZ	ANRZF1	Right Lwr Tibia Force Z	Ank	11110.160 N	+	9/4/2003	OK 416v	Denton	4826J
9024	4826J-93-MX	ANRXM1	Right Lwr Tibia Moment X	Ank	395.33504 N·m	+	9/4/2003	OK 416v	Denton	4826J
9025	4826J-93-MY	ANRYM1	Right Lwr Tibia Moment Y	Ank	396.87121 N·m	+	9/4/2003	OK 416v	Denton	4826J
9026	02102105-F18	FTRXG1	Right Foot Accel X	Fwd	1210.2817 g	+	7/9/2004	OK 416v	Entran	EGE-73B6Q-200
9027	02102105-F03	FTRYG1	Right Foot Accel Y	Rt	1195.4963 g	+	7/9/2004	OK 416v	Entran	EGE-73B6Q-200
9028	00L13-F72	FTRZG1	Right Foot Accel Z	Dn	1177.8749 g	+	7/9/2004	OK 416v	Entran	EGE-73B6Q-200
9030	P28853	HEDXG2	Head Accel X	Rwd	1223.7093 g	-	2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
9031	P28852	HEDYG2	Head Accel Y	Lft	1211.9490 g	-	2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
9032	P28760	HEDZG2	Head Accel Z	Up	1175.1744 g	-	2/13/2004	OK 048tr	Endevco	7264C-2K-2-180

D-3

040812

Channel Report

8/12/2004 7:49:47 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUA

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
0001	P29631	HEDXR2	Head Accel X Red	Rwd	1213.0536	g	- 7/1/2004	OK 048tr	Endevco	7264C-2K-2-180
0002	P30332	HEDYR2	Head Accel Y Red	Lt	1221.1337	g	- 7/1/2004	OK 048tr	Endevco	7264C-2K-2-180
0003	P30408	HEDZR2	Head Accel Z Red	Up	1223.5280	g	- 7/1/2004	OK 048tr	Endevco	7264C-2K-2-180
0004	1716A-858-FX	NEKXF2	Neck Force X	Hd	13336.459	N	- 3/22/2004	OK 048tr	Denton	1716A
0005	1716A-858-FY	NEKYF2	Neck Force Y	Hd	13341.046	N	+ 3/22/2004	OK 048tr	Denton	1716A
0006	1716A-858-FZ	NEKZF2	Neck Force Z	Hd	20042.276	N	+ 3/22/2004	OK 048tr	Denton	1716A
0007	1716A-858-MX	NEKXM2	Neck Moment X	Rt Ear	423.49931	N·m	- 3/22/2004	OK 048tr	Denton	1716A
0008	1716A-858-MY	NEKYM2	Neck Moment Y	Chn	424.45208	N·m	+ 3/22/2004	OK 048tr	Denton	1716A
0009	1716A-858-MZ	NEKZM2	Neck Moment Z	Chn	424.54394	N·m	+ 3/22/2004	OK 048tr	Denton	1716A
0010	5045J-78-FX	NKLXF2	Neck Lwr Force X	Hd	13355.815	N	+ 10/22/2003	OK 048tr	Denton	5045J
0011	5045J-78-FY	NKLYF2	Neck Lwr Force Y	Hd	13371.441	N	+ 10/22/2003	OK 048tr	Denton	5045J
0012	5045J-78-FZ	NKLZF2	Neck Lwr Force Z	Hd	20042.675	N	+ 10/22/2003	OK 048tr	Denton	5045J
0013	5045J-78-MX	NKLXM2	Neck Lwr Moment X	Lt Ear	423.76725	N·m	+ 10/22/2003	OK 048tr	Denton	5045J
0014	5045J-78-MY	NKLYM2	Neck Lwr Moment Y	Chn	424.04552	N·m	+ 10/22/2003	OK 048tr	Denton	5045J
0015	5045J-78-MZ	NKLZM2	Neck Lwr Moment Z	Chn	423.68498	N·m	+ 10/22/2003	OK 048tr	Denton	5045J
0016	P28854	CSTXG2	Chest Accel X	Fwd	598.83040	g	+ 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0017	P28381	CSTYG2	Chest Accel Y	Lft	604.70774	g	- 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0018	P28297	CSTZG2	Chest Accel Z	Up	596.12518	g	- 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0019	P33910	CSTXR2	Chest Accel X Red	Rwd	596.31959	g	- 4/19/2004	OK 048tr	Endevco	7264C-2K-2-180
0020	P33845	CSTYR2	Chest Accel Y Red	Lft	602.27499	g	- 4/19/2004	OK 048tr	Endevco	7264C-2K-2-180
0021	P34092	CSTZR2	Chest Accel Z Red	Up	594.95450	g	- 4/19/2004	OK 048tr	Endevco	7264C-2K-2-180
0022	6209-2038-0436	CSTXD2	Chest Deflection X	Strnm	99.969540	mm	+ 3/20/2004	OK 048tr	JDK	6209-2038
0023	P28280	PEVXG2	Pelvis Accel X	Rwd	603.59563	g	- 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0024	P28316	PEVYG2	Pelvis Accel Y	Lft	603.93738	g	- 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0025	P28400	PEVZG2	Pelvis Accel Z	Up	596.93139	g	- 2/13/2004	OK 048tr	Endevco	7264C-2K-2-180
0026	2121-0160	LFMZ2	Left Femur Force Z	Knee	20032.866	N	+ 3/22/2004	OK 048tr	Denton	2121
0027	2121-0161	RFMZ2	Right Femur Force Z	Knee	20022.290	N	+ 3/22/2004	OK 048tr	Denton	2121
0028	J18661	HEDXG3	Head Accel X	Rwd	1196.4623	g	- 7/8/2004	OK 070v	Endevco	7264-2000T
0029	AAMD5	HEDYG3	Head Accel Y	Lft	1166.1618	g	- 7/8/2004	OK 070v	Endevco	7264-2000LC
0030	AJ4R6	HEDZG3	Head Accel Z	Up	1176.8004	g	- 7/8/2004	OK 070v	Endevco	7264-2KM5T
0031	1716AJ-1563-FX	NEKXF3	Neck Force X	Hd	13358.937	N	+ 7/7/2004	OK 070v	Denton	1716AJ
0032	1716AJ-1563-FY	NEKYF3	Neck Force Y	Hd	13335.694	N	+ 7/7/2004	OK 070v	Denton	1716AJ

D-4

040812

Channel Report

8/12/2004 7:49:47 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUC

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
0001	1716AJ-1563-FZ	NEKZF3	Neck Force Z	Hd	20004.688	N	+ 7/7/2004	OK 070v	Denton	1716AJ
0002	1716AJ-1563-MX	NEKXM3	Neck Moment X	Lt Ear	424.79089	N·m	+ 7/7/2004	OK 070v	Denton	1716AJ
0003	1716AJ-1563-MY	NEKYM3	Neck Moment Y	Chn	423.76023	N·m	+ 7/7/2004	OK 070v	Denton	1716AJ
0004	1716AJ-1563-MZ	NEKZM3	Neck Moment Z	Chn	424.01586	N·m	+ 7/7/2004	OK 070v	Denton	1716AJ
0005	3251-107-FX	NKLXF3	Neck Lwr Force X	Hd	13336.563	N	- 7/8/2004	OK 070v	Denton	3251
0006	3251-107-FY	NKLYF3	Neck Lwr Force Y	Hd	13321.746	N	+ 7/8/2004	OK 070v	Denton	3251
0007	3251-107-FZ	NKLZF3	Neck Lwr Force Z	Hd	20046.671	N	+ 7/8/2004	OK 070v	Denton	3251
0008	3251-107-MX	NKLXM3	Neck Lwr Moment X	Rt Ear	424.75244	N·m	- 7/8/2004	OK 070v	Denton	3251
0009	3251-107-MY	NKLYM3	Neck Lwr Moment Y	Chn	424.53831	N·m	+ 7/8/2004	OK 070v	Denton	3251
0010	3251-107-MZ	NKLZM3	Neck Lwr Moment Z	Chn	424.25154	N·m	+ 7/8/2004	OK 070v	Denton	3251
0011	AAJY4	CSTXG3	Chest Accel X	Fwd	597.53442	g	+ 7/8/2004	OK 070v	Endevco	7264-2000LC
0012	AKAA4	CSTYG3	Chest Accel Y	Lft	606.99106	g	- 7/8/2004	OK 070v	Endevco	7264-2KM5T
0013	ACC63	CSTZG3	Chest Accel Z	Up	608.38815	g	- 7/8/2004	OK 070v	Endevco	7264-2000T
0014	14CB1-2897-070	CSTXD3	Chest Deflection X	Strnm	100.66837	mm	+ 7/13/2004	OK 070v	Servo	14CB1-2897
0015	AGN83	PEVXG3	Pelvis Accel X	Rwd	606.23024	g	- 7/8/2004	OK 070v	Endevco	7264-2000LC
0016	J35770	PEVYG3	Pelvis Accel Y	Lft	598.45978	g	- 7/8/2004	OK 070v	Endevco	7264-2000TZ
0017	J20014	PEVZG3	Pelvis Accel Z	Up	604.55779	g	- 7/8/2004	OK 070v	Endevco	7264-2KM5T
0018	IF-625-140-FZ	LFMZ3	Left Femur Force Z	Knee	20028.007	N	+ 7/14/2004	OK 070v	FTSS	IF-625
0019	IF-625-141-FZ	RFMZ3	Right Femur Force Z	Knee	20027.616	N	+ 7/14/2004	OK 070v	FTSS	IF-625
0020	P34978	LSXXG	Left Rear Seat Cross-member	FWD	997.04003	g	+ 6/7/2004	OK -1	Endevco	7264C-2K-2-180
0021	P34765	RSXXG	Right Rear Seat Cross-member	FWD	988.05457	g	+ 6/7/2004	OK -1	Endevco	7264C-2K-2-180
0022	P33608	TENXG	Top of Engine X-axis	FWD	1534.7721	g	+ 3/31/2004	OK -1	Endevco	7264C-2K-2-180
0023	P34231	BENXG	Bottom of Engine X-axis	RR	1536.6146	g	- 6/7/2004	OK -1	Endevco	7264C-2K-2-180
0024	P33513	RFCXG	Right Front Brake Caliper	FWD	1000.6253	g	+ 4/19/2004	OK -1	Endevco	7264C-2K-2-180
0025	P34966	LFCXG	Left Front Brake Caliper X-axis	RR	999.10236	g	- 6/7/2004	OK -1	Endevco	7264C-2K-2-180
0026	P34968	DPCXG	Instrument Panel Top Center	FWD	987.34958	g	+ 6/7/2004	OK -1	Endevco	7264C-2K-2-180
0027	P27919	VCGXG	Vehicle CG X-axis acceleration	FWD	1010.2285	g	+ 7/28/2004	OK -1	Endevco	7264C-2K-2-180
0028	P29507	VCGYG	Vehicle CG Y-axis acceleration	LT	981.78519	g	- 7/28/2004	OK -1	Endevco	7264C-2K-2-180
0029	P30415	VCGZG	Vehicle CG Z-axis acceleration	UP	988.94200	g	- 7/28/2004	OK -1	Endevco	7264C-2K-2-180
0030	P32767	RDKXG	Vehicle rear deck X-axis	RR	1004.3942	g	- 2/27/2004	OK -1	Endevco	7264C-2K-2-180
0031	P33974	RDKYG	Vehicle rear deck Y-axis	RT	1010.4598	g	+ 4/19/2004	OK -1	Endevco	7264C-2K-2-180
0032	P33874	RDKZG	Vehicle rear deck Z-axis	UP	987.34958	g	- 4/19/2004	OK -1	Endevco	7264C-2K-2-180

D-5

040812

Channel Report

8/12/2004 7:49:47 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUD

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
0001	ABFire1	DABETA	Driver airbag primary	IP01	5.12	V	+ 4/19/2004	OK -1	FLUKE	Y8101A
0002	ABFire2	DABETB	Driver airbag secondary	IP07	5.12	V	+ 4/19/2004	OK -1	FLUKE	Y8101A
0003	ABFire3	PABETA	Passenger airbag primary	IP02	5.12	V	+ 4/19/2004	OK -1	FLUKE	Y8101A
0004	ABFire4	PABETB	Passenger airbag secondary	IP05	5.12	V	+ 4/19/2004	OK -1	FLUKE	Y8101A
0005	3419T-828	SHBF3	2rd row Right Rear Passenger	1015	13329.966	N	+ 6/15/2004	OK -1	Lebow	3419T
0006	3419T-831	LBOF3	2rd row Right Rear Passenger	5228	13336.042	N	+ 3/23/2004	OK -1	Lebow	3419T

Channel Report

8/12/2004 7:49:47 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUE

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model	
0001	EVENT	EVENT	EVENT		5.12	V	+ 4/19/2004	OK	-1	TRC	Event
0002	398390053	LC0101	ROW 1 COLUMN 1		500056.15	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0003	398390008	LC0102	ROW 1 COLUMN 2		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0004	398390028	LC0103	ROW 1 COLUMN 3		499943.36	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0005	398390038	LC0104	ROW 1 COLUMN 4		500056.15	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0006	398390003	LC0105	ROW 1 COLUMN 5		500005.61	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0007	398390014	LC0106	ROW 1 COLUMN 6		499994.14	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0008	398390024	LC0107	ROW 1 COLUMN 7		499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0009	398390006	LC0108	ROW 1 COLUMN 8		499822.32	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0010	398390132	LC0109	ROW 1 COLUMN 9		499750.85	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0011	398390023	LC0110	ROW 1 COLUMN 10		499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0012	398390033	LC0111	ROW 1 COLUMN 11		499933.11	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0013	398390019	LC0112	ROW 1 COLUMN 12		500122.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0014	398390113	LC0113	ROW 1 COLUMN 13		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0015	398390098	LC0114	ROW 1 COLUMN 14		500125.03	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0016	398390104	LC0115	ROW 1 COLUMN 15		499816.96	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0017	398390088	LC0116	ROW 1 COLUMN 16		499750.85	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0018	398390120	LC0201	ROW 2 COLUMN 1		499822.32	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0019	398390063	LC0202	ROW 2 COLUMN 2		500252.81	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0020	398390124	LC0203	ROW 2 COLUMN 3		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0021	398390093	LC0204	ROW 2 COLUMN 4		499822.32	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0022	398390046	LC0205	ROW 2 COLUMN 5		500125.03	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0023	398390122	LC0206	ROW 2 COLUMN 6		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0024	398390002	LC0207	ROW 2 COLUMN 7		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0025	398390060	LC0208	ROW 2 COLUMN 8		500298.02	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0026	398390105	LC0209	ROW 2 COLUMN 9		499933.11	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0027	398390020	LC0210	ROW 2 COLUMN 10		499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0028	398390069	LC0211	ROW 2 COLUMN 11		500240.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0029	398390041	LC0212	ROW 2 COLUMN 12		499816.96	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0030	398390112	LC0213	ROW 2 COLUMN 13		499994.14	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0031	398390074	LC0214	ROW 2 COLUMN 14		500125.03	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
0032	398390128	LC0215	ROW 2 COLUMN 15		500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875

Channel Report

8/12/2004 7:49:48 AM

0033	398390075	LC0216	ROW 2 COLUMN 16	500125.03	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0034	398390125	LC0301	ROW 3 COLUMN 1	500176.82	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0035	398390004	LC0302	ROW 3 COLUMN 2	500298.02	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0036	398390051	LC0303	ROW 3 COLUMN 3	500298.02	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0037	398390042	LC0304	ROW 3 COLUMN 4	499816.96	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0038	398390011	LC0305	ROW 3 COLUMN 5	500057.13	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0039	398390117	LC0306	ROW 3 COLUMN 6	500298.02	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0040	398390066	LC0307	ROW 3 COLUMN 7	499692.08	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0041	398390045	LC0308	ROW 3 COLUMN 8	499943.36	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0042	398390077	LC0309	ROW 3 COLUMN 9	500056.15	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0043	398390029	LC0310	ROW 3 COLUMN 10	499750.85	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0044	398390100	LC0311	ROW 3 COLUMN 11	499874.29	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0045	398390102	LC0312	ROW 3 COLUMN 12	500056.15	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0047	398390012	LC0314	ROW 3 COLUMN 14	499943.36	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875
0048	398390017	LC0315	ROW 3 COLUMN 15	500252.81	N	-	12/10/2003	---	VRTC	KYOWA	F99-1875

Channel Report

8/12/2004 7:49:48 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUF

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
0001	398390081	LC0316	ROW 3 COLUMN 16		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0002	398390040	LC0401	ROW 4 COLUMN 1		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0003	398390007	LC0402	ROW 4 COLUMN 2		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0004	398390071	LC0403	ROW 4 COLUMN 3		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0005	398390094	LC0404	ROW 4 COLUMN 4		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0006	398390067	LC0405	ROW 4 COLUMN 5		499943.36 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0007	398390086	LC0406	ROW 4 COLUMN 6		500176.82 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0009	398390118	LC0407	ROW 4 COLUMN 7		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0010	398390101	LC0408	ROW 4 COLUMN 8		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0011	398390073	LC0409	ROW 4 COLUMN 9		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0012	398390047	LC0410	ROW 4 COLUMN 10		500298.02 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0013	398390099	LC0411	ROW 4 COLUMN 11		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0014	398390080	LC0412	ROW 4 COLUMN 12		499708.66 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
D-9 0015	398390097	LC0413	ROW 4 COLUMN 13		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0016	398390048	LC0414	ROW 4 COLUMN 14		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0017	398390061	LC0415	ROW 4 COLUMN 15		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0018	398390005	LC0416	ROW 4 COLUMN 16		500240.10 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0019	398390090	LC0501	ROW 5 COLUMN 1		500240.10 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0020	398390065	LC0502	ROW 5 COLUMN 2		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0021	398390079	LC0503	ROW 5 COLUMN 3		499816.96 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0022	398390055	LC0504	ROW 5 COLUMN 4		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0023	398390031	LC0505	ROW 5 COLUMN 5		499750.85 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0024	398390054	LC0506	ROW 5 COLUMN 6		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0025	398390050	LC0507	ROW 5 COLUMN 7		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0026	398390089	LC0508	ROW 5 COLUMN 8		499750.85 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0027	398390130	LC0509	ROW 5 COLUMN 9		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0028	398390082	LC0510	ROW 5 COLUMN 10		500005.61 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0029	398390083	LC0511	ROW 5 COLUMN 11		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0030	398390123	LC0512	ROW 5 COLUMN 12		499750.85 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0031	398390032	LC0513	ROW 5 COLUMN 13		499874.29 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
040812 0032	398390121	LC0514	ROW 5 COLUMN 14		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875

Channel Report

8/12/2004 7:49:48 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUG

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model
0001	398390009	LC0515	ROW 5 COLUMN 15		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0002	398390037	LC0516	ROW 5 COLUMN 16		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0003	398390036	LC0601	ROW 6 COLUMN 1		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0004	398390052	LC0602	ROW 6 COLUMN 2		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0005	398390010	LC0603	ROW 6 COLUMN 3		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0006	398390034	LC0604	ROW 6 COLUMN 4		499874.29 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0007	398390026	LC0605	ROW 6 COLUMN 5		500019.53 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0008	398390022	LC0606	ROW 6 COLUMN 6		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0009	398390030	LC0607	ROW 6 COLUMN 7		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0010	398390016	LC0608	ROW 6 COLUMN 8		500056.15 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0011	398390035	LC0609	ROW 6 COLUMN 9		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0012	398390092	LC0610	ROW 6 COLUMN 10		500298.02 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0013	398390043	LC0611	ROW 6 COLUMN 11		500176.82 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0014	398390076	LC0612	ROW 6 COLUMN 12		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0015	398390001	LC0613	ROW 6 COLUMN 13		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0016	398390087	LC0614	ROW 6 COLUMN 14		500176.82 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0017	398390096	LC0615	ROW 6 COLUMN 15		499943.36 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0018	398390015	LC0616	ROW 6 COLUMN 16		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0019	398390027	LC0701	ROW 7 COLUMN 1		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0020	398390111	LC0702	ROW 7 COLUMN 2		499994.14 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0021	398390072	LC0703	ROW 7 COLUMN 3		500125.03 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0022	398390106	LC0704	ROW 7 COLUMN 4		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0023	398390056	LC0705	ROW 7 COLUMN 5		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0024	398390114	LC0706	ROW 7 COLUMN 6		499755.97 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0025	398390068	LC0707	ROW 7 COLUMN 7		500331.76 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0026	398390057	LC0708	ROW 7 COLUMN 8		500180.72 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0027	398390049	LC0709	ROW 7 COLUMN 9		499692.08 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0028	398390131	LC0710	ROW 7 COLUMN 10		500125.03 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0029	398390018	LC0711	ROW 7 COLUMN 11		499750.85 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0030	398390084	LC0712	ROW 7 COLUMN 12		500122.10 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0031	398390062	LC0713	ROW 7 COLUMN 13		499874.29 N	-	12/10/2003	---	VRTC	KYOWA F99-1875
0032	398390078	LC0714	ROW 7 COLUMN 14		499933.11 N	-	12/10/2003	---	VRTC	KYOWA F99-1875

D-10

040812

Channel Report

8/12/2004 7:49:49 AM

Name of Test 040812-1

System MINIDAU

Name of DAU DAUH

Chan.#	Sensor #	Mnemonic	Description	Dir.	Range	Pol.	Cal.	Group	Mfg.	Model	
D-11	0001	398390127	LC0715	ROW 7 COLUMN 15	499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0002	398390021	LC0716	ROW 7 COLUMN 16	499874.29	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0003	398390133	LC0801	ROW 8 COLUMN 1	499874.29	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0004	398390039	LC0802	ROW 8 COLUMN 2	499750.85	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0005	398390085	LC0803	ROW 8 COLUMN 3	500298.02	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0006	398390059	LC0804	ROW 8 COLUMN 4	500125.03	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0007	398390116	LC0805	ROW 8 COLUMN 5	500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0008	398390013	LC0806	ROW 8 COLUMN 6	499933.11	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0009	398390119	LC0807	ROW 8 COLUMN 7	500122.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0010	398390107	LC0808	ROW 8 COLUMN 8	500122.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0011	398390095	LC0809	ROW 8 COLUMN 9	499755.97	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0012	398390103	LC0810	ROW 8 COLUMN 10	499750.85	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0013	398390129	LC0811	ROW 8 COLUMN 11	499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0014	398390058	LC0812	ROW 8 COLUMN 12	499874.29	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0015	398390126	LC0813	ROW 8 COLUMN 13	499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0016	398390108	LC0814	ROW 8 COLUMN 14	499755.97	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0017	398390025	LC0815	ROW 8 COLUMN 15	500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0018	398390070	LC0816	ROW 8 COLUMN 16	500252.81	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0019	398390109	LC0906	ROW 9 COLUMN 6	500122.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0020	398390044	LC0907	ROW 9 COLUMN 7	500122.10	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0021	398390134	LC0908	ROW 9 COLUMN 8	499960.94	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0022	398390115	LC0909	ROW 9 COLUMN 9	499755.97	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0023	398390110	LC0910	ROW 9 COLUMN 10	499692.08	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0024	398390064	LC0911	ROW 9 COLUMN 11	499943.36	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875
	0025	398390091	LC0313	ROW 3 COLUMN 13	500176.82	N	- 12/10/2003	---	VRTC	KYOWA	F99-1875

040812

D-12

040812

Dummy 416v Type HYBRID III 5th Descriptio VRTC - 416v HYBRID III w/RED.& THOR LEGS ICAL'd 9-4-03 (DKS 7-23-04)J211

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
HEDXG	Head Accel X	EGE-73B6Q-20	03E03E20-N20	Entran	0.0205746 g	2000	7/7/2004	Fwd	0
HEDYG	Head Accel Y	EGE-73B6Q-20	02A18-N10	Entran	0.0195632 g	2000	7/7/2004	Lft	1
HEDZG	Head Accel Z	EGE-73B6Q-20	02A09-F15	Entran	0.0212632 g	2000	7/7/2004	Up	1
HEDXR	Head Accel Red X	EGE-73B6Q-20	01L26-F02	Entran	0.020106 g	2000	7/7/2004	Rwd	1
HEDYR	Head Accel Red Y	EGE-73B6Q-20	02A09-F13	Entran	0.0194317 g	2000	7/7/2004	Lft	1
HEDZR	Head Accel Red Z	EGE-73B6Q-20	02A16-A06	Entran	0.0193531 g	2000	7/7/2004	Up	1
HD1XG	Head (LT) Accel X	EGE-73B6Q-20	02A16-A19	Entran	0.0210447 g	2000	7/7/2004	Fwd	0
HD1ZG	Head (LT) Accel Z	EGE-73B6Q-20	02A16-A22	Entran	0.0218403 g	2000	7/7/2004	Up	1
HD2YG	Head (FT) Accel Y	EGE-73B6Q-20	02A18-N04	Entran	0.0195438 g	2000	7/7/2004	Lft	1
HD2ZG	Head (FT) Accel Z	EGE-73B6Q-20	02A18-N20	Entran	0.0199345 g	2000	7/7/2004	Up	1
HD3XG	Head (TP) Accel X	EGE-73B6Q-20	03F03F09-N05	Entran	0.0191798 g	2000	7/7/2004	Fwd	0
HD3YG	Head (TP) Accel Y	EGE-73BQ-200	98H14-K10	Entran	0.0179668 g	2000	6/30/2004	Lft	1
NEKXF	Neck Force X	IF-205	IF-205-161-FX	FTSS	0.000186274 N	8896	1/8/2004	Hd Fd,Cst Rr	1
NEKYF	Neck Force Y	IF-205	IF-205-161-FY	FTSS	0.00017548 N	8896	1/8/2004	Hd Lt,Cst Rt	0
NEKZF	Neck Force Z	IF-205	IF-205-161-FZ	FTSS	0.000092918 N	13344	1/8/2004	Hd Up,Cst Dn	0
NEKXM	Neck Moment X	IF-205	IF-205-161-MX	FTSS	0.0058424 N·m	282.5	1/8/2004	Rt Ear to Rt Shld	1
NEKYM	Neck Moment Y	IF-205	IF-205-161-MY	FTSS	0.00605557 N·m	282.5	1/8/2004	Chin to Strnm	0
NEKZM	Neck Moment Z	IF-205	IF-205-161-MZ	FTSS	0.0085185 N·m	282.5	1/8/2004	Chn to Lt Shld	0
NKLXF	Neck Lwr Force X	3251	3251-108-FX	Denton	0.000174334 N	13345	1/7/2004	Hd Fd,Cst Rr	1
NKLYF	Neck Lwr Force Y	3251	3251-108-FY	Denton	0.00017327 N	13345	1/7/2004	Hd Lt,Cst Rt	0
NKLZF	Neck Lwr Force Z	3251	3251-108-FZ	Denton	0.00009623 N	13345	1/7/2004	Hd Up,Cst Dn	0
NKLXM	Neck Lwr Moment X	3251	3251-108-MX	Denton	0.0044466 N·m	452	1/7/2004	Rt Ear to Rt Shld	1
NKLYM	Neck Lwr Moment Y	3251	3251-108-MY	Denton	0.00426769 N·m	452	1/7/2004	Chn to Strnm	0
NKLZM	Neck Lwr Moment Z	3251	3251-108-MZ	Denton	0.005282 N·m	339	1/7/2004	Chn to Lt Shld	0
CSTXG	Chest Accel X	EGE-73B6Q-20	02A16-A04	Entran	0.020903 g	2000	7/7/2004	Fwd	0
CSTYG	Chest Accel Y	EGE-73B6Q-20	C02B19-F02	Entran	0.0187351 g	2000	7/7/2004	Lft	1

Thursday, August 12, 2004 416v

Page 1 of 3

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
CSTZG	Chest Accel Z	EGE-73B6Q-20	C02B19-F06	Entran	0.0188572 g	2000	7/7/2004	Up	1
CSTXR	Chest Accel Red X	EGE-73B6Q-20	B02A25-N08	Entran	0.0194962 g	2000	7/7/2004	Rwd	1
CSTYR	Chest Accel Red Y	EGE-73B6Q-20	03E03E19-N02	Entran	0.0223792 g	2000	7/7/2004	Lft	1
CSTZR	Chest Accel Red Z	EGE-73B6Q-20	C02B19-F04	Entran	0.0175788 g	2000	7/7/2004	Up	1
STUXG	Sternum Upr Accel X	EGE-73B6Q-20	B02A09-F08	Entran	0.0209767 g	2000	7/7/2004	Fwd	0
STMXG	Sternum Mid Accel X	EGE-73B6Q-20	02A16-A05	Entran	0.021901 g	2000	7/7/2004	Fwd	0
STLXG	Sternum Lwr Accel X	EGE-73B6Q-20	03F03F09-N18	Entran	0.0168275 g	2000	7/7/2004	Fwd	0
CSTXD	Chest Deflection X 516	14CB1-2897	14CB1-2897-416	Servo	1.7463 mm	100	1/8/2004	Strnm Away Frm Spn	0
!LMBXF	Lumbar Force X	2152	2152-076-FX	Denton	0.000144364 N	13344.6	6/1/2001	Cst Fd,Pel Rr	1
!LMBYF	Lumbar Force Y	2152	2152-076-FY	Denton	0.000143967 N	13344.6	6/1/2001	Cst Lt,Pel Rt	0
!LMBZF	Lumbar Force Z	2152	2152-076-FZ	Denton	0.000058433 N	17793	6/1/2001	Cst Up,Pel Dn	0
!LMBXM	Lumbar Moment X	2152	2152-076-MX	Denton	0.002374243 N·m	677.9	6/1/2001	Rt Shld to Rt Hip	1
!LMBYM	Lumbar Moment Y	2152	2152-076-MY	Denton	0.002370998 N·m	677.9	6/1/2001	Strnm to Frt of Legs	0
PEVXG	Pelvis Accel X	EGE-73B6Q-20	C02B19-F03	Entran	0.0172949 g	2000	7/7/2004	Rwd	1
PEVYG	Pelvis Accel Y	EGE-73B6Q-20	02A16-A27	Entran	0.0212091 g	2000	7/7/2004	Lft	1
PEVZG	Pelvis Accel Z	EGE-73B6Q-20	C02B19-F01	Entran	0.0193147 g	2000	7/7/2004	Up	1
LFMZ	Left Femur Force Z #8	2430	2430-736	GSE	0.000070083 N	13344	1/8/2004	Knee Fd,Pel Rr	0
RFMZ	Right Femur Force Z 507	2430	2430-742	GSE	0.000066696 N	13344	1/8/2004	Knee Fd,Pel Rr	0
KNLXD	Left Knee Displacement	150-0121VR	150-121VR-022653	Space Age	23.356 mm	40	5/29/2003	Tib Fd,Hld Fem	0
TBLXF	Left Upr Tibia Force X	4825J	4825J-91-FX	Denton	0.000266871 N	8896.4	9/4/2003	Tib Fd,Knee Rr	0
TBLZF	Left Upr Tibia Force Z	4825J	4825J-91-FZ	Denton	0.000108313 N	8896.4	9/4/2003	Tib Dn,Knee Up	0
TBLXM	Left Upr Tibia Moment X	4825J	4825J-91-MX	Denton	0.01029557 N·m	282.4	9/4/2003	Ank Lt,Hld Knee	0
TBLYM	Left Upr Tibia Moment Y	4825J	4825J-91-MY	Denton	0.010263008 N·m	282.4	9/4/2003	Ank Fd,Hld Knee	0
TBLXG	Left Tibia Accel X	EGE-73BQE0-	99H30-Z01	Entran	0.0188957 g	2000	7/12/2004	Fwd	0
TBLYG	Left Tibia Accel Y	EGE-73BQE0-	99108-F26	Entran	0.0235803 g	2000	7/12/2004	Rt	0
ANLXF	Left Lwr Tibia Force X	4826J	4826J-92-FX	Denton	0.00026461 N	8896.4	9/4/2003	Ank Fd,Knee Rr	0
ANLYF	Left Lwr Tibia Force Y	4826J	4826J-92-FY	Denton	0.000263263 N	8896.4	9/4/2003	Ank Rt,Knee Lft	0
ANLZF	Left Lwr Tibia Force Z	4826J	4826J-92-FZ	Denton	0.000107605 N	8896.4	9/4/2003	Ank Dn,Knee Up	0

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
ANLXM	Left Lwr Tibia Moment X	4826J	4826J-92-MX	Denton	0.01029021 N·m	282.4	9/4/2003	Ank Lt,Hld Knee	0
ANLYM	Left Lwr Tibia Moment Y	4826J	4826J-92-MY	Denton	0.01039794 N·m	282.4	9/4/2003	Ank Fd,Hld Knee	0
FTLXD	Left Foot Disp. X	PD210-4B	FLX102X	Contelec	3.15 °	318	7/21/2004	Inversion	1
FTLYD	Left Foot Disp. Y	PD210-4B	FLX102Y	Contelec	3.15 °	318	7/21/2004	Dorsiflexion	0
FTLZD	Left Foot Disp. Z	PD210-4B	FLX102Z	Contelec	3.15 °	318	7/21/2004	External Rotation	1
FTLXG	Left Foot Accel X	EGE-73B6Q-20	00L13-F29	Entran	0.0212289 g	2000	7/9/2004	Fwd	0
FTLYG	Left Foot Accel Y	EGE-73B6Q-20	01G25-N08	Entran	0.023383 g	2000	7/9/2004	Rt	0
FTLZG	Left Foot Accel Z	7264-2KM5T	BD88J	Endevco	0.0334028 g	2000	7/20/2004	Dn	0
KNRXD	Right Knee Displacement	150-0121VL	150-121VL-020590	Space Age	23.322 mm	40	5/29/2003	Tib Fd,Hld Fem	0
TBRXF	Right Upr Tibia Force X	4825J	4825J-90-FX	Denton	0.000267512 N	8896.4	9/3/2003	Tib Fd,Knee Rr	0
TBRZF	Right Upr Tibia Force Z	4825J	4825J-90-FZ	Denton	0.000108650 N	8896.4	9/3/2003	Tib Dn,Knee Up	0
TBRXM	Right Upr Tibia Moment X	4825J	4825J-90-MX	Denton	0.010211906 N·m	282.4	9/3/2003	Ank Lt,Hld Knee	0
TBRYM	Right Upr Tibia Moment Y	4825J	4825J-90-MY	Denton	0.010317505 N·m	282.4	9/3/2003	Ank Fd,Hld Knee	0
TBRXG	Right Tibia Accel X	EGE-73B6Q-20	02I02I10-N18	Entran	0.0224274 g	2000	7/8/2004	Fwd	0
TBRYG	Right Tibia Accel Y	EGE-73BQ-200	98H10-F05	Entran	0.0185521 g	2000	6/30/2004	Rt	0
ANRXF	Right Lwr Tibia Force X	4826J	4826J-93-FX	Denton	0.00026337 N	8896.4	9/4/2003	Ank Fd,Knee Rr	0
ANRYF	Right Lwr Tibia Force Y	4826J	4826J-93-FY	Denton	0.000264938 N	8896.4	9/4/2003	Ank Rt,Knee Lft	0
ANRZF	Right Lwr Tibia Force Z	4826J	4826J-93-FZ	Denton	0.000107672 N	8896.4	9/4/2003	Ank Dn,Knee Up	0
ANRXM	Right Lwr Tibia Moment X	4826J	4826J-93-MX	Denton	0.010118 N·m	282.4	9/4/2003	Ank Lt,Hld Knee	0
ANRYM	Right Lwr Tibia Moment Y	4826J	4826J-93-MY	Denton	0.01040396 N·m	282.4	9/4/2003	Ank Fd,Hld Knee	0
FTRXD	Right Foot Disp. X	PD210-4B	FLX101X	Contelec	3.15 °	318	7/21/2004	Eversion	1
FTRYD	Right Foot Disp. Y	PD210-4B	FLX101Y	Contelec	3.15 °	318	7/21/2004	Dorsiflexion	0
FTRZD	Right Foot Disp. Z	PD210-4B	FLX101Z	Contelec	3.15 °	318	7/21/2004	Internal Rotation	1
FTRXG	Right Foot Accel X	EGE-73B6Q-20	02I02I05-F18	Entran	0.0211521 g	2000	7/9/2004	Fwd	0
FTRYG	Right Foot Accel Y	EGE-73B6Q-20	02I02I05-F03	Entran	0.020394 g	2000	7/9/2004	Rt	0
FTRZG	Right Foot Accel Z	EGE-73B6Q-20	00L13-F72	Entran	0.0206991 g	2000	7/9/2004	Dn	0

D-15

040812

Dummy 048tr Type HYBRID III 5th Descriptio TRC - 048t HYBRID III 5th Female w/ Red. accels CAL DUE 8-13-04(DKS 7-21-04)J211

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
HEDXG	Head Accel X	7264C-2K-2-18	P28853	Endevco	0.02092 g	2000	2/13/2004	Rwd	1
HEDYG	Head Accel Y	7264C-2K-2-18	P28852	Endevco	0.02347 g	2000	2/13/2004	Lft	1
HEDZG	Head Accel Z	7264C-2K-2-18	P28760	Endevco	0.02723 g	2000	2/13/2004	Up	1
HEDXR	Head Accel X Red	7264C-2K-2-18	P29631	Endevco	0.0183511 g	2000	7/1/2004	Rwd	1
HEDYR	Head Accel Y Red	7264C-2K-2-18	P30332	Endevco	0.0220675 g	2000	7/1/2004	Lt	1
HEDZR	Head Accel Z Red	7264C-2K-2-18	P30408	Endevco	0.019021 g	2000	7/1/2004	Up	1
NEKXF	Neck Force X	1716A	1716A-858-FX	Denton	0.000191 N	8896.4	3/22/2004	Hd Fd,Cst Rr	1
NEKYF	Neck Force Y	1716A	1716A-858-FY	Denton	0.0001863 N	8896.4	3/22/2004	Hd Lt,Cst Rt	0
NEKZF	Neck Force Z	1716A	1716A-858-FZ	Denton	0.0000964 N	13344.6	3/22/2004	Hd Up,Cst Dn	0
NEKXM	Neck Moment X	1716A	1716A-858-MX	Denton	0.0060148 N·m	282.5	3/22/2004	Rt Ear to Rt Shld	1
NEKYM	Neck Moment Y	1716A	1716A-858-MY	Denton	0.0058842 N·m	282.5	3/22/2004	Chn to Strnm	0
NEKZM	Neck Moment Z	1716A	1716A-858-MZ	Denton	0.008375 N·m	282.5	3/22/2004	Chn to Lt Shld	0
NKLXF	Neck Lwr Force X	5045J	5045J-78-FX	Denton	0.00017114 N	13344.6	10/22/2003	Hd Rr,Cst Fd	0
NKLYF	Neck Lwr Force Y	5045J	5045J-78-FY	Denton	0.00017248 N	13344.6	10/22/2003	Hd Lt,Cst Rt	0
NKLZF	Neck Lwr Force Z	5045J	5045J-78-FZ	Denton	0.000095319 N	13344.6	10/22/2003	Hd Up,Cst Dn	0
NKLXM	Neck Lwr Moment X	5045J	5045J-78-MX	Denton	0.004195175 N·m	451.9	10/22/2003	Lt Ear to Lt Shld	0
NKLYM	Neck Lwr Moment Y	5045J	5045J-78-MY	Denton	0.004439035 N·m	451.9	10/22/2003	Chn to Strnm	0
NKLZM	Neck Lwr Moment Z	5045J	5045J-78-MZ	Denton	0.0057545 N·m	338.95	10/22/2003	Chn to Lt Shld	0
CSTXG	Chest Accel X	7264C-2K-2-18	P28854	Endevco	0.0225 g	2000	2/13/2004	Fwd	0
CSTYG	Chest Accel Y	7264C-2K-2-18	P28381	Endevco	0.02171 g	2000	2/13/2004	Lft	1
CSTZG	Chest Accel Z	7264C-2K-2-18	P28297	Endevco	0.01952 g	2000	2/13/2004	Up	1
CSTXR	Chest Accel X Red	7264C-2K-2-18	P33910	Endevco	0.01908 g	2000	4/19/2004	Rwd	1
CSTYR	Chest Accel Y Red	7264C-2K-2-18	P33845	Endevco	0.01977 g	2000	4/19/2004	Lft	1
CSTZR	Chest Accel Z Red	7264C-2K-2-18	P34092	Endevco	0.01831 g	2000	4/19/2004	Up	1
CSTXD	Chest Deflection X	6209-2038	6209-2038-0436	JDK	1.6792 mm	100	3/20/2004	Strnm Away Frm Spn	0
PEVXG	Pelvis Accel X	7264C-2K-2-18	P28280	Endevco	0.02175 g	2000	2/13/2004	Rwd	1

Thursday, August 12, 2004 048tr

Page 1 of 2

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
PEVYG	Pelvis Accel Y	7264C-2K-2-18	P28316	Endevco	0.02569 g	2000	2/13/2004	Lft	1
PEVZG	Pelvis Accel Z	7264C-2K-2-18	P28400	Endevco	0.02092 g	2000	2/13/2004	Up	1
LFMZF	Left Femur Force Z	2121	2121-0160	Denton	0.0000983 N	13344.6	3/22/2004	Knee Fd,Pel Rr	0
RFMZF	Right Femur Force Z	2121	2121-0161	Denton	0.0000995 N	13344.6	3/22/2004	Knee Fd,Pel Rr	0

D-16

040812

Thursday, August 12, 2004 048tr

Dummy 070v Type HYBRID III 5th Descriptio VRTC - 070v HYBRID III 5th Female ICAL'd 7-7-04 (DKS 7-19-04)J211

Chsnam	Location	Model	Name	Manufacturer	Sens./mV/V/U	Fullscal	Caldat	Pos Output	Flip
HEDXG	Head Accel X	7264-2000T	J18661	Endevco	0.0305663 g	2000	7/8/2004	Rwd	1
HEDYG	Head Accel Y	7264-2000LC	AAMD5	Endevco	0.0258263 g	2000	7/8/2004	Lft	1
HEDZG	Head Accel Z	7264-2KM5T	AJ4R6	Endevco	0.0217539 g	2000	7/8/2004	Up	1
NEKXF	Neck Force X	1716AJ	1716AJ-1563-FX	Denton	0.0001888 N	8896.4	7/7/2004	Hd Rr,Cst Fd	0
NEKYF	Neck Force Y	1716AJ	1716AJ-1563-FY	Denton	0.0001811 N	8896.4	7/7/2004	Hd Lt,Cst Rt	0
NEKZF	Neck Force Z	1716AJ	1716AJ-1563-FZ	Denton	0.0000955 N	13344.6	7/7/2004	Hd Up,Cst Dn	0
NEKXM	Neck Moment X	1716AJ	1716AJ-1563-MX	Denton	0.0058227 N·m	282.5	7/7/2004	Lt Ear to Lt Shld	0
NEKYM	Neck Moment Y	1716AJ	1716AJ-1563-MY	Denton	0.0058088 N·m	282.5	7/7/2004	Chn to Strnm	0
NEKZM	Neck Moment Z	1716AJ	1716AJ-1563-MZ	Denton	0.0083276 N·m	282.5	7/7/2004	Chn to Lt Shld	0
NKLXF	Neck Lwr Force X	3251	3251-107-FX	Denton	0.0001753 N	13345	7/8/2004	Hd Fd,Cst Rr	1
NKLYF	Neck Lwr Force Y	3251	3251-107-FY	Denton	0.0001763 N	13345	7/8/2004	Hd Lt,Cst Rt	0
NKLZF	Neck Lwr Force Z	3251	3251-107-FZ	Denton	0.0000953 N	13345	7/8/2004	Hd Up,Cst Dn	0
NKLXM	Neck Lwr Moment X	3251	3251-107-MX	Denton	0.004336 N·m	452	7/8/2004	Rt Ear to Rt Shld	1
NKLYM	Neck Lwr Moment Y	3251	3251-107-MY	Denton	0.0043072 N·m	452	7/8/2004	Chn to Strnm	0
NKLZM	Neck Lwr Moment Z	3251	3251-107-MZ	Denton	0.0056926 N·m	339	7/8/2004	Chn to Lt Shld	0
CSTXG	Chest Accel X	7264-2000LC	AAJY4	Endevco	0.0267767 g	2000	7/8/2004	Fwd	0
CSTYG	Chest Accel Y	7264-2KM5T	AKAA4	Endevco	0.0221975 g	2000	7/8/2004	Lft	1
CSTZG	Chest Accel Z	7264-2000T	ACC63	Endevco	0.024752 g	2000	7/8/2004	Up	1
CSTXD	Chest Deflection X	14CB1-2897	14CB1-2897-070	Servo	1.72407 mm	100	7/13/2004	Strnm Away Frm Spn	0
PEVXG	Pelvis Accel X	7264-2000LC	AGN83	Endevco	0.0234601 g	2000	7/8/2004	Rwd	1
PEVYG	Pelvis Accel Y	7264-2000TZ	J35770	Endevco	0.0244437 g	2000	7/8/2004	Lft	1
PEVZG	Pelvis Accel Z	7264-2KM5T	J20014	Endevco	0.023525 g	2000	7/8/2004	Up	1
LFMZF	Left Femur Force Z	IF-625	IF-625-140-FZ	FTSS	0.0000622 N	22240	7/14/2004	Knee Fd,Pel Rr	0
RFMZF	Right Femur Force Z	IF-625	IF-625-141-FZ	FTSS	0.0000619 N	22240	7/14/2004	Knee Fd,Pel Rr	0


Thursday, August 12, 2004 070v

Page 1 of 1

D-17

040812

2004 CHEVROLET AVALANCHE FRONTAL LCB IMPACT

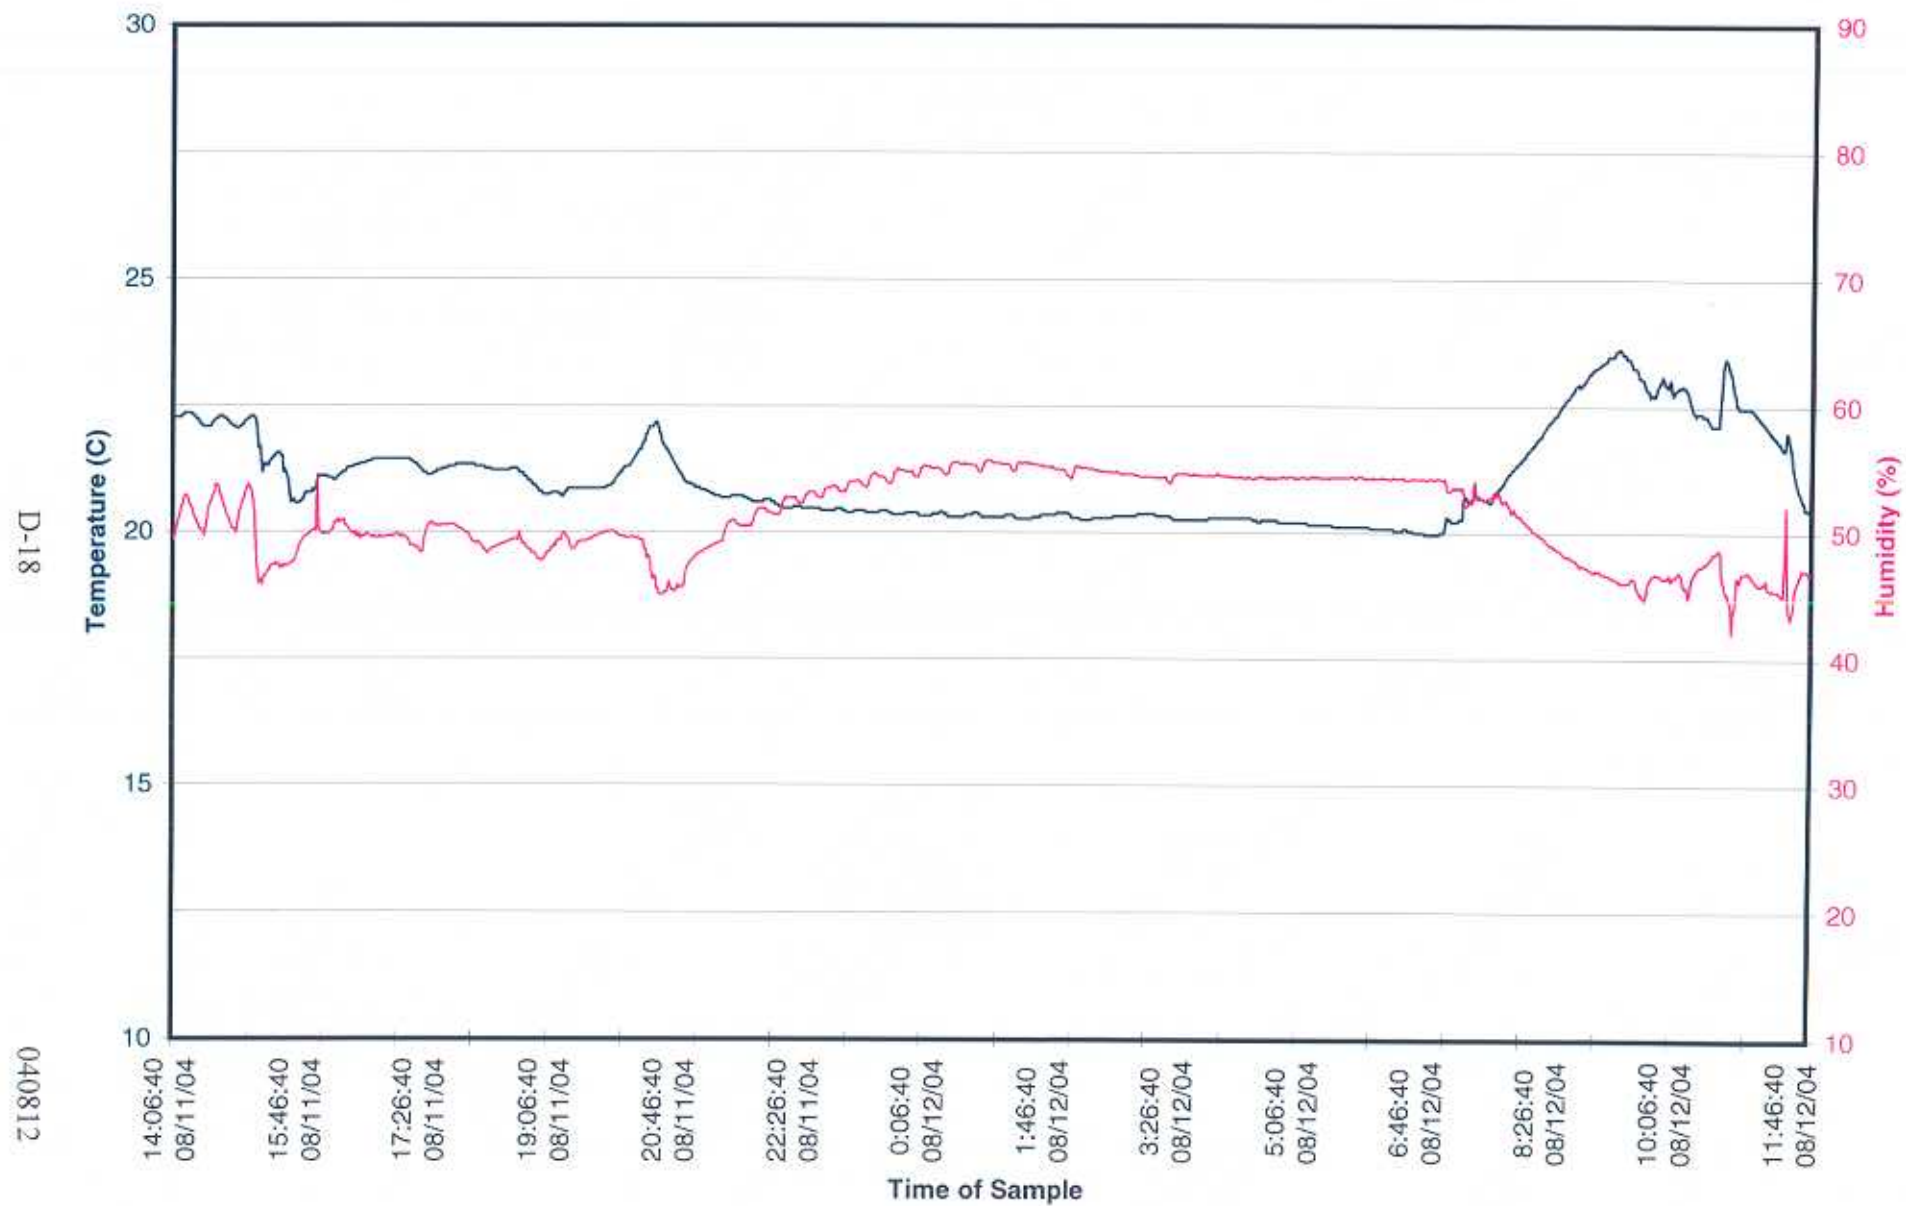

Appendix E

INSIA Report on Structural Measurements

STRUCTURAL SURVEY OF CARS. MEASUREMENT METHODOLOGY OF THE MAIN RESISTANT ELEMENTS IN THE CAR BODY

APARICIO IZQUIERDO, FRANCISCO
PÁEZ AYUSO, FRANCISCO JAVIER

INSIA
Carretera de Valencia, km. 7
Campus Sur de la Universidad Politécnica de Madrid
28031 – MADRID – (SPAIN)

March, 1999

REPORT DOCUMENTATION PAGE**Title:**

STRUCTURAL SURVEY OF CARS. MEASUREMENT METHODOLOGY OF THE MAIN RESISTANT ELEMENTS IN THE CAR BODY

Author(s):

Aparicio Izquierdo, Francisco
Páez Ayuso, Francisco Javier

Performing Organisation name and address:

INSIA – University Institute for Automobile Research
Carretera de Valencia, Km. 7 – Campus Sur de la Universidad Politécnica de Madrid
28031 – Madrid – Spain

Supplementary notes:

Under contract to:

THE EUROPEAN COMMUNITY

Project: "Improvement of Crash Compatibility between Cars"

Contract N°: RO – 97 – SC.1064

Abstract:

The main aim of this working package -*Structural Survey of Cars*- is the reduction of incompatibilities, both structural and geometric, between passenger vehicles and their potential collision partners. The understanding of these incompatibilities needs a previous step for the knowledge of the existing car fleet.

Firstly, it is necessary to select the main resistant elements in the car body. These elements have to be chosen from the point of view of the sort of collision that we want to study, that is to say, frontal and side impacts.

Detailed measurements have been taken from exterior and interior elements, spread to a total number of 74 models selected from the main vehicle manufacturers at Spain. All of them are being sold this year. Using the information available from the previous measurements in vehicles, the geometric characteristics of the main resistant elements involved in the geometric compatibility between cars will be defined.

This report shows the methodology followed to get these measurements.

Subject terms:

Crash compatibility, geometric compatibility, resistant elements, measure methodology

Date:

March, 1999

1.- METHODOLOGY.

Detailed measurements have been taken from exterior and interior elements. Using the information available from the previous measurements in vehicles, the geometric characteristics of the main resistant elements involved in the geometric compatibility between cars have been defined. These elements are presented in the following figures, and have been divided in two main groups according to the vehicle zones studied in this project.

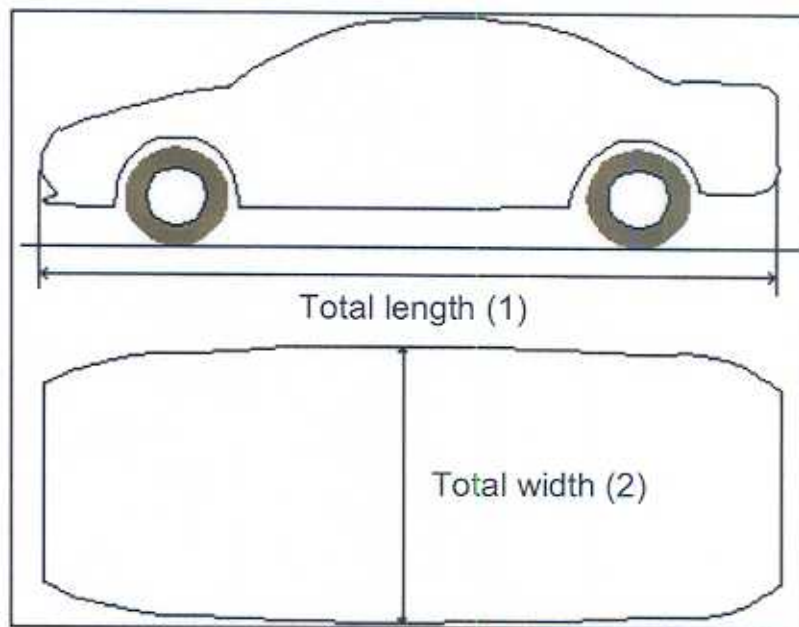


Figure 1.- Definition of the main resistant elements. General dimensions.

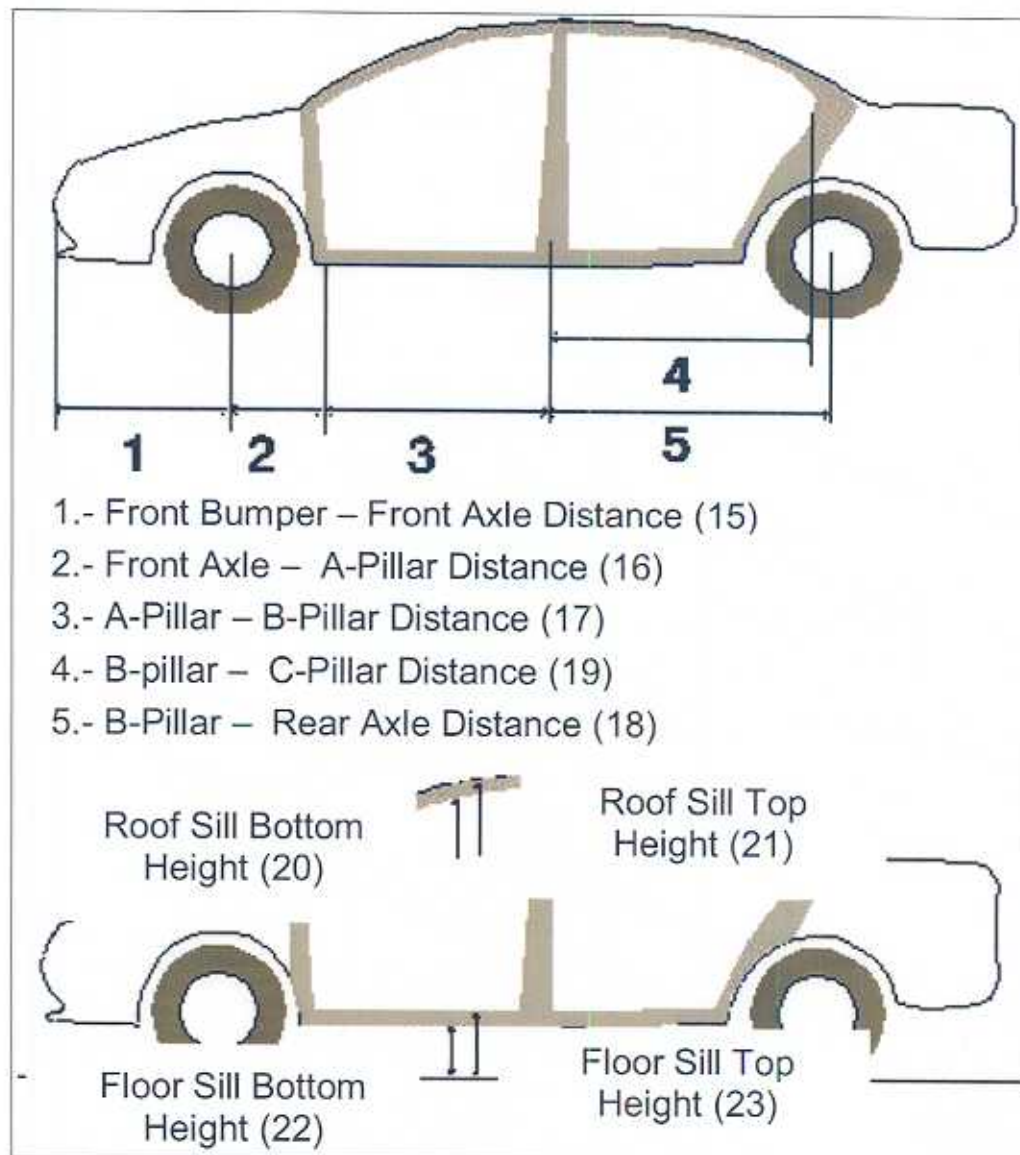


Figure 2.- Definition of the main resistant elements. Side elements.

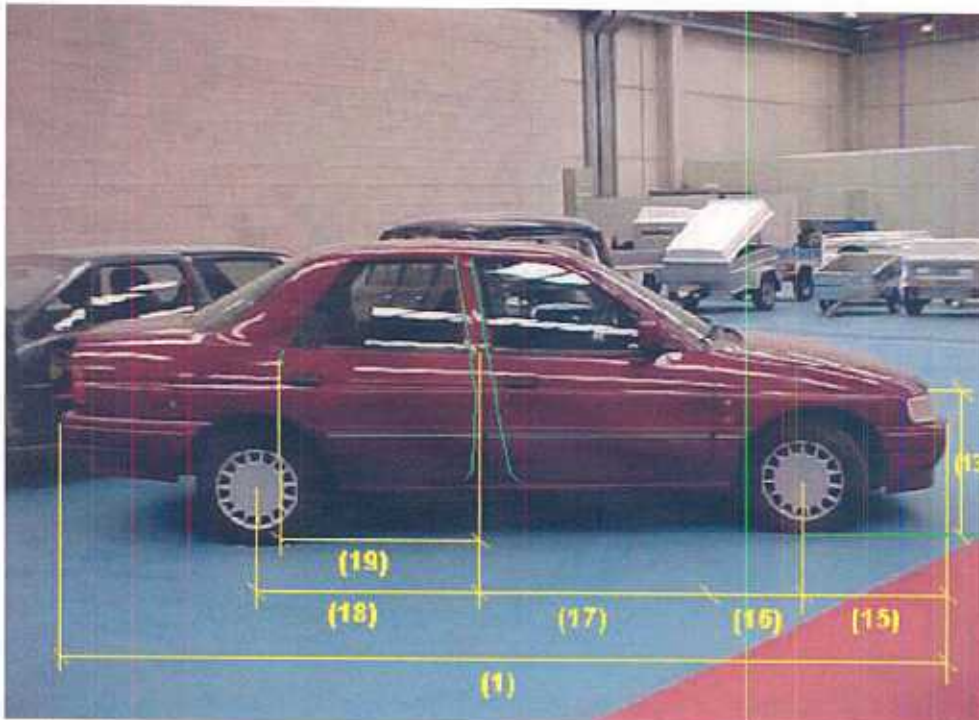


Figure 3.-
Measurements of
the side resistant
elements (outer).

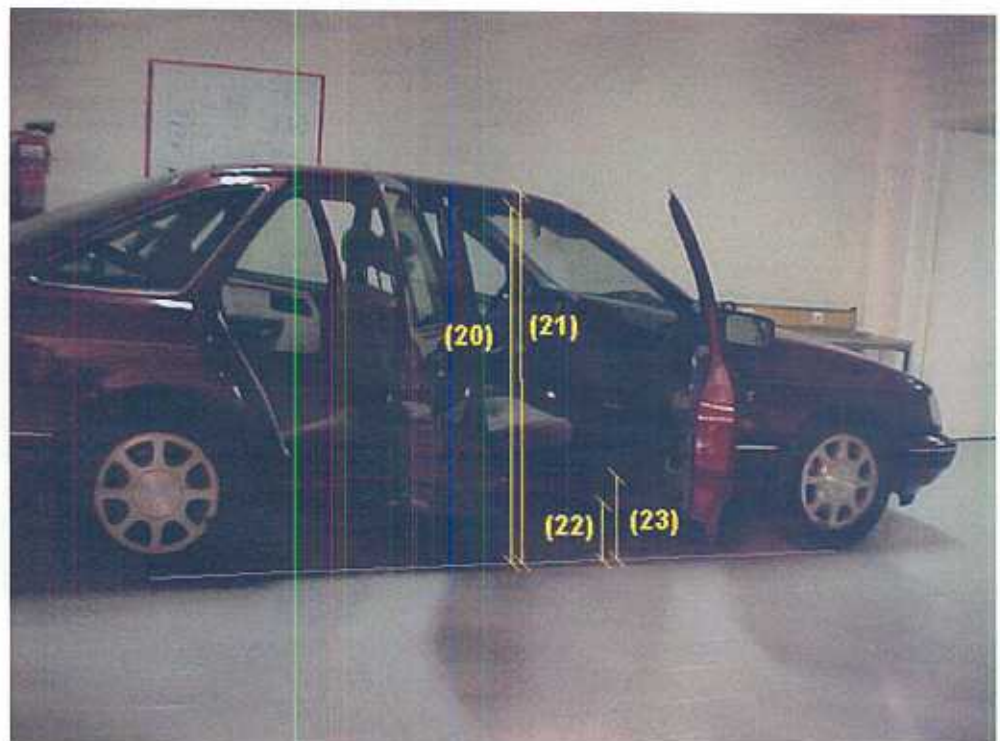


Figure 4.- Measurements
of the side resistant
elements (inner).

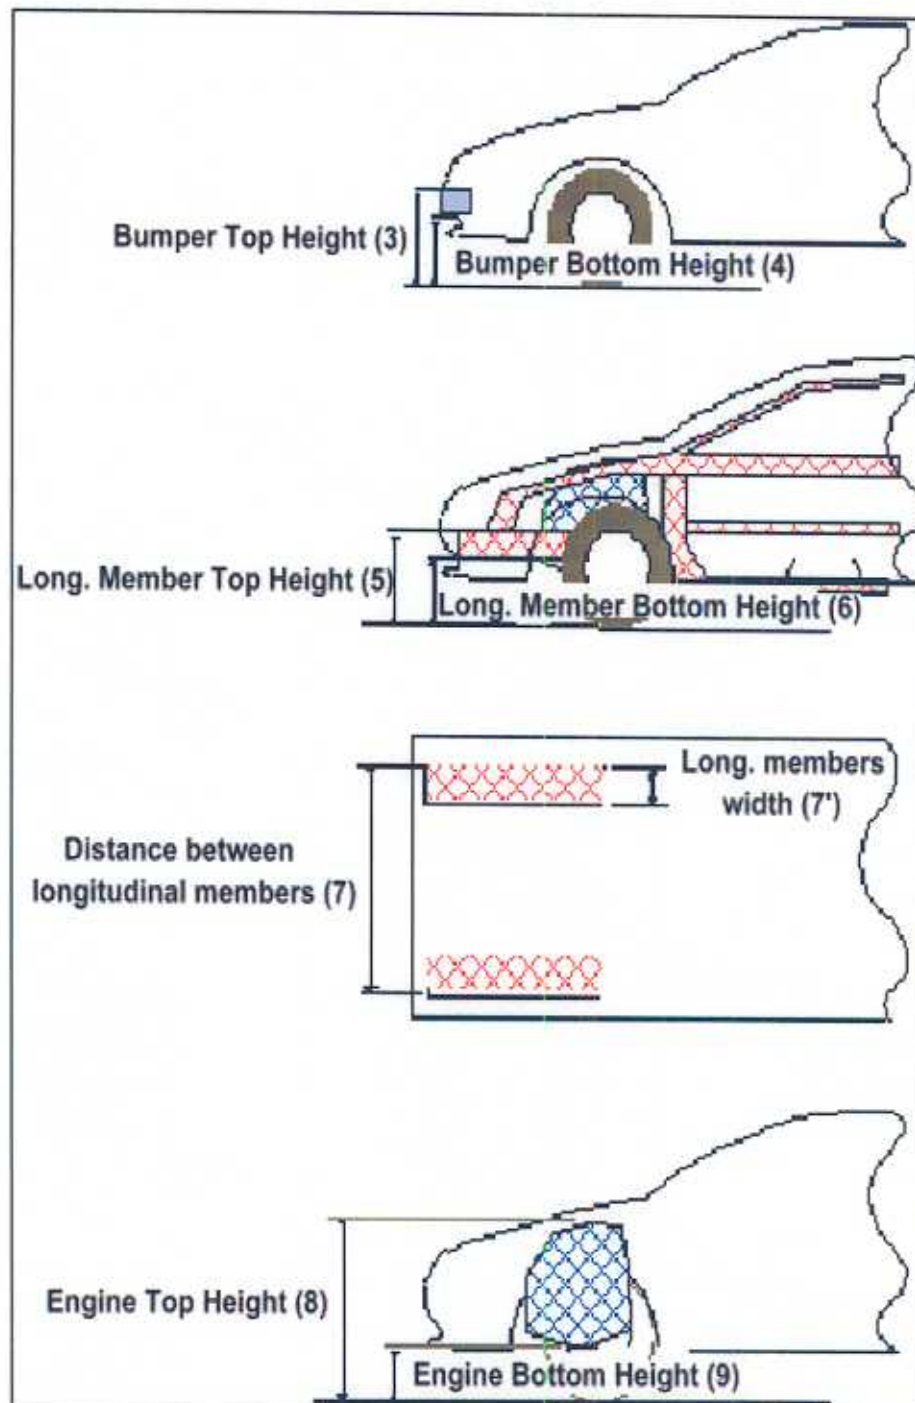


Figure 5.- Definition of the main resistant elements. Front elements.

Figure 6.-
Measurements of the
main resistant elements.
Front elements 1.

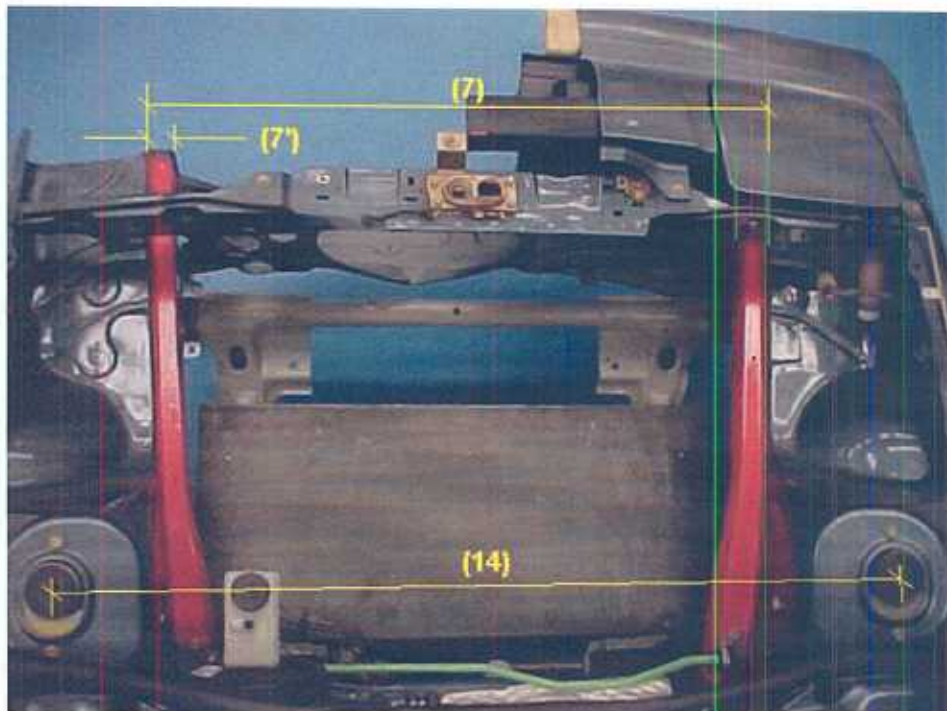
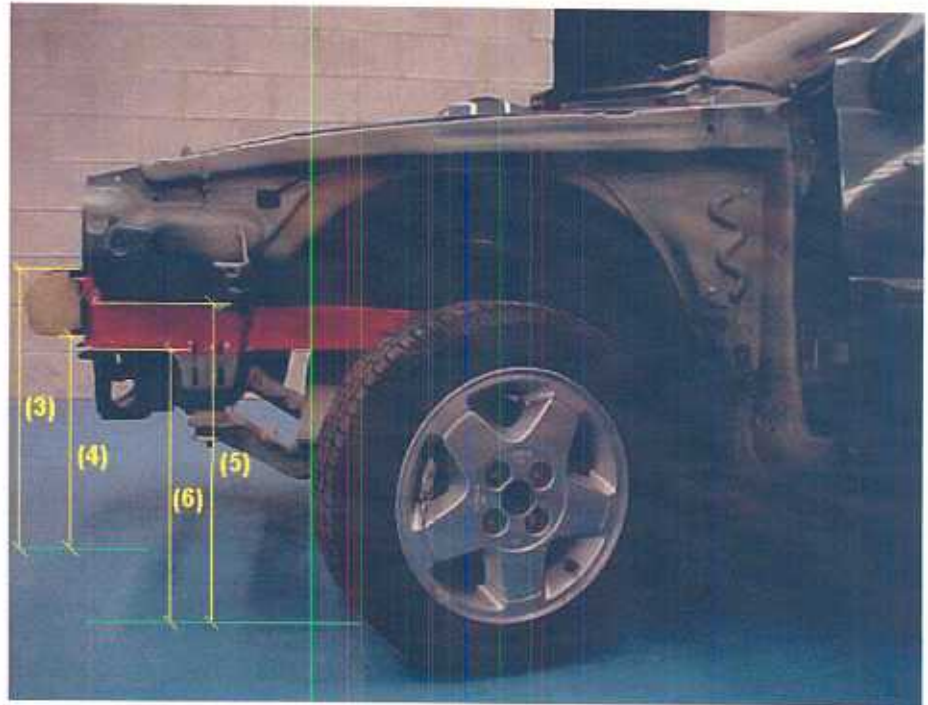


Figure 7.-
Measurements
of the main
resistant
elements. Front
elements 2.

Figure 8.-
Measurements of
the main resistant
elements. Front
elements 3.

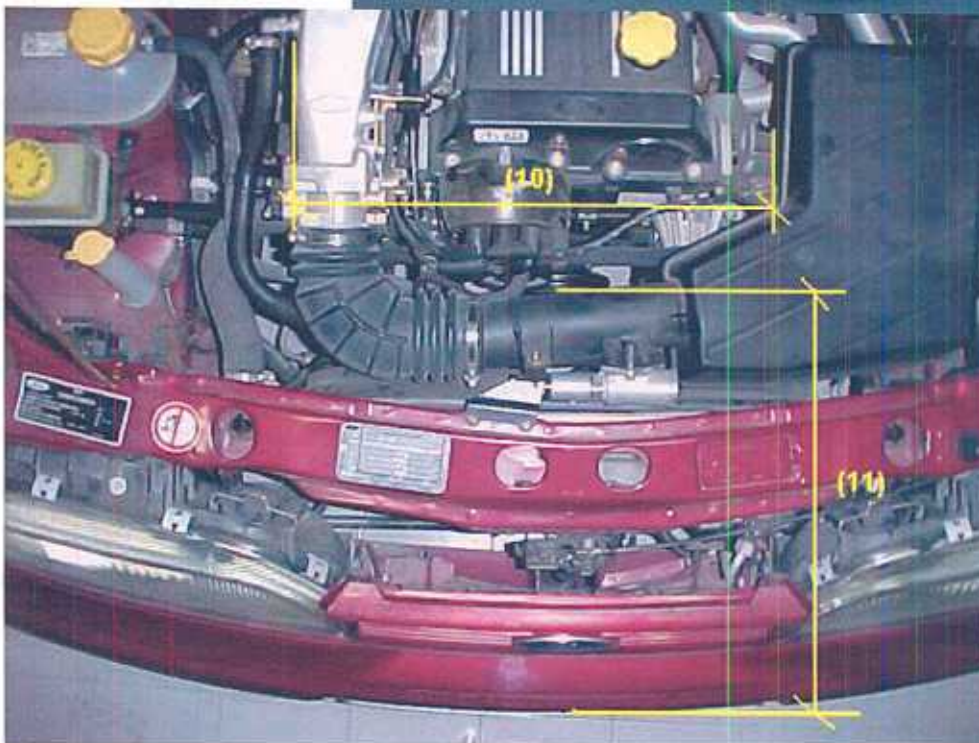
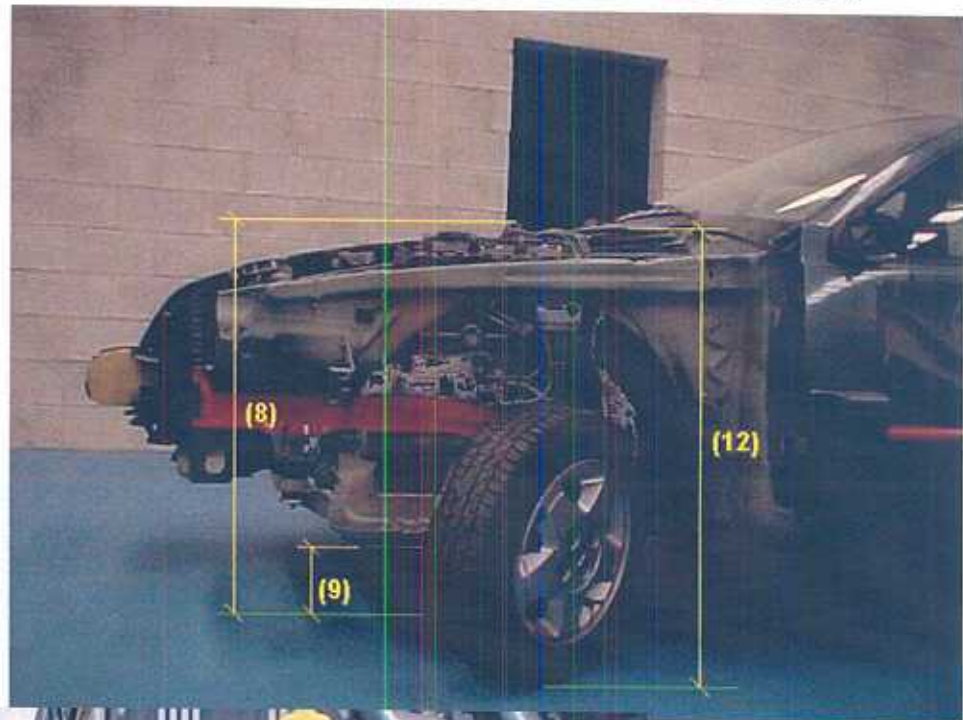


Figure 9.-
Definition of
the main
resistant
elements. Front
elements
(Longitudinal
engine).

The procedure considered to measure these elements is described as follows, where it is indicated the location of these ones in the Excel Sheet (SURVEY.XLS) into brackets:

FRONT ELEMENTS

- **Total Length –(1)- (Side & Front Sheets - C column):** distance between the point in the front bumper further on and the point in the rear bumper further back.
- **Weight (Side & Front Sheets - D column):** mass, including an average driver weight (70 kg), and the fuel tank mass (at half-capacity).
- **Total Width –(2)- (Side & Front Sheets - E column):** distance between the outer side points in a transverse plane of the vehicle (middle plane between the front and rear axles).
- **Bumper bottom height –(4)- (Front Sheet G column):** distance between the ground and the lowest point on the front bumper, being a resistant member (aerodynamic elements under the front bumper are not considered).
- **Bumper top height –(3)- (Front Sheet H column):** distance between the ground and the highest point on the front bumper, being a resistant member (aerodynamic elements are not considered).
- **Longitudinal member top height –(5)- (Front Sheet I column):** distance between the ground and the highest point on the longitudinal members, measured approximately in the front bumper-longitudinal member joint (when accessible).
- **Longitudinal member bottom height –(6)- (Front Sheet J column):** distance between the ground and the lowest point on the longitudinal members, measured approximately in the front bumper-longitudinal member joint.
- **Distance between longitudinal members (Front Sheet K column):** transverse distance between extreme points in longitudinal members, measured approximately in the front bumper-longitudinal member joint.

Depending on the accessibility of these members, the extreme points are the inner points (I) or the outer points (O).

- **Longitudinal member width -7'- (Front Sheet L column):** width of one of the longitudinal members, measured approximately in the front bumper-longitudinal member joint.

- **Engine top height (8) (Front Sheet N column):** distance between the ground and the highest point on the engine that can be a resistant member in case of accident (usually, the highest point on the head, or the highest point of the inlet or exhaust manifolds).
- **Engine bottom height (9) (Front Sheet M column):** distance between the ground and the lowest point on the engine (usually, the lowest point on the crankcase).
- **Engine and Gearbox width (10) (Front Sheet O & P columns):**
 - *Transverse configuration engine:* distance between extreme points in the gearbox-cylinder block unit or others resistant members attached to the cylinder block unit, i.e. fan belts (from a front point of view).
 - *Longitudinal configuration engine:* distance between extreme points in the cylinder block unit (from a front point of view).
- **Front bumper - Engine distance (11) (Front Sheet Q column):** distance between the point in the front bumper further on and the point in the engine further on that is a resistant element, i.e. the further on point of the exhaust manifold placed in the front of the engine.
- **Front shock absorber fixing width (14) (Front Sheet R column):** transverse distance between the front shock absorber - body car joints.
- **Front shock absorber fixing height (12) (Front Sheet S column):** distance between the ground and the front shock absorber-body car joint.
- **Bonnet leading edge height (Front Sheet T column):** distance between the ground and the bonnet edge further on.

SIDE ELEMENTS

- **Front bumper - Front axle distance (15) (Side Sheet G column):** distance between the point in the front bumper further on and the middle point in the front tyre-road contact patch.
- **Front axle - A Pillar distance (16) (Side Sheet H column):** distance between the middle point in the front tyre-road contact patch and the point in the A-pillar further back.
- **A Pillar - B Pillar distance (17) (Side Sheet I column):** distance between the point in the A-pillar further back and the middle point in the B-pillar.
- **B Pillar - C Pillar distance (19) (Side Sheet J column):** distance between the middle point in the B-pillar and the point in the C-pillar further back (only 4/5-door vehicles).
- **B Pillar - Rear axle distance (18) (Side Sheet K column):** distance between the middle point in the B-pillar and the middle point in the rear tyre-road contact patch.
- **Roof sill bottom height (20) (Side Sheet L column):** distance between the ground and the lowest point on the roof sill, measured in the front door middle point.
- **Roof sill top height (21) (Side Sheet M column):** distance between the ground and the highest point on the roof sill (usually located in the sill-roof joint), measured in the front door middle point.
- **Floor sill bottom height (22) (Side Sheet N column):** distance between the ground and the lowest point on the floor sill, measured in the front door middle point.
- **Floor sill top height (23) (Side Sheet O column):** distance between the ground and the highest point on the floor sill, measured in the front door middle point.

NOTE

- N/A: dimension not available.