

DTS-TRC-06-005

40% Offset Vehicle to Deformable

Barrier Crash Test

Mitsubishi Motors North America, Inc.

2006 Mitsubishi Galant DE 4-door sedan

NHTSA Number: R65607

TRC Inc. Test Number: 060630-2

Prepared By:

Transportation Research Center Inc.

10820 State Route 347

East Liberty, OH 43319



Final Report

July 13, 2006

Prepared For:

U. S. Department of Transportation

Volpe National Transportation Systems Center

55 Broadway, Kendall Square

Cambridge, MA 02142

This publication is distributed by the U. S. Department of Transportation, Volpe National Transportation Systems Center, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the Volpe National Transportation Systems Center. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned, it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Test Performed By: William Millis, Engineering Technician

Report Approved By:



Walter D. Dudek, Project Manager
Transportation Research Center Inc.

Date 7/13/2006

FINAL REPORT ACCEPTANCE BY COTR:

Contracting Officer's Technical Representative (COTR),
USDOT, Volpe National Transportation Systems Center

Date _____

1. Report No. DTS-TRC-06-005	2. Government Accession No.	3. Recipient's Catalog No.	
4. Title and Subtitle Final Report of a 40% Frontal Offset Vehicle to Deformable Barrier Crash Test of a 2006 Mitsubishi Galant DE 4-door sedan, NHTSA No. 060630-2		5. Report Date	
		6. Performing Organization Code TRC Inc.	
7. Author(s) Walter D. Dudek, Project Manager		8. Performing Organization Report No. 060630-2	
9. Performing Organization Name and Address Transportation Research Center Inc. 10820 State Route 347 East Liberty, OH 43319-0367		10. Work Unit No. (TRAIS)	
		11. Contract or Grant No. DTRS57-05-D-30108	
12. Sponsoring Agency Name and Address U. S. Department of Transportation Volpe National Transportation Systems Center 55 Broadway, Kendall Square Cambridge, MA 02142		13. Type of Report and Period Covered Final Report June - July 2006	
		14. Sponsoring Agency Code DTS-85	
15. Supplemental Notes			
16. Abstract A 56.0 km/h 40% frontal offset vehicle to deformable barrier crash test was conducted on a 2006 Mitsubishi Galant DE 4-door sedan, NHTSA No. 060630-2, at Transportation Research Center Inc. on June 30, 2006. This test was conducted in accordance with Volpe Task Order No. 1, for the evaluation of vehicle and occupant responses. The barrier impact velocity was 55.8 km/h. The vehicle's maximum static crush was 672 millimeters. The ambient temperature was 21° C. The driver's 15 millisecond Head Injury Criteria (HIC) was 161. The driver's chest maximum resultant acceleration with three (3) milliseconds minimum duration was 31.4 g. The driver's maximum chest deflection was 23 millimeters. The driver's left and right femur maximum axial compressive forces were -108 N and -133 N, respectively.			
17. Key Words Frontal Barrier Impact Test		18. Distribution Statement Copies of this report are available from: National Highway Traffic Safety Admin. NHTSA Technical Reference Division 400 Seventh Street, S. W., Room 5108 Washington, DC 20590	
19. Security Classif. (of this report) Unclassified	20. Security Classif. (of this page) Unclassified	21. Number of Pages 419	22. Price

Table of Contents

<u>Section</u>	<u>Description</u>	<u>Page</u>
1.0	Purpose and Test Procedure	1-1
2.0	Offset Deformable Barrier Test Summary	2-1
Appendix A	Photographs	A-1
Appendix B	Dummy, Vehicle and Barrier Data Plots	B-1
Appendix C	Dummy Configuration and Performance Verification Data	C-1
Appendix D	Customer Provided Seating Procedure	D-1
Appendix E	Test Equipment and Instrumentation Calibration Information	D-1
Appendix F	INSIA Report on Structural Measurements	F-1

Data Sheets

<u>Number</u>	<u>Description</u>	<u>Page</u>
1	Crash Test Summary	2-5
2	General Test and Vehicle Parameter Data	2-7
3	Post-Impact Test Data	2-11
4	Test Vehicle Information	2-12
5	Dummy Positioning in Vehicle	2-14
6	Seat Belt Positioning	2-15
7	Vehicle Accelerometer Location and Data Summary	2-16
8	Dummy Injury Criteria Values	2-19
9	Seat Belt Performance Data	2-23
10	Summary of FMVSS 212 Data	2-24
11	FMVSS 219 (Partial) Windshield Zone Intrusion Data	2-25
12	FMVSS 301 Fuel System Integrity Data	2-26
13	FMVSS 301 Static Rollover Data	2-27
14	Vehicle Measurements	2-28
15	Camera Data	2-38
16	Reference Photo Targets	2-40
17	Post Test Air Bag Data	2-41
18	Accident Investigation Division Data	2-42
19	Offset Barrier and Vehicle Orientation	2-43
20	Deformable Barrier Honeycomb Crush	2-44
21	Deformable Barrier Load Cell Locations	2-54

List of Photographs

<u>Description</u>	<u>Figure</u>
Pre-Test Front View	A-1
Post-Test Front View	A-2
Pre-Test Left Front View	A-3
Post-Test Left Front View	A-4
Pre-Test Left Side View	A-5
Post-Test Left Side View	A-6
Pre-Test Left Rear View	A-7
Post-Test Left Rear View	A-8
Pre-Test Rear View	A-9
Post-Test Rear View	A-10
Pre-Test Right Rear View	A-11
Post-Test Right Rear View	A-12
Pre-Test Right Side View	A-13
Post-Test Right Side View	A-14
Pre-Test Right Front View	A-15
Post-Test Right Front View	A-16
Pre-Test Overhead View	A-17
Post-Test Overhead View	A-18
Pre-Test Front Underbody View	A-19
Post-Test Front Underbody View	A-20
Pre-Test Mid Front Underbody View	A-21
Post-Test Mid Front Underbody View	A-22
Pre-Test Mid Underbody View	A-23
Post-Test Mid Underbody View	A-24
Pre-Test Mid Rear Underbody View	A-25
Post-Test Mid Rear Underbody View	A-26
Pre-Test Rear Underbody View	A-27
Post-Test Rear Underbody View	A-28

List of Photographs, Continued

<u>Description</u>	<u>Figure</u>
Pre-Test Fuel Tank View	A-29
Post-Test Fuel Tank View	A-30
Pre-Test Fuel Filler Neck View	A-31
Post-Test Fuel Filler Neck View	A-32
Pre-Test Fuel Filler Cap View	A-33
Post-Test Fuel Filler Cap View	A-34
Pre-Test Engine Compartment View	A-35
Post-Test Engine Compartment View	A-36
Pre-Test Windshield View	A-37
Post-Test Windshield View	A-38
Pre-Test Windshield - Driver Dummy View	A-39
Post-Test Windshield - Driver Dummy View	A-40
Pre-Test Driver Dummy - View 1	A-41
Post-Test Driver Dummy - View 1	A-42
Pre-Test Driver Dummy - View 2	A-43
Post-Test Driver Dummy - View 2	A-44
Pre-Test Driver Dummy - View 3	A-45
Post-Test Driver Dummy - View 3	A-46
Pre-Test Driver Dummy - View 4	A-47
Post-Test Driver Dummy - View 4	A-48
Post-Test Driver Dummy Overall View	A-49
Post-Test Driver Dummy Head Contact - View 1	A-50
Post-Test Driver Dummy Head Contact - View 2	A-51
Post-Test Driver Dummy Knee Contact View	A-52
Pre-Test Driver Foot Position	A-53
Post-Test Driver Foot Position	A-54
Post-Test Driver Floorboard Deformation - View 1	A-55
Post-Test Driver Floorboard Deformation - View 2	A-56

List of Photographs, Continued

<u>Description</u>	<u>Figure</u>
Pre-Test Driver Toeboard View	A-57
Post-Test Driver Toeboard Deformation - View 1	A-58
Post-Test Driver Toeboard Deformation - View 2	A-59
Post-Test Driver Toeboard Deformation - View 3	A-60
Pre-Test Barrier Front View	A-61
Post-Test Barrier Front View	A-62
Pre-Test Barrier Left Side View	A-63
Post-Test Barrier Left Side View	A-64
Pre-Test Barrier Right Side View	A-65
Post-Test Barrier Right Side View	A-66
Pre-Test Barrier Top View	A-67
Post-Test Barrier Top View	A-68
Vehicle on Rollover Device - 90°	A-69
Vehicle on Rollover Device - 180°	A-70
Vehicle on Rollover Device - 270°	A-71
Vehicle on Rollover Device - 360°	A-72
Vehicle Certification Label View	A-73
Vehicle Tire Load Label View	A-74

Section 1.0

Purpose and Test Procedure

Purpose

This 56.0 km/h (target speed) Left 40% Offset Deformable Barrier test was conducted for the Volpe National Transportation Systems Center (Volpe) by Transportation Research Center Inc. (TRC Inc).

The purpose of this testing was to evaluate and compare vehicle and occupant responses during 40% frontal offset vehicle to deformable barrier crash tests. For this test, the subject vehicle was a 2006 Mitsubishi Galant DE 4-door sedan with a 50th percentile driver dummy.

Test Procedure

This test was conducted in accordance with VNTSC's instructions for a 40% offset vehicle to deformable barrier crash test. Data was obtained relative to FMVSS 208, "Occupant Crash Protection" performance, FMVSS 212, "Windshield Retention"; FMVSS 219, "Windshield Zone Intrusion"; and FMVSS 301, "Fuel System Integrity," performance.

The test vehicle, a 2006 Mitsubishi Galant DE 4-door sedan, was instrumented with nine (9) accelerometers to measure longitudinal axis accelerations, three (3) accelerometers to measure lateral axis accelerations, and one (1) accelerometer to measure vertical axis accelerations. The driver's primary and secondary airbag signals were monitored with inductive pickups. The vehicle impacted a 40% left offset deformable barrier. The vehicle's specified impact velocity range was 55.2 to 56.8 km/h.

The test vehicle contained one (1) Part 572E 50th percentile adult male Hybrid III anthropomorphic test device (dummy) in the driver position. The 50th percentile dummy was positioned in the front outboard designated seating position according to a procedure provided by the NHTSA COTR on March 22, 2006. The seating procedure is included as Appendix D. The driver dummy was restrained with a 3-point seat belt and a front dual stage airbag.

The dummy was instrumented with an array of twelve (12) accelerometers in the head, and six (6) accelerometers in the chest, oriented to measure longitudinal, lateral, and vertical accelerations. The dummy was also instrumented with 6-channel upper and lower neck moment and force load cells, left and right femur load cells to measure axial forces, a chest deflection potentiometer, and knee displacement potentiometers. The dummy was equipped with THOR-LX legs, which included upper and lower tibia load cells to measure forces and moments, longitudinal and lateral tibia accelerometers, three (3) foot accelerometers on each foot to measure accelerations in three (3) axes and three (3) rotary potentiometers at each ankle to measure foot rotations about three (3) axes.

The vehicle impacted a deformable barrier instrumented with 90 load cells to measure longitudinal forces.

The 176 data channels were digitally sampled and recorded at 12,500 samples per second and processed per SAE J211 March 1995.

The crash event was recorded by one (1) real-time panning motion picture camera and fifteen (15) high-speed digital motion picture cameras. The pre-test and post-test conditions were recorded by one (1) real-time motion picture camera.

The 40% left frontal offset vehicle to deformable barrier crash test summary data and all occupant, camera, vehicle, and deformable barrier face measurements are presented in Section 2.0. Appendix A contains the still photographs. Appendix B contains the dummy, vehicle, and barrier data plots. Appendix C contains the dummy verification data. Appendix D contains customer provided seating procedure. Appendix E contains miscellaneous test information. Appendix F contains an INSIA report that was the basis for the Structural Measurements presented in Table 8 of this report.

Section 2.0

Offset Deformable Barrier Test Summary

Test Results Summary

This 56.0 km/h (target speed) left 40% offset vehicle to deformable barrier crash test was conducted by TRC Inc. on June 30, 2006.

The test vehicle, a 2006 Mitsubishi Galant DE 4-door sedan, NHTSA Number R65607, was equipped with a 4-liter 4-cylinder transverse engine, automatic transmission, power steering, power brakes and dual stage front airbags. The vehicle's test weight was 1645.4 kg. The vehicle's impact speed was 55.8 km/h. The vehicle sustained 672 mm of static crush during the impact.

The occupant injury assessment values are summarized below.

Injury Criterion	Limits	Driver
Head		
HIC 36	1000	324
HIC 15	700	161
Neck		
Upper Neck Tension (N)	4170	1008
Upper Neck Compression (N)	-4000	-714
Neck Injury (NIJ) NTE	1.0	0.2
Neck Injury (NIJ) NTF	1.0	0.2
Neck Injury (NIJ) NCE	1.0	0.3
Neck Injury (NIJ) NCF	1.0	0.0
Chest		
3 ms Clip (g)	60	31
Chest Displacement (mm)	63	23
Femur		
Left Femur Force (N)	-9040	-108
Right Femur Force (N)	-9040	-133
Tibia		
Left Upper Tibia Index	0.91	0.32
Right Upper Tibia Index	0.91	0.49
Left Lower Tibia Index	0.91	0.27
Right Lower Tibia Index	0.91	0.67
Left Upper Tibia Force (N)	-5600	-1273
Right Upper Tibia Force (N)	-5600	-1377
Left Lower Tibia Force (N)	-5200	-1909
Right Lower Tibia Force (N)	-5200	-2410

Test Results Summary, Continued

Injury Criterion	Limits	Driver
Ankle		
Left Inversion (degrees)	-35	-8
Left Eversion (degrees)	35	36
Left Plantarflexion (degrees)	-	-27
Left Dorsiflexion (degrees)	35	11
Left External Rotation (degrees)	-	0
Left Internal Rotation (degrees)	-	14
Right Eversion (degrees)	-35	-39
Right Inversion (degrees)	35	3
Right Plantarflexion (degrees)	-	-28
Right Dorsiflexion (degrees)	35	0
Right Internal Rotation (degrees)	-	-1
Right External Rotation (degrees)	-	19

Data Acquisition Explanations

Electronic data anomalies are summarized below:

Channel Number	Sensor Type	Sensor Location	Sensor Attachment (Name)	Axis	Problem/Action
1	Accel	Head	11HEADCG00H3ACXA	X	Questionable data throughout event. Redundant accelerometers used to calculate HIC. Resultant affected.
28	Accel	Chest Red.	11CHSTCGRDH3ACXA	X	Questionable data throughout event. Resultant affected.
29	Accel	Chest Red.	11CHSTCGRDH3ACYA	Y	Questionable data throughout event. Resultant affected.
57	Accel	Right Tibia	11TIBIRILXH3ACXA	X	Questionable data throughout event. High pre-event offset.
58	Accel	Right Tibia	11TIBIRILXH3ACYA	Y	Questionable data throughout event. High pre-event offset.

DATA SHEET NO. 1
CRASH VEHICLE SUMMARY

Vehicle NHTSA No.: R65607 Test Mode: Left 40% Offset Deformable Barrier
Test Date: 06/30/06 Time: 18:05 Temperature: 21 °C
Vehicle Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
Vehicle Test Weight: 1645.4 kg
Vehicle/Barrier Impact Angle: 0 °
Vehicle/Barrier Impact Accuracy: 5 mm down
3 mm right
Impact Velocity: 55.8 km/h
Maximum Static Crush: 672 mm
Vehicle Rebound: N/A mm

DUMMIES:

DRIVER #202

Type: HIII 50th
Type Lower Leg / Serial Number: THOR-LX/045 & 046
Restraint System: 3-pt. seat belt, airbag

Number of Data Channels: 71
Number of Cameras: 1 Real-Time
15 High-Speed Digital

DOOR OPENING DATA:

<u>Easy</u>	- Left Front
<u>Easy</u>	- Right Front
<u>Easy</u>	- Left Rear
<u>Easy</u>	- Right Rear

DATA SHEET NO. 1 (continued)
CRASH VEHICLE SUMMARY

<u>FRONT SEAT(S) DATA:</u>	<u>DRIVER</u>	<u>RIGHT FRONT PASSENGER</u>
Seat Track Failure (mm of shift):	None	N/A
Seat Back Failure:	None	N/A
<u>REAR SEAT(S) DATA:</u>	<u>LEFT REAR PASSENGER</u>	<u>RIGHT REAR PASSENGER</u>
Seat Track Failure (mm of shift):	N/A	N/A
Seat Back Failure:	N/A	N/A
<u>VISIBLE DUMMY CONTACT POINTS :</u>		
	<u>DRIVER</u>	
Head:	Airbag, B-Pillar	
Chest:	Airbag	
Abdomen:	None	
Left Knee:	Dash panel	
Right Knee:	None	

DATA SHEET NO. 2
GENERAL TEST AND VEHICLE PARAMETER DATA

TEST VEHICLE INFORMATION:

Year/Make/Model/Body
Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA No.: R65607 VIN: 4A3AB26F16E012740 Color: Liquid Silver
Engine Data: 4 Cylinders CID 4 Liters
Placement: Longitudinal or In-line X Transverse or Lateral
Transmission Data: 4 Speeds Manual X Automatic Overdrive
Final Drive: Rear Wheel X Front Wheel Four Wheel
Major Options: A/C X Pwr. Steering X Pwr. Brakes Pwr. Seats
 Tilt Wheel Pwr. Windows Pwr. Locks Cruise
 Control
Date Received: 5/24/2006 Odometer Reading: 310 miles
Selling Dealer: Family Mitsubishi-North
& Address: 13927 Trade Center Drive, Fishers, IN 46038-4548

DATA FROM TIRE VEHICLE'S CERTIFICATION LABEL:

Vehicle Manufactured by: Mitsubishi Motors North America, Inc.
Date of Manufacture Aug, 2005
GVWR: 1960 kg; GAWR: 1035 kg FRONT; 925 kg REAR


DATA FROM TIRE OR TIRE PLACARD:

Tire Pressure with Maximum Capacity Vehicle Load: 220 kPa FRONT
220 kPa REAR
Load Index & Speed Symbol: 94H
Recommended Tire Size: P215 / 60R16
* Recommended Cold Tire Pressure: 220 kPa FRONT; 220 kPa REAR
Tire Grades: 200 Treadwear; A Temperature; B Traction
Size of Tires on Test Vehicle: P215/60R16 ; Manufacturer: Yokohama, Radial 376
Vehicle Capacity Data:
Type of Front Seats: Bench; X Bucket; Split Bench
Number of
Occupants: 2 Front; 3 Rear; 5 Total
Vehicle Capacity Weight (VCW) = 375 kg
No. of Occupants x 68 kg = 340 kg
Rated Cargo/Luggage Weight (RCLW) = 35 kg

*Tire pressure used for test

DATA SHEET NO. 2 (continued)
GENERAL TEST AND VEHICLE PARAMETER DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

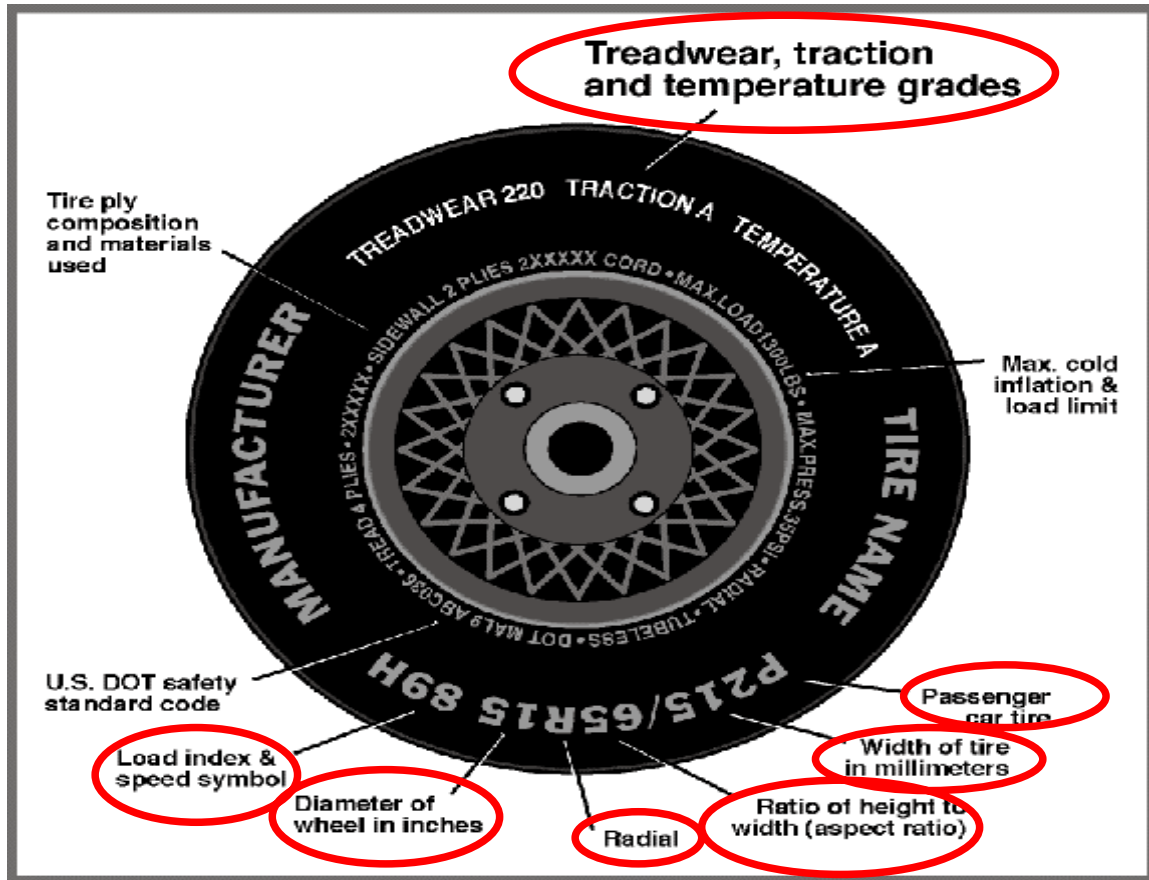

DATA RECORDED FROM ACTUAL TIRES ON TEST VEHICLE

	Front	Rear
Manufacturer	Yokohama	Yokohama
Brand Name	Radial 376	Radial 376
Tire Size (ex. P215/65R15)	P215/60R16	P215/60R16
Load Index and Speed Symbol	94H	94H
Treadwear	200	200
Traction	B	B
Temperature	A	A

DATA SHEET NO. 2 (continued)
GENERAL TEST AND VEHICLE PARAMETER DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

WEIGHT OF TEST VEHICLE AS RECEIVED FROM DEALER (with max. fluids) = UDW:

Right Front	=	<u>444.0</u>	kg	Right Rear	=	<u>313.0</u>	kg
Left Front	=	<u>468.5</u>	kg	Left Rear	=	<u>309.0</u>	kg
TOTAL FRONT	=	<u>912.5</u>	kg	TOTAL REAR	=	<u>622.0</u>	kg
TOTAL DELIVERED WEIGHT =				<u>1534.5</u>	kg		
% of Total Front of Vehicle Weight =				<u>59.5</u>	%		
% of Total Rear of Vehicle Weight =				<u>40.5</u>	%		

CALCULATION OF VEHICLE'S TARGET TEST WEIGHT:

Total Delivered Weight (UDW)	=	<u>1534.5</u>	kg
Rated Cargo/Luggage Weight (RCLW)	=	<u>35.0</u>	kg
Weight of One Part 572E Dummy @ 76 each	=	<u>76.0</u>	kg
TARGET TEST WEIGHT	=	<u>1645.5</u>	kg

WEIGHT OF TEST VEHICLE WITH ONE DUMMY:

Right Front	=	<u>453.6</u>	kg	Right Rear	=	<u>351.4</u>	kg
Left Front	=	<u>482.8</u>	kg	Left Rear	=	<u>357.6</u>	kg
TOTAL FRONT	=	<u>936.4</u>	kg	TOTAL REAR	=	<u>709.0</u>	kg
TOTAL TEST WEIGHT =				<u>1645.4</u>	kg		
% of Total Front of Vehicle Weight =				<u>56.9</u>	%		
% of Total Rear of Vehicle Weight =				<u>43.1</u>	%		
Weight of Ballast Secured in Vehicle Trunk Area =				<u>0</u>	kg		

Vehicle Components Removed for Weight Reduction: Rear fascia, both taillights, rear deck lid, deck lid seal, rear deck speakers, both rear windows and window motors, both rear door skins, right passenger door skin, both rear door seals, passenger front door seal, two rear seatbelts

VEHICLE ATTITUDE (all dimension in millimeters):

AS DELIVERED :	RF	<u>745</u>	LF	<u>740</u>	RR	<u>716</u>	LR	<u>716</u>
FULLY LOADED :	RF	<u>741</u>	LF	<u>730</u>	RR	<u>700</u>	LR	<u>690</u>
AS TESTED :	RF	<u>728</u>	LF	<u>722</u>	RR	<u>688</u>	LR	<u>686</u>
Vehicle's Wheel Base :		<u>2760</u>	mm					
Location of Vehicle's C.G.:		<u>1189</u>	mm rearward of front wheel center.					

DATA SHEET NO. 2 (continued)
GENERAL TEST AND VEHICLE PARAMETER DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

FUEL SYSTEM DATA :

Fuel System Capacity From Owner's Manual = 67.0 liters
Usable Capacity Figure Furnished by COTR = N/A liters
Test Volume Range (92 to 94% of Usable Capacity) = 61.6 to 63.0 liters
ACTUAL TEST VOLUME = 62.5 liters (with entire fuel system filled)
Test Fluid Type: Stoddard; Specific Gravity = 0.764
Kinematic Viscosity = 0.99 centistokes; Color = Purple
Type of Fuel Pump: Electric- X; Mechanical-
Does Electric Pump operate with ignition switch "ON" & engine "OFF" Yes- X No-
Details of Fuel System: The fuel tank is located in front of the rear axle under the rear seat area. The filler neck enter the back left corner of the tank. The fuel filler cap is located on the left rear quarter panel. The fuel lines run along inside of the left frame rail.

DATA SHEET NO. 3
POST IMPACT DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

TYPE OF TEST:

Type of Test: Left 40% Offset Deformable Barrier Impact Angle: 0 °
Test Date: 06/30/06 Time: 18:05 Temperature: 21 °C
Vehicle NHTSA No.: R65607
Required Impact Velocity Range: 55.2 to 56.8 km/h

BARRIER IMPACT VELOCITY:

Trap No. 1 = 55.8 km/h; Trap No. 2 = 55.8 km/h

VEHICLE STATIC CRUSH: (mm)

Vehicle Length:


Pre-Test	Right =	<u>4604</u>	; C/L =	<u>4804</u>	; Left =	<u>4604</u>
Post-Test	Right =	<u>4653</u>	; C/L =	<u>4289</u>	; Left =	<u>3932</u>
Crush	Right =	<u>-49</u>	; C/L =	<u>515</u>	; Left =	<u>672</u>
AVERAGE	=	<u>379</u>	mm			

DATA SHEET NO. 4
TEST VEHICLE INFORMATION

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

Nominal Design Riding Position for adjustable driver and passenger seat backs. Please describe how to position the inclinometer to measure the seat back angle. Include description of the location of the adjustment latch detent, if applicable.

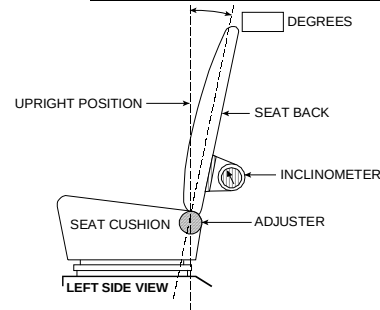

FRONT SEAT ASSEMBLY

Left Front Seat Cushion Placement: Detent 17 of 23

Total Length of Fore/Aft Adjustment Travel: 220 mm

Total Number of Adjustment Positions or Detents: 23

Left Front Seat Back Adjustment Position: Full up

Left Front Head Restraint Placement: Full up

Left D-Ring Placement: Full up

Right Front Seat Cushion Placement: N/A - Seat removed

Total Length of Fore/Aft Adjustment Travel: N/A mm

Total Number of Adjustment Positions or Detents: N/A

Right Front Seat Back Adjustment Position: N/A

Right Front Head Restraint Placement: N/A

Right D-Ring Placement: N/A

Adjustable Steering Column Position: 20°; center of geometric range of travel

Window Positions:

Right Front: Open

Right Rear: Open

Left Front: Open

Left Rear: Open

Amount of Stoddard Solvent In Fuel Tank:


67.0 liters (fuel tank usable capacity)

62.5 liters used in test (92% - 94% of fuel tank usable capacity)



Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607


Test Date: 06/30/06

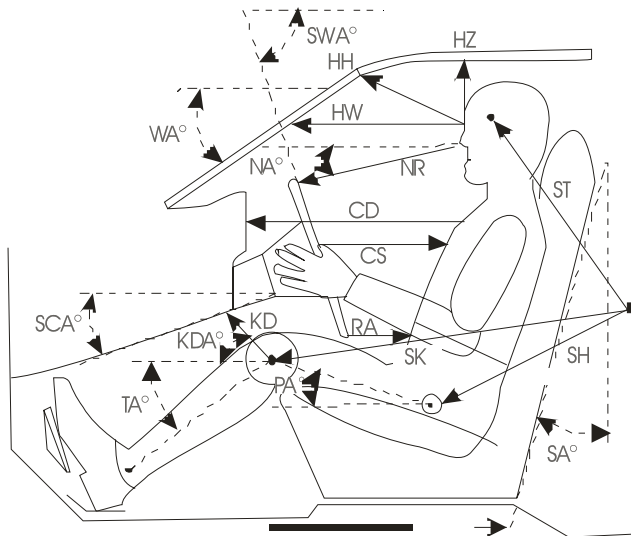

AD Arm to Door
HD H-Point to Door
HR Head to Side Header
HS Head to Side Window
KK Knee to Knee
SHY Striker to H-Point (Y-Axis)

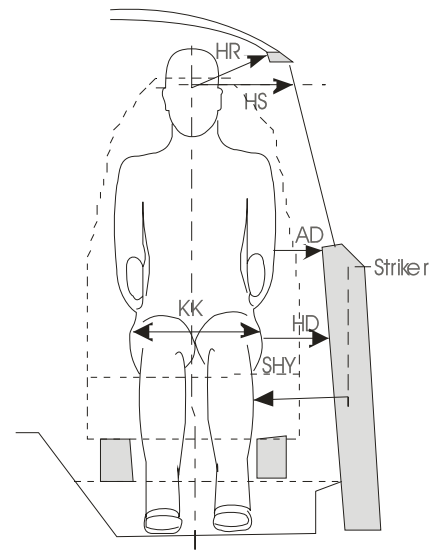

CD Chest to Dash
CS Chest to Steering Wheel Hub
HH Head to Header
HW Head to Windshield
HZ Head to Roof
KDA Knee to Dash Angle
KDL Left Knee to Dash
NA Nose to Rim Angle
NR Nose to Rim
PA Pelvic Angle
RA Rim to Abdomen
SA Seat Back Angle
SCA Steering Column Angle
SH Striker to H-Point
SK Striker to Knee
ST Striker to Head
SWA Steering Wheel Angle
TA Tibial Angle
WA Windshield Angle

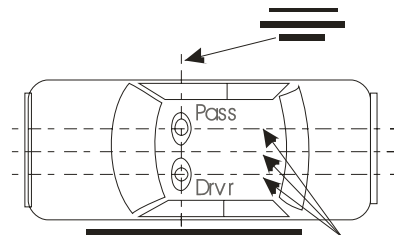

DUMMY MEASUREMENTS FOR FRONT SEAT OCCUPANTS

DATA SHEET NO. 5
FRONT SEAT DUMMY POSITIONING MEASUREMENTS IN VEHICLE


Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

	DRIVER (Serial #202)			RIGHT FRONT PASSENGER (Serial #N/A)		
WA°	23.1°					
SWA°	70.1°					
SCA°	19.9°					
SA°	12.4°					
HZ	182 mm					
HW	735 mm					
HH	409 mm					
HR	215 mm					
NR	436 mm					
NA°	8.0°					
CD	617 mm					
CS	341 mm					
RA	256 mm					
KDL	222 mm	Angle (KDA)	16.7°			
KDR	226 mm					
PA°	25.8°					
TA°	30.9°					
KK	343 mm					
ST	467 mm	Angle	-84.1°			
SK	560 mm	Angle	6.0°			
SH	260 mm	Angle	46.9°			
SHY	152 mm					
HS	327 mm					
HD	137 mm					
AD	148 mm					

DATA SHEET NO. 6 **SEAT BELT POSITIONING DATA**

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

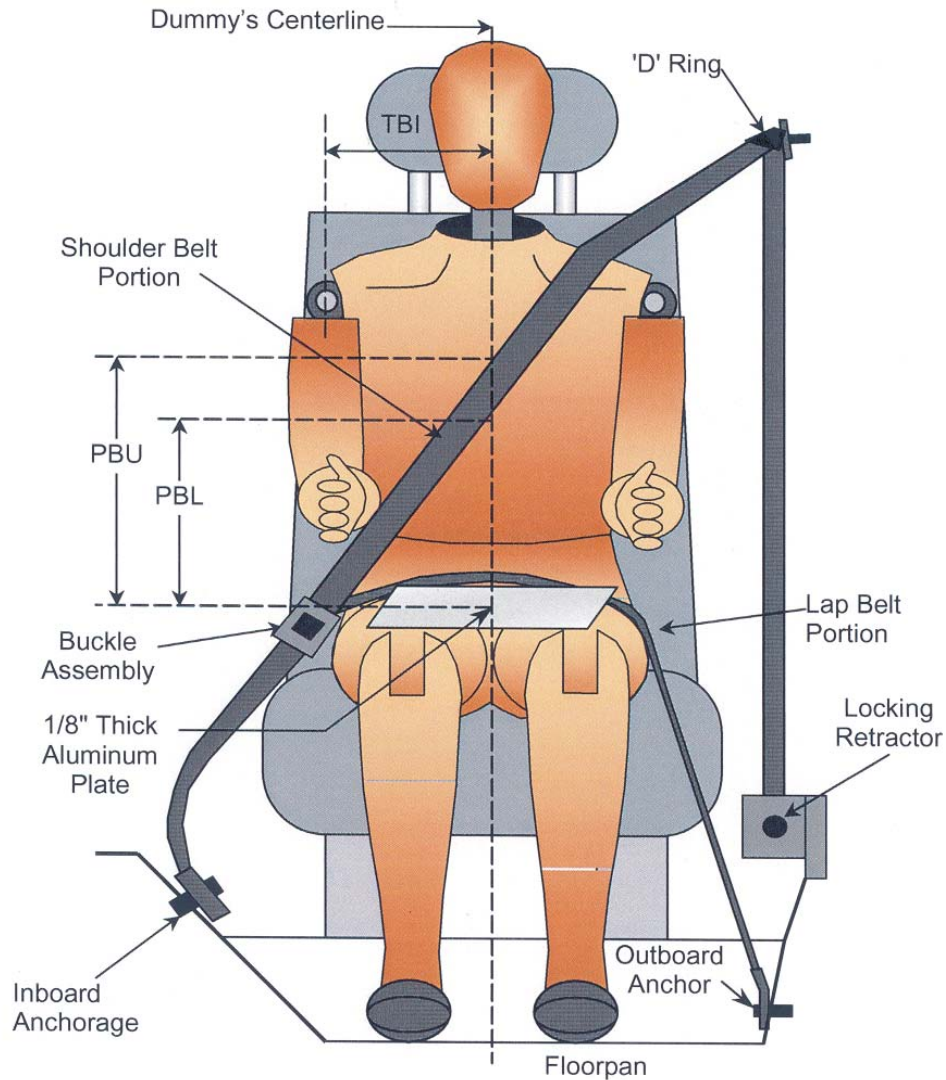


	Driver Dummy	Passenger Dummy	Rear Passenger Dummy
PBU - Top surface of aluminum plate to belt upper edge, mm	379		
PBL - Top surface of aluminum plate to belt lower edge, mm	294		

DATA SHEET NO. 7


Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

VEHICLE ACCELEROMETER LOCATION AND DATA SUMMARY

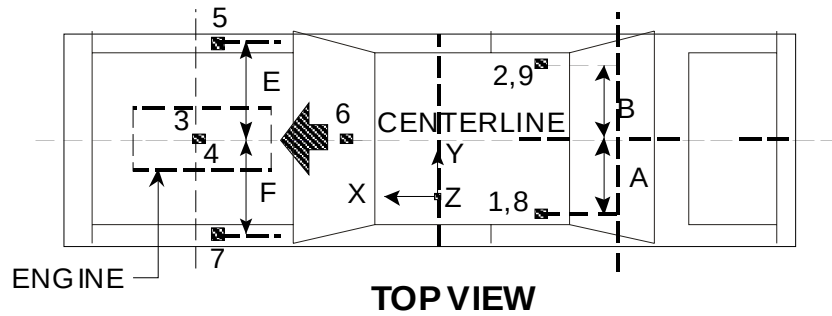

REAR SEAT CUSHION
ASSY. FRONT ATTACHMENT
BRACKET SUPPORT

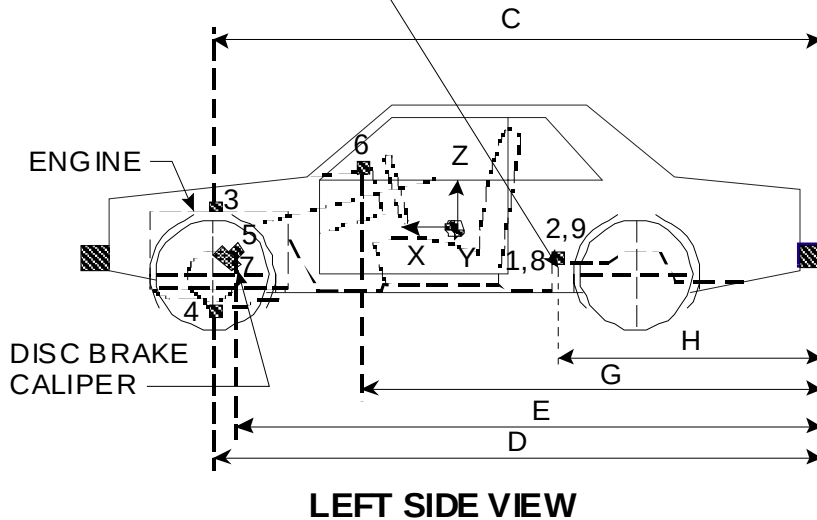

NOTE: Vehicle accelerometer location and data summary shown in DATA SHEET NO. 6.

DATA SHEET NO. 7 (continued)
VEHICLE ACCELEROMETER LOCATIONS AND DATA SUMMARY

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

DIMENSION	LENGTH (mm)
	PRE-TEST VALUES
A Left Rear Seat Crossmember Y	400
B Right Rear Seat Crossmember Y	400
C Top of Engine X	4529
D Bottom of Engine X	4360
E Disc Brake Calipers X	4405
F Disc Brake Calipers Y	715
G Instrument Panel X	3670
H Left Rear Seat Cross Member X	2662
I Right Rear Seat Cross Member X	2662
J Left Side Driver Mid Seat Track X	3135
J Vehicle Center of Gravity X	3130

DATA SHEET NO. 7 (continued)
VEHICLE ACCELEROMETER LOCATIONS AND DATA SUMMARY

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

LOCATION NUMBER	<u>DESCRIPTION</u>	MAXIMUM VALUE (g's)			
		Positive	Time, ms	Negative	Time, ms
1	Left Rear Seat Cross Member X	1.9	166.2	33.2	100.2
2	Right Rear Seat Cross Member X	1.6	167.0	29.9	89.0
3	Top of Engine Block X	3.3	203.7	80.0	78.4
4	Bottom of Engine Block X	15.6	94.5	43.4	84.3
5	Disc Brake Caliper at Right Side X	11.5	136.4	49.5	101.0
6	Instrument Panel X	10.6	38.0	36.3	98.7
7	Disc Brake Caliper at Left Side X	27.4	102.4	62.2	80.0
8	Left Rear Seat Cross Member Z	9.1	76.4	1.2	121.1
9	Right Rear Seat Cross Member Z	6.4	75.3	1.9	120.8
10	Left Side Driver Mid Seat Track X	1.4	165.2	34.6	100.5
11	Vehicle Center of Gravity X	1.1	165.0	32.1	90.1
	Vehicle Center of Gravity Y	11.0	87.9	5.1	120.5
	Vehicle Center of Gravity Z	6.9	79.8	7.5	67.5

DATA SHEET NO. 8
DUMMY INJURY CRITERIA VALUES

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

		MAXIMUM VALUE							
		Driver				Right Front Passenger			
DESCRIPTION	Unit	Positive	Time, ms	Negative	Time, ms	Positive	Time, ms	Negative	Time, ms
Head X ¹	g	----	----	----	----				
Head Y	g	12.1	295.3	3.9	105.2				
Head Z	g	26.7	117.8	1.5	26.1				
Head Resultant ¹	g	----	----						
Head Redundant X	g	31.4	295.3	39.9	133.4				
Head Redundant Y	g	13.6	294.8	4.8	103.6				
Head Redundant Z	g	27.4	123.4	1.5	26.0				
Head Resultant Red.	g	45.1	133.4						
Head (FT) Y	g	15.4	294.3	2.5	87.0				
Head (FT) Z	g	29.5	128.4	3.0	184.1				
Head (TP) X	g	49.6	294.3	35.9	141.5				
Head (TP) Y	g	19.3	294.2	8.3	101.7				
Head (LT) X	g	33.8	295.2	37.5	133.3				
Head (LT) Z	g	28.9	111.0	2.9	167.4				
Upper Neck Fx	N	132.3	124.6	250.7	309.8				
Upper Neck Fy	N	572.8	133.5	223.5	305.8				
Upper Neck Fz	N	1008.3	127.8	714.8	304.6				
Upper Neck Mx	N-m	25.5	151.5	5.8	232.6				
Upper Neck My	N-m	17.6	108.5	34.4	309.8				
Upper Neck Mz	N-m	13.1	112.2	6.0	144.5				
Lower Neck Fx	N	206.8	151.8	267.8	290.5				
Lower Neck Fy	N	408.2	148.9	245.7	102.7				
Lower Neck Fz	N	1352.4	117.8	471.3	304.5				
Lower Neck Mx	N-m	23.5	308.5	120.4	136.6				
Lower Neck My	N-m	48.8	171.5	61.9	122.9				
Lower Neck Mz	N-m	24.5	137.0	5.2	289.7				
Chest X	g	6.5	310.0	28.5	106.9				
Chest Y	g	13.2	108.5	1.2	28.2				
Chest Z	g	10.3	126.9	1.7	79.6				
Chest Resultant	g	31.7	108.5						

DATA SHEET NO. 8 (continued)
DUMMY INJURY CRITERIA VALUES

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

		MAXIMUM VALUE							
		Driver				Right Front Passenger			
DESCRIPTION	Unit	Positive	Time, ms	Negative	Time, ms	Positive	Time, ms	Negative	Time, ms
Chest Redundant X ¹	g	----	----	----	----				
Chest Redundant Y ¹	g	----	----	----	----				
Chest Redundant Z	g	14.8	108.6	1.1	28.1				
Chest Resultant Redundant ¹	g	----	----						
Chest Displacement	mm	0.0	24.5	23.0	119.1				
Left Femur Z	N	1223.8	111.5	108.3	136.2				
Right Femur Z	N	1574.0	112.9	132.9	143.5				
Left Knee Displacement X	mm	0.3	82.8	24.8	185.7				
Left Upper Tibia Fx	N	230.2	118.3	75.9	136.3				
Left Upper Tibia Fz	N	133.1	155.6	1273.0	87.8				
Left Upper Tibia Mx	N-m	30.7	159.8	40.4	88.2				
Left Upper Tibia My	N-m	32.2	127.4	35.9	89.6				
Left Tibia X	g	8.3	136.0	26.7	114.6				
Left Tibia Y	g	9.0	81.4	8.9	116.9				
Left Lower Tibia Fx	N	72.6	136.2	390.3	98.3				
Left Lower Tibia Fy	N	288.2	127.7	88.1	160.3				
Left Lower Tibia Fz	N	58.7	233.6	1907.2	87.7				
Left Lower Tibia Mx	N-m	25.8	118.9	5.2	41.4				
Left Lower Tibia My	N-m	22.6	129.0	27.2	88.5				
Left Foot Angular Displacement X	°	36.3	129.1	8.0	303.2				
Left Foot Angular Displacement Y	°	11.0	108.3	26.9	243.7				
Left Foot Angular Displacement Z	°	14.0	147.4	0.3	275.1				
Left Foot X	g	18.1	35.7	42.8	34.8				
Left Foot Y	g	21.1	34.6	13.9	122.0				
Left Foot Z	g	8.9	104.8	56.8	35.4				
Left Foot Resultant	g	63.9	34.8						

DATA SHEET NO. 8 (continued)
DUMMY INJURY CRITERIA VALUES

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

DESCRIPTION	Unit	MAXIMUM VALUE							
		Driver				Right Front Passenger			
		Positive	Time, ms	Negative	Time, ms	Positive	Time, ms	Negative	Time, ms
Right Knee Displacement X	mm	0.0	206.3	0.9	130.9				
Right Upper Tibia Fx	N	294.7	121.5	39.9	87.1				
Right Upper Tibia Fz	N	155.8	48.6	1675.3	96.6				
Right Upper Tibia Mx	N-m	27.0	157.5	92.0	104.7				
Right Upper Tibia My	N-m	30.2	144.2	53.2	110.3				
Right Tibia X ¹	g	----	----	----	----				
Right Tibia Y ¹	g	----	----	----	----				
Right Lower Tibia Fx	N	150.1	144.8	290.3	109.0				
Right Lower Tibia Fy	N	196.2	105.4	182.8	95.0				
Right Lower Tibia Fz	N	96.9	163.0	2404.9	96.5				
Right Lower Tibia Mx	N-m	3.8	82.9	122.0	101.1				
Right Lower Tibia My	N-m	10.5	143.1	46.1	107.7				
Right Foot Angular Displacement X	°	3.5	215.3	38.4	104.5				
Right Foot Angular Displacement Y	°	0.2	92.2	27.9	50.0				
Right Foot Angular Displacement Z	°	19.4	126.7	0.9	7.7				
Right Foot X	g	18.1	51.1	33.3	99.8				
Right Foot Y	g	89.8	99.4	5.6	247.1				
Right Foot Z	g	22.2	51.0	61.7	49.3				
Right Foot Resultant	g	94.8	99.8						
Lap Belt Load	N	5988.1	107.8	10.3	228.5				
Shoulder Belt	N	4223.0	100.0	35.6	18.9				

DATA SHEET NO. 8 (continued)
DUMMY INJURY CRITERIA VALUES

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

	HEAD INJURY CRITERIA			
	HIC**	t₁ (ms)	t₂ (ms)	Average Acceleration t₁ to t₂ (g's)
Left Front - Driver	161	119.9	135.0	40.9
Right Front - Passenger				
Left Rear - Passenger				
Right Rear - Passenger				

** Head Injury Criteria (HIC) is as defined in FMVSS 208. The maximum time interval from t₁ to t₂ is 0.015 seconds.

	CLIP SUMMARY*			
	CLIP (g's)	t₁ (ms)	t₂ (ms)	Chest Severity Index
Left Front - Driver	31	106.5	109.5	239
Right Front - Passenger				
Left Rear - Passenger				
Right Rear - Passenger				

* The maximum chest resultant acceleration (clip) is defined as the maximum acceleration that exceeds 0.003 seconds in duration.

DATA SHEET NO. 9
SEAT BELT PERFORMANCE ASSESSMENT TEST DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

<u>BELT LENGTH DATA:</u>	<u>Driver*</u>	<u>Right Front Passenger *</u>
Total belt length.	<u>2962</u>	<u>N/A</u>
Shoulder belt length as measured on Part 572 Dummy.	<u>854</u>	<u>N/A</u>
Lap belt length as measured on Part 572 Dummy.	<u>765</u>	<u>N/A</u>
<u>SHOULDER BELT SPOOL-OFF DATA:</u>	<u>Driver*</u>	<u>Right Front Passenger*</u>
As determined mechanically.	<u>N/A¹</u>	<u>N/A</u>

NOTE:

* All measurements in millimeters.

¹ Belt spool data not part of test request.

DATA SHEET NO. 10 **SUMMARY OF FMVSS 212 DATA**

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

FMVSS No. 212 – “Windshield Mounting” Data

Details Of Windshield Mounting Such As


Retention Method, Trim Type, Etc.: adhesive, plastic trim, unknown

FMVSS 212 Requirements

The Post-Test periphery retention amount must be at least 75% of the Pre-Test periphery measurement for vehicles NOT equipped with automatic restraints, and 50% for each side of the windshield for vehicles equipped with automatic restraint systems for front occupants.

	Windshield Periphery		% of Retention
	Pre-Test (mm)	Post-Test (mm)	
Right Side	2195	2195	100.0
Left Side	2195	2195	100.0
Total	4390	4390	100.0

Area of Retention Failure: none

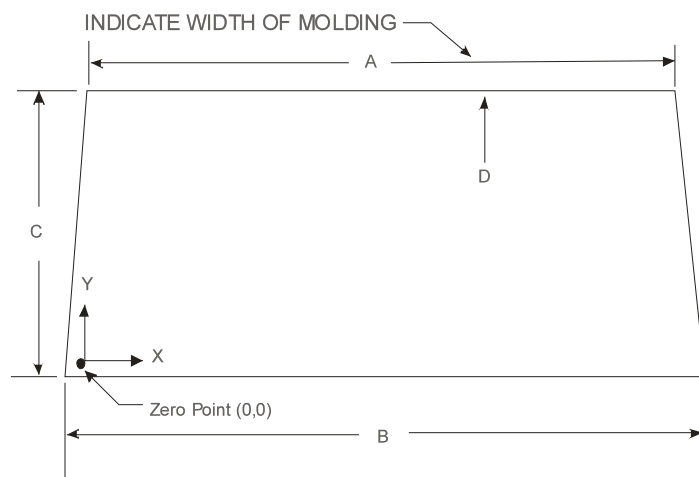

Dimensions (mm)	
A	1210
B	1530
C	825
D	10

FRONT VIEW OF WINDSHIELD

Failure Details

DATA SHEET NO. 11
FMVSS 219 (PARTIAL) – “WINDSHIELD ZONE INTRUSION” DATA


Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

Protected Zone Lower Edge Requirement

The lower edge of the protected zone is determined by placing a 165 mm diameter rigid sphere weighing 6.8 kg in a position such that it simultaneously contacts the inner surface of the windshield and the top of the instrument panel including padding. The locus of points is drawn on the inner surface of the windshield contacted by the sphere across the width of the instrument panel. From the outermost contactable points extend the locus line horizontally to the edges of the windshield; then draw a line on the inner surface of the windshield below and 13 mm distant from the locus line. The LOWER EDGE OF THE PROTECTED ZONE is the longitudinal projection of this line onto the outer surface of the windshield.

FMVSS 219 Test Data

(Dimensions in mm)

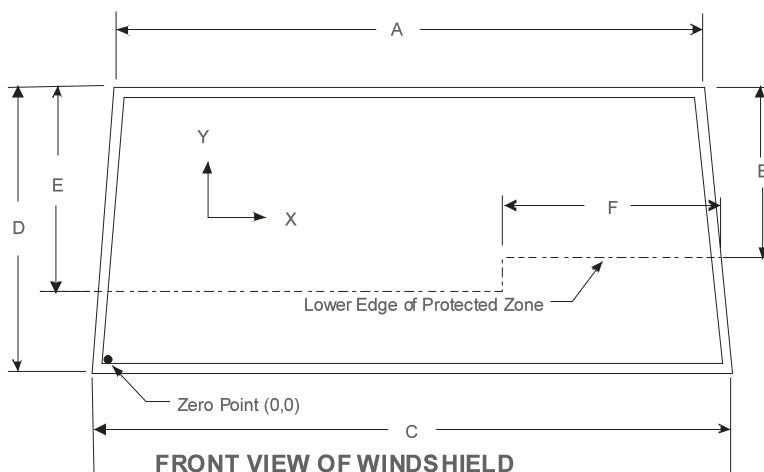

Dimensions	
A	1210
B	470
C	1530
D	825
E	557
F	551

(Show location of penetration on the above sketch)

Details of Windshield Glass Penetration Greater Than 6 mm: None


COORDINATES		
	X	Y
1.		
2.		
3.		
4.		

DATA SHEET NO. 12**FMVSS NO. 301-75 "FUEL SYSTEM INTEGRITY" POST IMPACT TEST DATA**Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedanNHTSA Test No.: R65607 Test Date: 06/30/06

The test vehicle was filled from 92% to 94% of the manufacturer's "usable" capacity. The electric fuel pump was operating if it will operate without engine operation. Two Part 572 anthropomorphic test devices were located at each of the front designated seating positions.

TEST VEHICLE IMPACT TYPE

X	Frontal (56 kph)
	Oblique (48 kph) with _____ deg. barrier face first contacting _____ side (driver / passenger)
	Rear Moving Barrier (48 kph)
	Lateral Moving Barrier (32 kph)

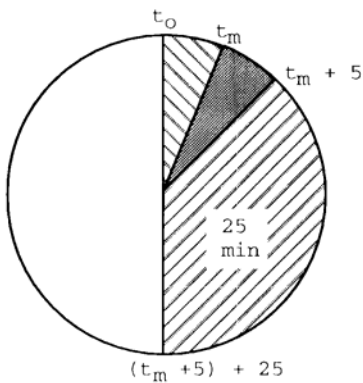FUEL SPILLAGE MEASUREMENT


	ACTUAL	MAX. ALLOWED
1. From impact until vehicle motion ceases	0.0 g	28 g
2. For 5 minute period after vehicle motion ceases	0.0 g	141 g
3. For next 25 minutes	0.0 g	28 g/min.

SOLVENT SPILLAGE DETAILS

none

DATA SHEET NO. 13
FMVSS 301 STATIC ROLLOVER DATA SHEET

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

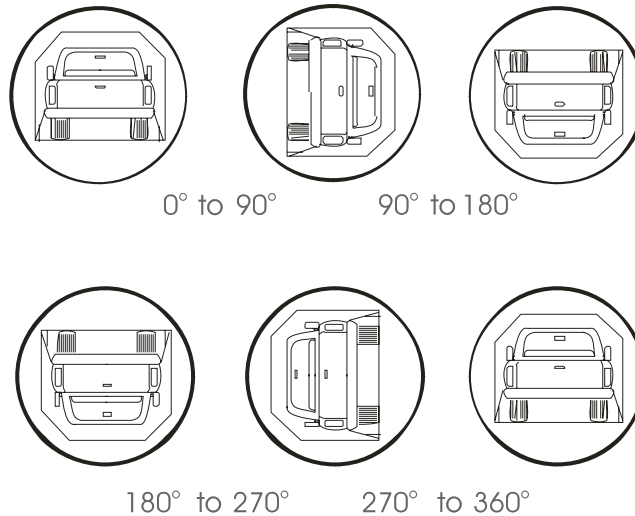

1. The specified fixture rollover rate for each 90° of rotation is 60 to 120 seconds.
2. The position hold time at each position is 300 seconds (minimum).


Details of Stoddard Solvent Spillage Locations

none

Test Phase	Rotation Time (sec.)	Hold Time (sec.)	Spillage (oz.)
0° to 90°	60	300	0
90° to 180°	60	300	0
180° to 270°	60	300	0
270° to 360°	60	300	0

DATA SHEET NO. 14 **TEST VEHICLE MEASUREMENTS**

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

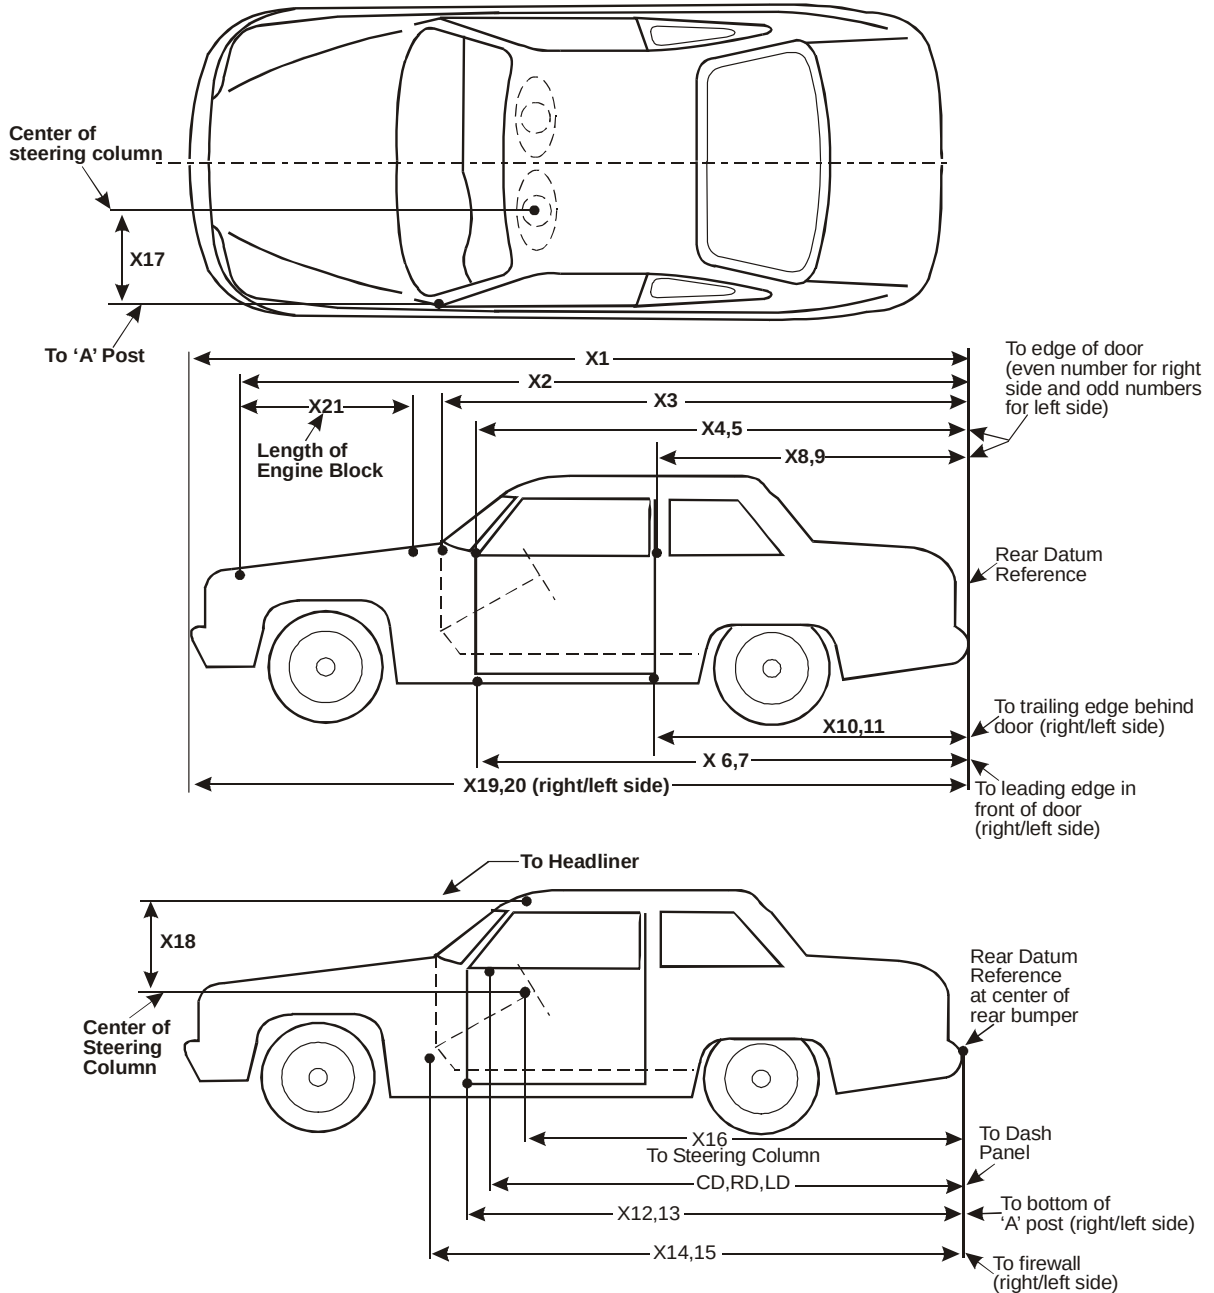

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06


No.	Type of measurement	Pre-Test	Post-Test	Difference
X1	Total Length of Vehicle at Centerline	4804	4289	515
X2	Rear Surface of Vehicle to Front of Engine Block	4163	3945	218
X3	Rear Surface of Vehicle to Firewall	3730	3559	171
X4	Rear Surface of Vehicle to Upper Leading Edge of Right Door	3276	3070	206
X5	Rear Surface of Vehicle to Upper Leading Edge of Left Door	3269	3069	200
X6	Rear Surface of Vehicle to Lower Leading Edge of Right Door	3234	3185	49
X7	Rear Surface of Vehicle to Lower Leading Edge of Left Door	3244	3023	221
X8	Rear Surface of Vehicle to Upper Trailing Edge of Right Door	2229	2015	214
X9	Rear Surface of Vehicle to Upper Trailing Edge of Left Door	2224	2013	211
X10	Rear Surface of Vehicle to Lower Trailing Edge of Right Door	2230	2028	202
X11	Rear Surface of Vehicle to Lower Trailing Edge of Left Door	2237	2019	218
X12	Rear Surface of Vehicle to Bottom of " A " Post on Right Side	3279	3063	216
X13	Rear Surface of Vehicle to Bottom of " A " Post on Left Side	3279	2073	1206
X14	Rear Surface of Vehicle to Firewall-Right Side	3744	3627	117
X15	Rear Surface of Vehicle to Firewall-Left Side	3744	3537	207
X16	Rear Surface of Vehicle to Steering Wheel Center	2854	2636	218
X17	Center of Steering Column to " A " Post	310	319	-9
X18	Center of Steering Column to Headliner	390	370	20
X19	Rear Surface of Vehicle to Right Side of Front Bumper	4604	4653	-49
X20	Rear Surface of Vehicle to Left Side of Front Bumper	4604	3932	672
X21	Length of Engine Block	500	500	0
RD	Rear Surface of Vehicle to Right Side of Dash Panel	3239	2920	319
CD	Rear Surface of Vehicle to Center of Dash Panel	3129	2911	218
LD	Rear Surface of Vehicle to Left Side of Dash Panel	3139	2884	255

All measurements are in millimeters.

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

DOOR OPENING WIDTH

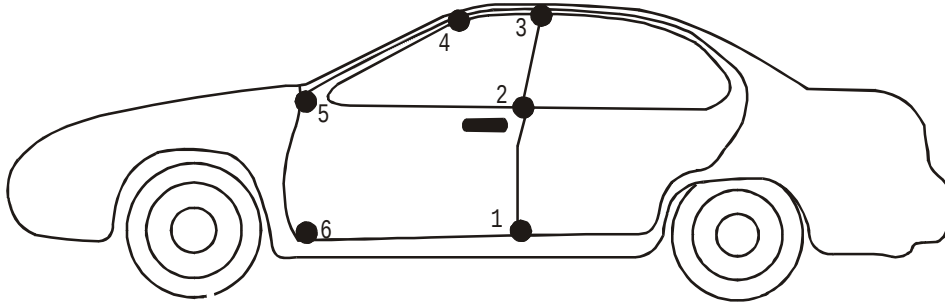

Left Front

Point Location	PRE-TEST (mm)			POST-TEST (mm)			CHANGE (mm)		
	X	Y	Z	X	Y	Z	X	Y	Z
1	2462	-804	66	2461	-803	65	-1	1	-1
2	2268	-800	-453	2268	-798	-453	0	2	0
3	2171	-612	-926	2172	-610	-926	1	2	0
4	2749	-652	-860	2750	-649	-862	1	3	-2
5	3269	-782	-453	3267	-782	-454	-2	0	-1
6	3248	-792	51	3245	-791	52	-3	1	1

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

	Elements	Pre-Test
1	Total Length	4804
2	Total Width	1830
3	Bumper Top Height	532
4	Bumper Bottom Height	417
5	Longitudinal Member Top Height	552
6	Longitudinal Member Bottom Height	462
7	Distance Between Longitudinal Members	1185
7'	Longitudinal Member Width	110
8	Engine Top Height	857
9	Engine Bottom Height	170
10	Engine and Gearbox Width	810
11	Front Bumper - Engine Distance	390
12	Front Shock Absorber Fixing Height	882
13	Bonnet Leading Edge Height	687
14	Front Shock Absorber Fixing Width	1166
15	Front Bumper - Front Axle Distance	950
16	Front Axle - A Pillar Distance	590
17	A Pillar - B Pillar Distance	1040
18	B Pillar - Rear Axle Distance	1110
19	B Pillar - C Pillar Distance	1000
20	Roof Sill Bottom Height	1331
21	Roof Sill Top Height	1356
22	Floor Sill Bottom Height	329
23	Floor Sill Top Height	381


All distance measurements are in millimeters.

¹ Taken from INSIA report, "Structural Survey of Cars, Methodology of the Main Resistant Elements in the Car Body", March 1999. This report is included in Appendix F.

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

STATIC FOOTWELL DEFORMATION

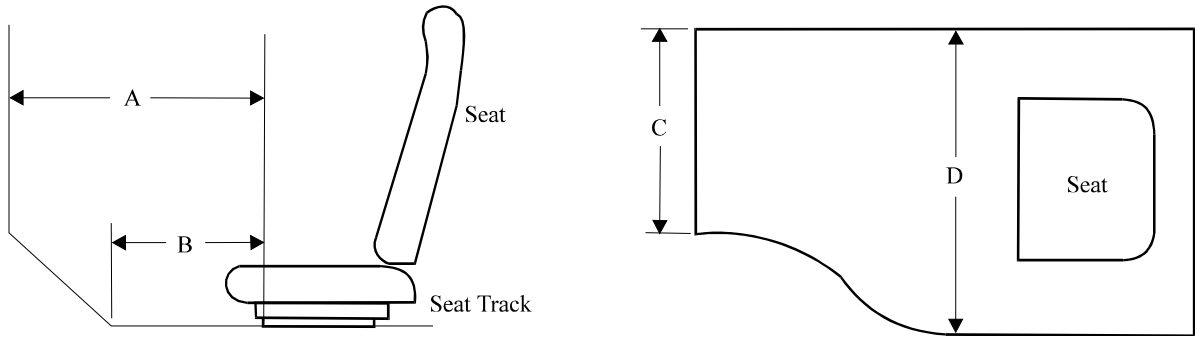

DRIVER


Measurement	Pre-Test	Post-Test	Difference
A	601	563	-38
B	455	438	-17
C	392	392	0
D	373	373	0

All units in millimeters

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

STATIC PASSENGER COMPARTMENT INTRUSION

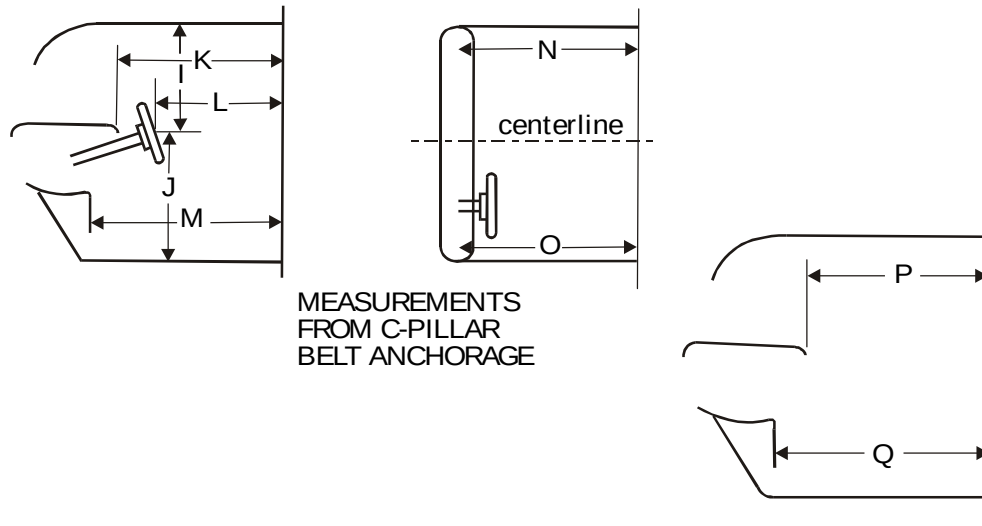

Measurement	Pre-Test	Post-Test	Difference
I	415	370	45
J	635	657	-22
K	2002	2012	-10
L	1760	1763	-3
M	2145	2138	7
N	2000	1994	6
O	1965	1964	1
P = K (PASS.)	2020	2012	8
Q = M (PASS.)	2112	2092	20


All units in millimeters

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS


Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

FLOORBOARD DEFORMATION

DRIVERS SIDE

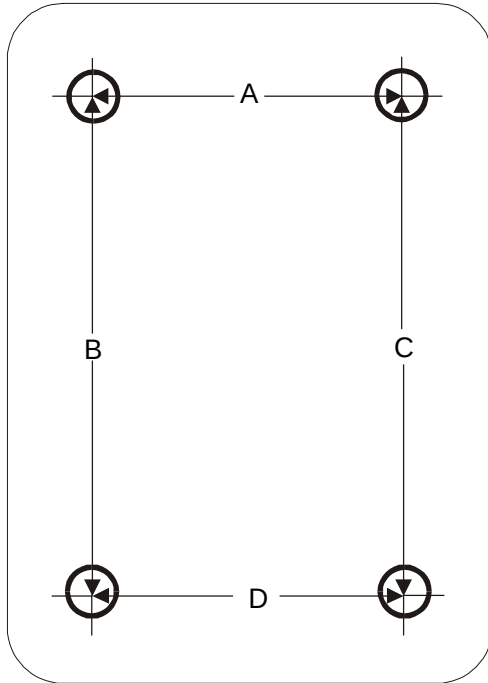

PASSENGERS SIDE

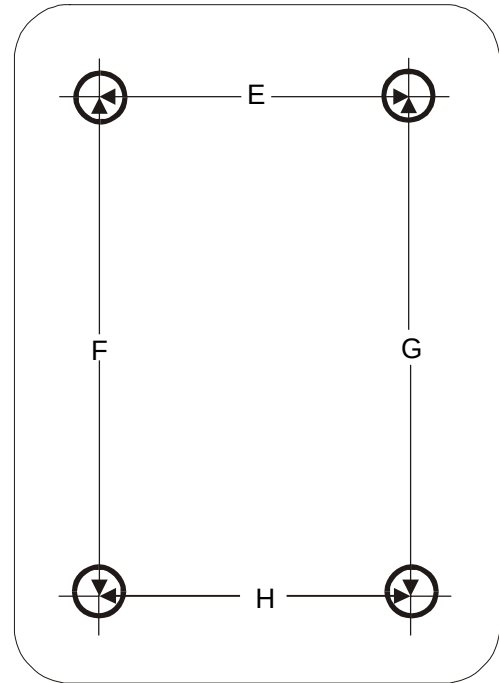

TOP VIEW THROUGH FLOOR PAN

Measurement	Pre-Test	Post-Test	Difference
A	411	409	-2
B	455	438	-17
C	493	469	-24
D	373	373	0

All units in millimeters

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

Bottom of Front Bumper

Pre-Test				Post-Test			Difference		
Index	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm
1	4643	-719	-7	N/A	N/A	N/A	N/A	N/A	N/A
2	4777	-457	-7	N/A	N/A	N/A	N/A	N/A	N/A
3	4828	-154	8	N/A	N/A	N/A	N/A	N/A	N/A
4	4827	156	8	N/A	N/A	N/A	N/A	N/A	N/A
5	4778	458	-7	N/A	N/A	N/A	N/A	N/A	N/A
6	4648	718	-7	N/A	N/A	N/A	N/A	N/A	N/A

Top of Front Bumper

Pre-Test				Post-Test			Difference		
Index	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm
1	4613	-718	-148	N/A	N/A	N/A	N/A	N/A	N/A
2	4749	-457	-120	N/A	N/A	N/A	N/A	N/A	N/A
3	4798	-154	-113	N/A	N/A	N/A	N/A	N/A	N/A
4	4797	155	-117	N/A	N/A	N/A	N/A	N/A	N/A
5	4745	457	-132	N/A	N/A	N/A	N/A	N/A	N/A
6	4615	720	-149	N/A	N/A	N/A	N/A	N/A	N/A

Center of Grill

Pre-Test				Post-Test			Difference		
Index	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm
1	4558	-720	-202	N/A	N/A	N/A	N/A	N/A	N/A
2	4700	-456	-202	N/A	N/A	N/A	N/A	N/A	N/A
3	4721	-117	-202	N/A	N/A	N/A	N/A	N/A	N/A
4	4723	118	-201	N/A	N/A	N/A	N/A	N/A	N/A
5	4704	458	-201	N/A	N/A	N/A	N/A	N/A	N/A
6	4562	718	-201	4560	642	-209	-2	-76	-8

Front of Hood


Pre-Test				Post-Test			Difference		
Index	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm	X, mm	Y, mm	Z, mm
1	4392	-718	-379	4132	-729	-437	-260	-11	-58
2	4635	-457	-280	4088	-424	-264	-547	33	16
3	4678	-155	-271	4257	-186	-265	-421	-31	6
4	4677	155	-273	4448	45	-296	-229	-110	-23
5	4636	458	-282	4585	307	-371	-51	-151	-89
6	4393	719	-382	4394	604	-447	1	-115	-65

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

TOE PAN FLOORBOARD INTRUSION

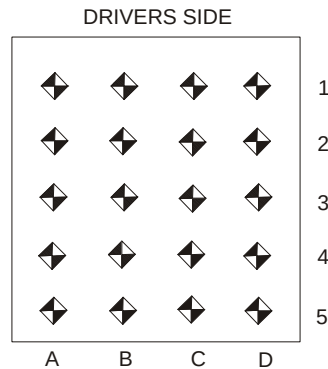

Driver Side Toe Pan and Floorboard Measurements

Intrusion Location	Pre-Test (mm)			Post-Test (mm)			Difference (mm)		
	X	Y	Z	X	Y	Z	X	Y	Z
A1	3463	-604	61	3422	-588	45	-41	16	-16
B1	3493	-469	79	3444	-452	62	-49	17	-17
C1	3506	-328	68	3438	-316	40	-68	12	-28
D1	3495	-212	40	3443	-196	30	-52	16	-10
A2	3386	-609	120	3351	-596	113	-35	13	-7
B2	3426	-468	133	3388	-457	127	-38	11	-6
C2	3433	-334	126	3379	-324	113	-54	10	-13
D2	3424	-210	136	3392	-202	139	-32	8	3
A3	3317	-612	178	3297	-605	185	-20	7	7
B3	3332	-463	179	3299	-456	186	-33	7	7
C3	3342	-324	180	3311	-319	194	-31	5	14
D3	3354	-201	178	3329	-196	194	-25	5	16
A4	3110	-616	194	3107	-616	204	-3	0	10
B4	3107	-478	181	3102	-477	197	-5	1	16
C4	3104	-334	196	3101	-332	208	-3	2	12
D4	3122	-205	192	3121	-204	190	-1	1	-2
A5	2862	-607	181	2859	-606	179	-3	1	-2
B5	2861	-492	181	2859	-491	185	-2	1	4
C5	2863	-353	181	2861	-351	182	-2	2	1
D5	2861	-234	180	2860	-233	176	-1	1	-4
BP	3352	-372	-15	3310	-377	-40	-42	-5	-25
LB	3075	-532	-284	3074	-530	-285	-1	2	-1
RB	3056	-231	-284	3056	-230	-287	0	1	-3
SW	2824	-382	-434	2843	-373	-454	19	9	-20
AB	2802	-610	83	2802	-607	81	0	3	-2

BP=Brake Pedal, LB=Left side of bolster, RB=Right side of bolster, SW=Steering wheel center, AB=Front outboard seat anchor bolt.

Procedure for measuring interior points is located in Appendix E.

DATA SHEET NO. 14 (continued)
VEHICLE MEASUREMENTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

BUMPER BEAM MEASUREMENTS

Index	PRE-TEST			POST-TEST			CHANGE		
	X	Y	Z	X	Y	Z	X	Y	Z
1	4685	-605	-49	4185	-597	-5	-500	8	44
2	4719	-485	-50	4228	-480	0	-491	5	50
3	4734	-358	-50	4254	-355	3	-480	3	53
4	4744	-230	-50	4274	-231	5	-470	-1	55
5	4750	-105	-49	4355	-158	-7	-395	-53	42
6	4751	-0	-50	4422	-79	-17	-329	-79	33
7	4749	100	-50	4485	-1	-26	-264	-101	24
8	4743	230	-50	4562	103	-37	-181	-127	13
9	4732	358	-49	4635	208	-48	-97	-150	1
10	4717	485	-50	4704	315	-62	-13	-170	-12
11	4684	605	-49	4754	428	-78	70	-177	-29


All units in millimeters

DATA SHEET NO. 15
CAMERA POSITIONS FOR FRONTAL IMPACTS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

NOTE: Camera information shown in DATA SHEET NO. 15.

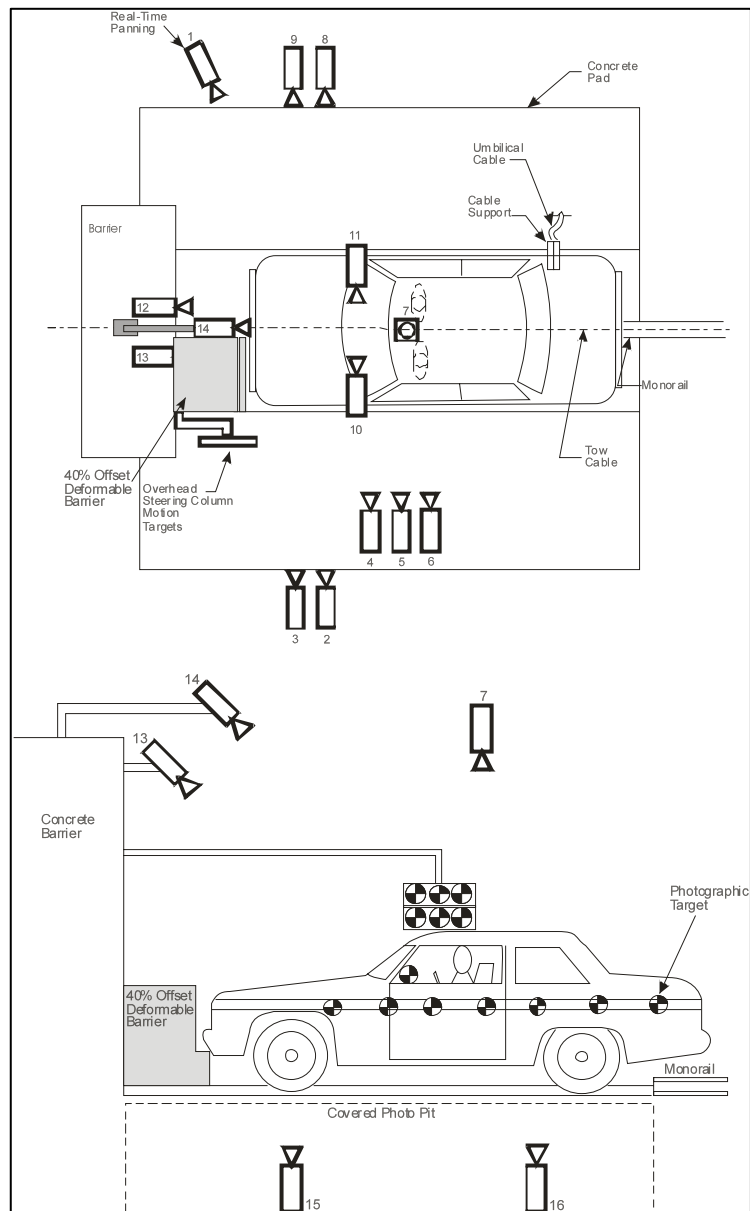

DATA SHEET NO. 15 (continued)
HIGH-SPEED CAMERA LOCATIONS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

CAMERA NO.	VIEW	CAMERA POSITIONS (mm)*			ANGLE (deg)**	FILM PLANE TO HEAD TARGET (mm)	LENS (mm)	SPEED (fps)
		X	Y	Z				
1	Real-Time Camera	---	---	---	---	---	Zoom	30
2	Overall Left Side	1630	6550	1260	4.7	6250	12.5	1000
3	Left Side View	700	4640	690	1.9	4770	25	1000
4	Driver View	2000	8300	1280	1.4	7960	50	1000
5	Steering Column Top	2580	7560	2130	8.3	7100	50	1000
6	Steering Column Bottom	2850	7060	1340	1.6	6630	50	1000
7	Top View	910	0	5660	90.0	N/A	12.5	1000
8	Overall Right Side	2100	6150	1100	2.6	6520	12.5	1000
9	Right Side View	670	7650	980	1.7	8330	25	1000
10	Left Driver Foot View	2750	80	760	34.8	630	6.5	1000
11	Right Driver Foot View	2400	450	270	6.8	1010	6.5	1000
12	Driver Front Angled View	1500	580	2180	20.6	4600	35	1000
13	Driver Front View	1500	7400	2180	20.6	4500	25	1000
14	Windshield View	1500	0	2180	20.6	4500	12.5	1000
15	Pit View of Engine	980	0	3280	90.0	N/A	25	1000
16	Pit View of Fuel Tank	2450	0	3280	90.0	N/A	12.5	1000

*X = film plane to impact location

Y = film plane to monorail centerline


Z = film plane to ground

**Angle = referenced to horizontal plane

DATA SHEET NO. 16
VEHICLE REFERENCE PHOTO TARGET LOCATIONS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

A	400
B	630
C	610
D	319
E	1655
F	3433
G	915
H	915
I	1970
J	5010
K	2882
L	2225
M	1665
N	1960
O	930
P	905
Q	2200
R	2890
S	5010

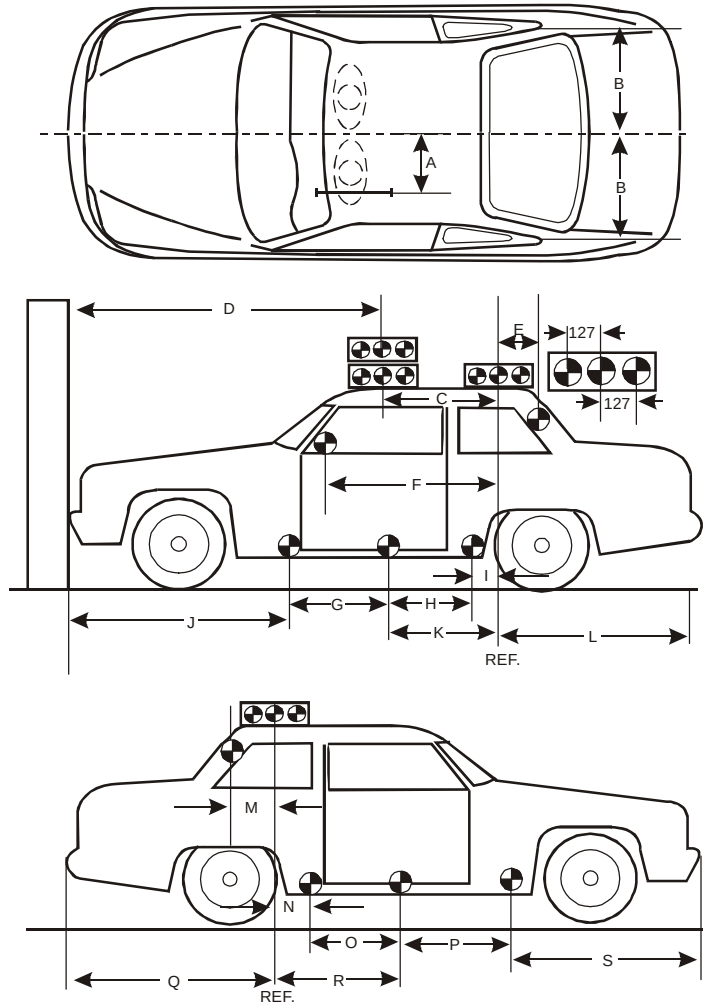

All measurements in millimeters

The relative target spacing for targets placed on top of the hood and roof top of the vehicle is 300 mm.

DATA SHEET NO. 17
POST TEST AIR BAG DATA


Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
NHTSA Test No.: R65607 Test Date: 06/30/06

NHTSA No.: R65607 Test Date: 06/30/06 Technician: William Millis

Vehicle Model Year/Make/Model: 2006/Mitsubishi/Galant DE

- A. No. of vent holes: 2 -Driver -Passenger
- B. Size of vent holes: (mm²) -Driver -Passenger
- C. Total vent area: (mm²) 628 -Driver -Passenger
- D. Deflated air bag length and width dimensions or, if round, diameter. (mm)
- Driver: -Length; -Width; 580 -Diameter
- Passenger: -Height; -Width; -Depth
- E. Is the air bag tethered?
- Driver: -Yes; -No; If yes, record length of tether (mm)-
- Passenger: -Yes; -No; If yes, record length of tether (mm)-

Sketch the air bag showing the location of the vent holes, how the bag is tethered, and where the bag is tethered. Also describe how the tethers are attached to the bag and the steering wheel.

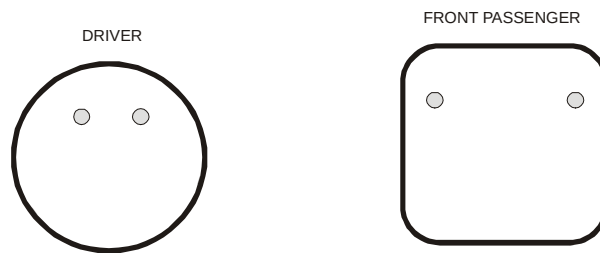

(Note: Not to scale; V_n = Vent hole_n, T_n = Tether_n).

- F. Record part numbers and manufacturer name of the air bag and gas generator.
- Driver: Not legible
- Passenger: N/A

DATA SHEET NO. 18
ACCIDENT INVESTIGATION DIVISION DATA

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

FOR FRONTAL BARRIER IMPACT

NHTSA Test No.: R65607 VIN: 4A3AB26F16E012740

Model Year: 2006 Build Date: Aug. 2005 Test Date: 06/30/06


Vehicle Size Category: Sedan Test Weight: 1645.4 kg

Vehicle Wheelbase: 2760 mm; Front Overhang: 950 mm; Overall Width: 1830 mm

Collision Deformation Classification (CDC) Code: 12FDEW3

Crush Depth Dimensions with Bumper¹

	PRE-TEST	POST-TEST	DIFFERENCE	
C1 =	4604	3932	672	mm
C2 =	4739	4149	590	mm
C3 =	4794	4189	605	mm
C4 =	4794	4379	415	mm
C5 =	4739	4557	182	mm
C6 =	4604	4653	-49	mm

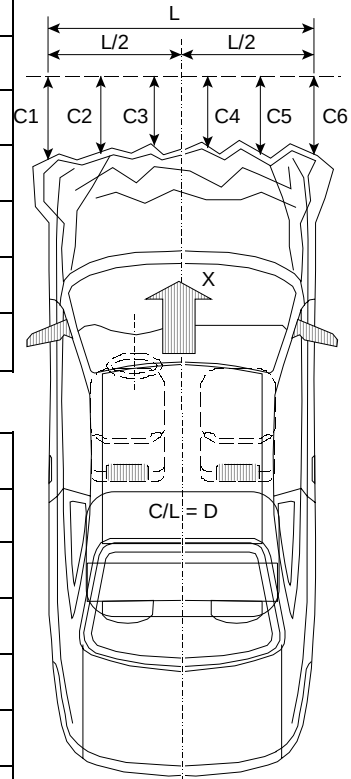

Crush Depth Dimensions without Bumper

	PRE-TEST	POST-TEST	DIFFERENCE	
C1 =	4685	4185	500	mm
C2 =	4734	4254	480	mm
C3 =	4750	4355	355	mm
C4 =	4749	4485	264	mm
C5 =	4732	4635	97	mm
C6 =	4684	4754	-70	mm

Midpoint of Damage: D = Vehicle Centerline (Longitudinal)

Length of Damaged Region L1= 1524 mm


L2= 762 mm

L3= 762 mm

¹ Measurements 1-6 are included in the NHTSA Entrée database submission as Damage Profile Distances 1-6.

DATA SHEET NO. 19
OFFSET BARRIER AND VEHICLE ORIENTATION

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

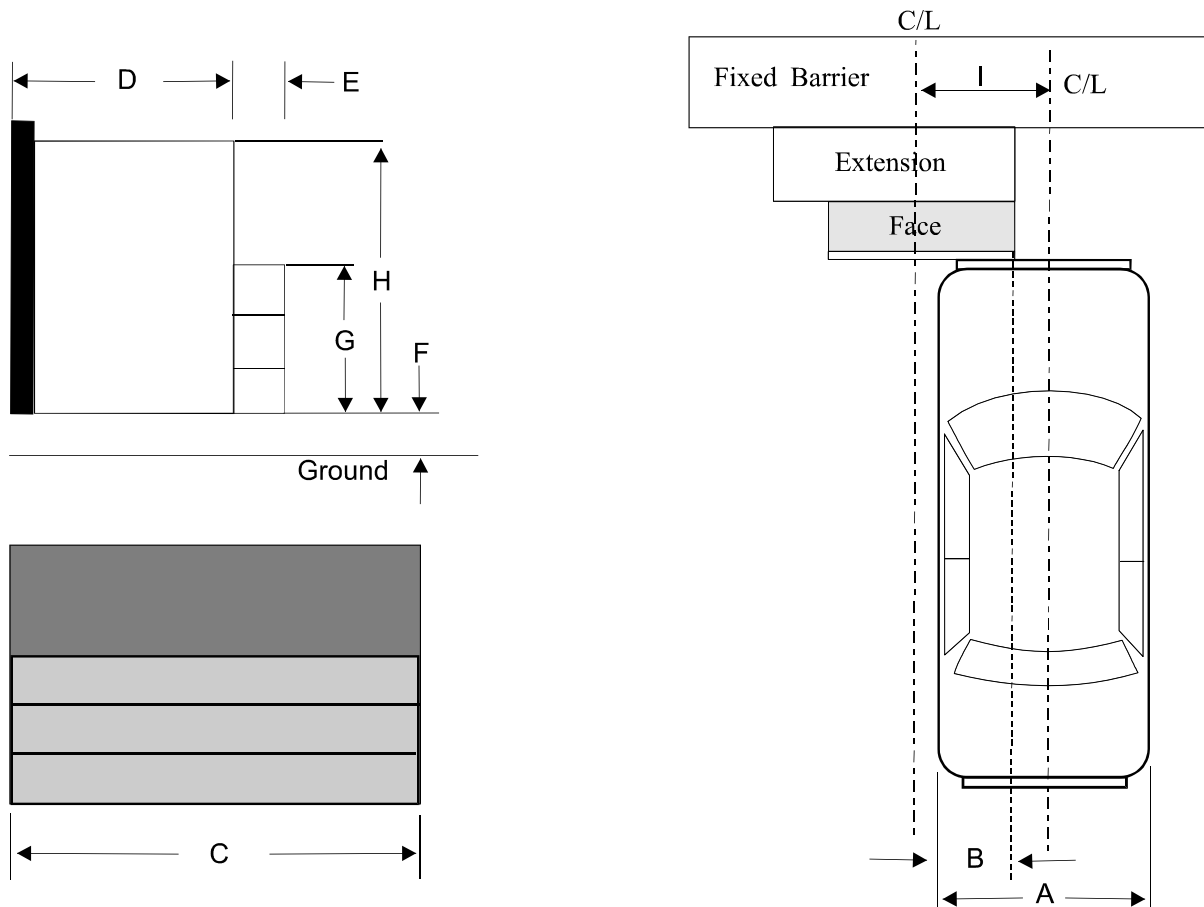


A. Total Vehicle Width	<u>1830</u>	mm
B. 40% Overlap Distance	<u>732</u>	mm
C. Deformable Face Width	<u>1000</u>	mm
D. Single Stage Honeycomb Depth	<u>450</u>	mm
E. Bumper Element Depth	<u>90</u>	mm
F. Lower Edge Height From Ground	<u>200</u>	mm
G. Bumper Element Height*	<u>330</u>	mm
H. Deformable Barrier Honeycomb Height	<u>650</u>	mm
I. Offset	<u>-683</u>	mm

* The bumper element consists of three 110 mm height blocks of 1.723 MPa honeycomb.

DATA SHEET NO. 20
DEFORMABLE BARRIER HONEYCOMB CRUSH

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan

NHTSA Test No.: R65607 Test Date: 06/30/06

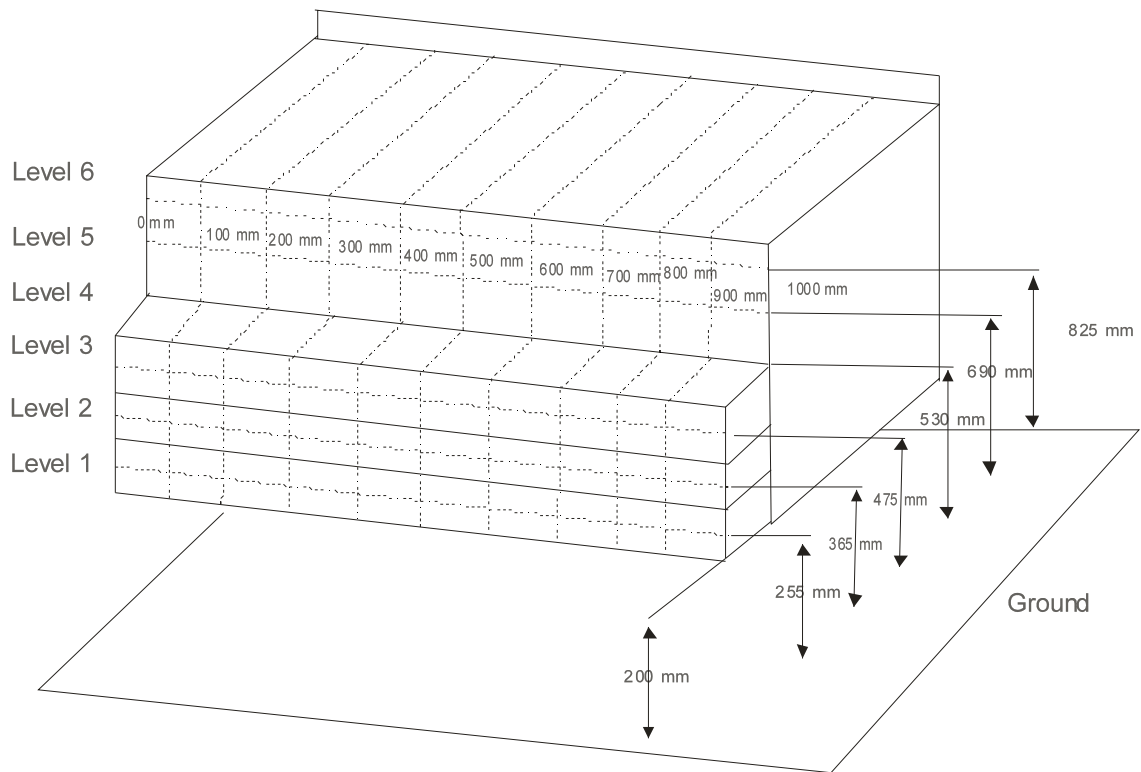

Deformable Barrier Face Profile

Pre-Test

Index	Xmm	Ymm	Zmm
1	-455.0	494.4	47.2
2	-454.4	397.9	47.6
3	-454.0	297.7	47.3
4	-453.8	198.0	46.9
5	-453.5	98.1	46.4
6	-453.1	-2.3	46.5
7	-452.9	-102.1	46.0
8	-452.7	-202.1	45.8
9	-452.6	-302.0	45.8
10	-452.5	-401.8	45.4
11	-452.2	-497.3	44.9
12	-455.0	493.7	-86.7
13	-455.0	398.9	-87.6
14	-454.7	298.8	-88.0
15	-454.5	198.6	-88.1
16	-454.2	98.2	-89.0
17	-454.0	-1.8	-88.9
18	-453.8	-101.4	-88.7
19	-453.6	-201.3	-89.0
20	-453.4	-302.0	-89.5
21	-453.0	-402.0	-89.8
22	-452.4	-496.8	-90.0

Post-Test

Index	Xmm	Ymm	Zmm
1	-459.9	444.7	-63.0
2	-415.9	338.1	-66.7
3	-407.8	239.1	-57.8
4	-391.8	142.0	-67.7
5	-398.5	50.8	-57.1
6	-377.1	-39.4	-50.4
7	-338.2	-125.1	-33.3
8	-307.6	-214.1	-36.5
9	-282.2	-293.7	-46.0
10	-285.6	-376.3	-98.6
11	-247.9	-459.3	-122.8
12	-456.9	479.3	-190.4
13	-458.2	388.3	-217.0
14	N/A	N/A	N/A
15	-397.9	154.6	-163.9
16	-385.1	58.1	-176.7
17	-330.2	-18.2	-161.2
18	-264.3	-89.0	-139.8
19	-214.8	-178.7	-103.2
20	-175.6	-265.4	-111.0
21	-200.1	-322.8	-184.6
22	-177.7	-396.6	-197.8

Difference

Index	Xmm	Ymm	Zmm
1	4.9	49.7	110.2
2	-38.5	59.8	114.3
3	-46.2	58.6	105.1
4	-62.0	56.0	114.6
5	-55.0	47.3	103.5
6	-76.0	37.1	96.9
7	-114.7	23.0	79.3
8	-145.1	12.0	82.3
9	-170.4	-8.3	91.8
10	-166.9	-25.5	144.0
11	-204.3	-38.0	167.7
12	1.9	14.4	103.7
13	3.2	10.6	129.4
14	N/A	N/A	N/A
15	-56.6	44.0	75.8
16	-69.1	40.1	87.7
17	-123.8	16.4	72.3
18	-189.5	-12.4	51.1
19	-238.8	-22.6	14.2
20	-277.8	-36.6	21.5
21	-252.9	-79.2	94.8
22	-274.7	-100.2	107.8

Deformable Barrier Face Profile Cont'd.

Pre-Test

Index	Xmm	Ymm	Zmm
23	-455.5	494.9	-227.2
24	-455.7	400.0	-228.0
25	-455.0	299.2	-228.2
26	-454.8	199.0	-228.6
27	-454.5	99.0	-228.8
28	-454.3	-1.3	-229.2
29	-454.1	-100.9	-229.6
30	-454.1	-201.6	-230.4
31	-453.9	-301.7	-230.5
32	-453.3	-401.5	-230.5
33	-452.4	-496.0	-230.6
34	-546.6	492.9	-301.5
35	-546.7	397.2	-302.6
36	-547.0	297.1	-303.3
37	-546.3	197.7	-303.5
38	-545.9	97.5	-303.7
39	-545.6	-2.6	-304.4
40	-545.5	-102.3	-304.4
41	-545.1	-202.2	-304.8
42	-545.0	-302.7	-305.2
43	-544.6	-402.0	-305.5
44	-543.6	-497.4	-306.5

Post-Test

Index	Xmm	Ymm	Zmm
23	-442.7	516.7	-327.9
24	-425.8	433.8	-349.5
25	-376.9	346.5	-352.7
26	-325.3	264.6	-359.0
27	-305.0	100.9	-278.7
28	-259.9	73.2	-391.7
29	-246.2	-18.4	-390.5
30	-184.3	-94.0	-406.8
31	N/A	N/A	N/A
32	N/A	N/A	N/A
33	N/A	N/A	N/A
34	-563.2	472.9	-362.2
35	-510.0	393.9	-369.3
36	-452.4	313.1	-377.7
37	-422.5	231.8	-376.2
38	-387.7	136.2	-379.8
39	-348.8	41.4	-387.7
40	-296.8	-39.2	-409.5
41	-242.4	-121.7	-422.3
42	-217.8	-216.2	-394.1
43	-205.9	-312.2	-374.3
44	-184.5	-406.1	-374.0

Difference

Index	Xmm	Ymm	Zmm
23	-12.8	-21.8	100.7
24	-29.9	-33.8	121.5
25	-78.1	-47.3	124.5
26	-129.5	-65.6	130.4
27	-149.5	-1.9	49.9
28	-194.4	-74.5	162.5
29	-207.9	-82.5	160.9
30	-269.8	-107.6	176.4
31	N/A	N/A	N/A
32	N/A	N/A	N/A
33	N/A	N/A	N/A
34	16.6	20.0	60.7
35	-36.7	3.3	66.7
36	-94.6	-16.0	74.4
37	-123.8	-34.1	72.7
38	-158.2	-38.7	76.1
39	-196.8	-44.0	83.3
40	-248.7	-63.1	105.1
41	-302.7	-80.5	117.5
42	-327.2	-86.5	88.9
43	-338.7	-89.8	68.8
44	-359.1	-91.3	67.5

Deformable Barrier Face Profile Cont'd.

Pre-Test


Index	Xmm	Ymm	Zmm
45	-547.1	494.3	-411.3
46	-546.9	398.3	-411.7
47	-546.8	298.8	-412.6
48	-546.8	199.2	-412.8
49	-546.1	98.7	-413.5
50	-545.9	-1.0	-414.0
51	-545.5	-101.2	-414.7
52	-545.3	-201.3	-414.9
53	-545.1	-301.1	-415.6
54	-544.7	-401.7	-415.7
55	-544.2	-496.6	-416.4
56	-547.2	494.2	-527.2
57	-546.9	399.2	-527.5
58	-546.8	299.4	-527.9
59	-546.4	199.7	-528.4
60	-546.2	99.3	-529.0
61	-545.7	-0.3	-529.3
62	-545.4	-100.5	-529.9
63	-545.1	-200.4	-530.4
64	-544.9	-300.2	-531.0
65	-544.4	-400.6	-531.7
66	-544.2	-496.1	-531.7


Post-Test


Index	Xmm	Ymm	Zmm
45	-557.3	507.2	-477.2
46	-530.6	414.9	-480.1
47	-501.8	320.3	-483.6
48	-481.1	230.2	-480.3
49	-458.9	131.8	-479.2
50	-434.8	35.9	-475.4
51	-401.8	-59.5	-470.8
52	-358.2	-149.8	-469.2
53	-310.0	-236.9	-476.1
54	-280.9	-332.0	-458.0
55	-244.8	-419.4	-449.3
56	-597.2	503.3	-603.9
57	-573.1	411.6	-598.7
58	-548.1	315.2	-593.5
59	-530.0	216.5	-586.0
60	-510.9	118.9	-578.8
61	-489.1	22.0	-572.5
62	-464.7	-75.2	-567.9
63	-439.6	-171.9	-563.0
64	-414.4	-267.2	-557.8
65	-390.2	-364.7	-551.5
66	-365.0	-456.0	-546.4


Difference


Index	Xmm	Ymm	Zmm
45	10.2	-12.9	65.9
46	-16.3	-16.6	68.4
47	-45.0	-21.5	71.0
48	-65.7	-31.0	67.5
49	-87.2	-33.1	65.7
50	-111.1	-36.9	61.4
51	-143.7	-41.7	56.1
52	-187.1	-51.5	54.3
53	-235.1	-64.2	60.5
54	-263.8	-69.7	42.3
55	-299.4	-77.2	32.9
56	50.0	-9.1	76.7
57	26.2	-12.4	71.2
58	1.3	-15.8	65.6
59	-16.4	-16.8	57.6
60	-35.3	-19.6	49.8
61	-56.6	-22.3	43.2
62	-80.7	-25.3	38.0
63	-105.5	-28.5	32.6
64	-130.5	-33.0	26.8
65	-154.2	-35.9	19.8
66	-179.2	-40.1	14.7

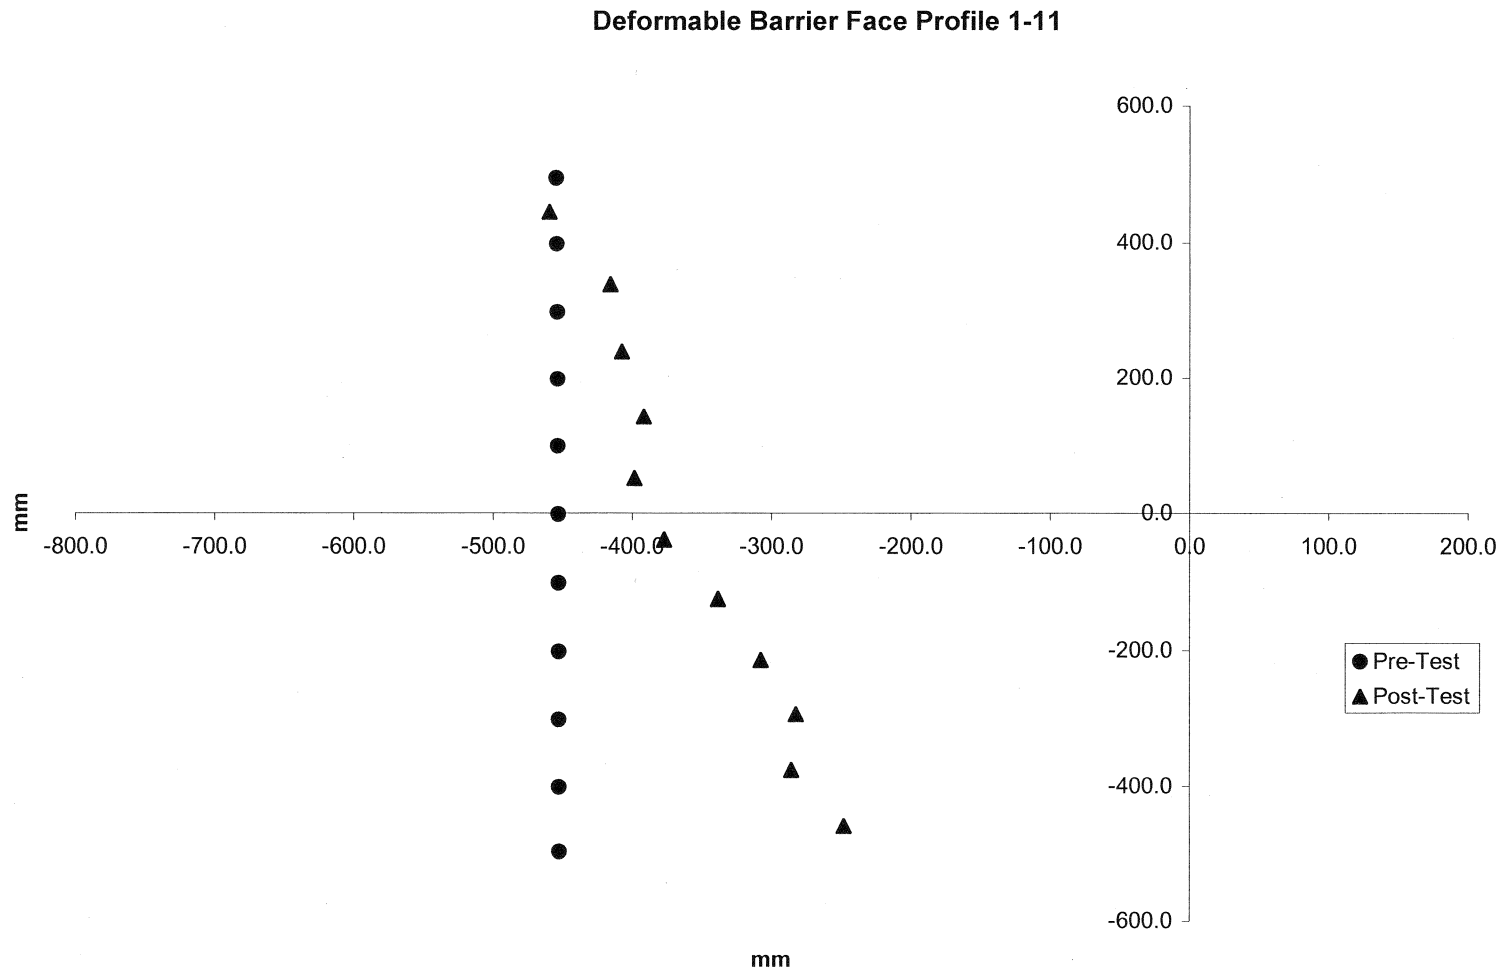


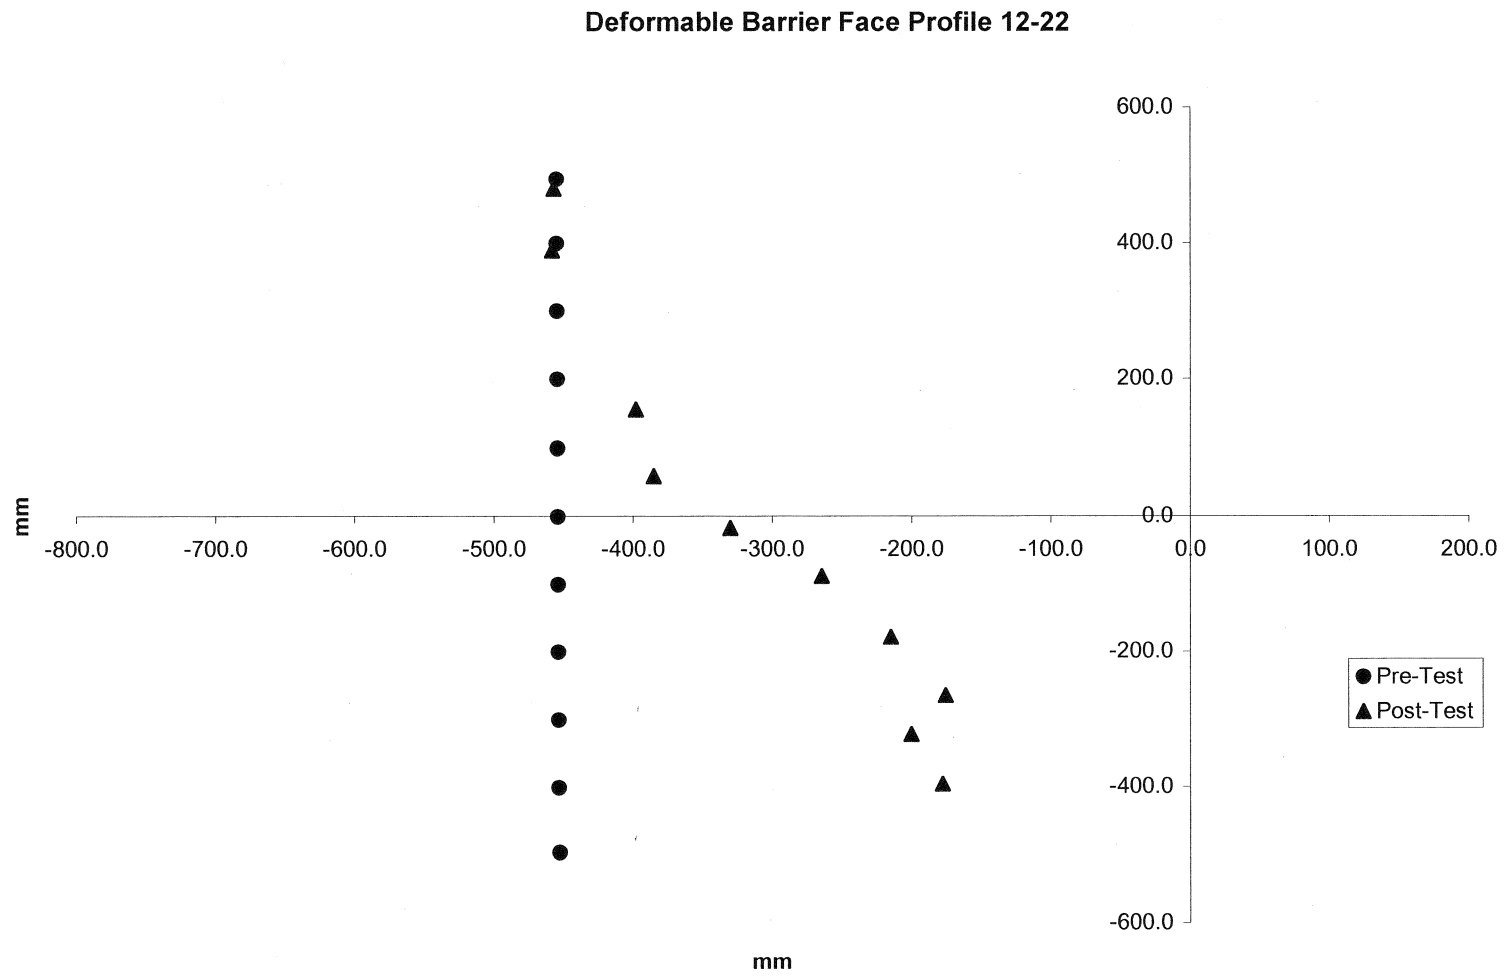

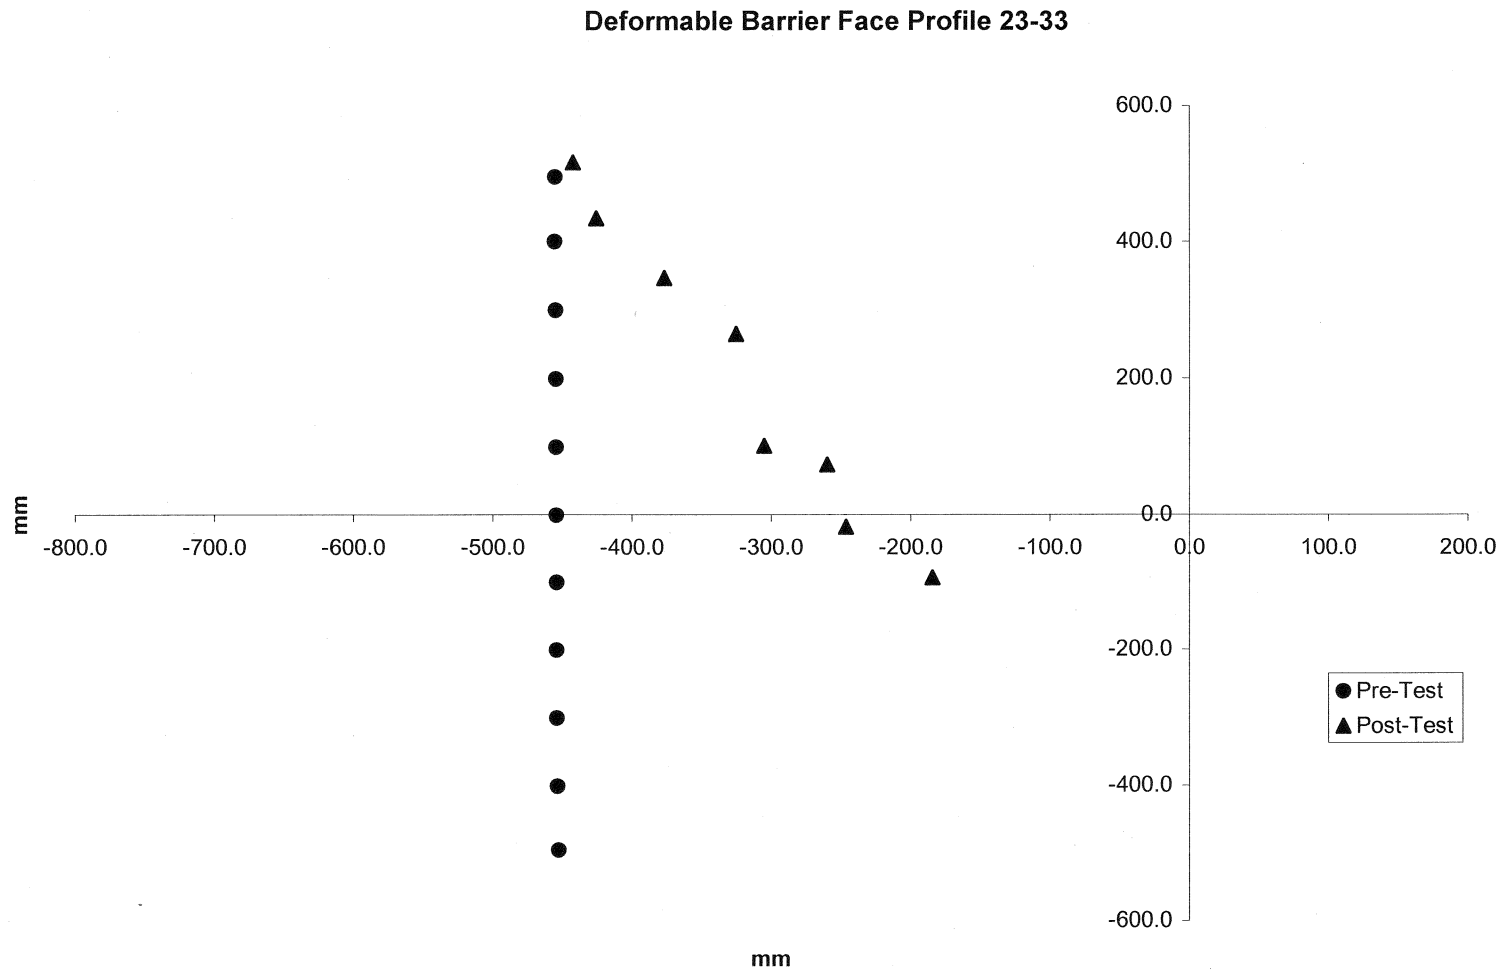

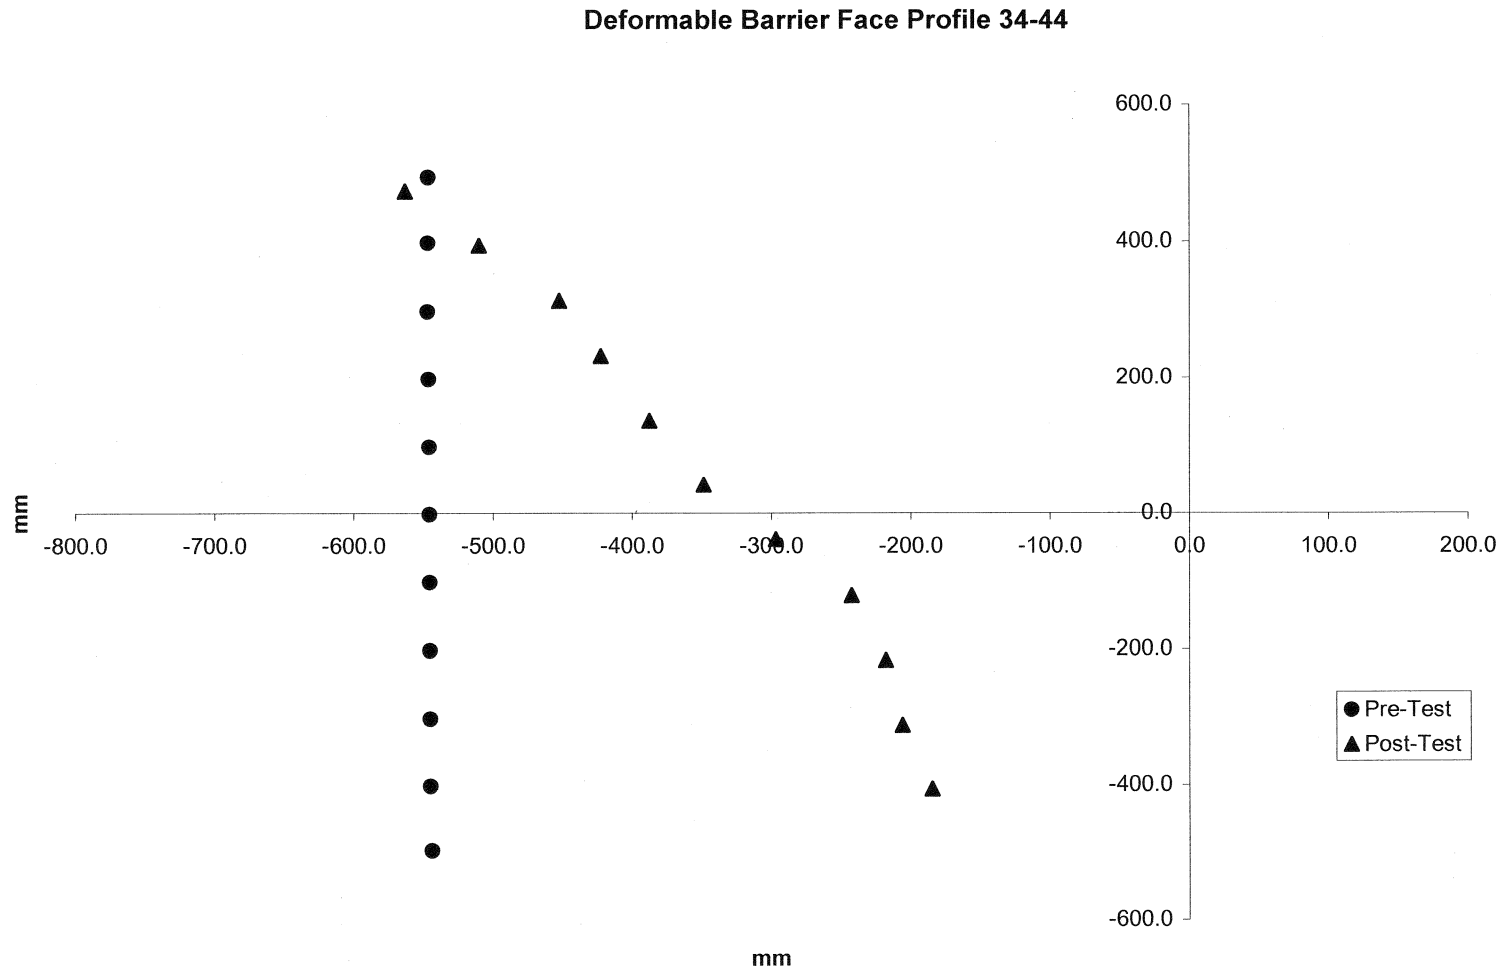


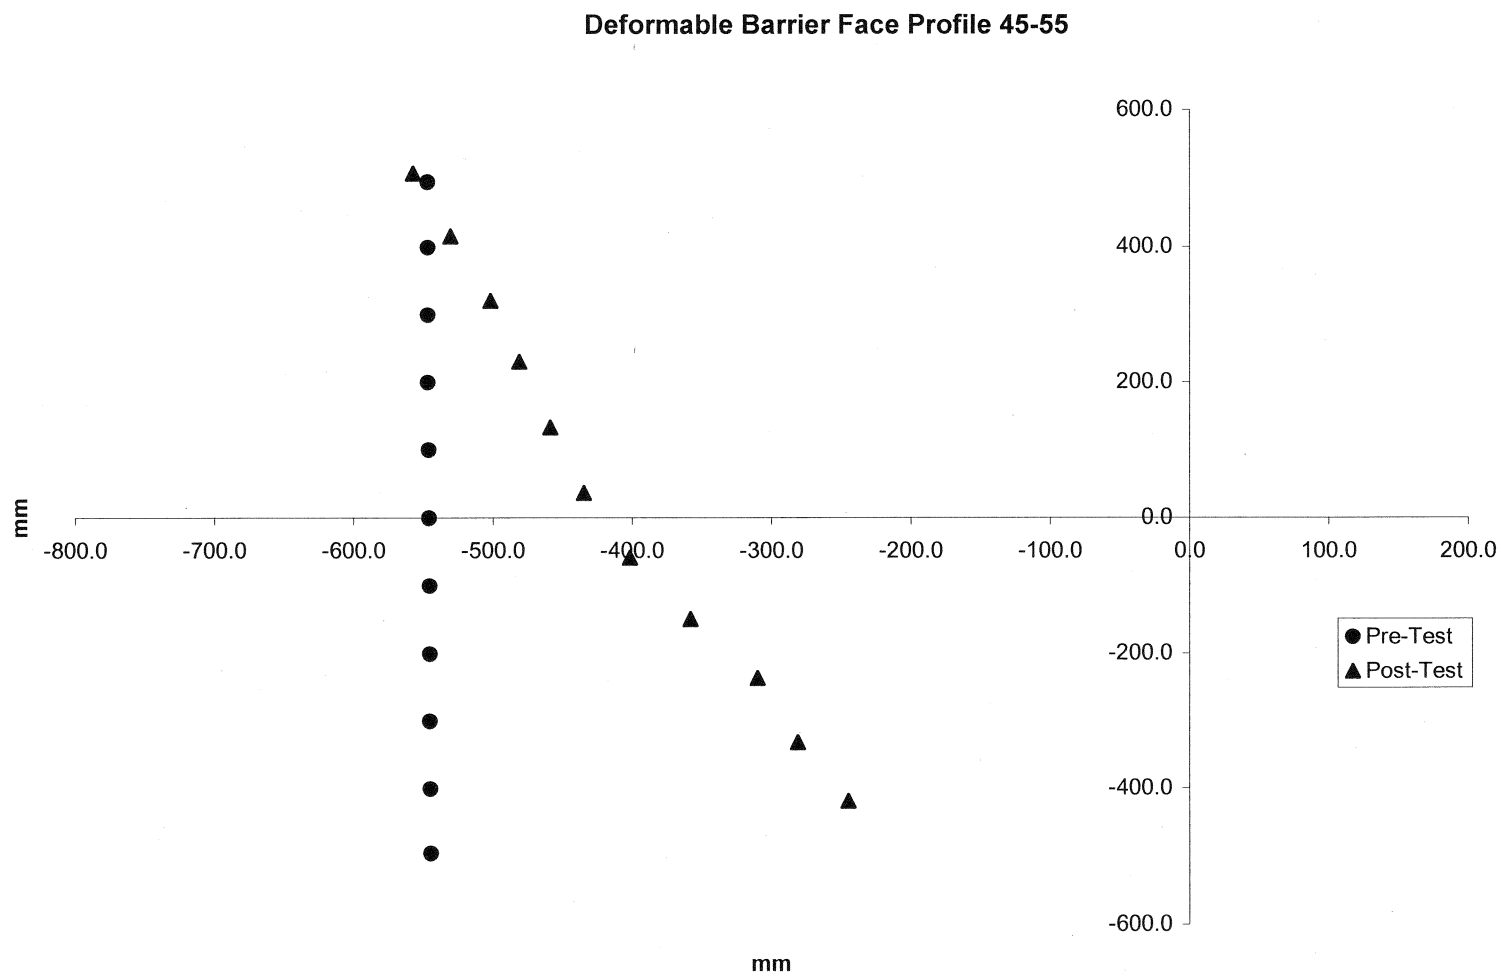

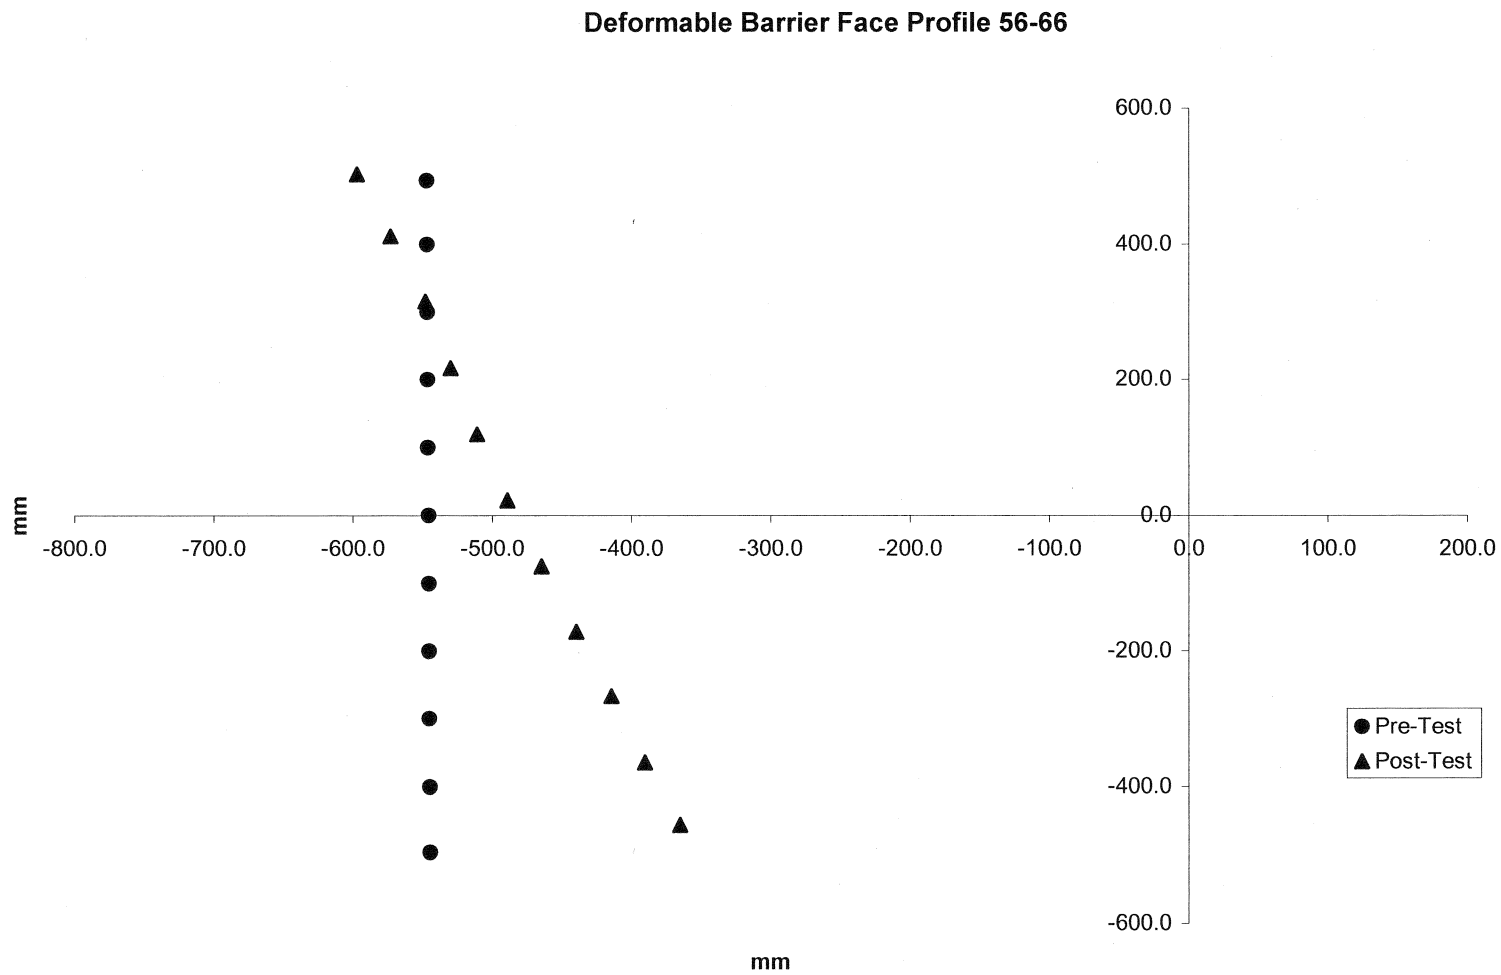

DATA SHEET NO. 21
DEFORMABLE BARRIER LOAD CELL LOCATIONS

Vehicle Year/Make/Model/Body Style: 2006/Mitsubishi/Galant DE/4-door sedan
 NHTSA Test No.: R65607 Test Date: 06/30/06

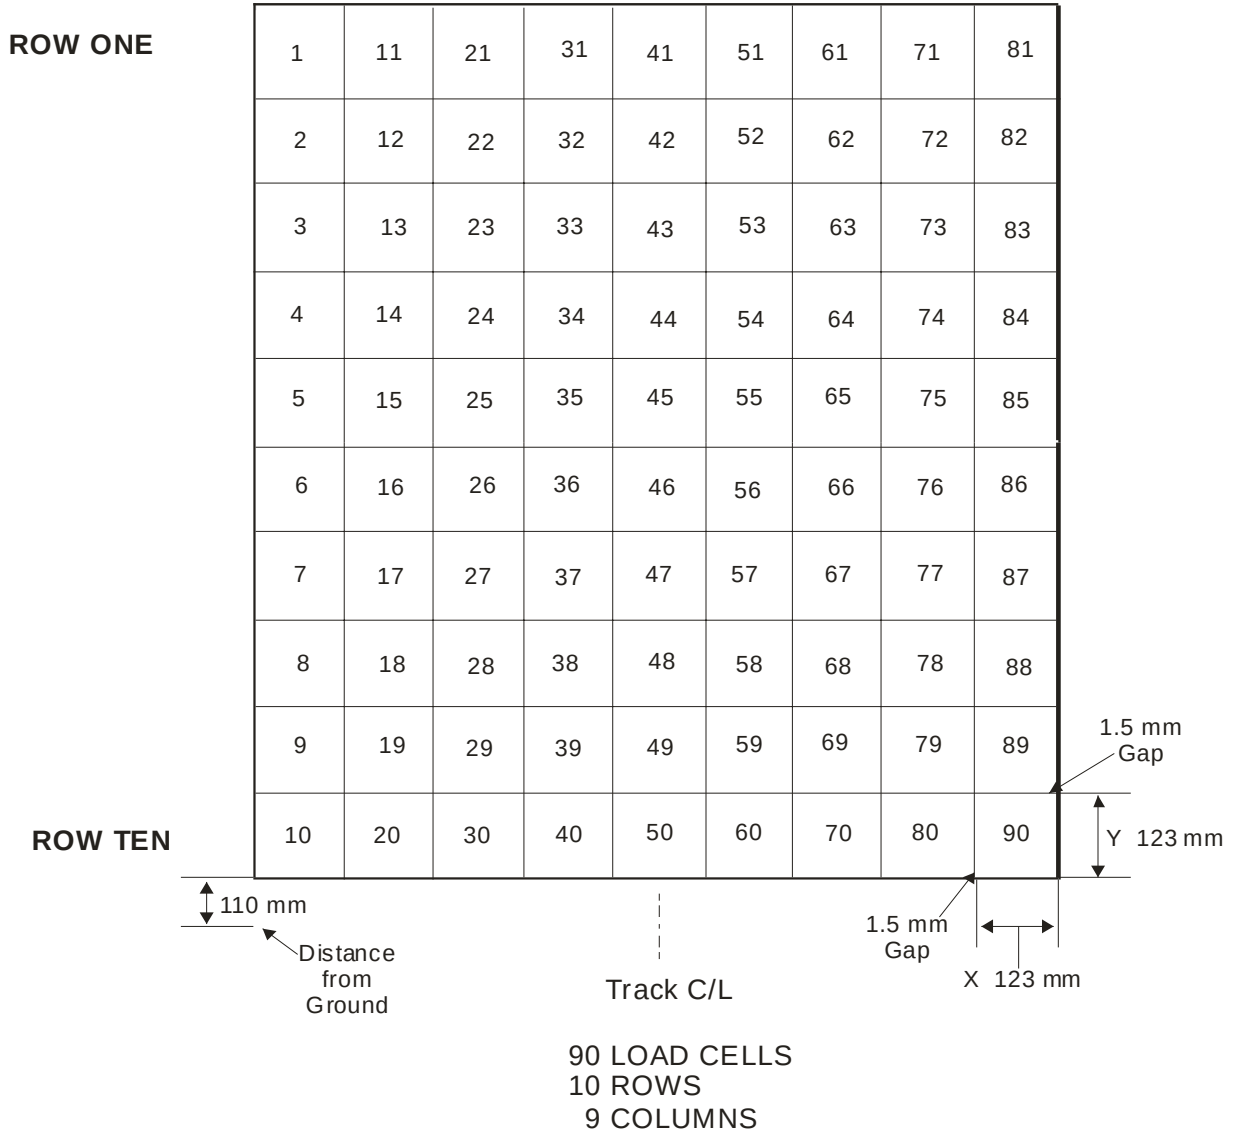

FRONT VIEW

Appendix A

Photographs

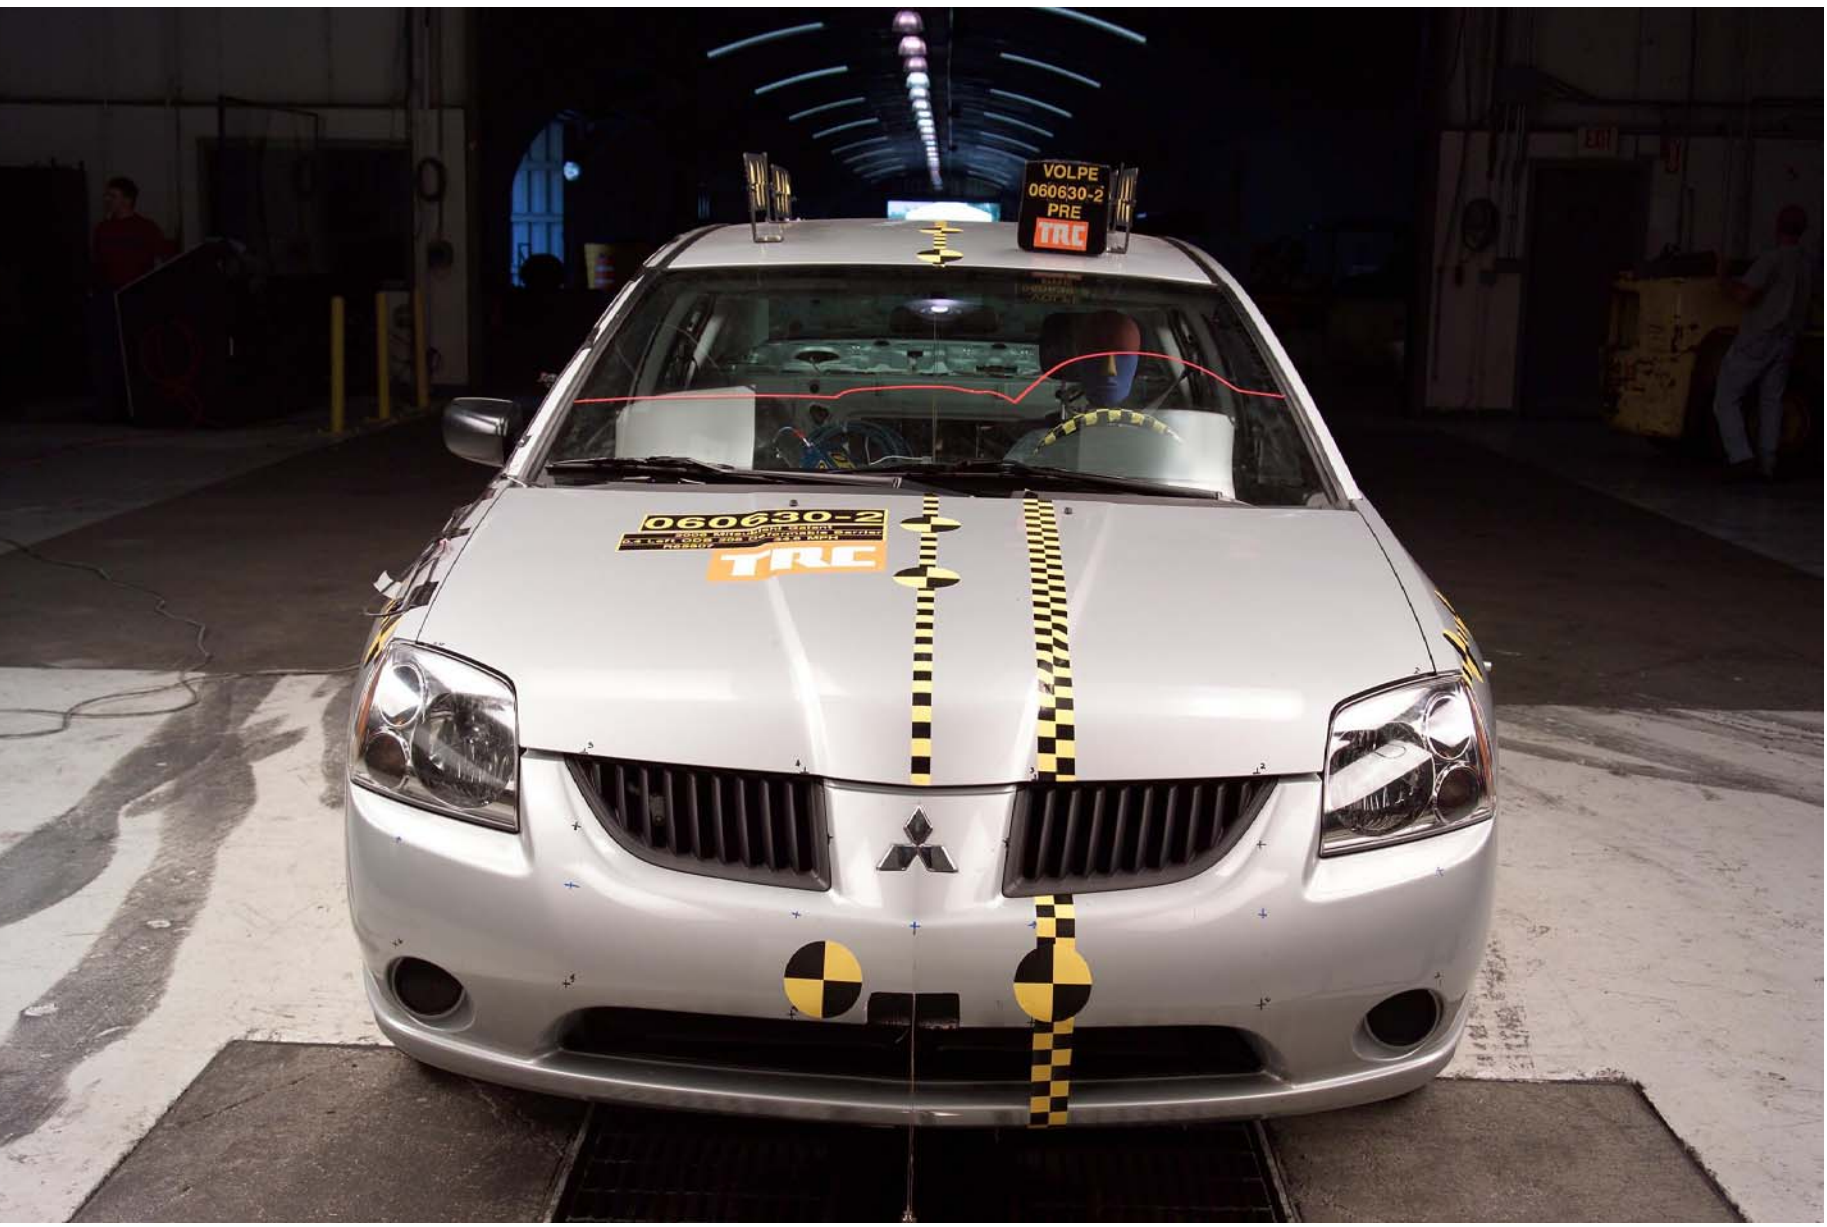


Figure A-1 Pre-Test Front View

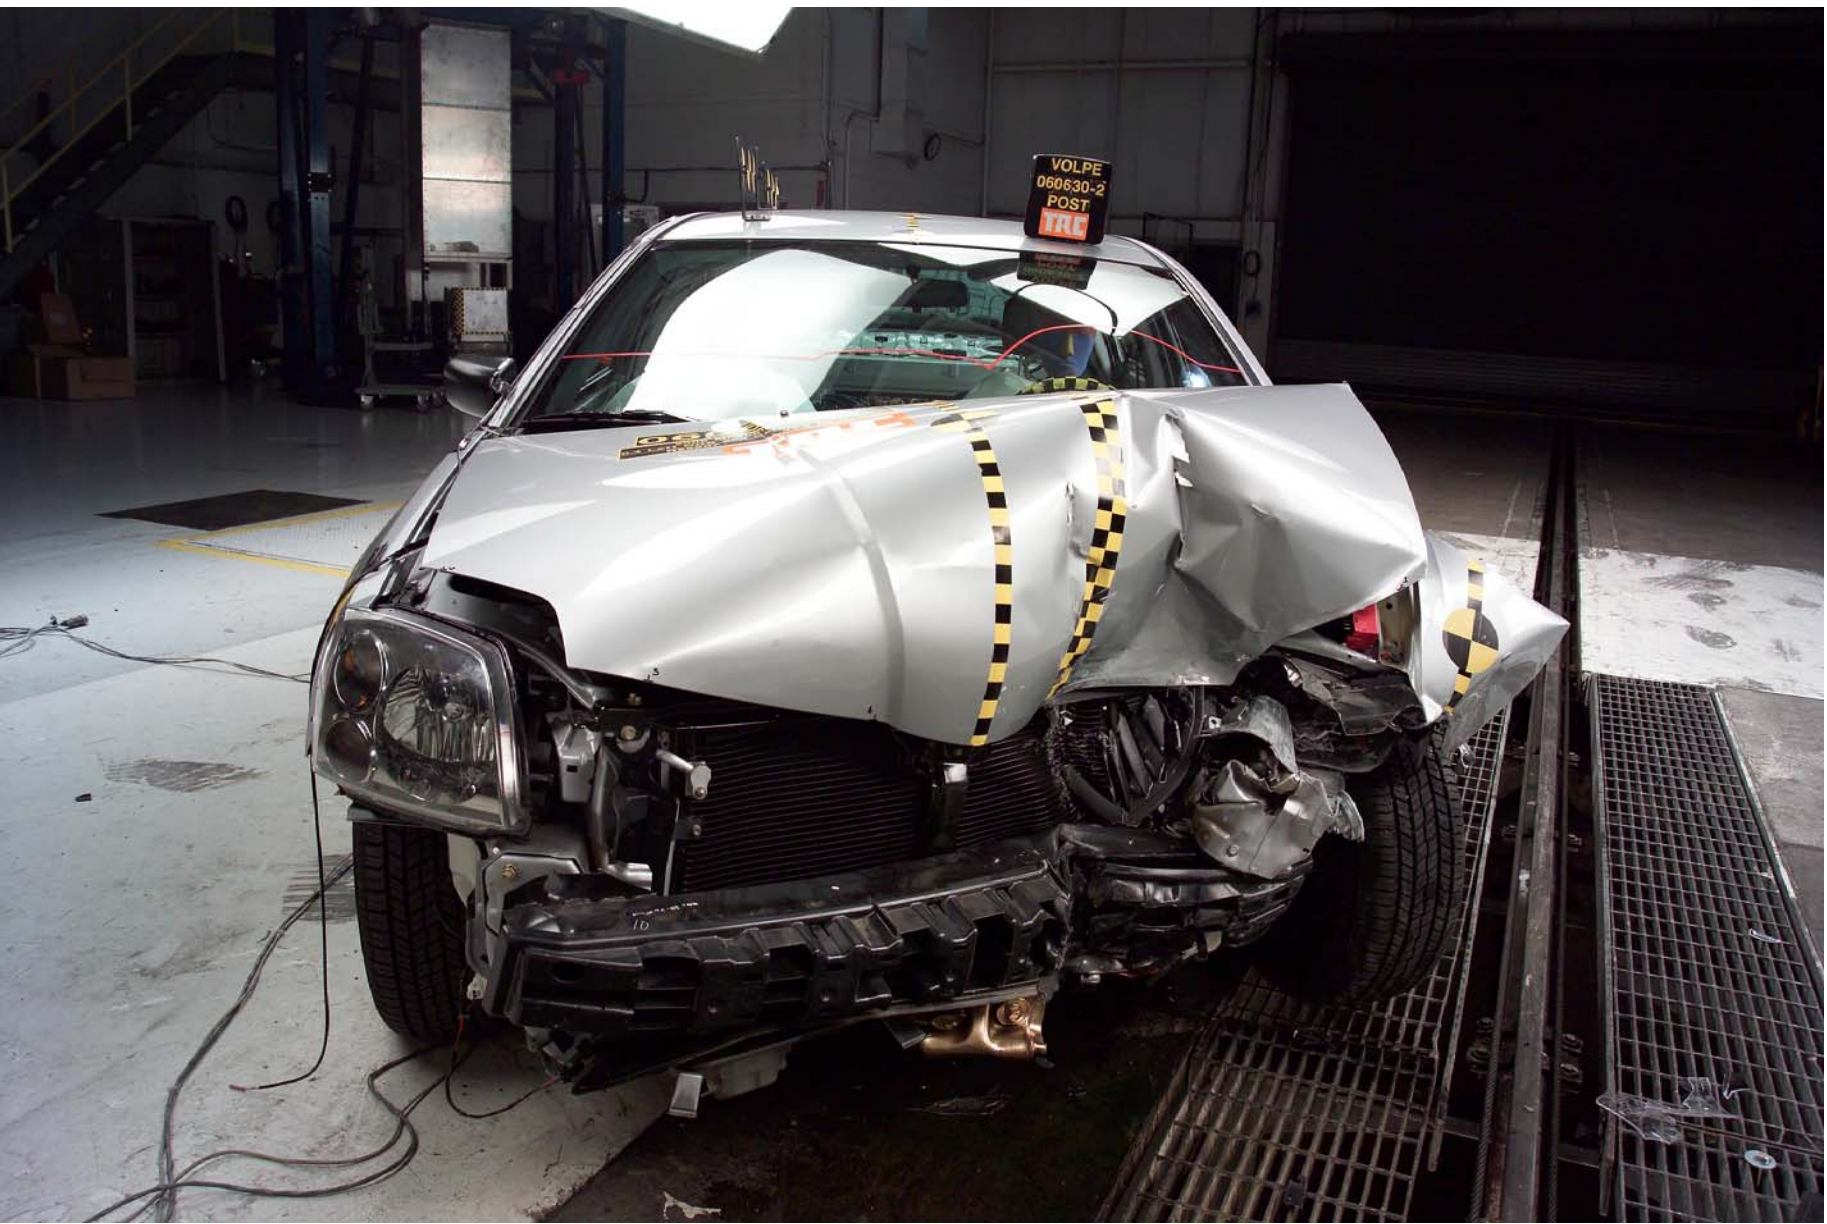


Figure A-2 Post-Test Front View



Figure A-3 Pre-Test Left Front View

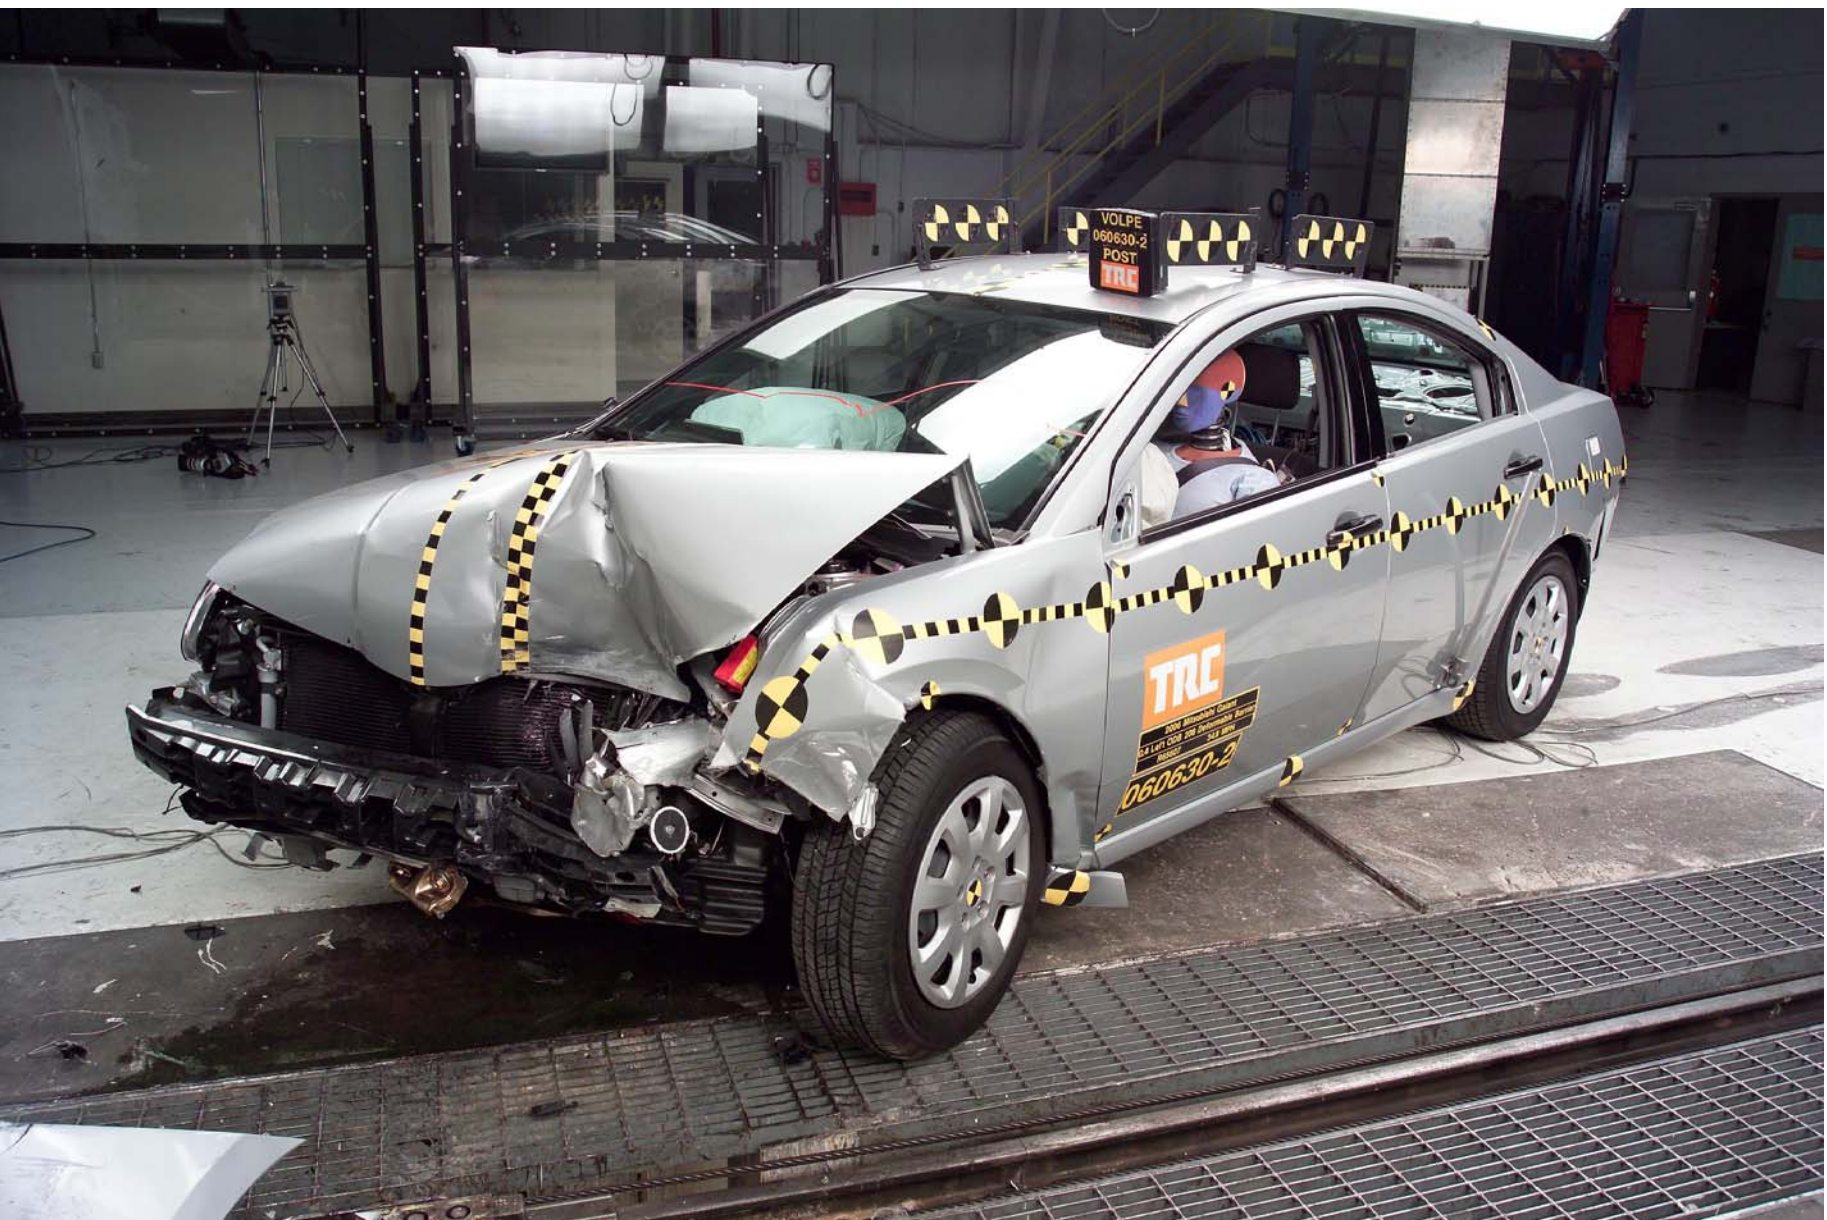


Figure A-4 Post-Test Left Front View



Figure A-5 Pre-Test Left Side View



Figure A-6 Post-Test Left Side View



Figure A-7 Pre-Test Left Rear View



Figure A-8 Post-Test Left Rear View



Figure A-9 Pre-Test Rear View

A-10

060630-2



Figure A-10 Post-Test Rear View

A-11

060630-2



Figure A-11 Pre-Test Right Rear View



Figure A-12 Post-Test Right Rear View

A-13

060630-2



Figure A-13 Pre-Test Right Side View



Figure A-14 Post-Test Right Side View

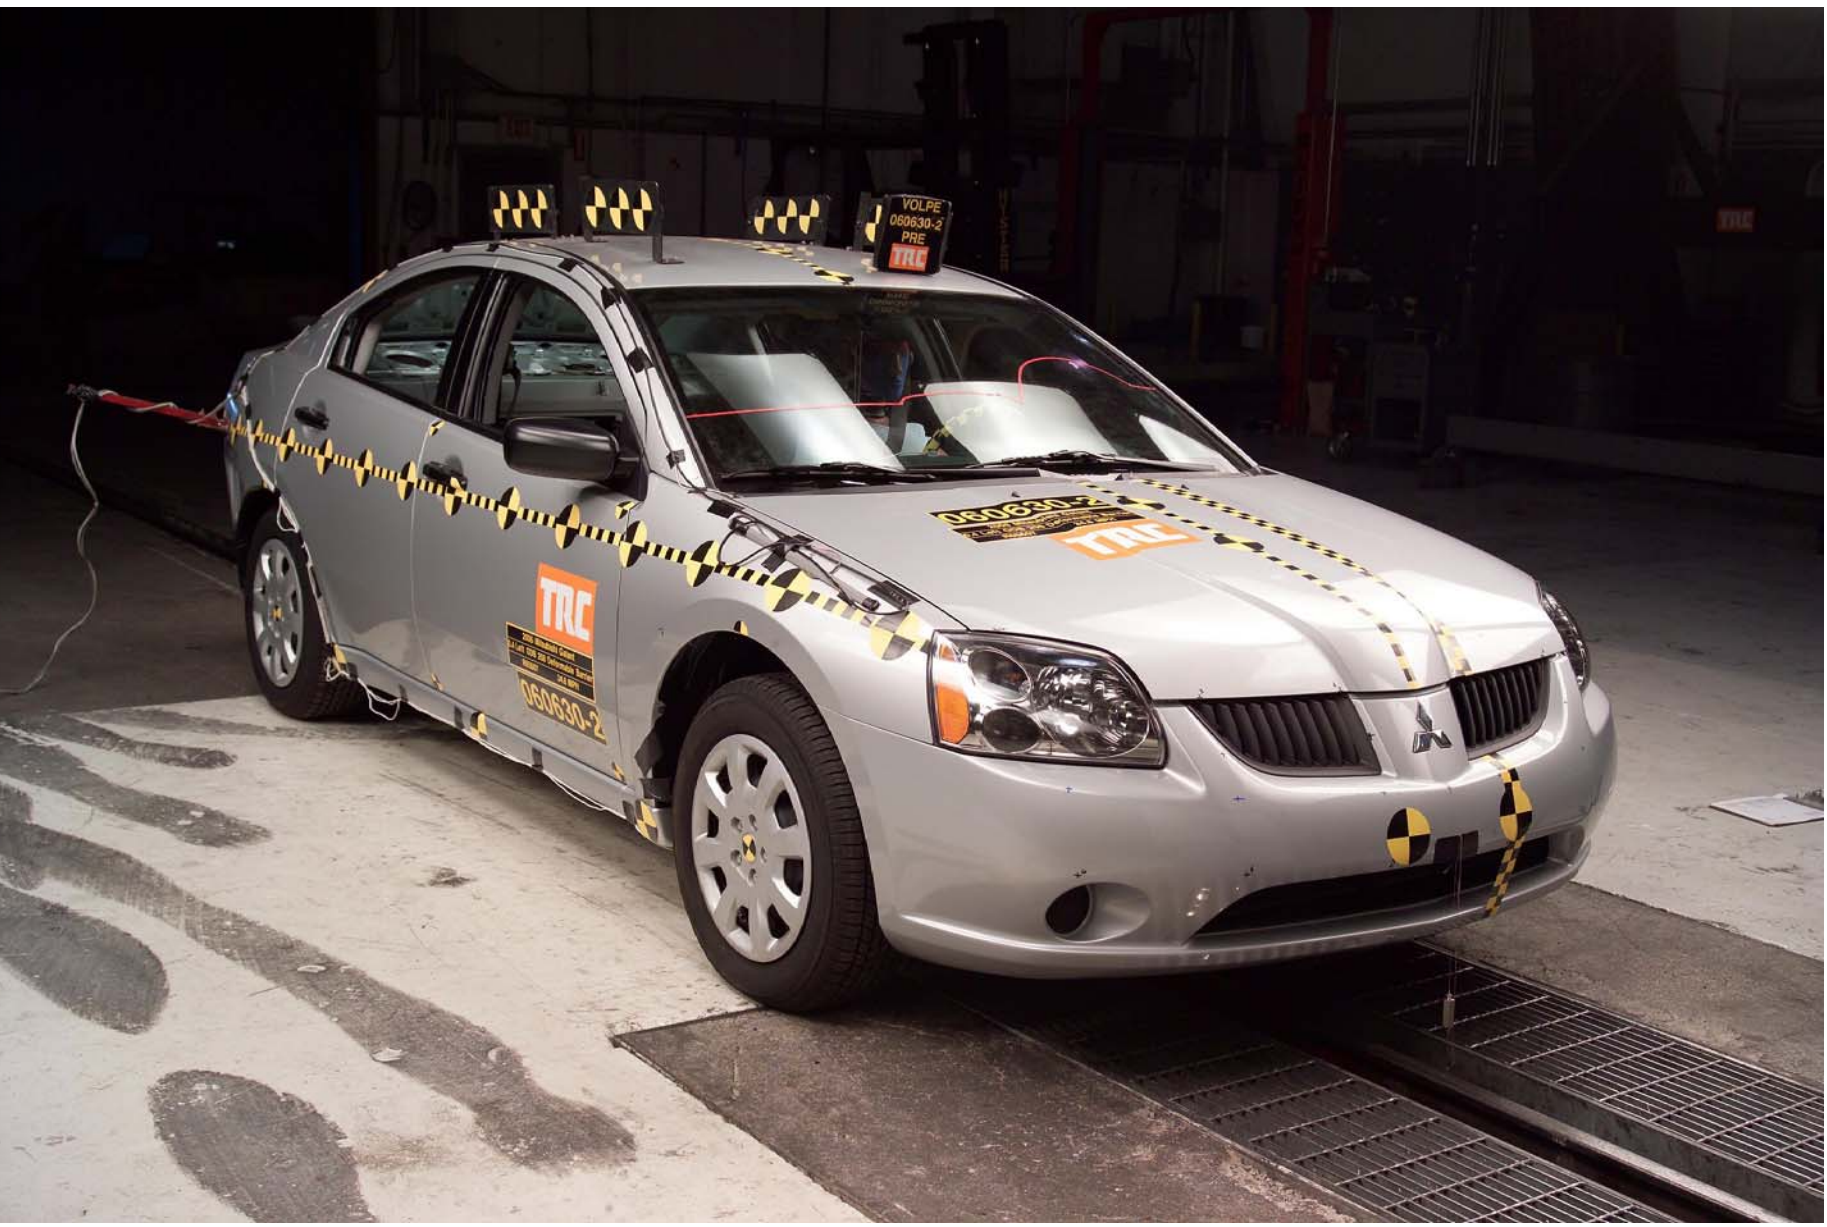


Figure A-15 Pre-Test Right Front View



Figure A-16 Post-Test Right Front View

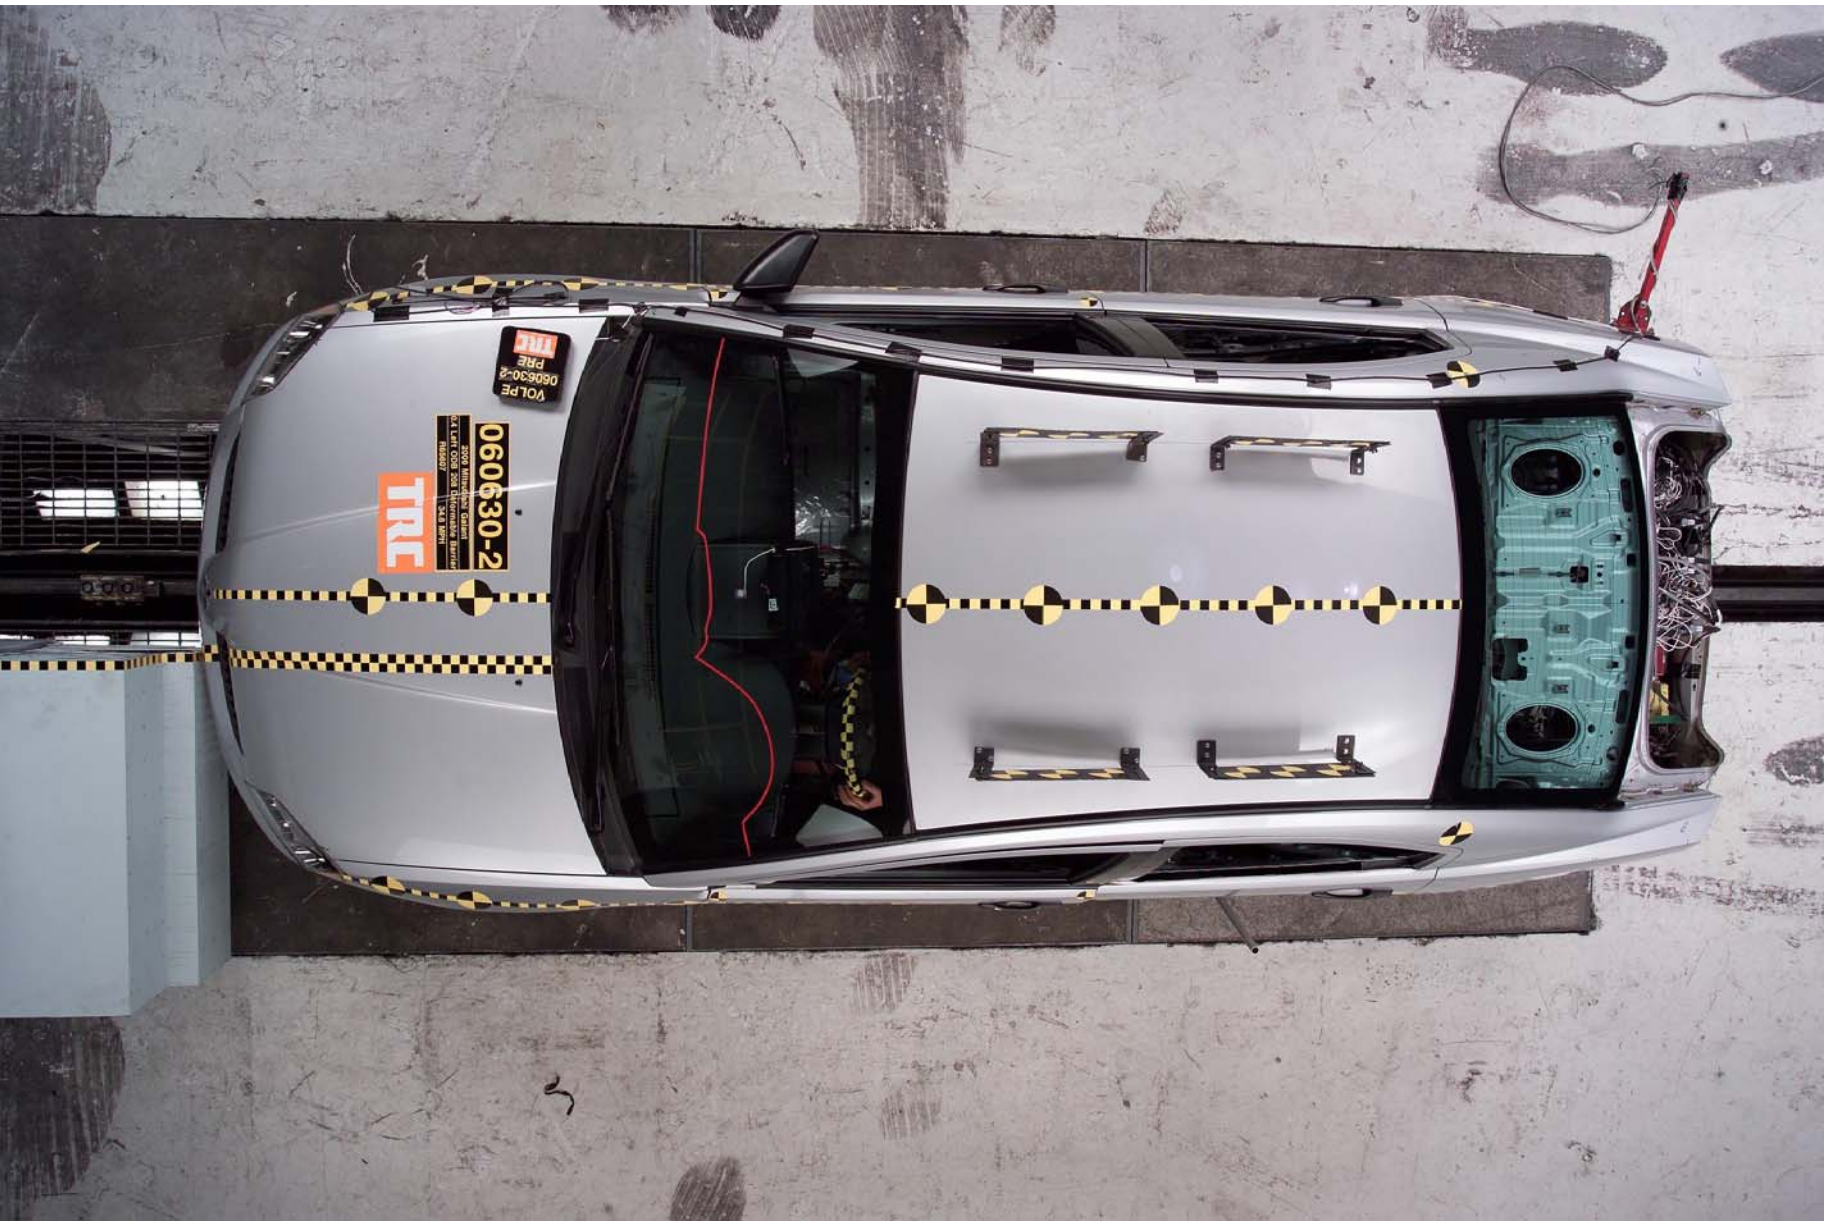


Figure A-17 Pre-Test Overhead View

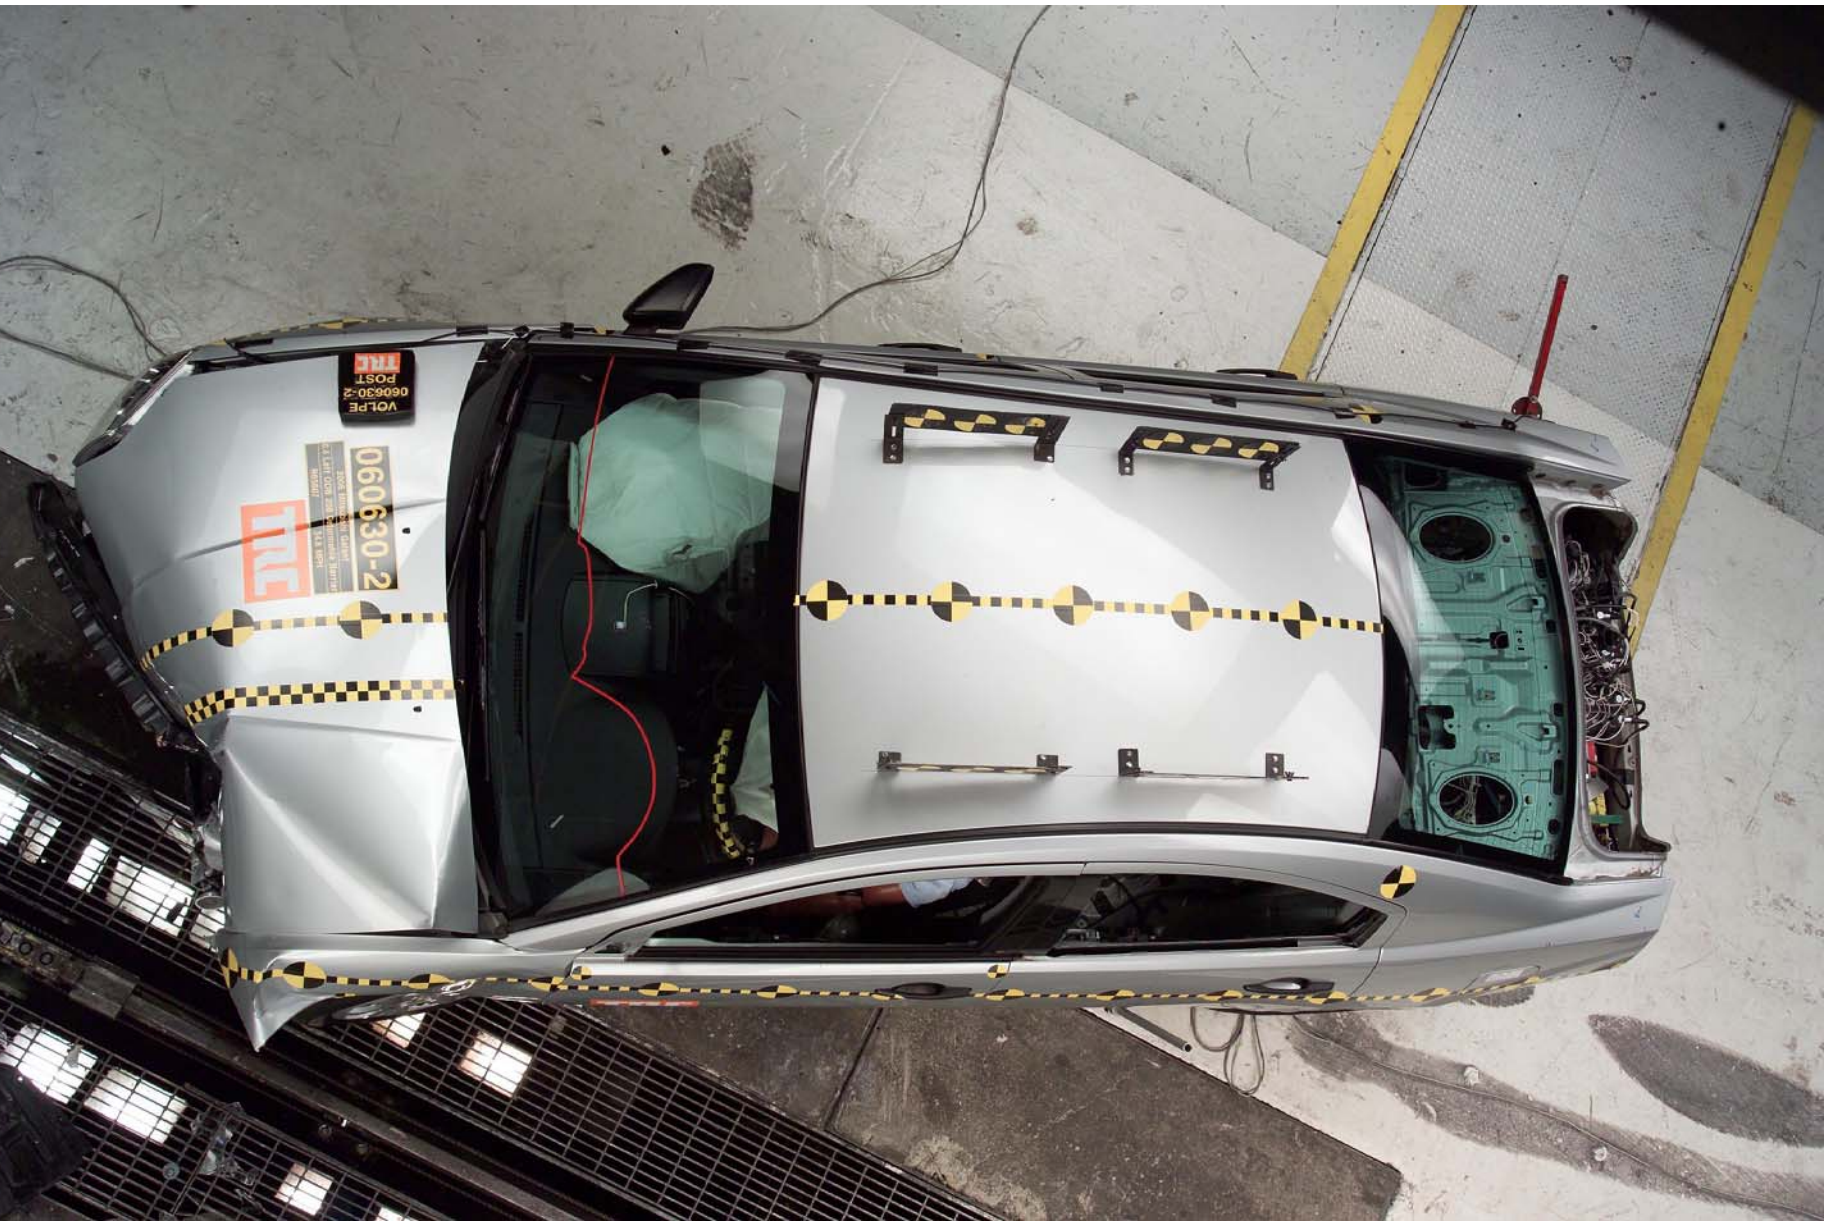


Figure A-18 Post-Test Overhead View

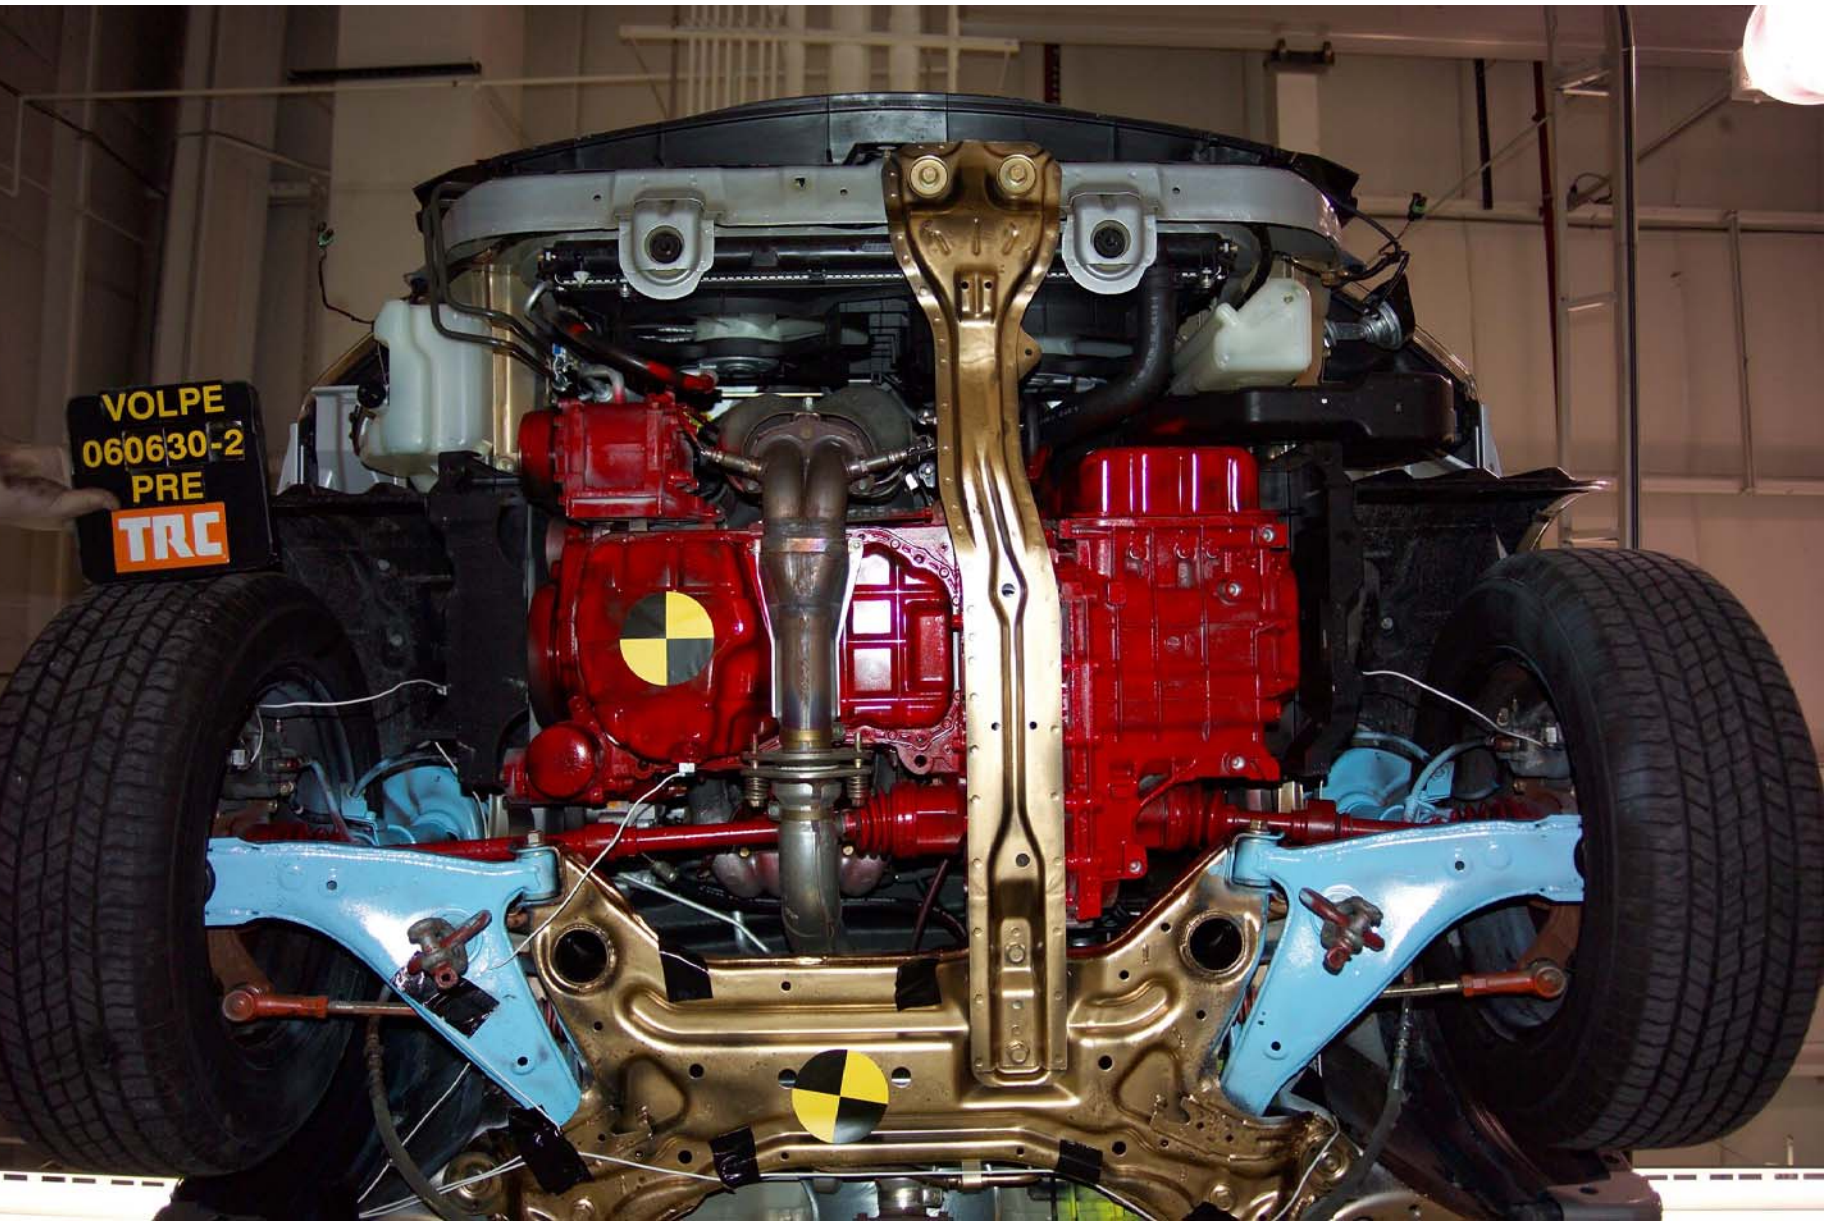


Figure A-19 Pre-Test Front Underbody View

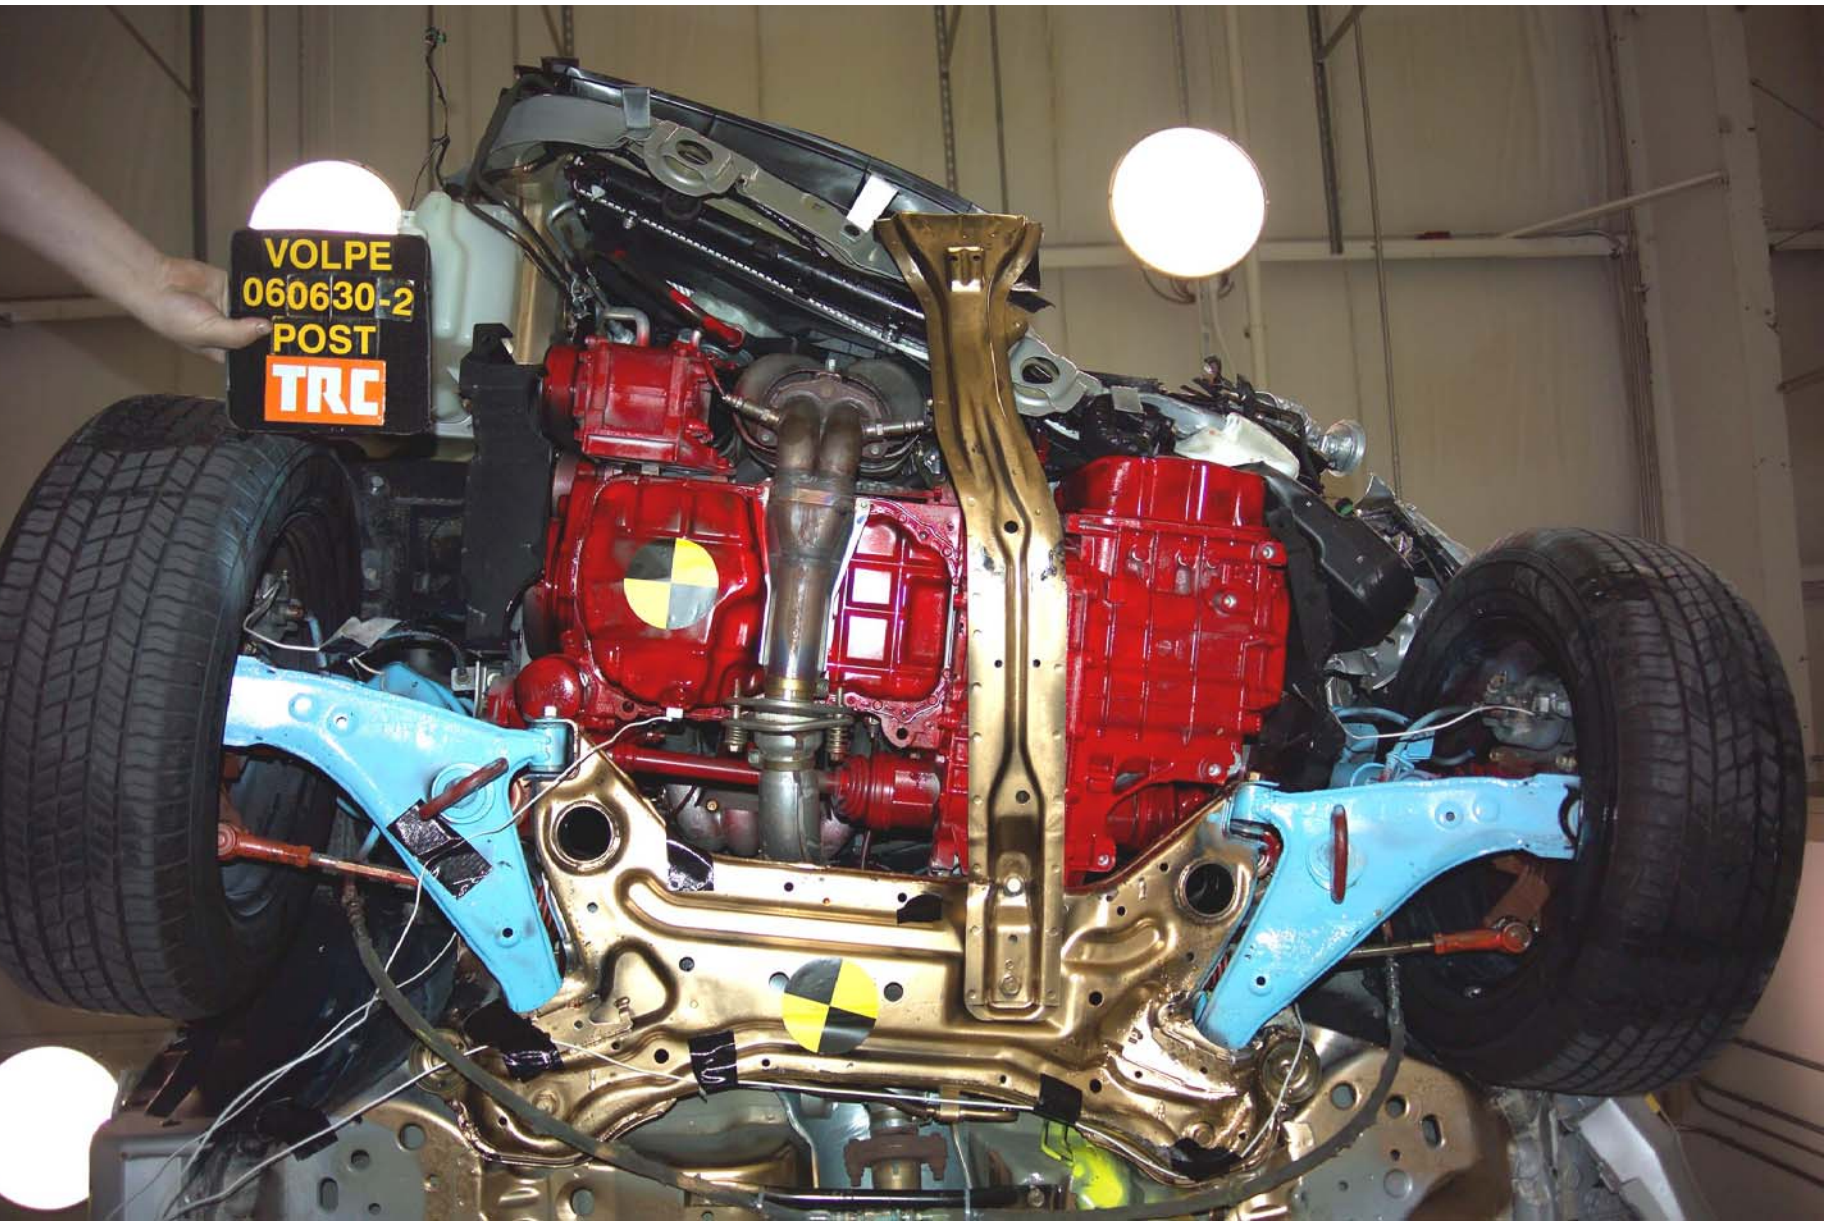


Figure A-20 Post-Test Front Underbody View

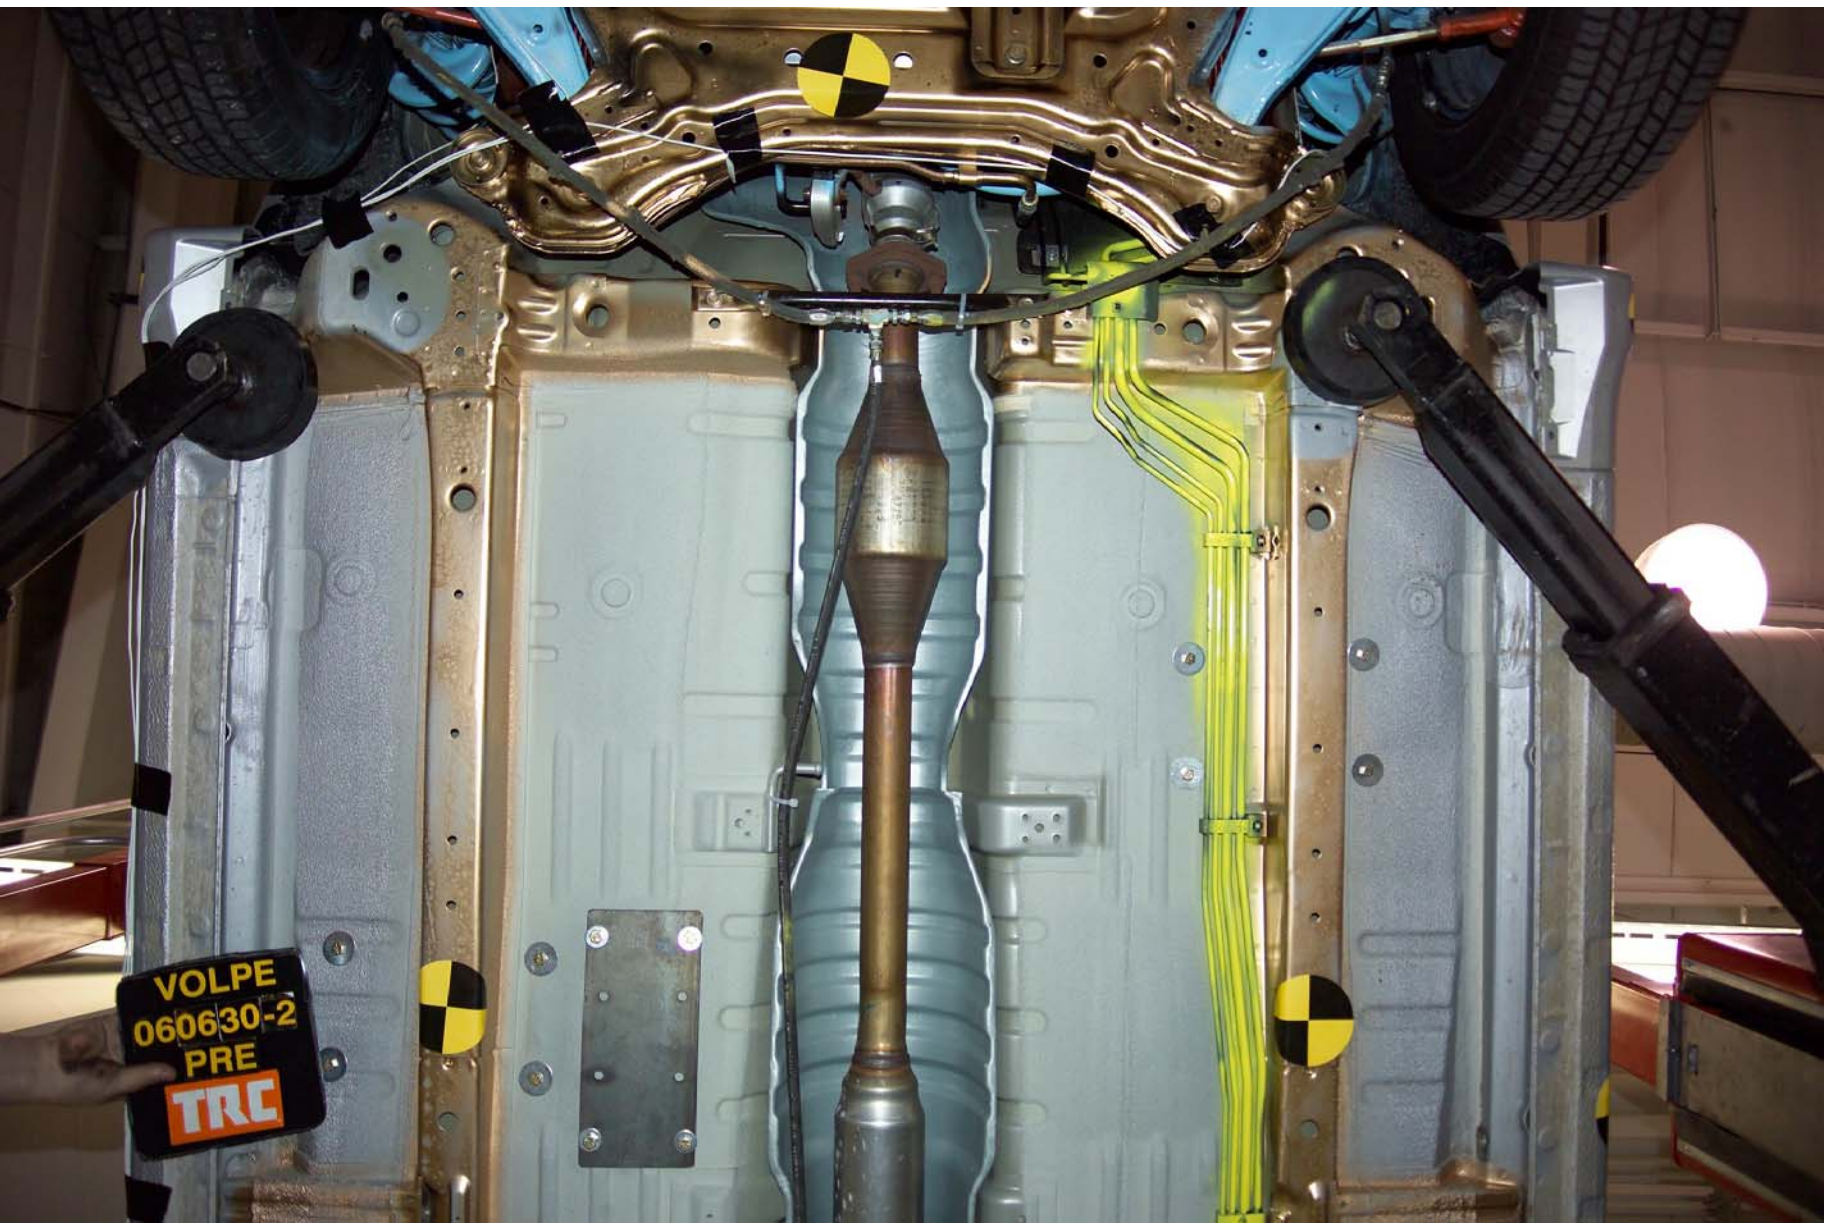


Figure A-21 Pre-Test Mid Front Underbody View

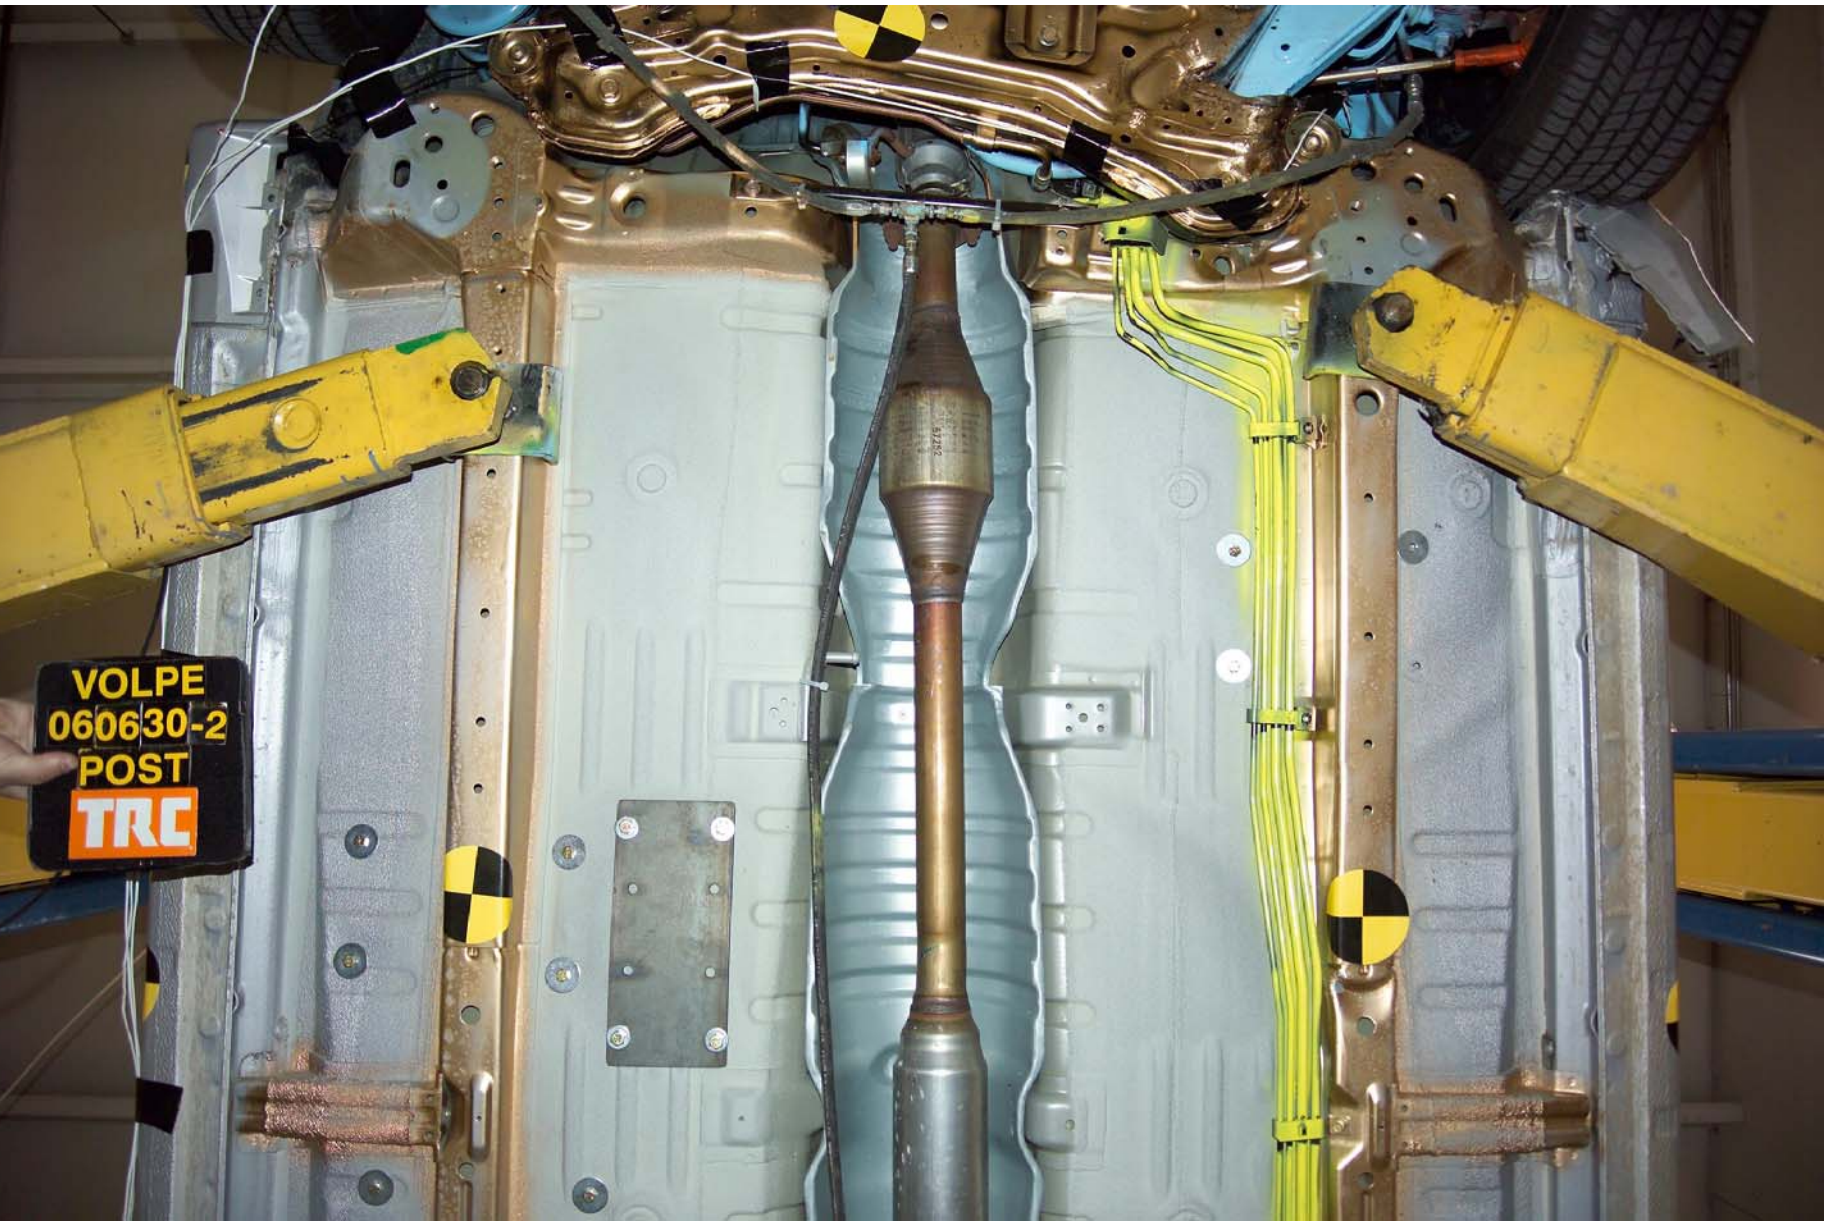


Figure A-22 Post-Test Mid Front Underbody View

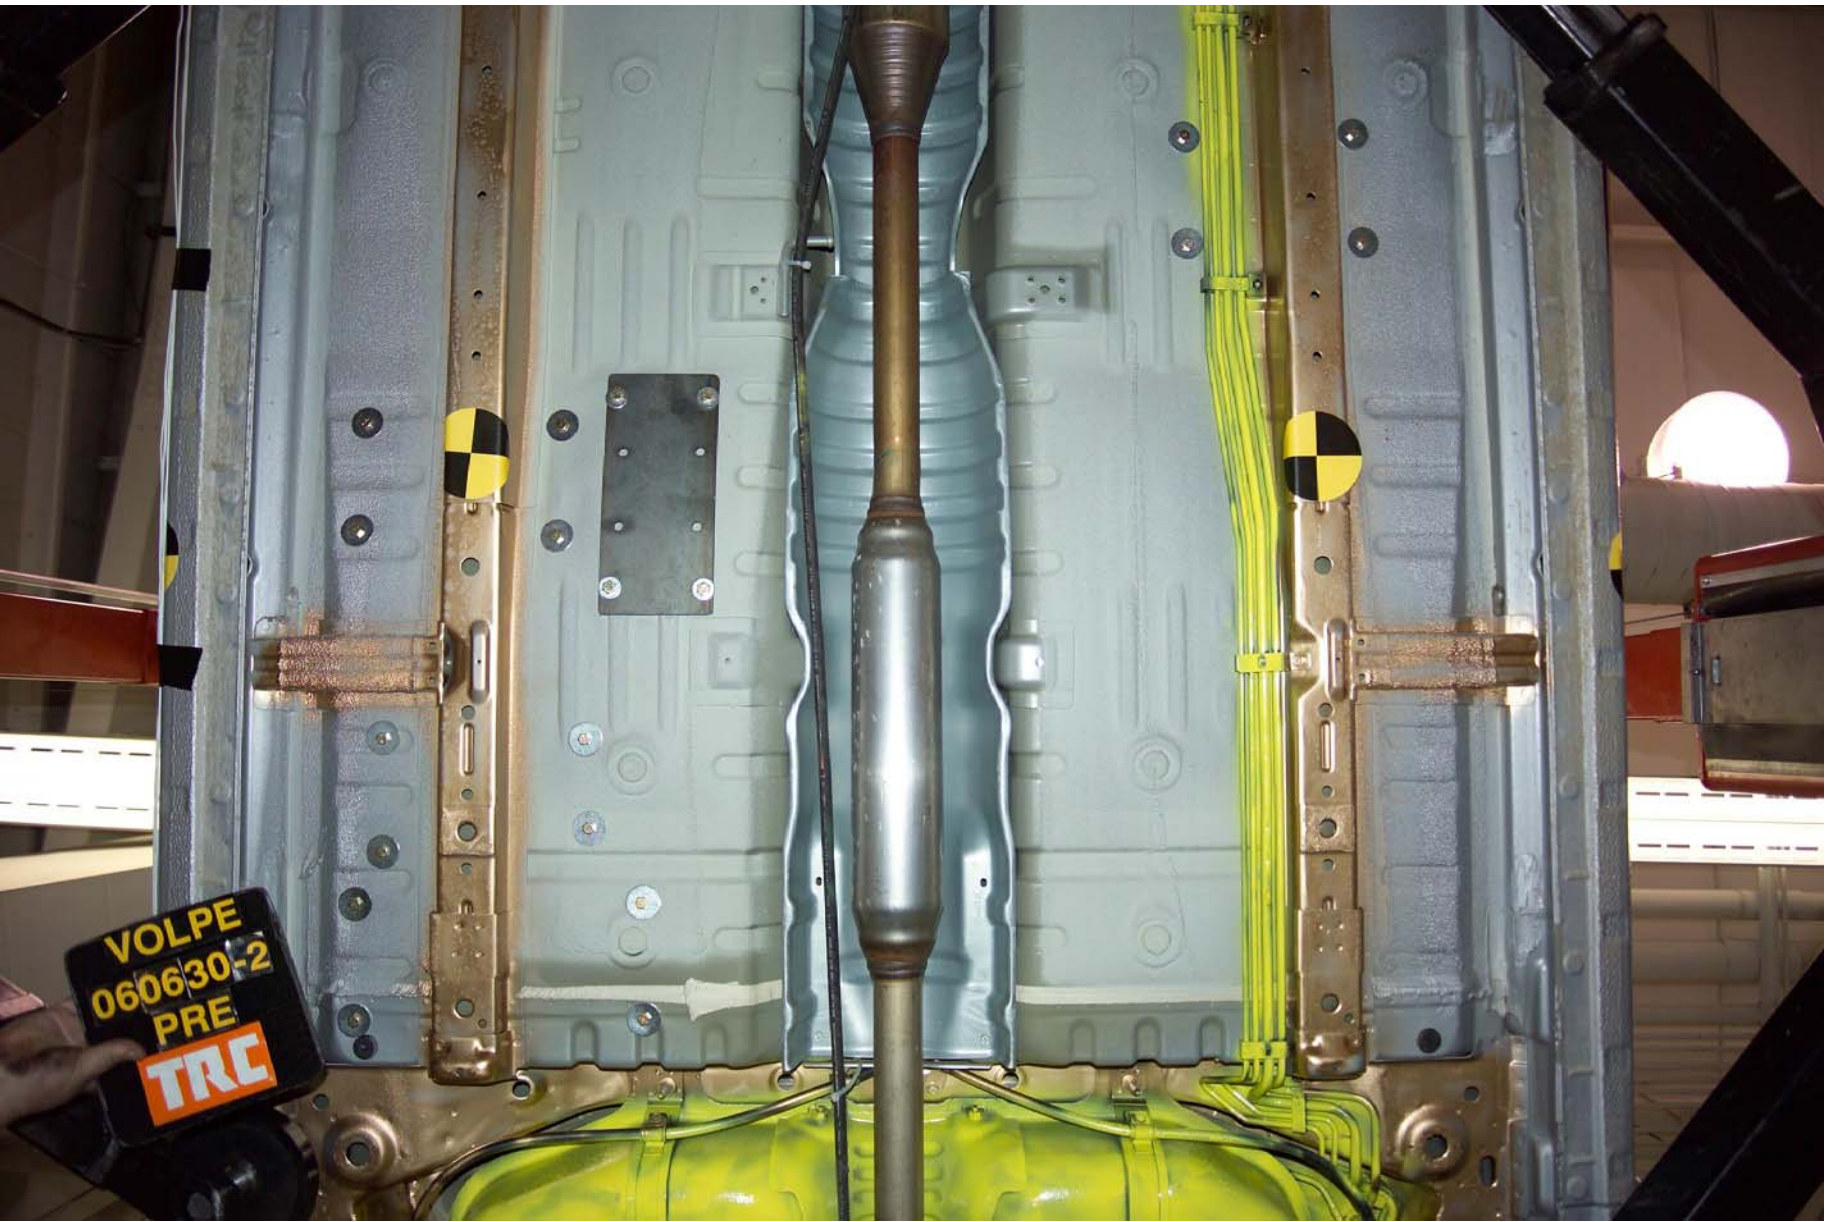


Figure A-23 Pre-Test Mid Underbody View

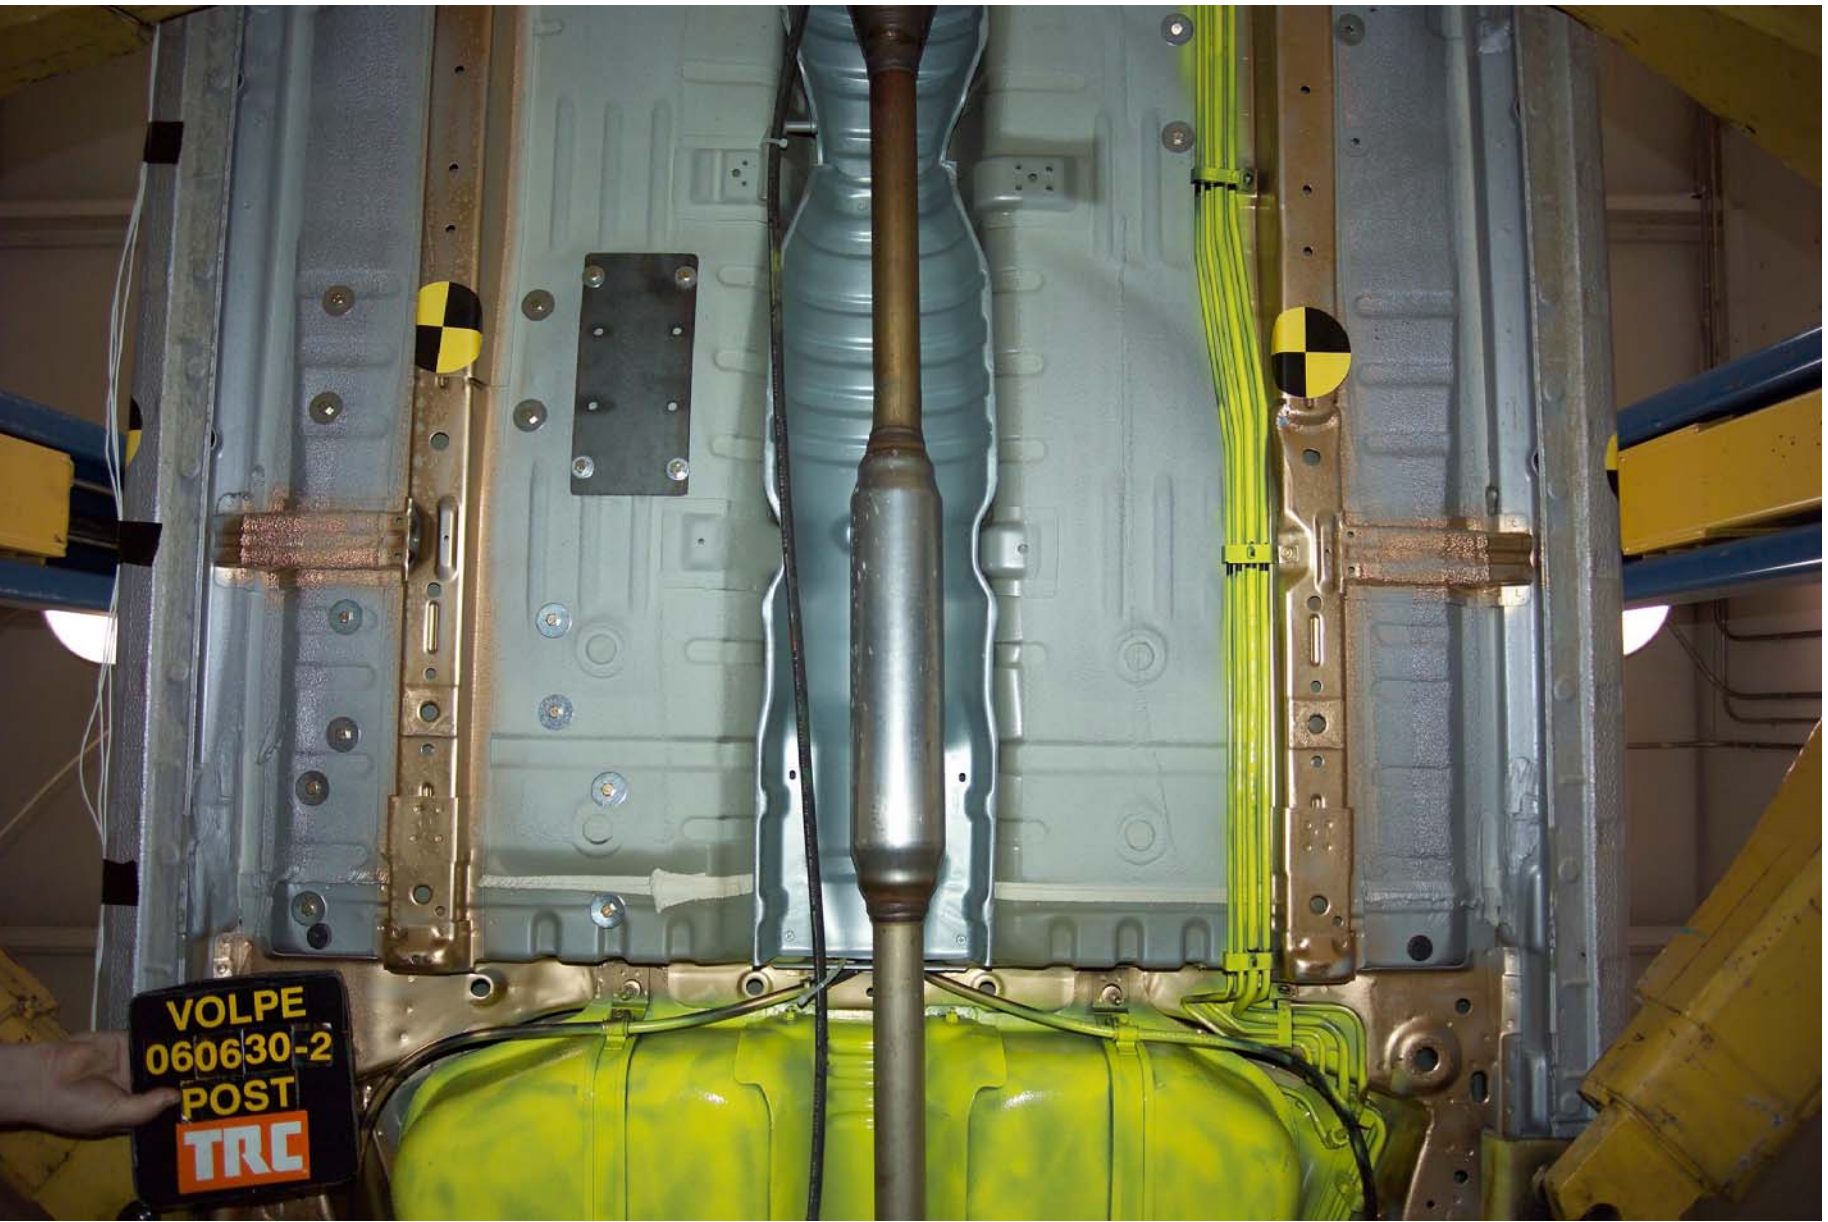


Figure A-24 Post-Test Mid Underbody View

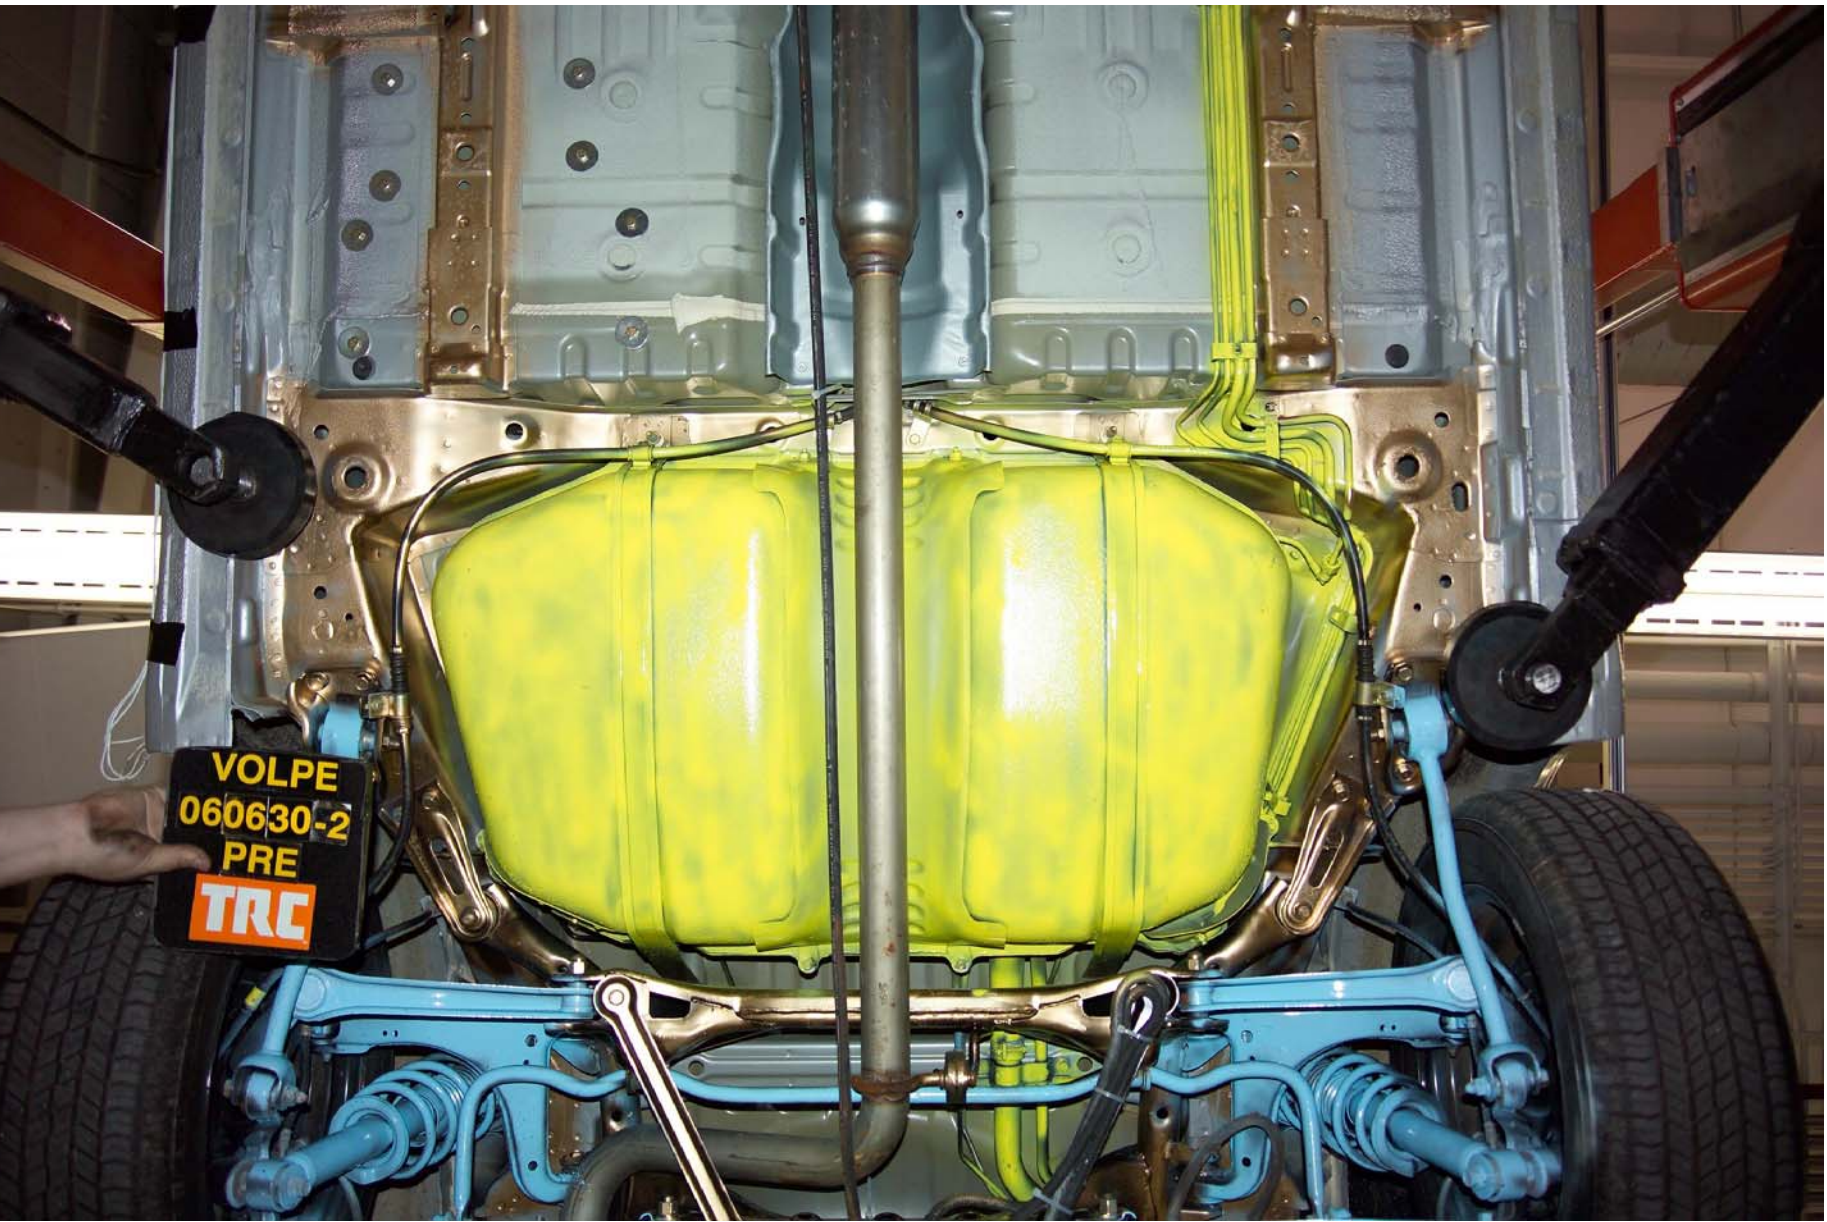


Figure A-25 Pre-Test Mid Rear Underbody View

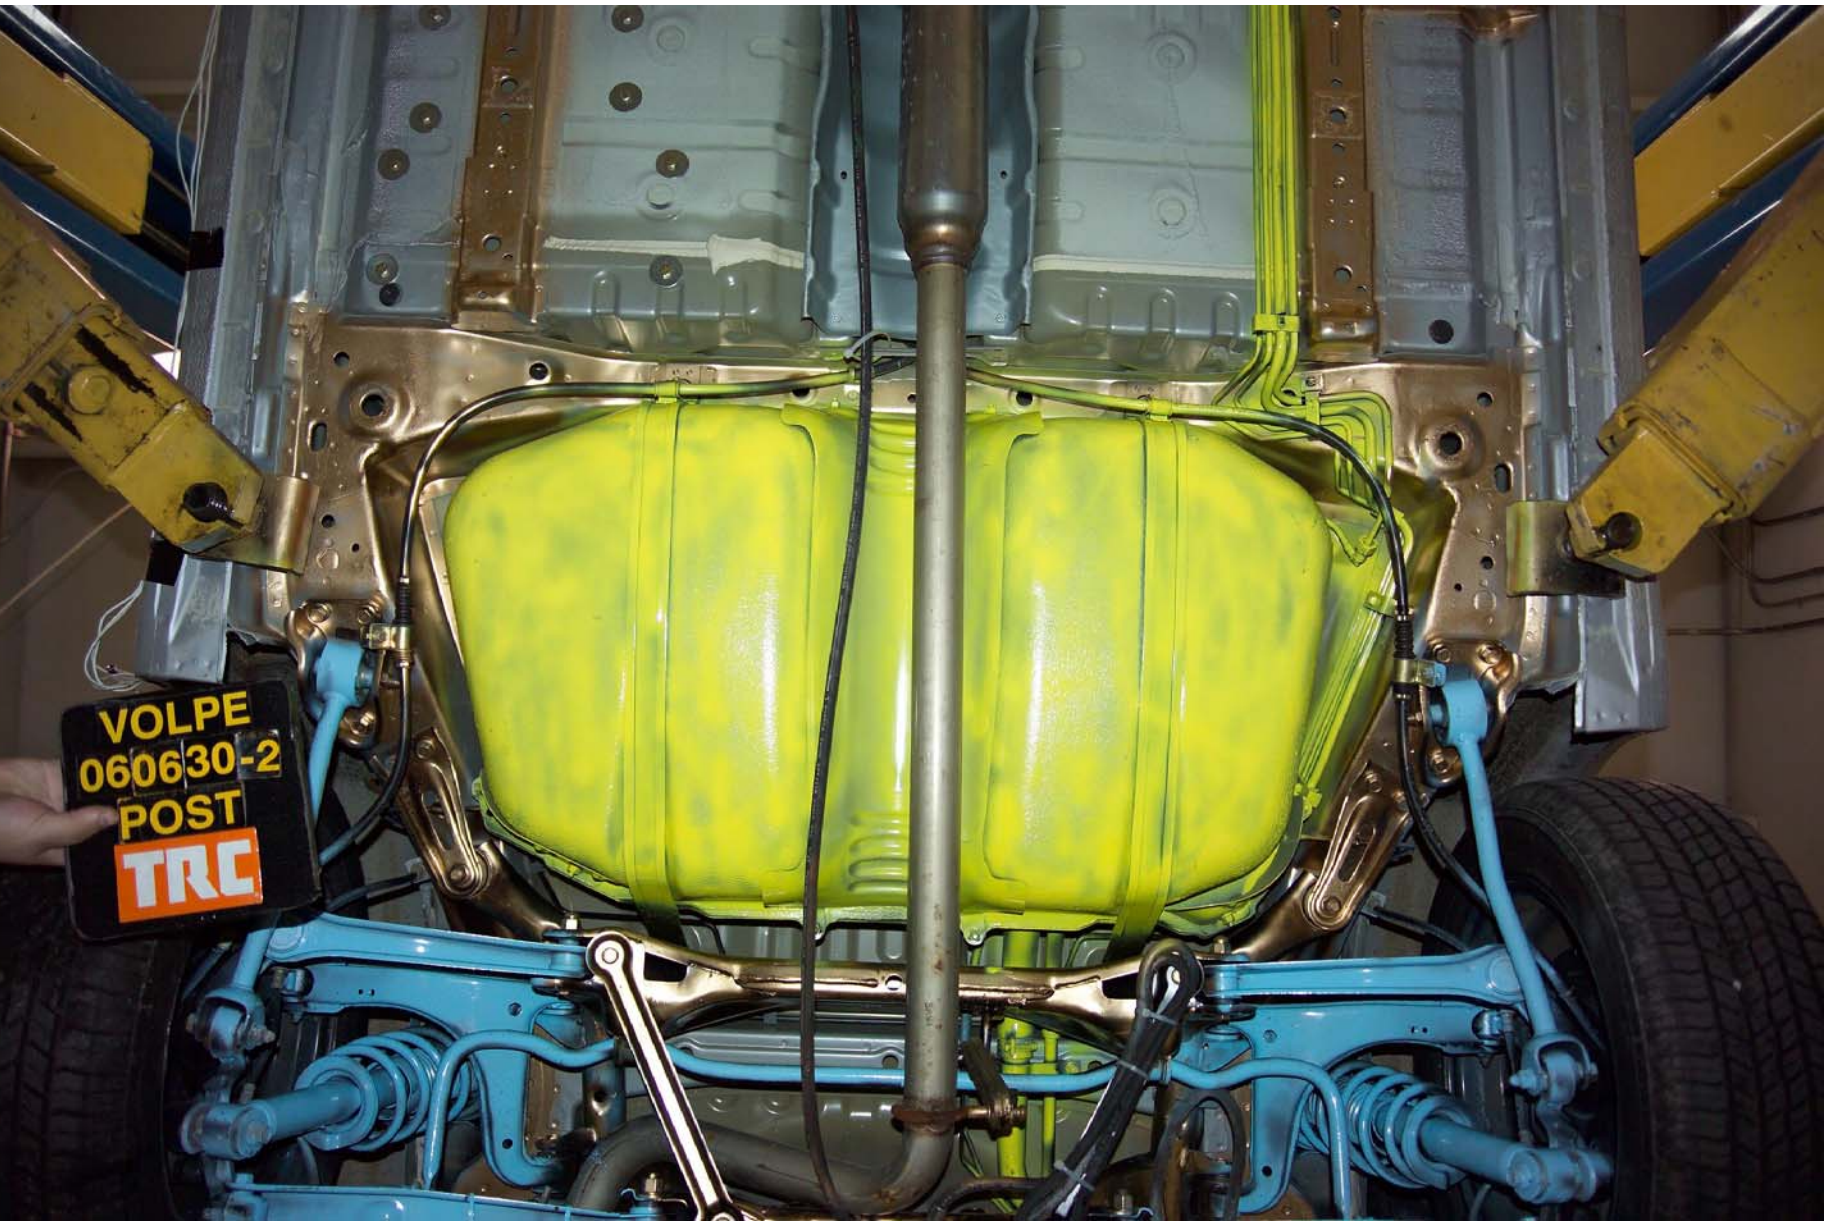


Figure A-26 Post-Test Mid Rear Underbody View

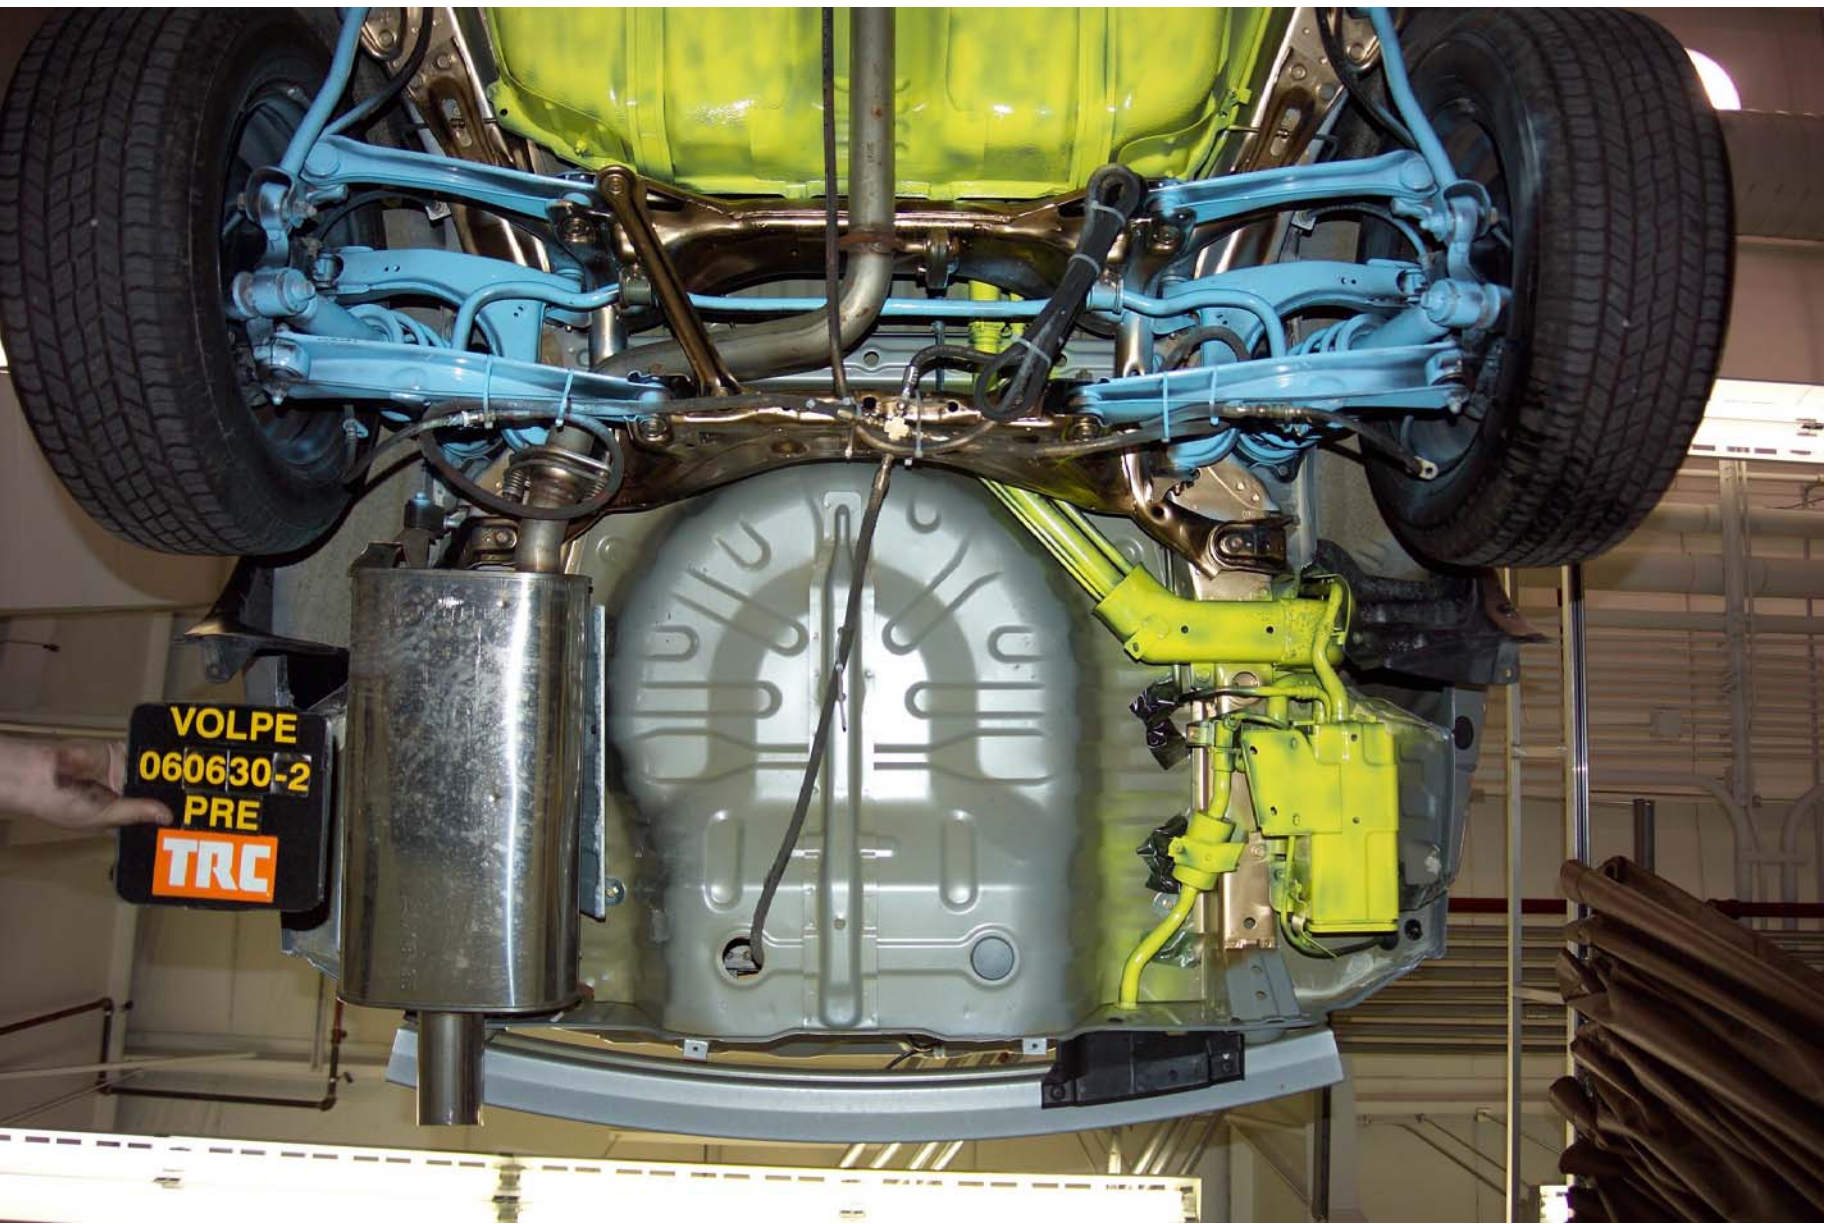


Figure A-27 Pre-Test Rear Underbody View

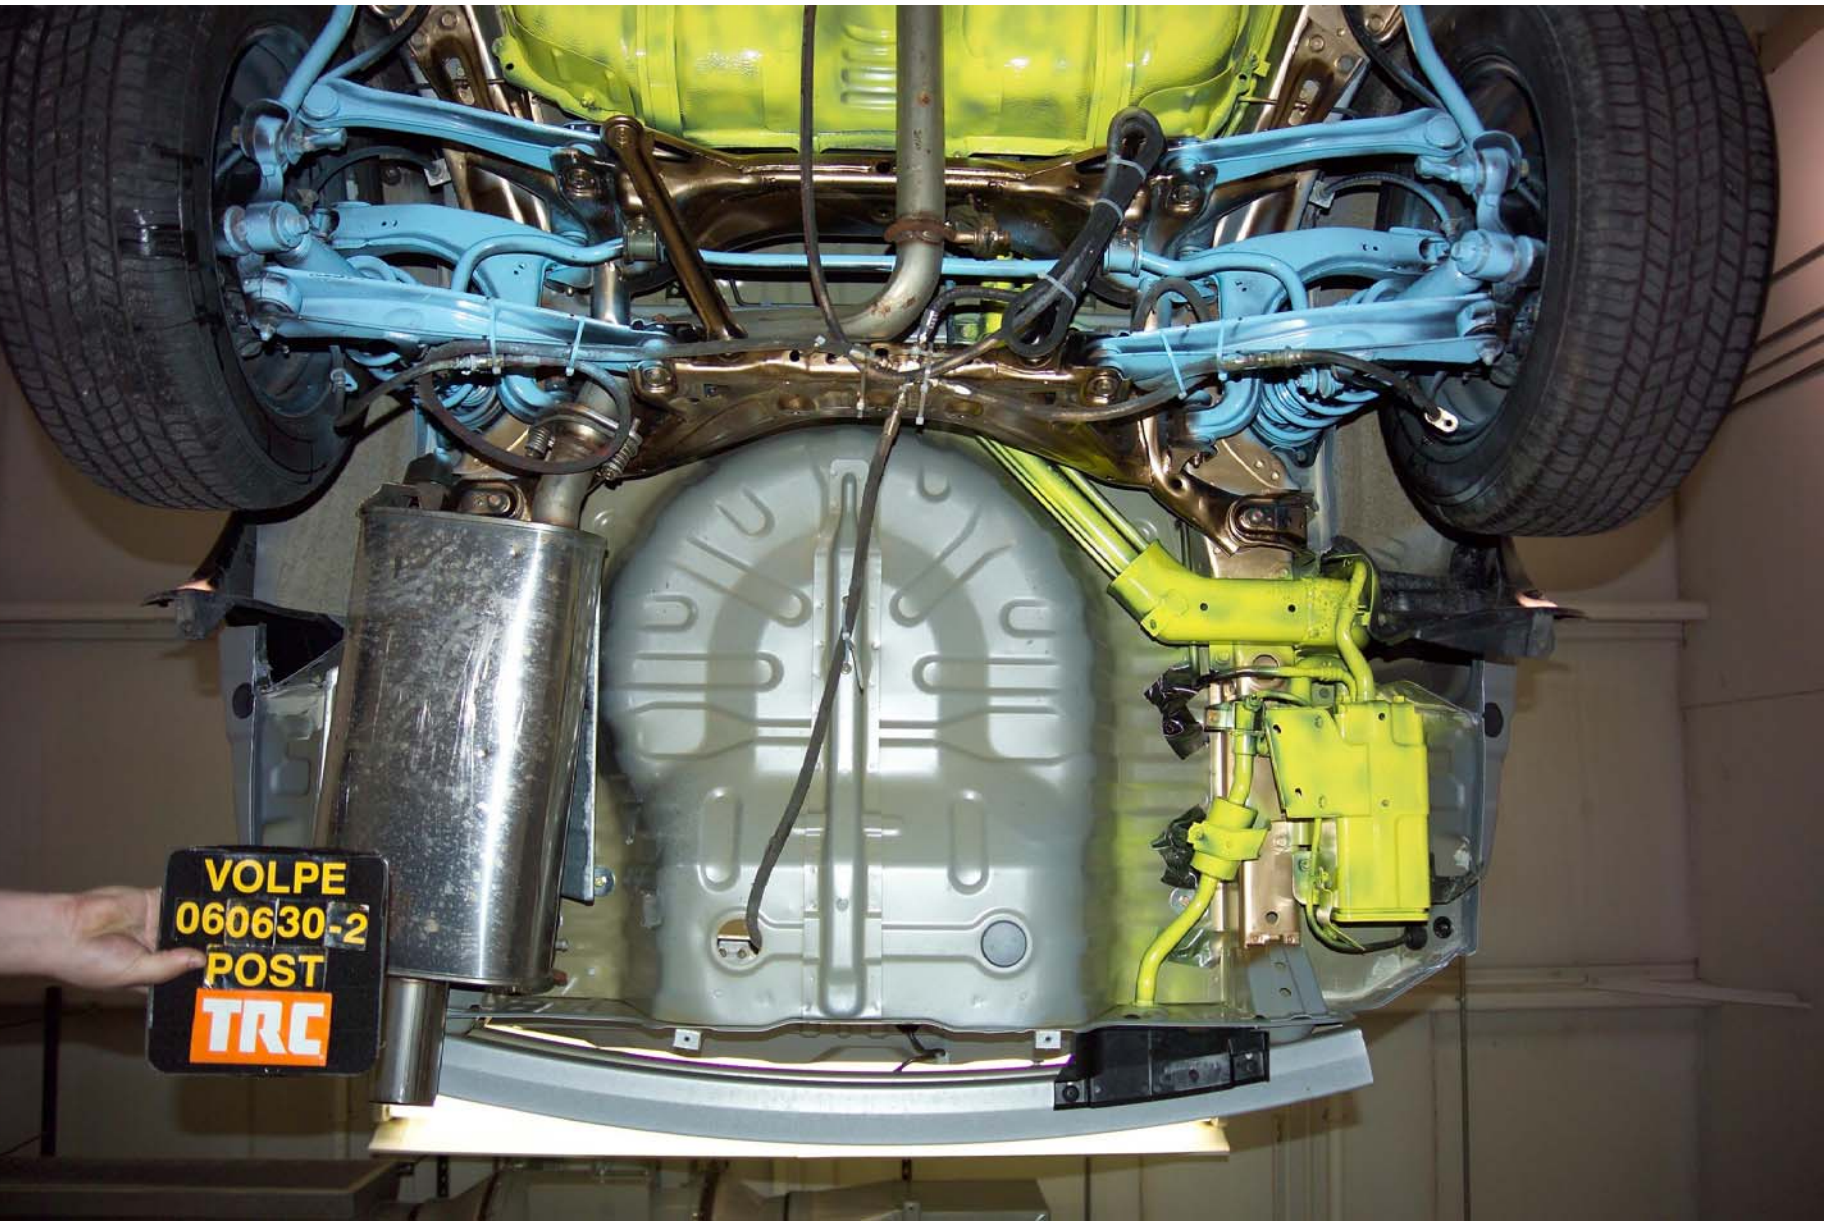


Figure A-28 Post-Test Rear Underbody View

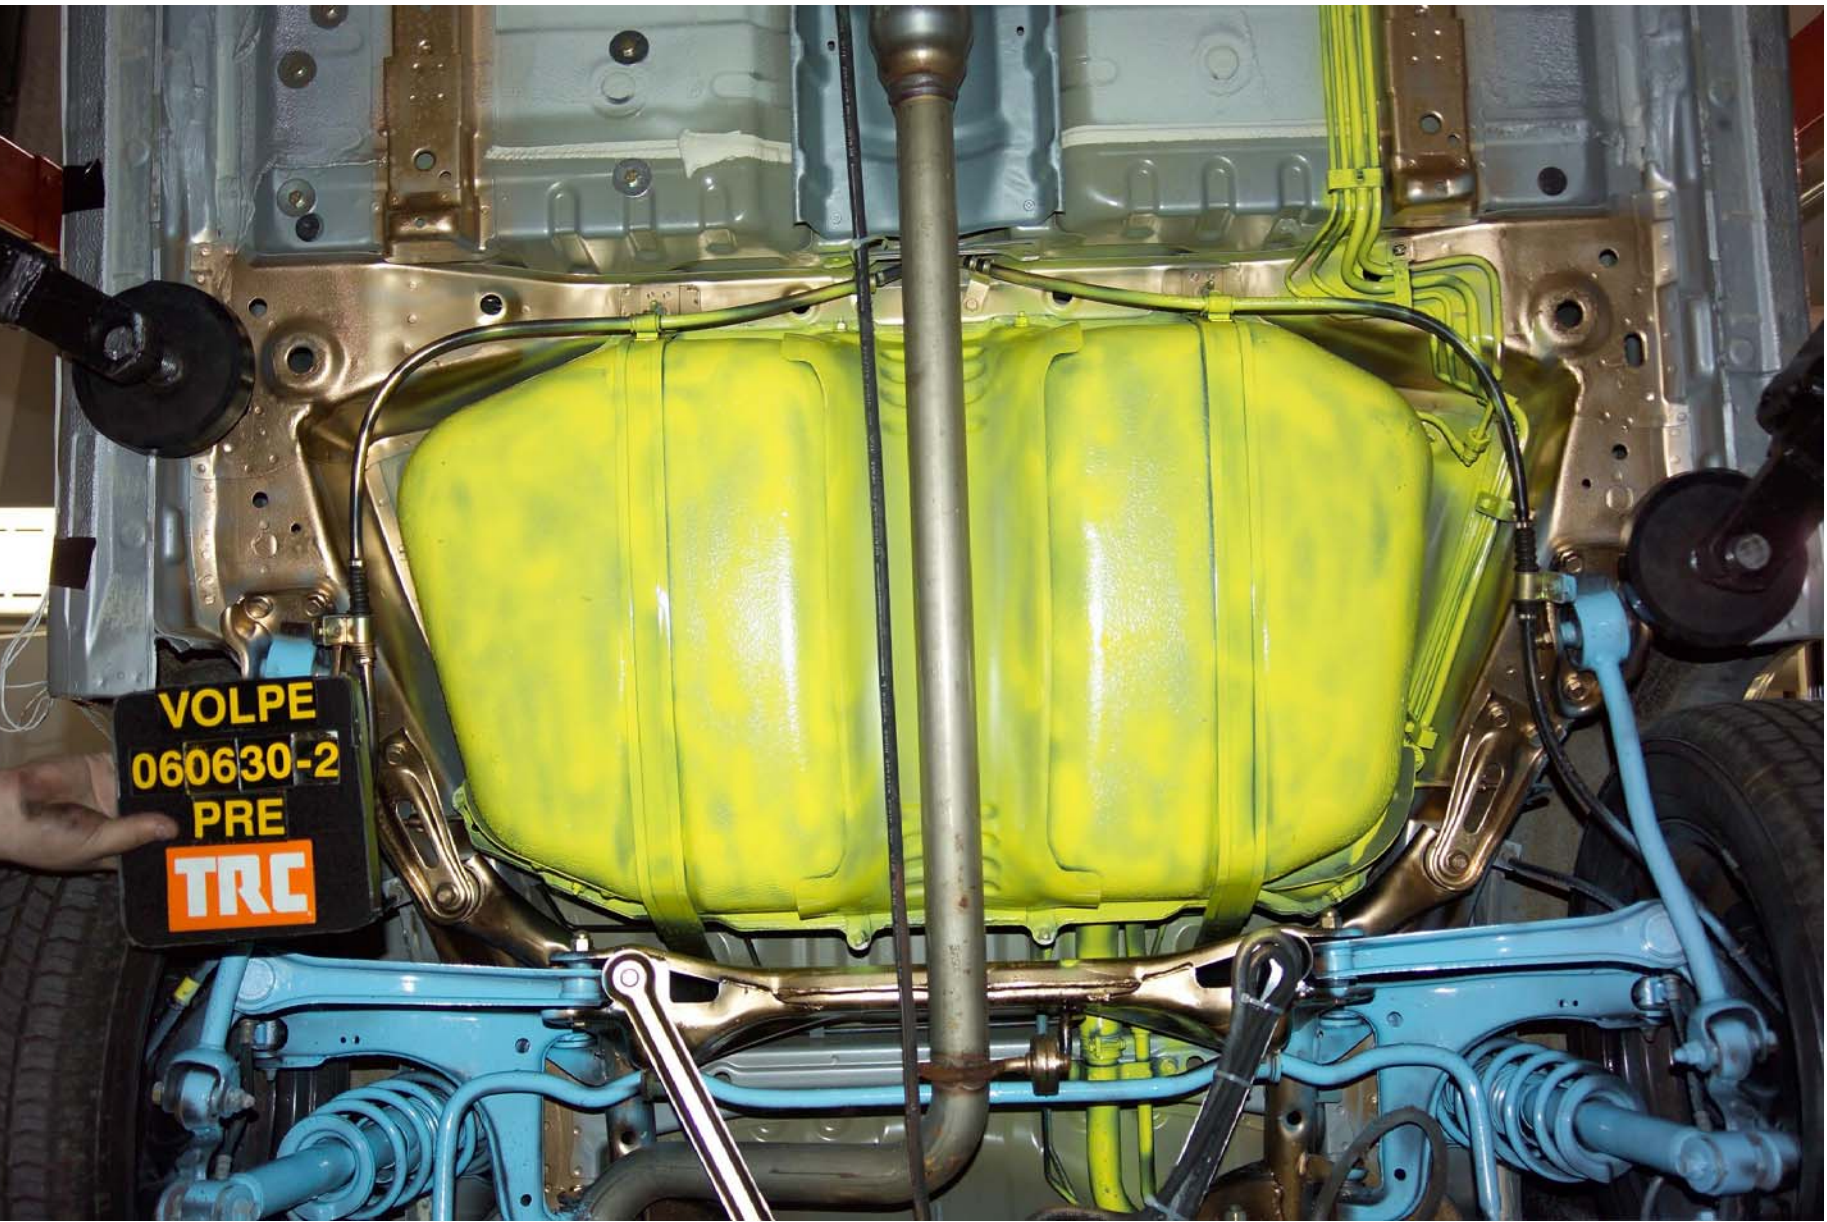


Figure A-29 Pre-Test Fuel Tank View

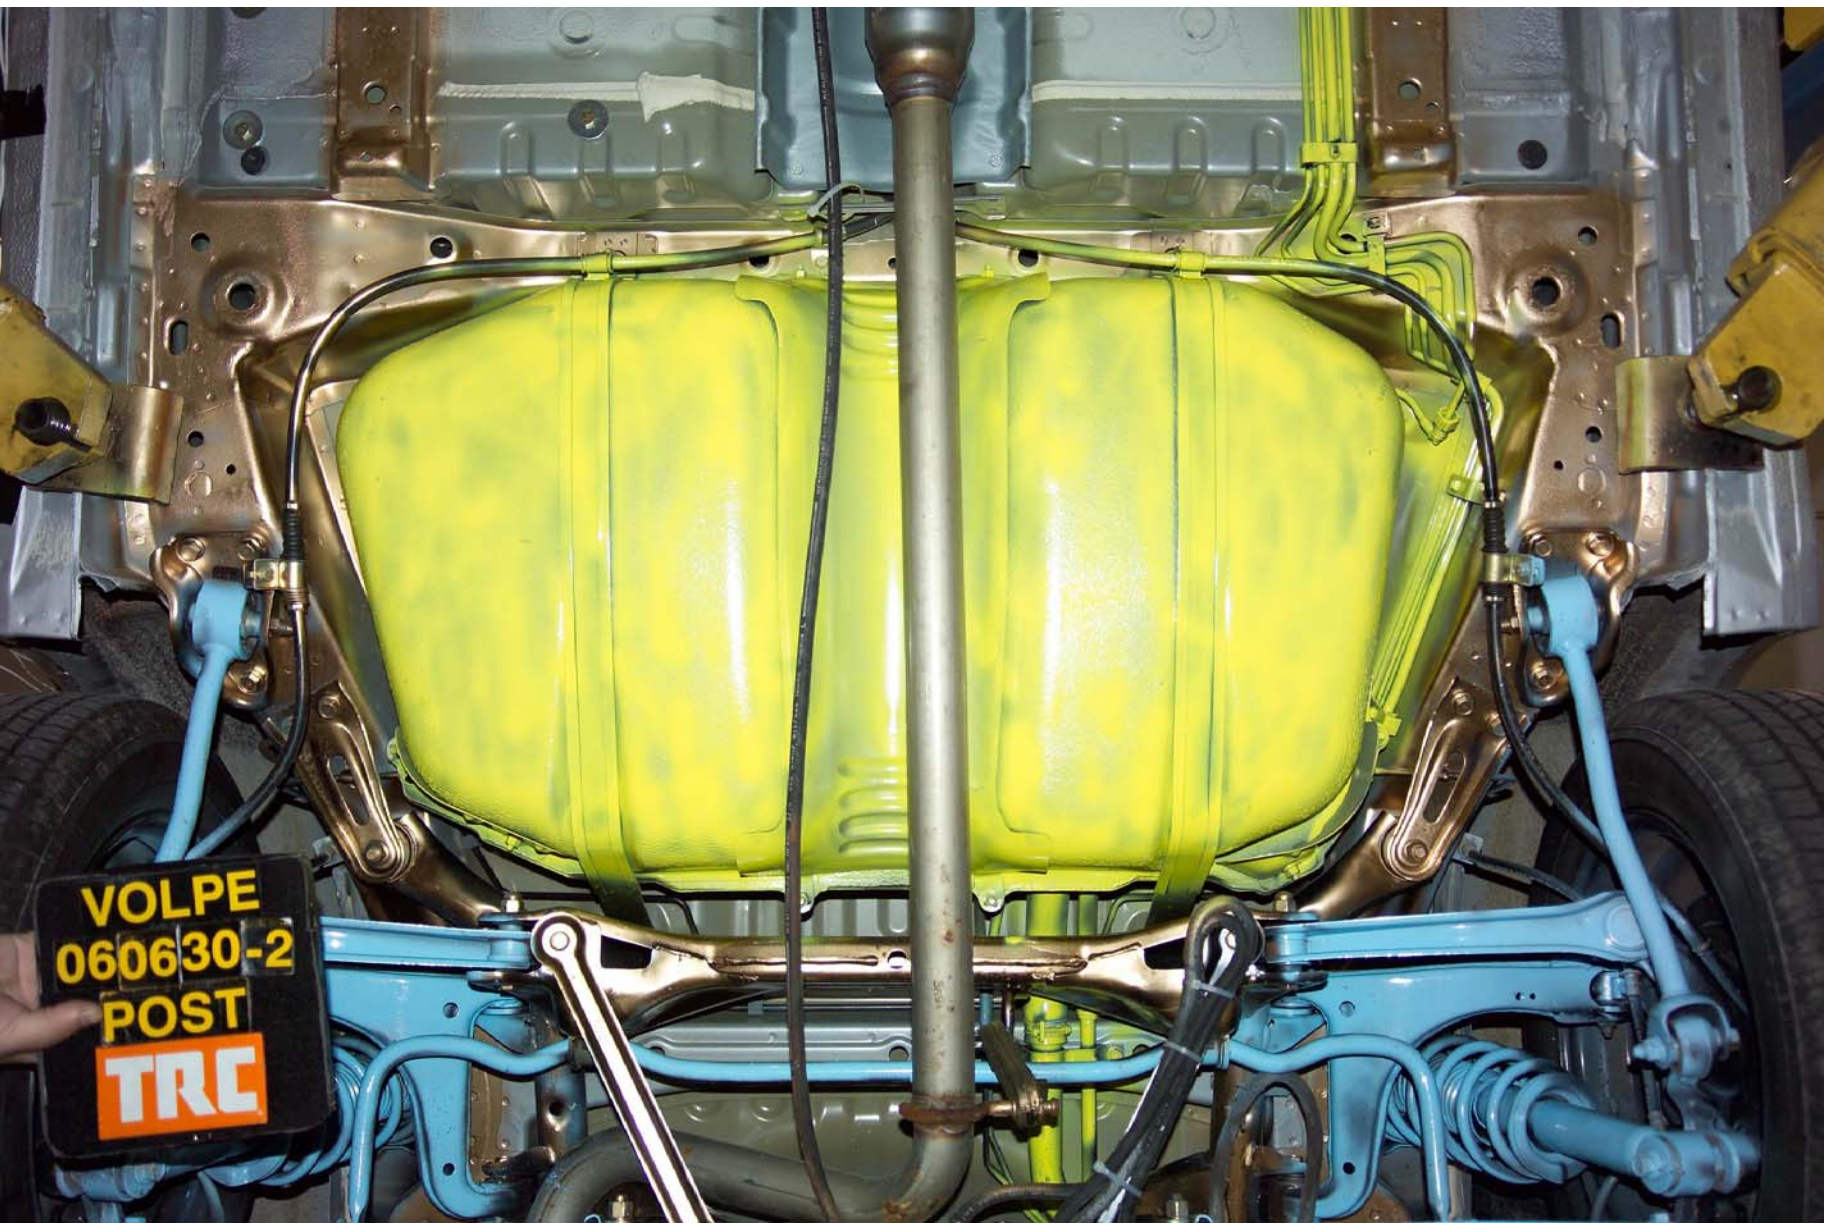


Figure A-30 Post-Test Fuel Tank View

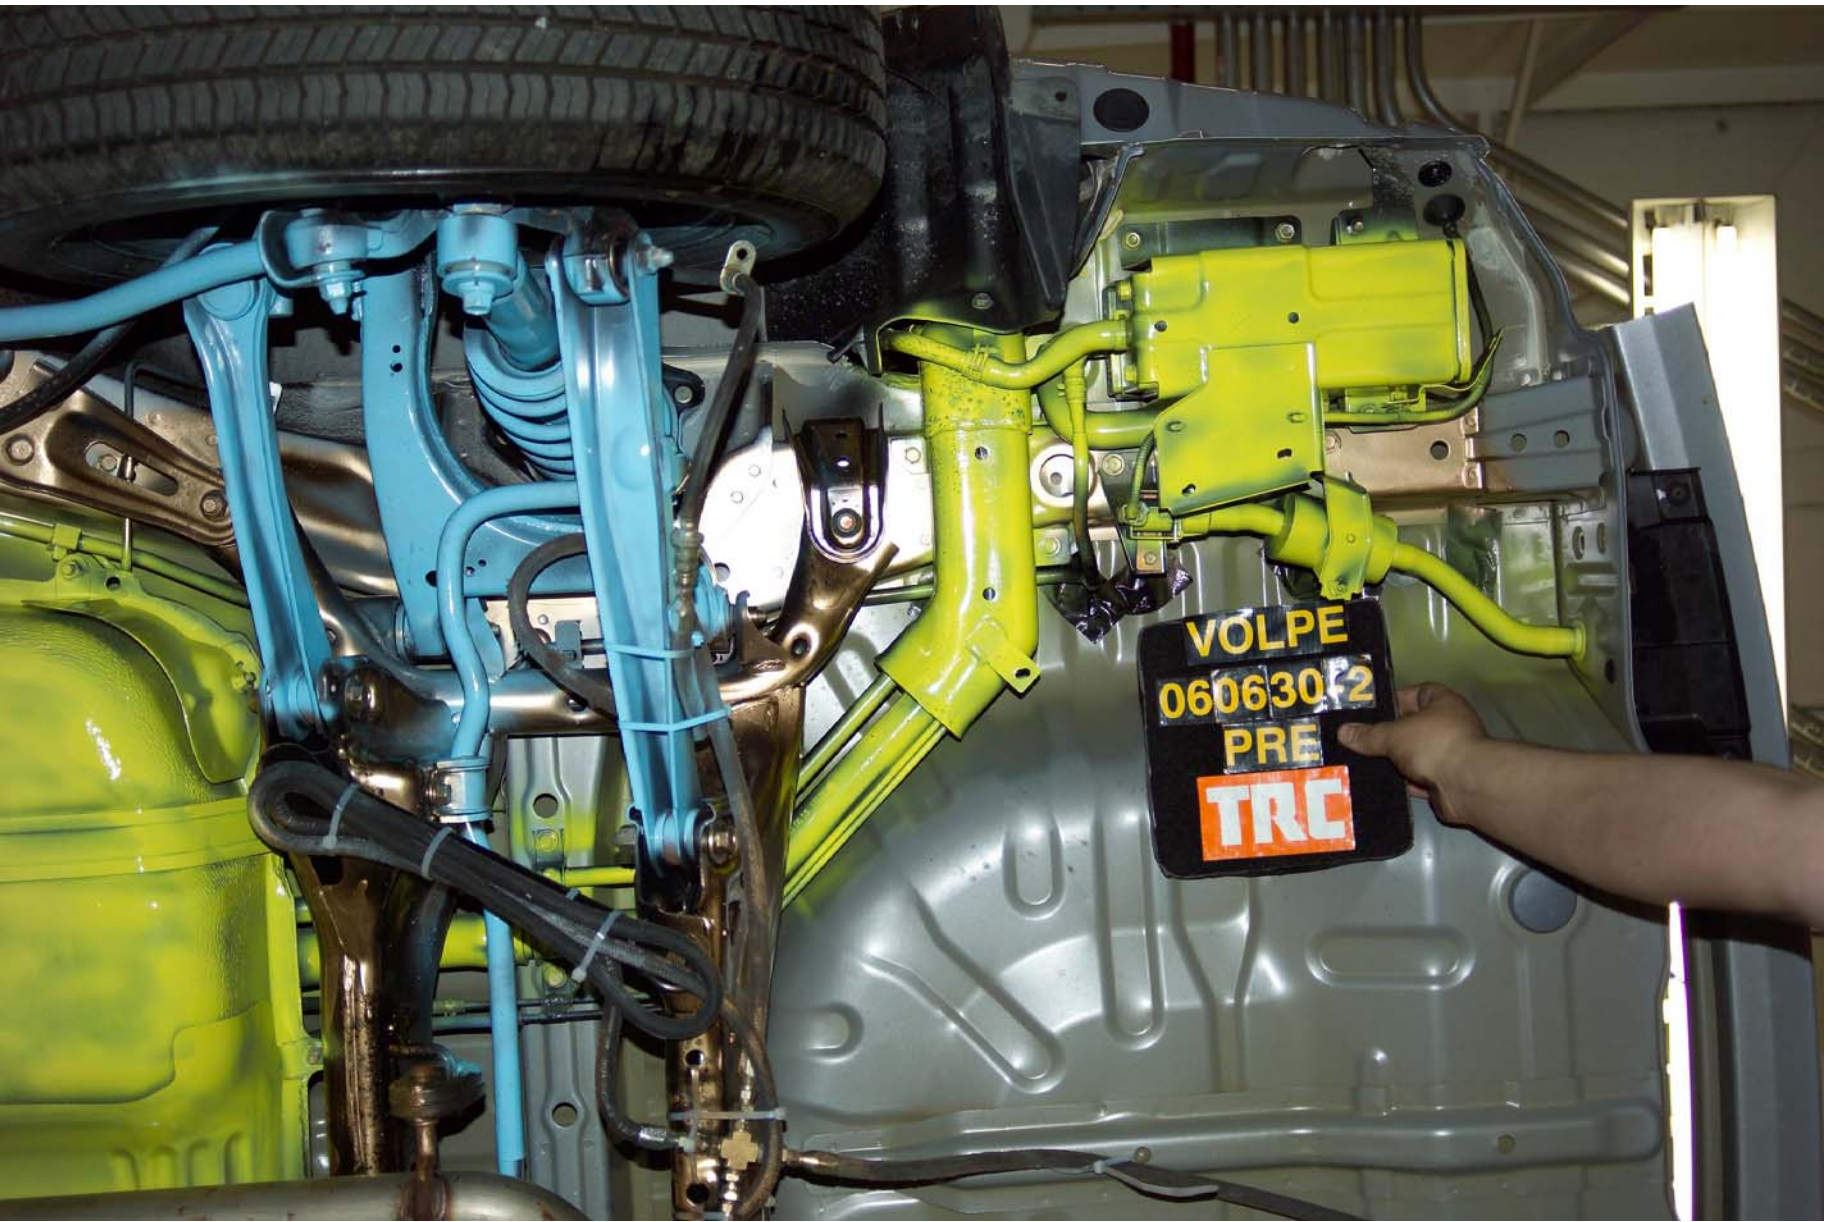


Figure A-31 Pre-Test Fuel Filler Neck View



Figure A-32 Post-Test Fuel Filler Neck View



Figure A-33 Pre-Test Fuel Filler Cap View



Figure A-34 Post-Test Fuel Filler Cap View



Figure A-35 Pre-Test Engine Compartment View



Figure A-36 Post-Test Engine Compartment View



Figure A-37 Pre-Test Windshield View



Figure A-38 Post-Test Windshield View



Figure A-39 Pre-Test Windshield - Driver Dummy View

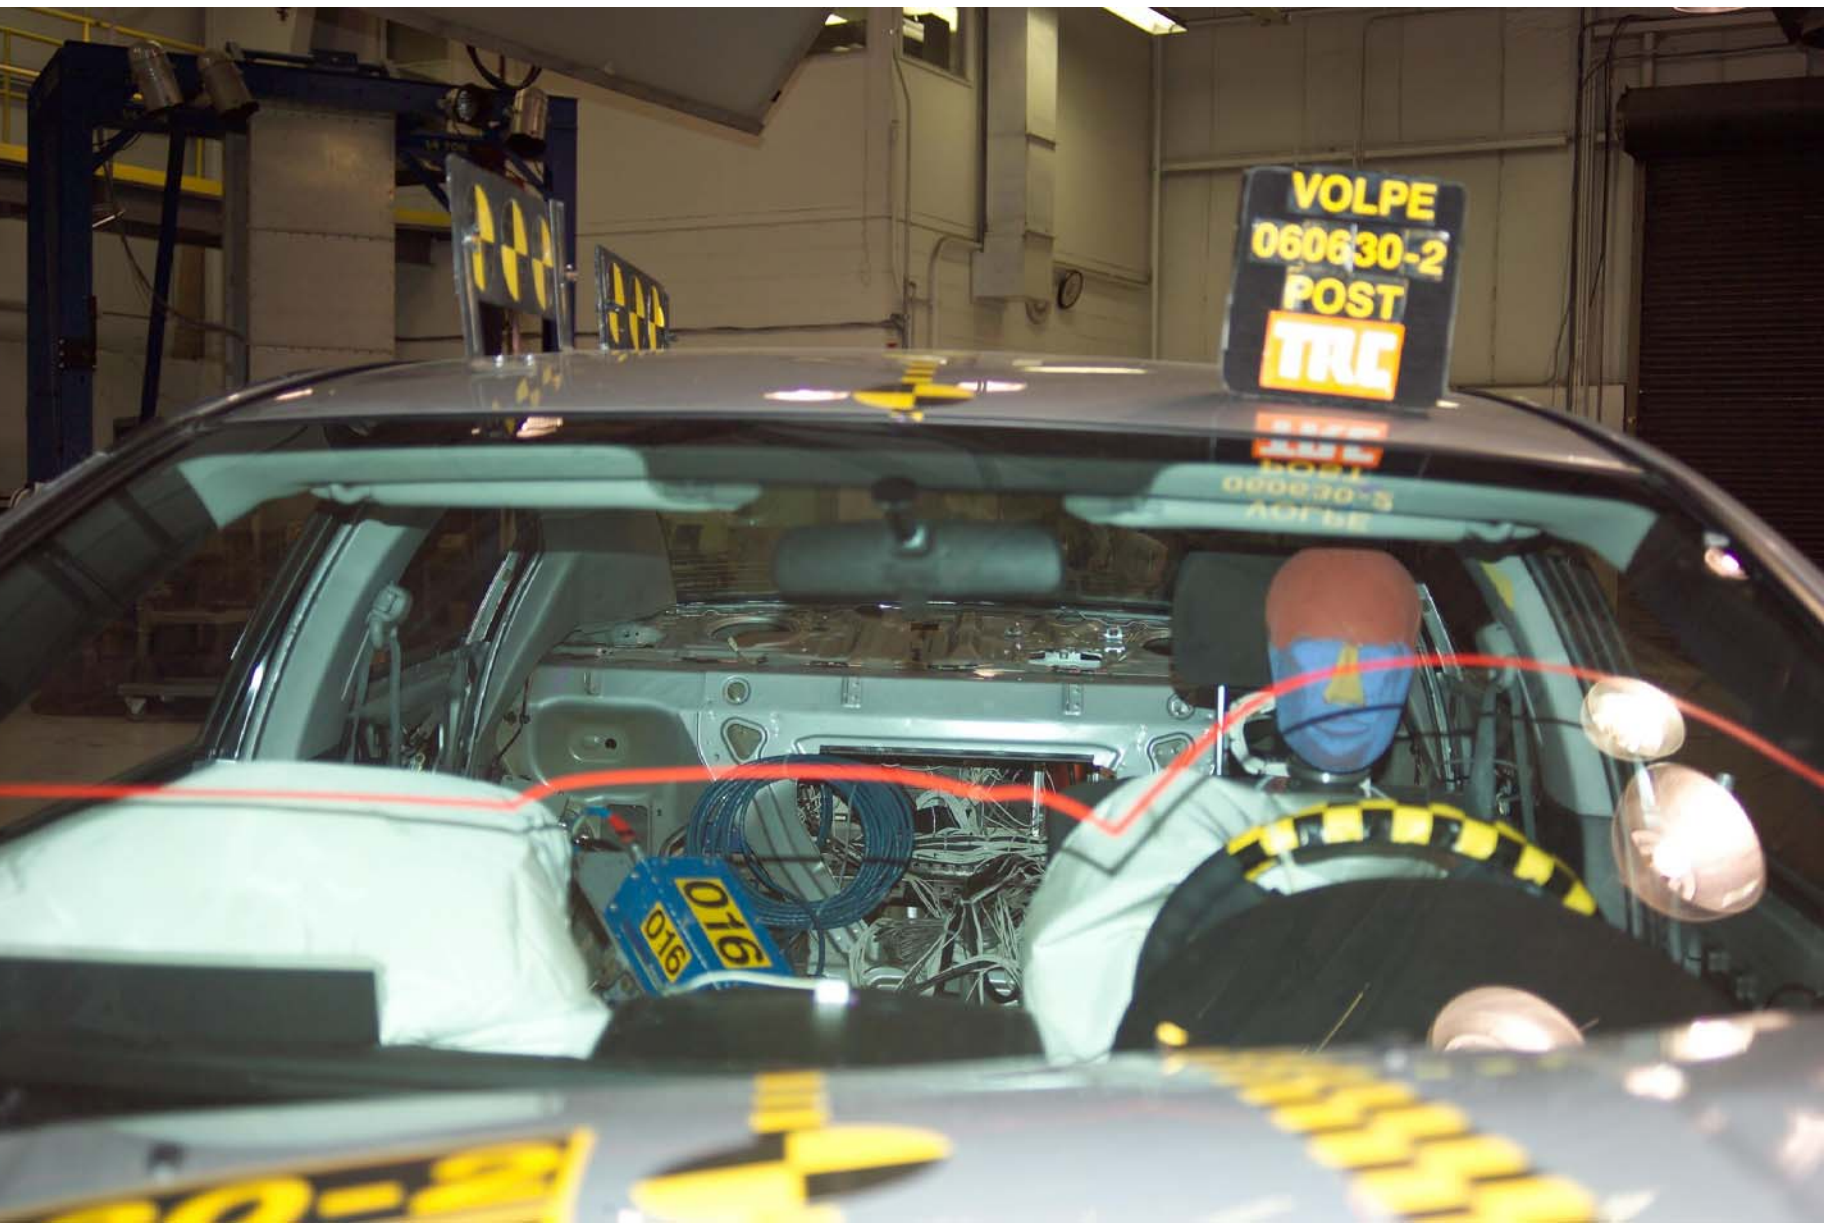


Figure A-40 Post-Test Windshield - Driver Dummy View



Figure A-41 Pre-Test Driver Dummy - View 1



Figure A-42 Post-Test Driver Dummy - View 1



Figure A-43 Pre-Test Driver Dummy - View 2



Figure A-44 Post-Test Driver Dummy - View 2

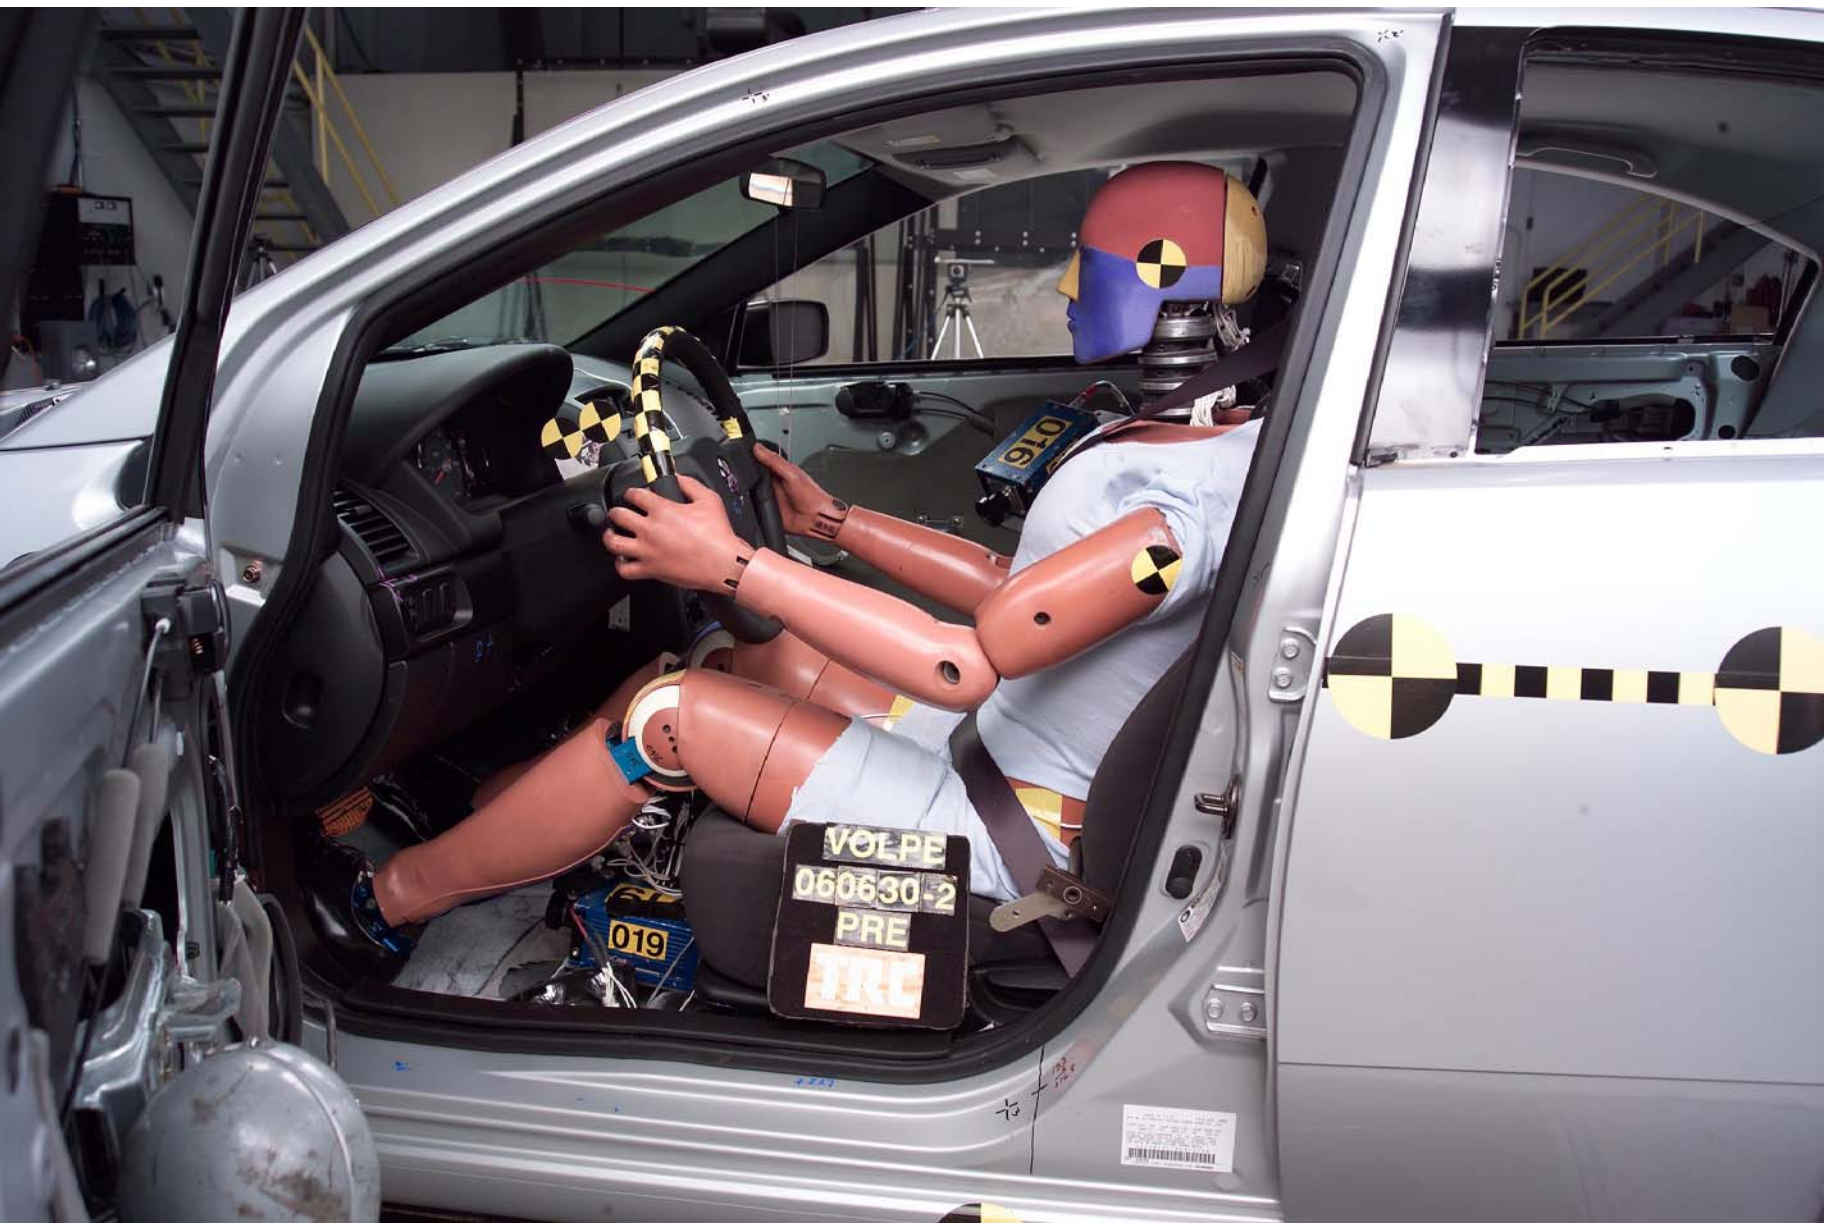


Figure A-45 Pre-Test Driver Dummy - View 3

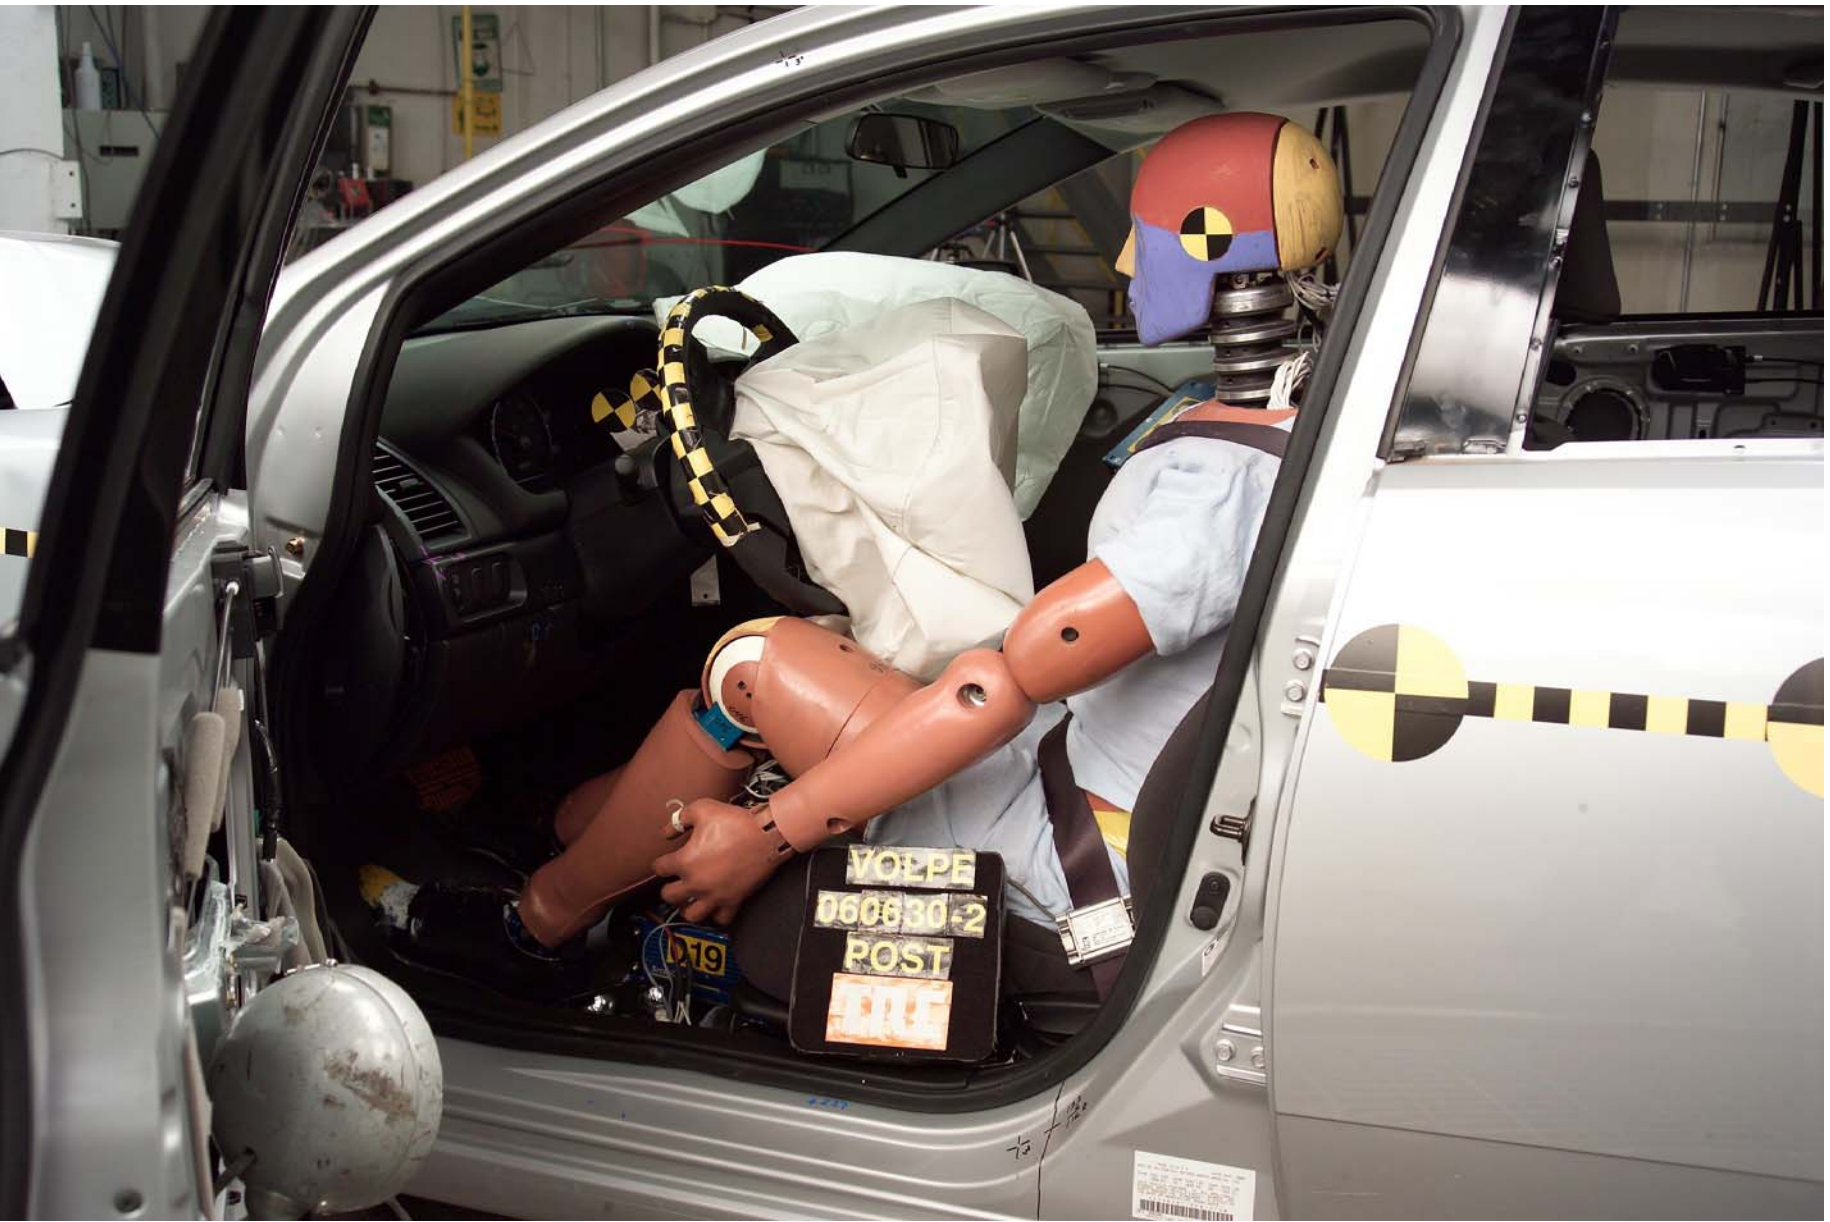


Figure A-46 Post-Test Driver Dummy - View 3



Figure A-47 Pre-Test Driver Dummy - View 4



Figure A-48 Post-Test Driver Dummy - View 4



Figure A-49 Post-Test Driver Dummy Overall View

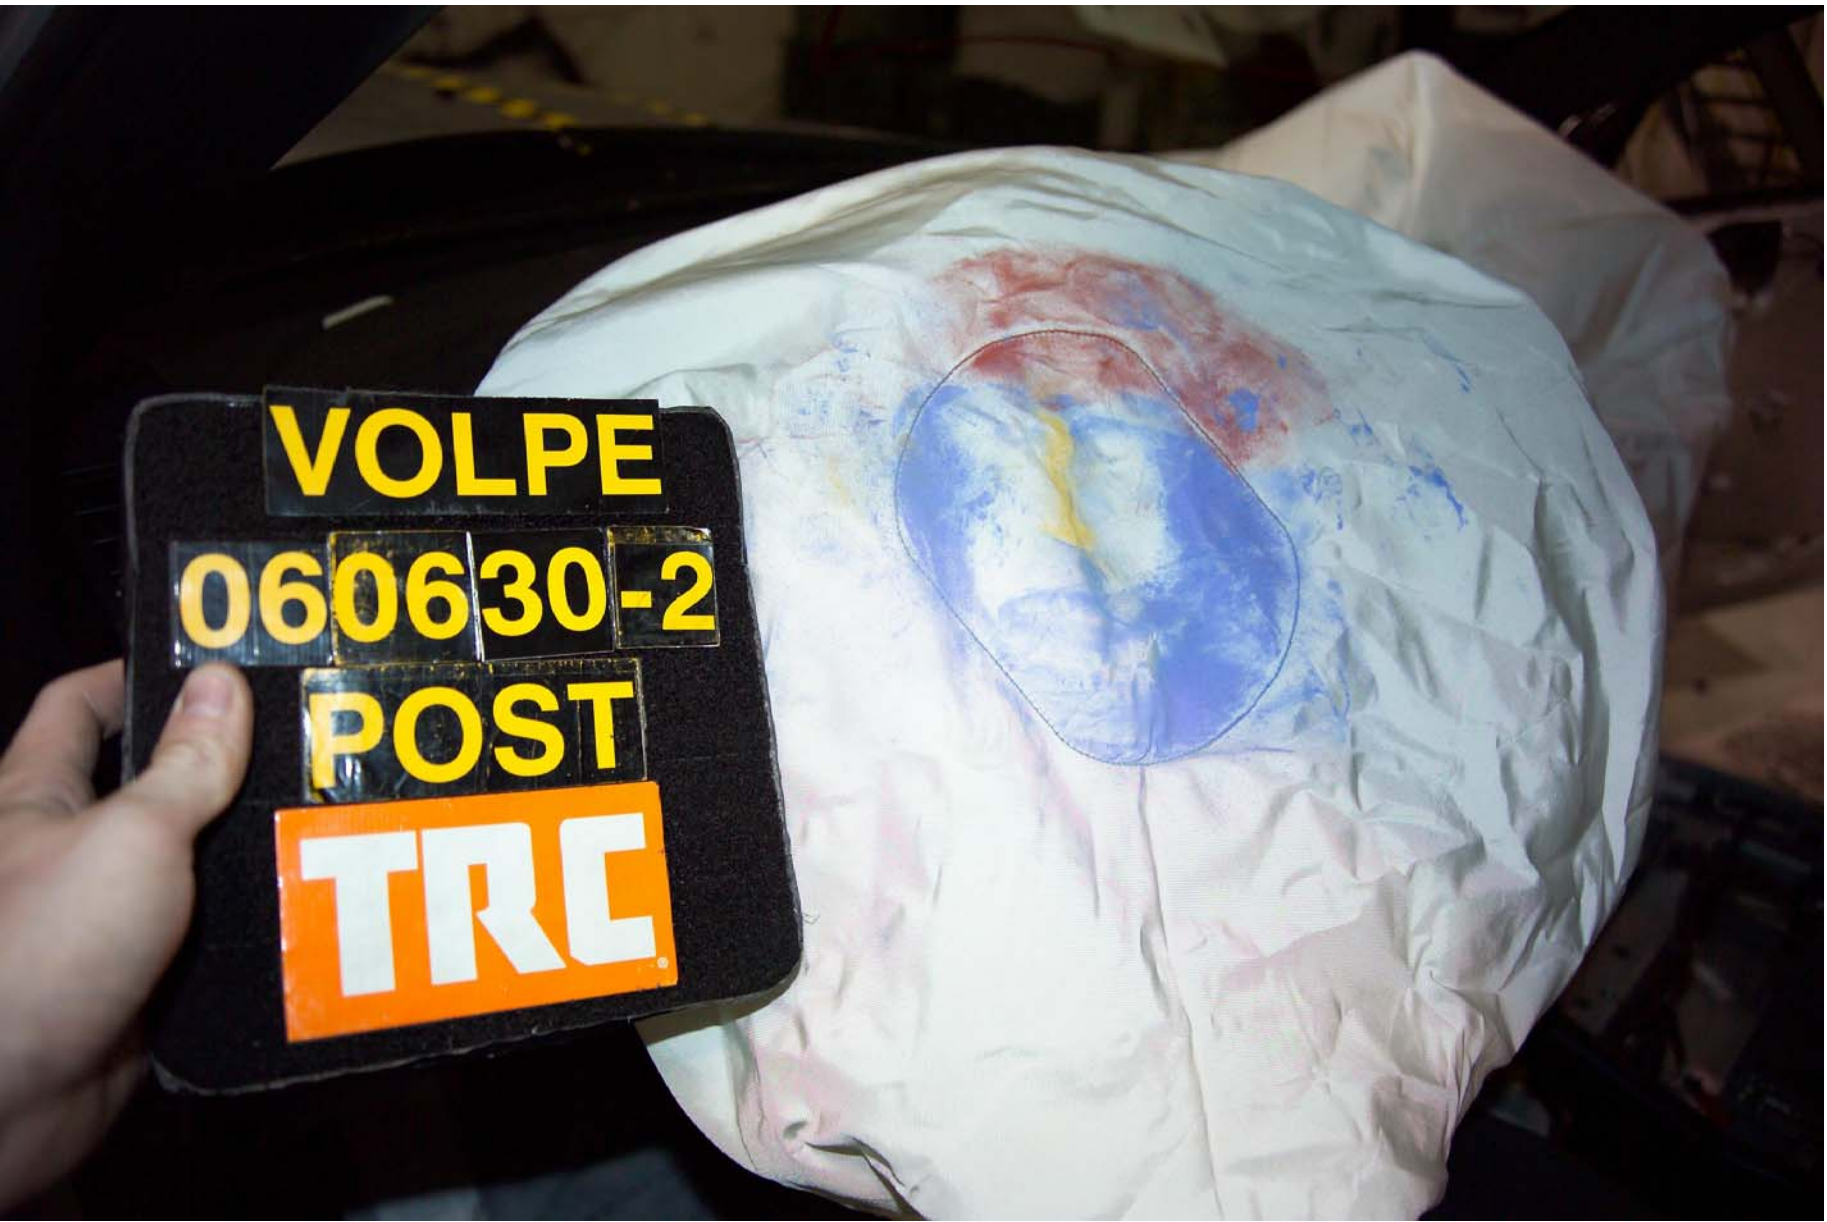


Figure A-50 Post-Test Driver Dummy Head Contact - View 1



Figure A-51 Post-Test Driver Dummy Head Contact - View 2

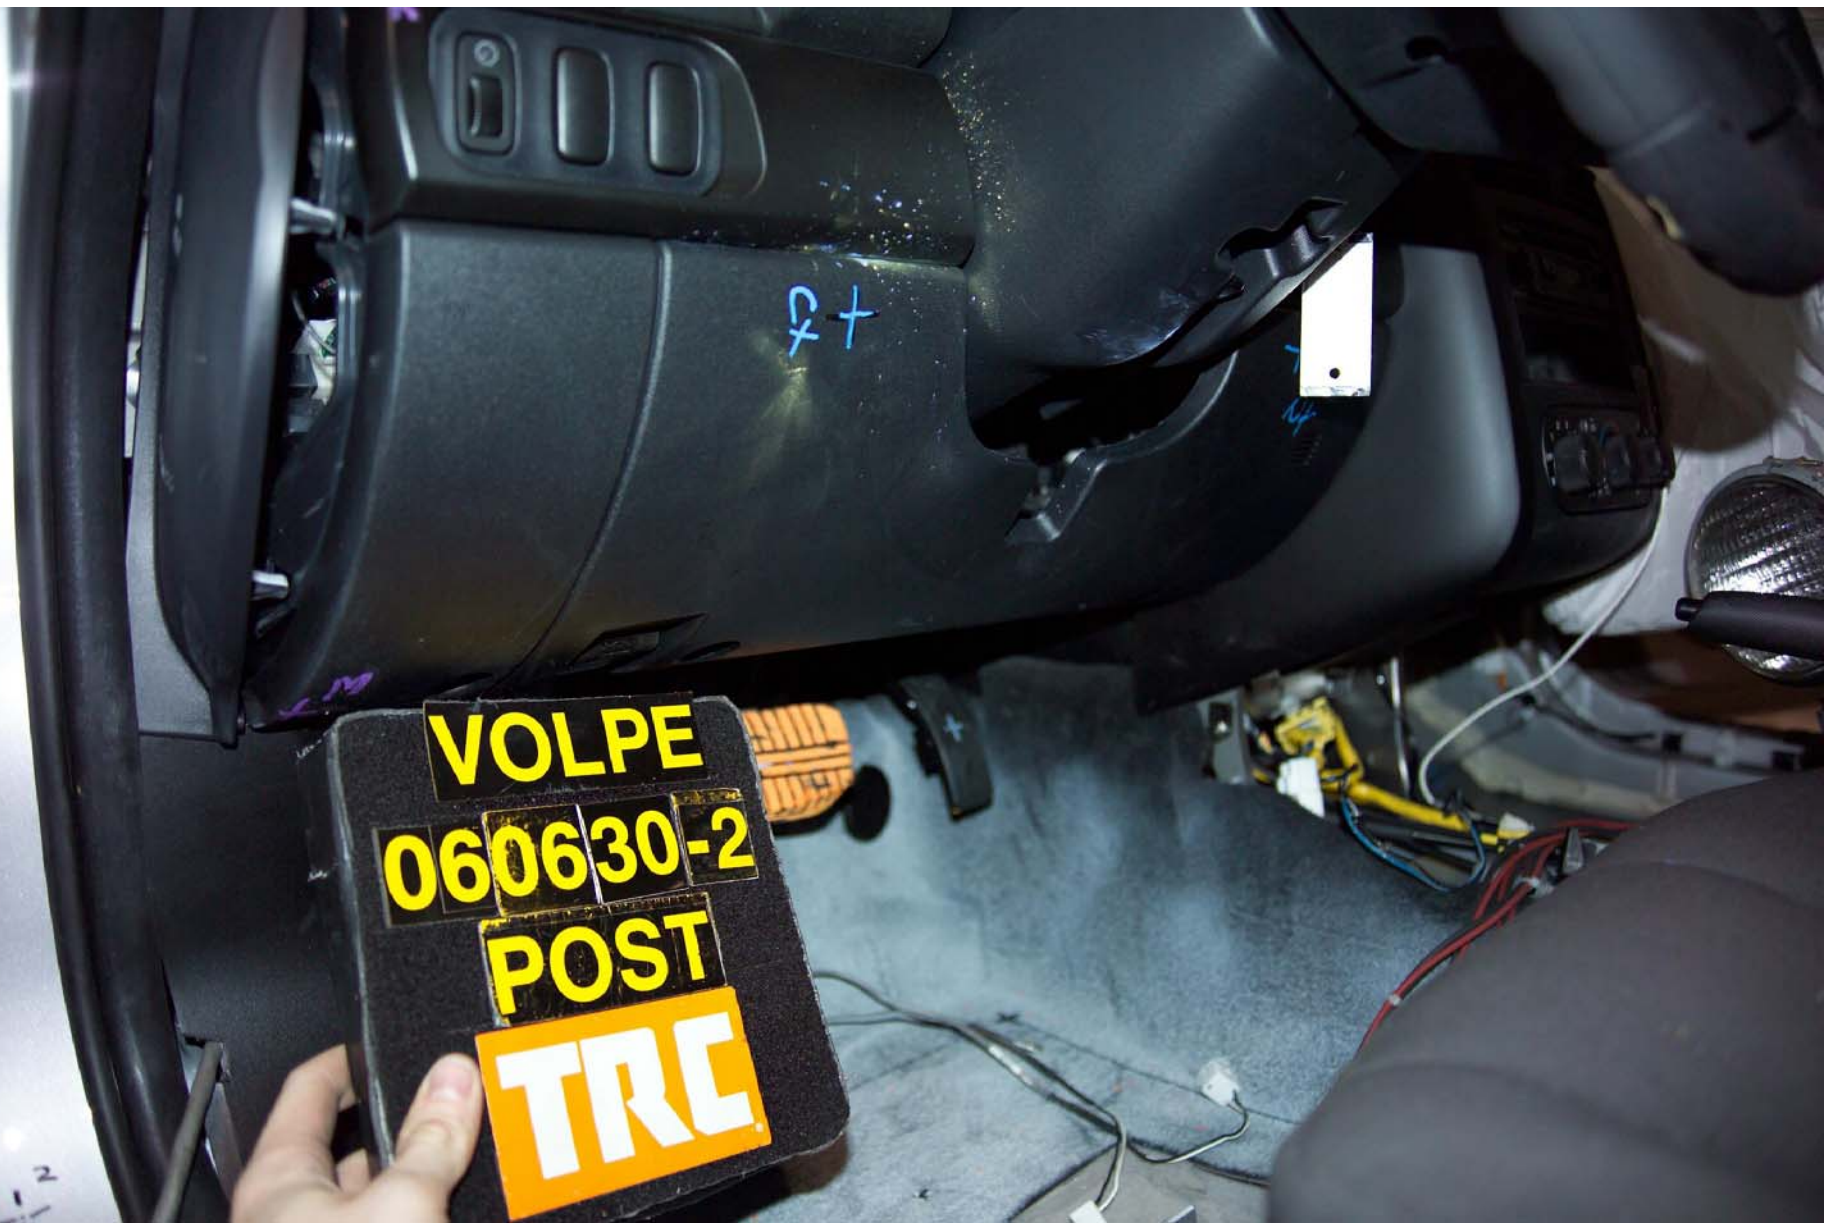


Figure A-52 Post-Test Driver Dummy Knee Contact View



Figure A-53 Pre-Test Driver Floorboard Deformation - View 1



Figure A-54 Post-Test Driver Floorboard Deformation - View 1

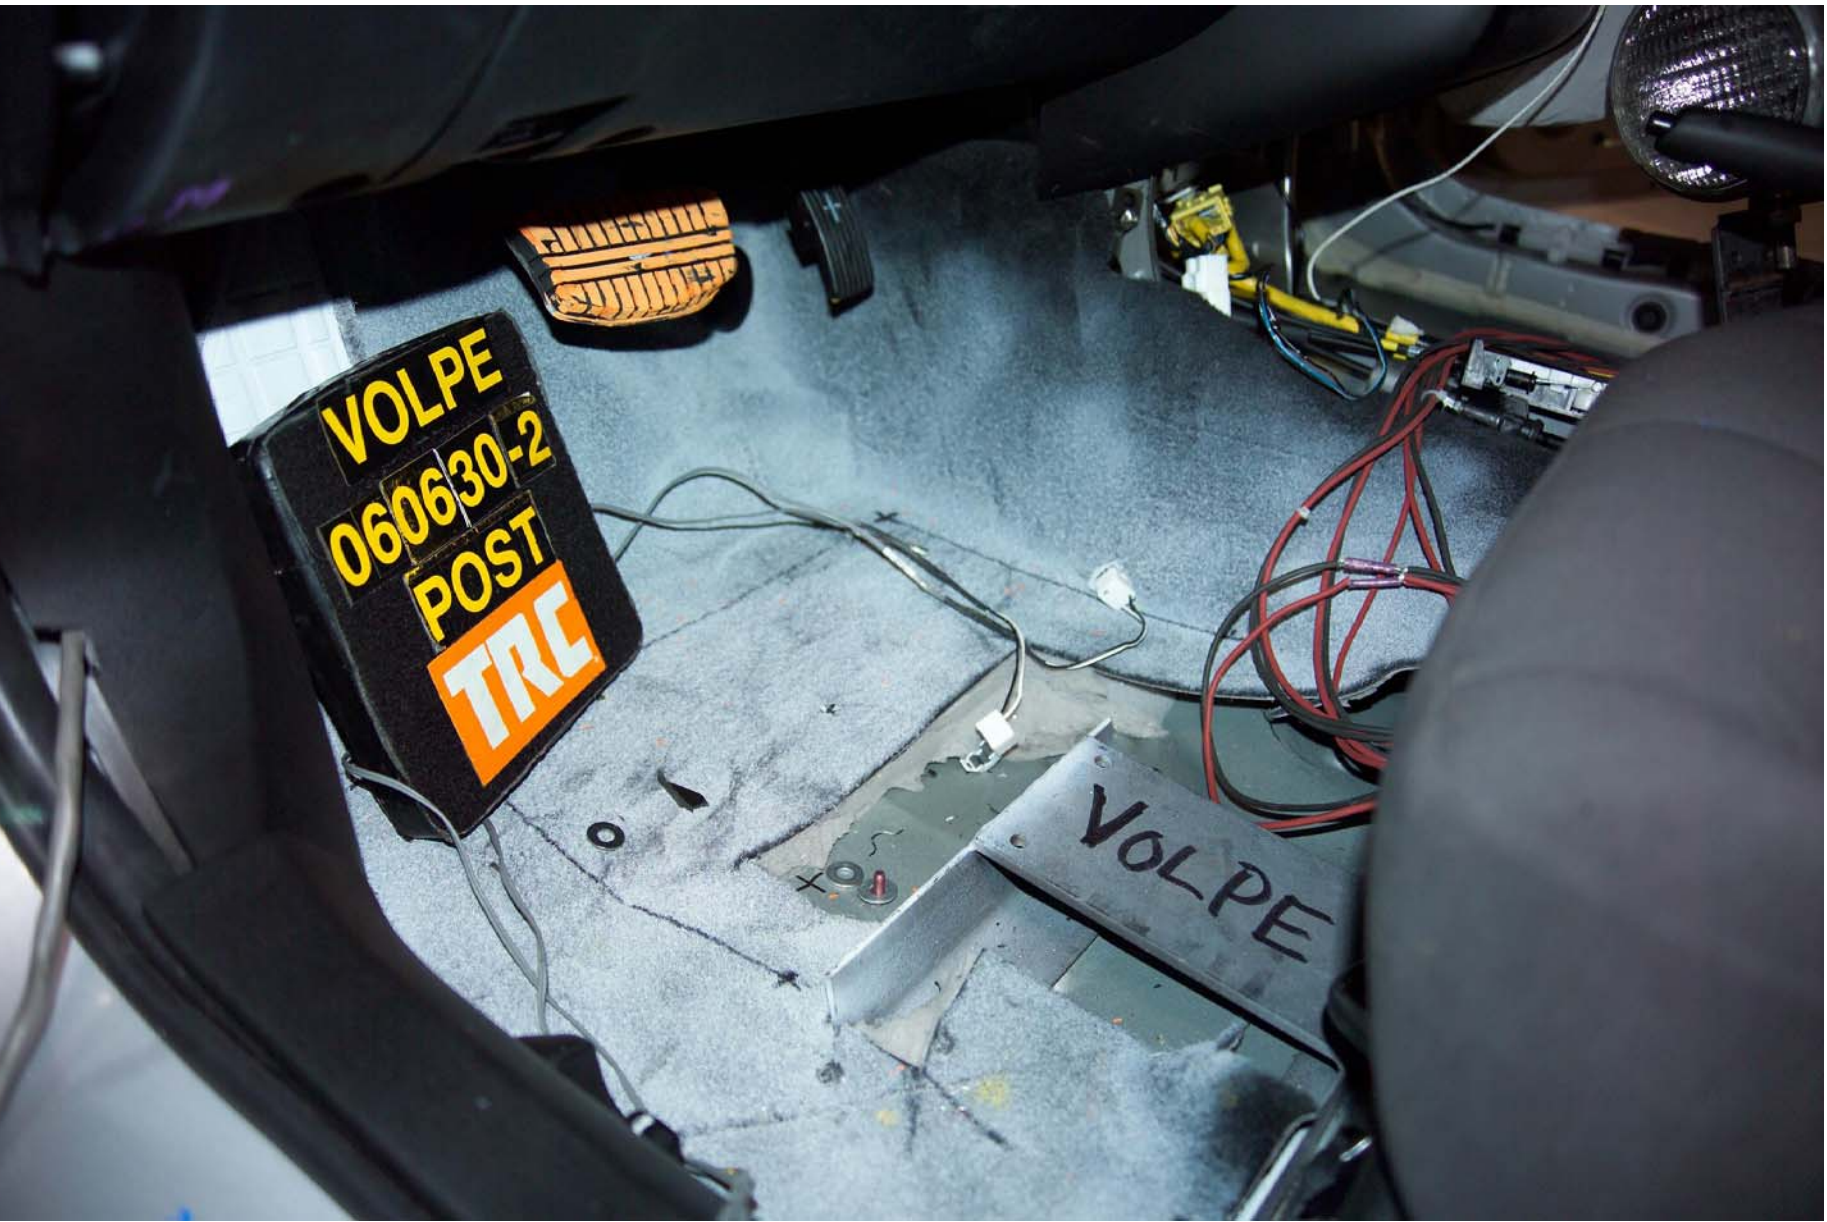


Figure A-55 Post-Test Driver Floorboard Deformation - View 2



Figure A-56 Post-Test Driver Floorboard Deformation - View 3



Figure A-57 Pre-Test Driver Toeboard Deformation View



Figure A-58 Post-Test Driver Toeboard Deformation - View 1



Figure A-59 Post-Test Driver Toeboard Deformation - View 2



Figure A-60 Post-Test Driver Toeboard Deformation - View 3



Figure A-61 Pre-Test Barrier Front View

A-62

060630-2



Figure A-62 Post-Test Barrier Front View

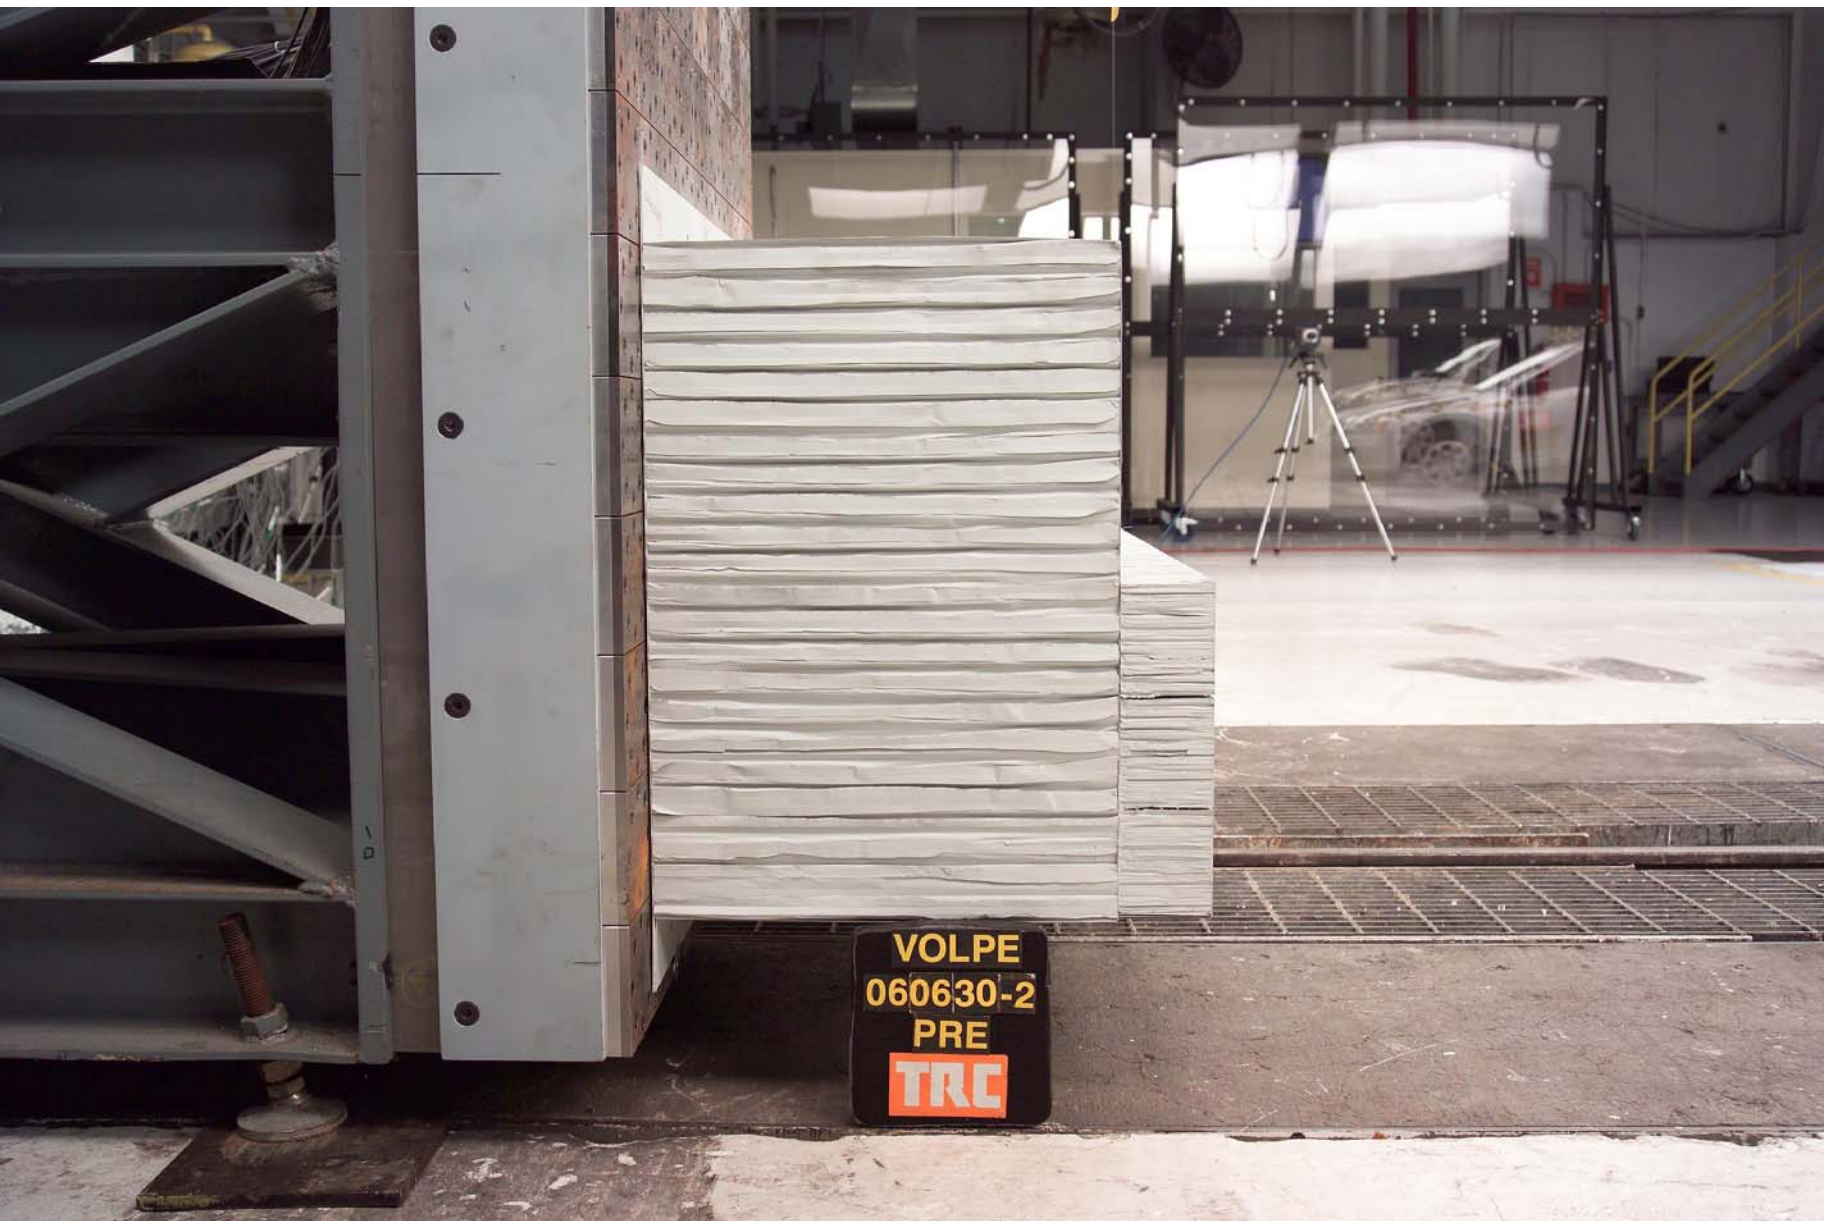


Figure A-63 Pre-Test Barrier Left Side View

A-64

060630-2



Figure A-64 Post-Test Barrier Left Side View



Figure A-65 Pre-Test Barrier Right Side View

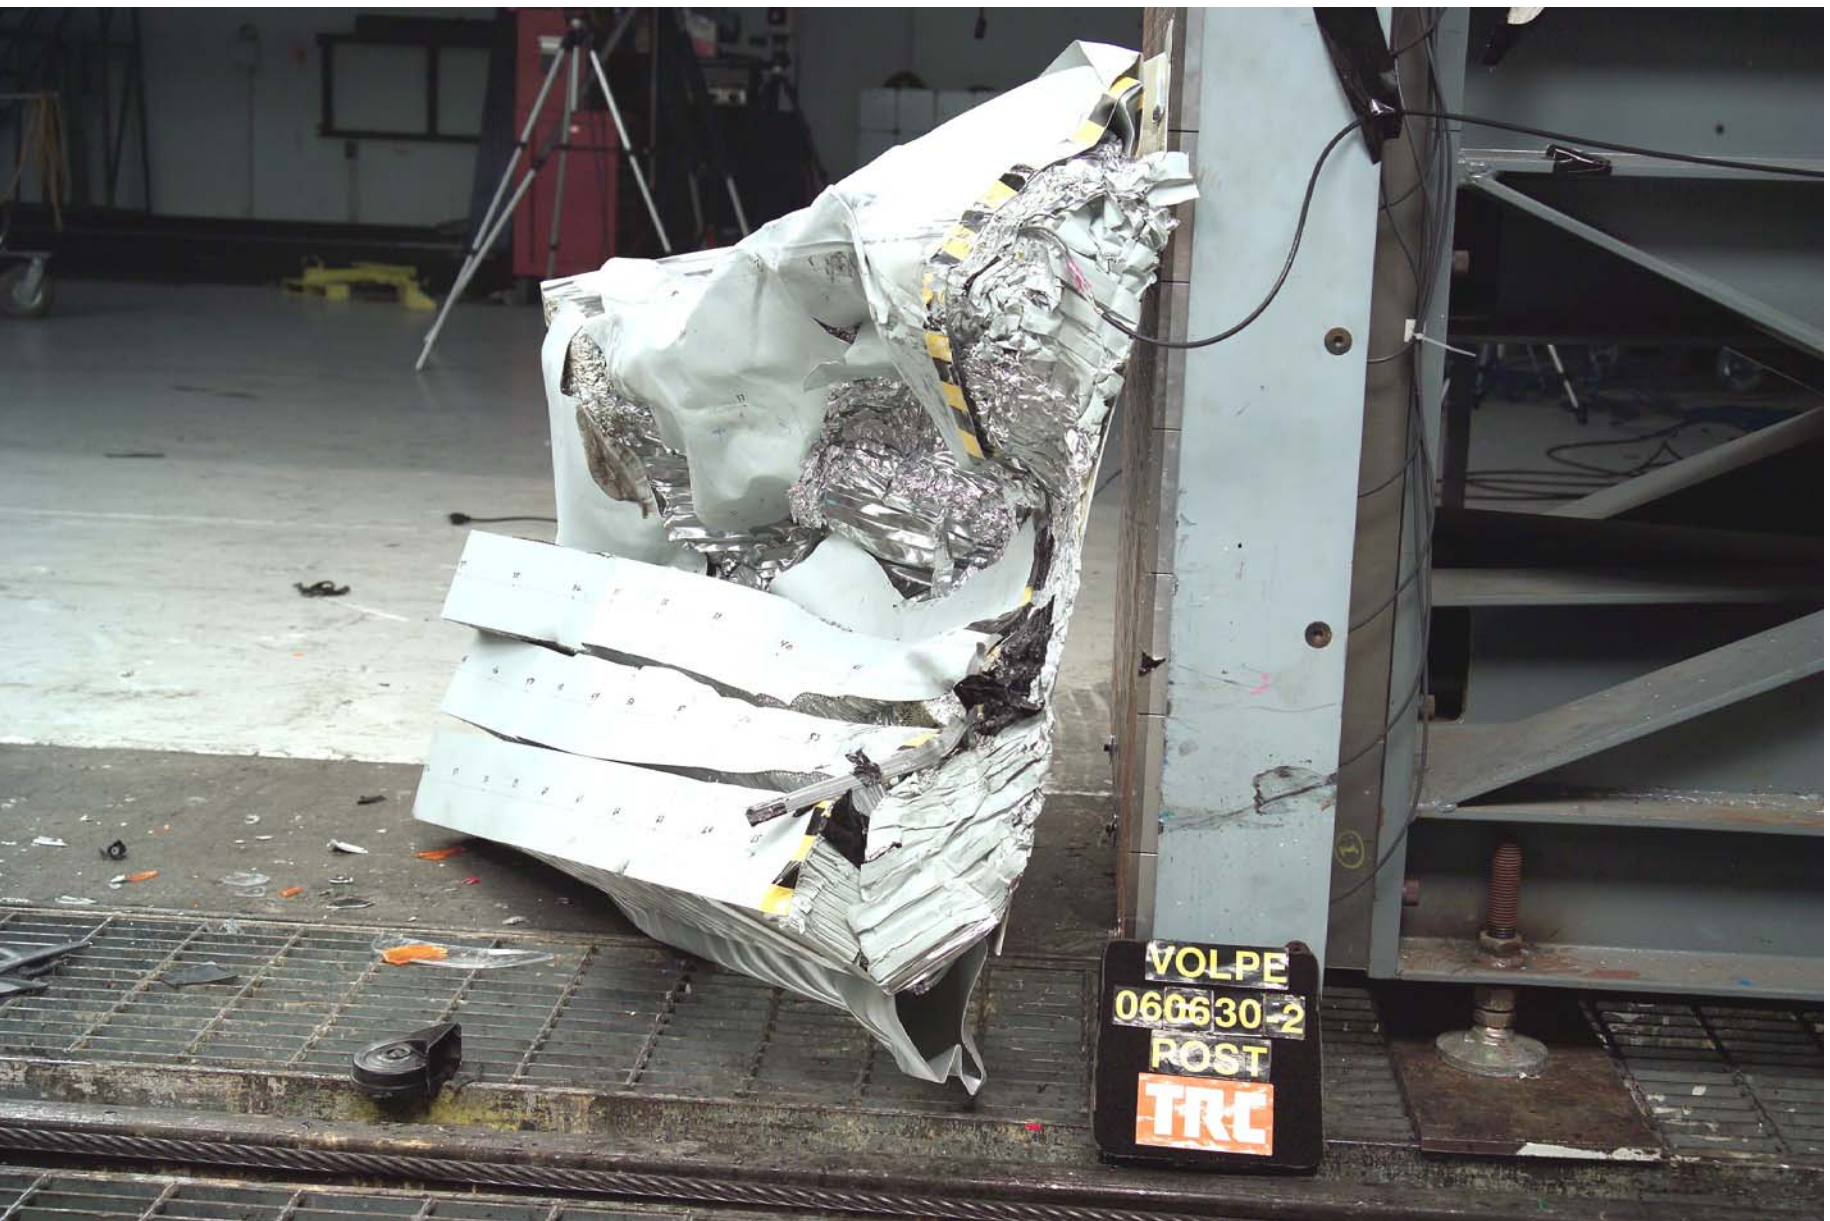


Figure A-66 Post-Test Barrier Right Side View



Figure A-67 Pre-Test Barrier Top View



Figure A-68 Post-Test Barrier Top View

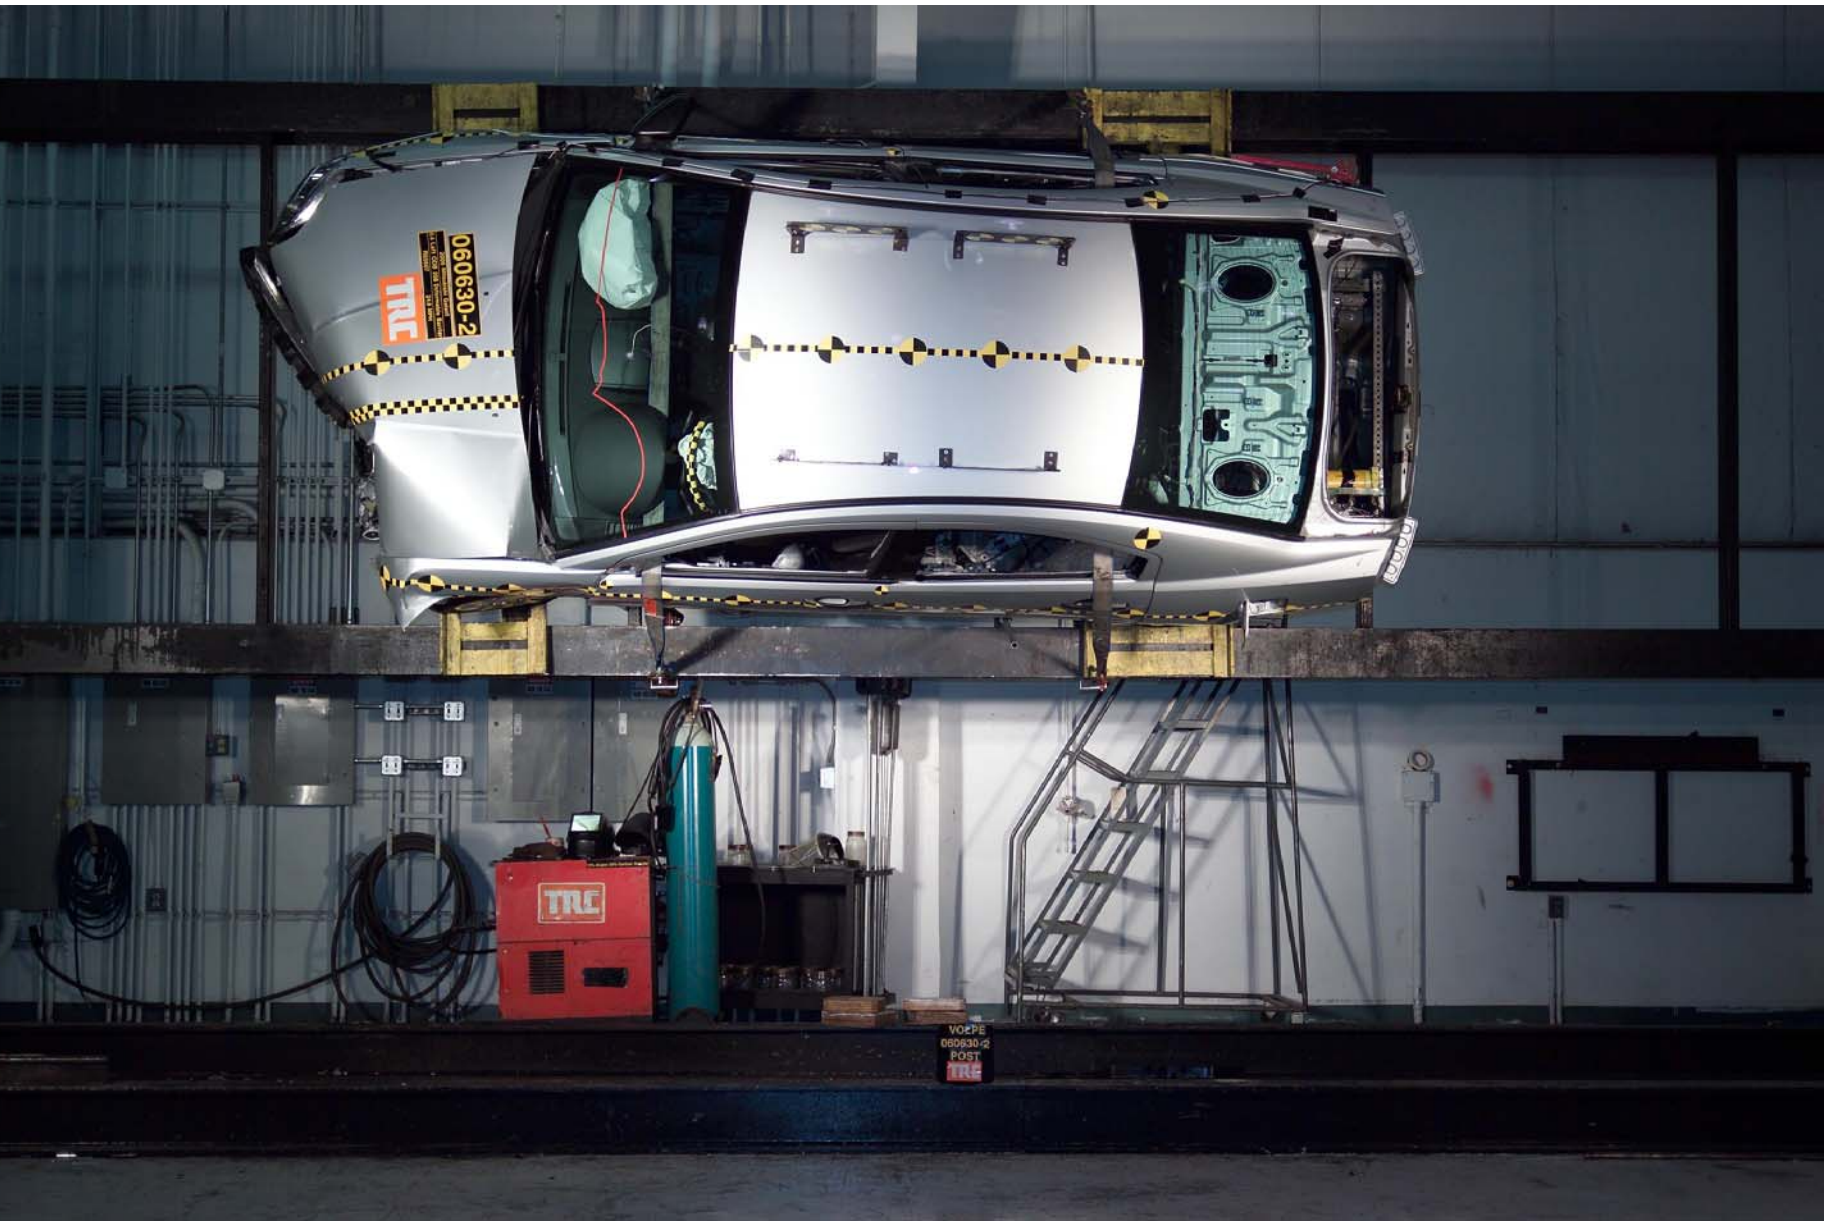


Figure A-69 Vehicle on Rollover Device - 90°

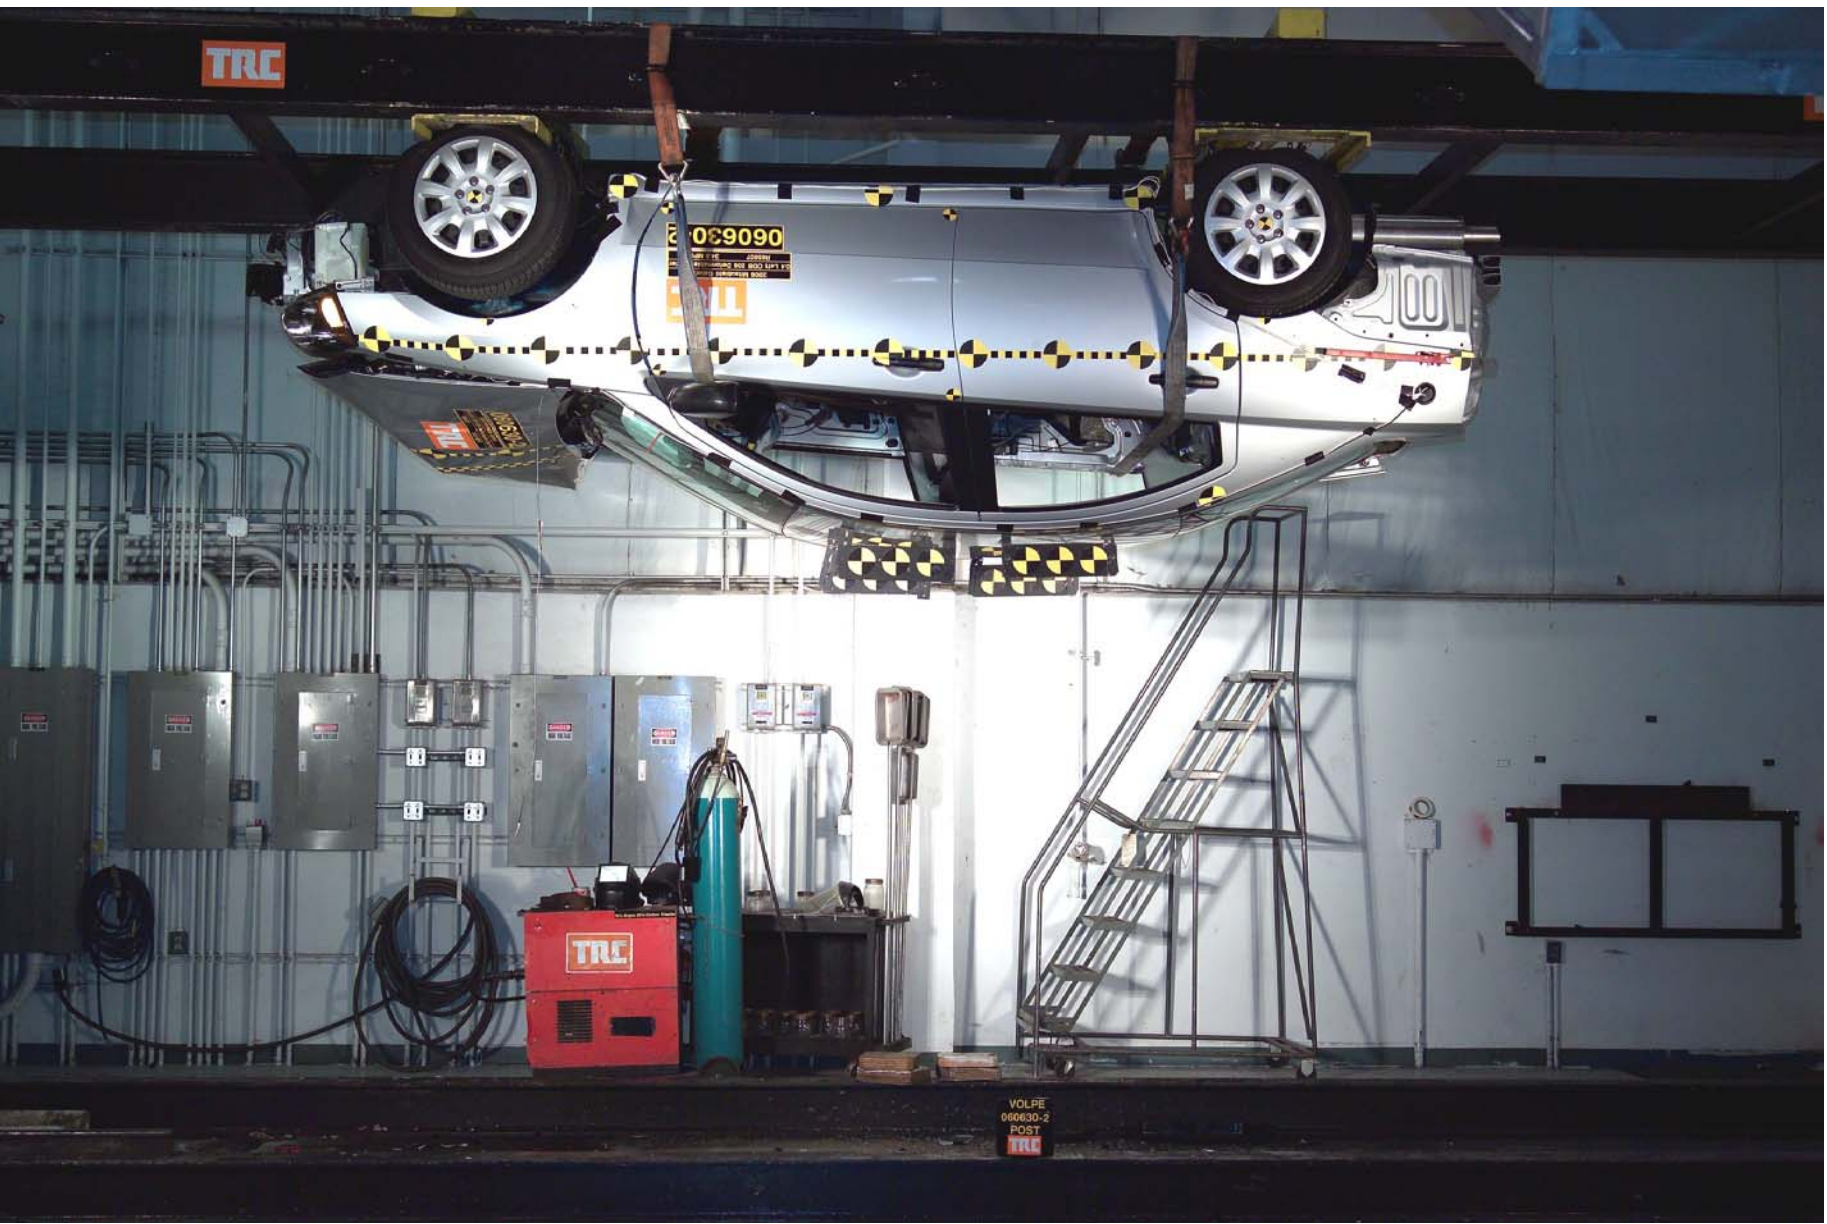


Figure A-70 Vehicle on Rollover Device - 180°

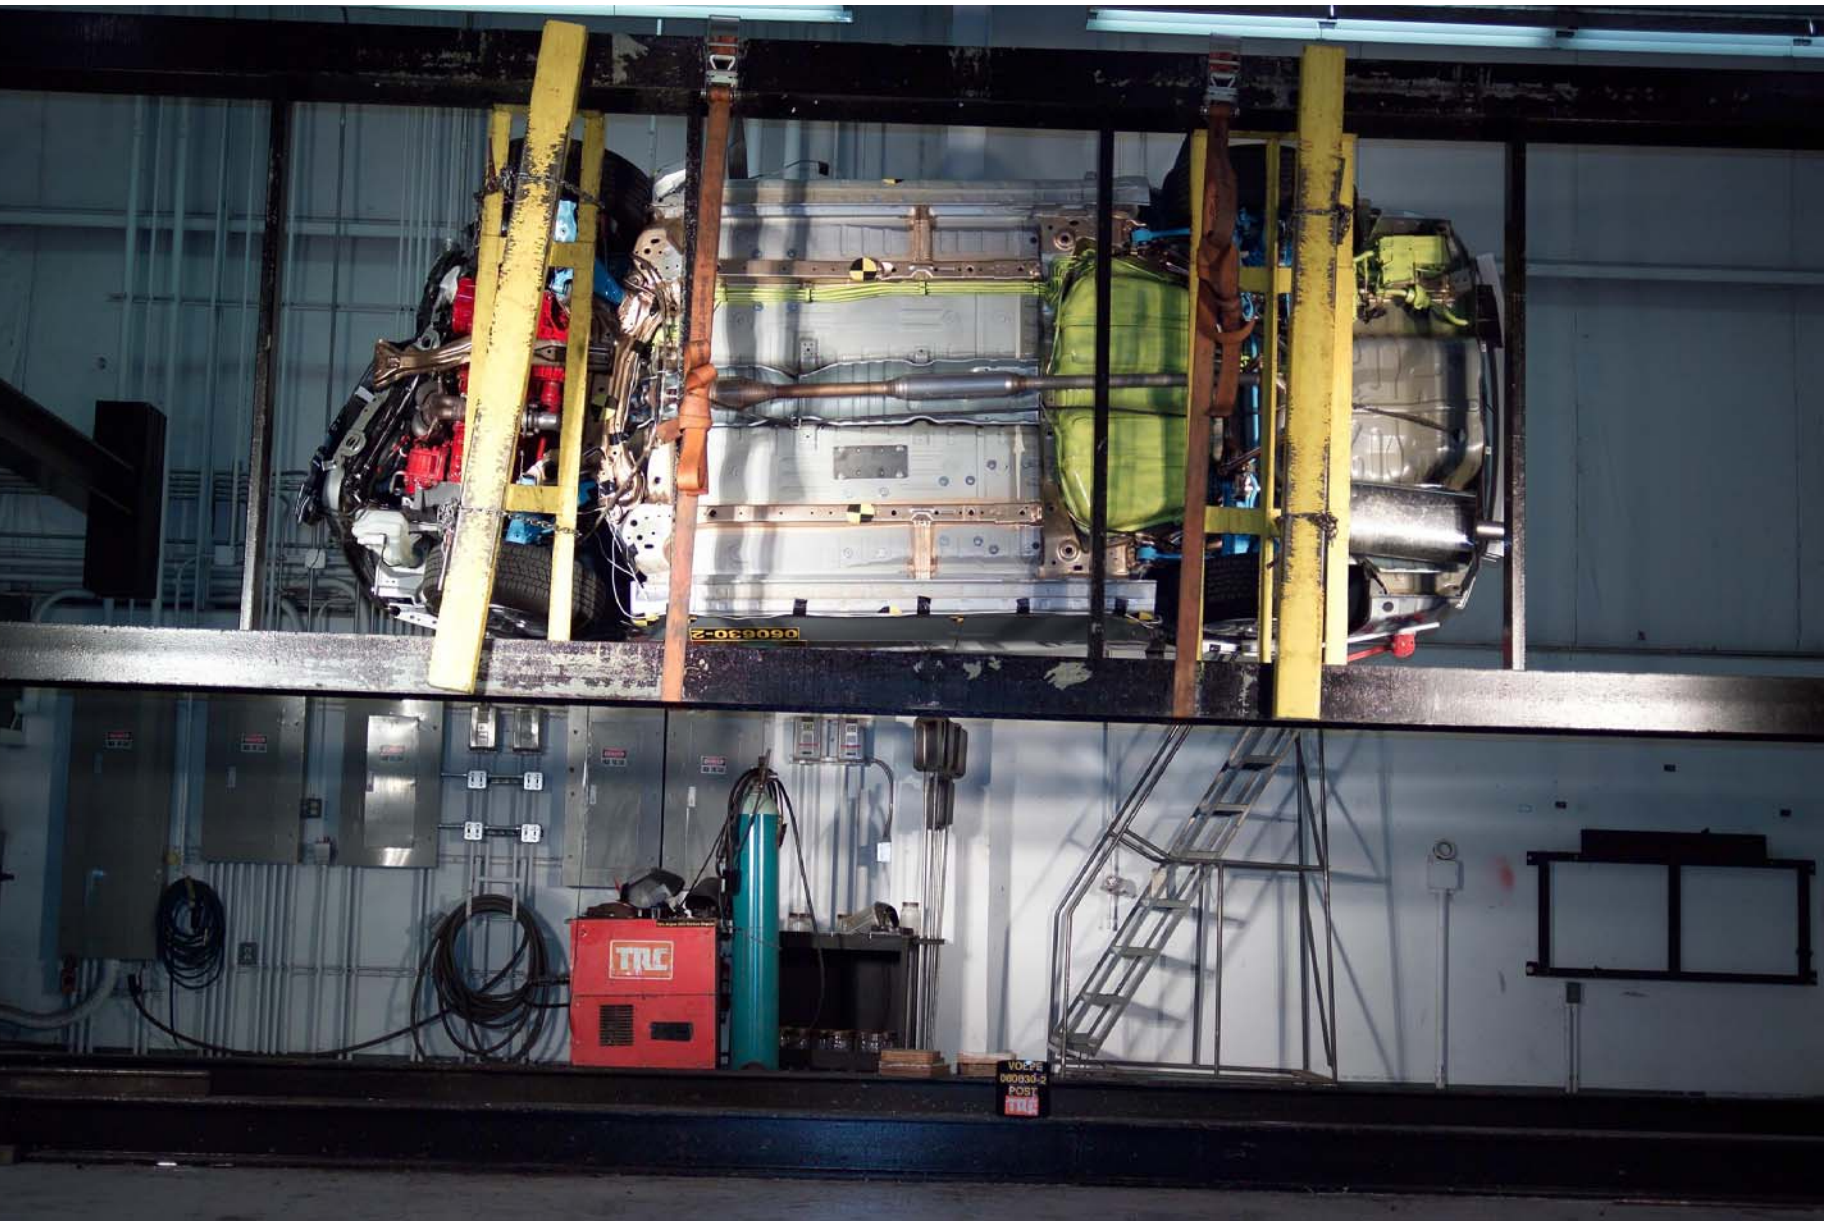


Figure A-71 Vehicle on Rollover Device - 270°

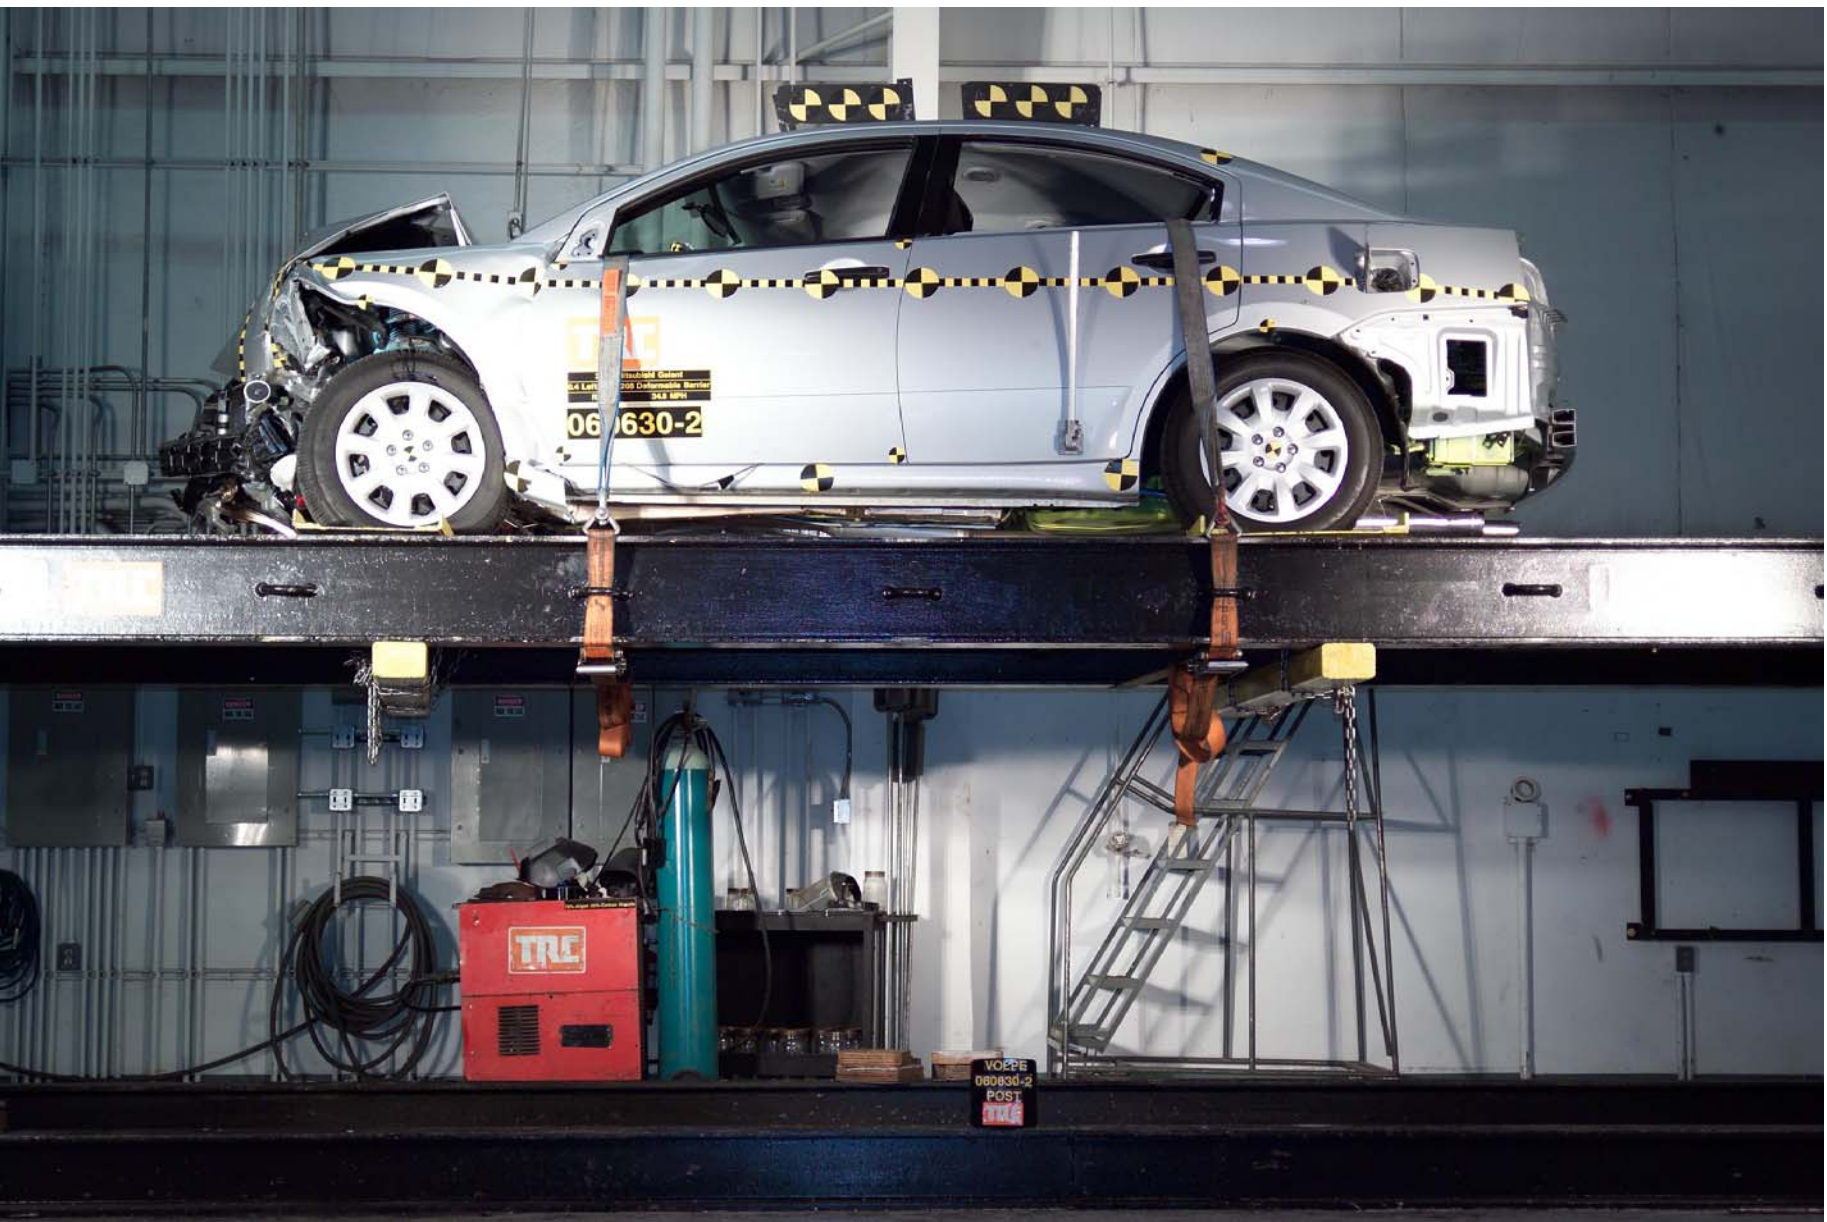


Figure A-72 Vehicle on Rollover Device - 360°



Figure A-73 Vehicle Certification Label View



Figure A-74 Vehicle Tire Load Label View

Appendix B

Dummy, Vehicle, and Load Cell Barrier Data Plots

Table of Data Plots
Curve Number Corresponds to NHTSA Database Sequence

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
1	Driver Head X-Axis Acceleration	B-8
2	Driver Head Y-Axis Acceleration	B-9
3	Driver Head Z-Axis Acceleration	B-10
--- ¹	Driver Head Resultant Acceleration	B-11
4	Driver Head X-Axis Acceleration Redundant	B-12
5	Driver Head Y-Axis Acceleration Redundant	B-13
6	Driver Head Z-Axis Acceleration Redundant	B-14
--- ¹	Driver Head Redundant Resultant Acceleration	B-15
7	Driver Head Y-Axis (FT) Acceleration	B-16
8	Driver Head Z-Axis (FT) Acceleration	B-17
9	Driver Head X-Axis (TP) Acceleration	B-18
10	Driver Head Y-Axis (TP) Acceleration	B-19
11	Driver Head X-Axis (LT) Acceleration	B-20
12	Driver Head Z-Axis (LT) Acceleration	B-21
13	Driver Neck X-Axis Shear Force	B-22
14	Driver Neck Y-Axis Shear Force	B-23
15	Driver Neck Z-Axis Axial Force	B-24
16	Driver Neck Moment About X Axis	B-25
17	Driver Neck Moment About Y Axis	B-26
18	Driver Neck Moment About Z Axis	B-27
19	Driver Neck Lower X-Axis Shear Force	B-28
20	Driver Neck Lower Y-Axis Shear Force	B-29
21	Driver Neck Lower Z-Axis Axial Force	B-30
22	Driver Neck Lower Moment About X Axis	B-31
23	Driver Neck Lower Moment About Y Axis	B-32
24	Driver Neck Lower Moment About Z Axis	B-33
25	Driver Chest X-Axis Acceleration	B-34
26	Driver Chest Y-Axis Acceleration	B-35
27	Driver Chest Z-Axis Acceleration	B-36
--- ¹	Driver Chest Resultant Acceleration	B-37
28	Driver Chest X-Axis Acceleration Redundant	B-38

Table of Data Plots, Continued

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
29	Driver Chest Y-Axis Acceleration Redundant	B-39
30	Driver Chest Z-Axis Acceleration Redundant	B-40
--- ¹	Driver Chest Redundant Resultant Acceleration	B-41
31	Driver Chest Deflection	B-42
32	Driver Left Femur Force	B-43
33	Driver Right Femur Force	B-44
34	Driver Left Knee Displacement	B-45
35	Driver Left Upper Tibia X-Axis Force	B-46
36	Driver Left Upper Tibia Z-Axis Force	B-47
37	Driver Left Upper Tibia Moment About X Axis	B-48
38	Driver Left Upper Tibia Moment About Y Axis	B-49
39	Driver Left Tibia X-Axis Acceleration	B-50
40	Driver Left Tibia Y-Axis Acceleration	B-51
41	Driver Left Lower Tibia X-Axis Force	B-52
42	Driver Left Lower Tibia Y-Axis Force	B-53
43	Driver Left Lower Tibia Z-Axis Force	B-54
44	Driver Left Lower Tibia Moment About X-Axis	B-55
45	Driver Left Lower Tibia Moment About Y-Axis	B-56
46	Driver Left Foot Angular X-Axis Rotation	B-57
47	Driver Left Foot Angular Y-Axis Rotation	B-58
48	Driver Left Foot Angular Z-Axis Rotation	B-59
49	Driver Left Foot X-Axis Acceleration	B-60
50	Driver Left Foot Y-Axis Acceleration	B-61
51	Driver Left Foot Z-Axis Acceleration	B-62
--- ¹	Driver Left Foot Resultant Acceleration	B-63
52	Driver Right Knee Displacement	B-64
53	Driver Right Upper Tibia X-Axis Force	B-65
54	Driver Right Upper Tibia Z-Axis Force	B-66
55	Driver Right Upper Tibia Moment About X-Axis	B-67
56	Driver Right Upper Tibia Moment About Y-Axis	B-68
57	Driver Right Tibia X-Axis Acceleration	B-69
58	Driver Right Tibia Y-Axis Acceleration	B-70

Table of Data Plots, Continued

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
59	Driver Right Lower Tibia X-Axis Force	B-71
60	Driver Right Lower Tibia Y-Axis Force	B-72
61	Driver Right Lower Tibia Z-Axis Force	B-73
62	Driver Right Lower Tibia Moment About X-Axis	B-74
63	Driver Right Lower Tibia Moment About Y-Axis	B-75
64	Driver Right Foot to Ankle X-Axis Rotation	B-76
65	Driver Right Foot to Ankle Y-Axis Rotation	B-77
66	Driver Right Foot to Ankle Z-Axis Rotation	B-78
67	Driver Right Foot X-Axis Acceleration	B-79
68	Driver Right Foot Y-Axis Acceleration	B-80
69	Driver Right Foot Z-Axis Acceleration	B-81
--- ¹	Driver Right Foot Resultant Acceleration	B-82
70	Left Rear Seat Crossmember X-Axis Acceleration	B-83
71	Right Rear Seat Crossmember X-Axis Acceleration	B-84
72	Left Rear Seat Crossmember Y-Axis Acceleration	B-85
73	Right Rear Seat Crossmember Y-Axis Acceleration	B-86
74	Top of Engine Block X-Axis Acceleration	B-87
75	Bottom of Engine Block X-Axis Acceleration	B-88
76	Right Front Brake Caliper X-Axis Acceleration	B-89
77	Left Front Brake Caliper X-Axis Acceleration	B-90
78	Instrument Panel X-Axis Acceleration	B-91
79	Left Side Driver Mid Seat Track X-Axis Acceleration	B-92
80	Vehicle CG X-Axis Acceleration	B-93
81	Vehicle CG X-Axis Velocity	B-94
82	Vehicle CG X-Axis Displacement	B-95
83	Vehicle CG Y-Axis Acceleration	B-96
84	Vehicle CG Y-Axis Velocity	B-97
85	Vehicle CG Y-Axis Displacement	B-98
86	Vehicle CG Z-Axis Acceleration	B-99
87	Vehicle CG Z-Axis Velocity	B-100
88	Vehicle CG Z-Axis Displacement	B-101
89	Vehicle CG Resultant Acceleration	B-102

Table of Data Plots, Continued

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
90	Driver Front Airbag 1 Inductive	B-103
91	Driver Front Airbag 2 Inductive	B-104
92	Driver Lap Belt	B-105
93	Driver Shoulder Belt	B-106
94	Load Cell Row 1 Column 1	B-107
95	Load Cell Row 2 Column 1	B-108
96	Load Cell Row 3 Column 1	B-109
97	Load Cell Row 4 Column 1	B-110
98	Load Cell Row 5 Column 1	B-111
99	Load Cell Row 6 Column 1	B-112
100	Load Cell Row 7 Column 1	B-113
101	Load Cell Row 8 Column 1	B-114
102	Load Cell Row 9 Column 1	B-115
103	Load Cell Row 10 Column 1	B-116
104	Load Cell Row 1 Column 2	B-117
105	Load Cell Row 2 Column 2	B-118
106	Load Cell Row 3 Column 2	B-119
107	Load Cell Row 4 Column 2	B-120
108	Load Cell Row 5 Column 2	B-121
109	Load Cell Row 6 Column 2	B-122
110	Load Cell Row 7 Column 2	B-123
111	Load Cell Row 8 Column 2	B-124
112	Load Cell Row 9 Column 2	B-125
113	Load Cell Row 10 Column 2	B-126
114	Load Cell Row 1 Column 3	B-127
115	Load Cell Row 2 Column 3	B-128
116	Load Cell Row 3 Column 3	B-129
117	Load Cell Row 4 Column 3	B-130
118	Load Cell Row 5 Column 3	B-131
119	Load Cell Row 6 Column 3	B-132
120	Load Cell Row 7 Column 3	B-133
121	Load Cell Row 8 Column 3	B-134

Table of Data Plots, Continued

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
122	Load Cell Row 9 Column 3	B-135
123	Load Cell Row 10 Column 3	B-136
124	Load Cell Row 1 Column 4	B-137
125	Load Cell Row 2 Column 4	B-138
126	Load Cell Row 3 Column 4	B-139
127	Load Cell Row 4 Column 4	B-140
128	Load Cell Row 5 Column 4	B-141
129	Load Cell Row 6 Column 4	B-142
130	Load Cell Row 7 Column 4	B-143
131	Load Cell Row 8 Column 4	B-144
132	Load Cell Row 9 Column 4	B-145
133	Load Cell Row 10 Column 4	B-146
134	Load Cell Row 1 Column 5	B-147
135	Load Cell Row 2 Column 5	B-148
136	Load Cell Row 3 Column 5	B-149
137	Load Cell Row 4 Column 5	B-150
138	Load Cell Row 5 Column 5	B-151
139	Load Cell Row 6 Column 5	B-152
140	Load Cell Row 7 Column 5	B-153
141	Load Cell Row 8 Column 5	B-154
142	Load Cell Row 9 Column 5	B-155
143	Load Cell Row 10 Column 5	B-156
144	Load Cell Row 1 Column 6	B-157
145	Load Cell Row 2 Column 6	B-158
146	Load Cell Row 3 Column 6	B-159
147	Load Cell Row 4 Column 6	B-160
148	Load Cell Row 5 Column 6	B-161
149	Load Cell Row 6 Column 6	B-162
150	Load Cell Row 7 Column 6	B-163
151	Load Cell Row 8 Column 6	B-164
152	Load Cell Row 9 Column 6	B-165

Table of Data Plots, Continued

<u>Curve No.</u>	<u>Data Plot Title</u>	<u>Page</u>
153	Load Cell Row 10 Column 6	B-166
154	Load Cell Row 1 Column 7	B-167
155	Load Cell Row 2 Column 7	B-168
156	Load Cell Row 3 Column 7	B-169
157	Load Cell Row 4 Column 7	B-170
158	Load Cell Row 5 Column 7	B-171
159	Load Cell Row 6 Column 7	B-172
160	Load Cell Row 7 Column 7	B-173
161	Load Cell Row 8 Column 7	B-174
162	Load Cell Row 9 Column 7	B-175
163	Load Cell Row 10 Column 7	B-176
164	Load Cell Row 1 Column 8	B-177
165	Load Cell Row 2 Column 8	B-178
166	Load Cell Row 3 Column 8	B-179
167	Load Cell Row 4 Column 8	B-180
168	Load Cell Row 5 Column 8	B-181
169	Load Cell Row 6 Column 8	B-182
170	Load Cell Row 7 Column 8	B-183
171	Load Cell Row 8 Column 8	B-184
172	Load Cell Row 9 Column 8	B-185
173	Load Cell Row 10 Column 8	B-186
174	Load Cell Row 1 Column 9	B-187
175	Load Cell Row 2 Column 9	B-188
176	Load Cell Row 3 Column 9	B-189
177	Load Cell Row 4 Column 9	B-190
178	Load Cell Row 5 Column 9	B-191
179	Load Cell Row 6 Column 9	B-192
180	Load Cell Row 7 Column 9	B-193
181	Load Cell Row 8 Column 9	B-194
182	Load Cell Row 9 Column 9	B-195
183	Load Cell Row 10 Column 9	B-196

¹ Curve is not included in NHTSA database.



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head X-Axis Acceleration

Customer: Volpe

11HEADCG00H3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

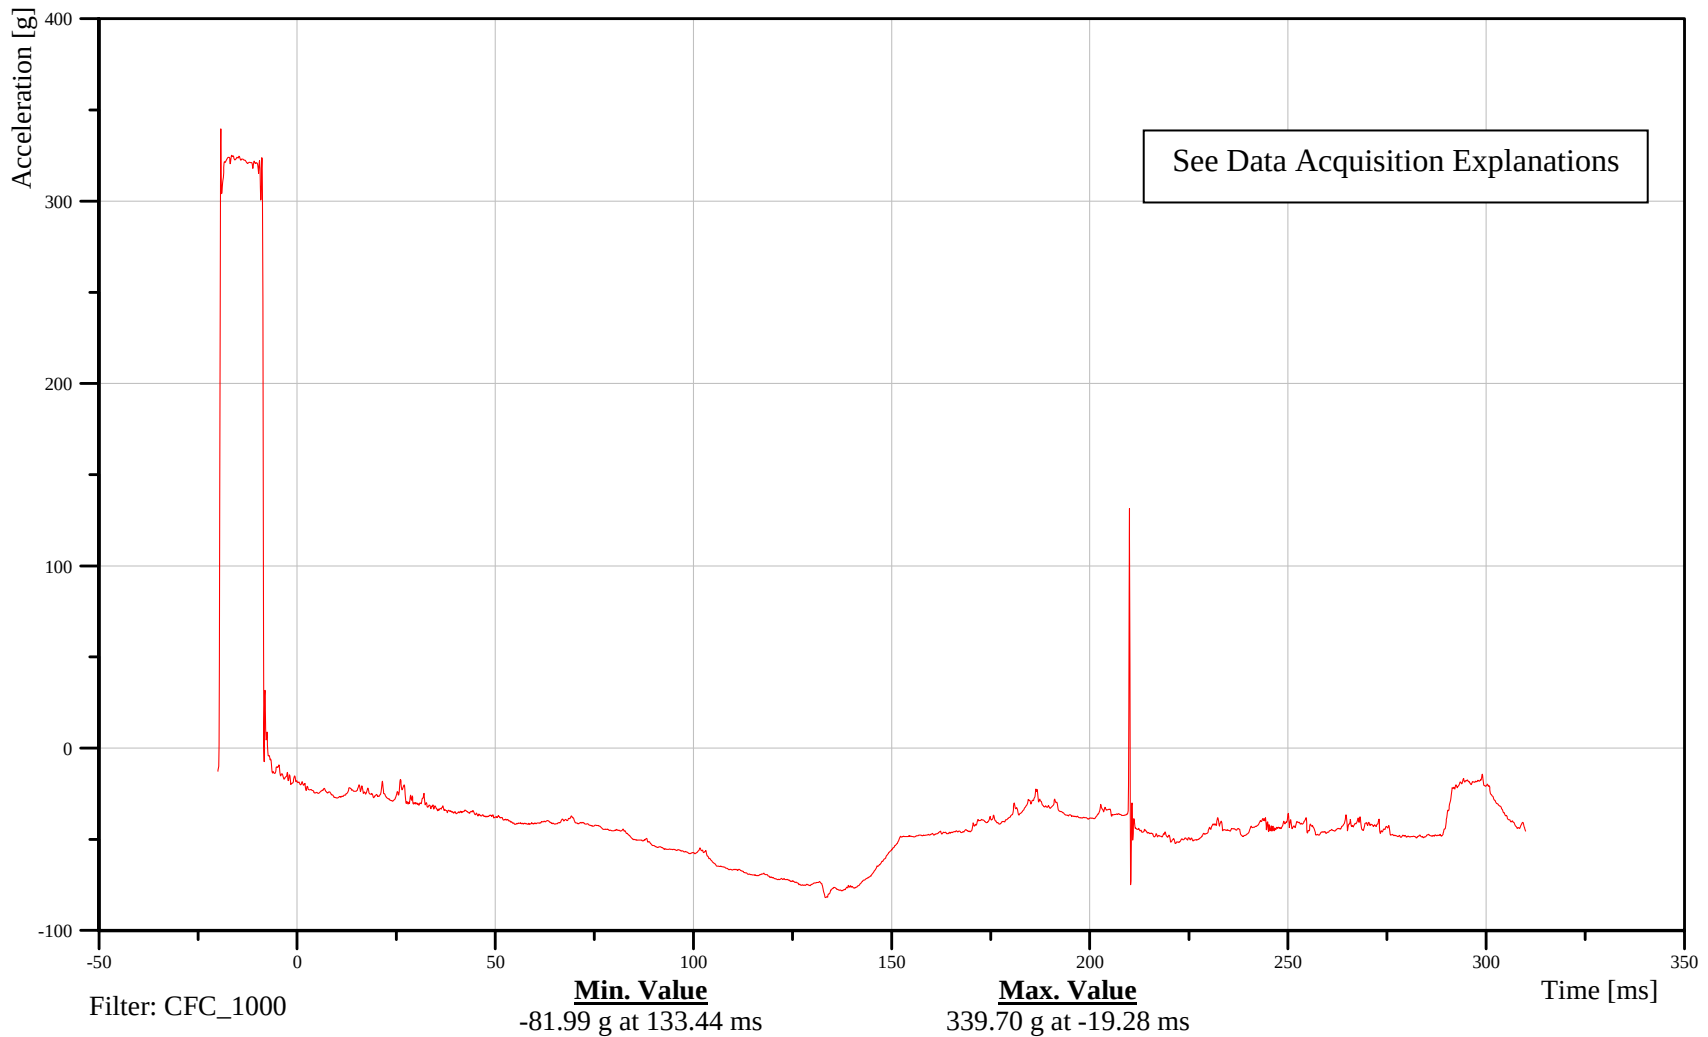

B-8

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Y-Axis Acceleration

Customer: Volpe

11HEADCG00H3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

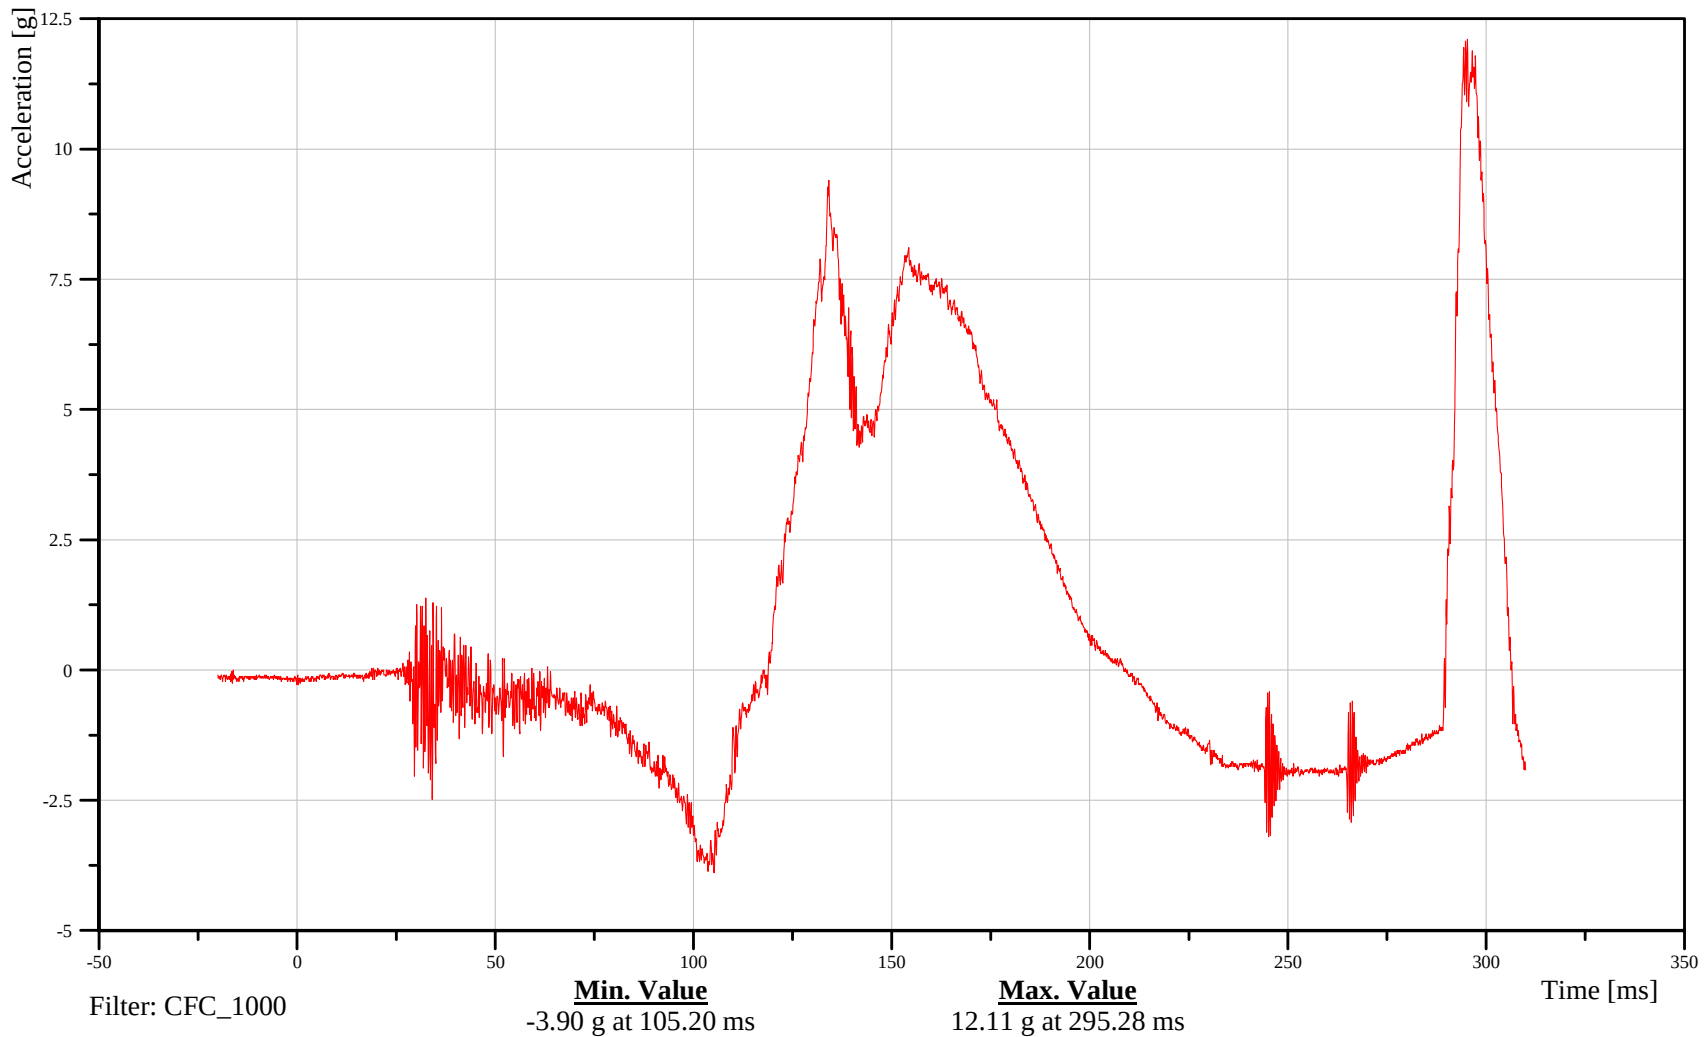

B-9

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Z-Axis Acceleration

Customer: Volpe

11HEADCG00H3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

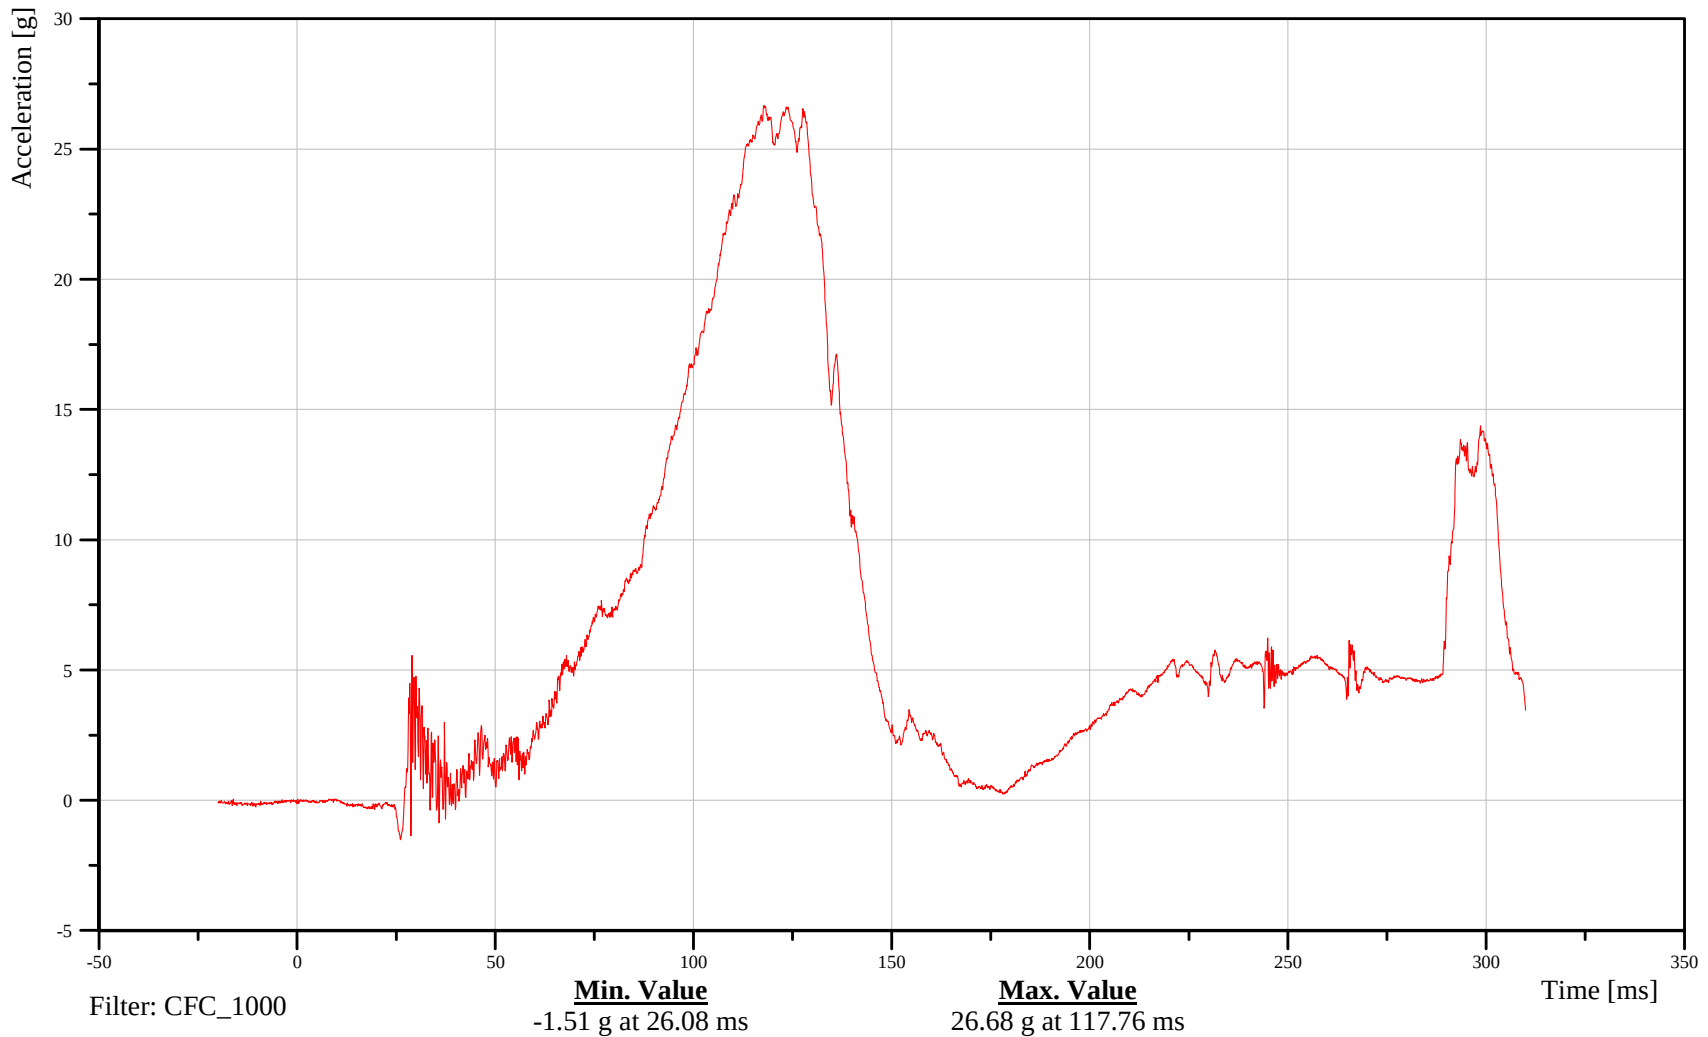

B-10

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Resultant Acceleration

Customer: Volpe

11HEADCG00H3ACRA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

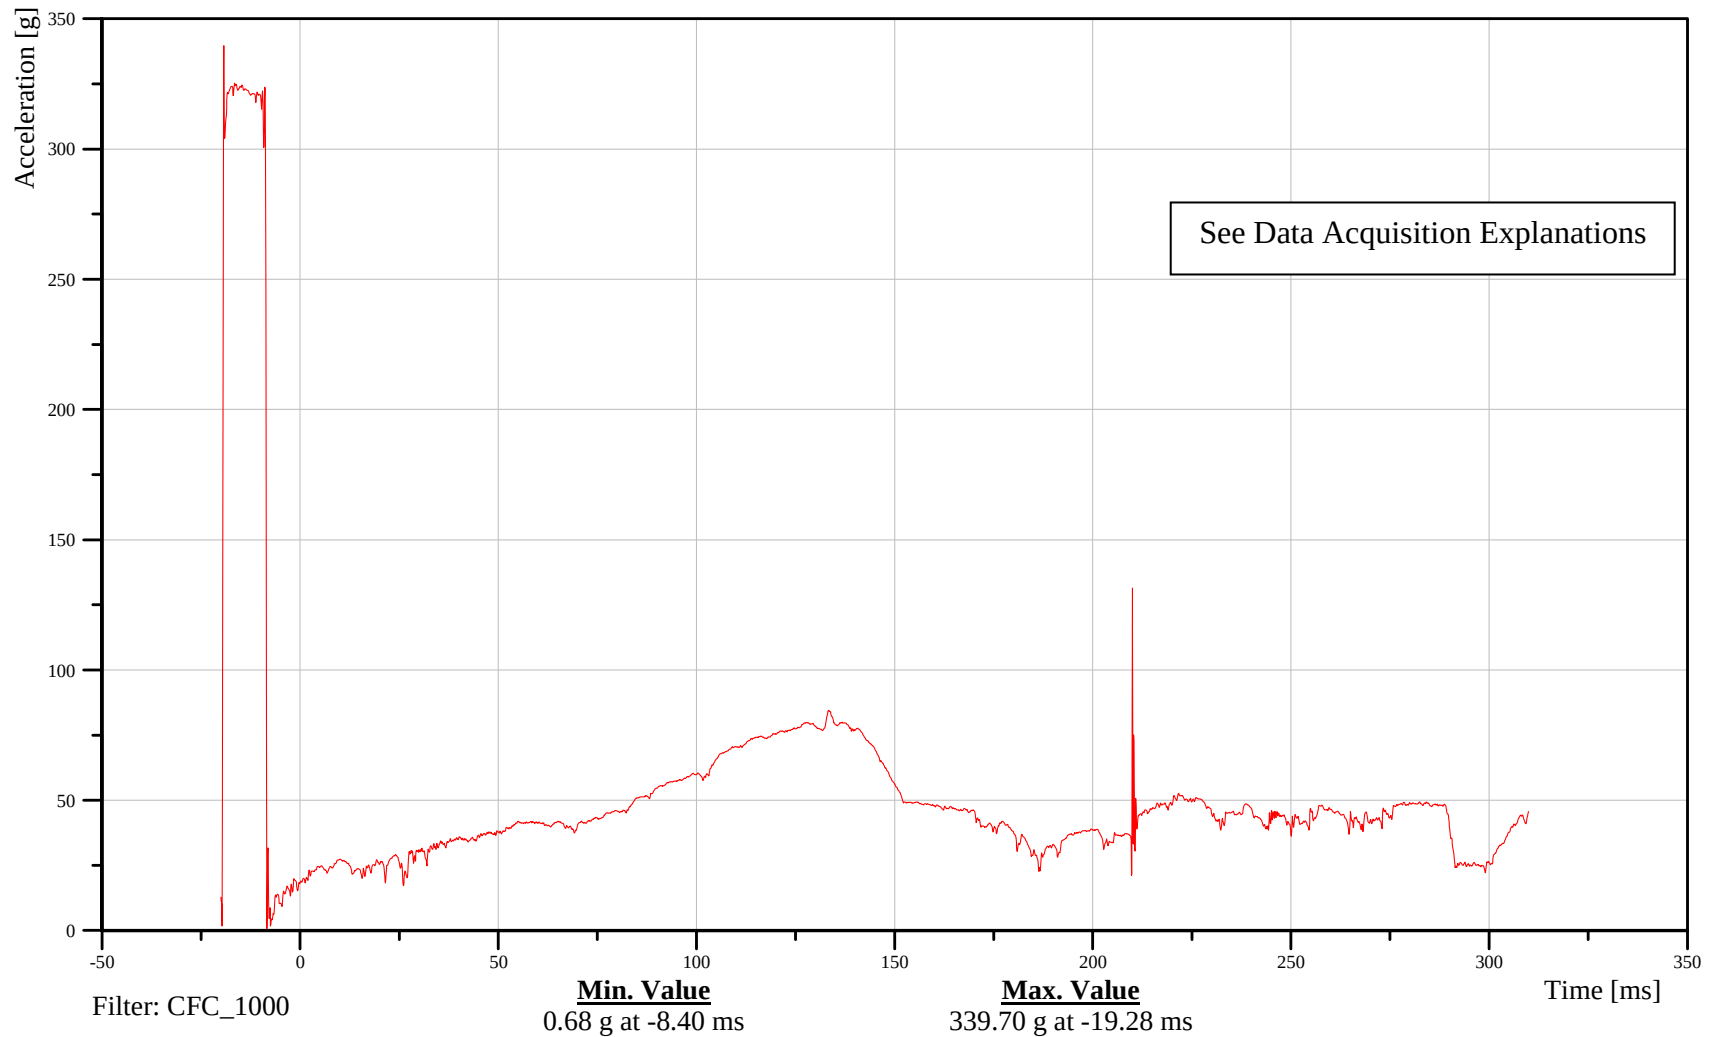

B-11

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head X-Axis Redundant Acceleration

Customer: Volpe

11HEADCGRDH3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

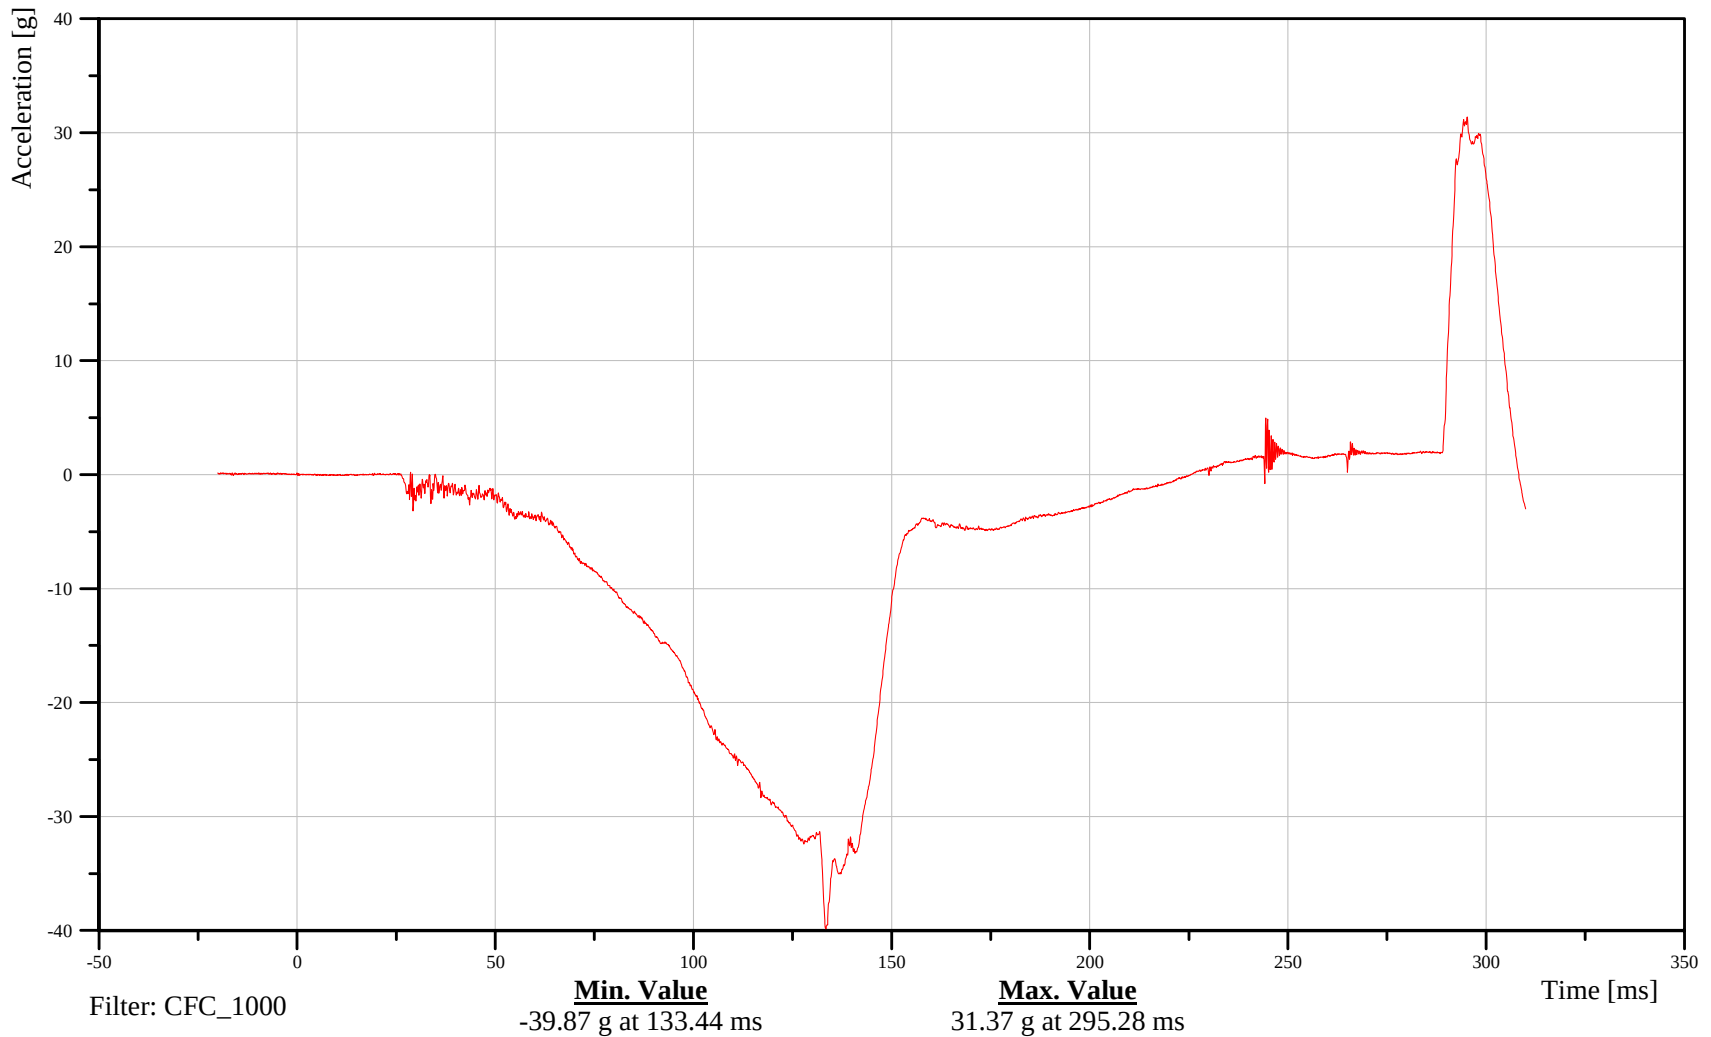

B-12

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Y-Axis Redundant Acceleration

Customer: Volpe

11HEADCGRDH3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

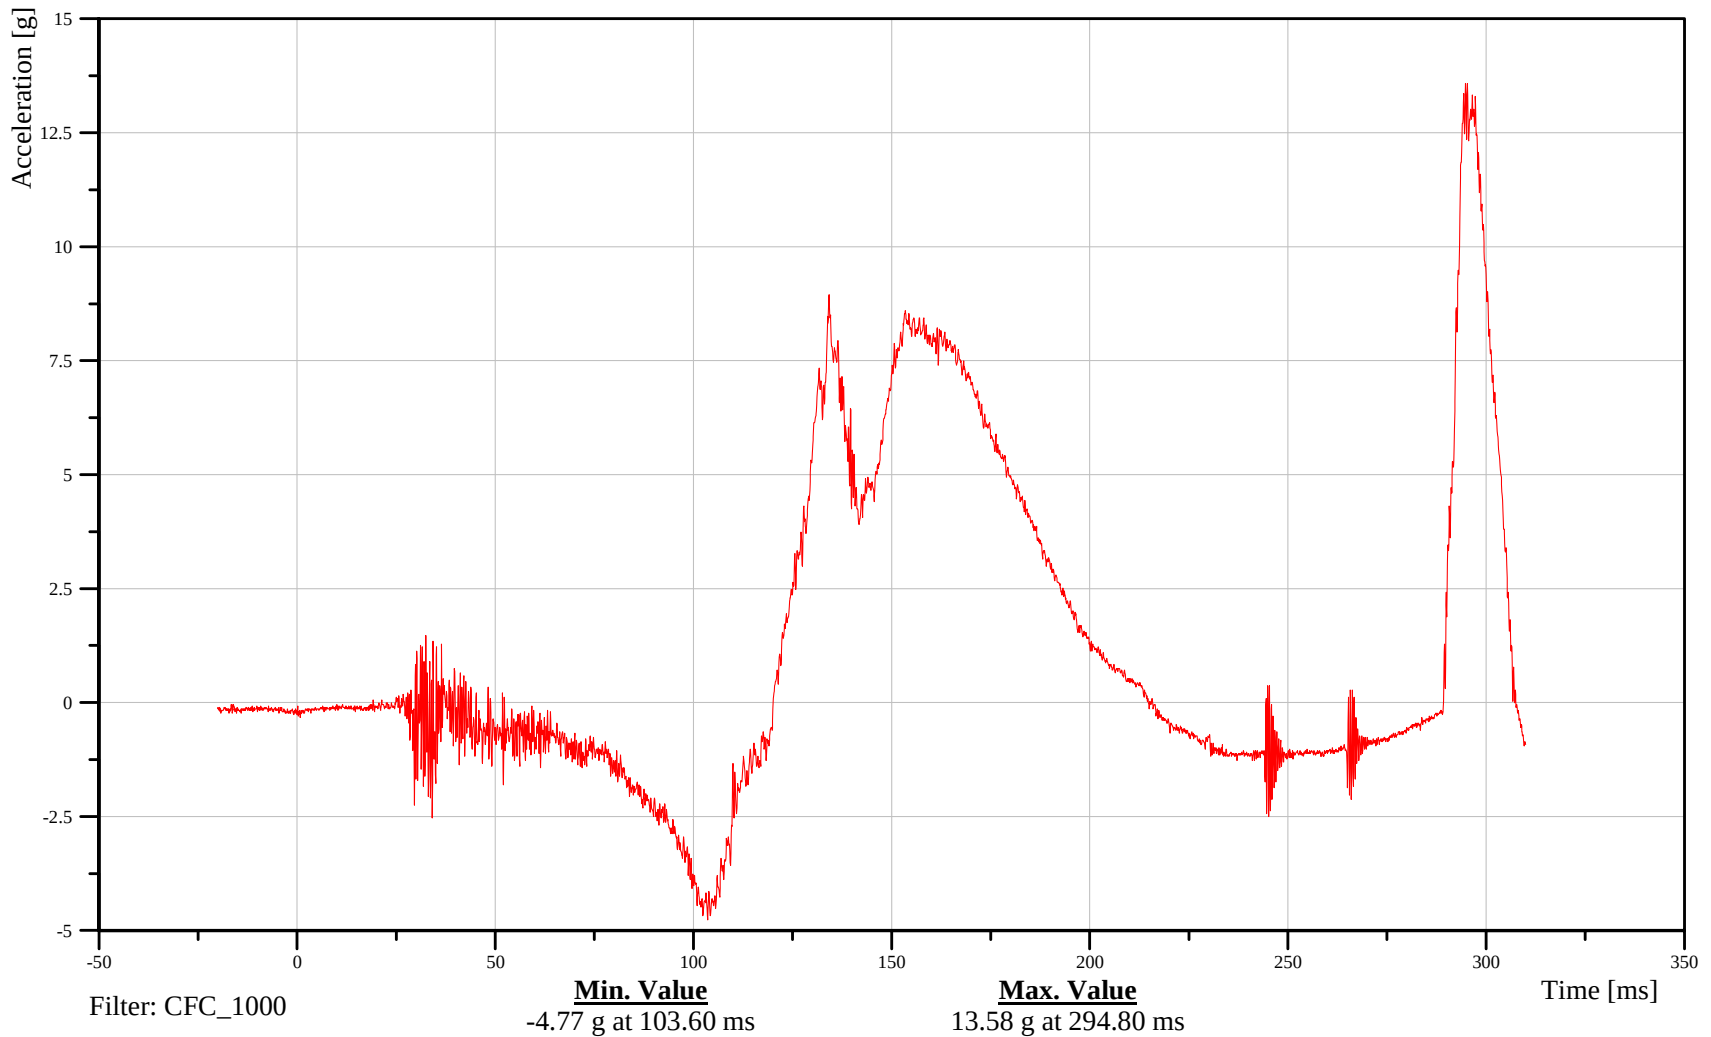

B-13

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Z-Axis Redundant Acceleration

Customer: Volpe

11HEADCGRDH3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

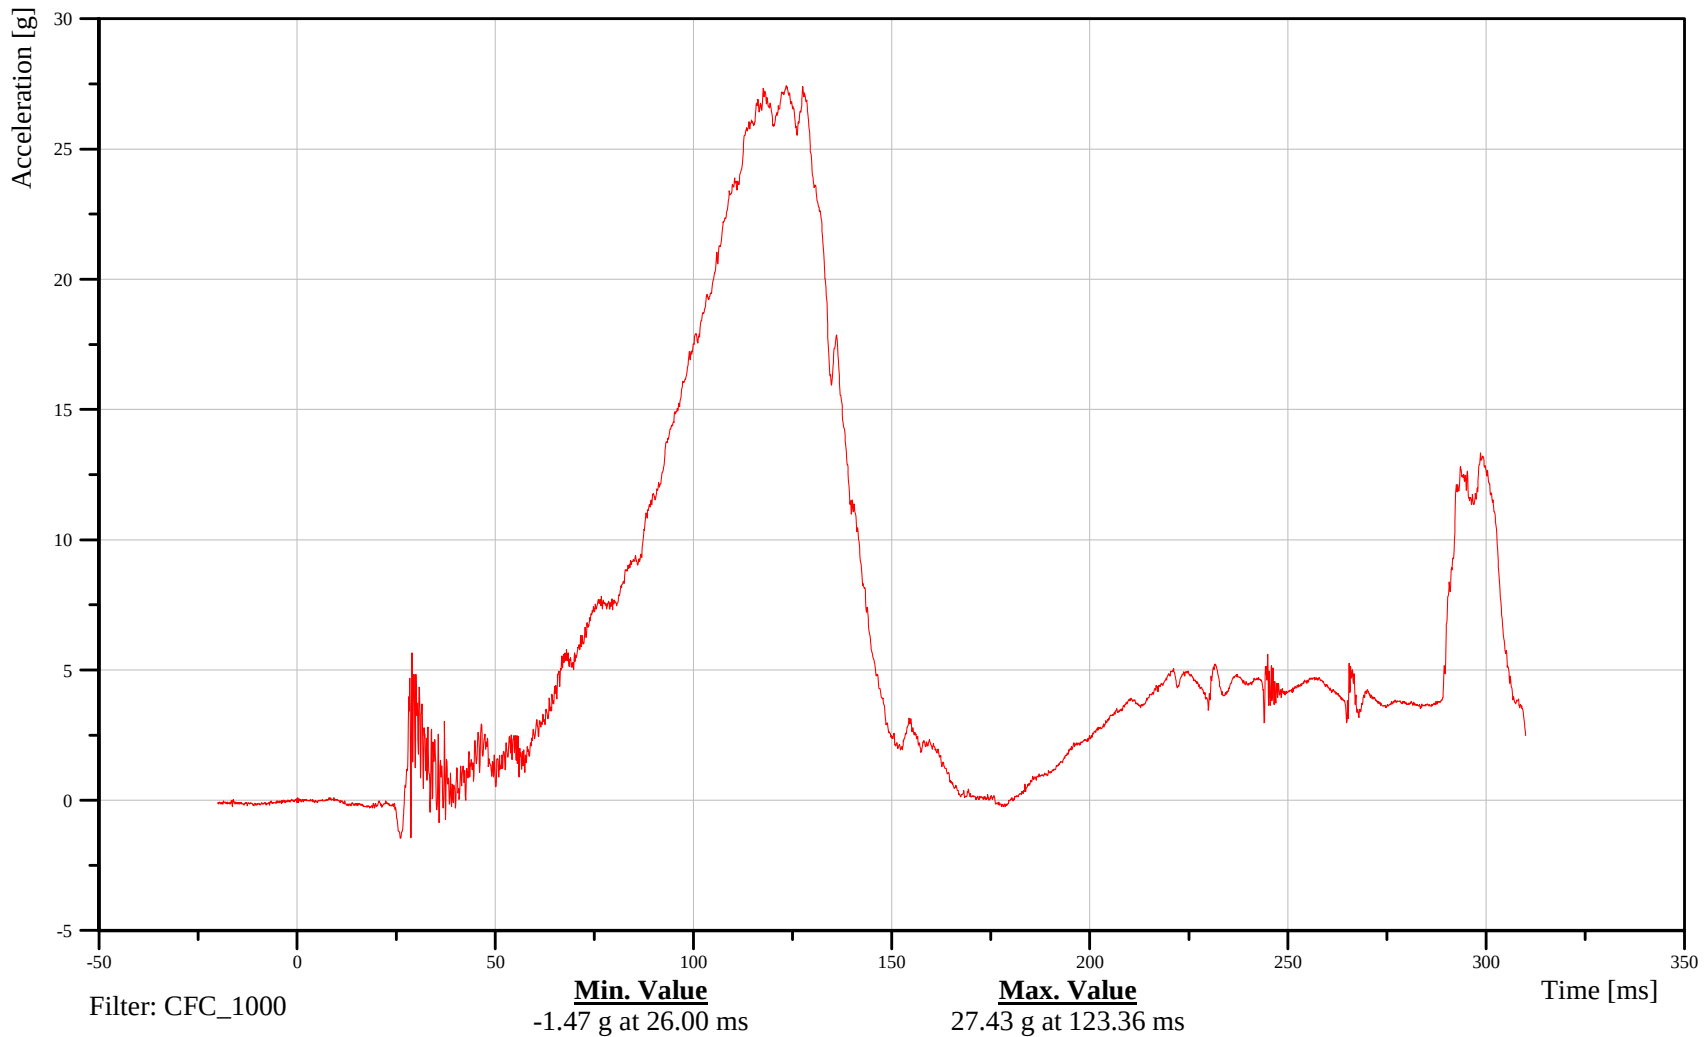

B-14

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head Redundant Resultant Acceleration

Customer: Volpe

11HEADCGRDH3ACRA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

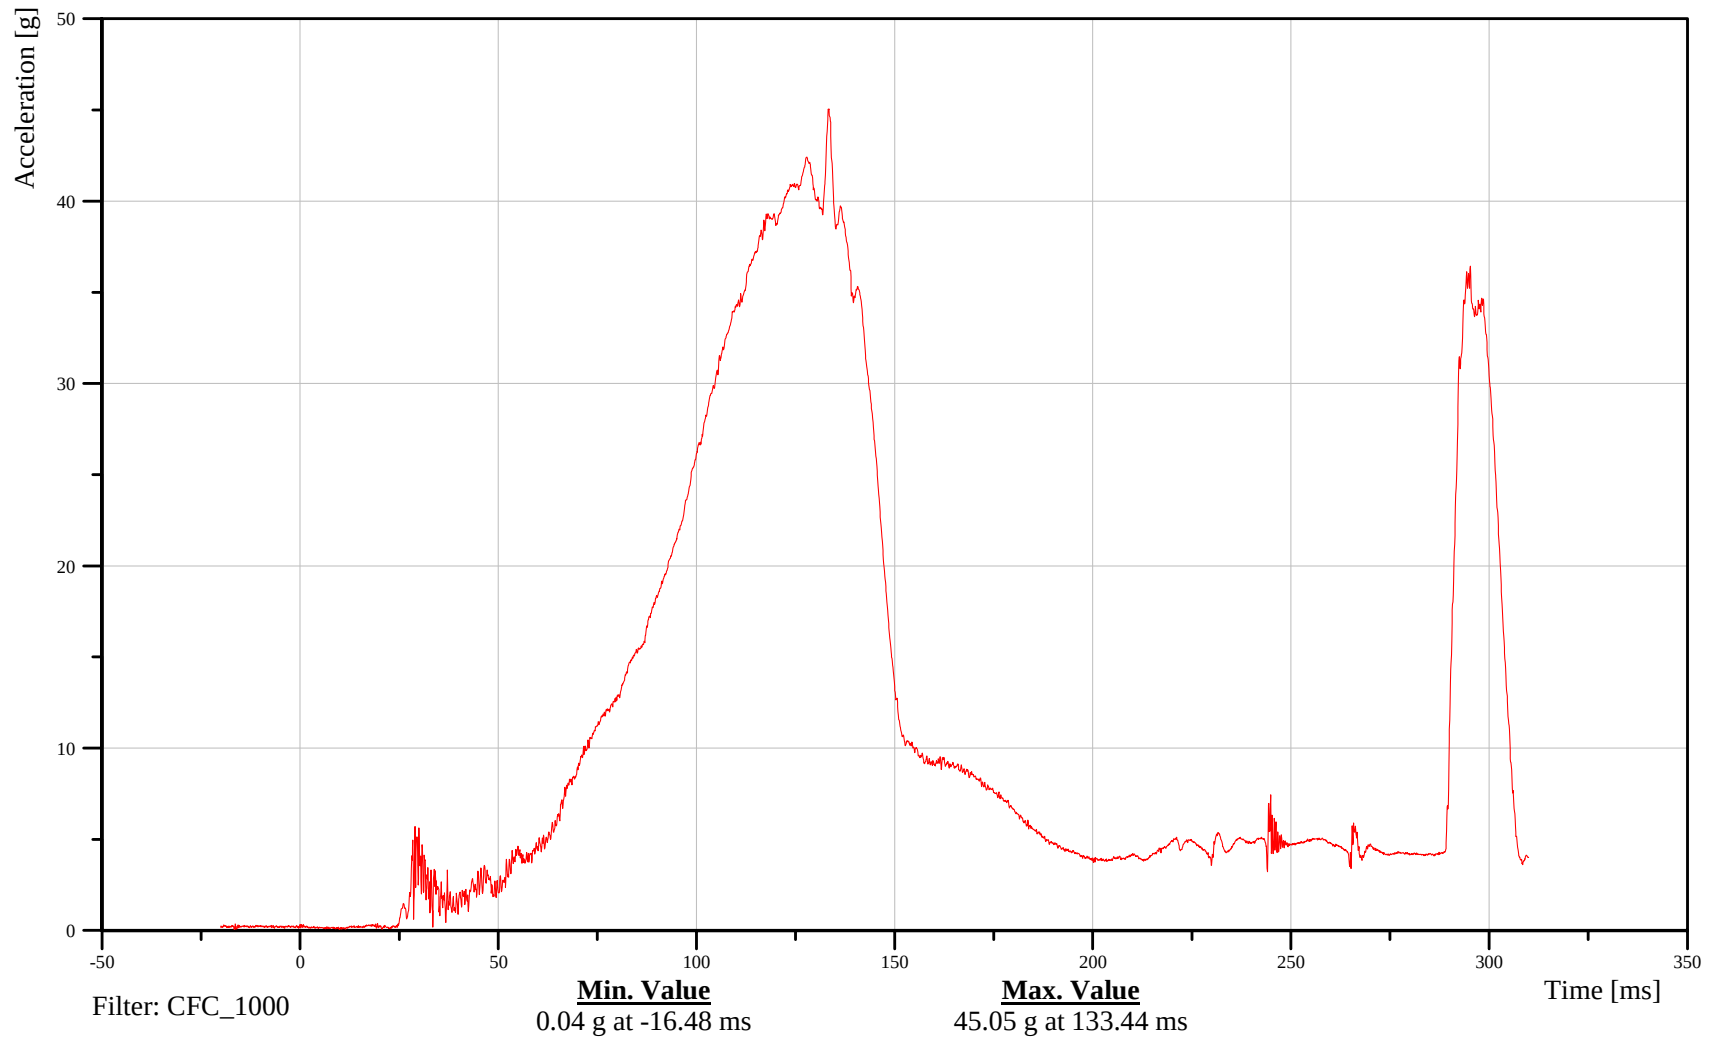

B-15

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (FT) Y-Axis Acceleration

Customer: Volpe

11HEADFR00H3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

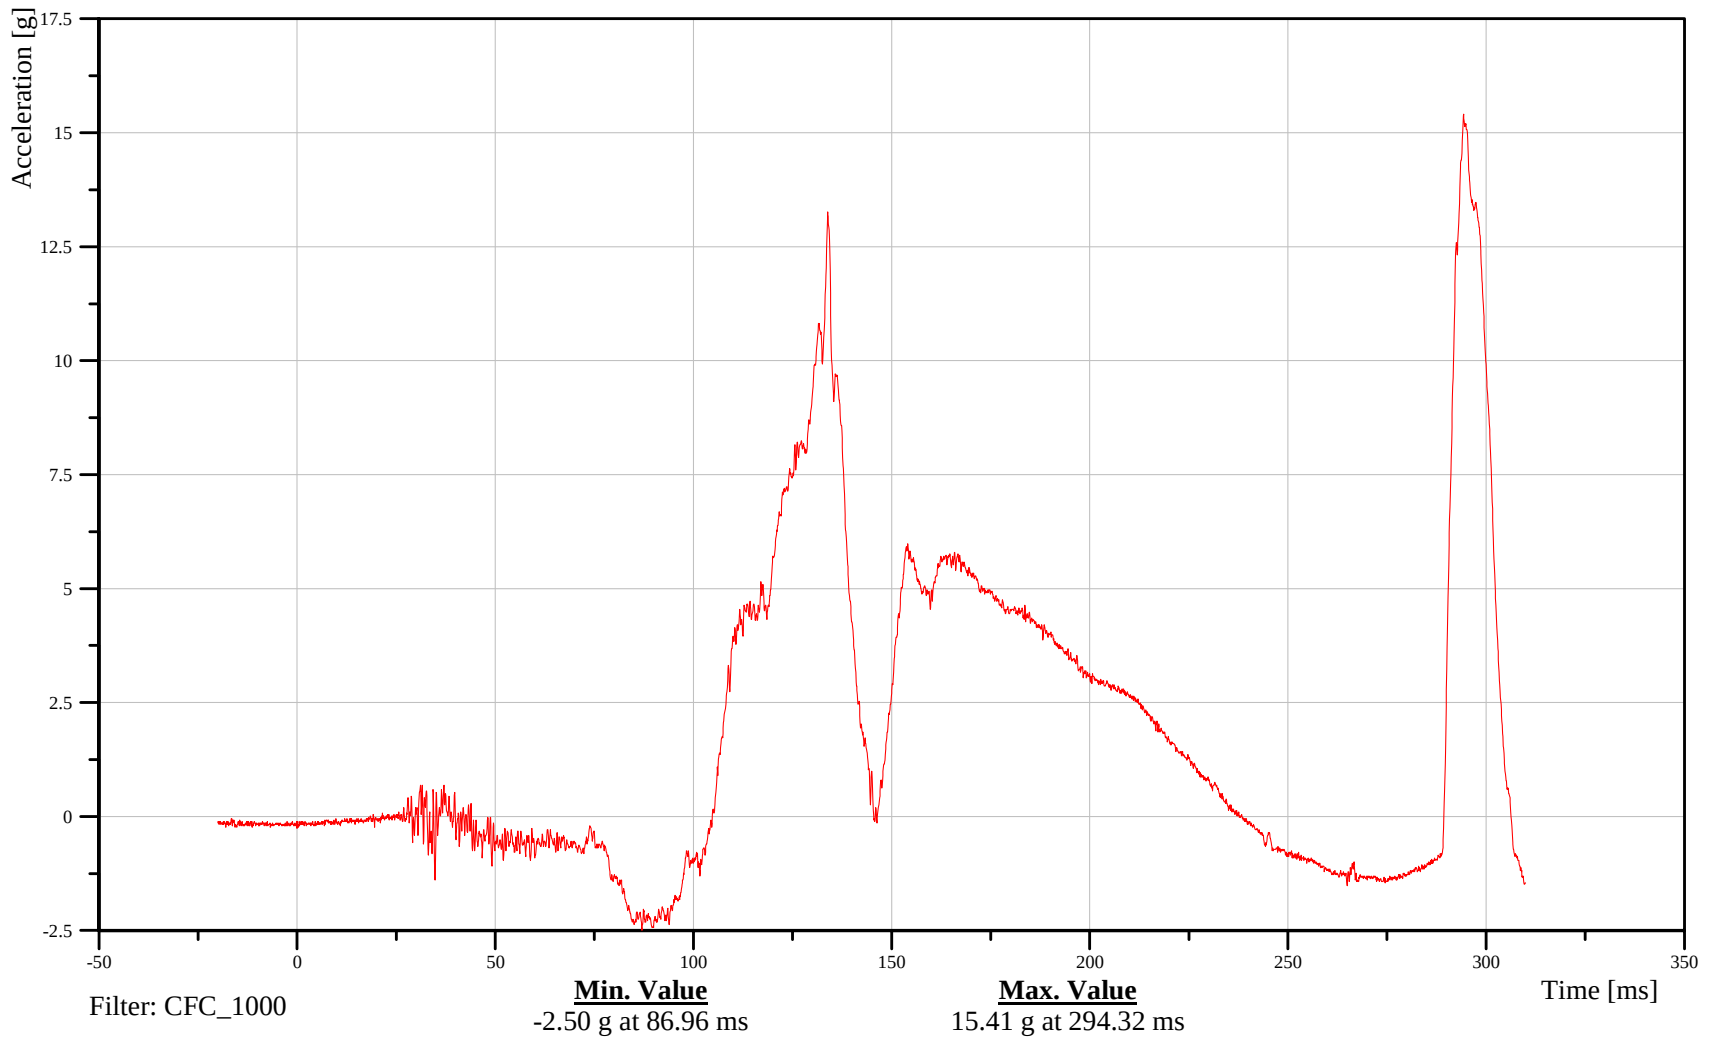

B-16

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (FT) Z-Axis Acceleration

Customer: Volpe

11HEADFR00H3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

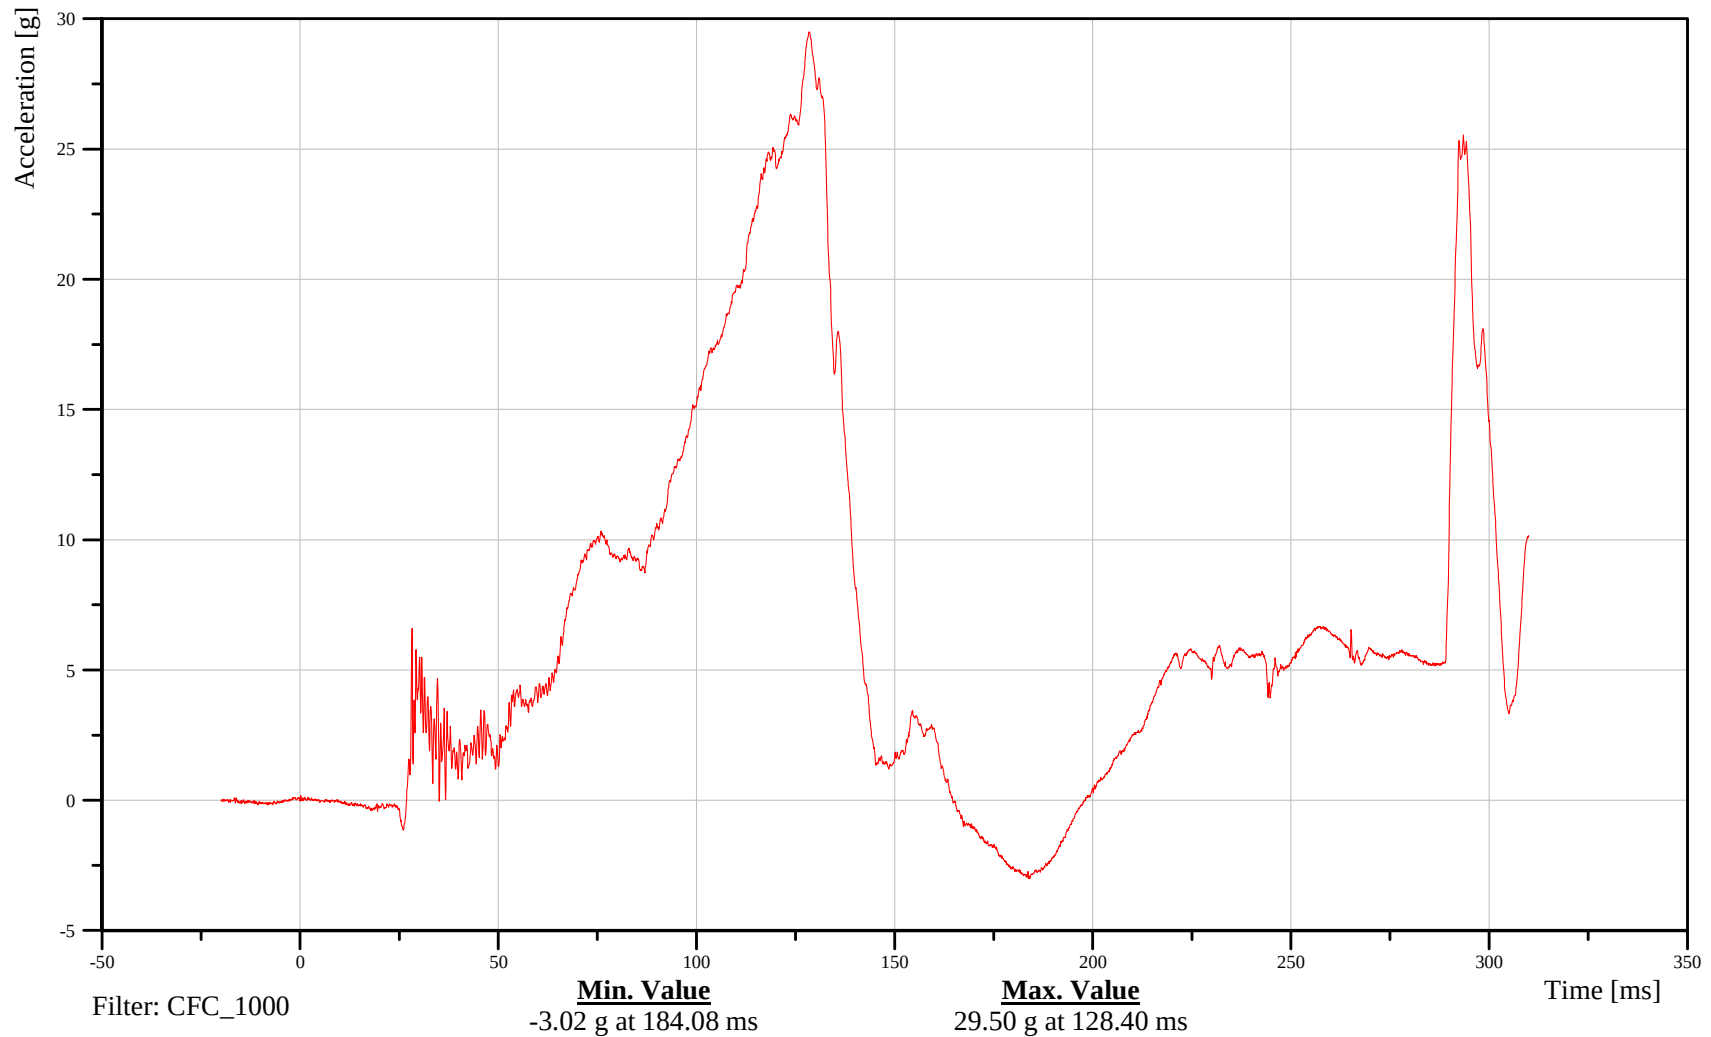

B-17

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (TP) X-Axis Acceleration

Customer: Volpe

11HEADUP00H3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

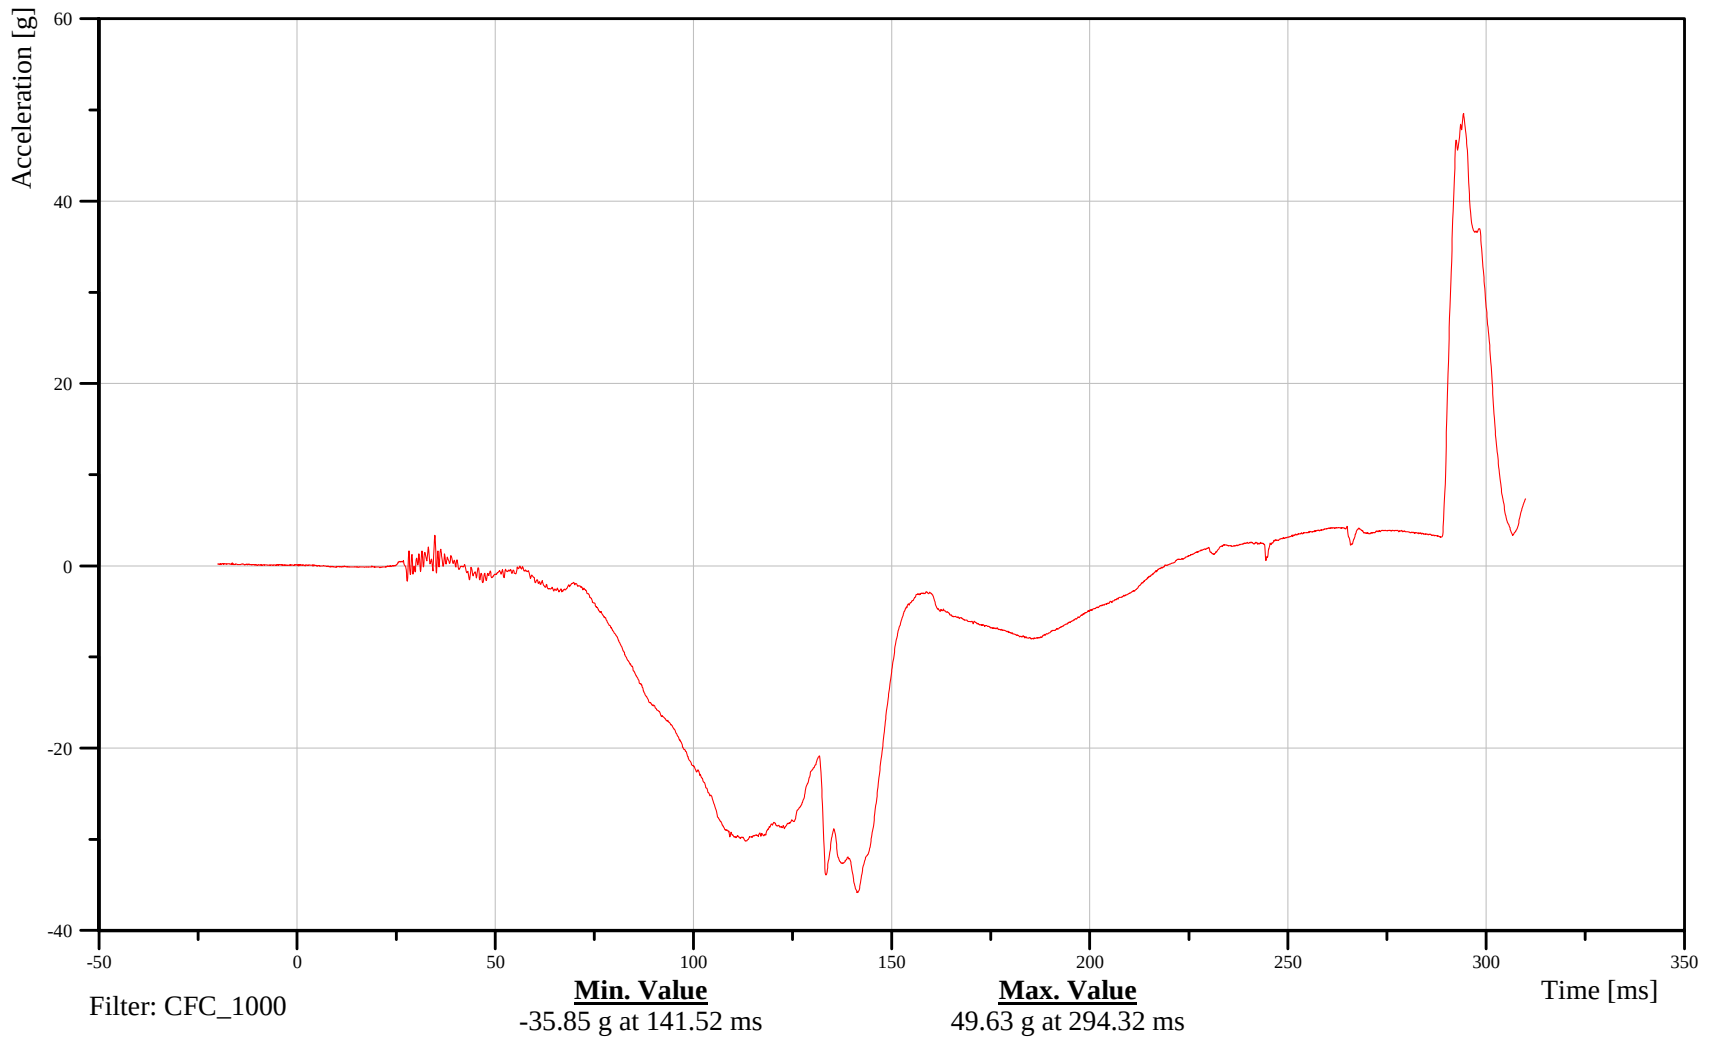

B-18

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (TP) Y-Axis Acceleration

Customer: Volpe

11HEADUP00H3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

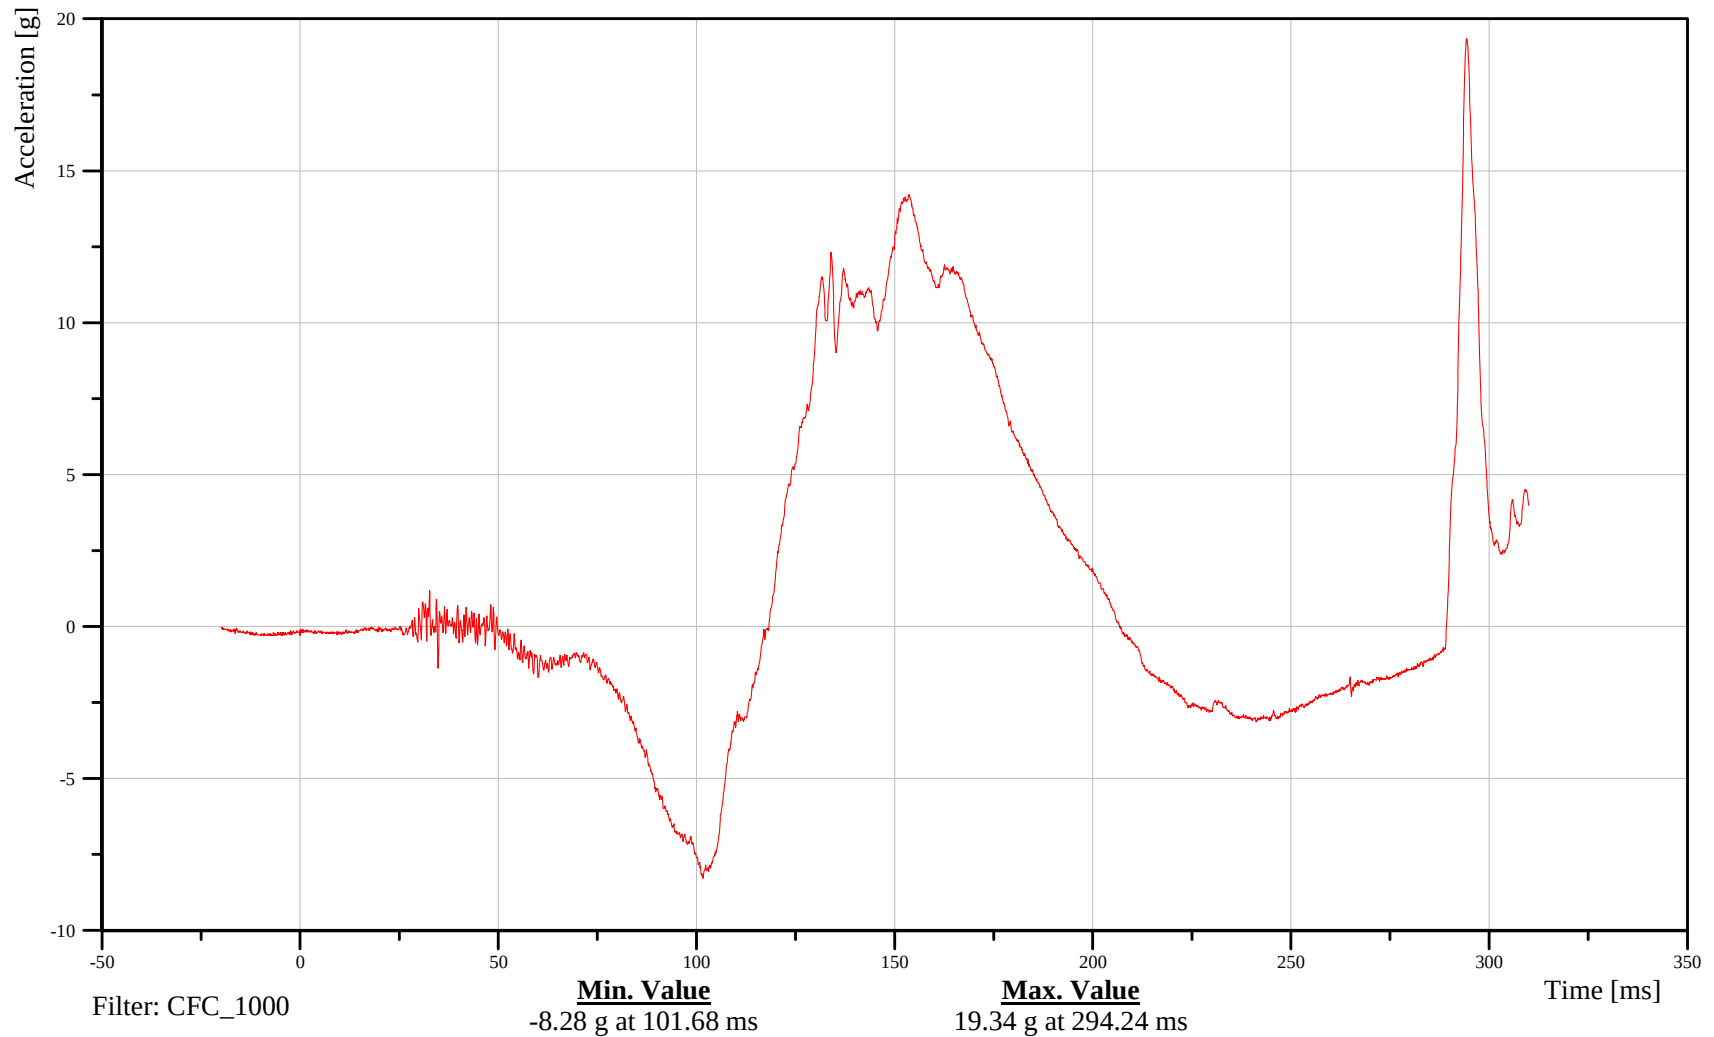

B-19

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (LT) X-Axis Acceleration

Customer: Volpe

11HEADLE00H3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

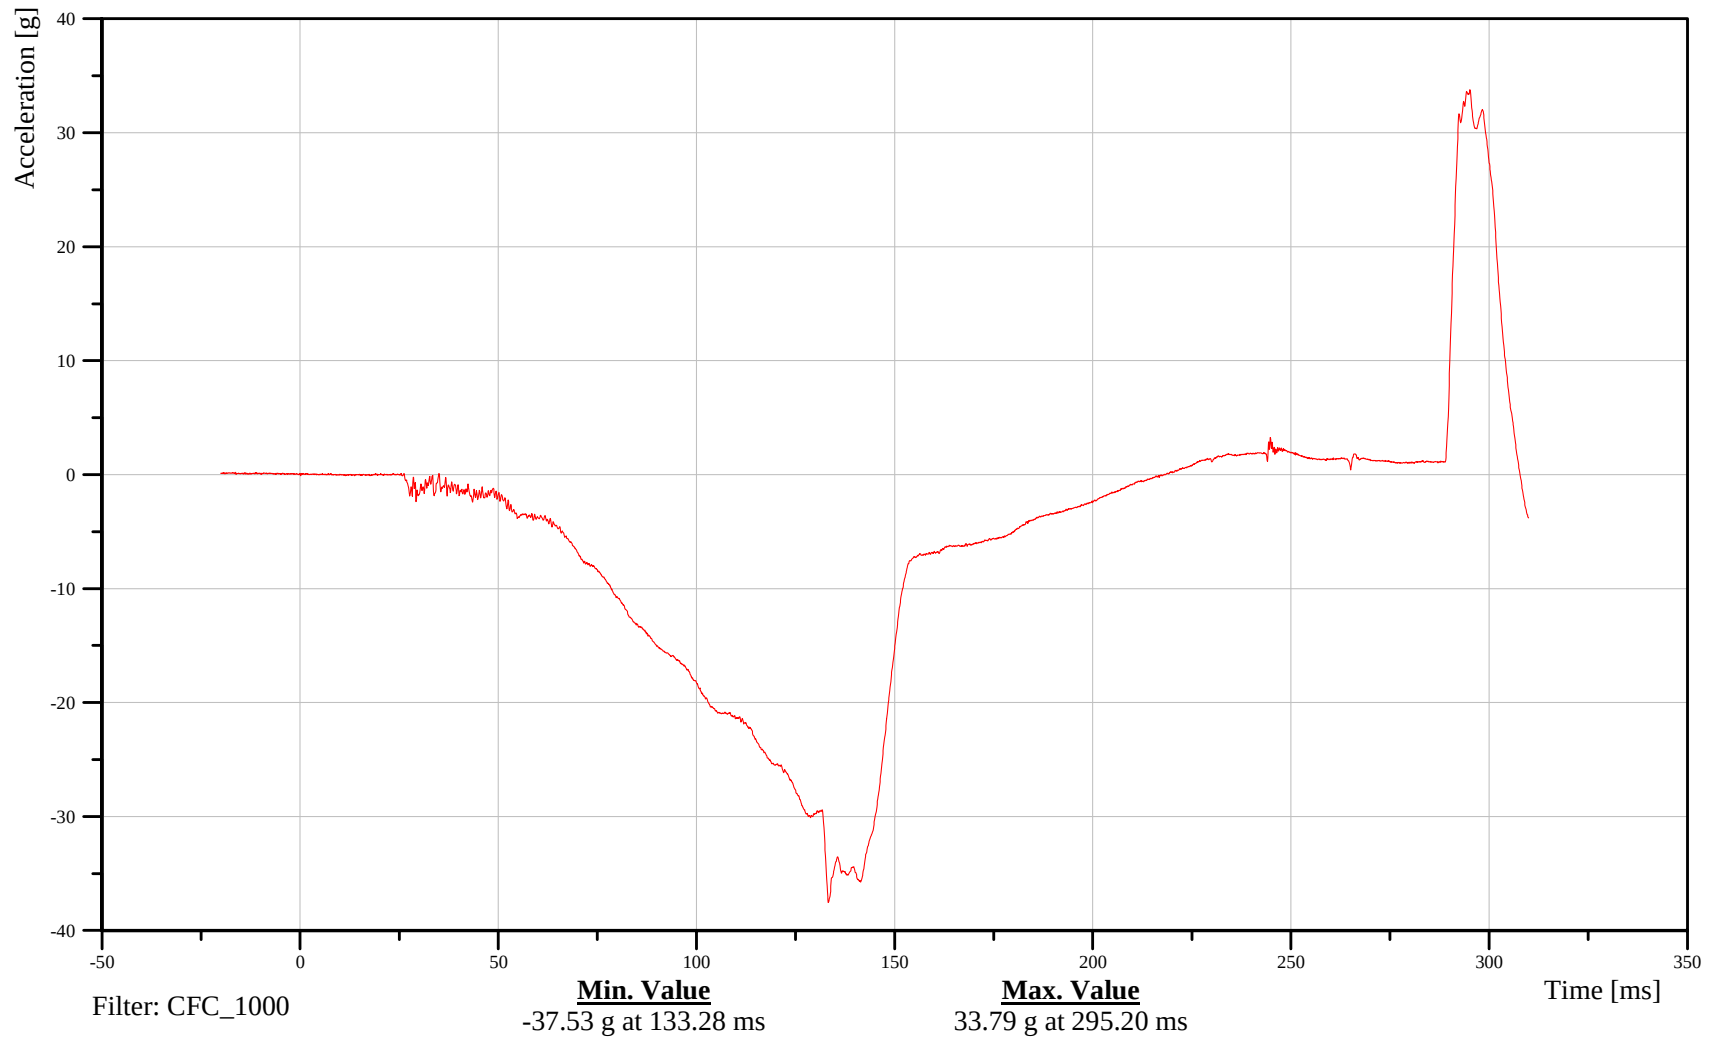

B-20

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Head (LT) Z-Axis Acceleration

Customer: Volpe

11HEADLE00H3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

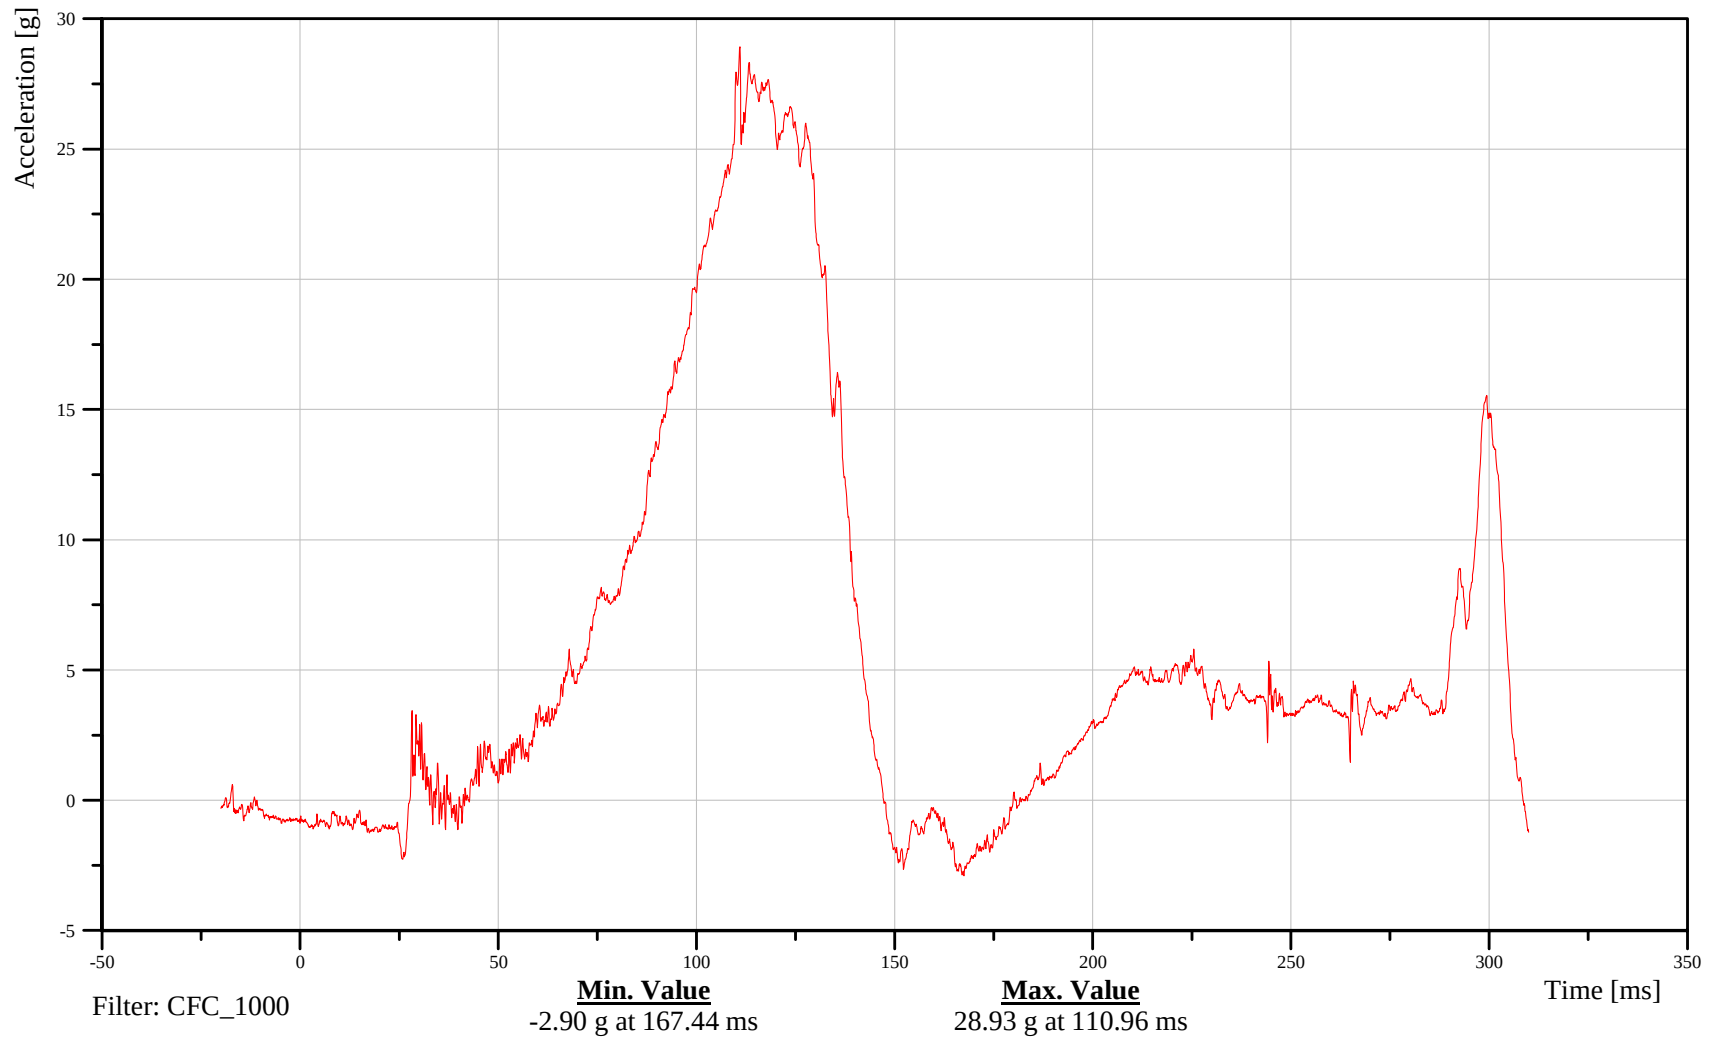

B-21

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck X-Axis Force

Customer: Volpe

11NECKUP00H3FOXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

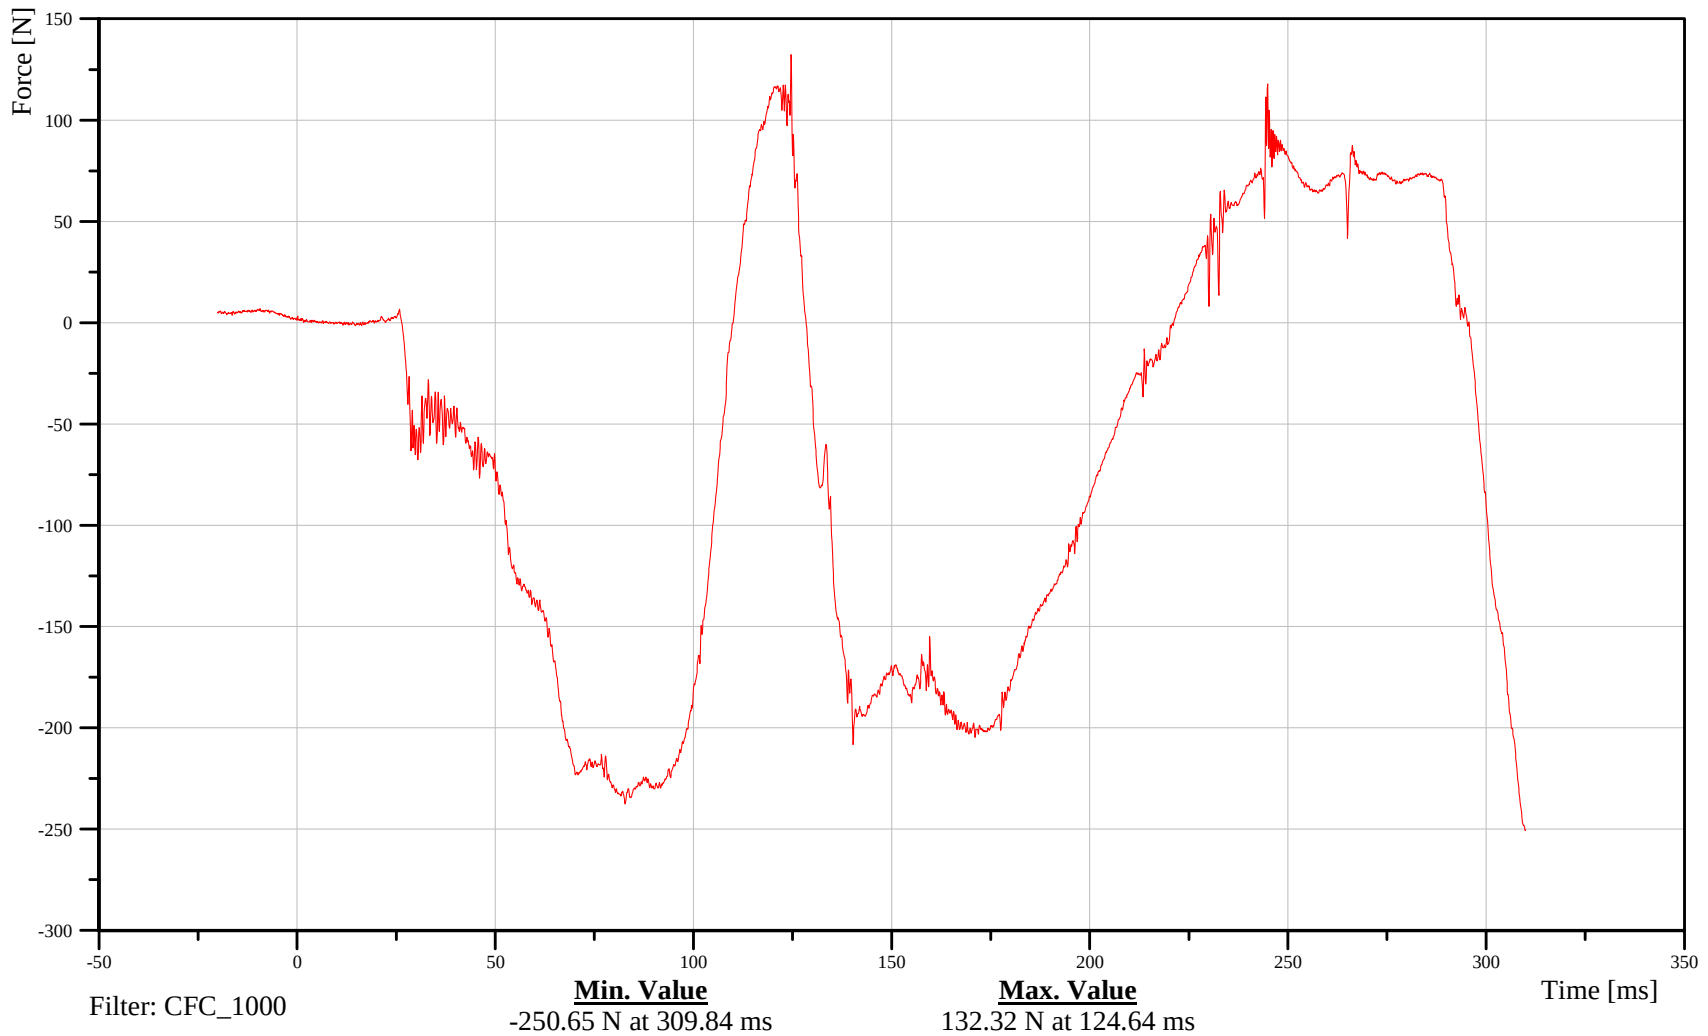

B-22

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck Y-Axis Force

Customer: Volpe

11NECKUP00H3FOYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

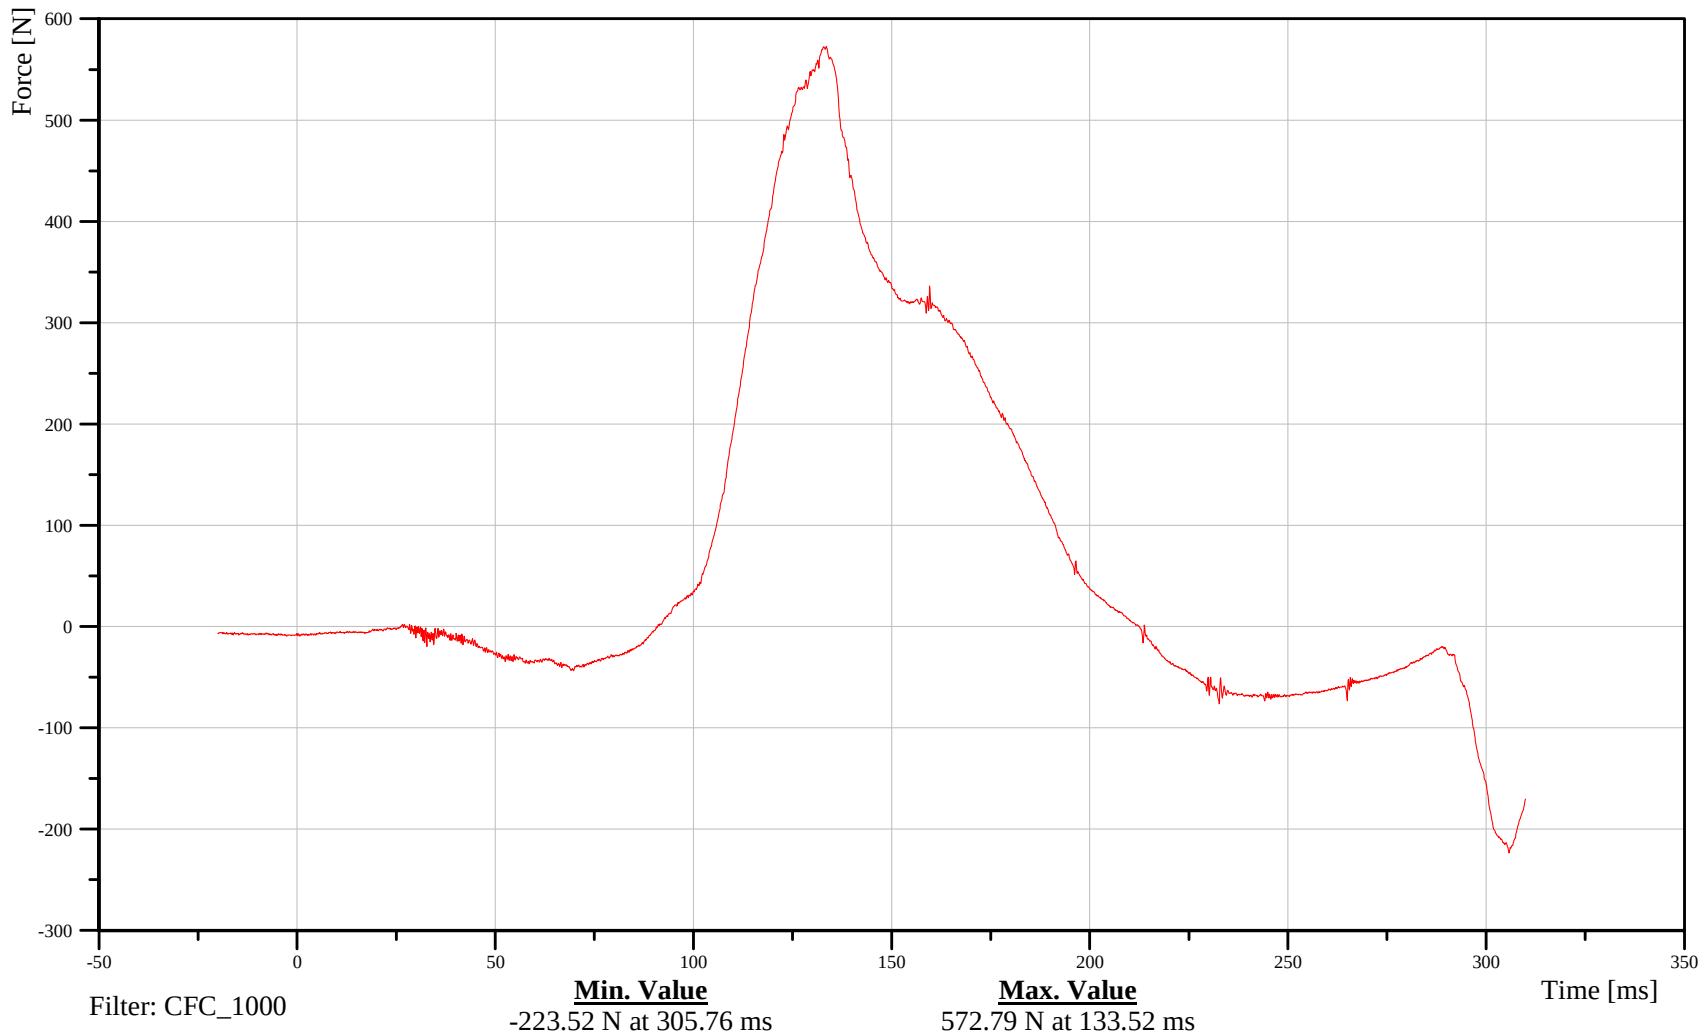

B-23

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck Z-Axis Force

Customer: Volpe

11NECKUP00H3FOZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

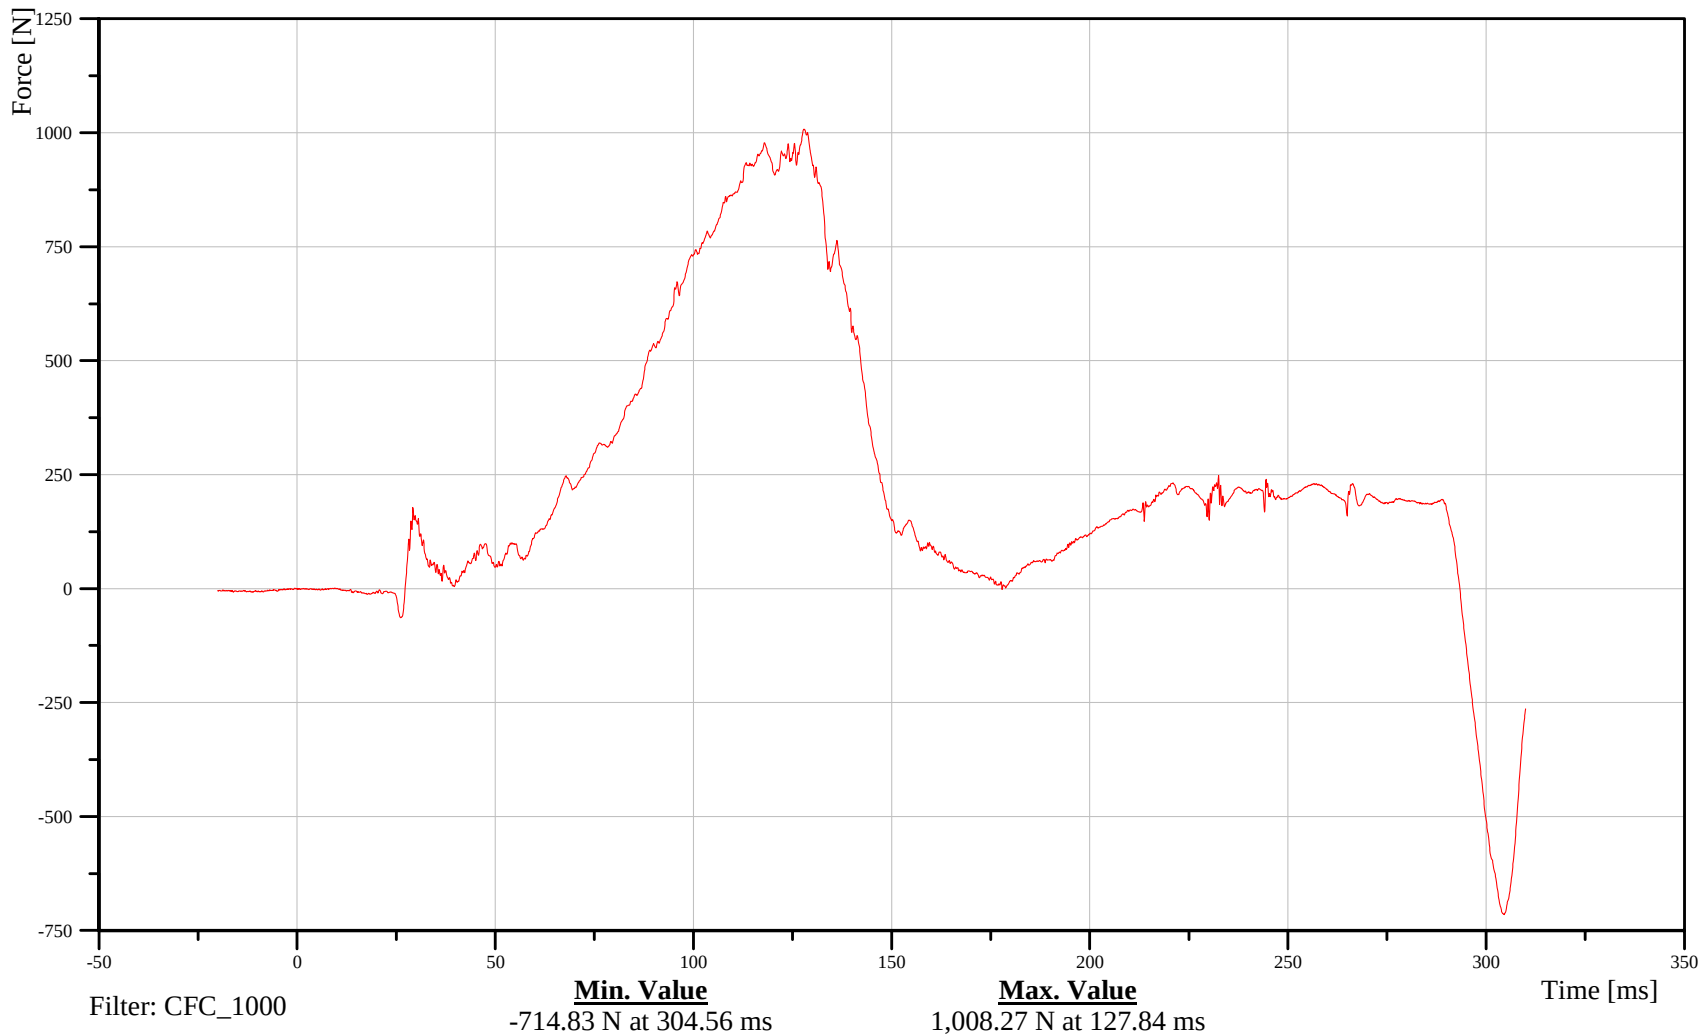

B-24

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck Moment About X Axis

Customer: Volpe

11NECKUP00H3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

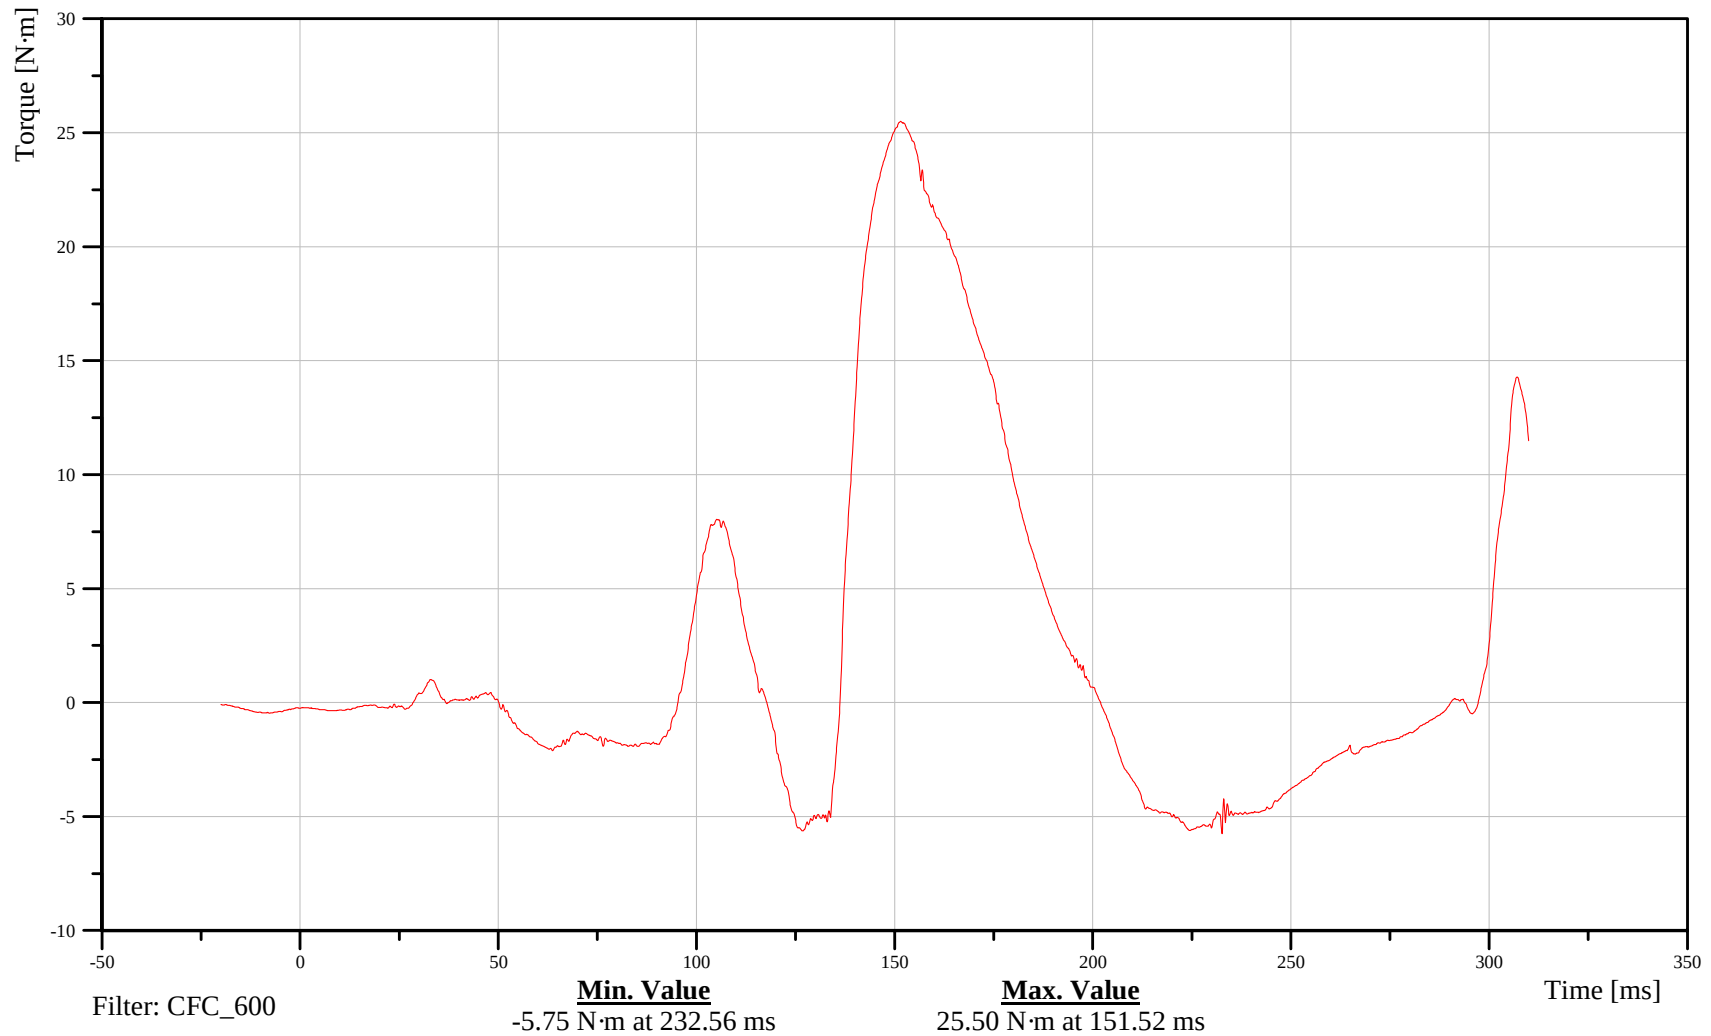

B-25

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck Moment About Y Axis

Customer: Volpe

11NECKUP00H3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

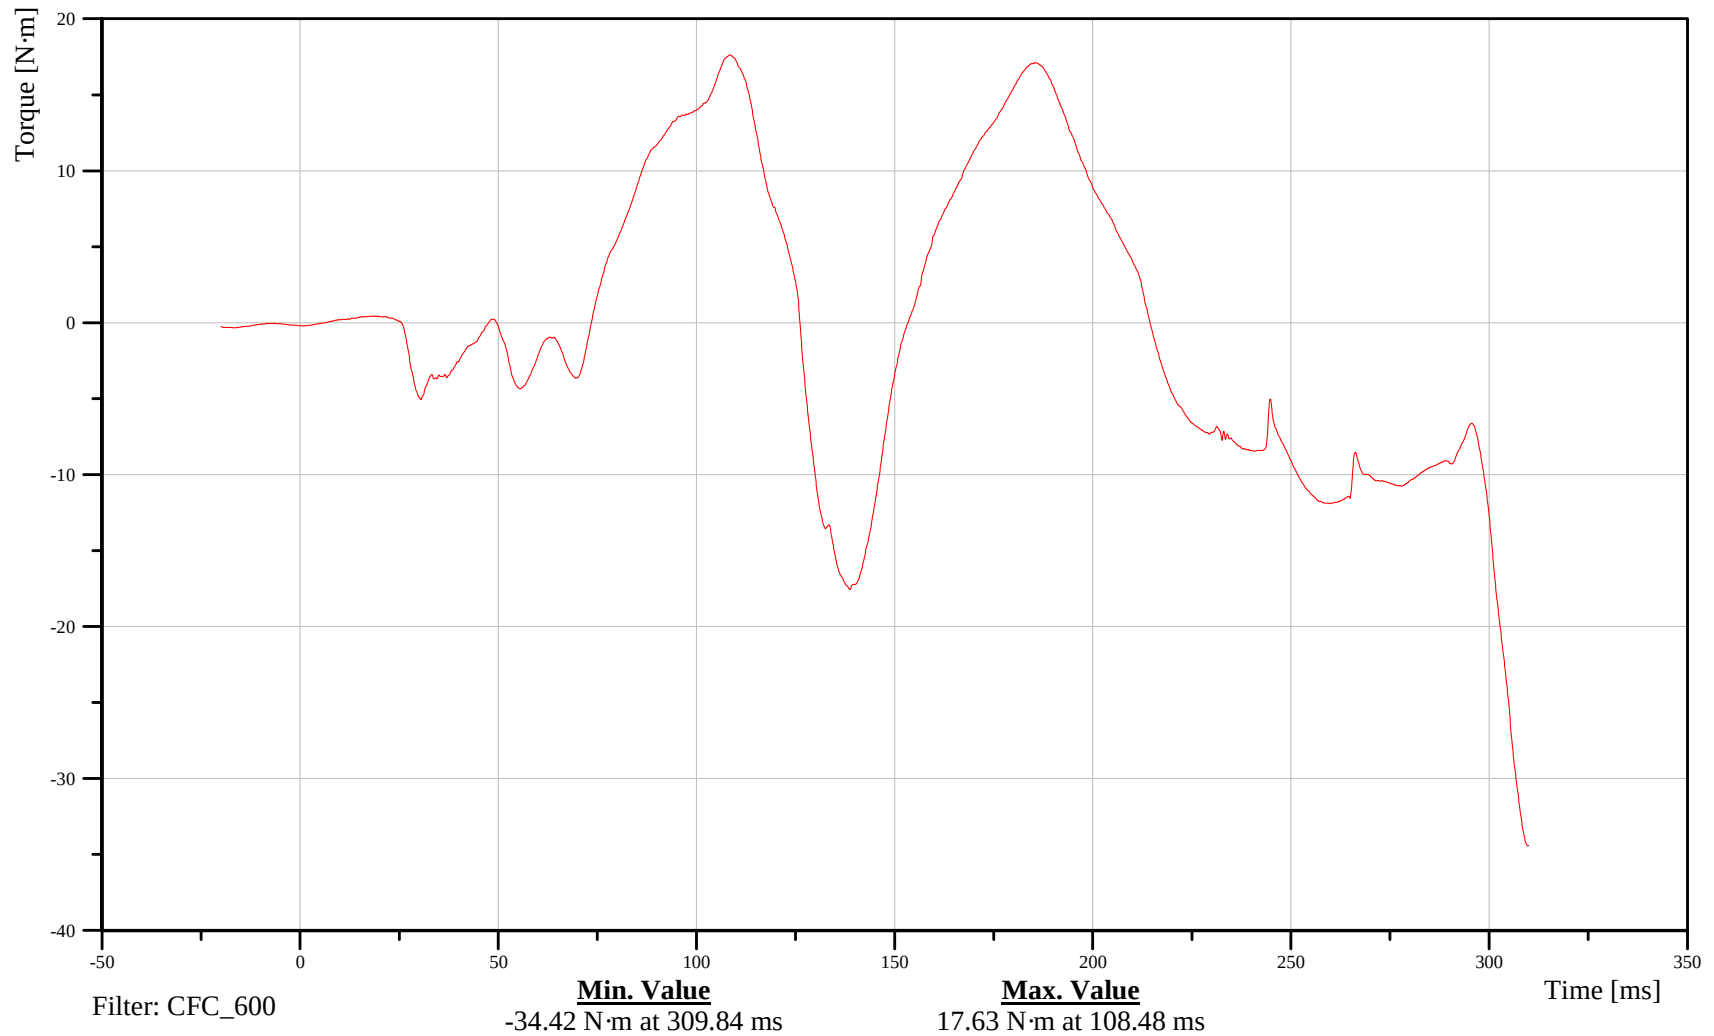

B-26

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Upper Neck Moment About Z Axis

Customer: Volpe

11NECKUP00H3MOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

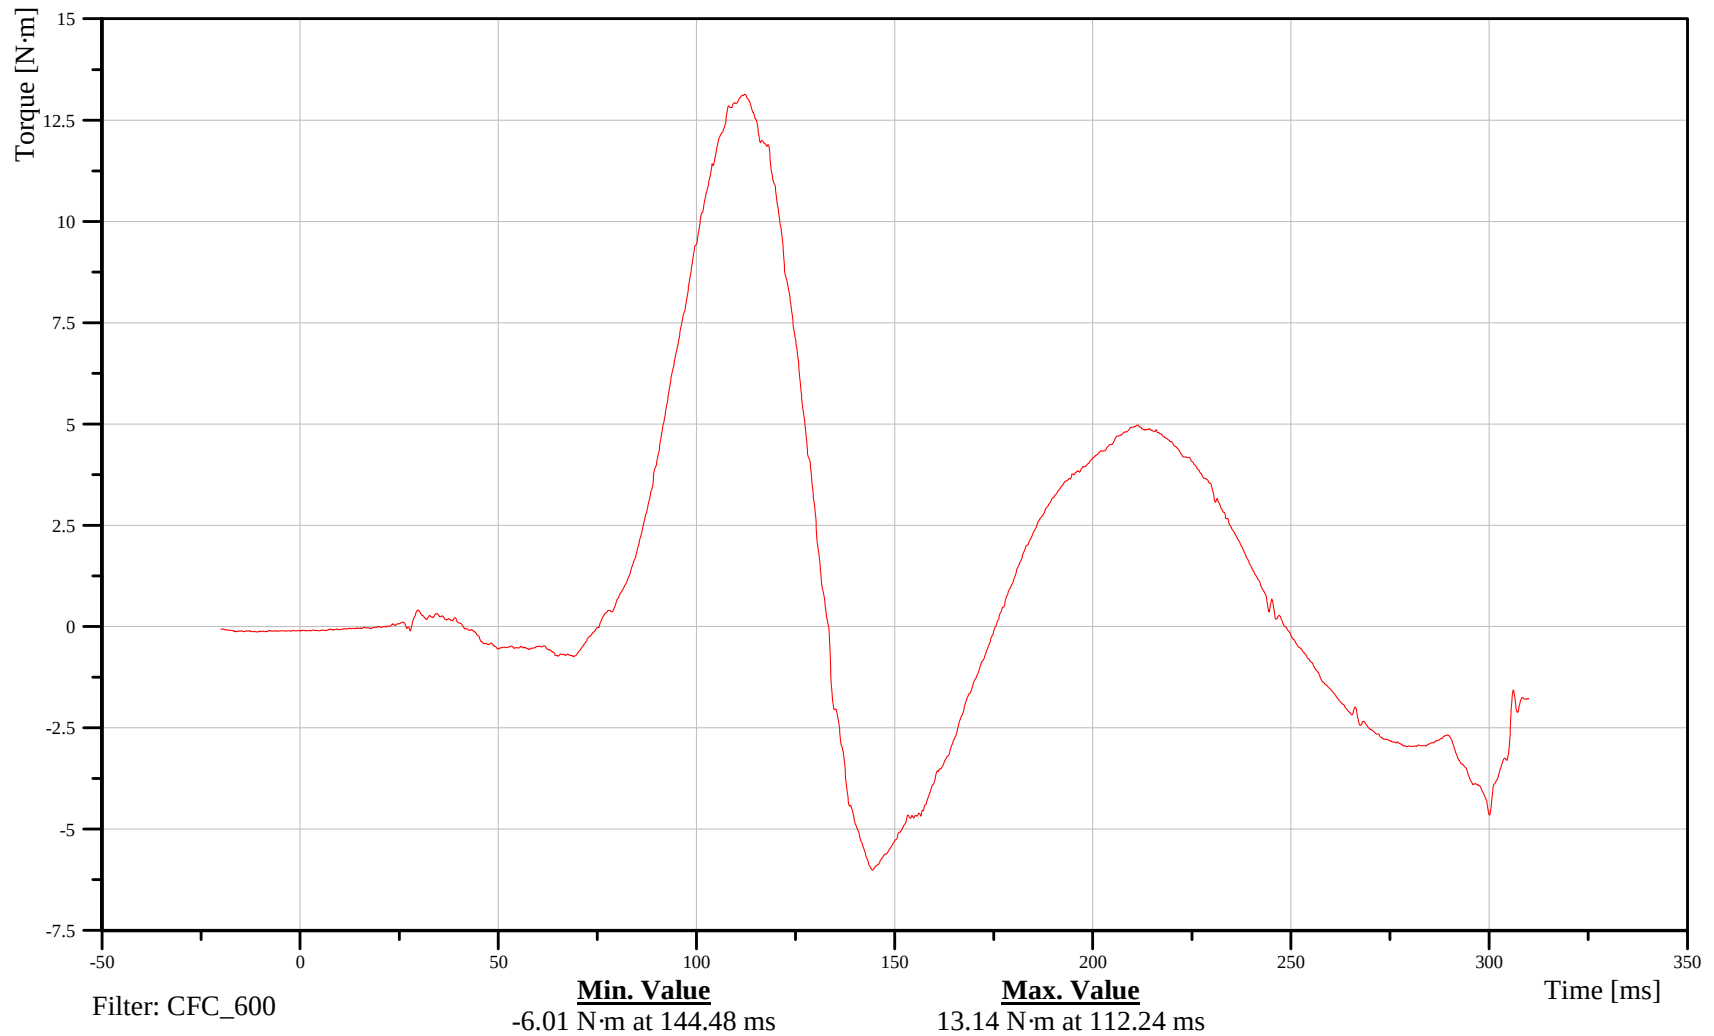

B-27

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck X-Axis Force

Customer: Volpe

11NECKLO00H3FOXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

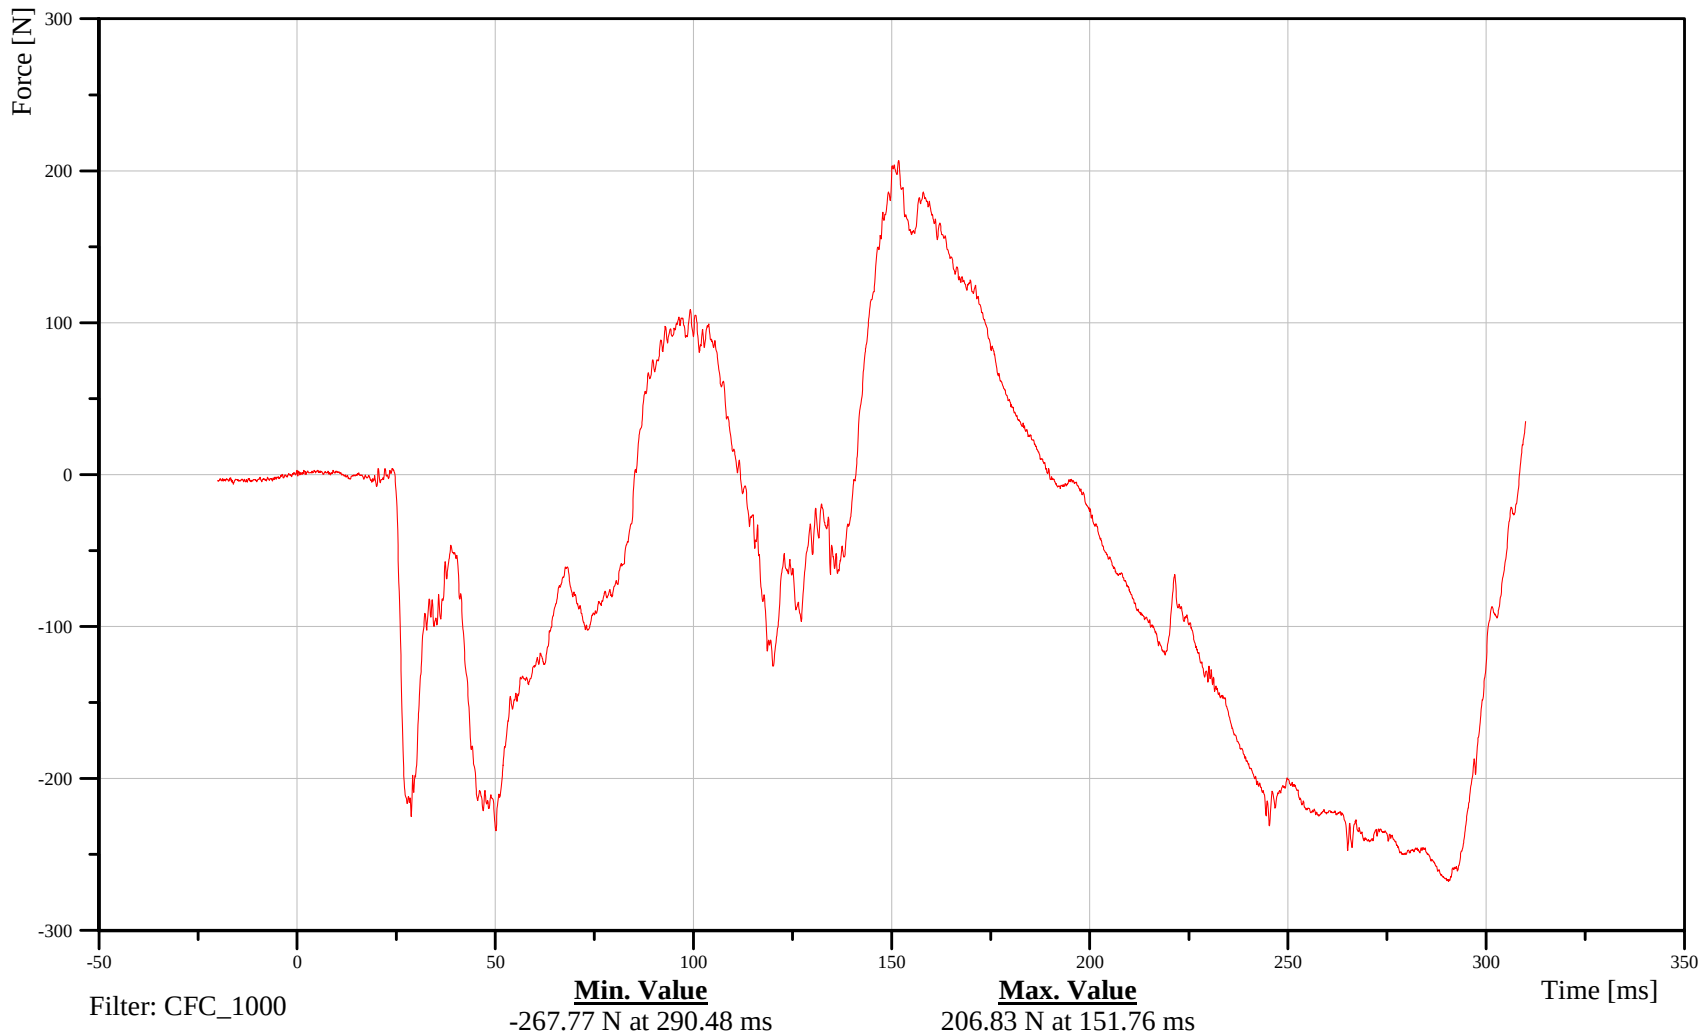

B-28

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck Y-Axis Force

Customer: Volpe

11NECKLO00H3FOYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

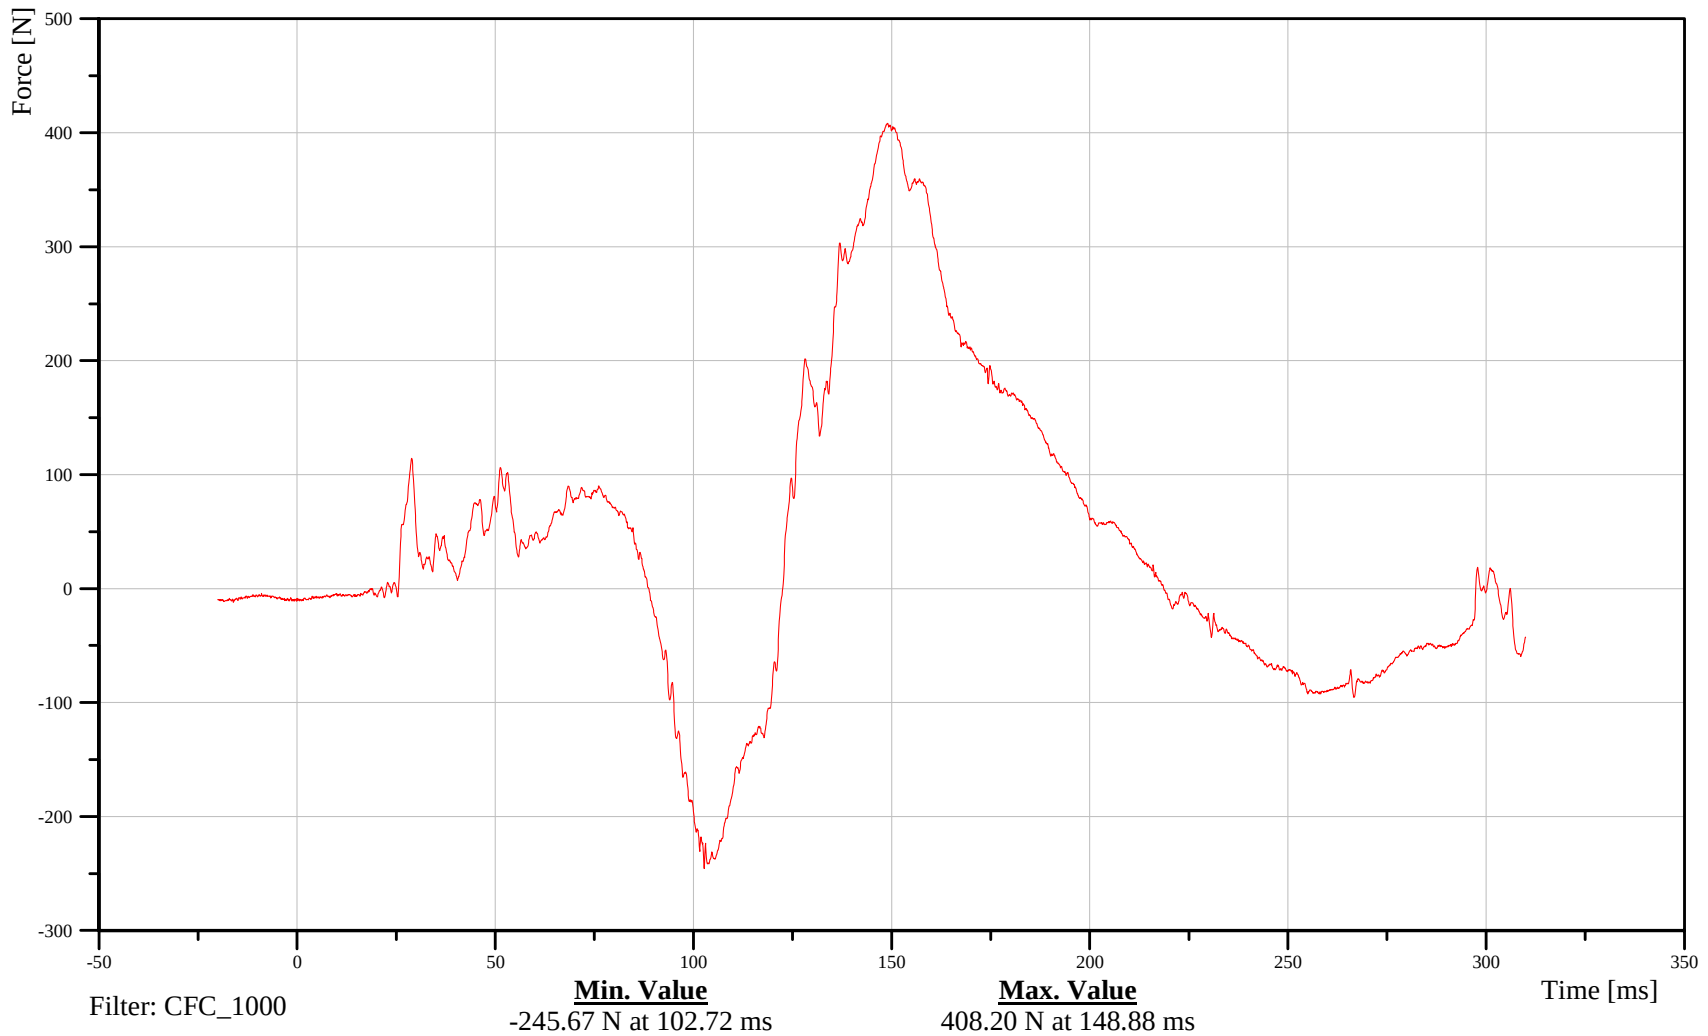

B-29

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck Z-Axis Force

Customer: Volpe

11NECKLO00H3FOZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

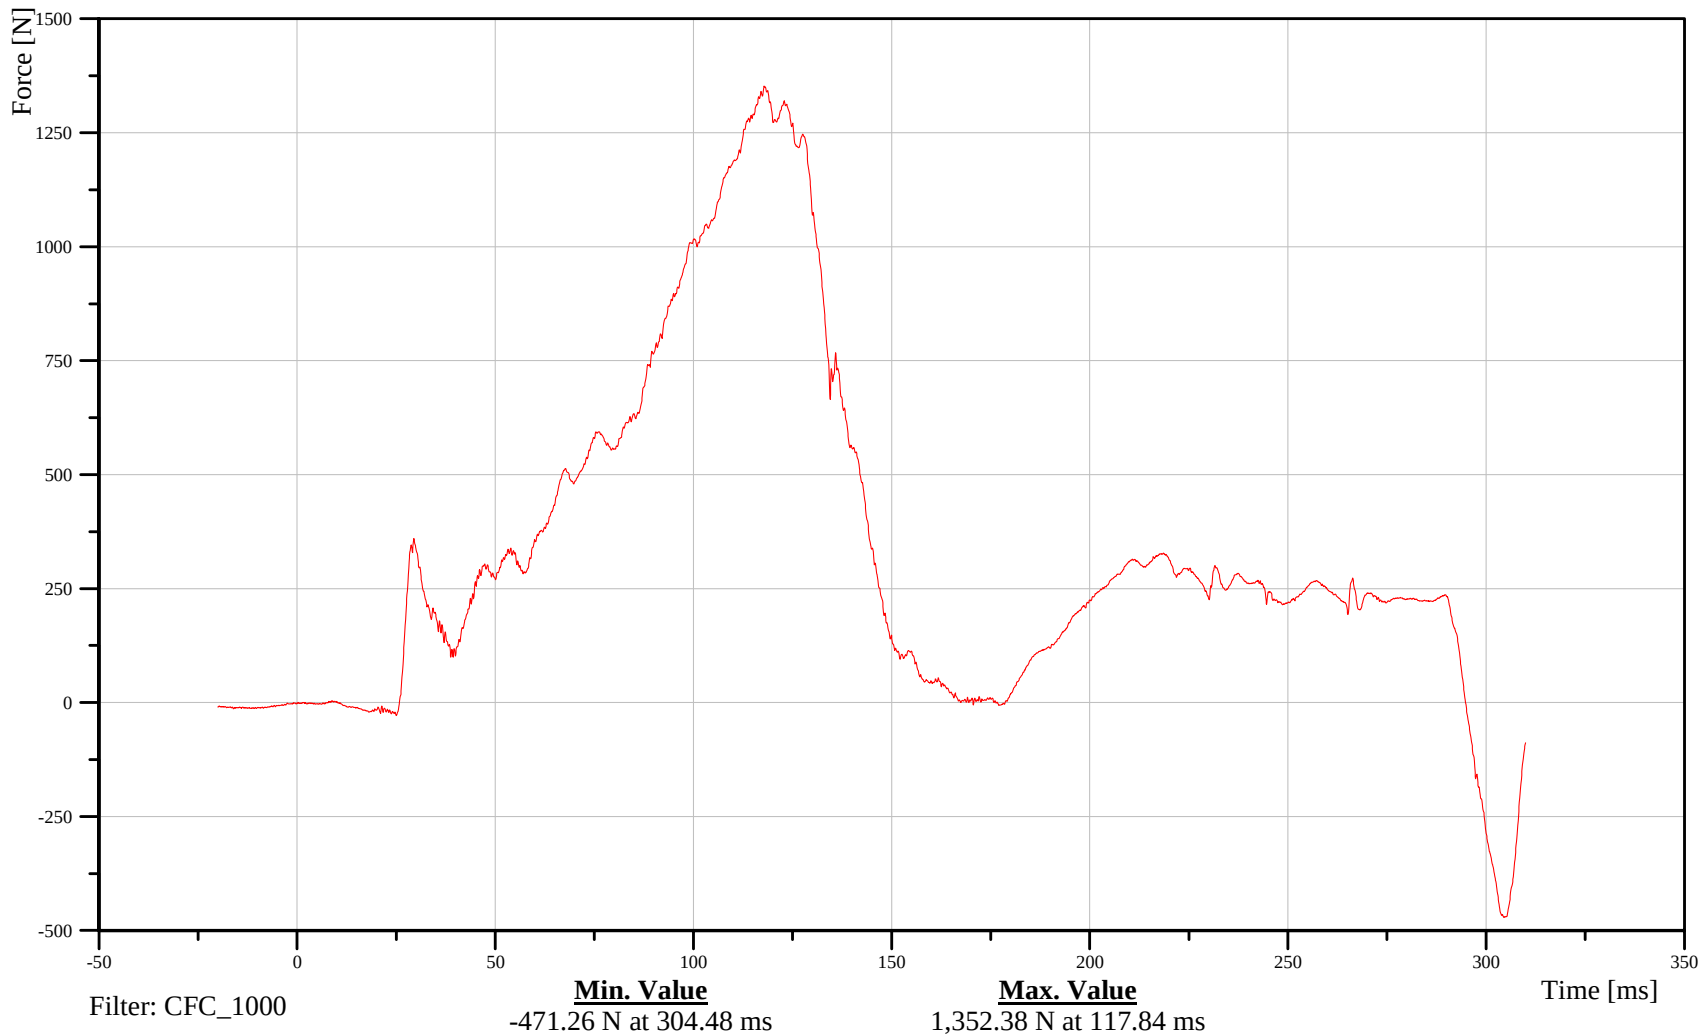

B-30

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck Moment About X Axis

Customer: Volpe

11NECKLO00H3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

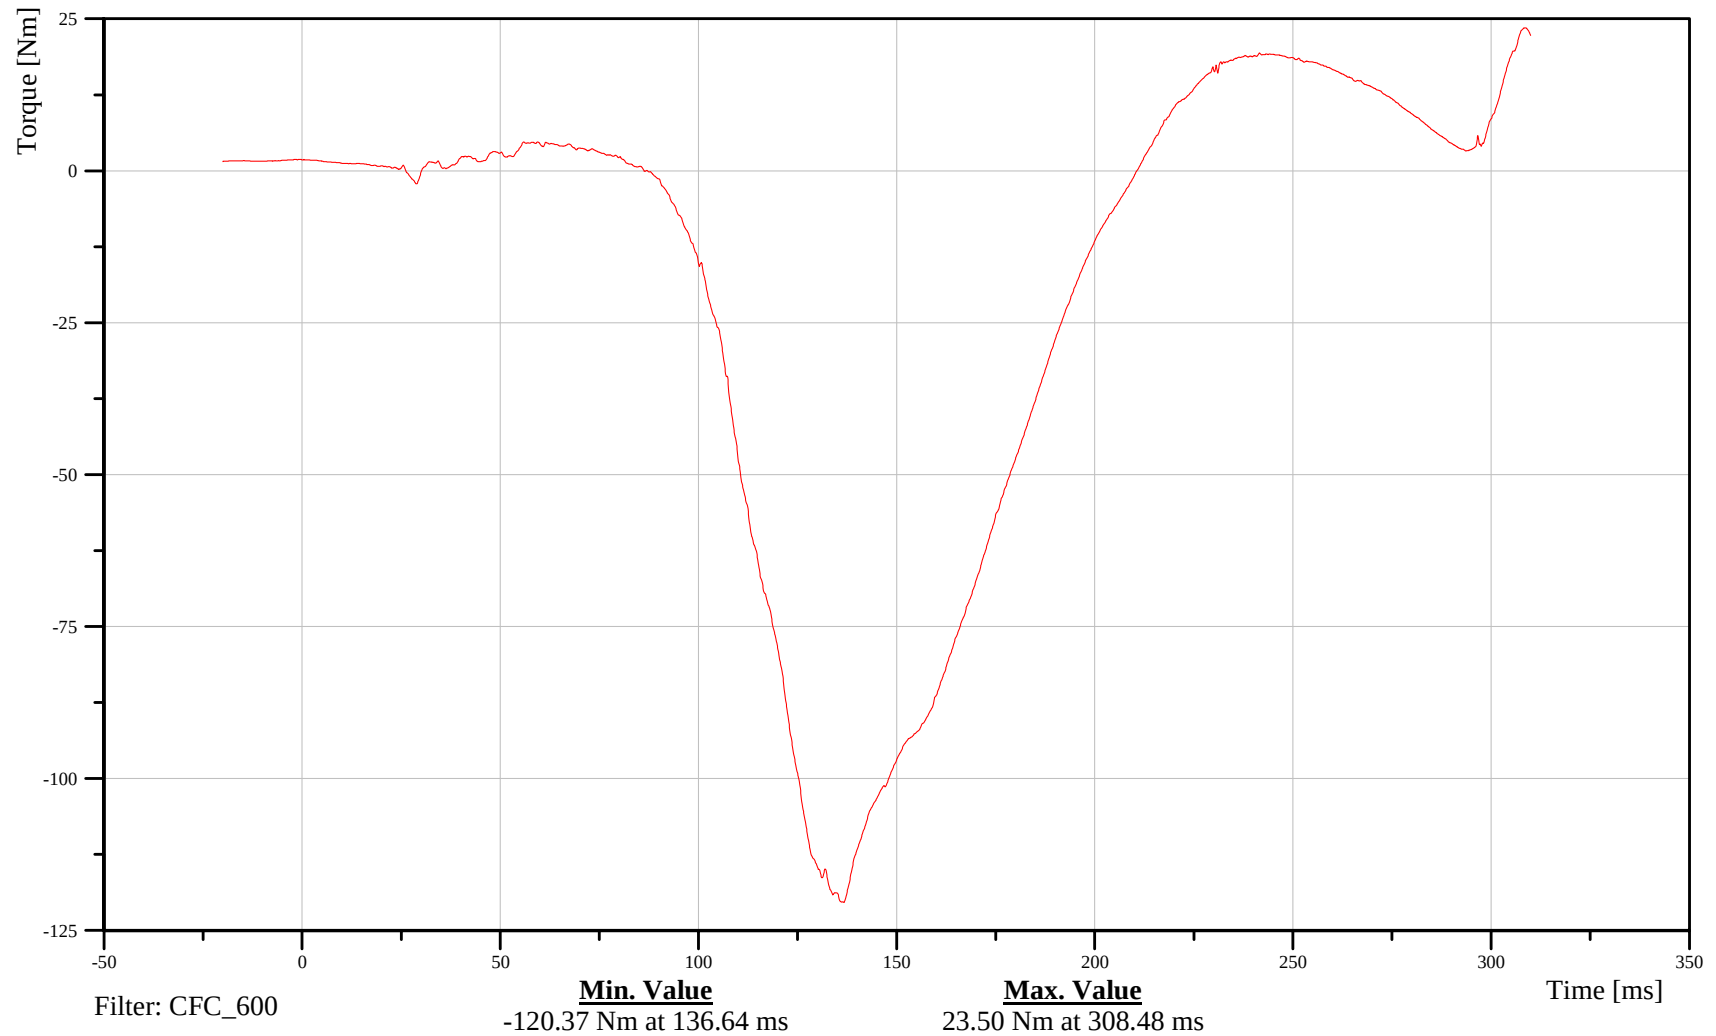

B-31

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck Moment About Y Axis

Customer: Volpe

11NECKLO00H3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

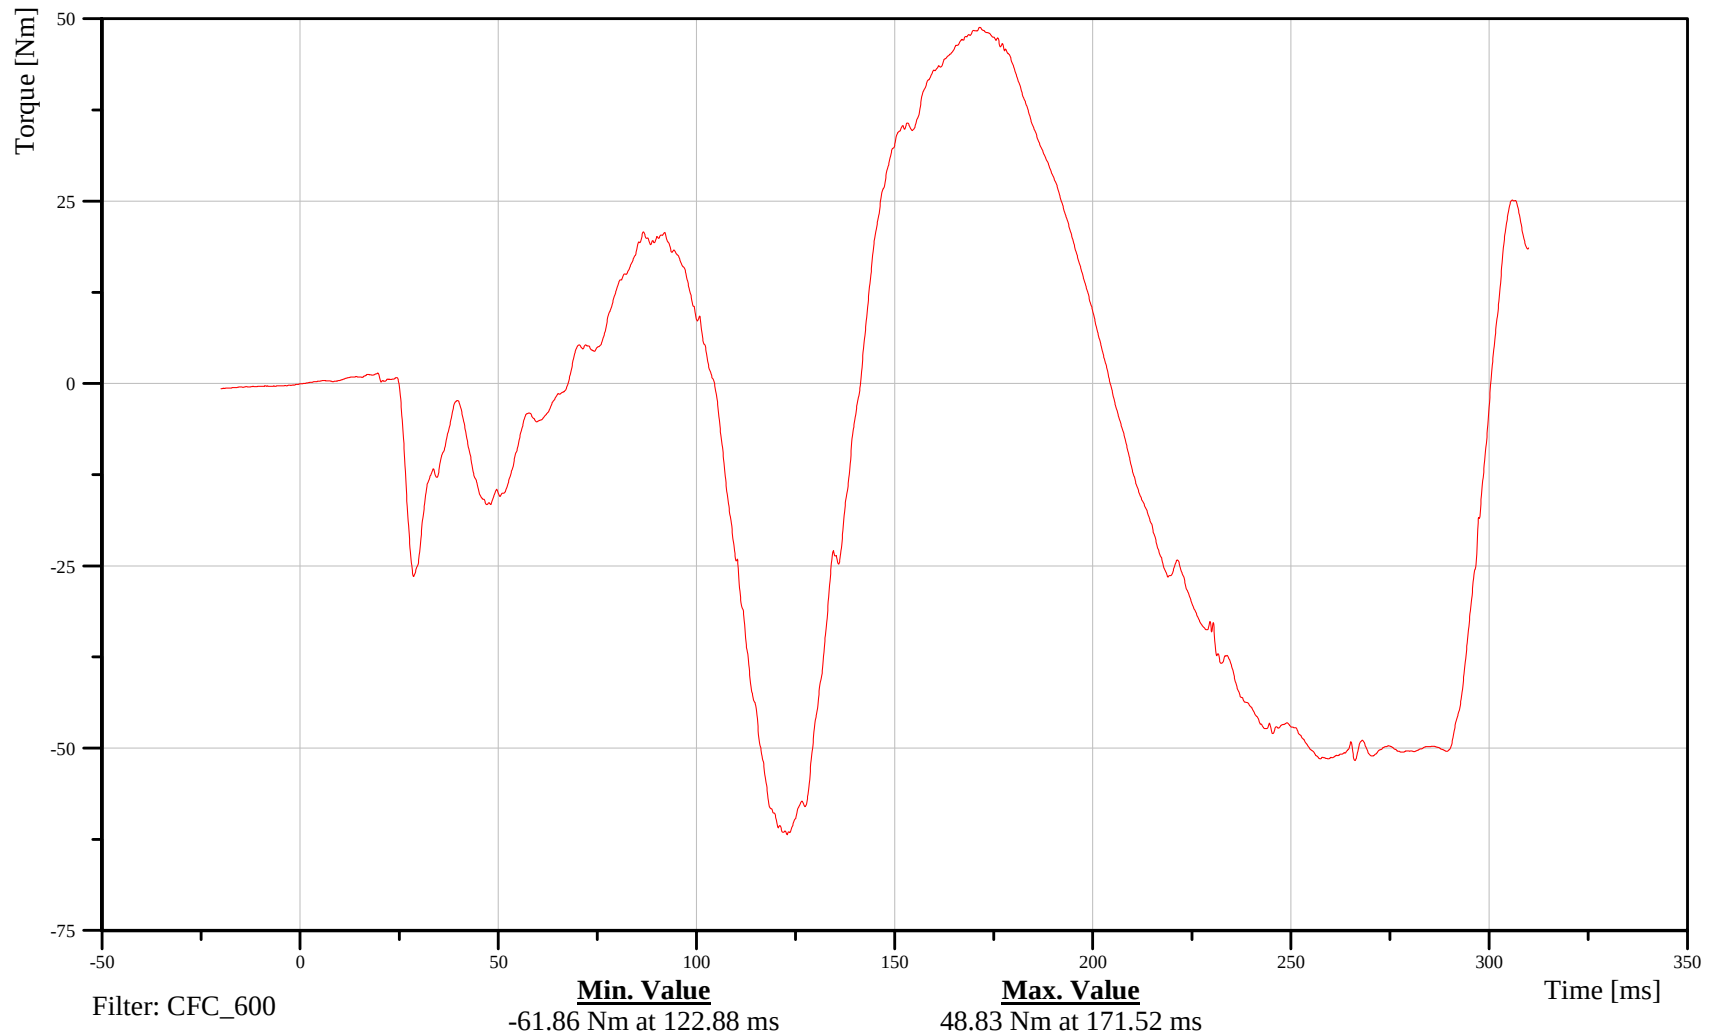

B-32

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Lower Neck Moment About Z Axis

Customer: Volpe

11NECKLO00H3MOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

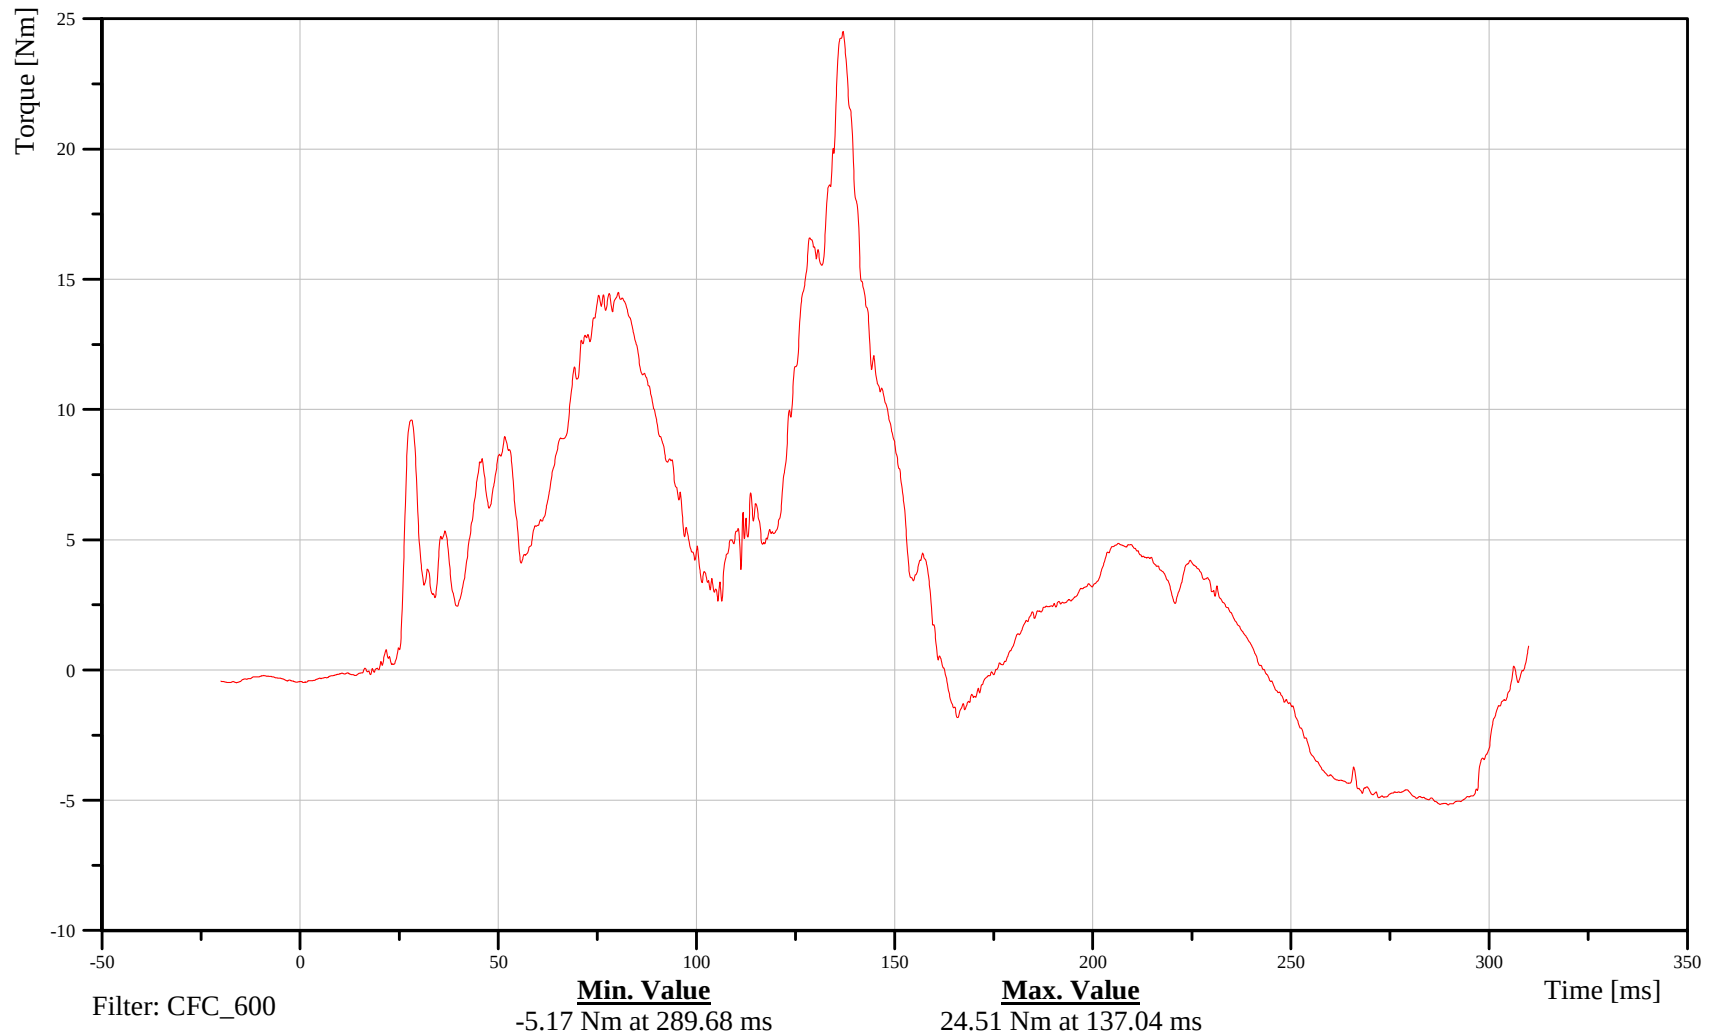

B-33

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest X-Axis Acceleration

Customer: Volpe

11CHSTCG00H3ACXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

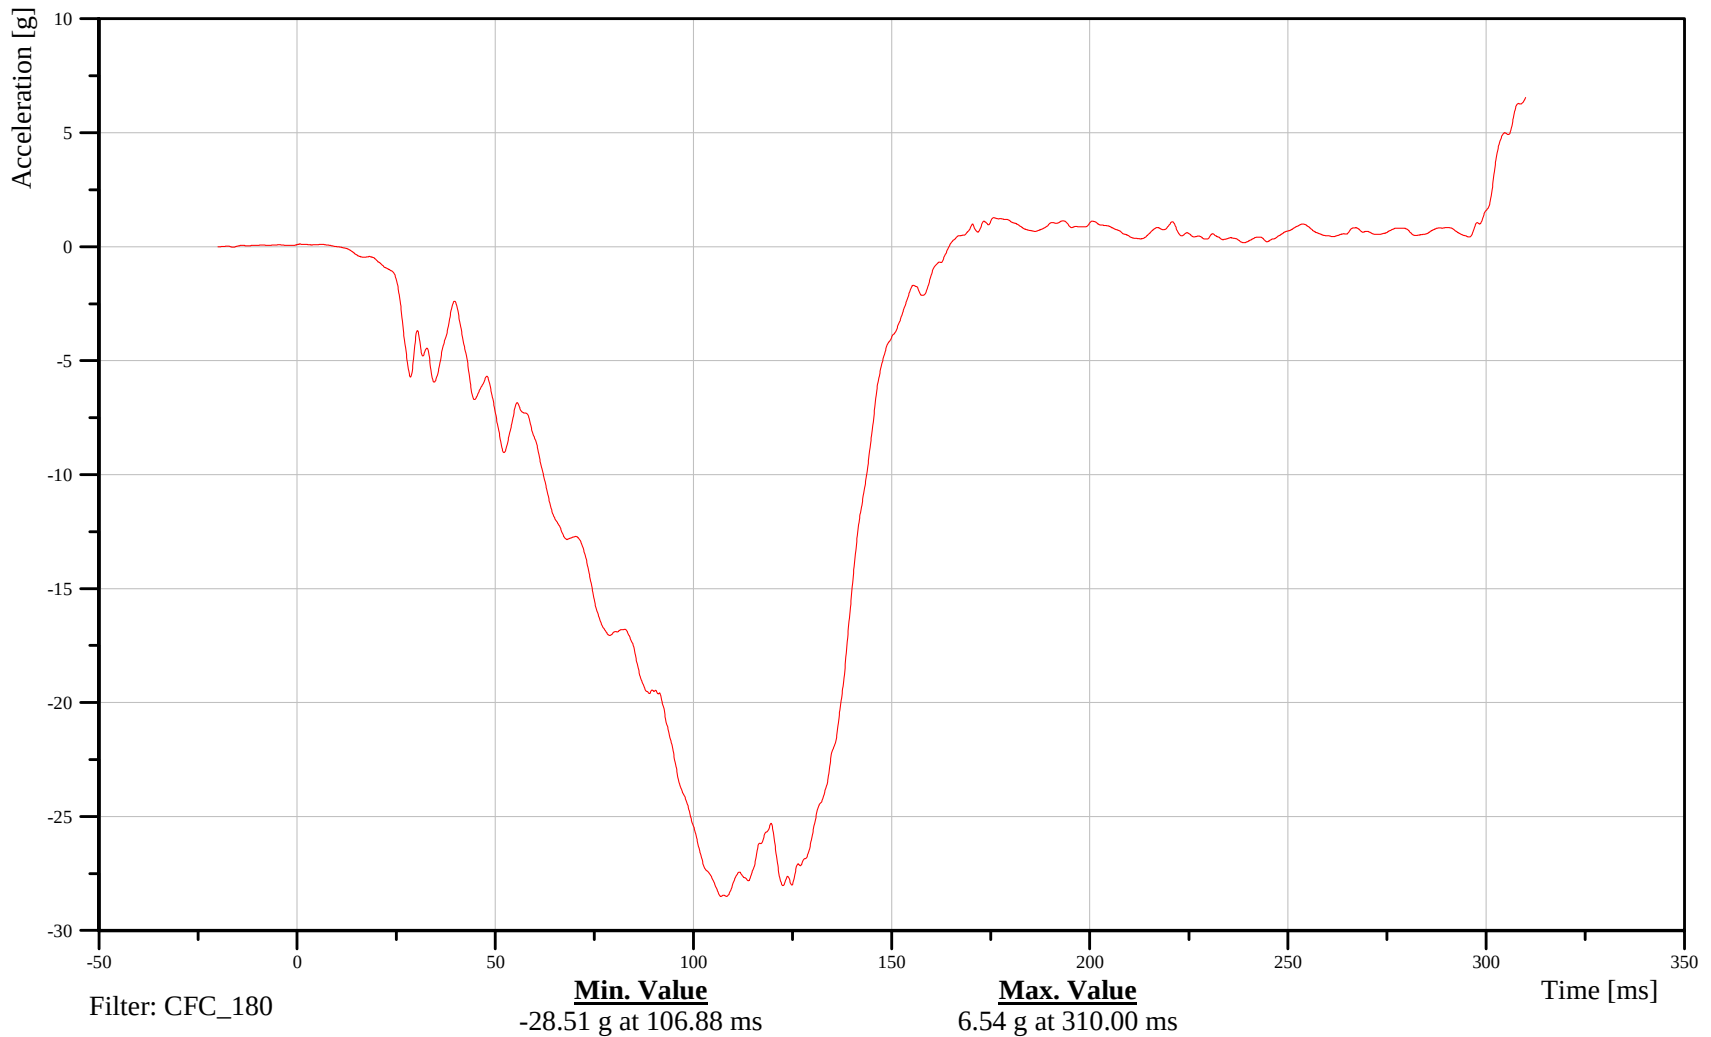

B-34

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Y-Axis Acceleration

Customer: Volpe

11CHSTCG00H3ACYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

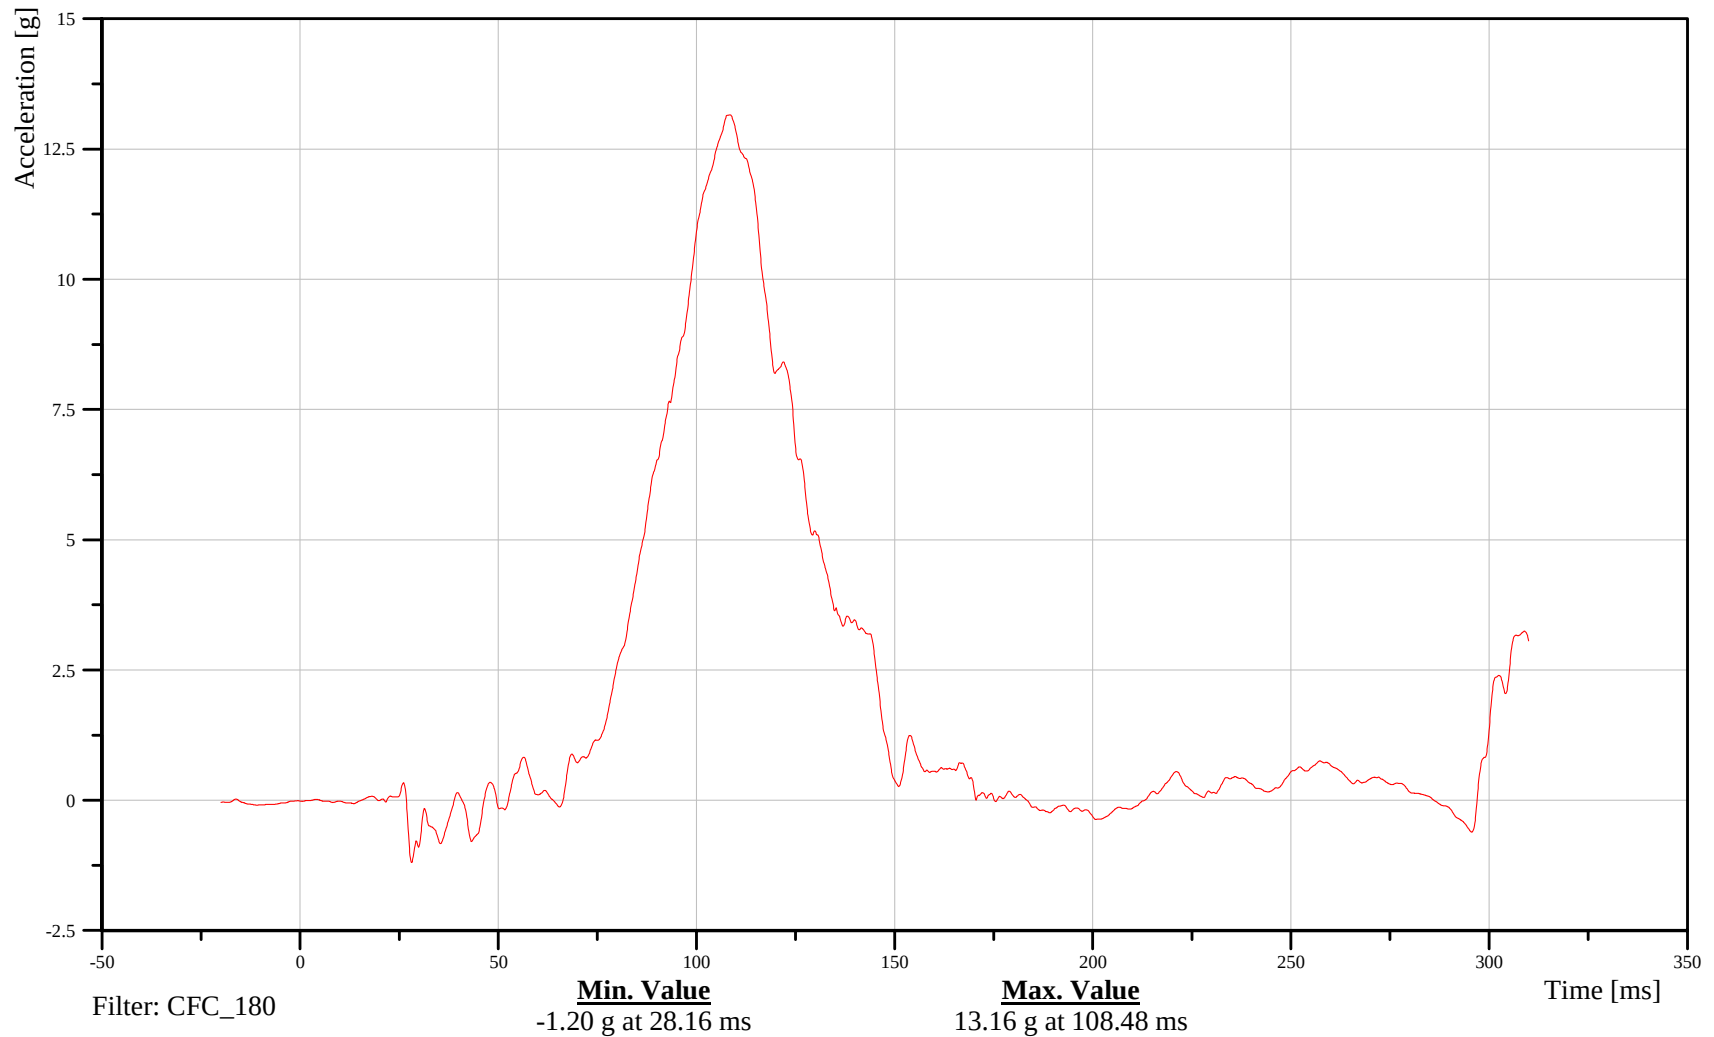

B-35

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Z-Axis Acceleration

Customer: Volpe

11CHSTCG00H3ACZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

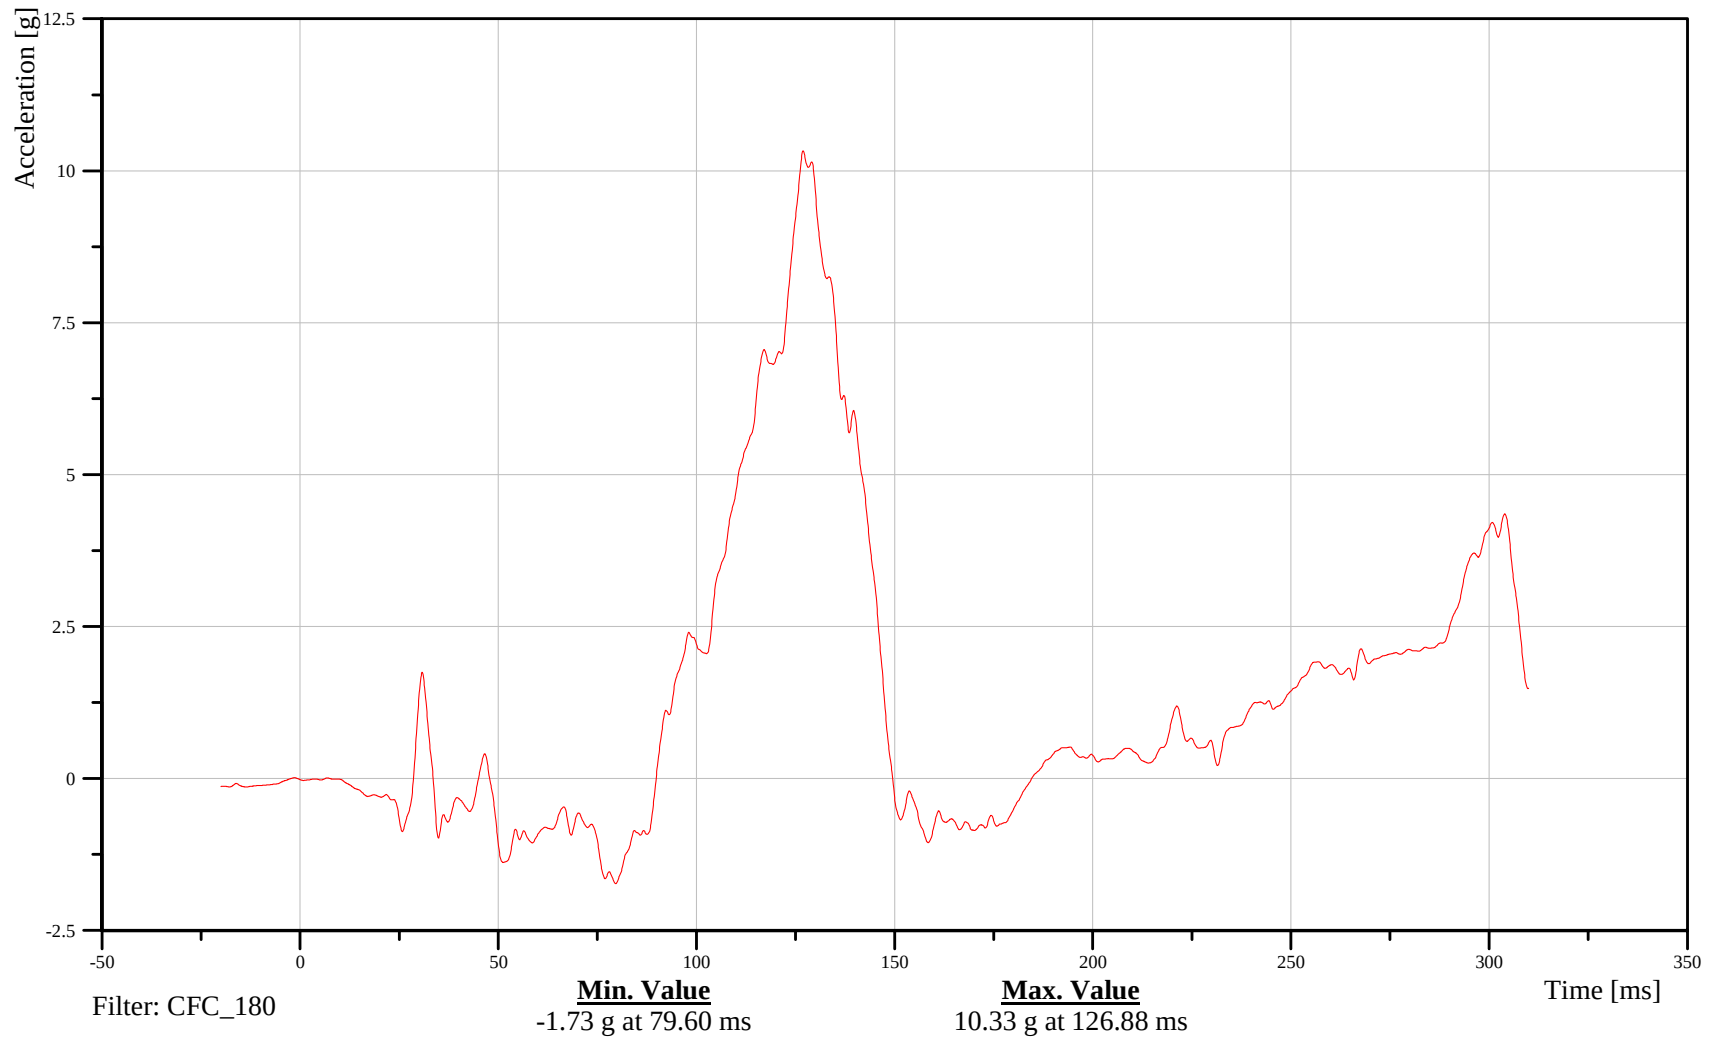

B-36

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Resultant Acceleration

Customer: Volpe

11CHSTCG00H3ACRC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

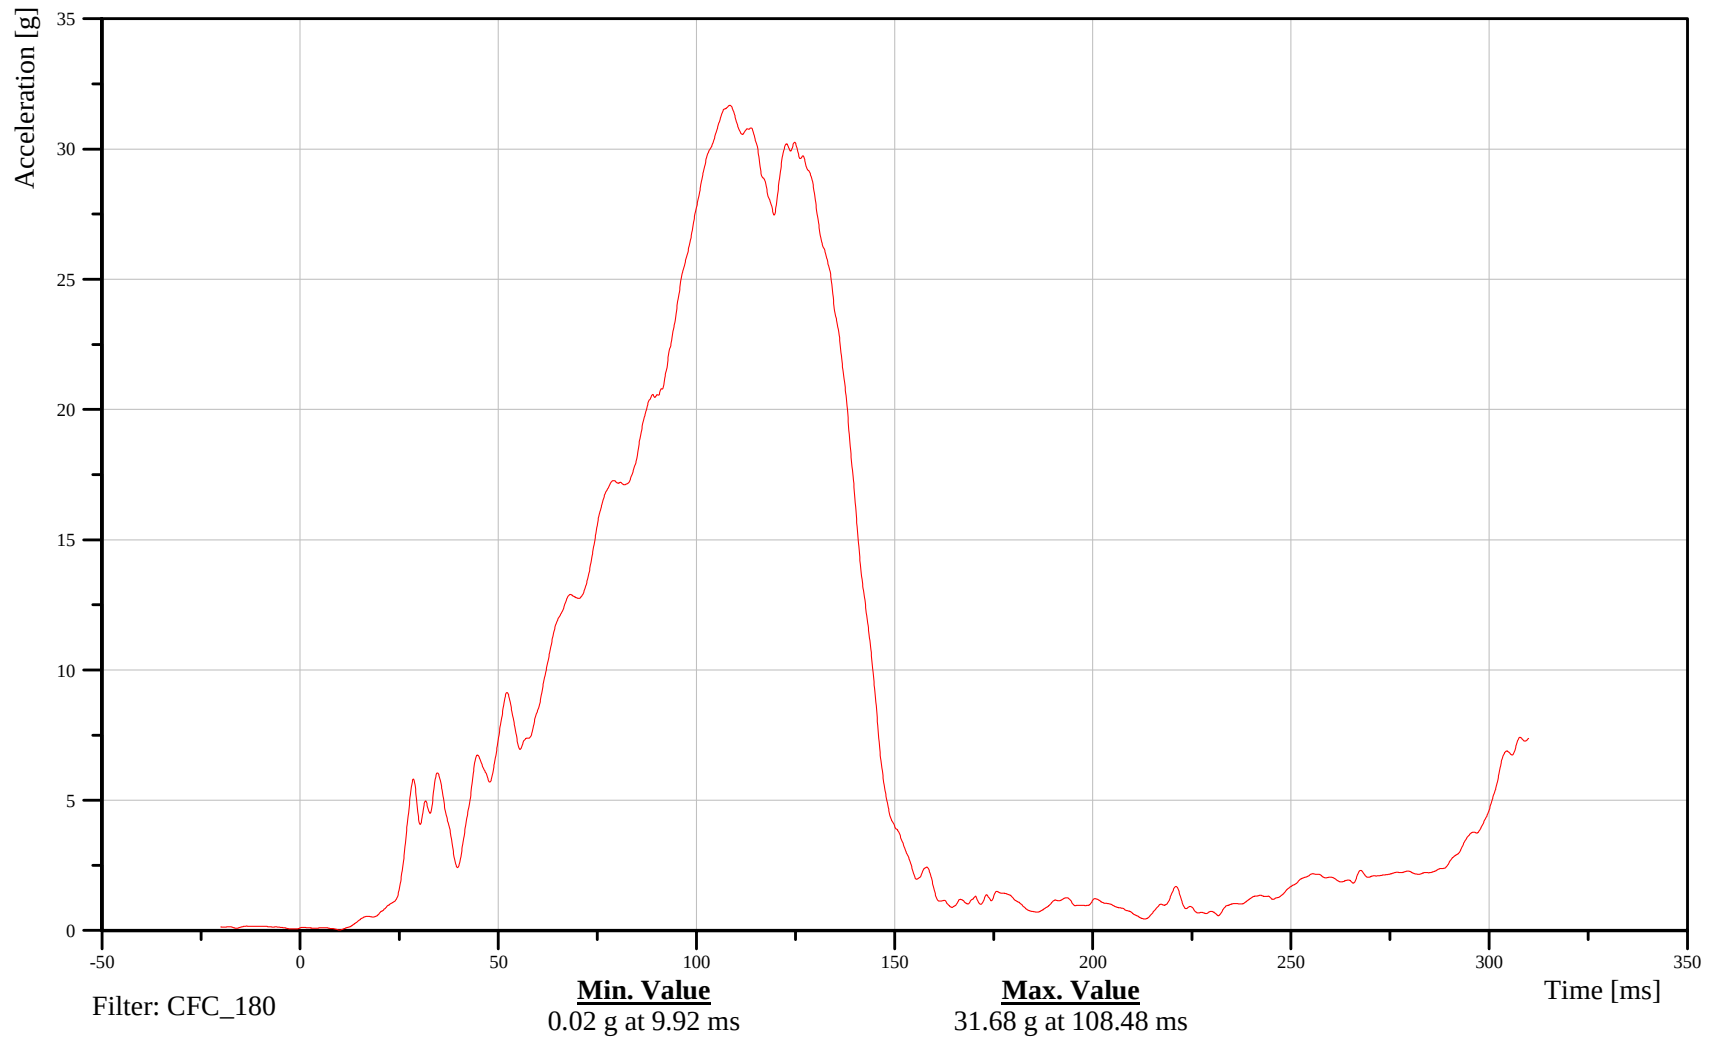

B-37

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest X-Axis Redundant Acceleration

Customer: Volpe

11CHSTCGRDH3ACXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

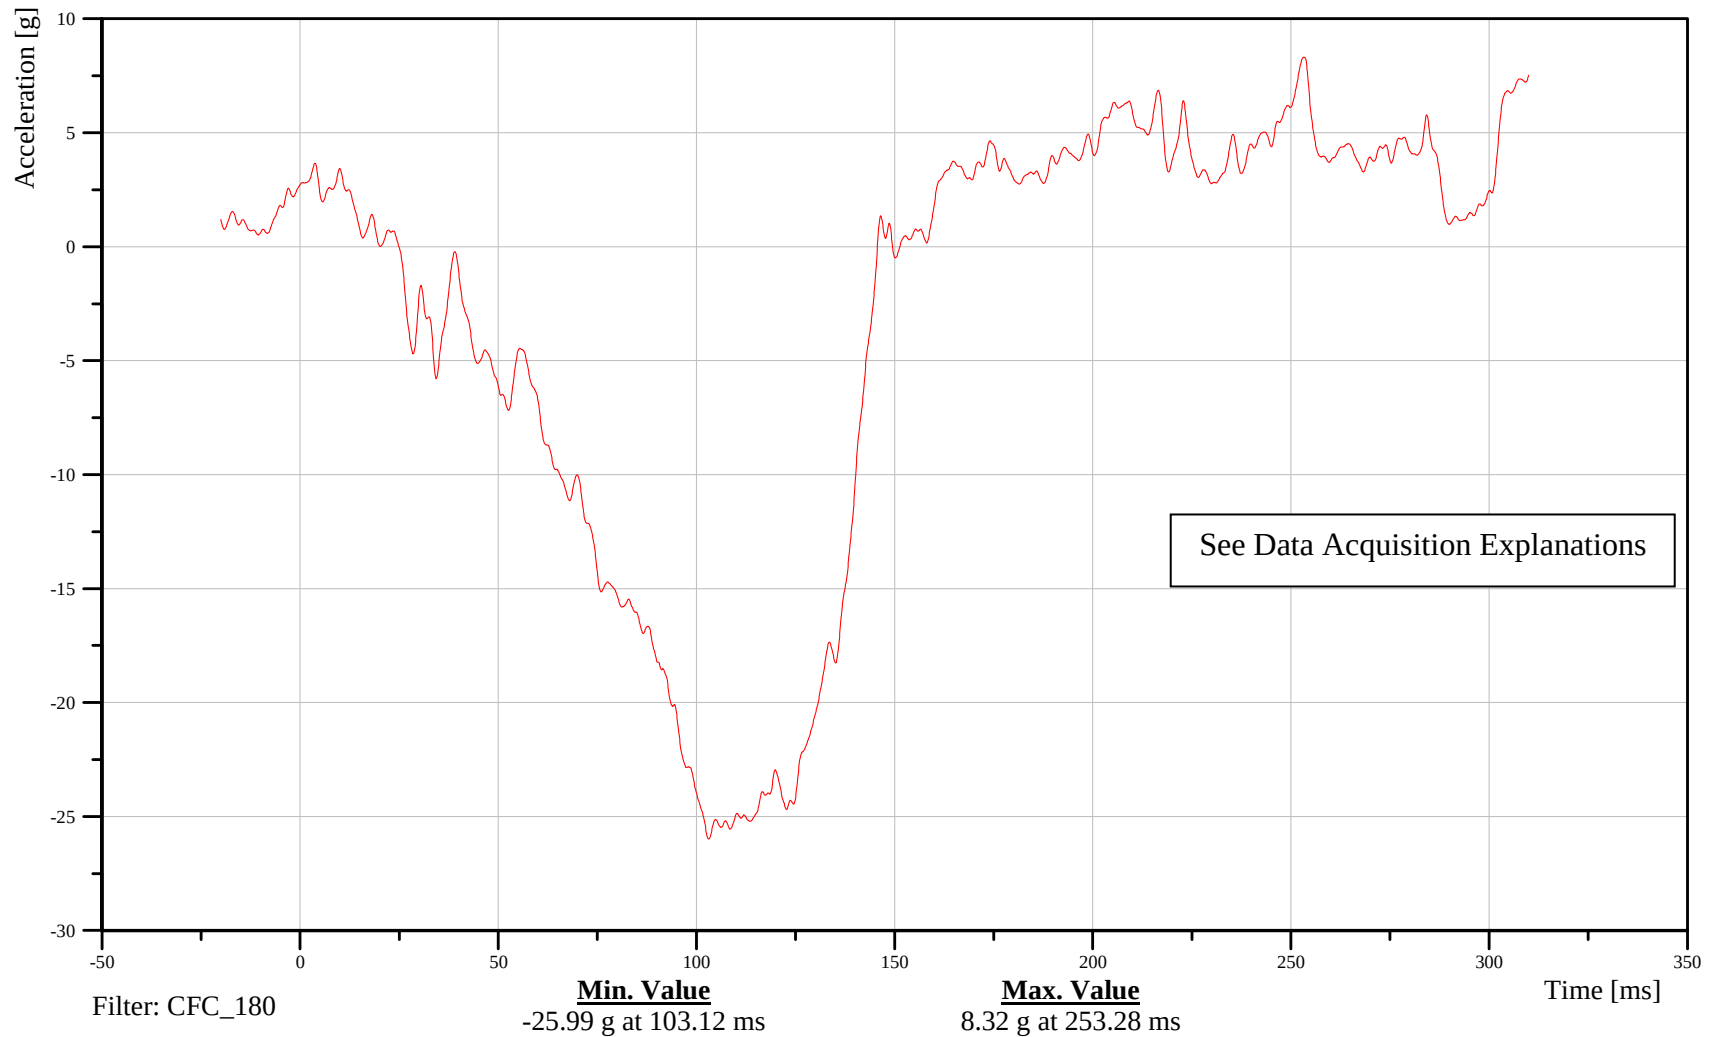

B-38

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Y-Axis Redundant Acceleration

Customer: Volpe

11CHSTCGRDH3ACYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

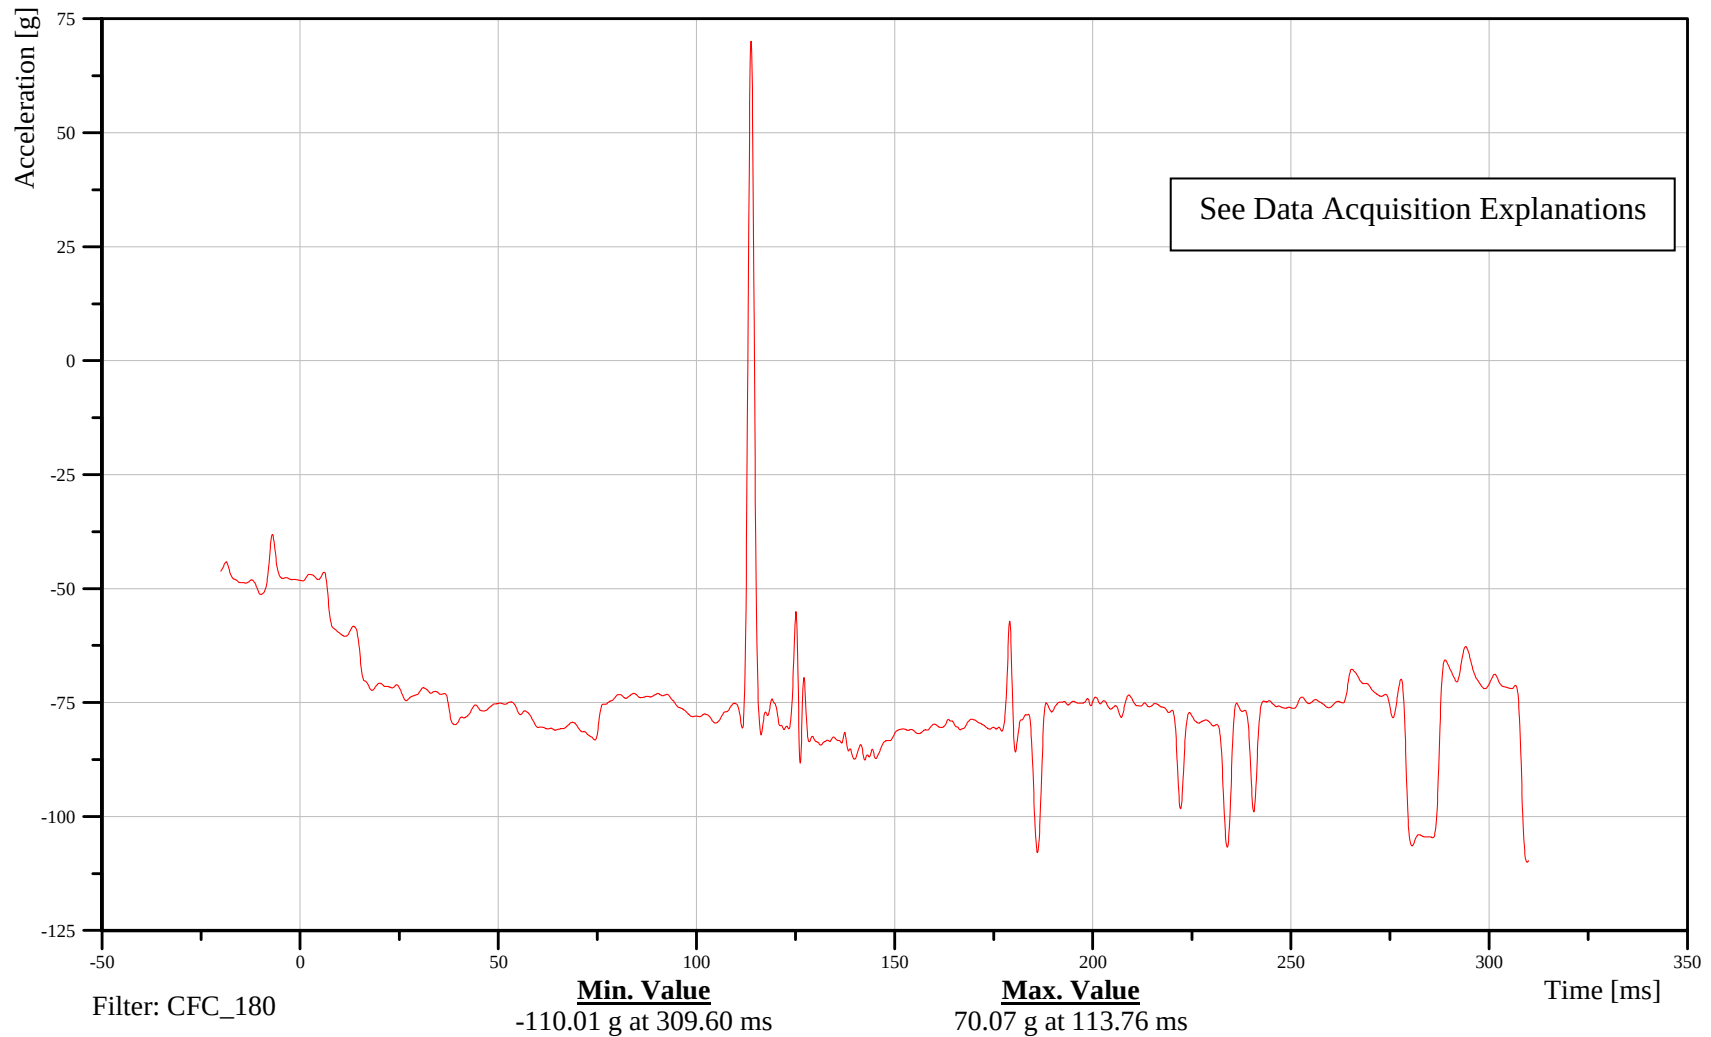

B-39

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Z-Axis Redundant Acceleration

Customer: Volpe

11CHSTCGRDH3ACZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

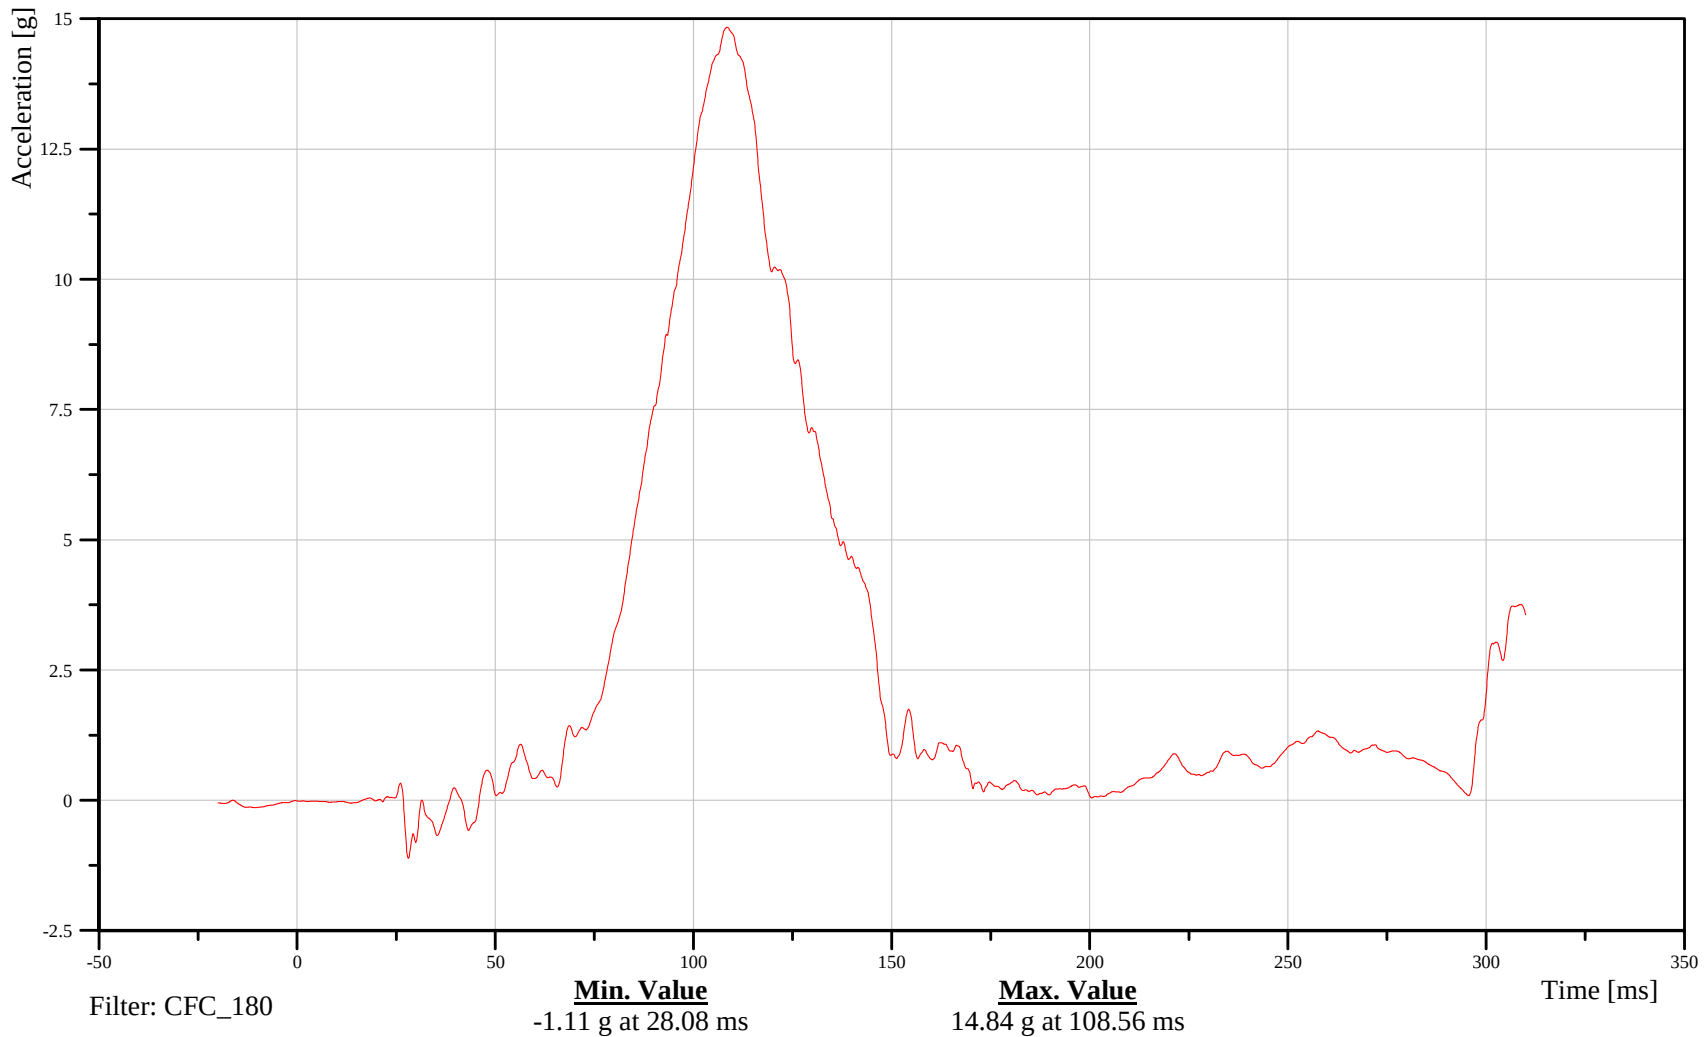

B-40

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Redundant Resultant Acceleration

Customer: Volpe

11CHSTCGRDH3ACRC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

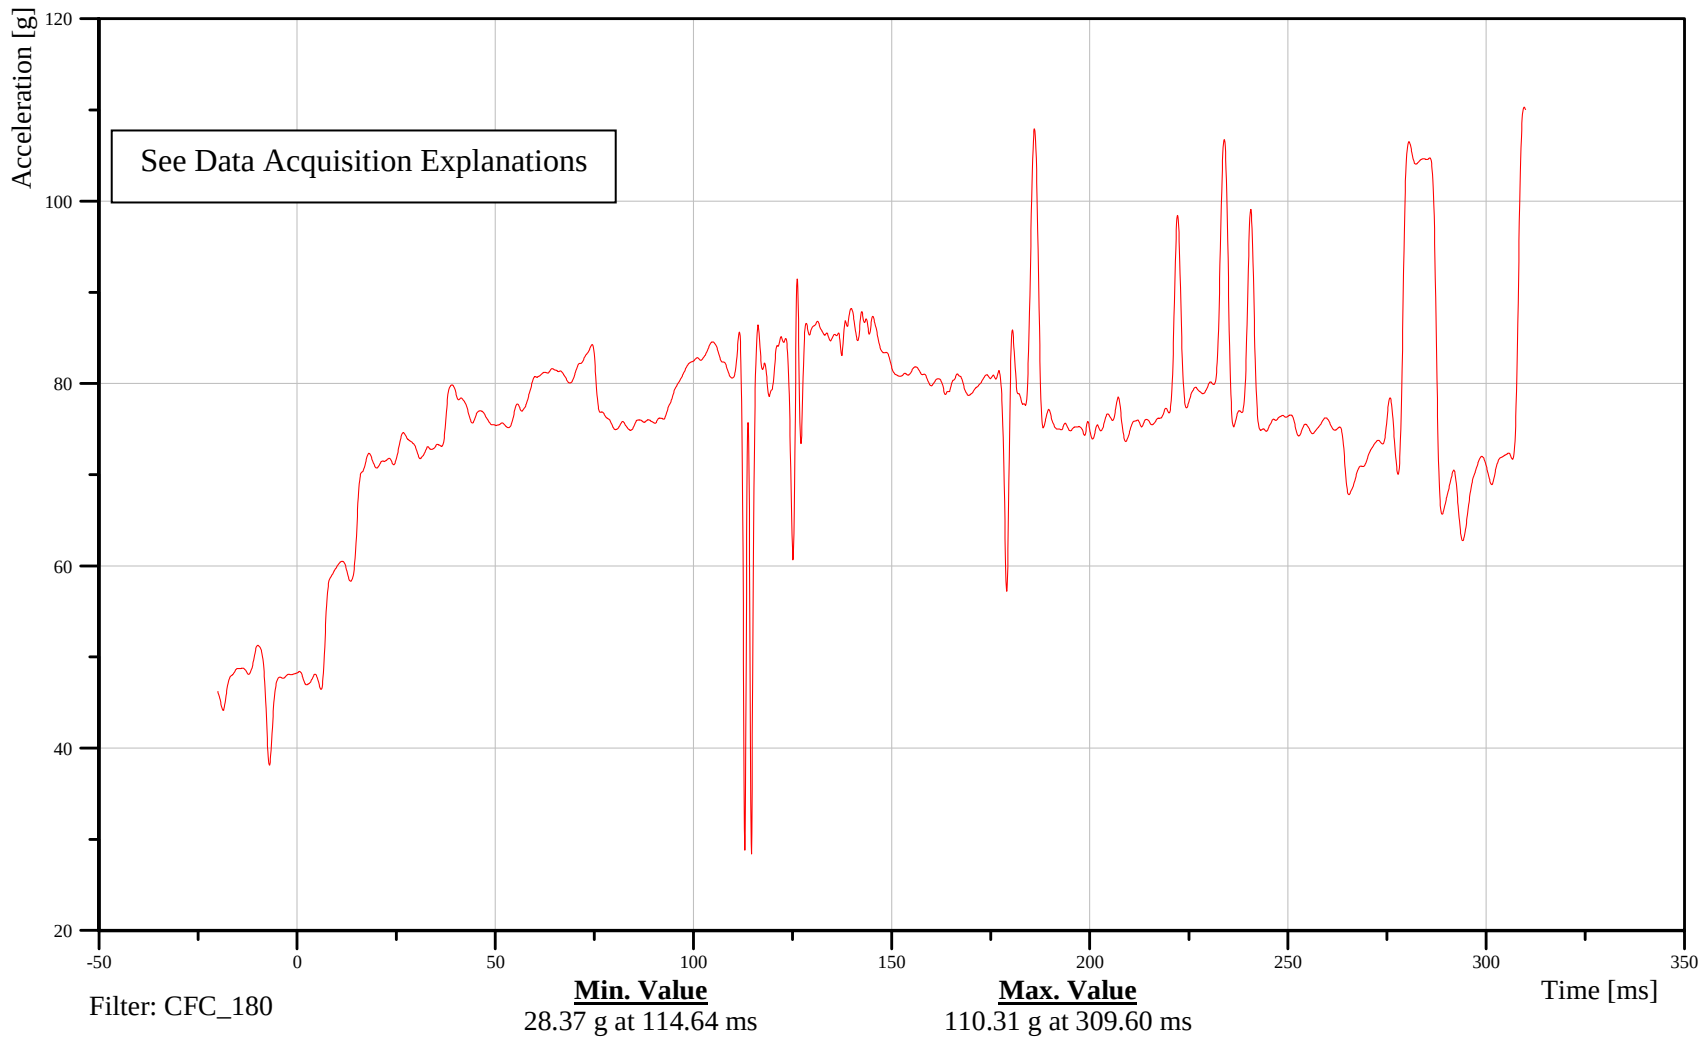

B-41

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Chest Displacement

Customer: Volpe

11CHST0000H3DSXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

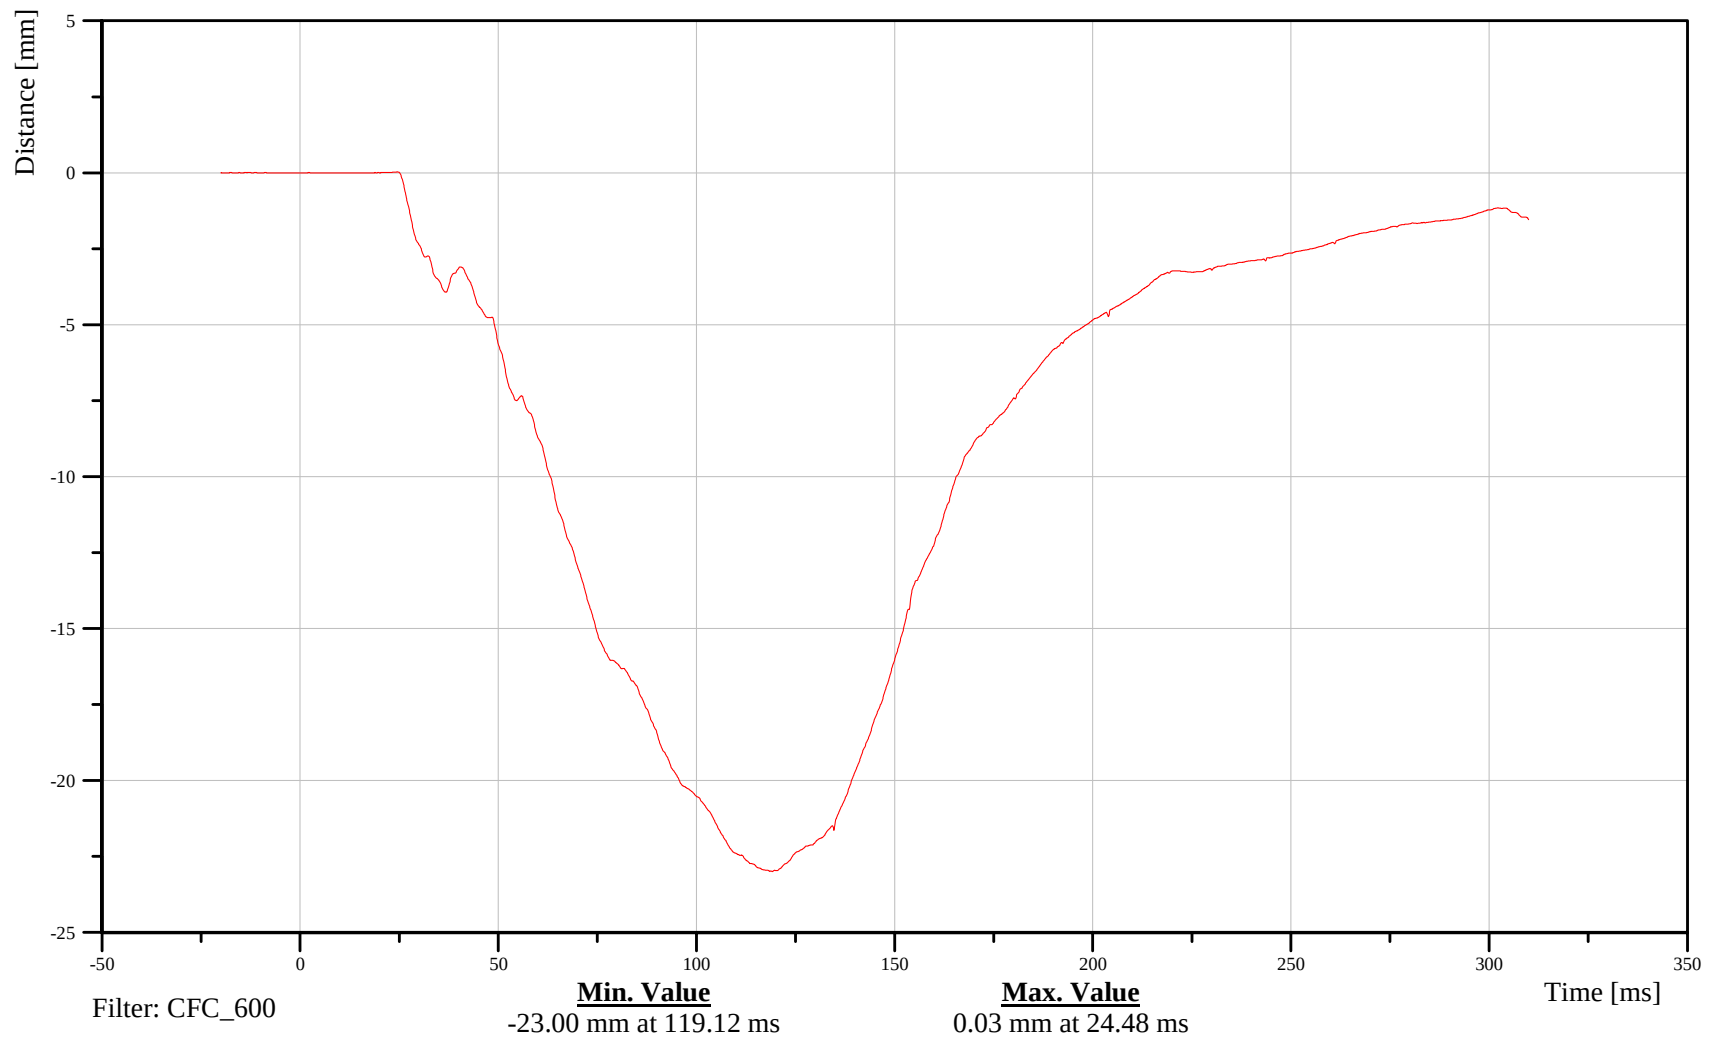

B-42

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Femur Z-Axis Force

Customer: Volpe

11FEMRLL00H3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

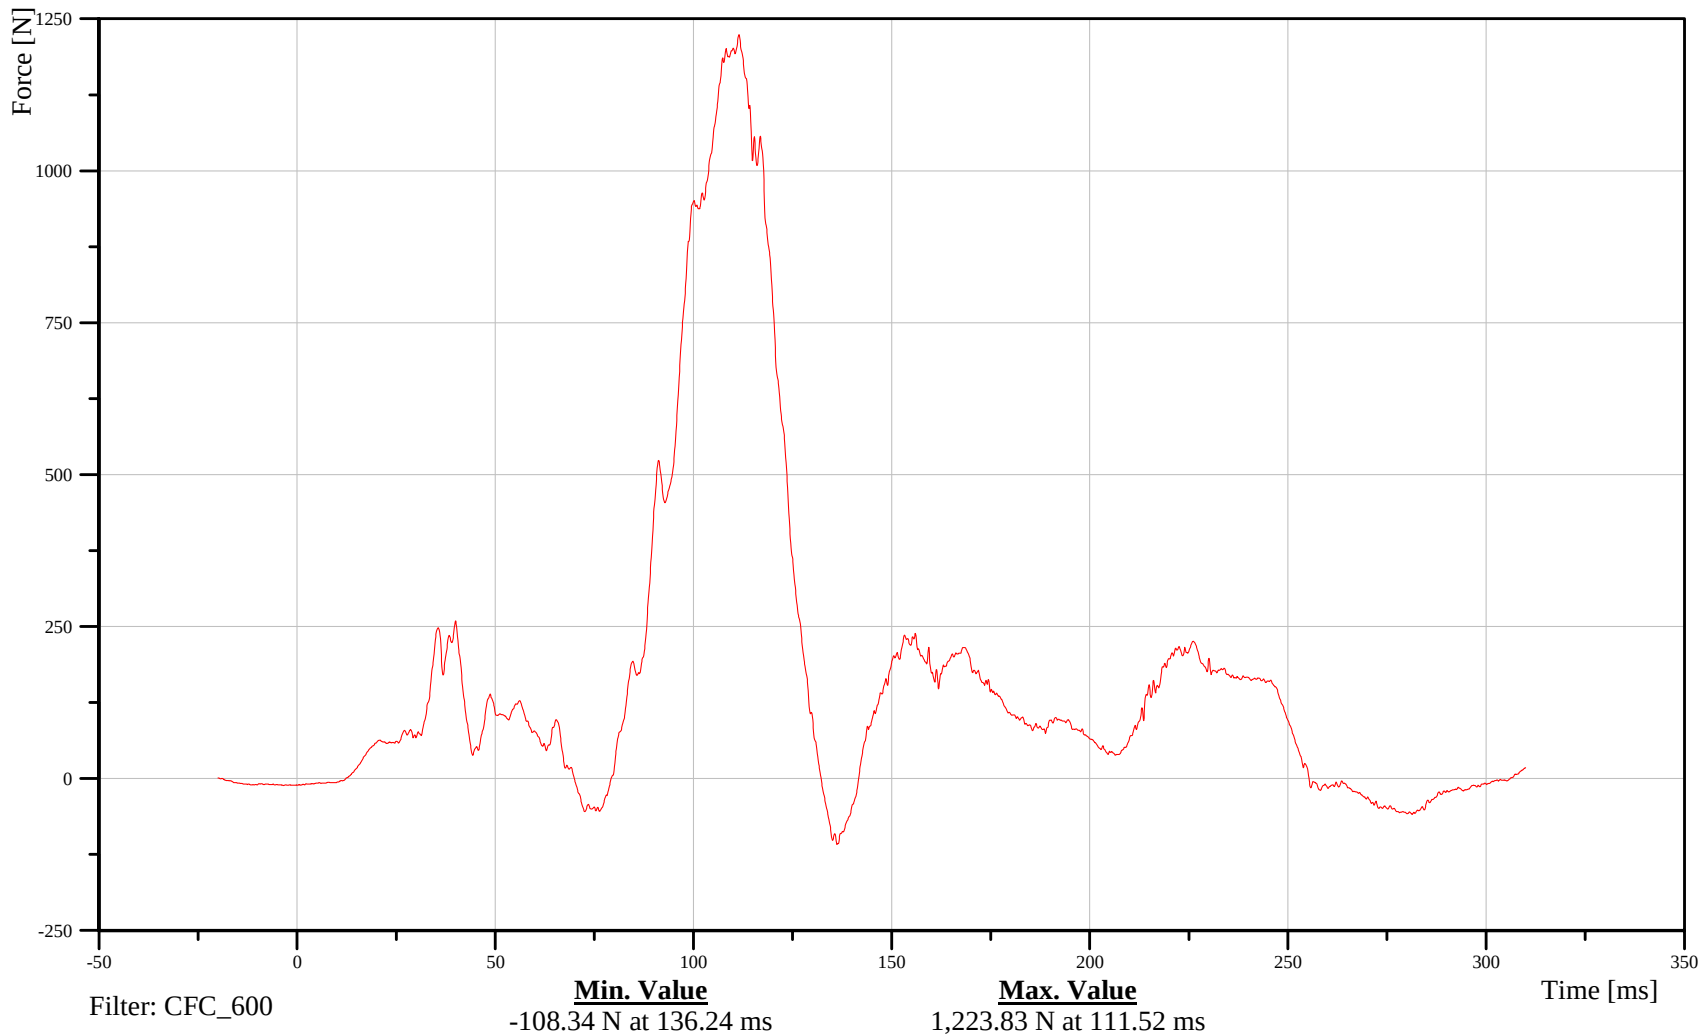

B-43

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Femur Z-Axis Force

Customer: Volpe

11FEMRRL00H3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

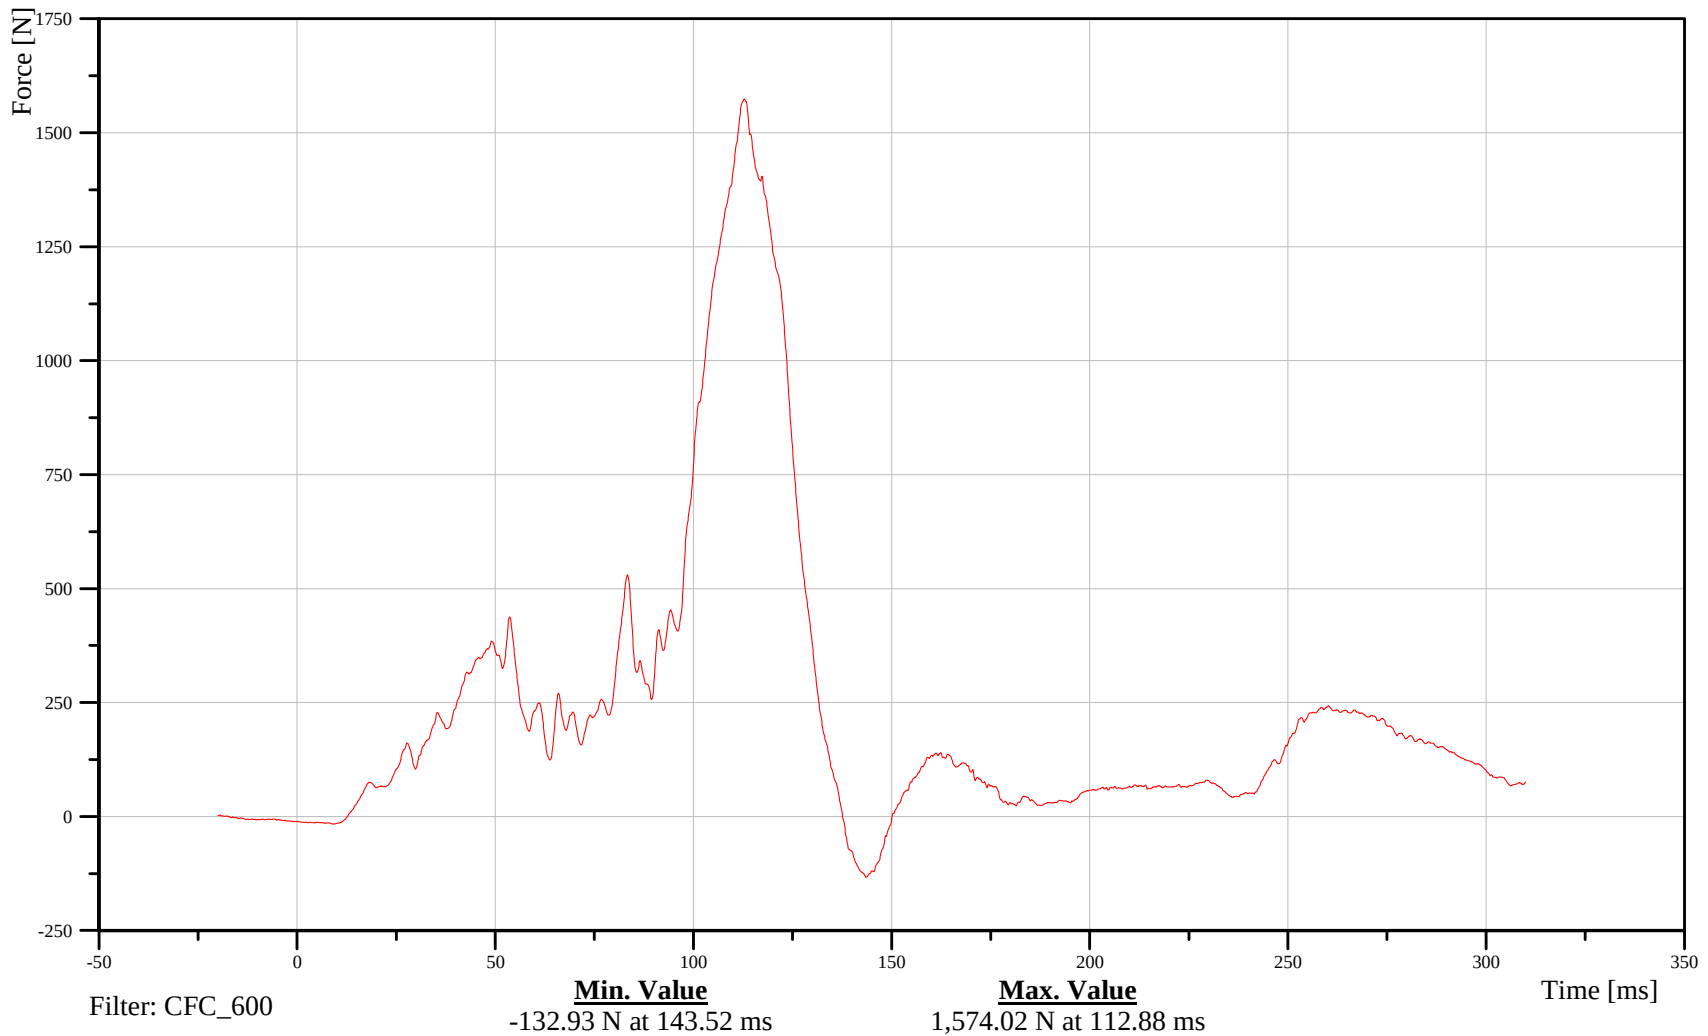

B-44

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Knee Displacement

Customer: Volpe

11KNSLLE00H3DSXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

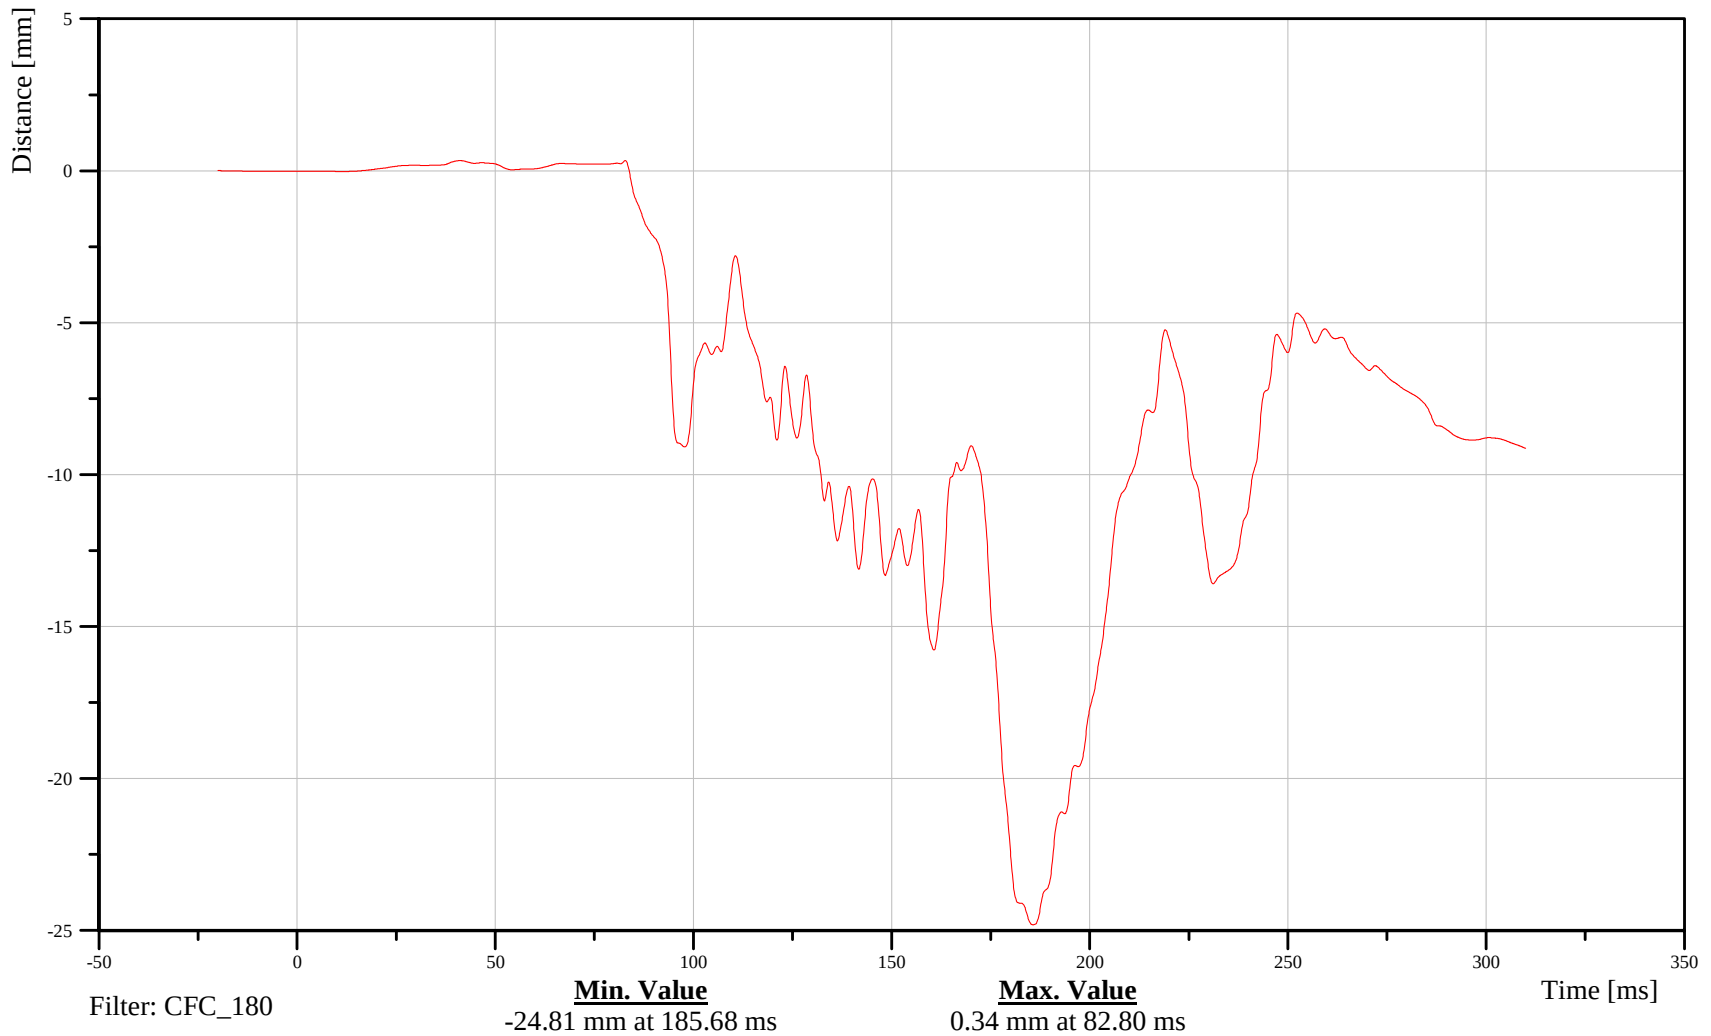

B-45

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Upper Tibia X-Axis Force

Customer: Volpe

11TIBILULXH3FOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

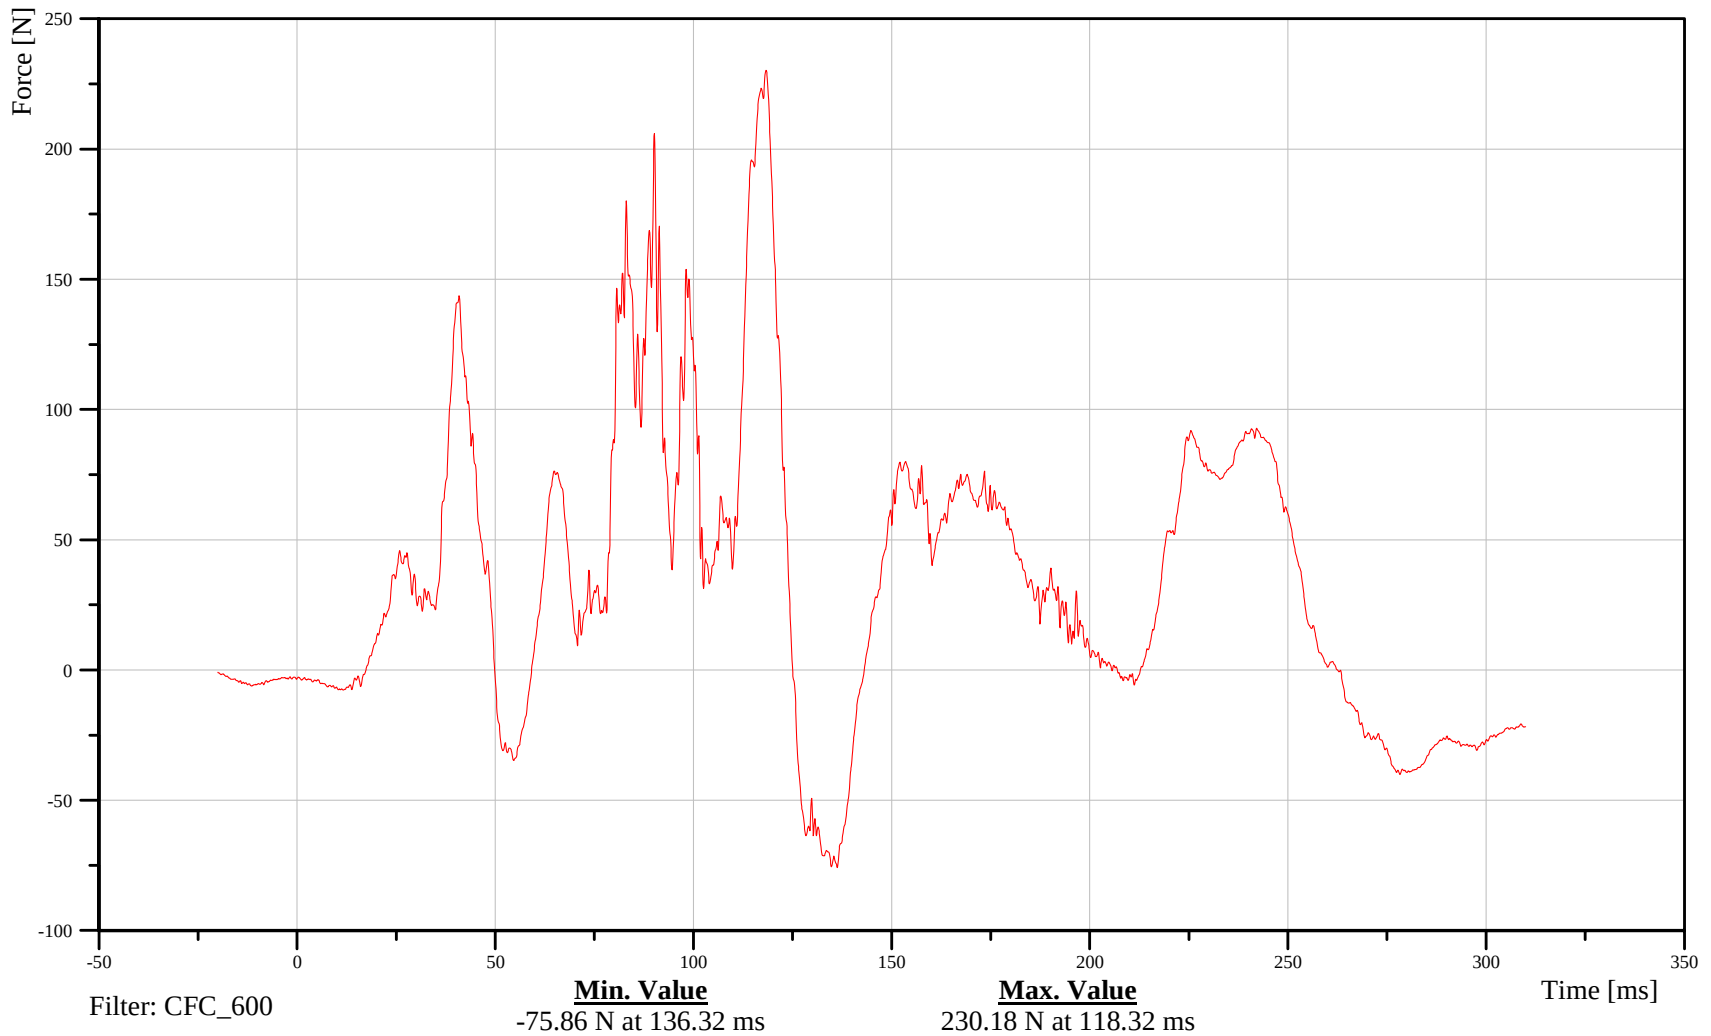

B-46

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Upper Tibia Z-Axis Force

Customer: Volpe

11TIBILULXH3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

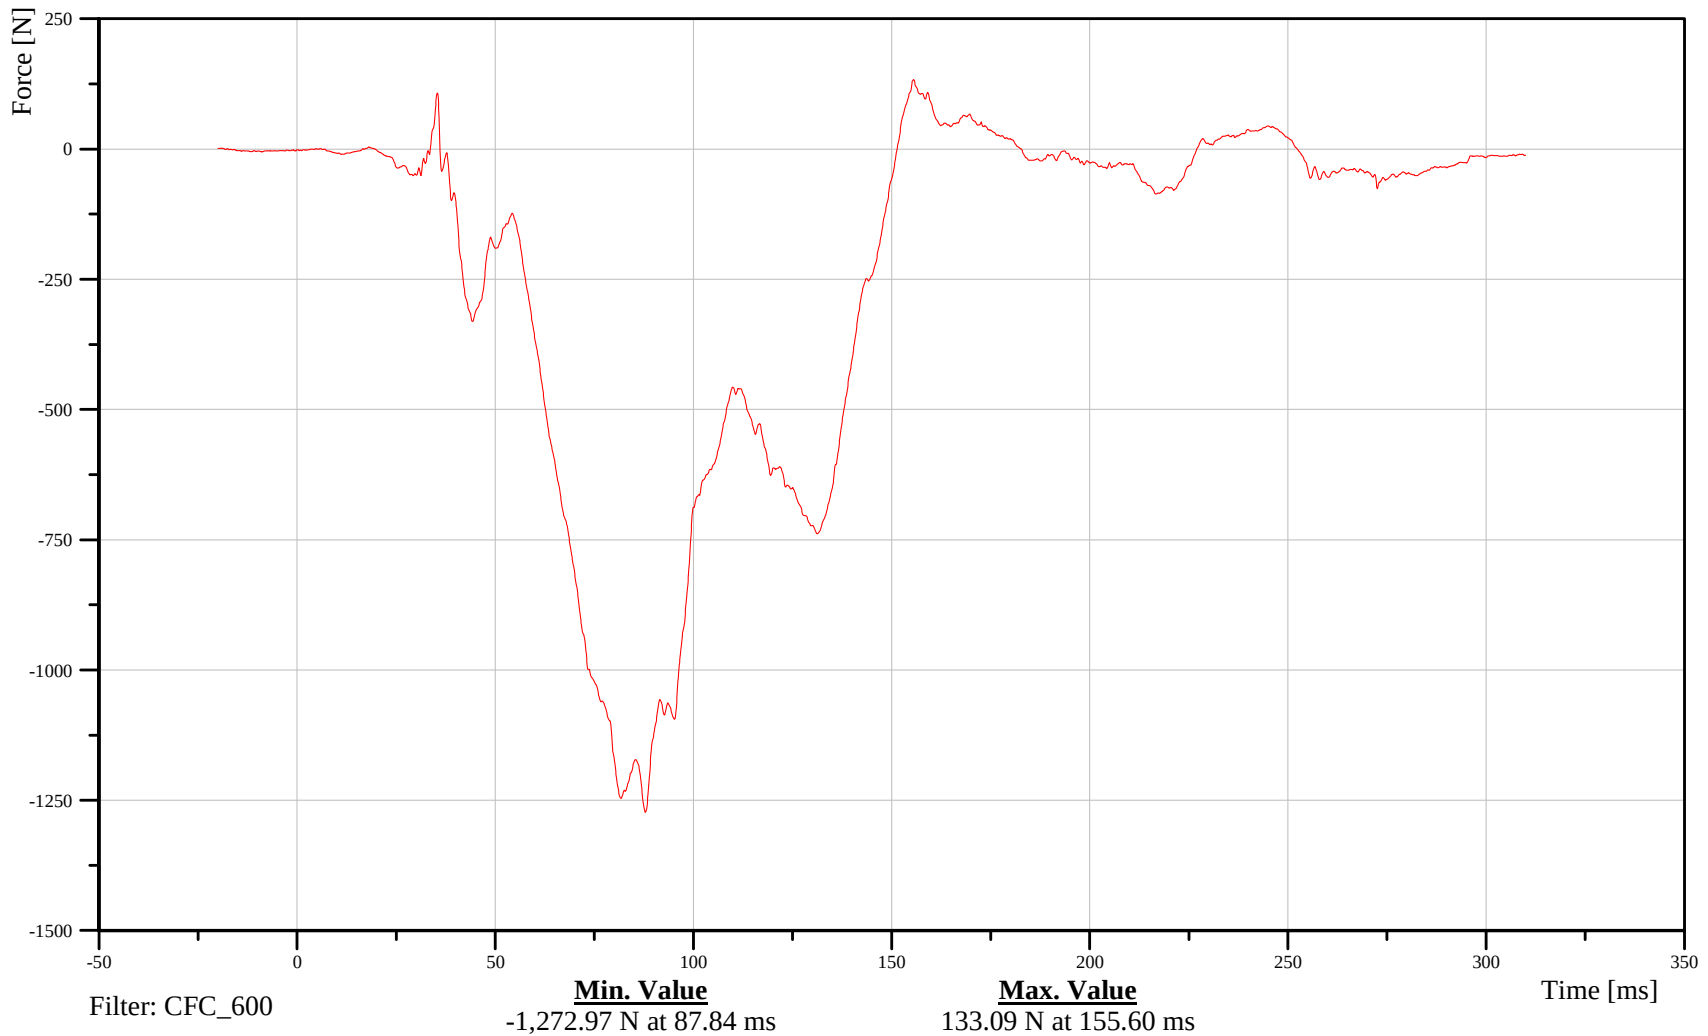

B-47

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Upper Tibia Moment About X Axis

Customer: Volpe

11TIBILULXH3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

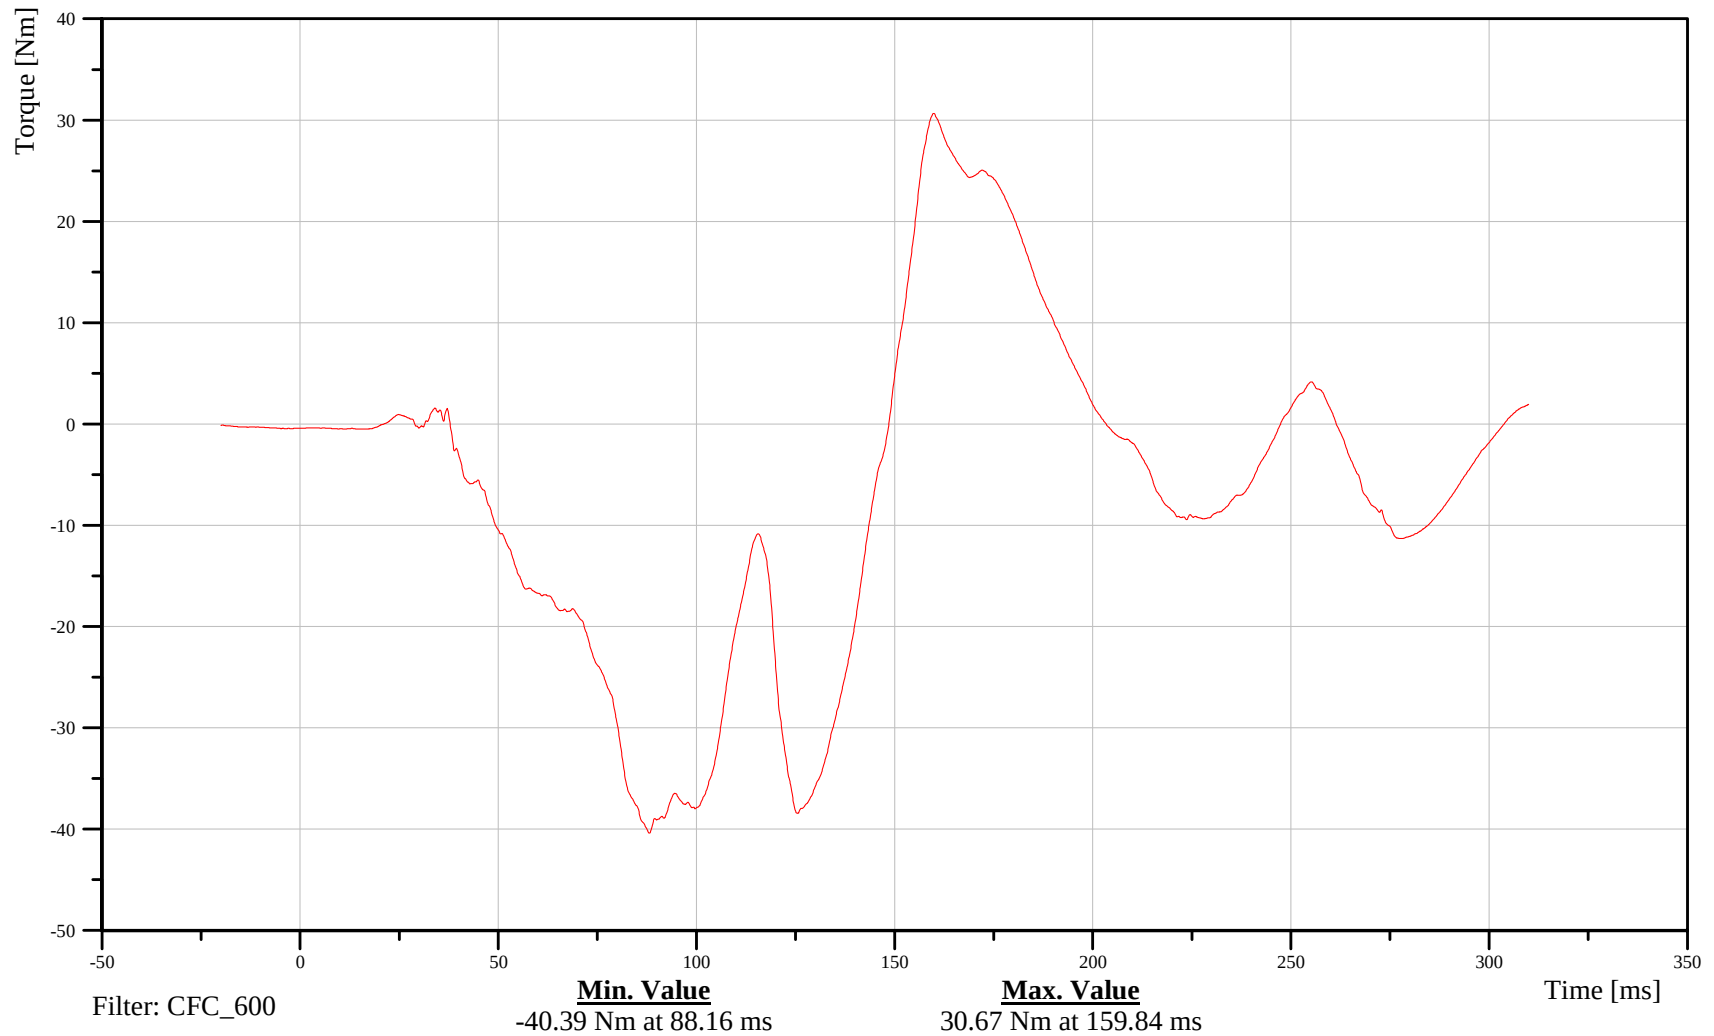

B-48

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Upper Tibia Moment About Y Axis

Customer: Volpe

11TIBILULXH3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

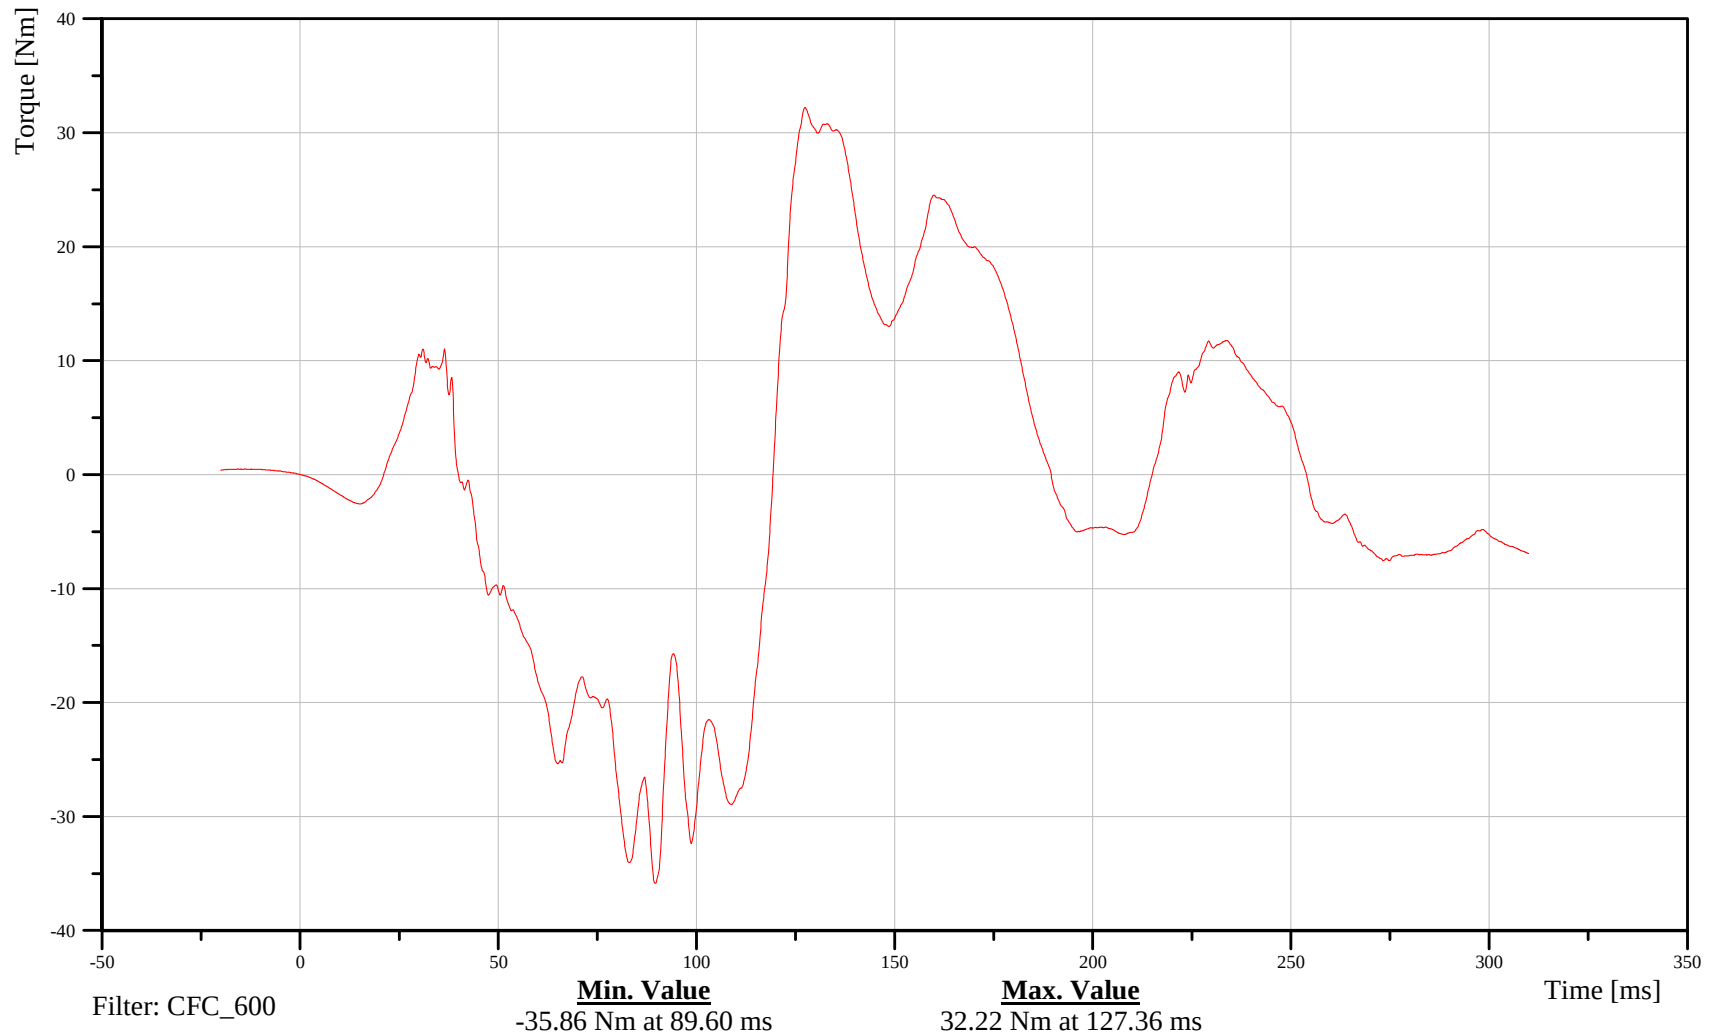

B-49

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Tibia X-Axis Acceleration

Customer: Volpe

11TIBILELXH3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

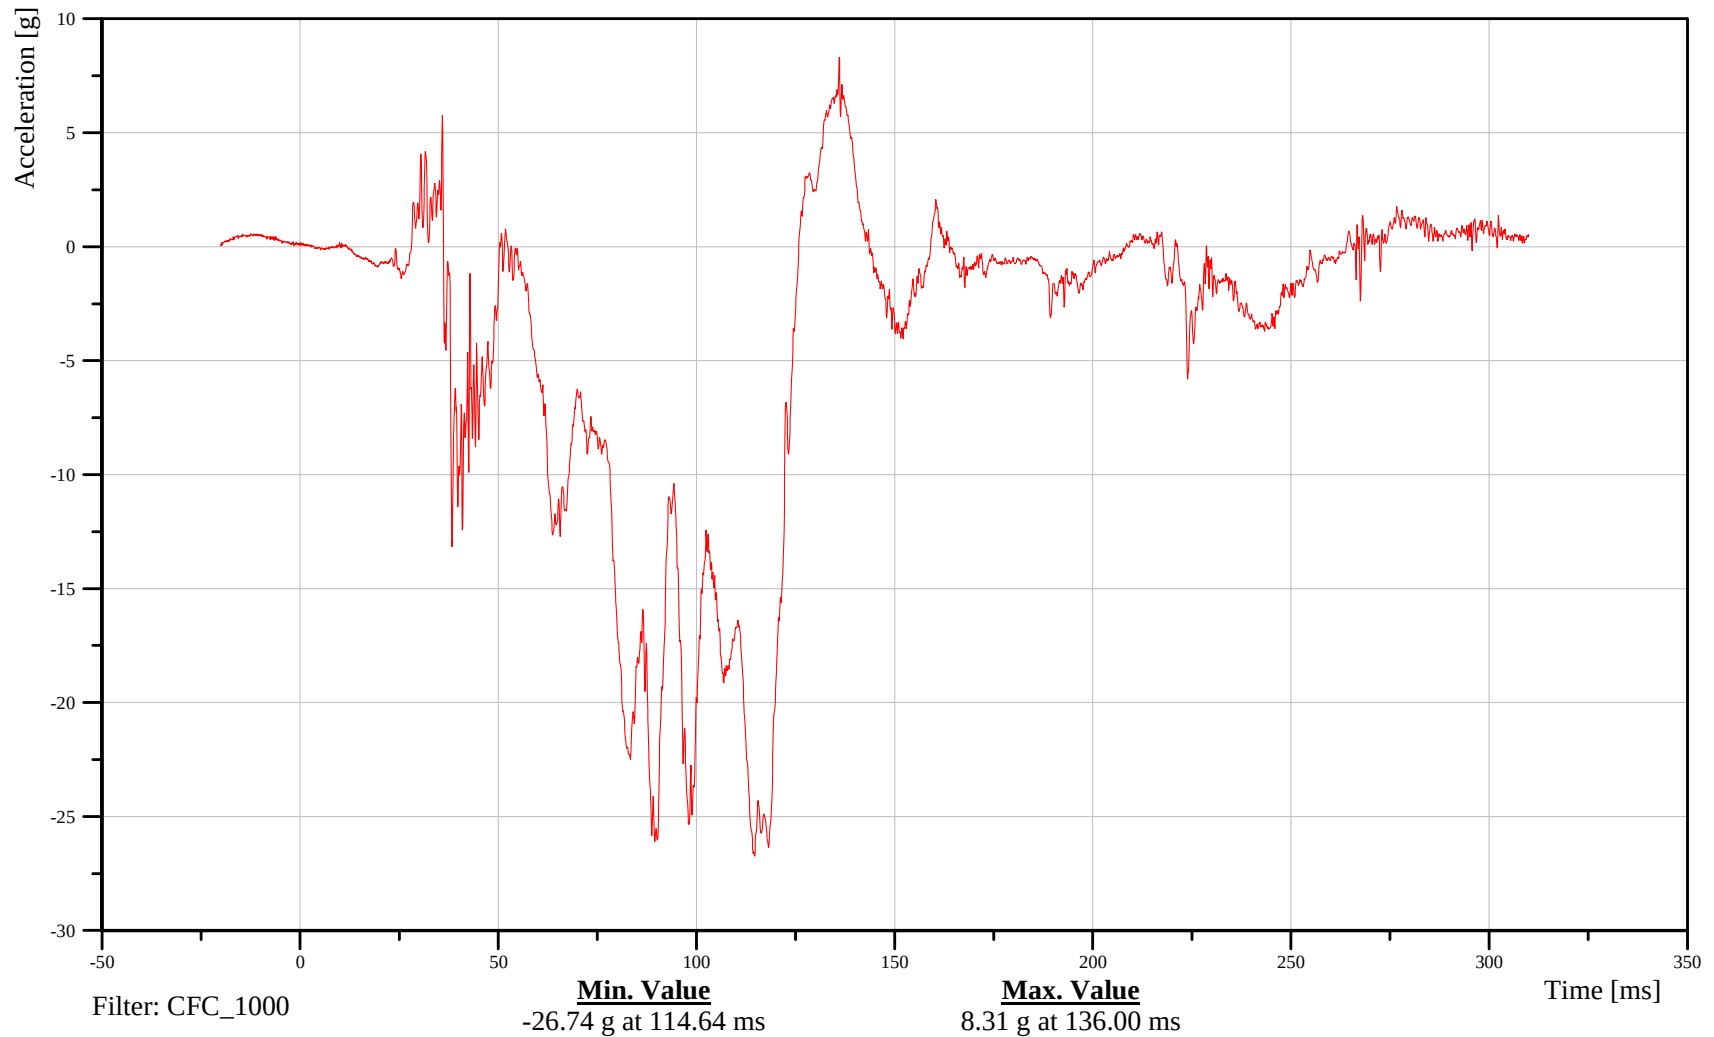

B-50

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Tibia Y-Axis Acceleration

Customer: Volpe

11TIBILELXH3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

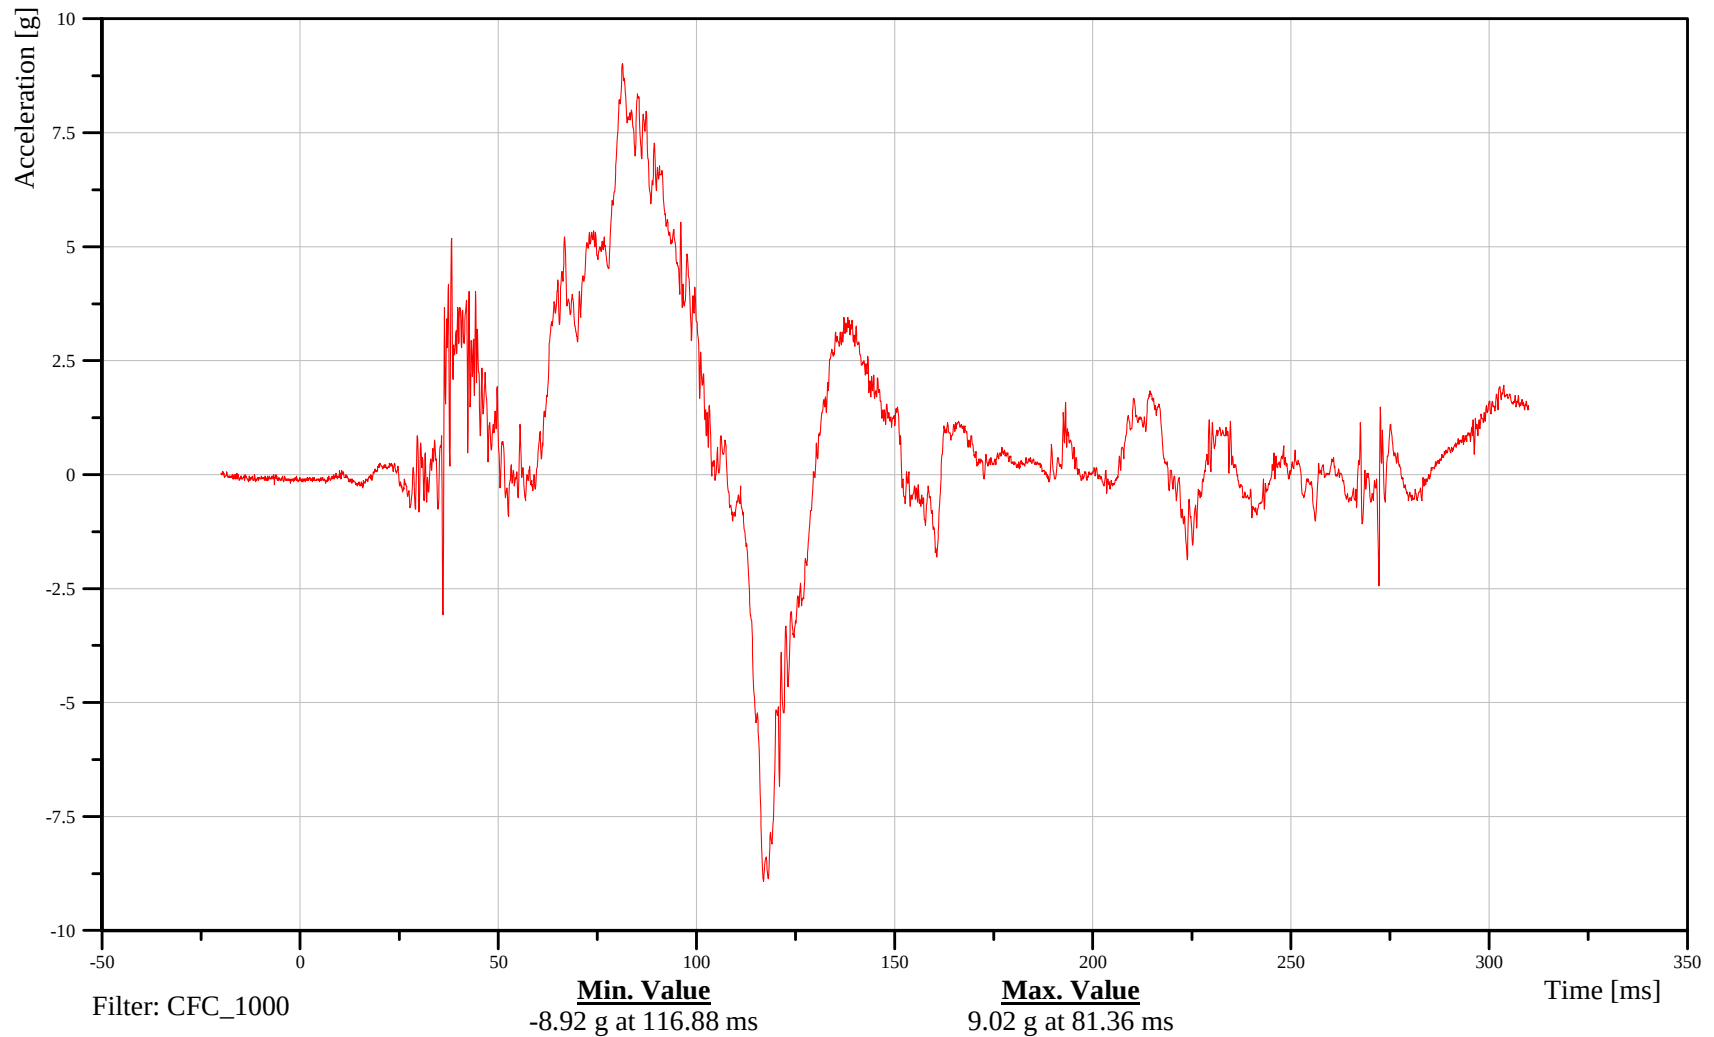

B-51

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Lower Tibia X-Axis Force

Customer: Volpe

11TIBILLXH3FOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

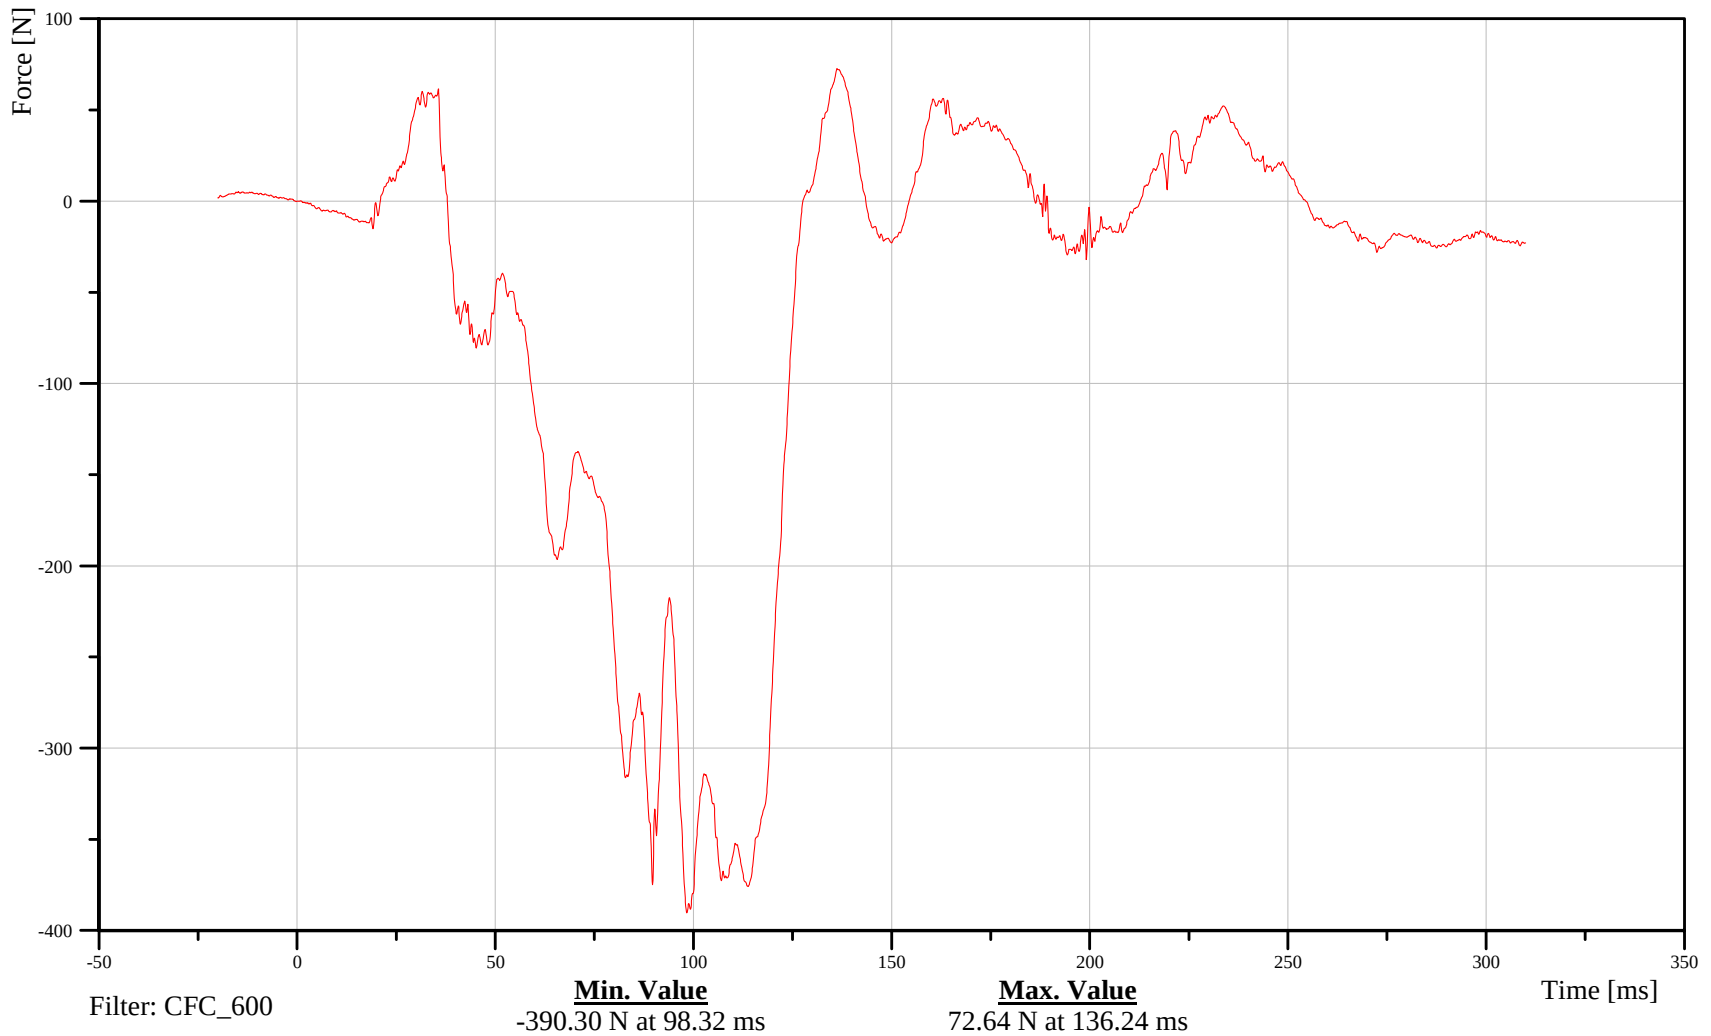

B-52

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Lower Tibia Y-Axis Force

Customer: Volpe

11TIBILLXH3FOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

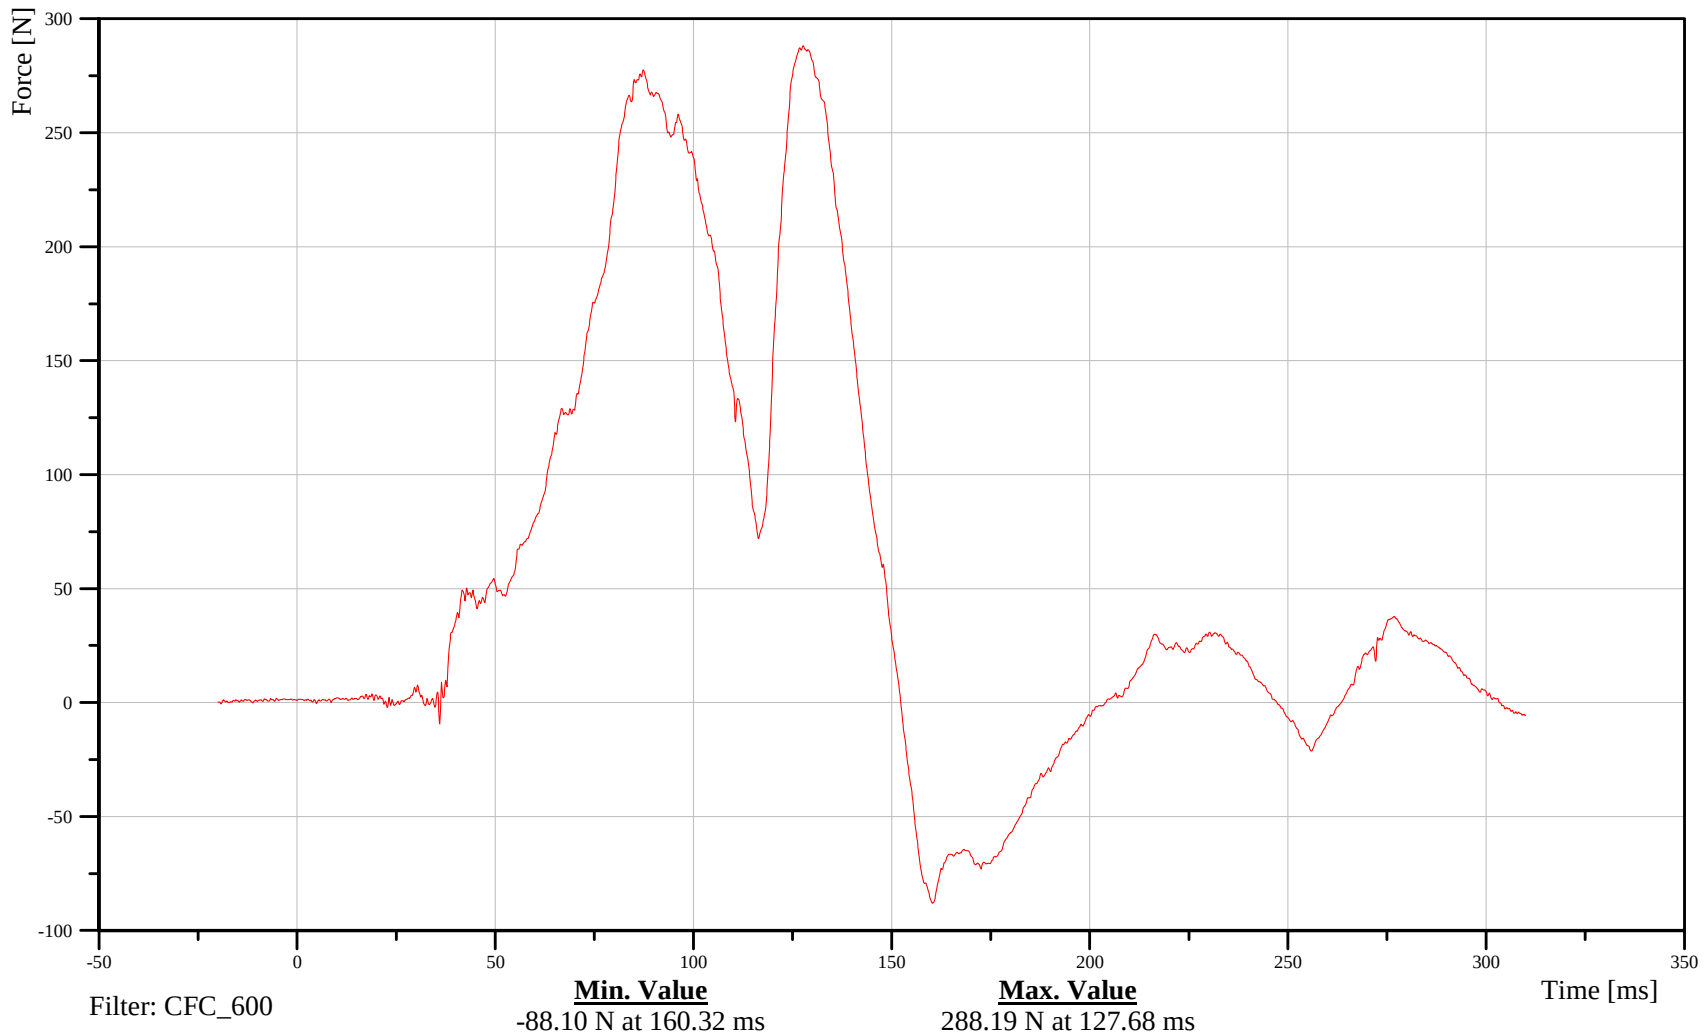

B-53

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Lower Tibia Z-Axis Force

Customer: Volpe

11TIBILLXH3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

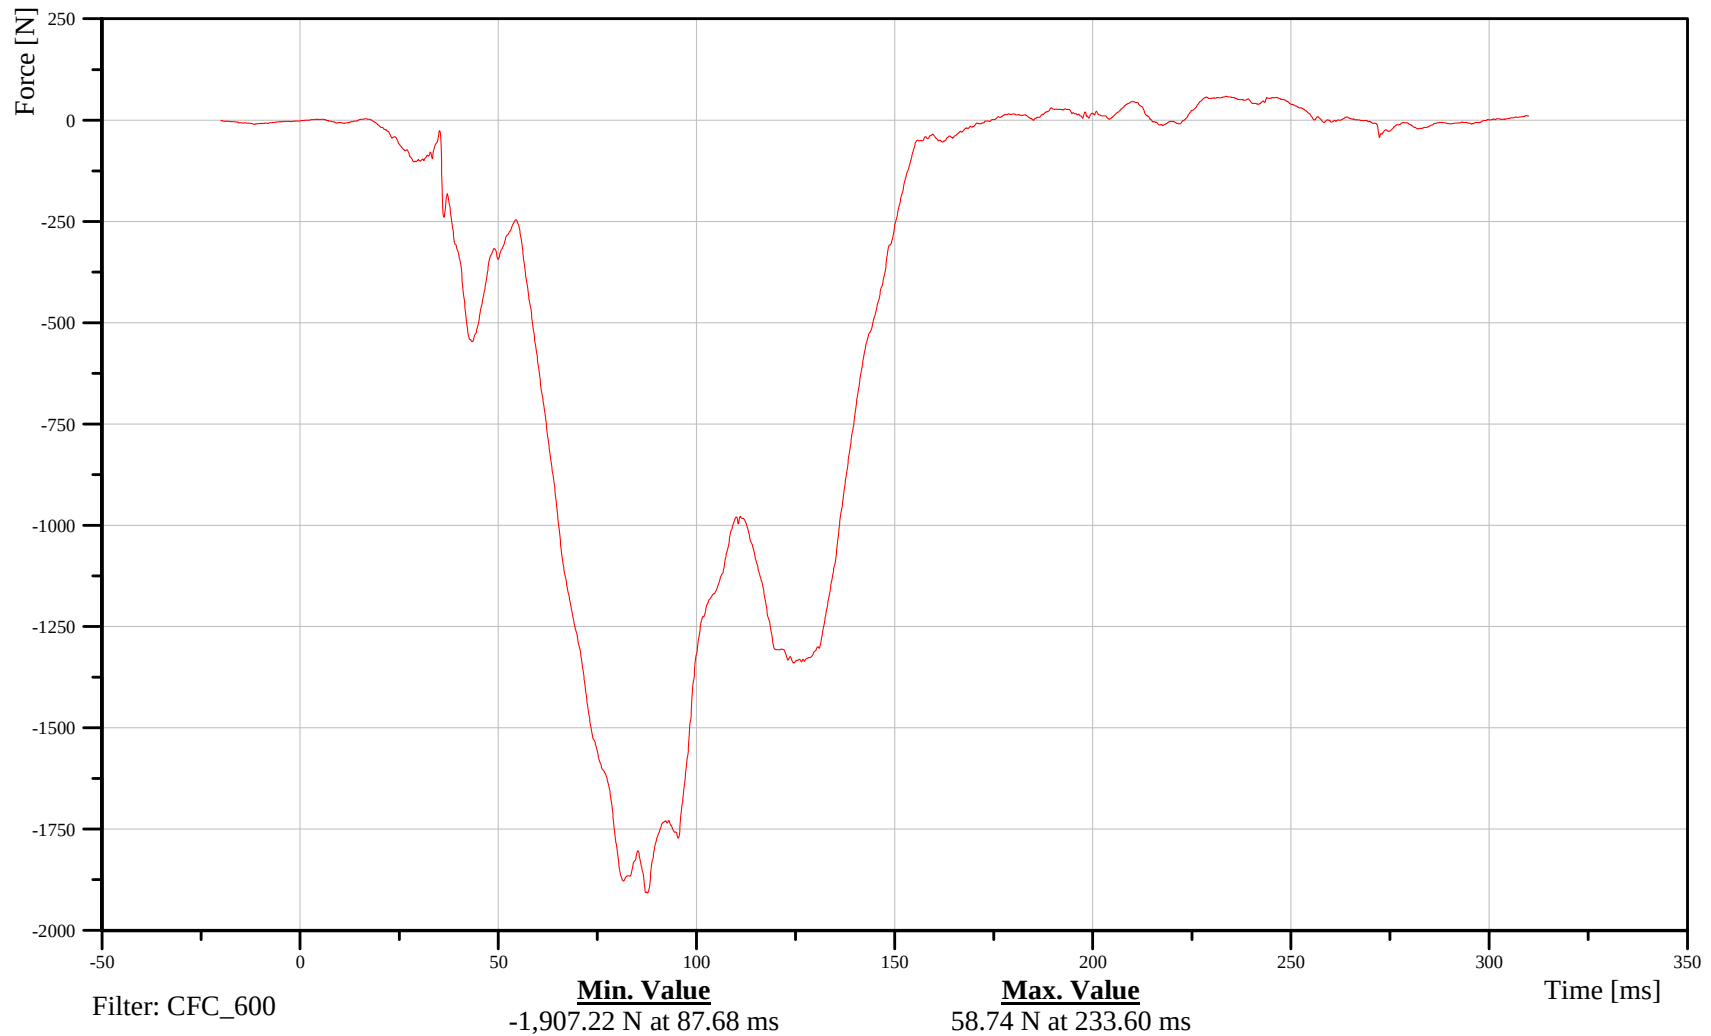

B-54

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Lower Tibia Moment About X Axis

Customer: Volpe

11TIBILLXH3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

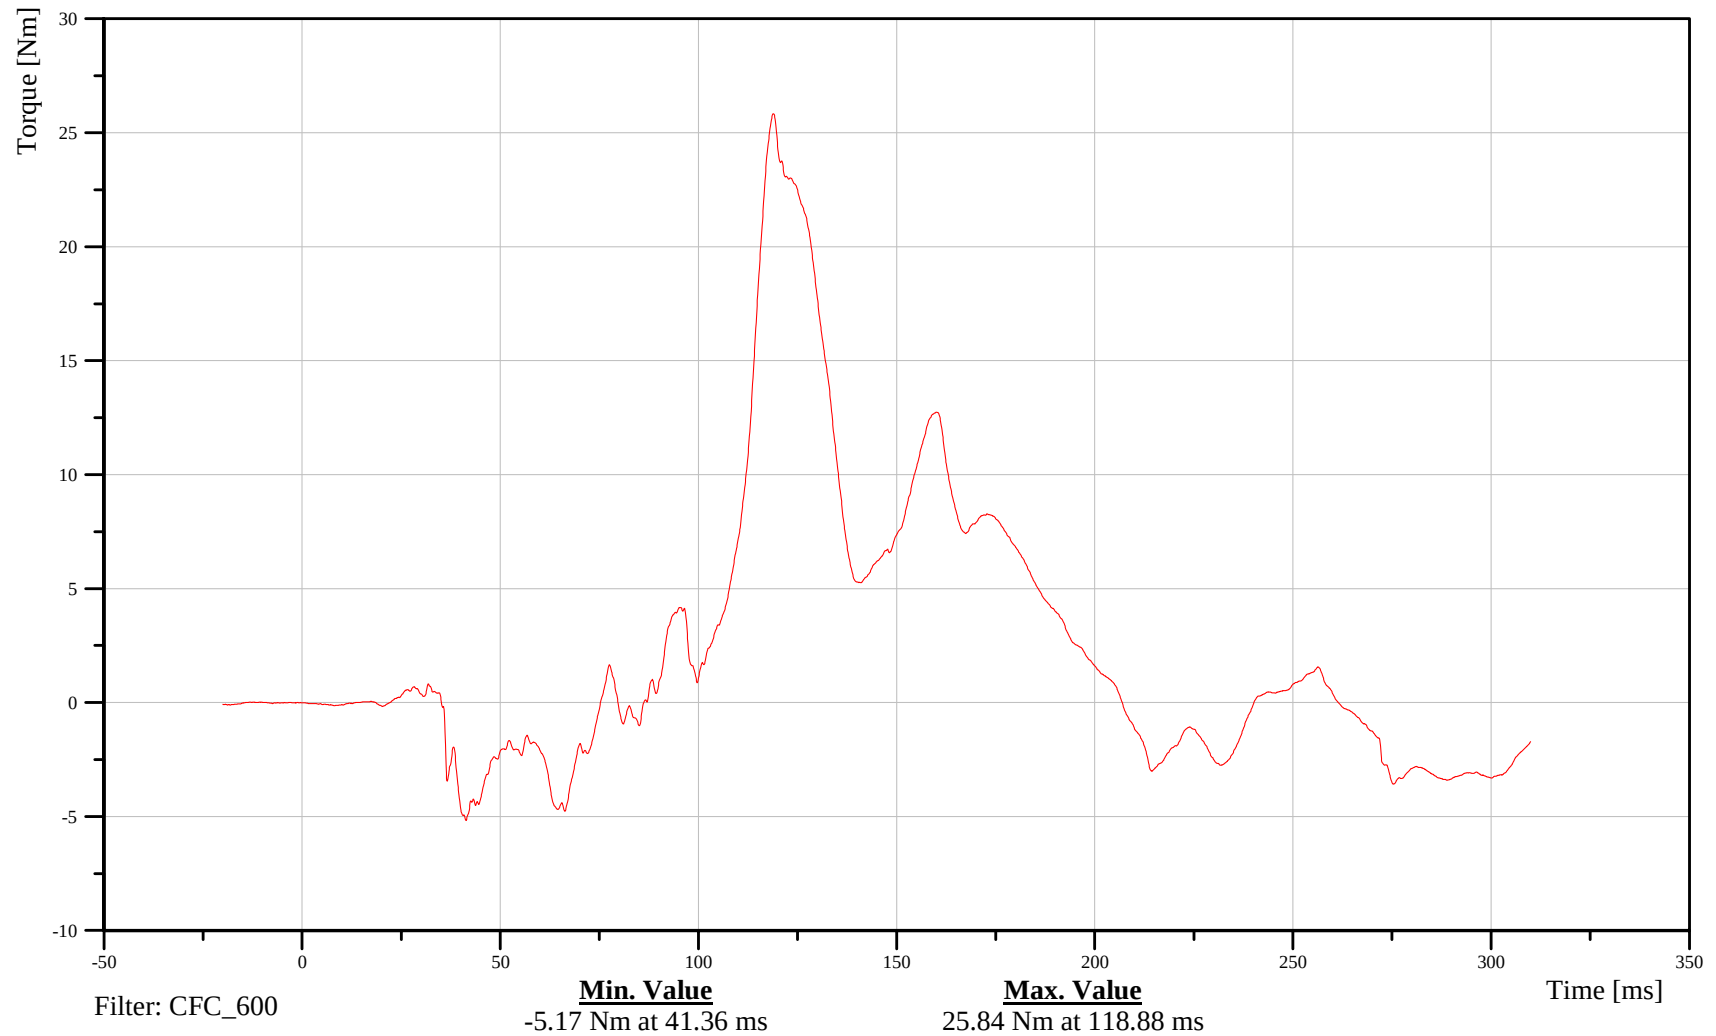

B-55

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Lower Tibia Moment About Y Axis

Customer: Volpe

11TIBILLXH3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

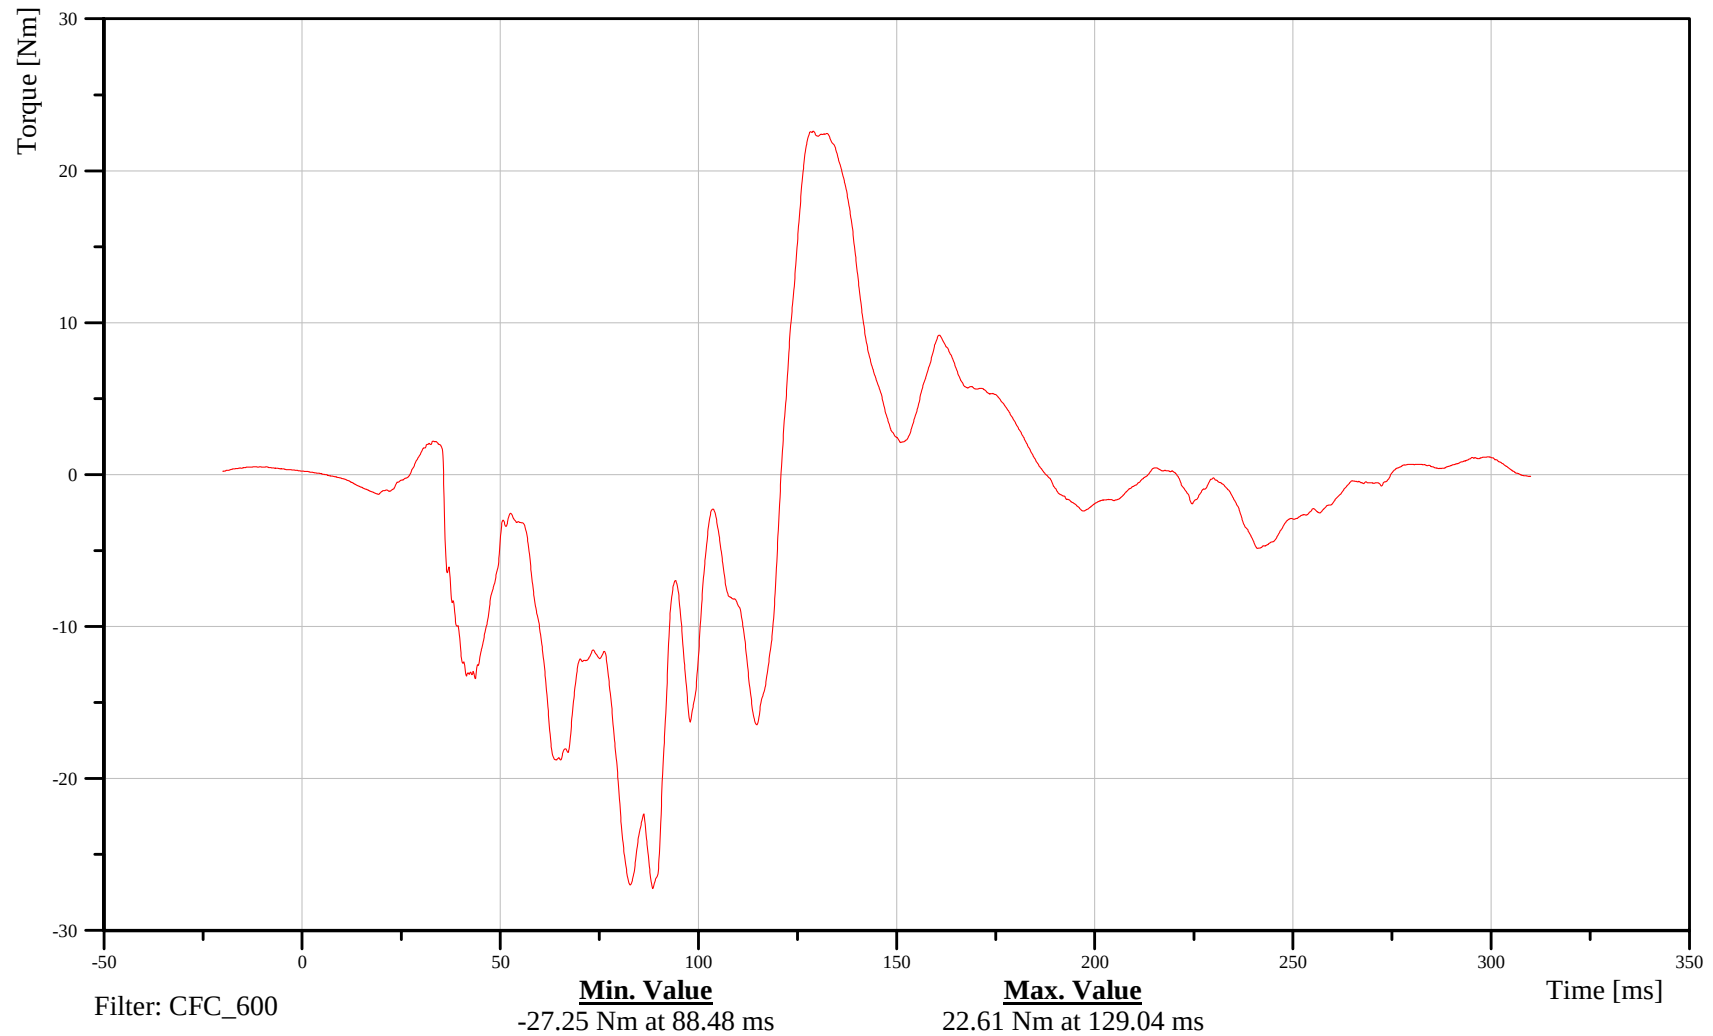

B-56

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot X-Axis Rotation

Customer: Volpe

11FOOTLELXH3ANXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

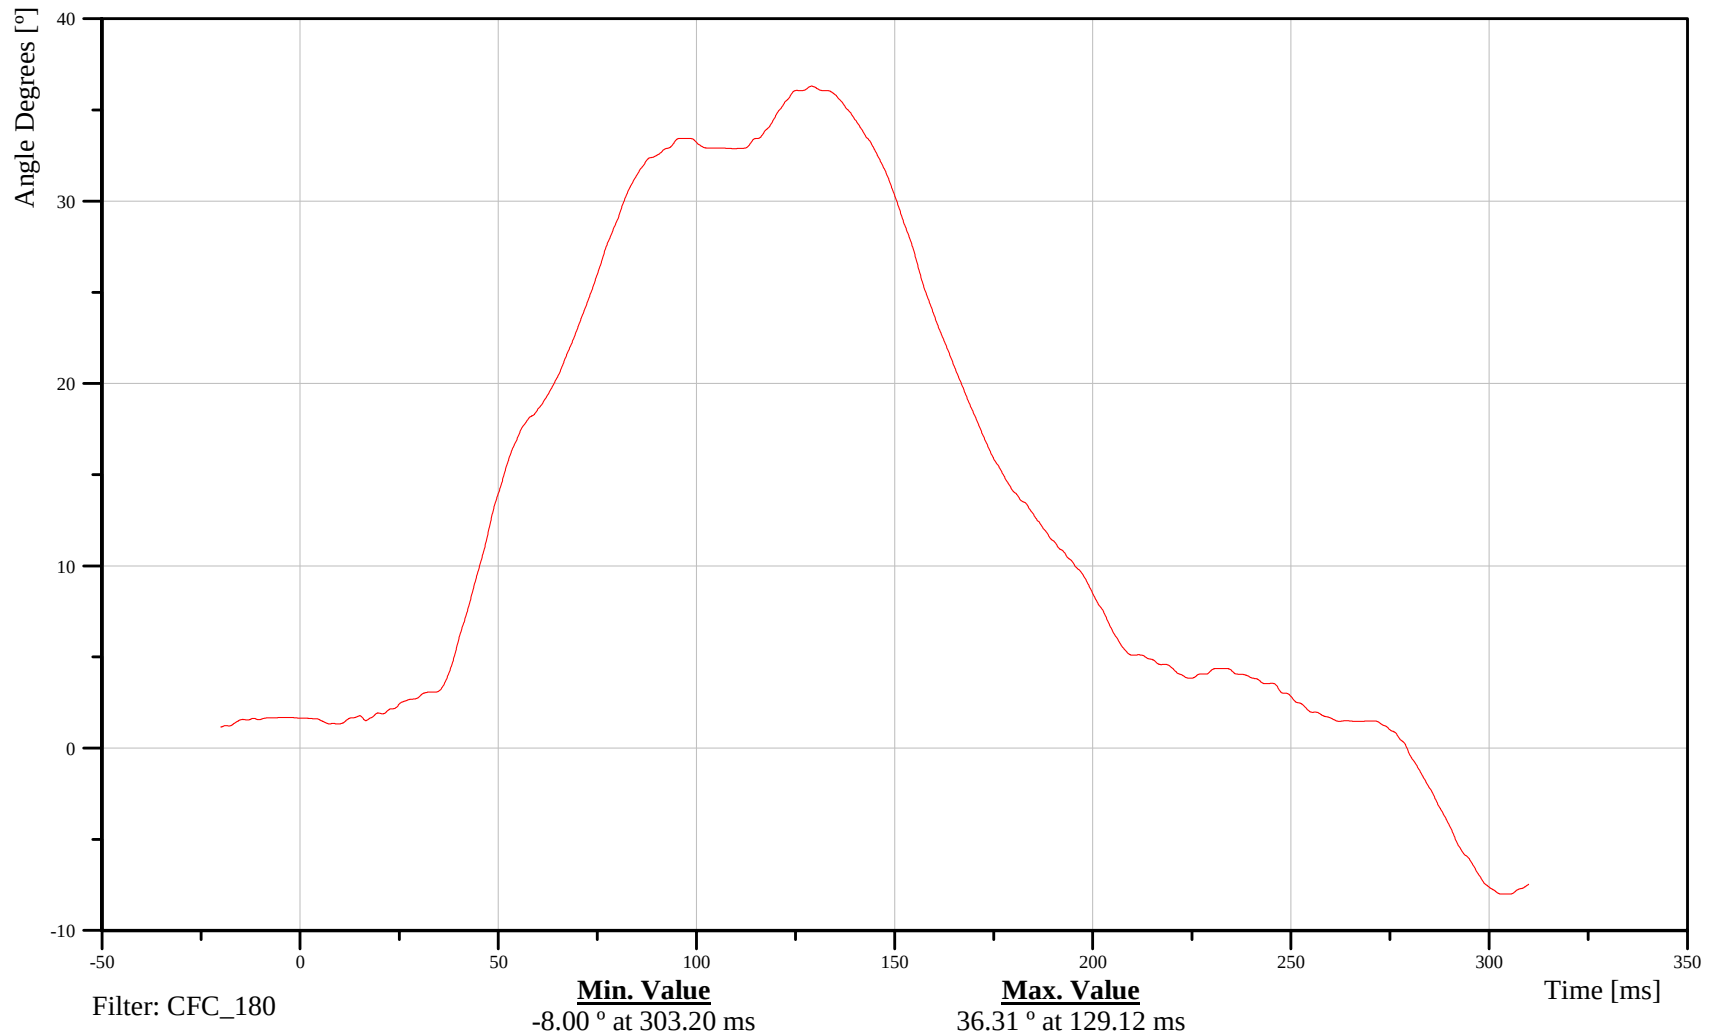

B-57

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot Y-Axis Rotation

Customer: Volpe

11FOOTLELXH3ANYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

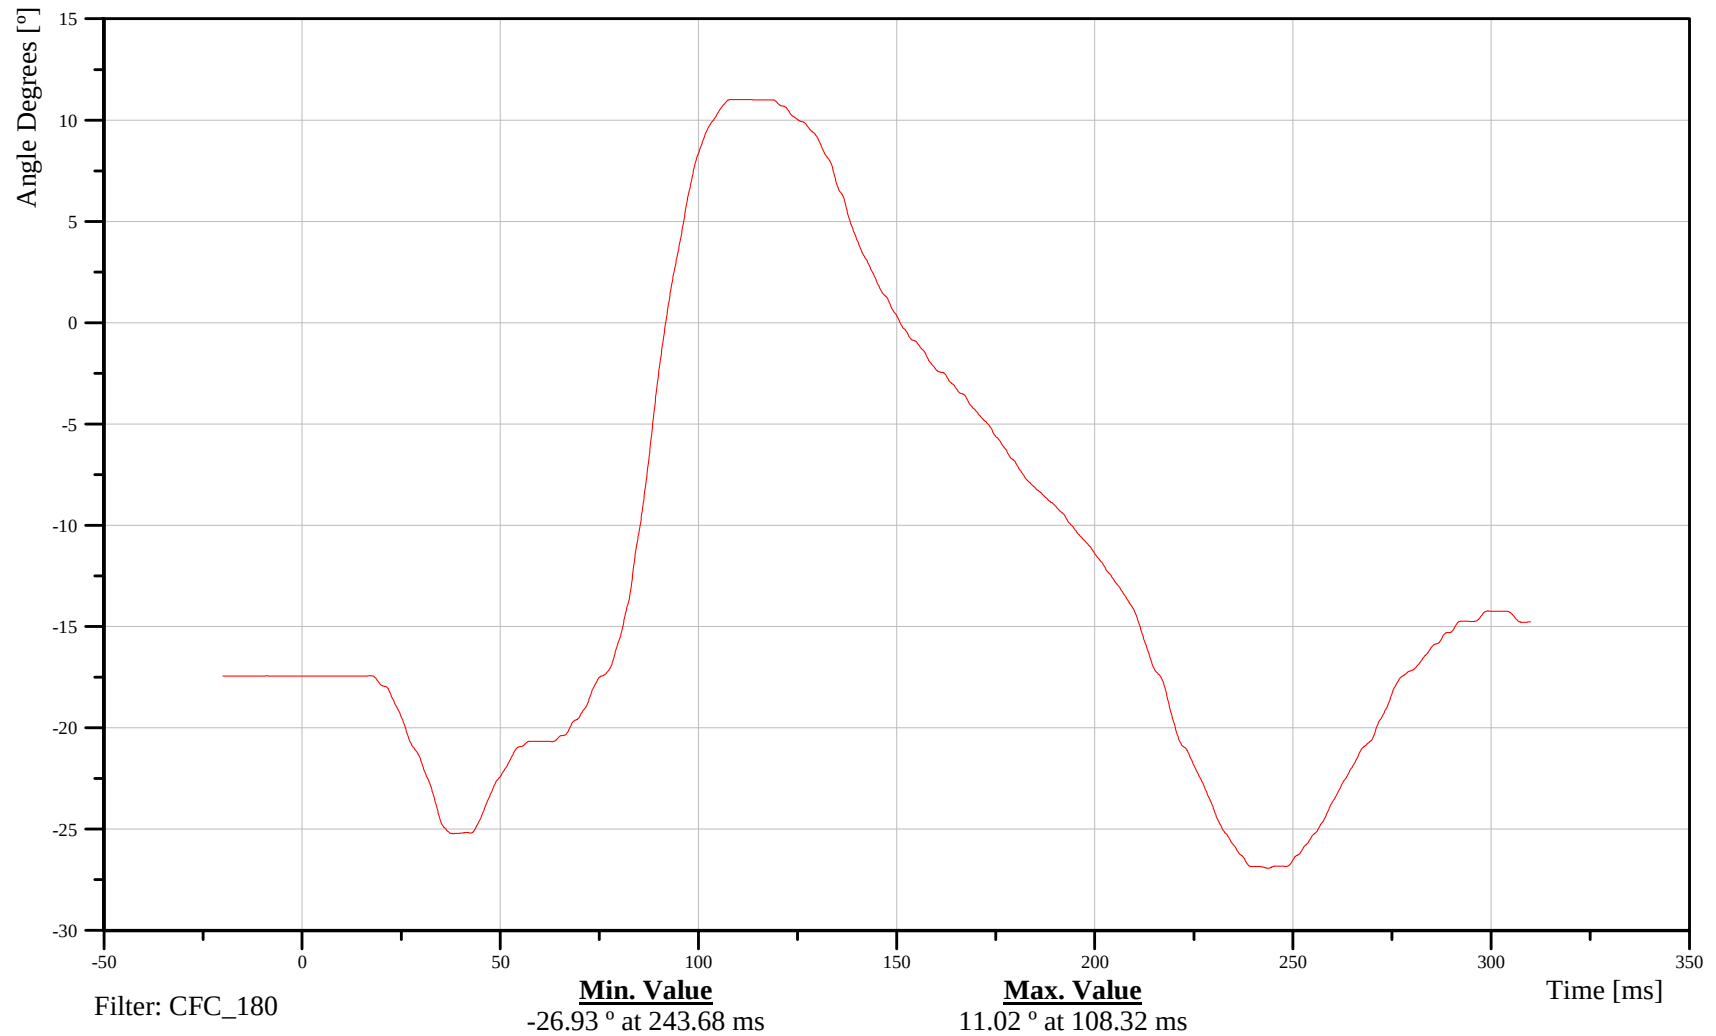

B-58

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot Z-Axis Rotation

Customer: Volpe

11FOOTLELXH3ANZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

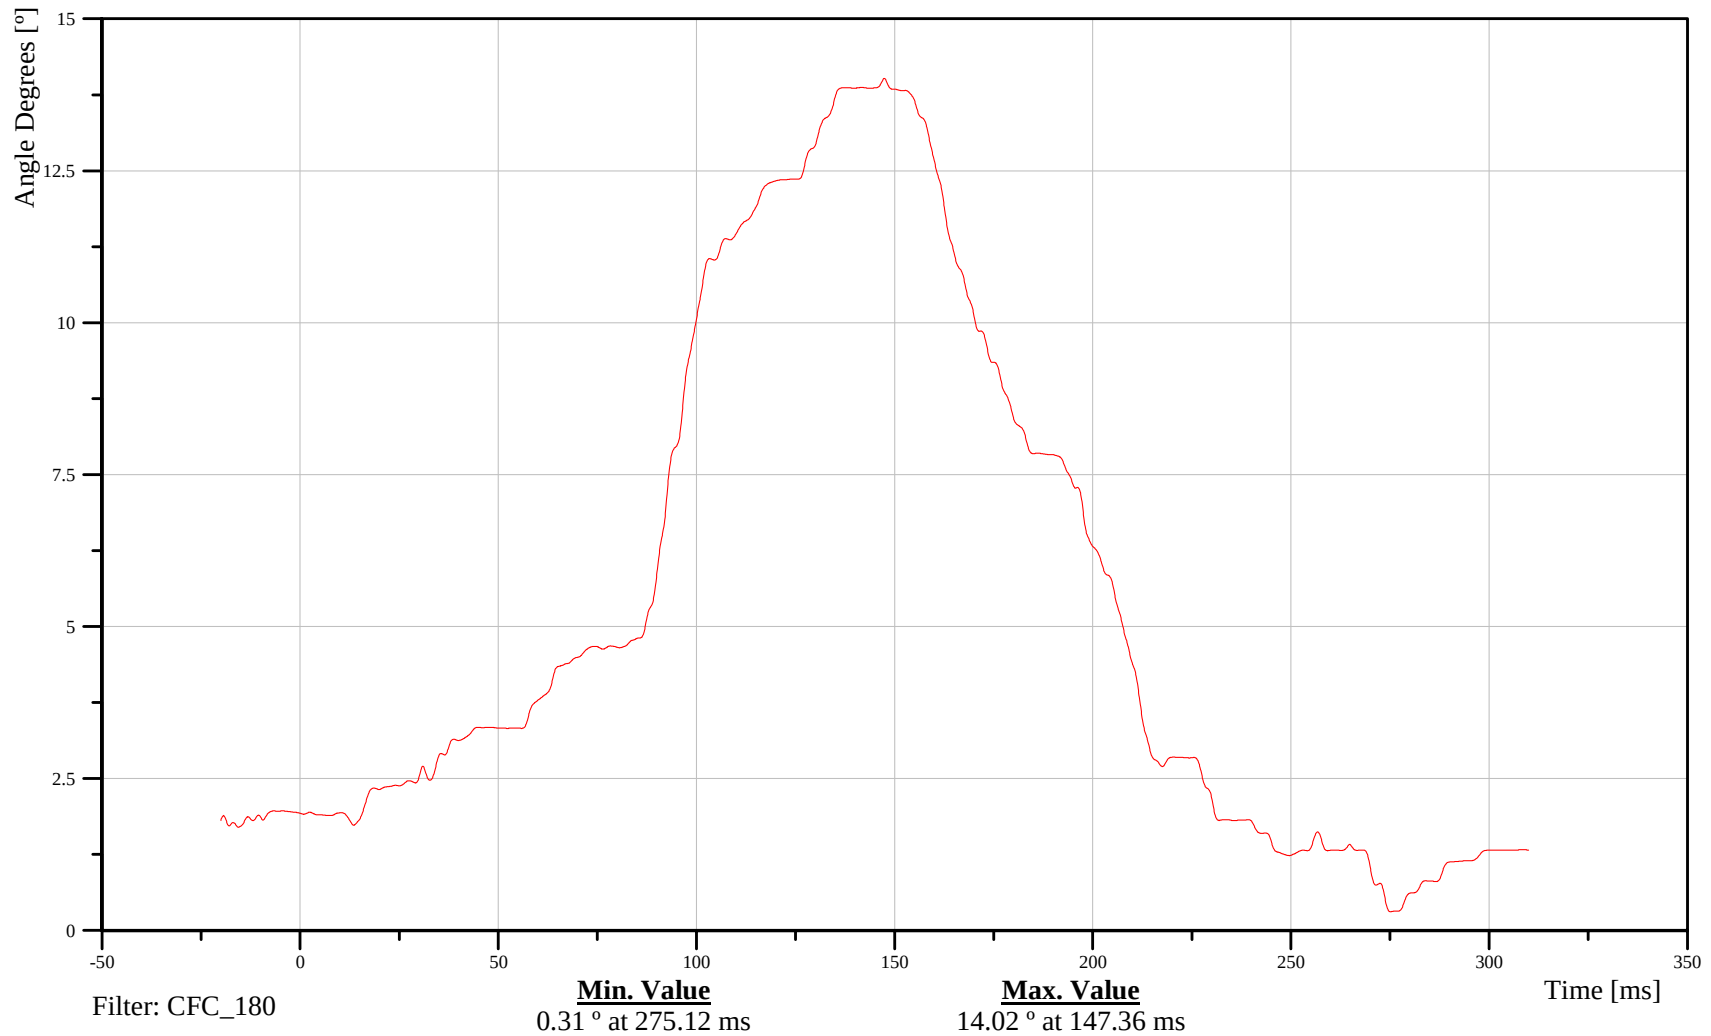

B-59

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot X-Axis Acceleration

Customer: Volpe

11FOOTLELXH3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

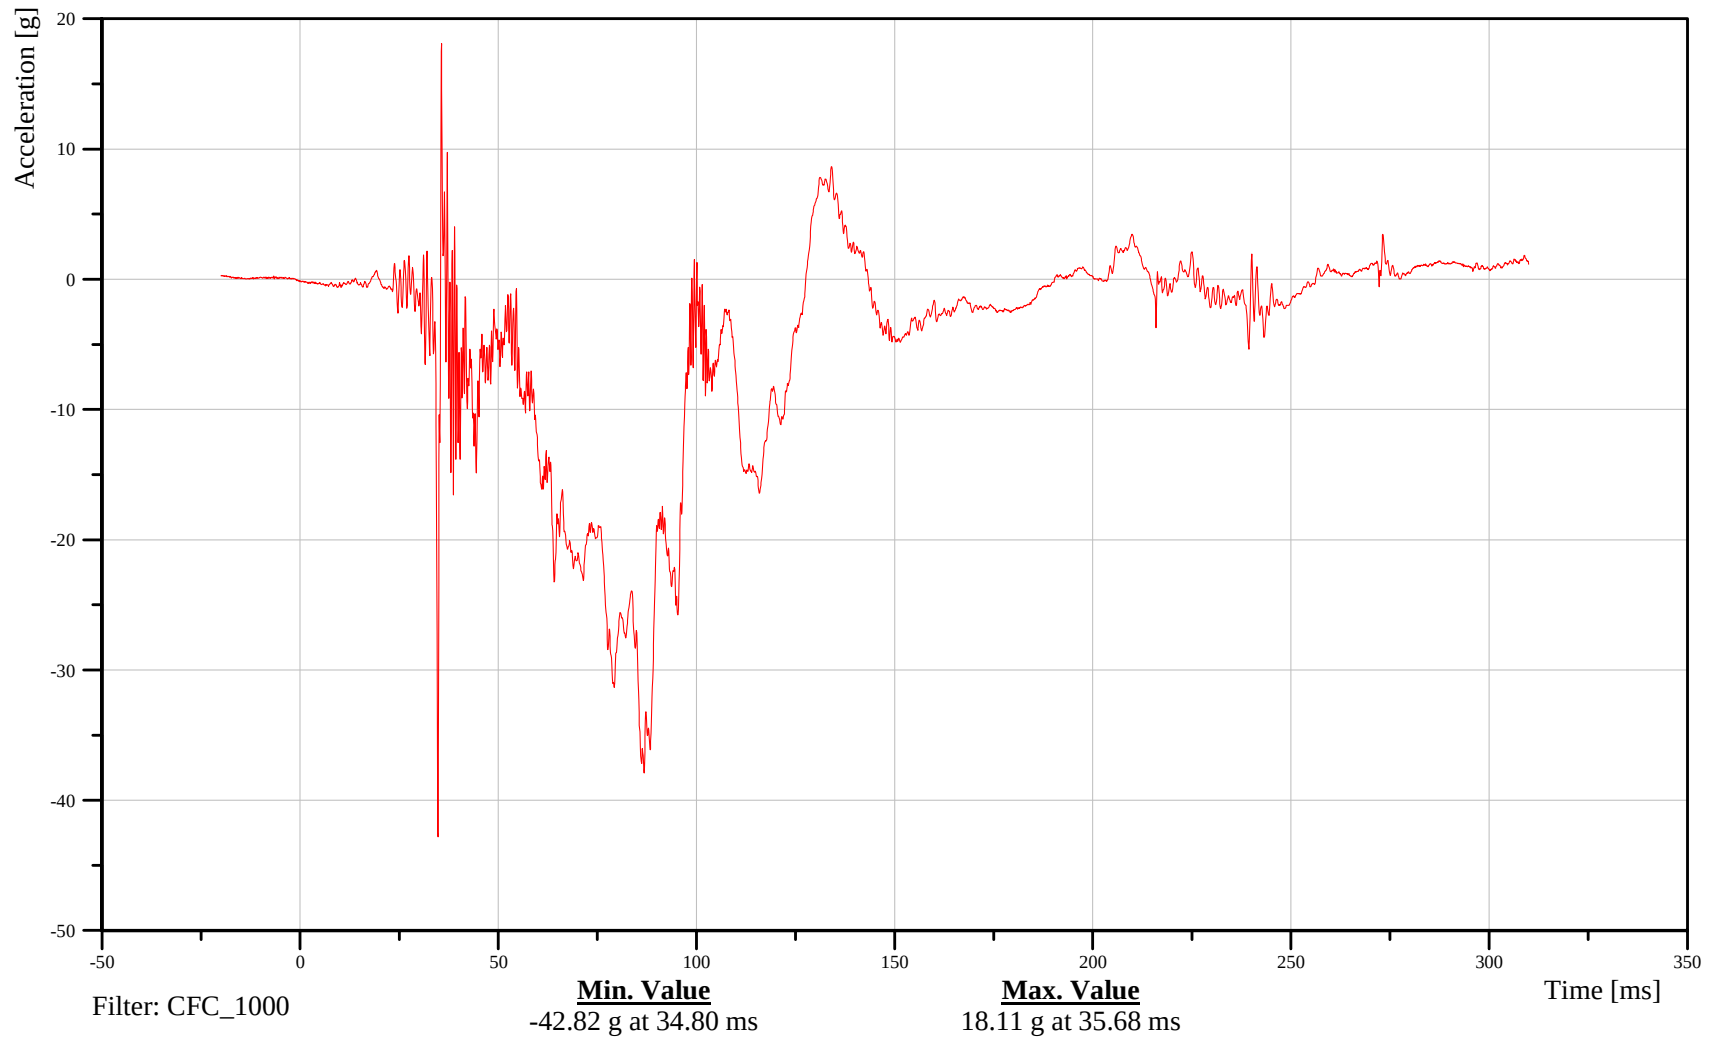

B-60

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot Y-Axis Acceleration

Customer: Volpe

11FOOTLELXH3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

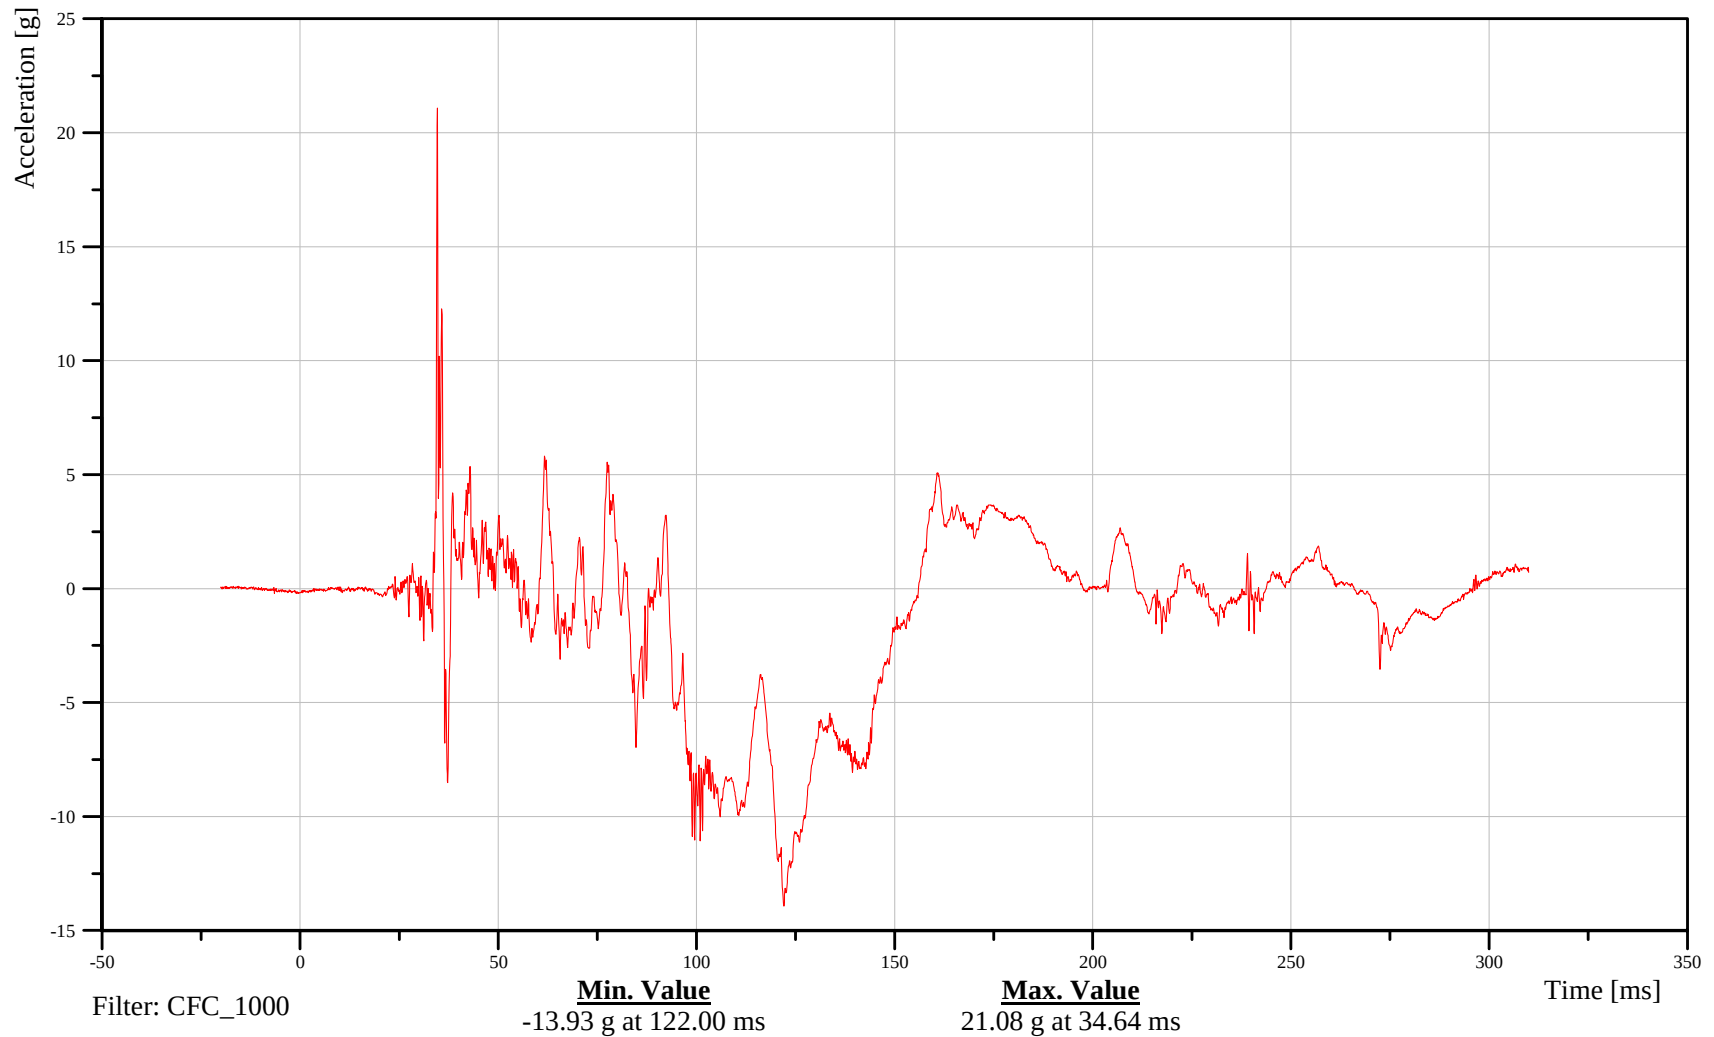

B-61

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot Z-Axis Acceleration

Customer: Volpe

11FOOTLELXH3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

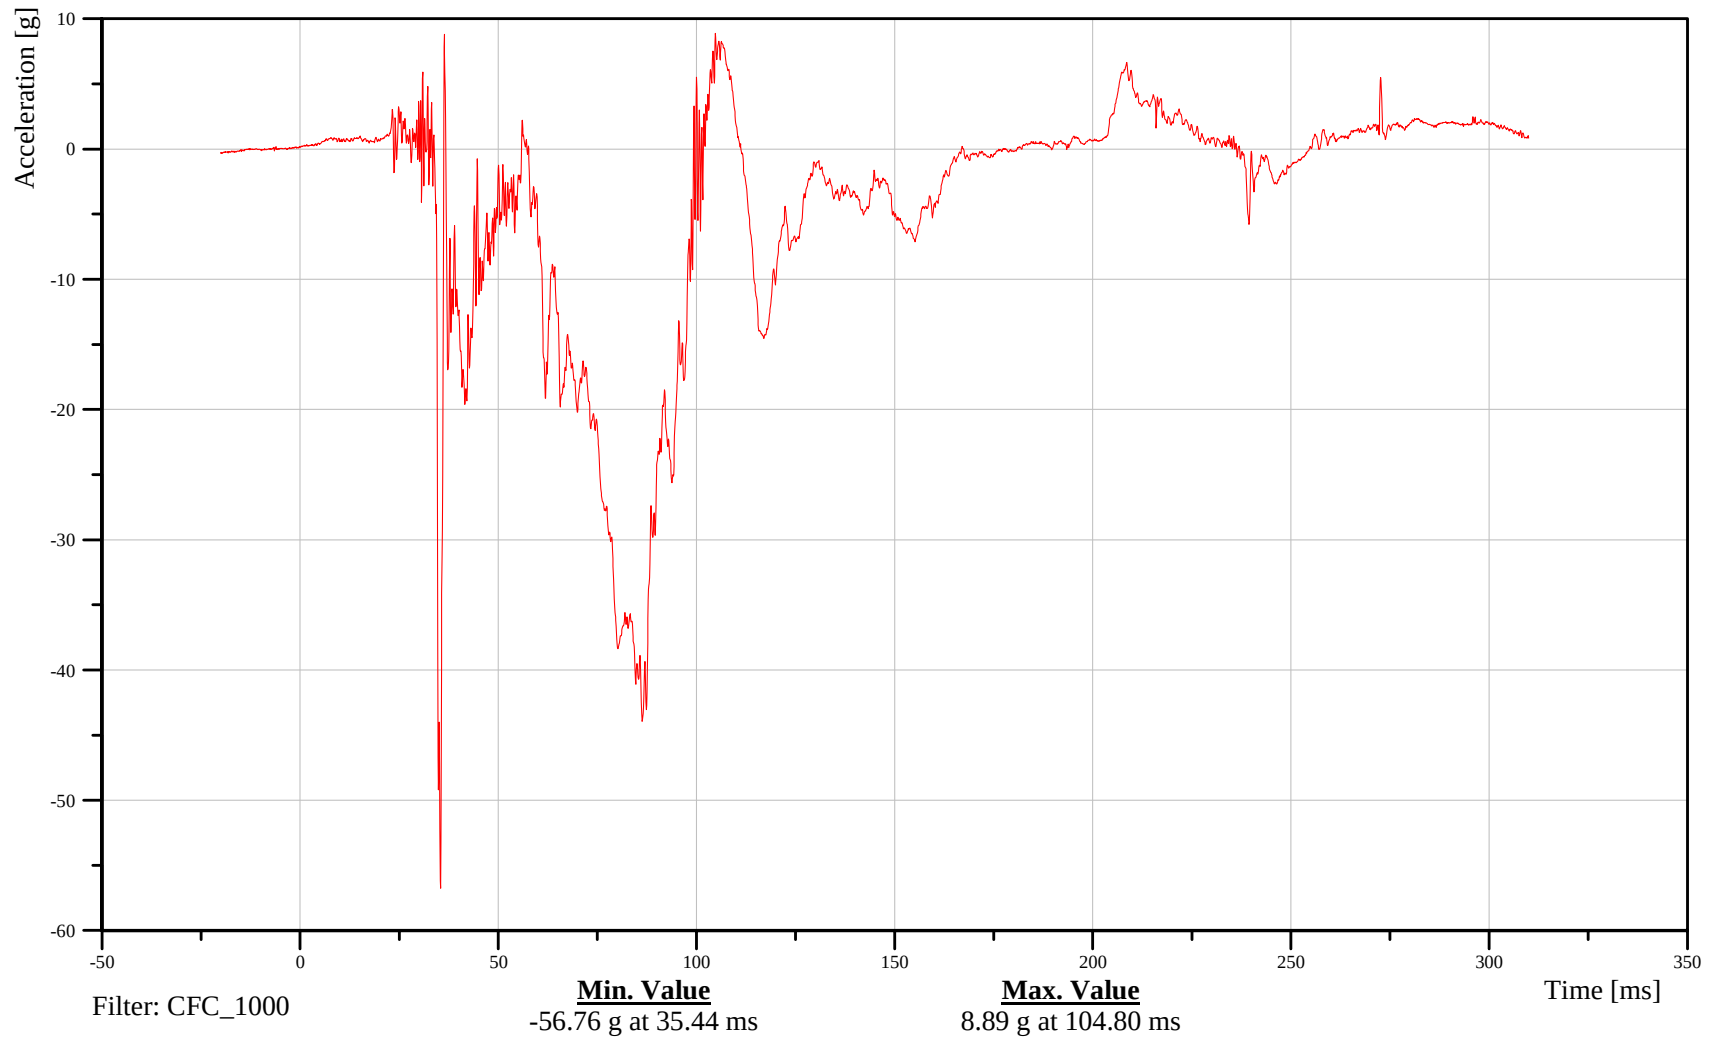

B-62

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Foot Resultant Acceleration

Customer: Volpe

11FOOTLELXH3ACRA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

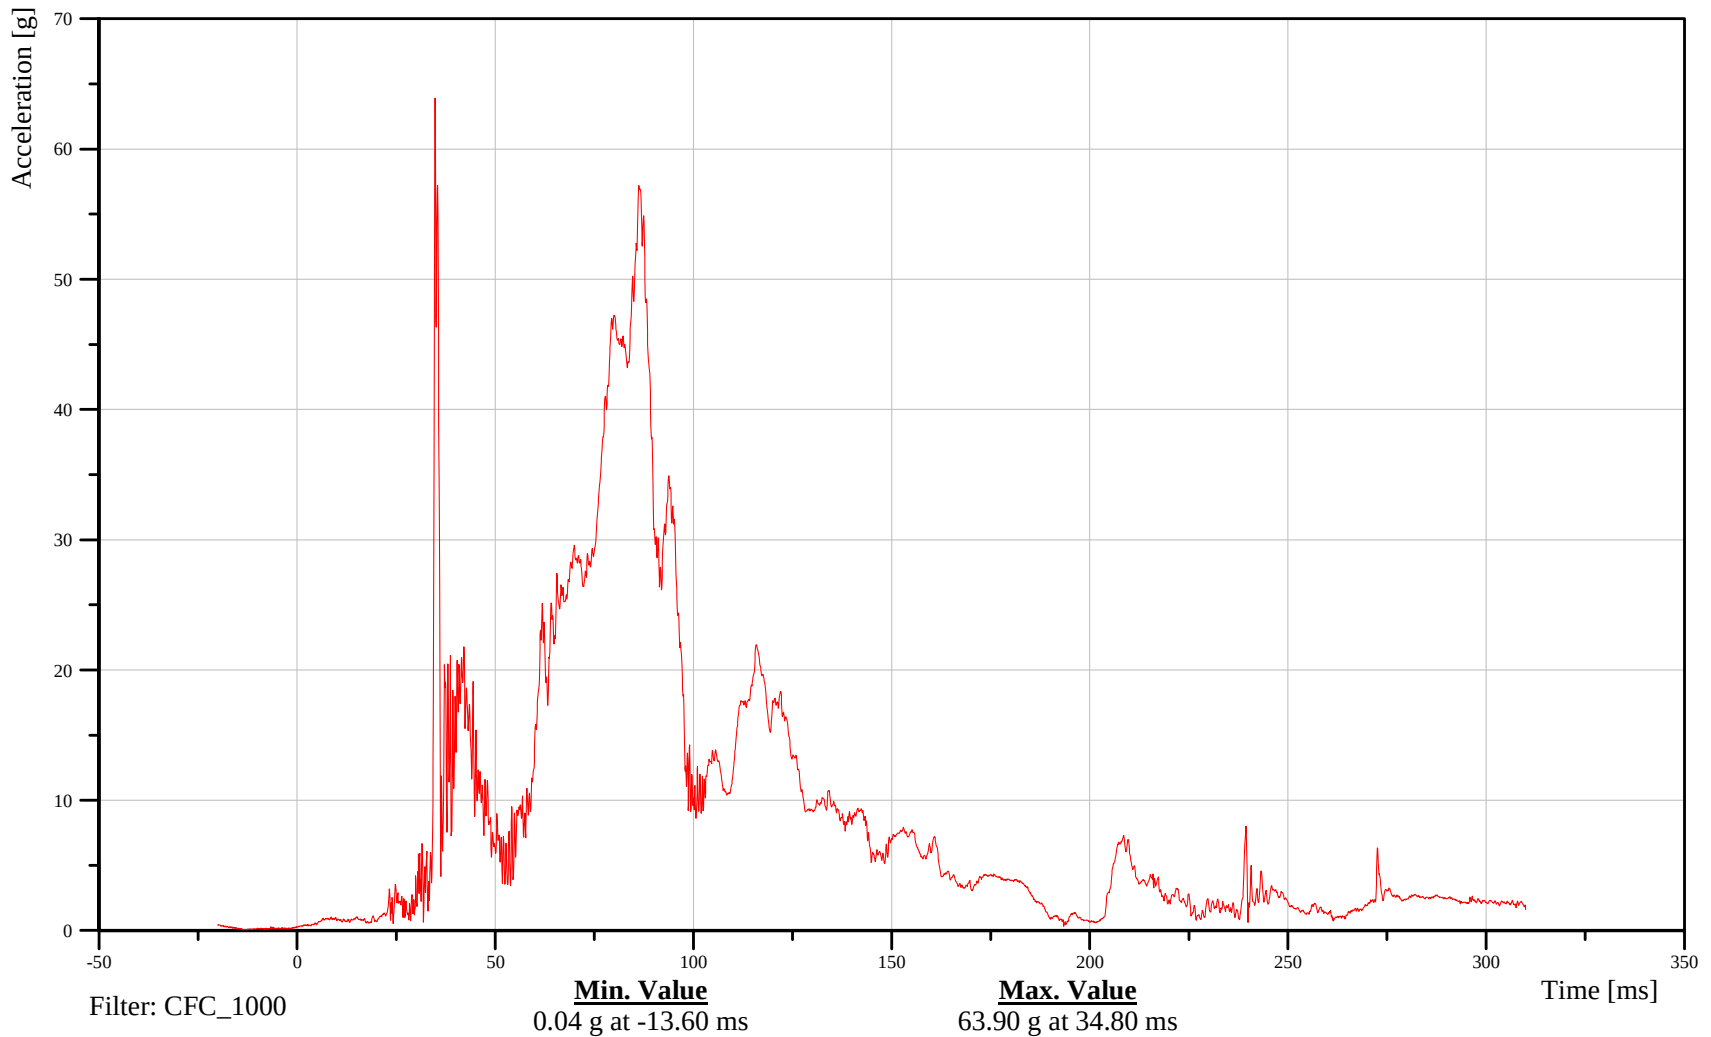

B-63

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Knee Displacement

Customer: Volpe

11KNSLRI00H3DSXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

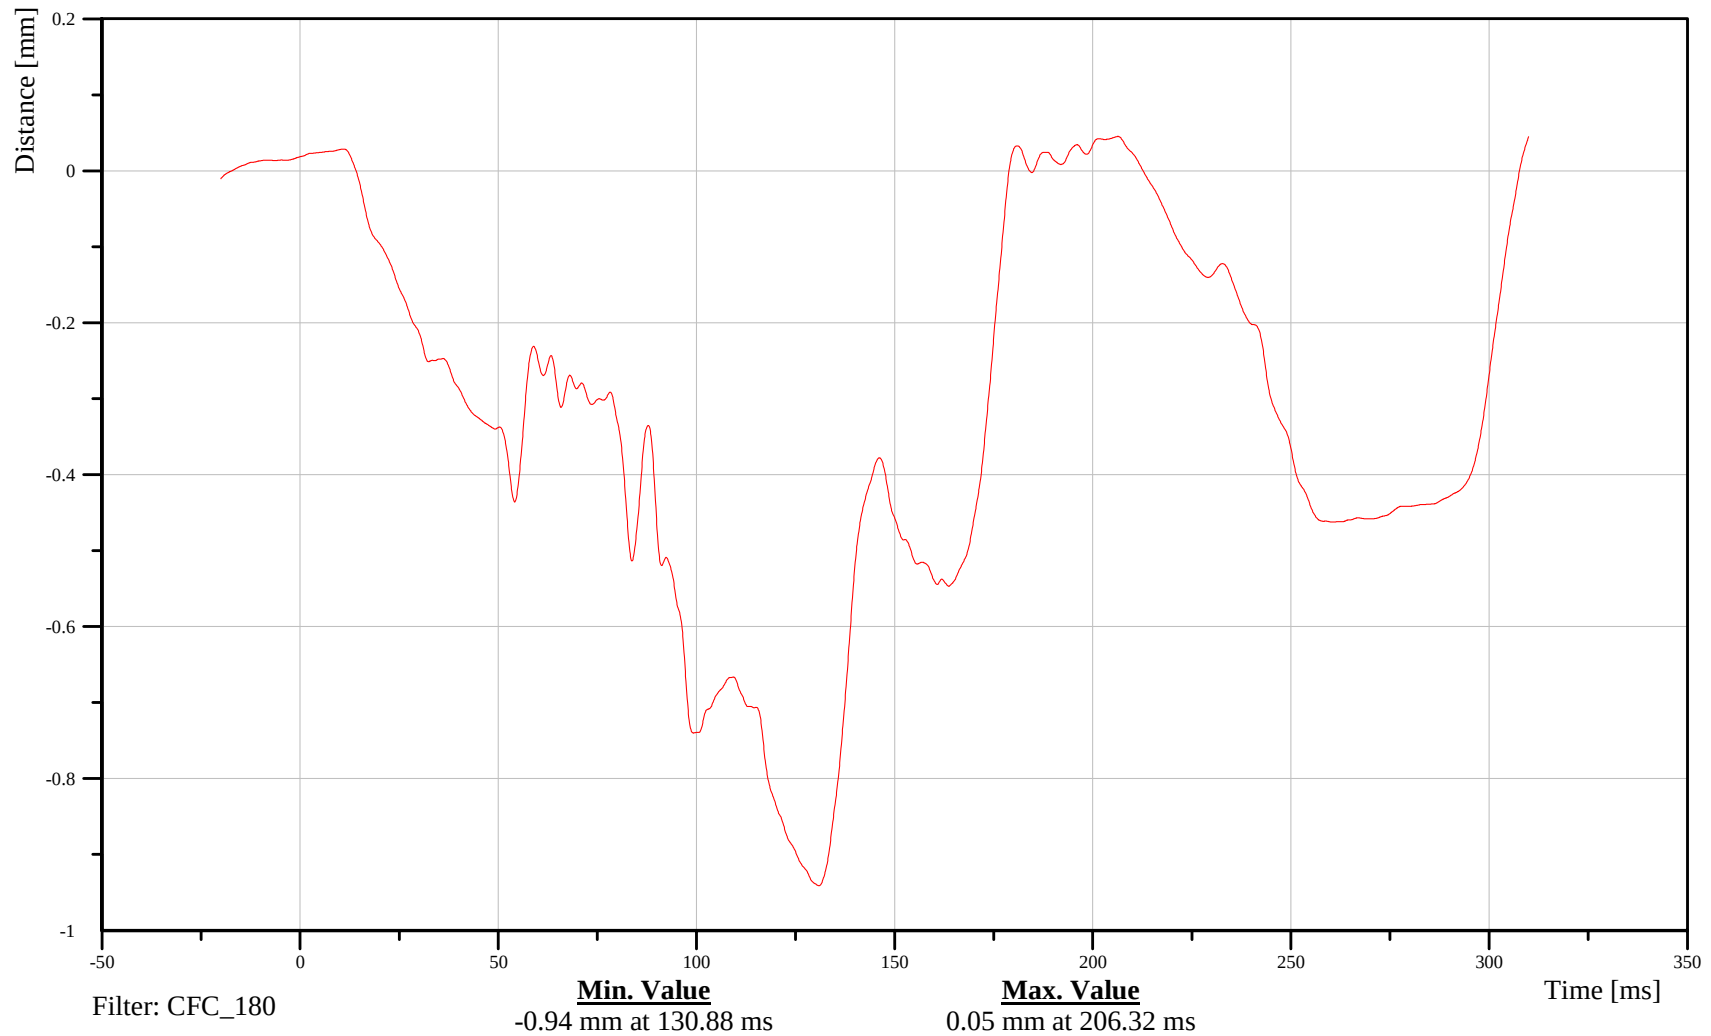

B-64

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Upper Tibia X-Axis Force

Customer: Volpe

11TIBIRULXH3FOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

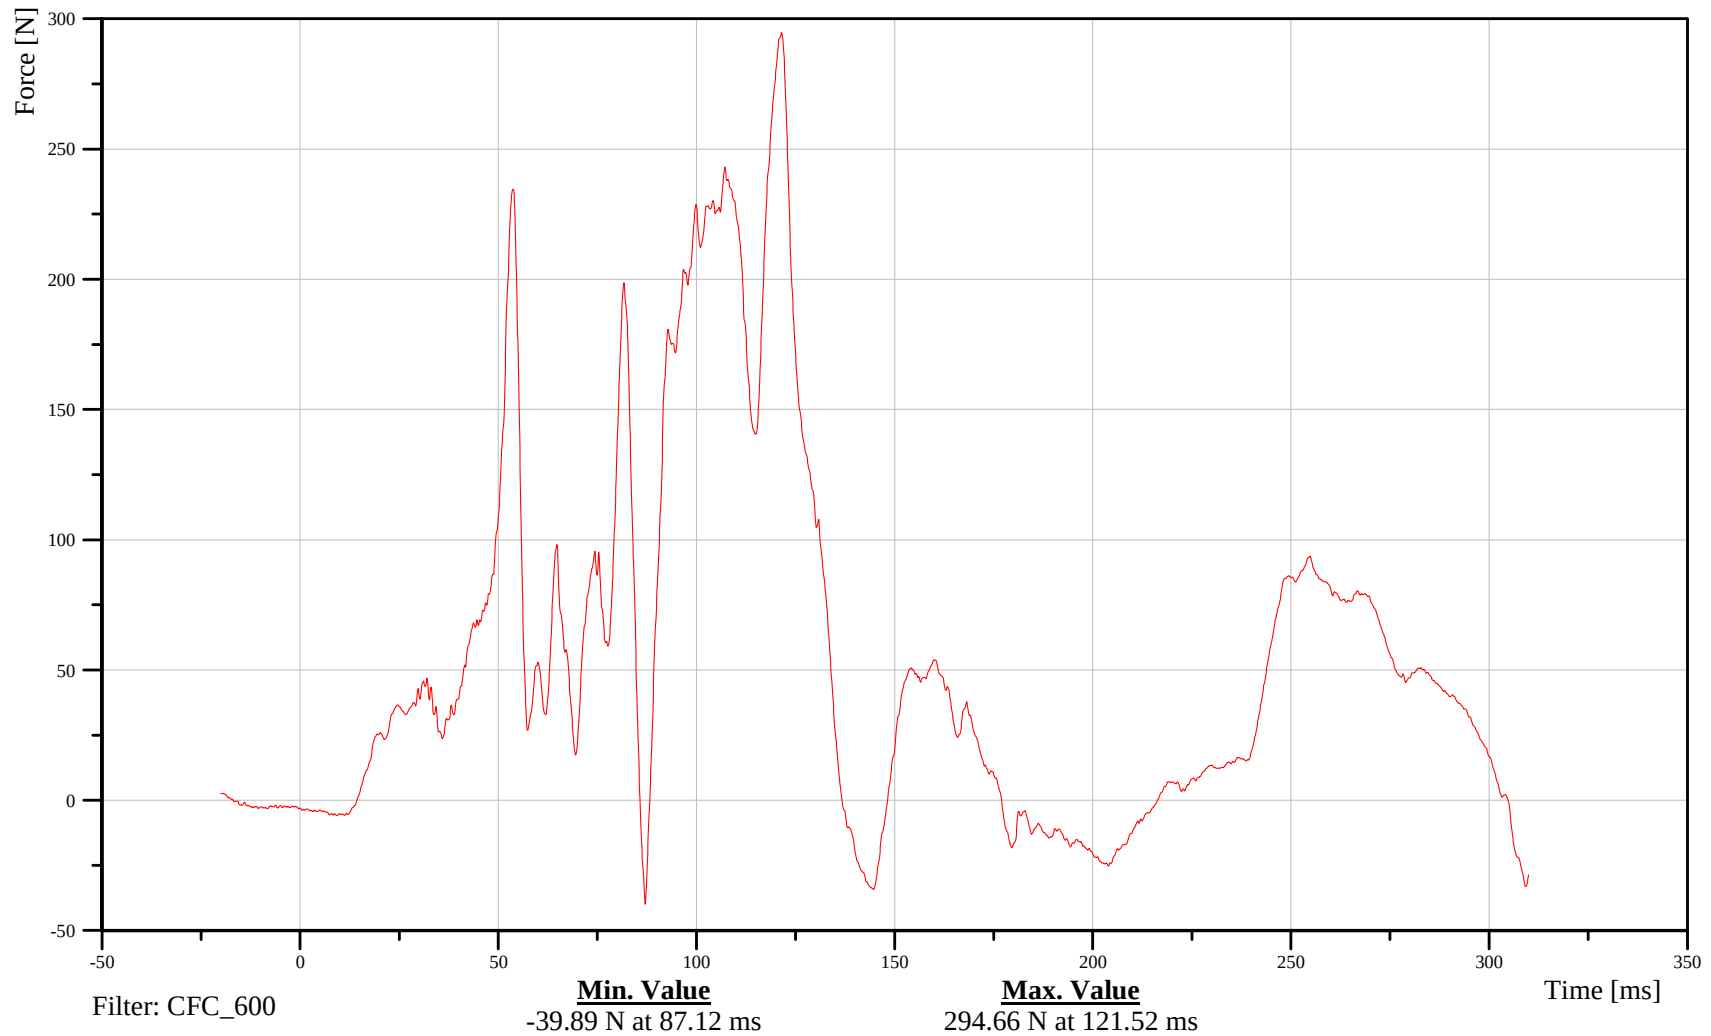

B-65

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Upper Tibia Z-Axis Force

Customer: Volpe

11TIBIRULXH3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

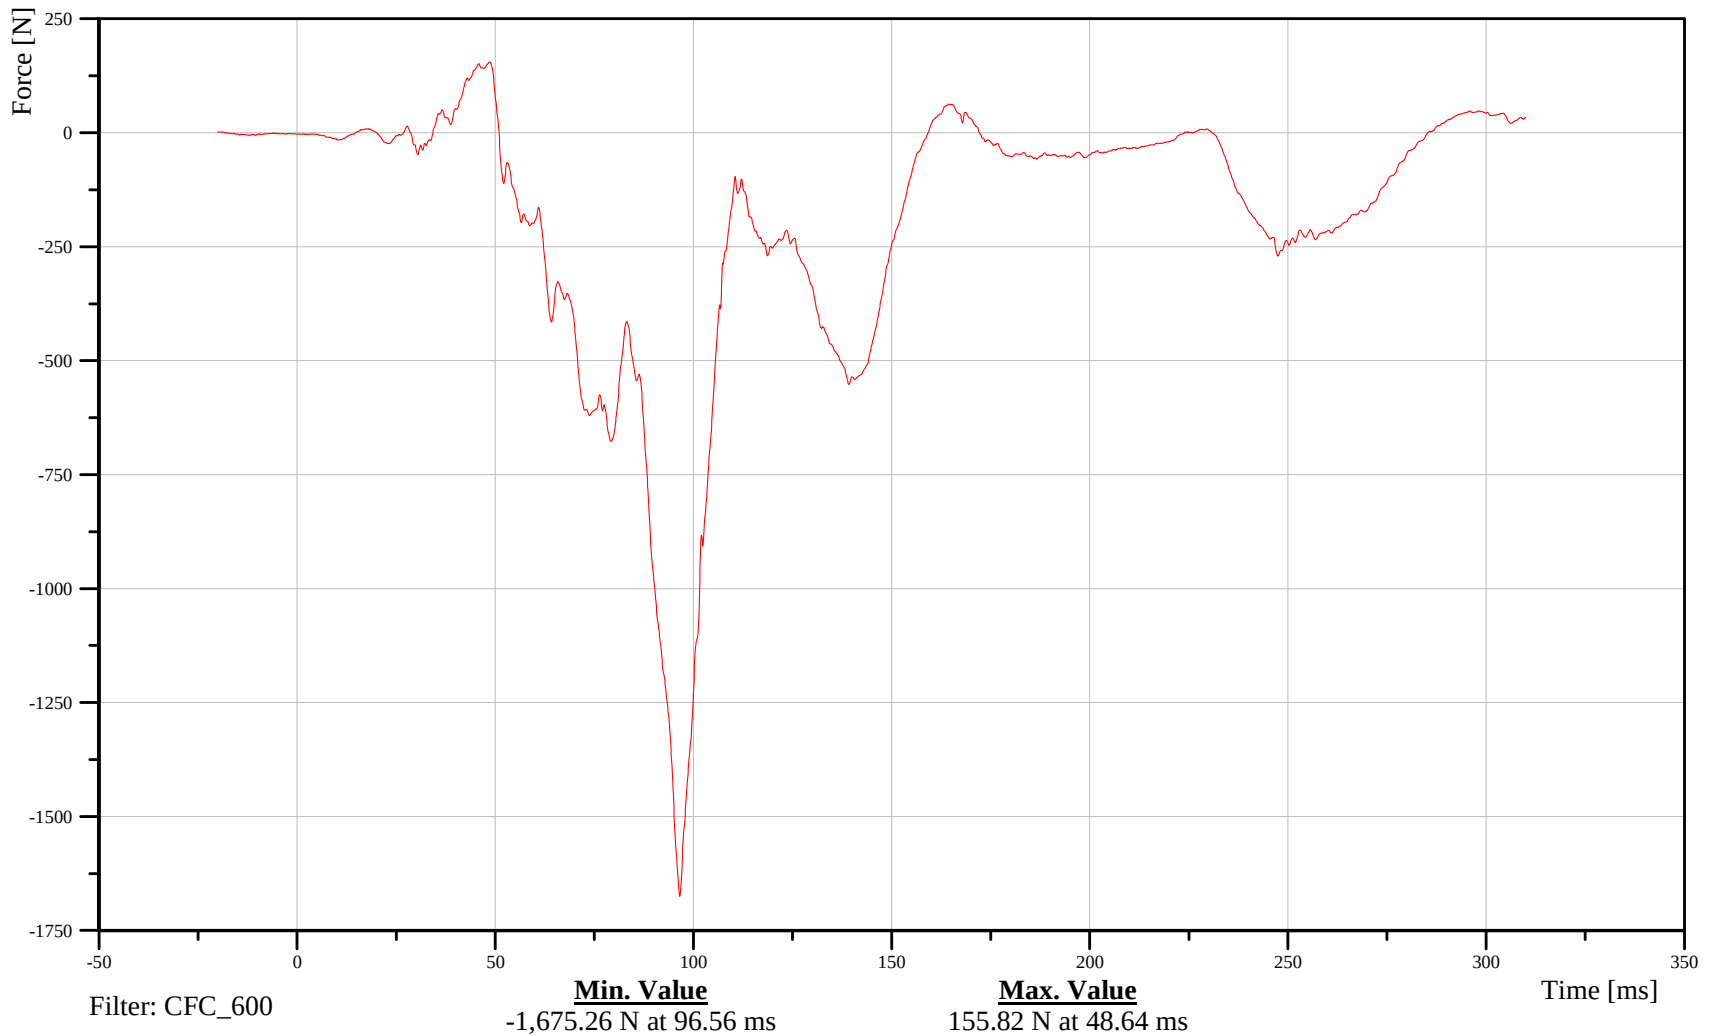

B-66

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Upper Tibia Moment About X Axis

Customer: Volpe

11TIBIRULXH3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

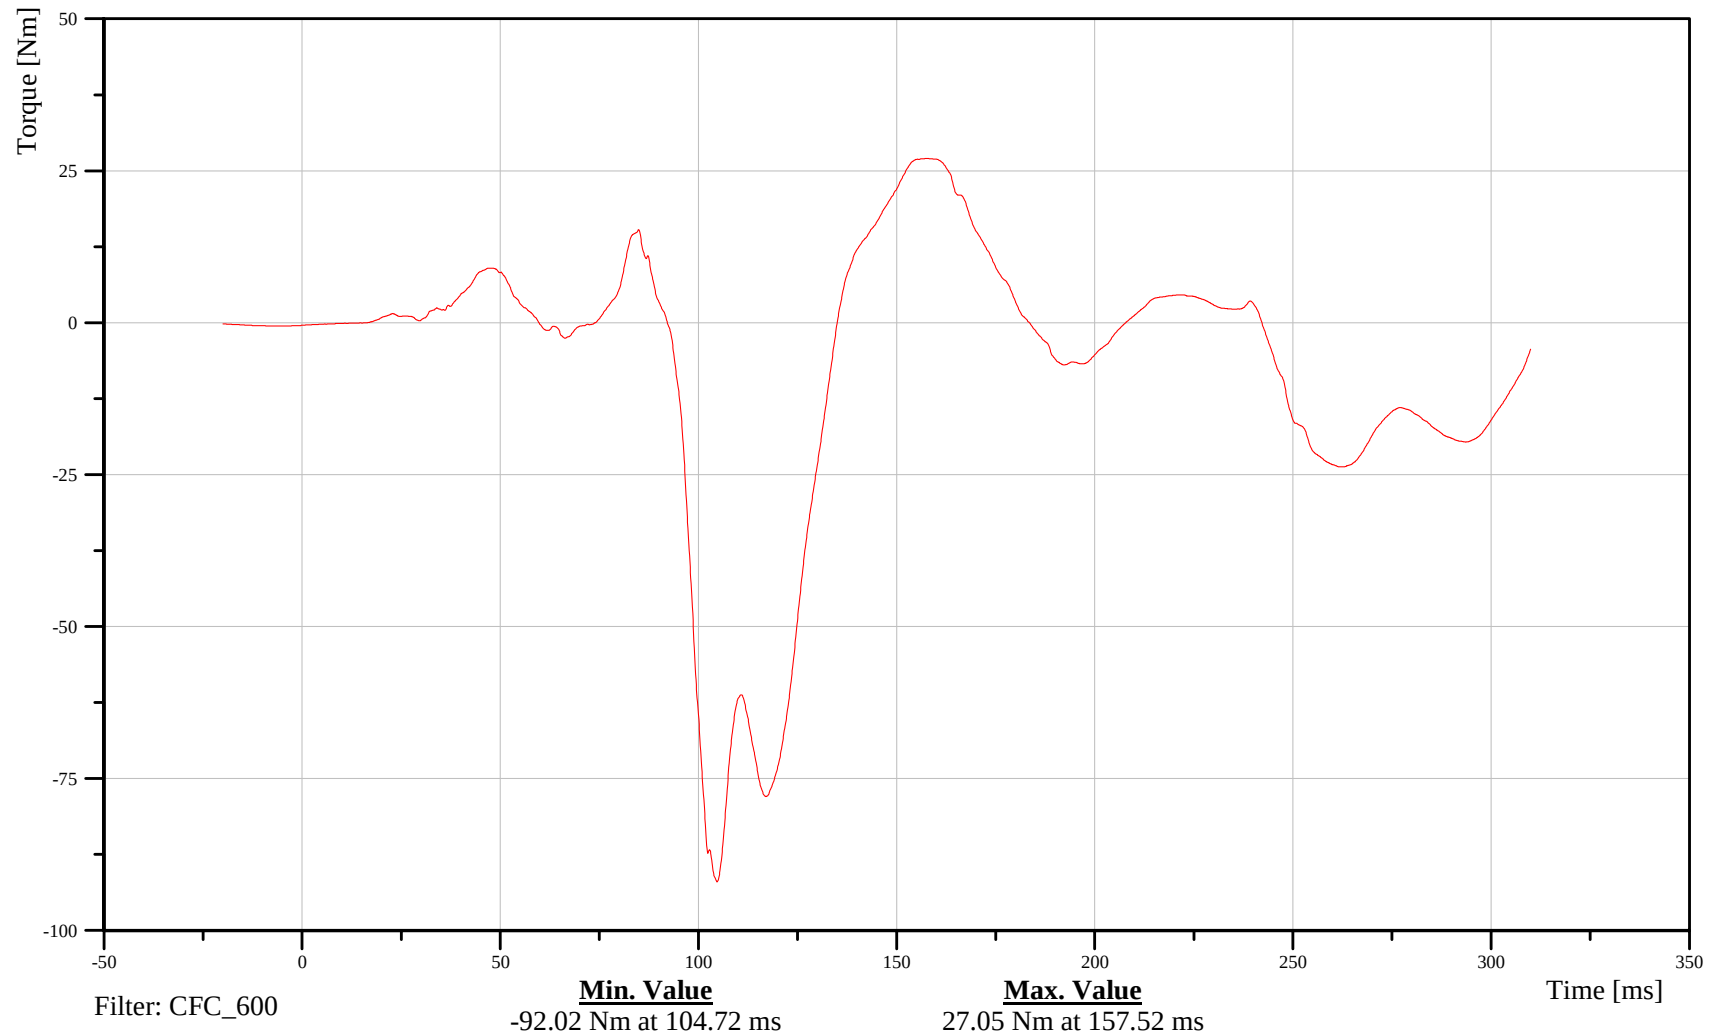

B-67

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Right Upper Tibia Moment About Y Axis

Customer: Volpe

11TIBIRULXH3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

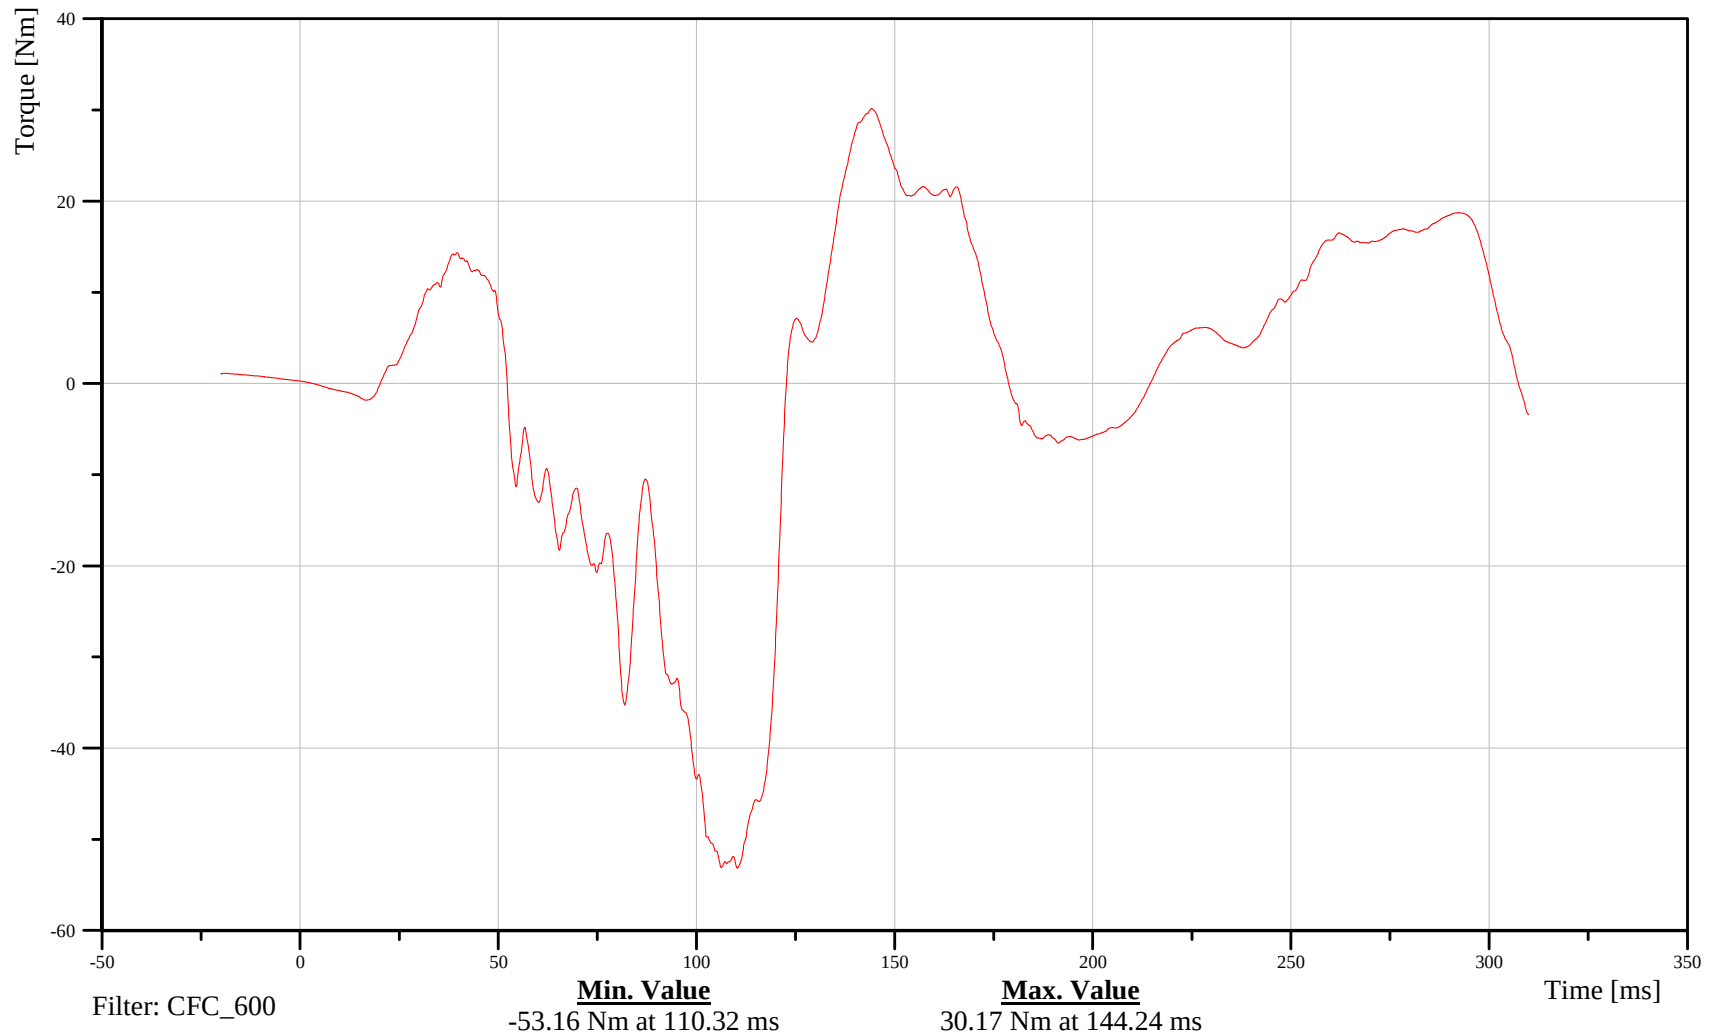

B-68

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Tibia X-Axis Acceleration

Customer: Volpe

11TIBIRILXH3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

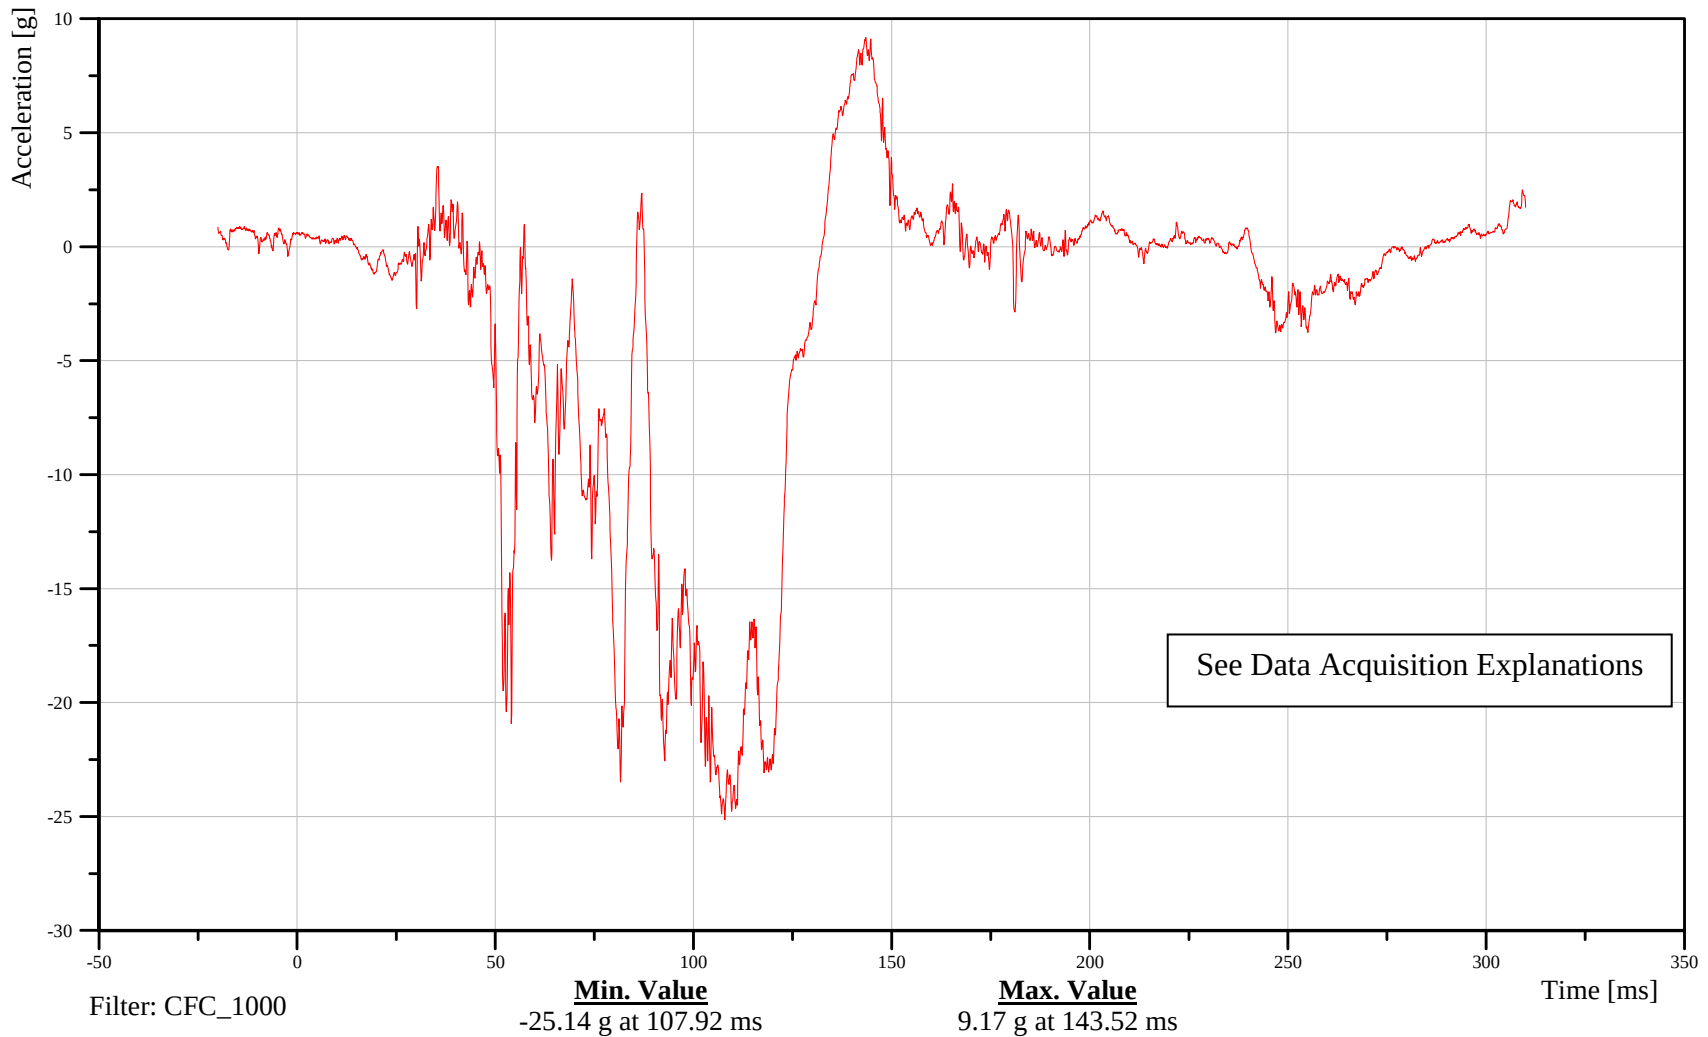

B-69

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Tibia Y-Axis Acceleration

Customer: Volpe

11TIBIRILXH3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

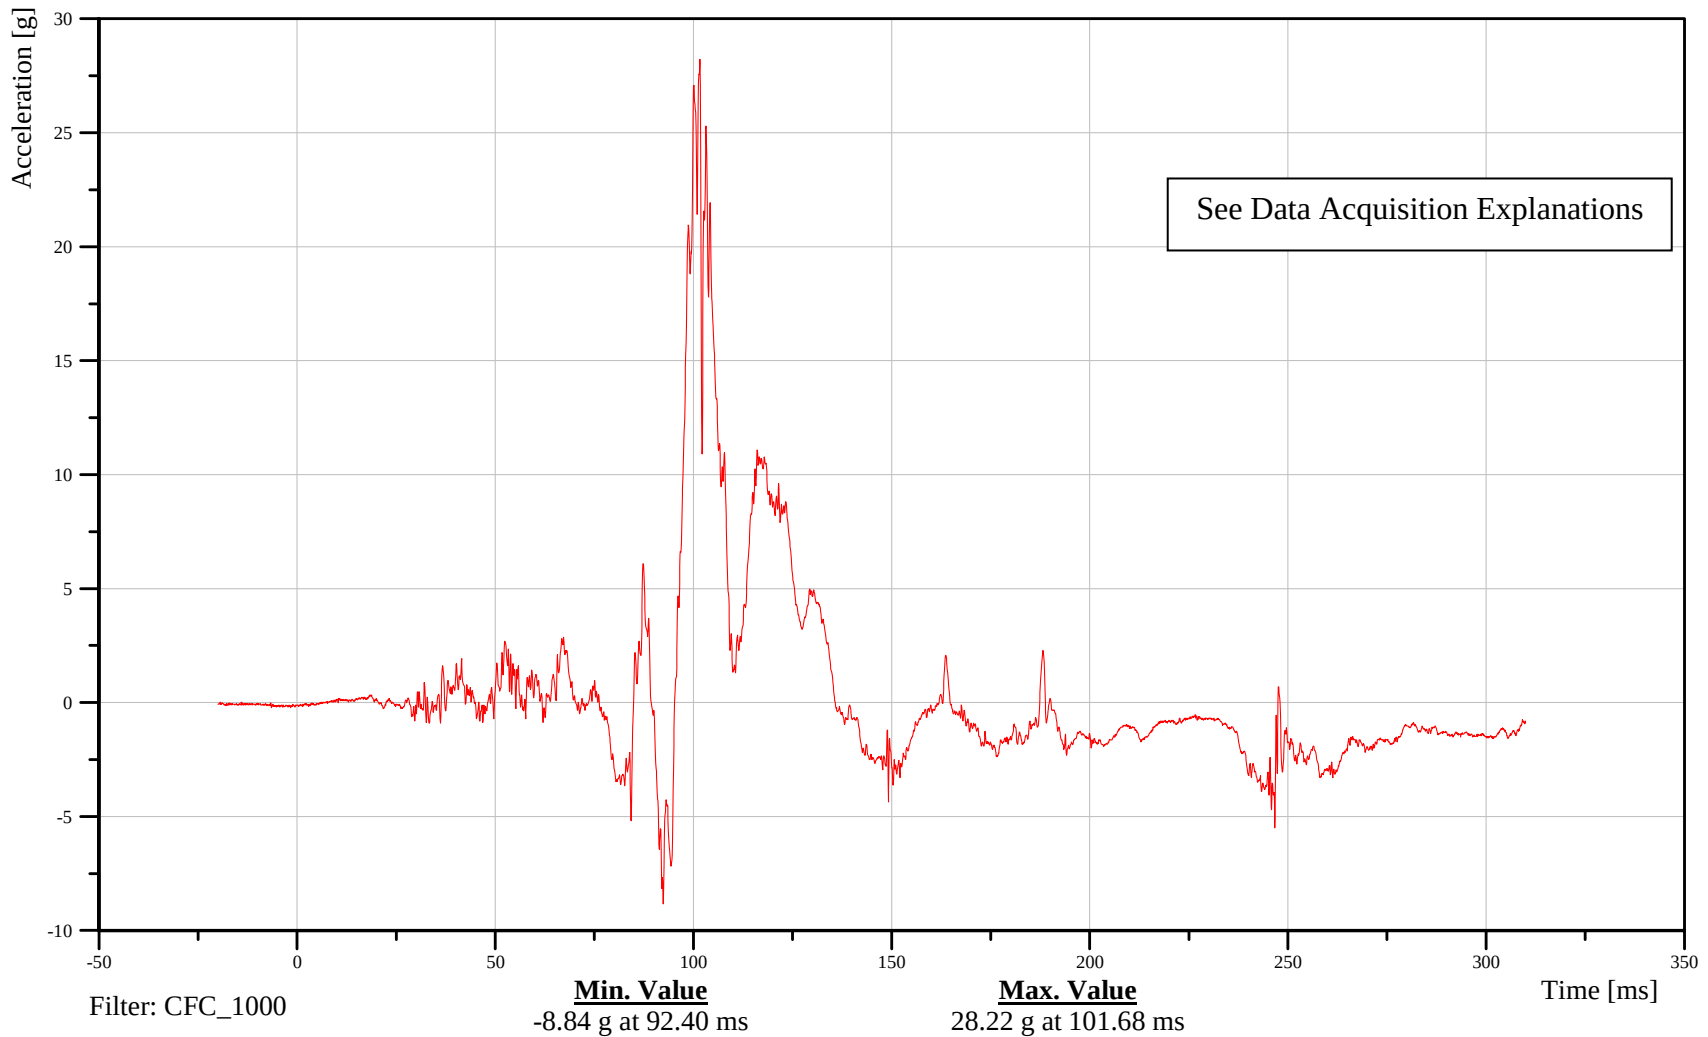

B-70

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Lower Tibia X-Axis Force

Customer: Volpe

11TIBIRLLXH3FOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

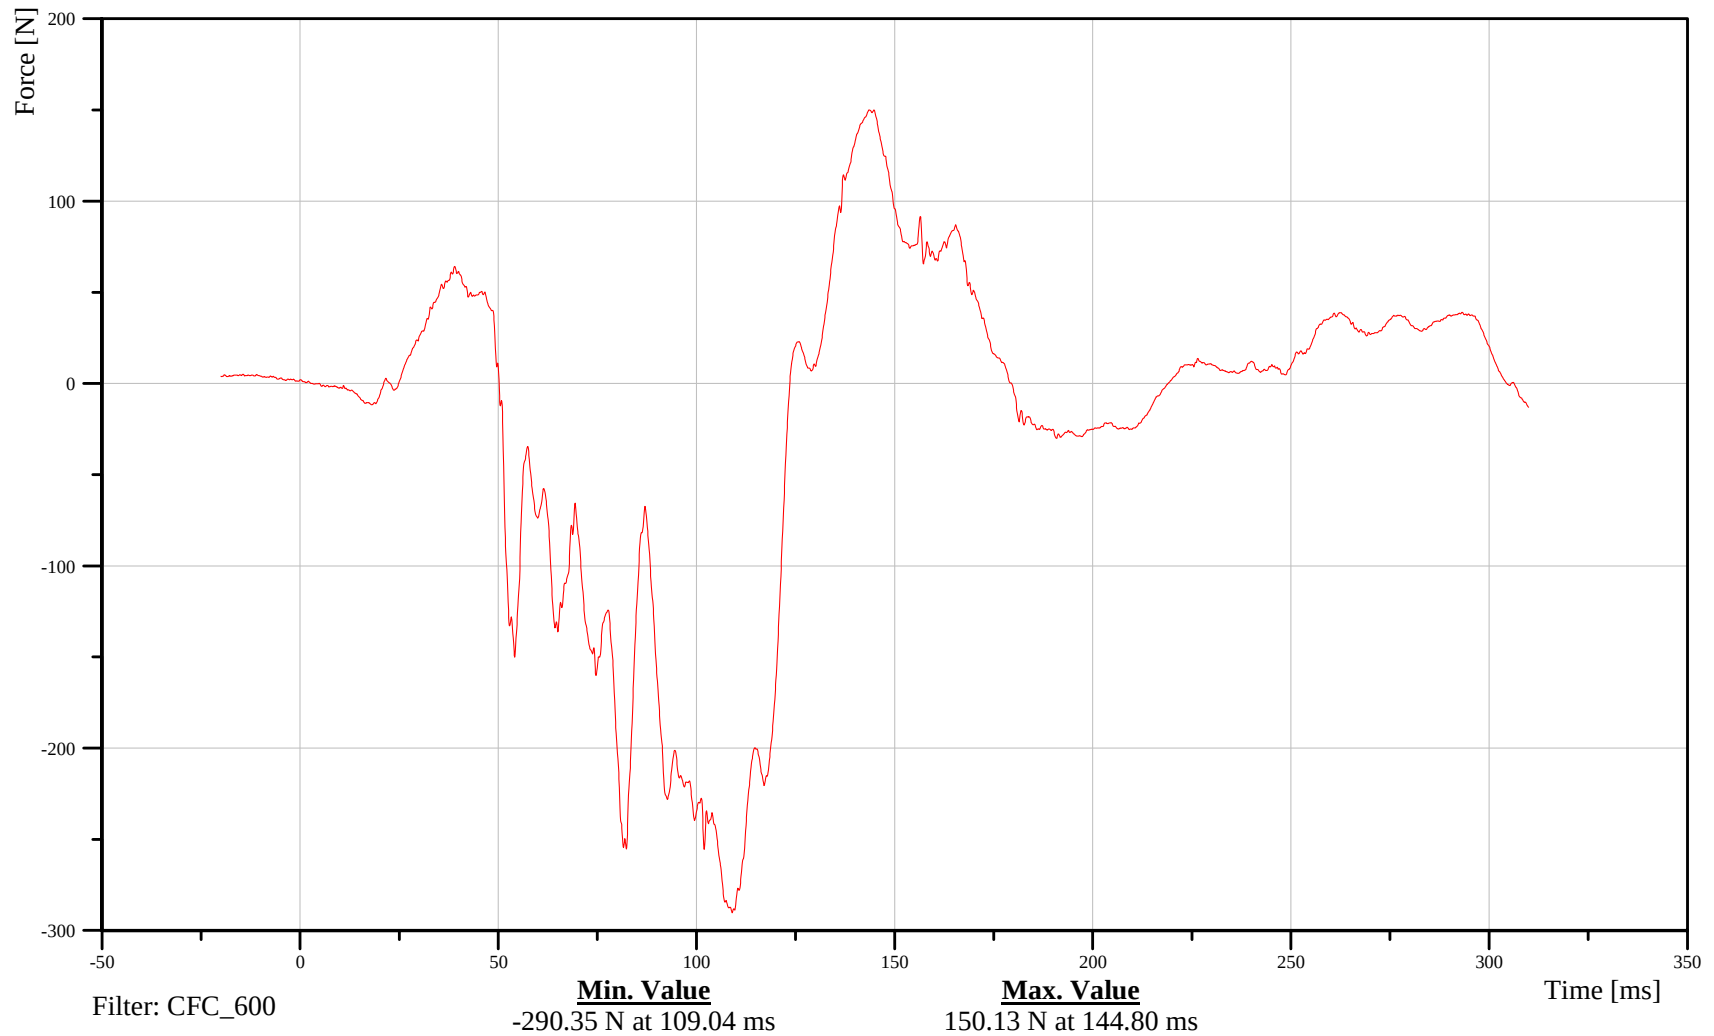

B-71

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Lower Tibia Y-Axis Force

Customer: Volpe

11TIBIRLLXH3FOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

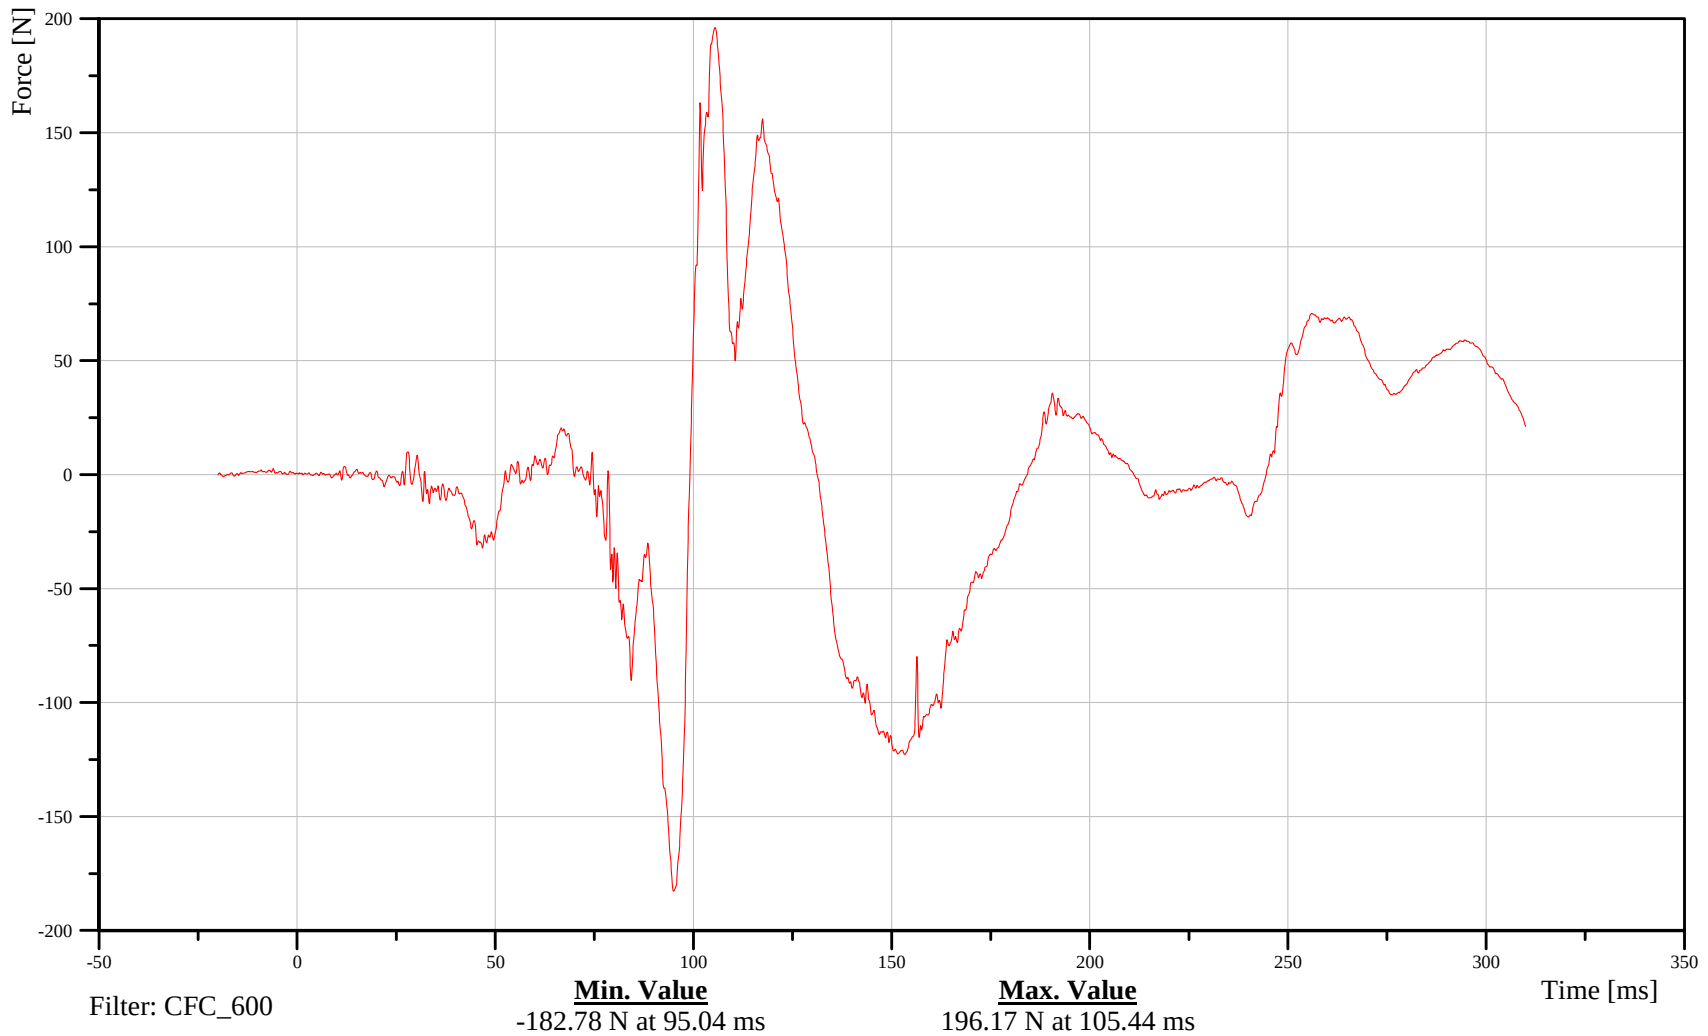

B-72

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Right Lower Tibia Z-Axis Force

Customer: Volpe

11TIBIRLLXH3FOZB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

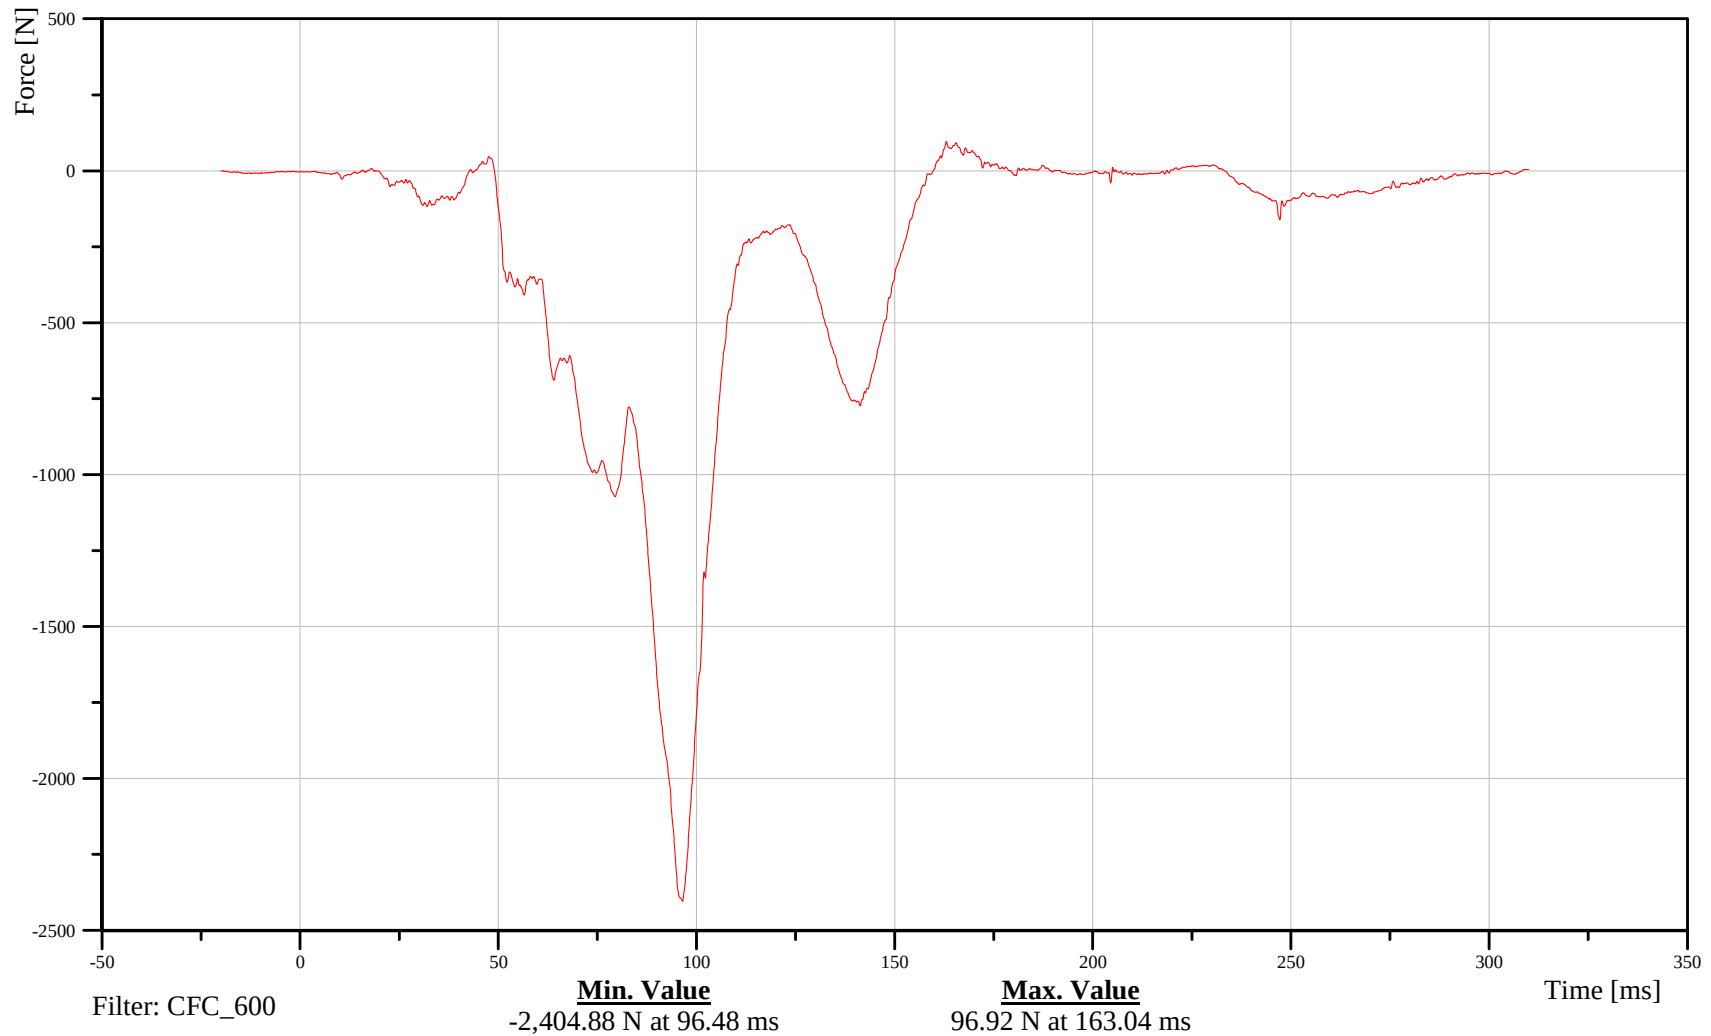

B-73

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Lower Tibia Moment About X Axis

Customer: Volpe

11TIBIRLLXH3MOXB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

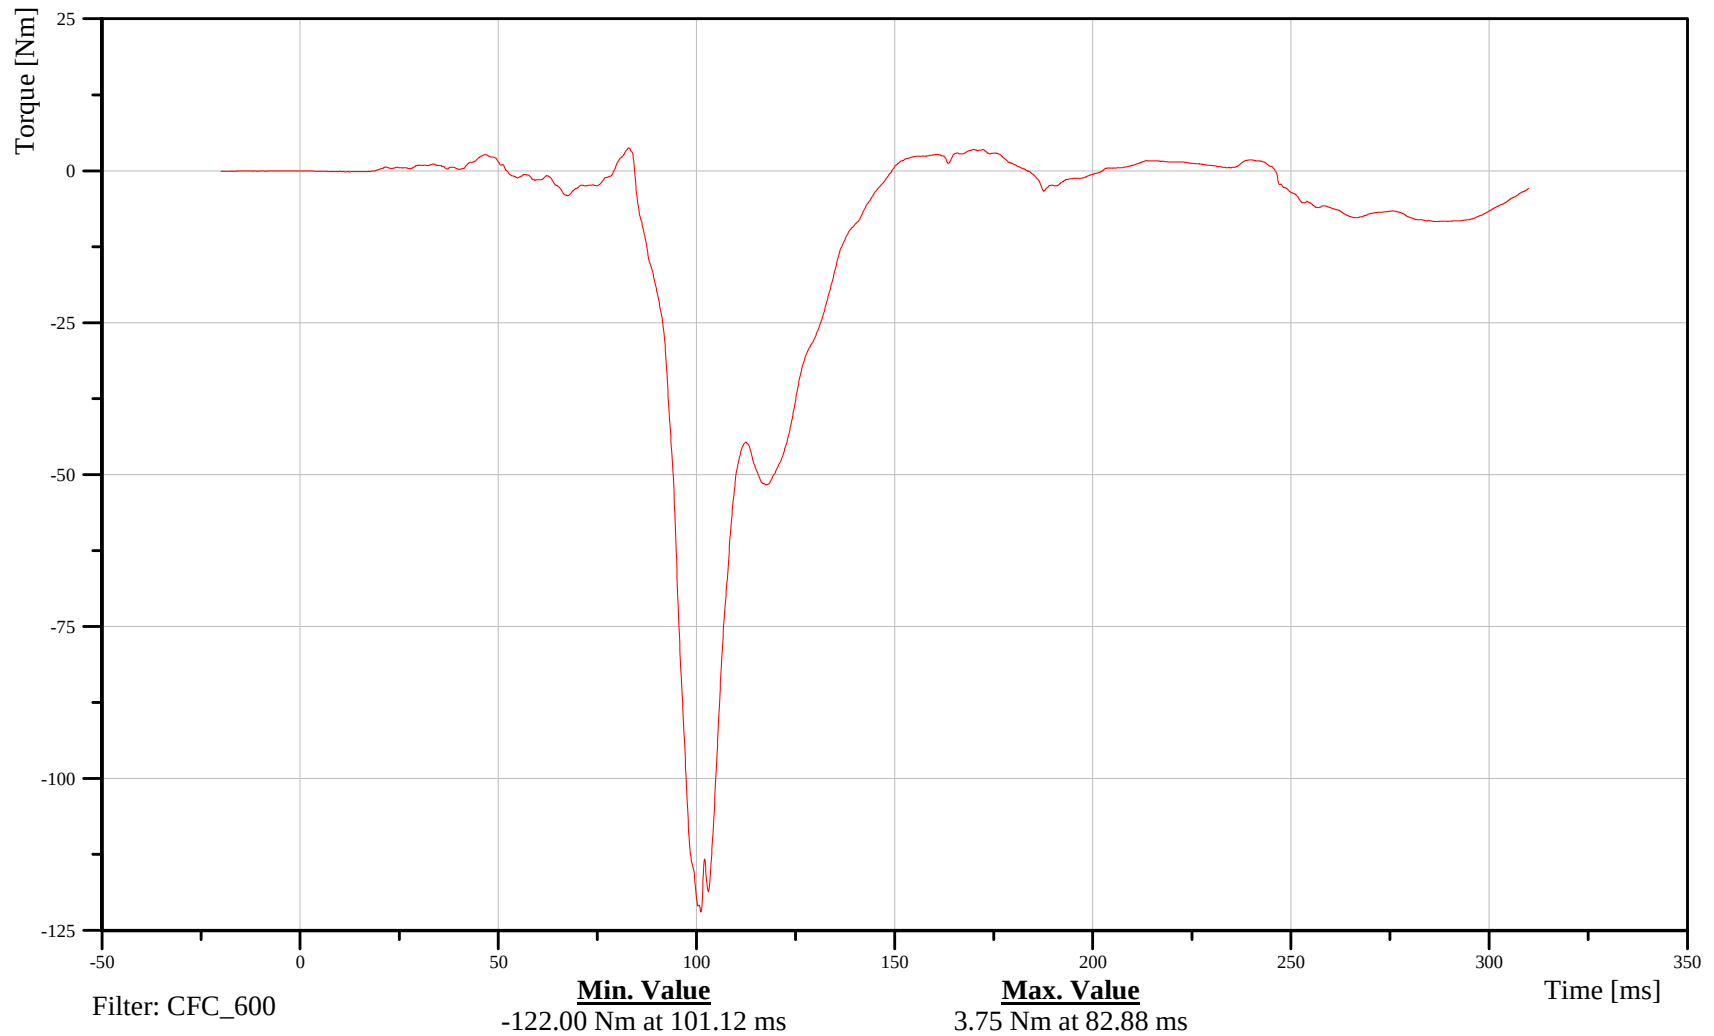

B-74

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Lower Tibia Moment About Y Axis

Customer: Volpe

11TIBIRLLXH3MOYB

TRC Inc. Test Lab: CTF

Test Number: 060630-2

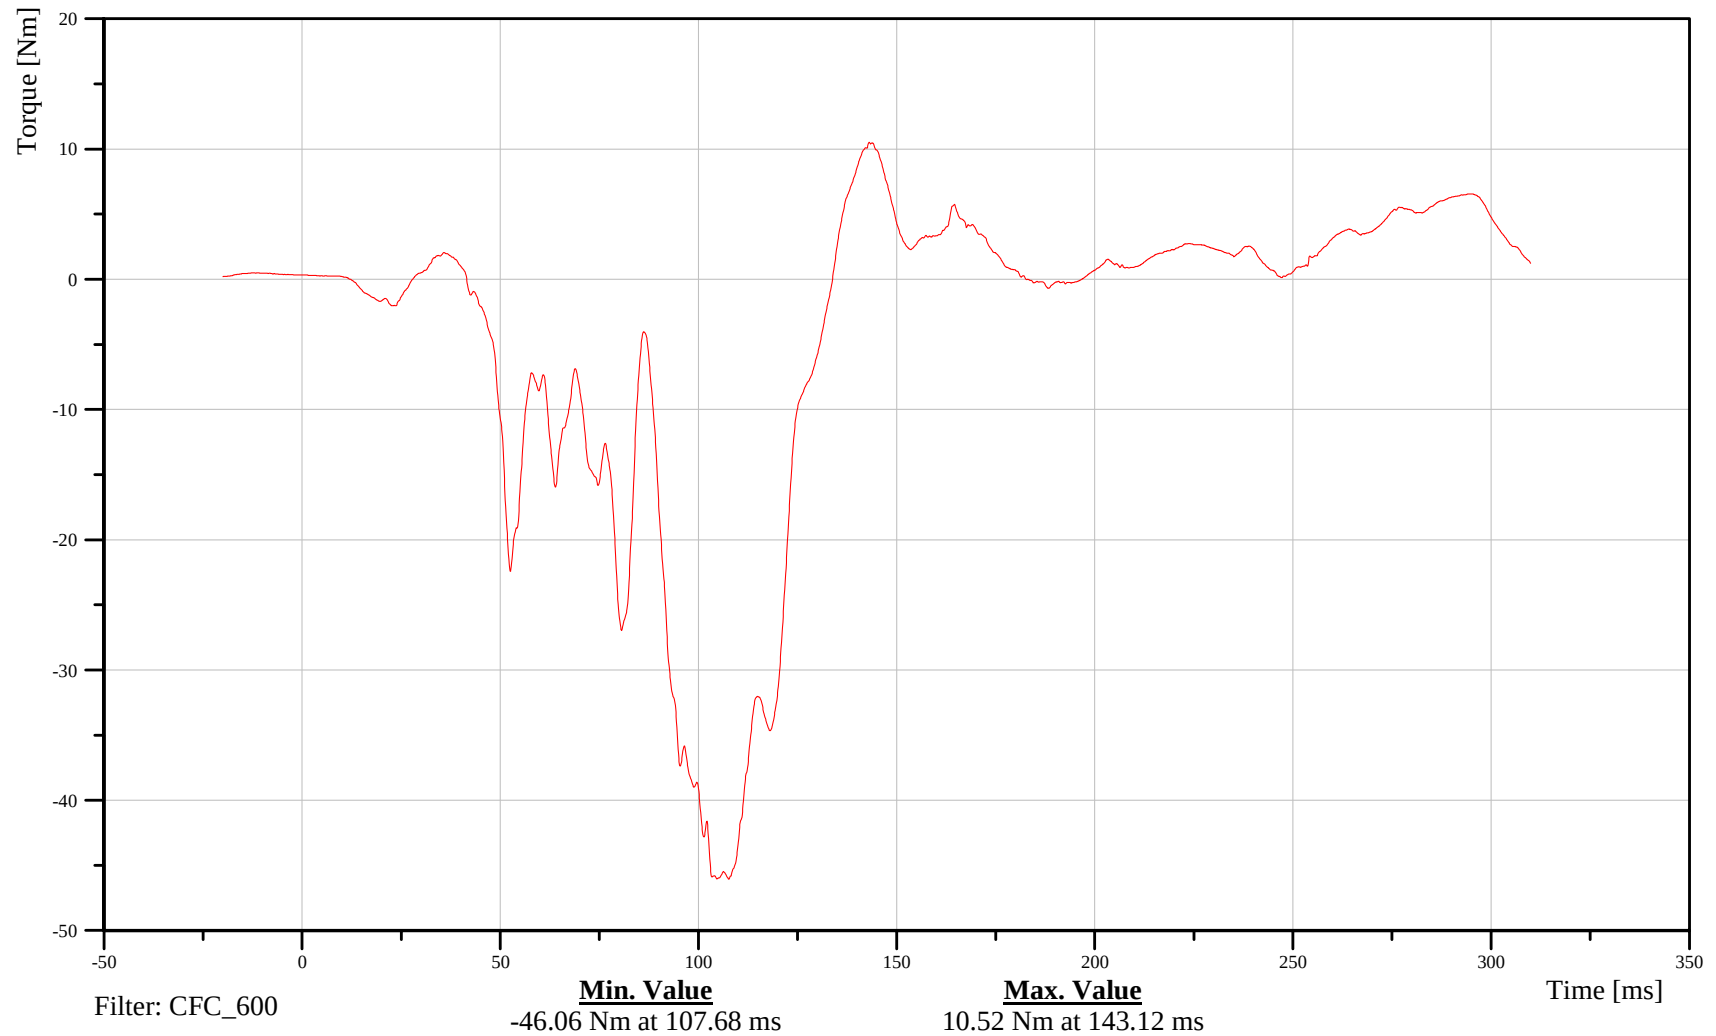

B-75

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot X-Axis Rotation

Customer: Volpe

11FOOTRILXH3ANXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

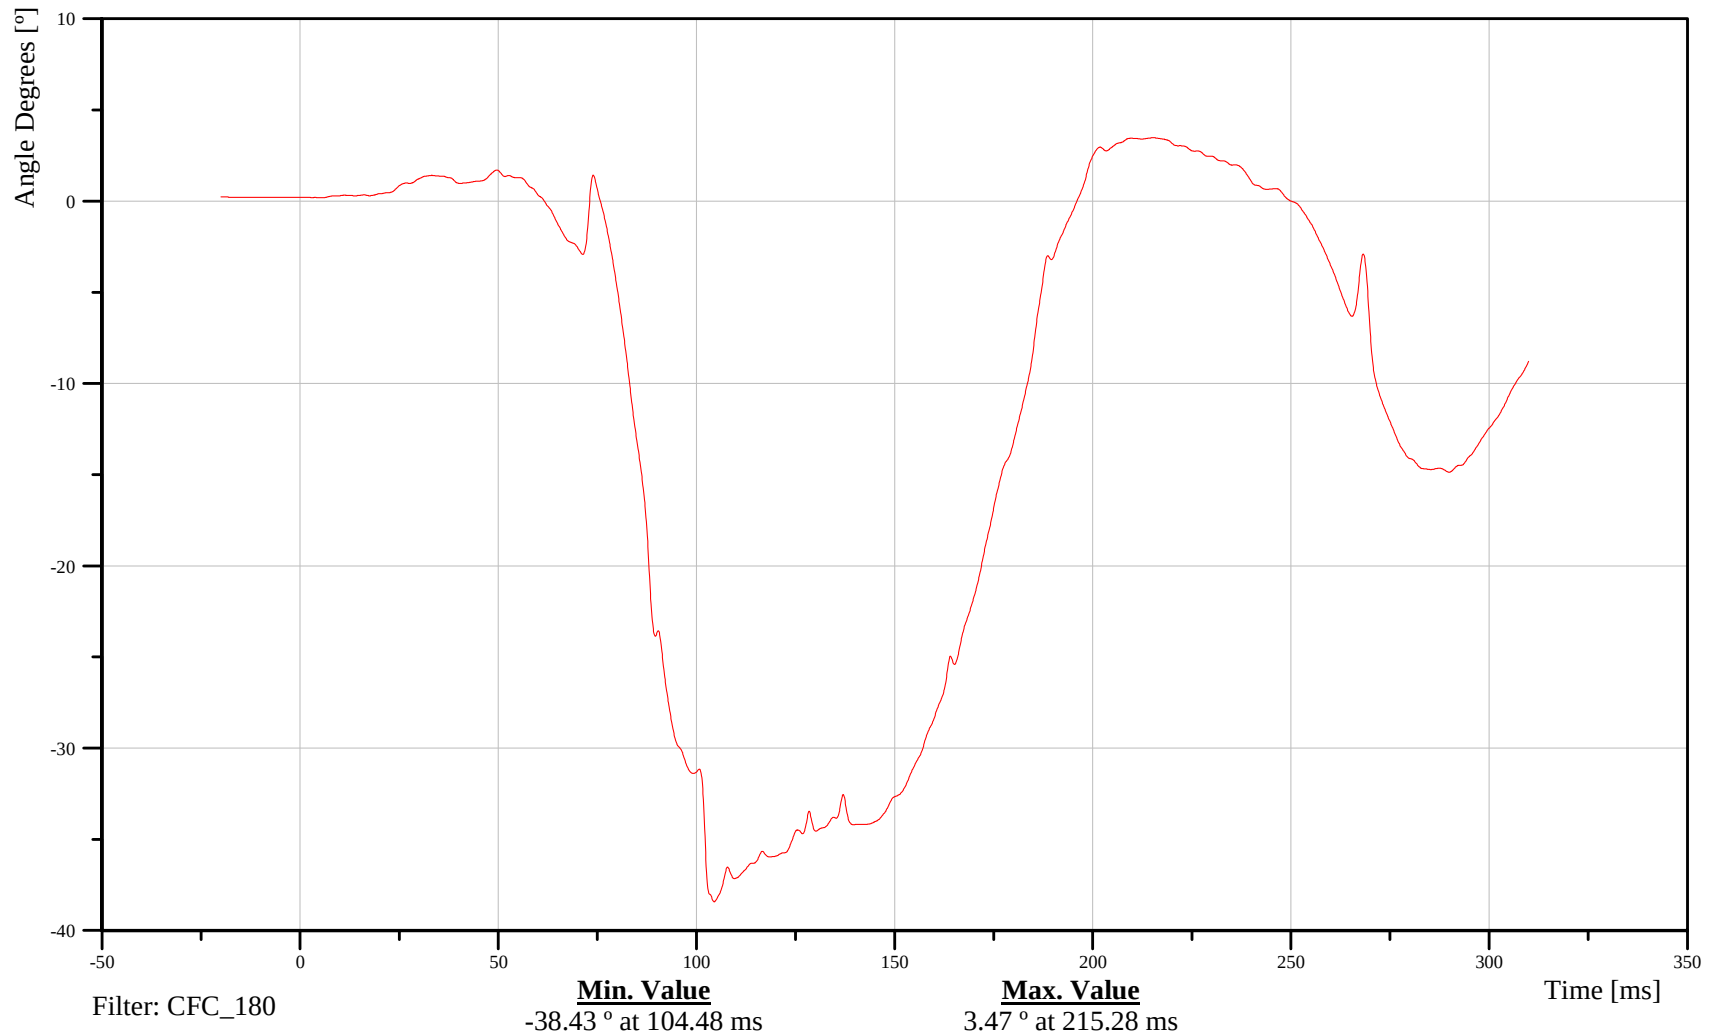

B-76

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot Y-Axis Rotation

Customer: Volpe

11FOOTRILXH3ANYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

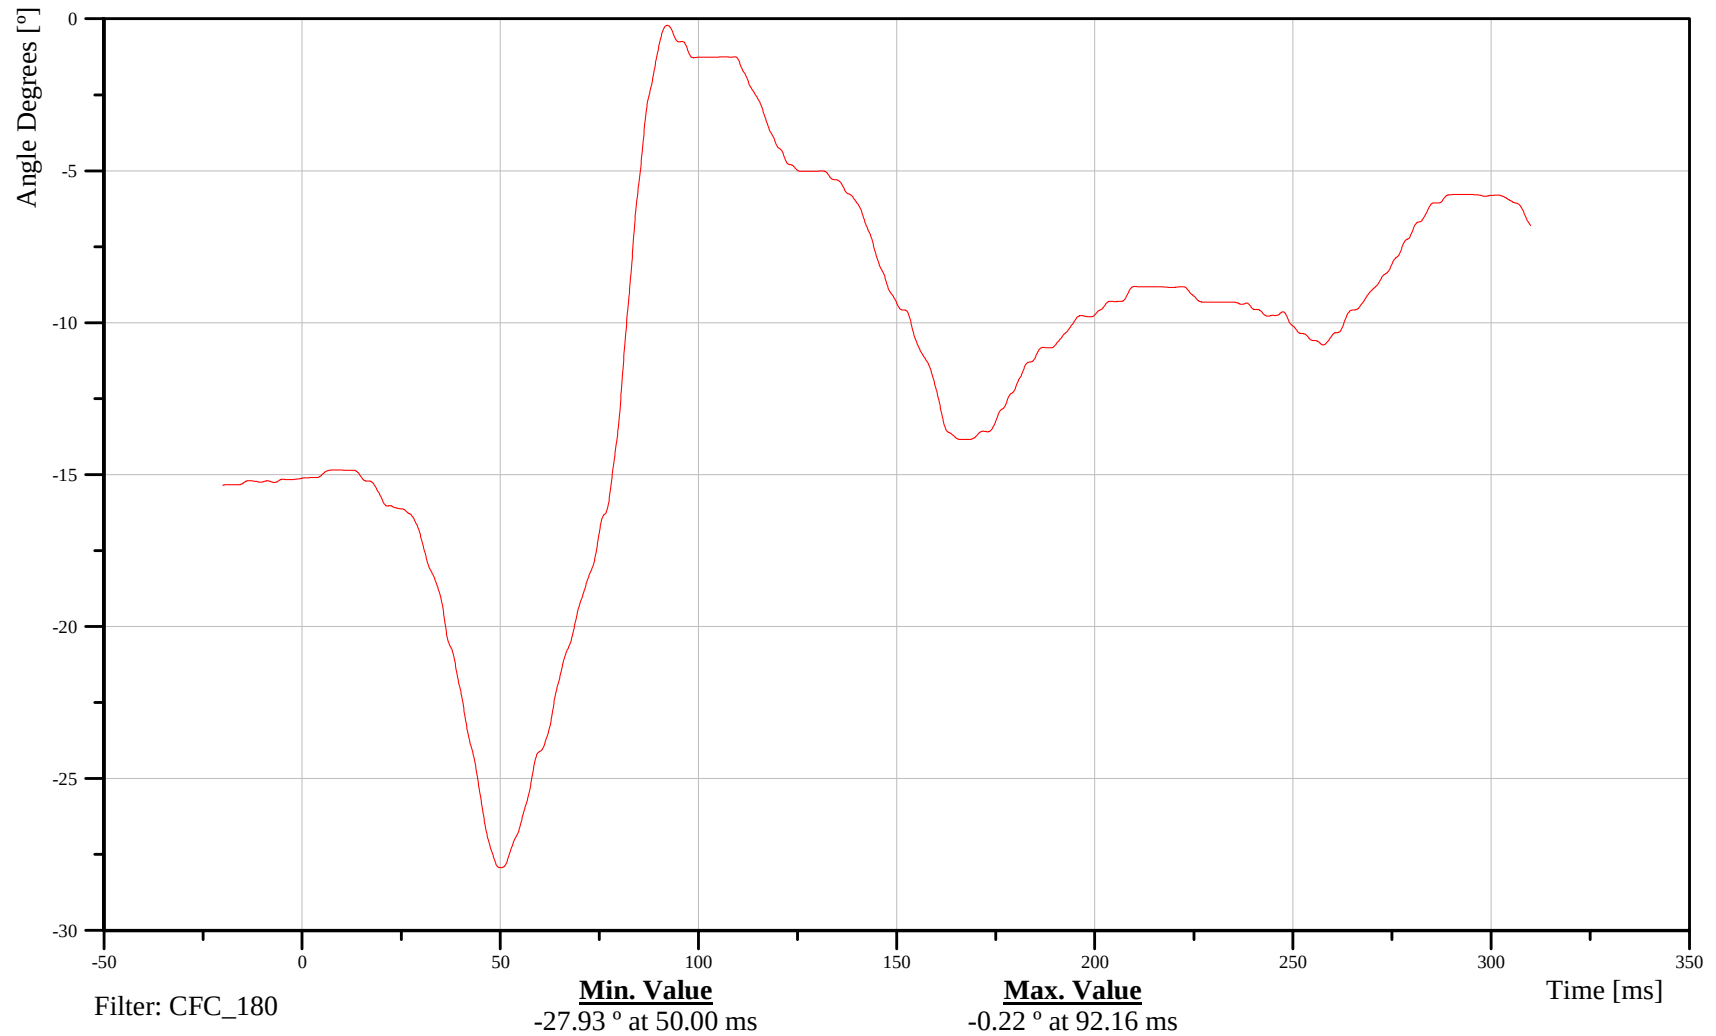

B-77

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot Z-Axis Rotation

Customer: Volpe

11FOOTRILXH3ANZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

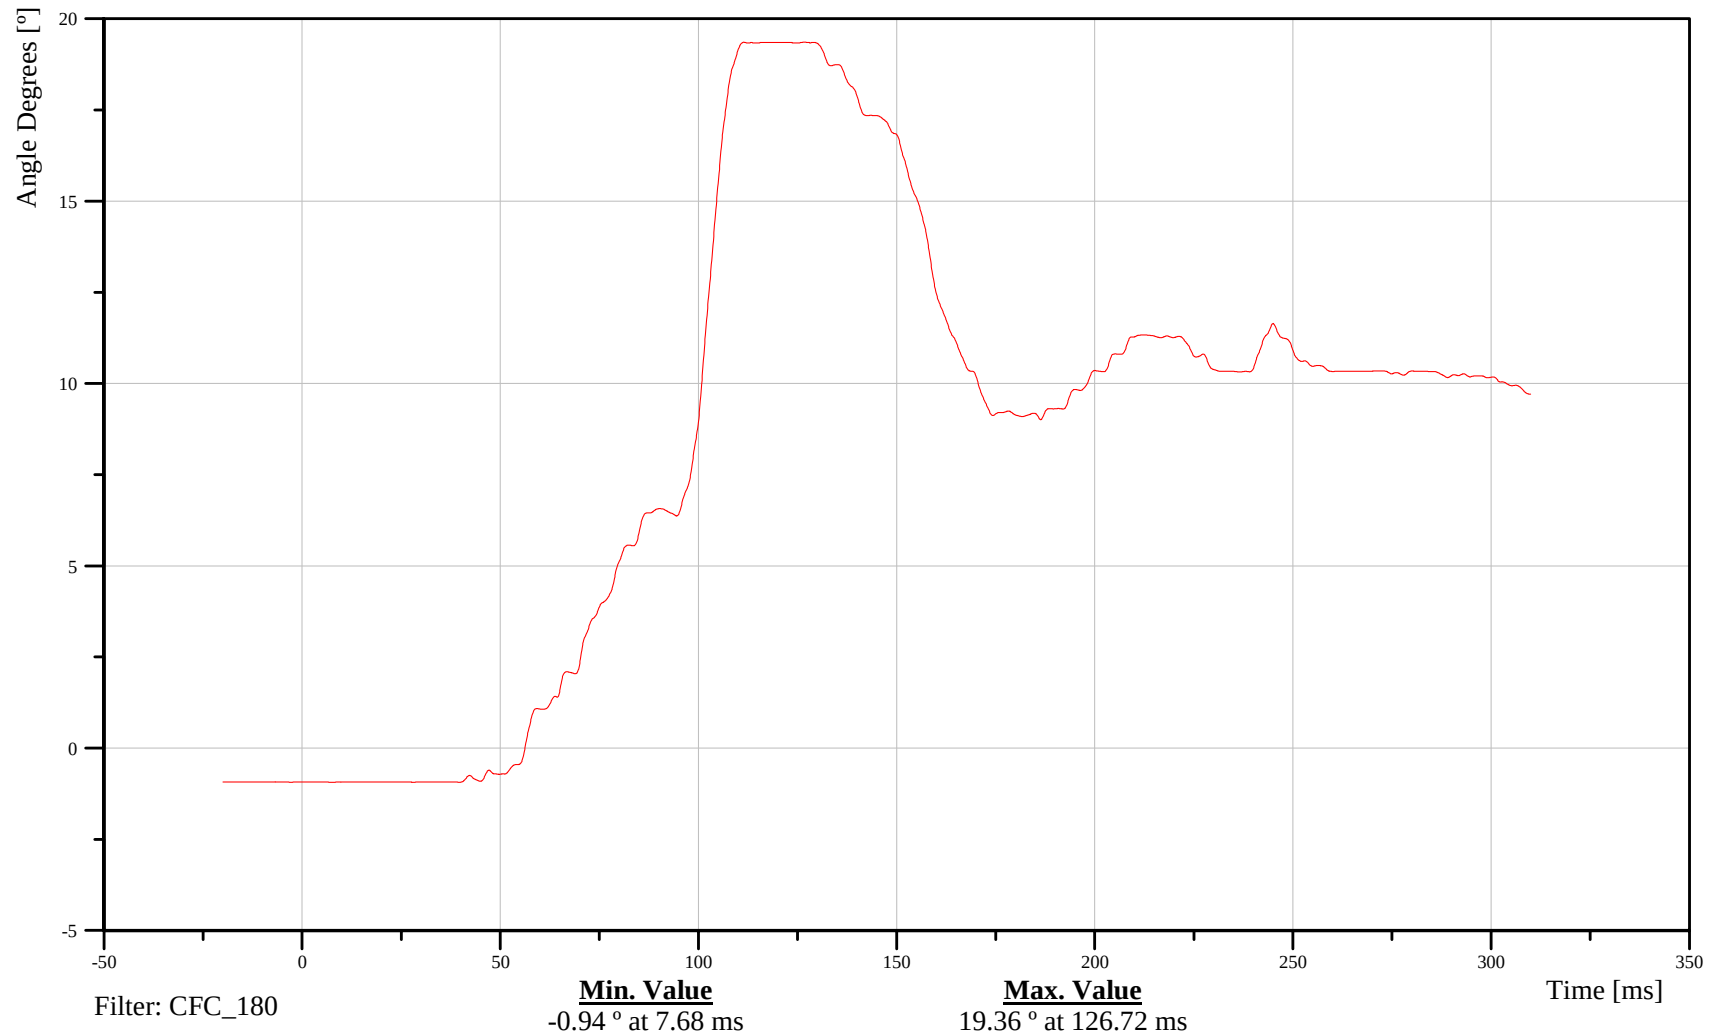

B-78

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot X-Axis Acceleration

Customer: Volpe

11FOOTRILXH3ACXA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

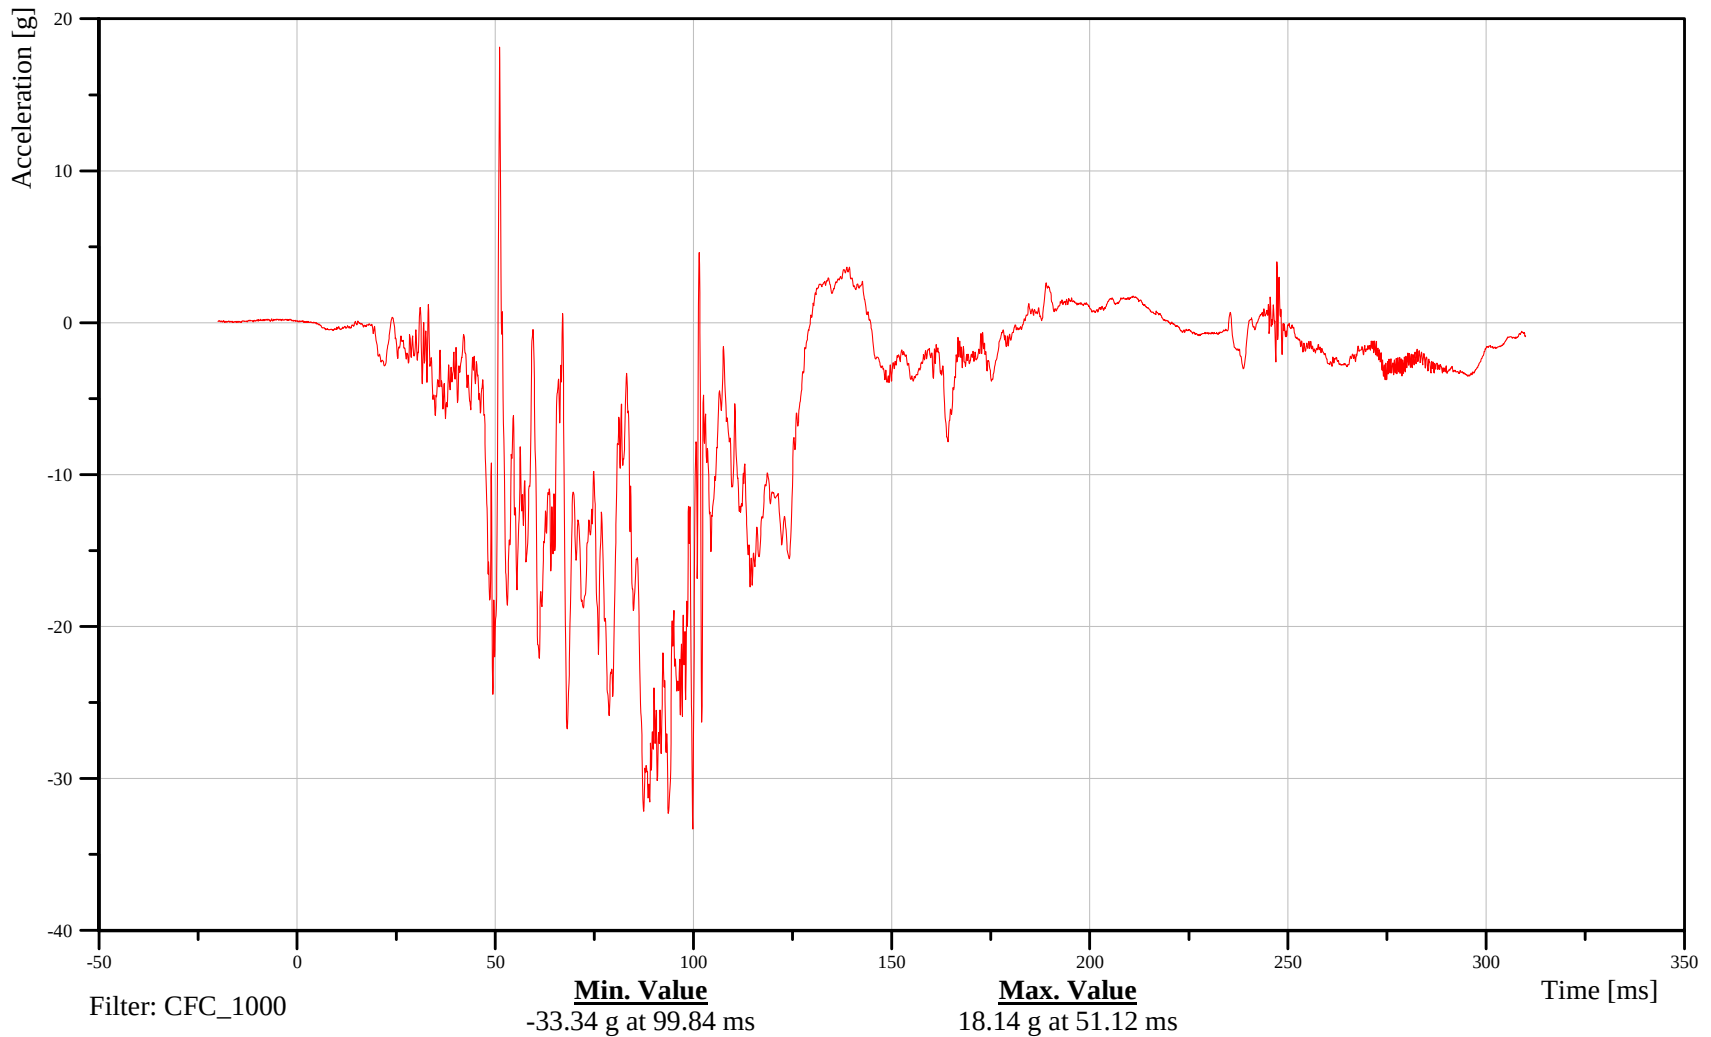

B-79

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot Y-Axis Acceleration

Customer: Volpe

11FOOTRILXH3ACYA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

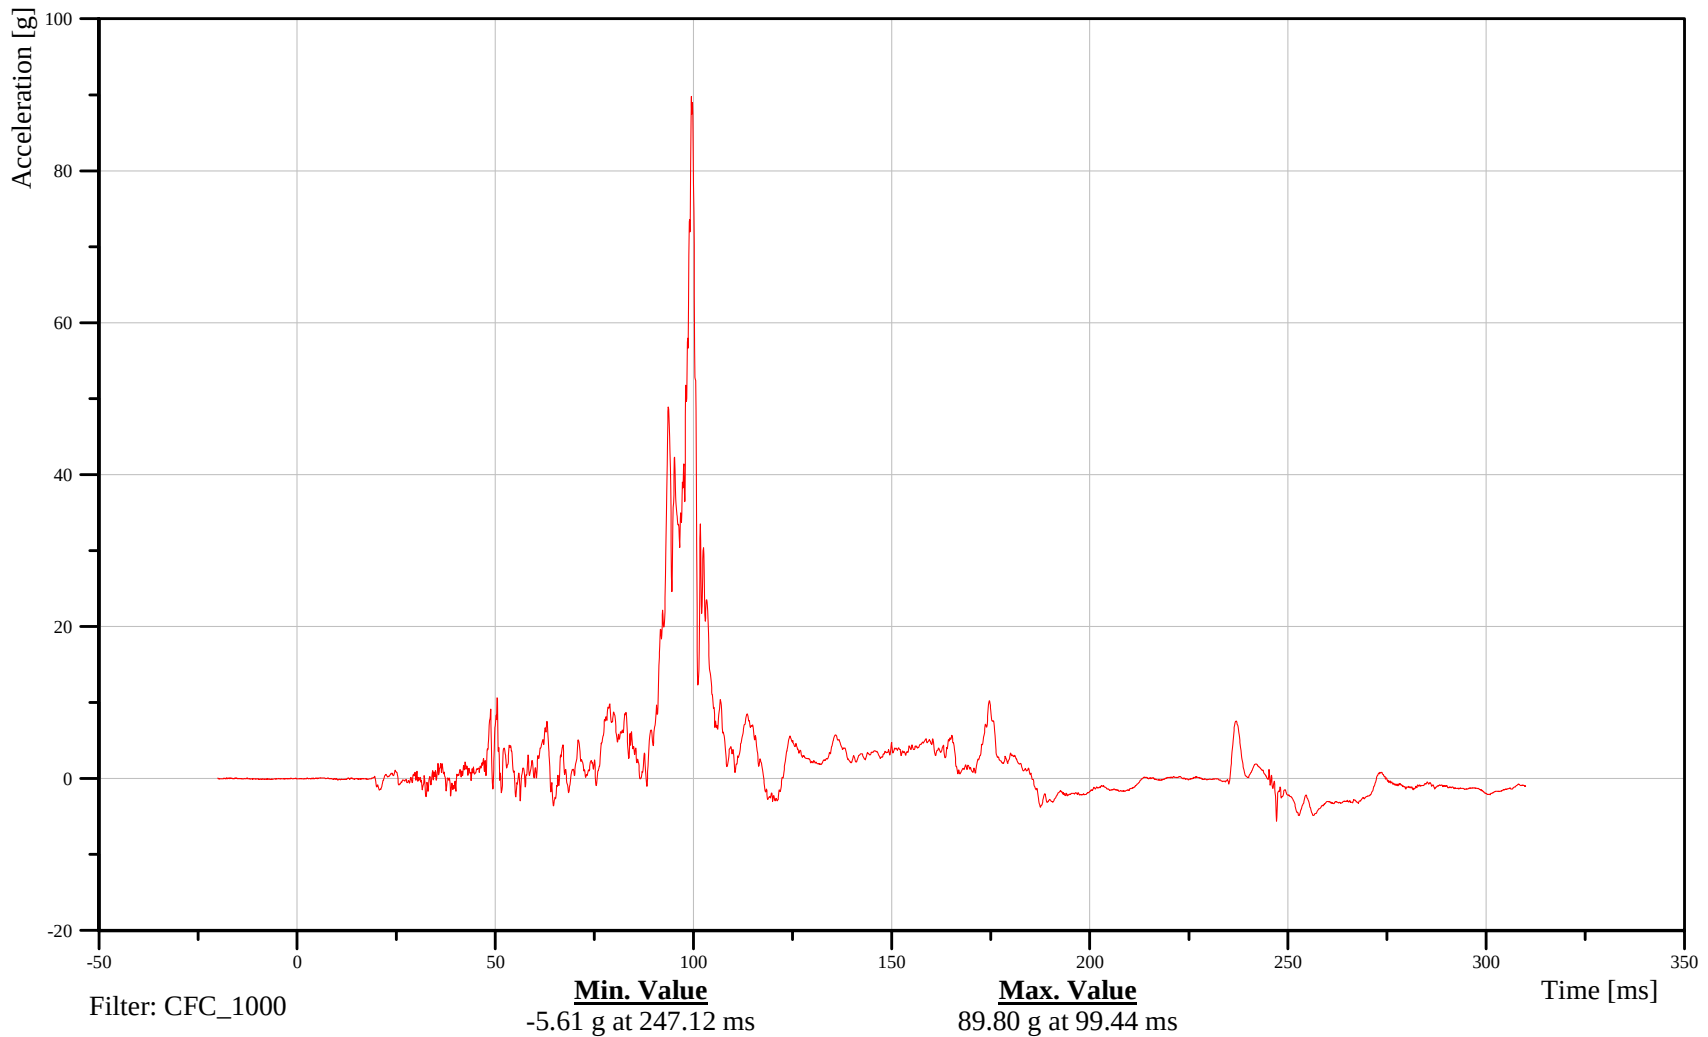

B-80

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot Z-Axis Acceleration

Customer: Volpe

11FOOTRILXH3ACZA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

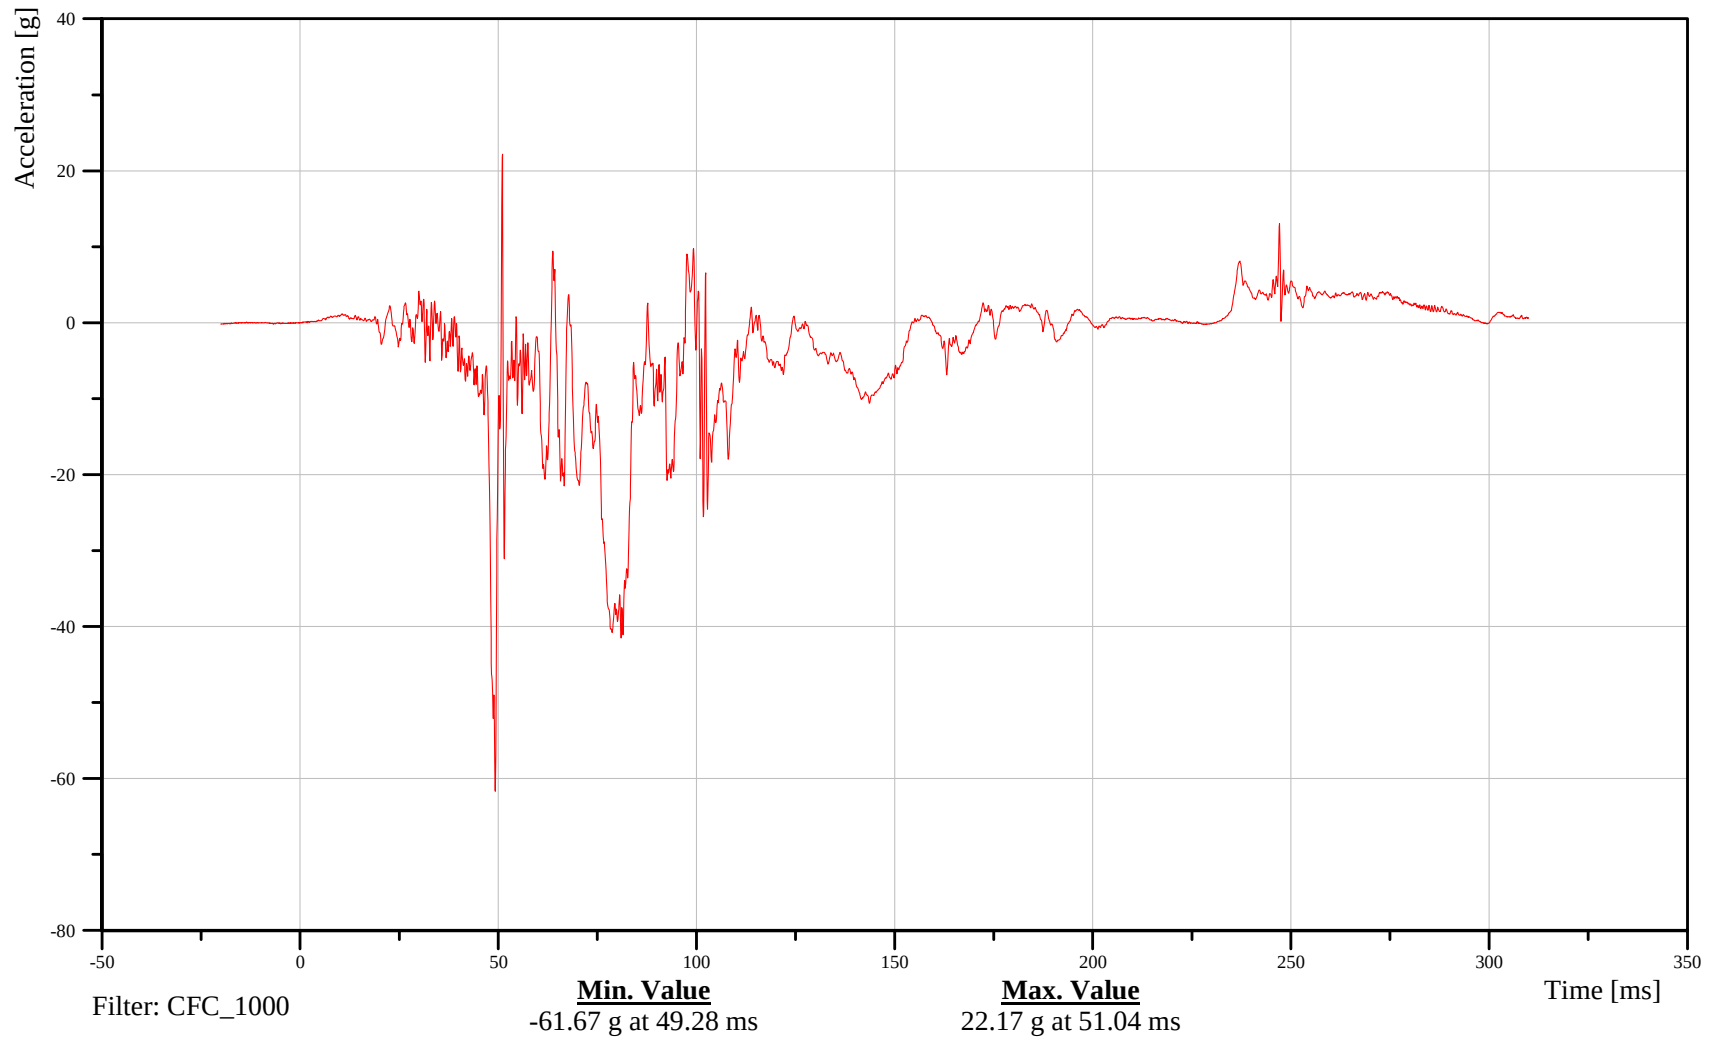

B-81

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Foot Resultant Acceleration

Customer: Volpe

11FOOTRILXH3ACRA

TRC Inc. Test Lab: CTF

Test Number: 060630-2

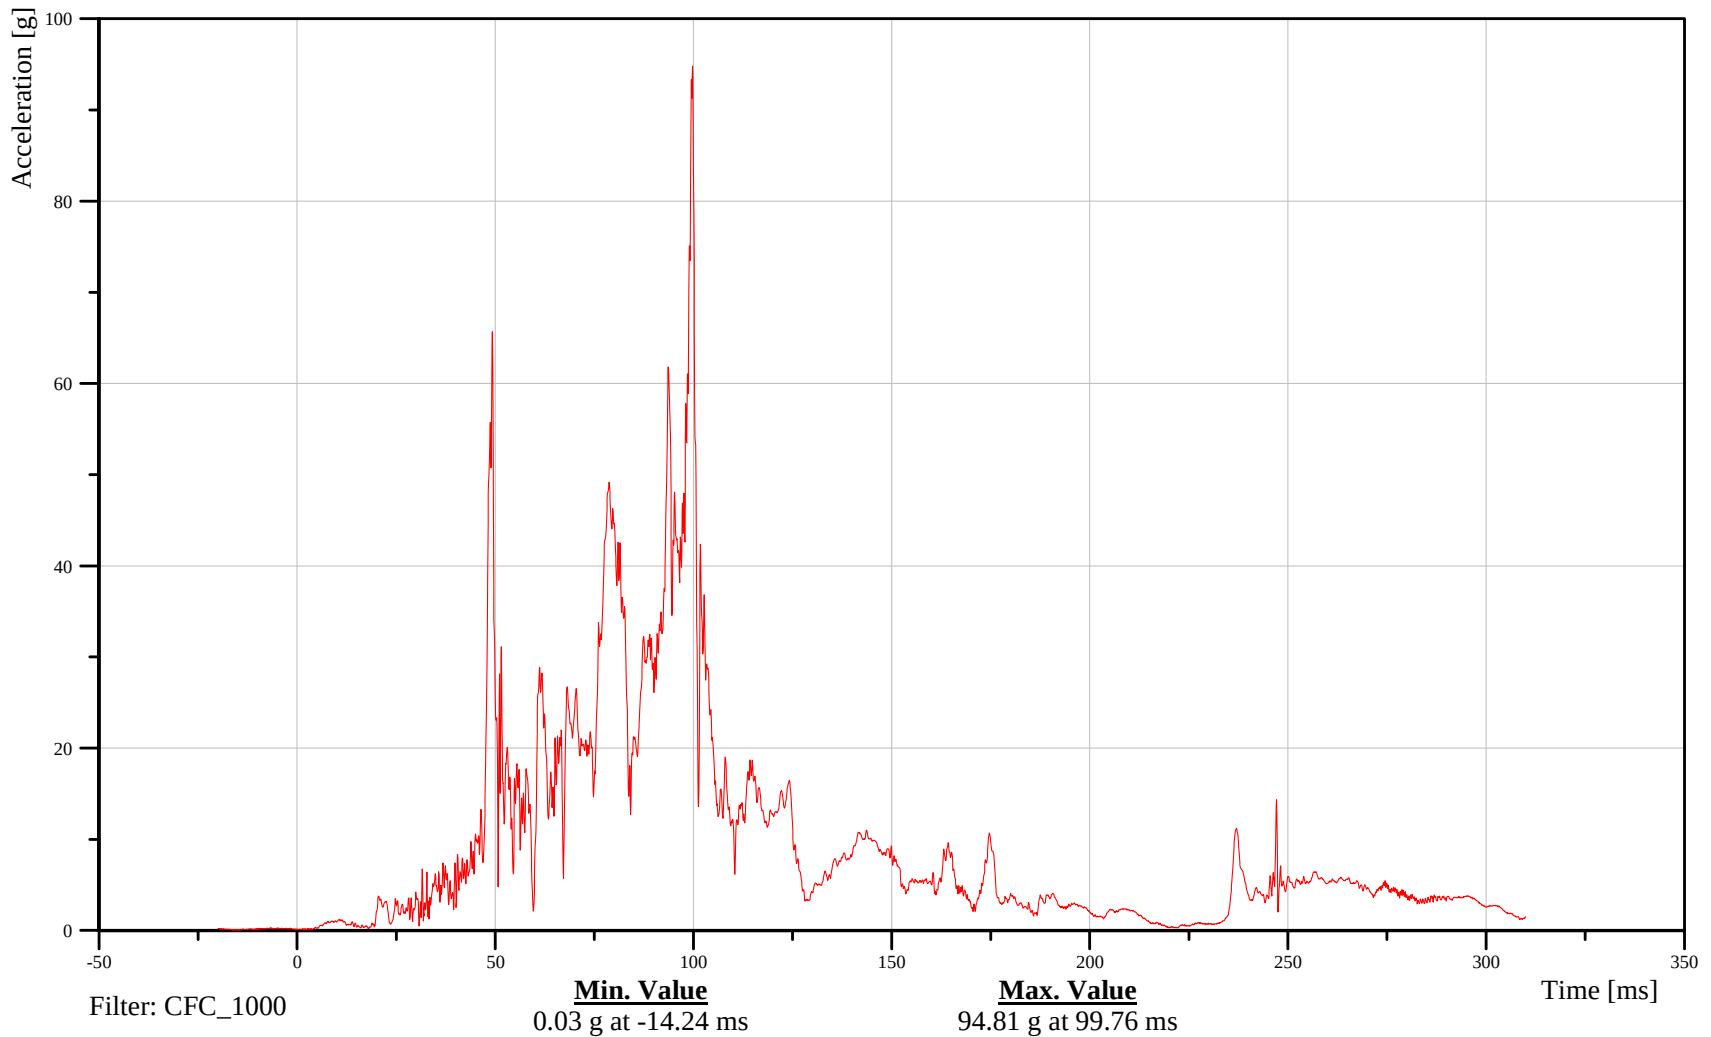

B-82

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Rear Seat Cross-Member X-Axis Acceleration

Customer: Volpe

14CRME000000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

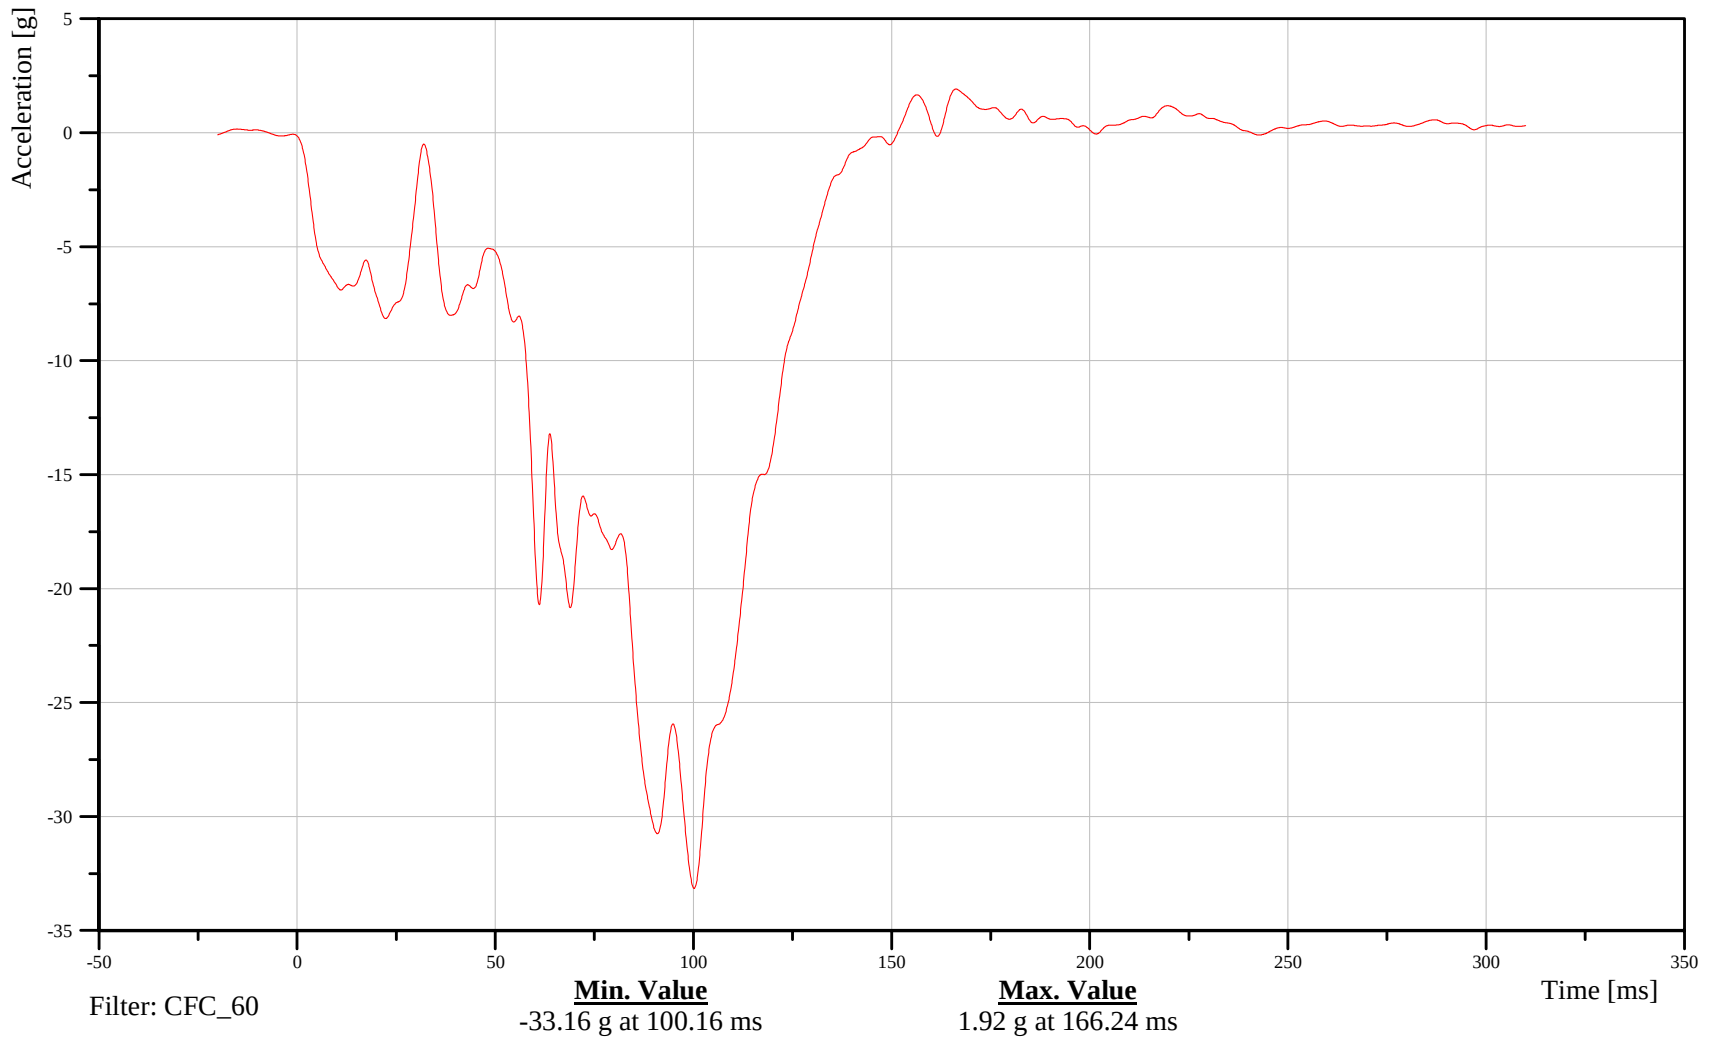

B-83

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Rear Seat Cross-Member X-Axis Acceleration

Customer: Volpe

16CRME000000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

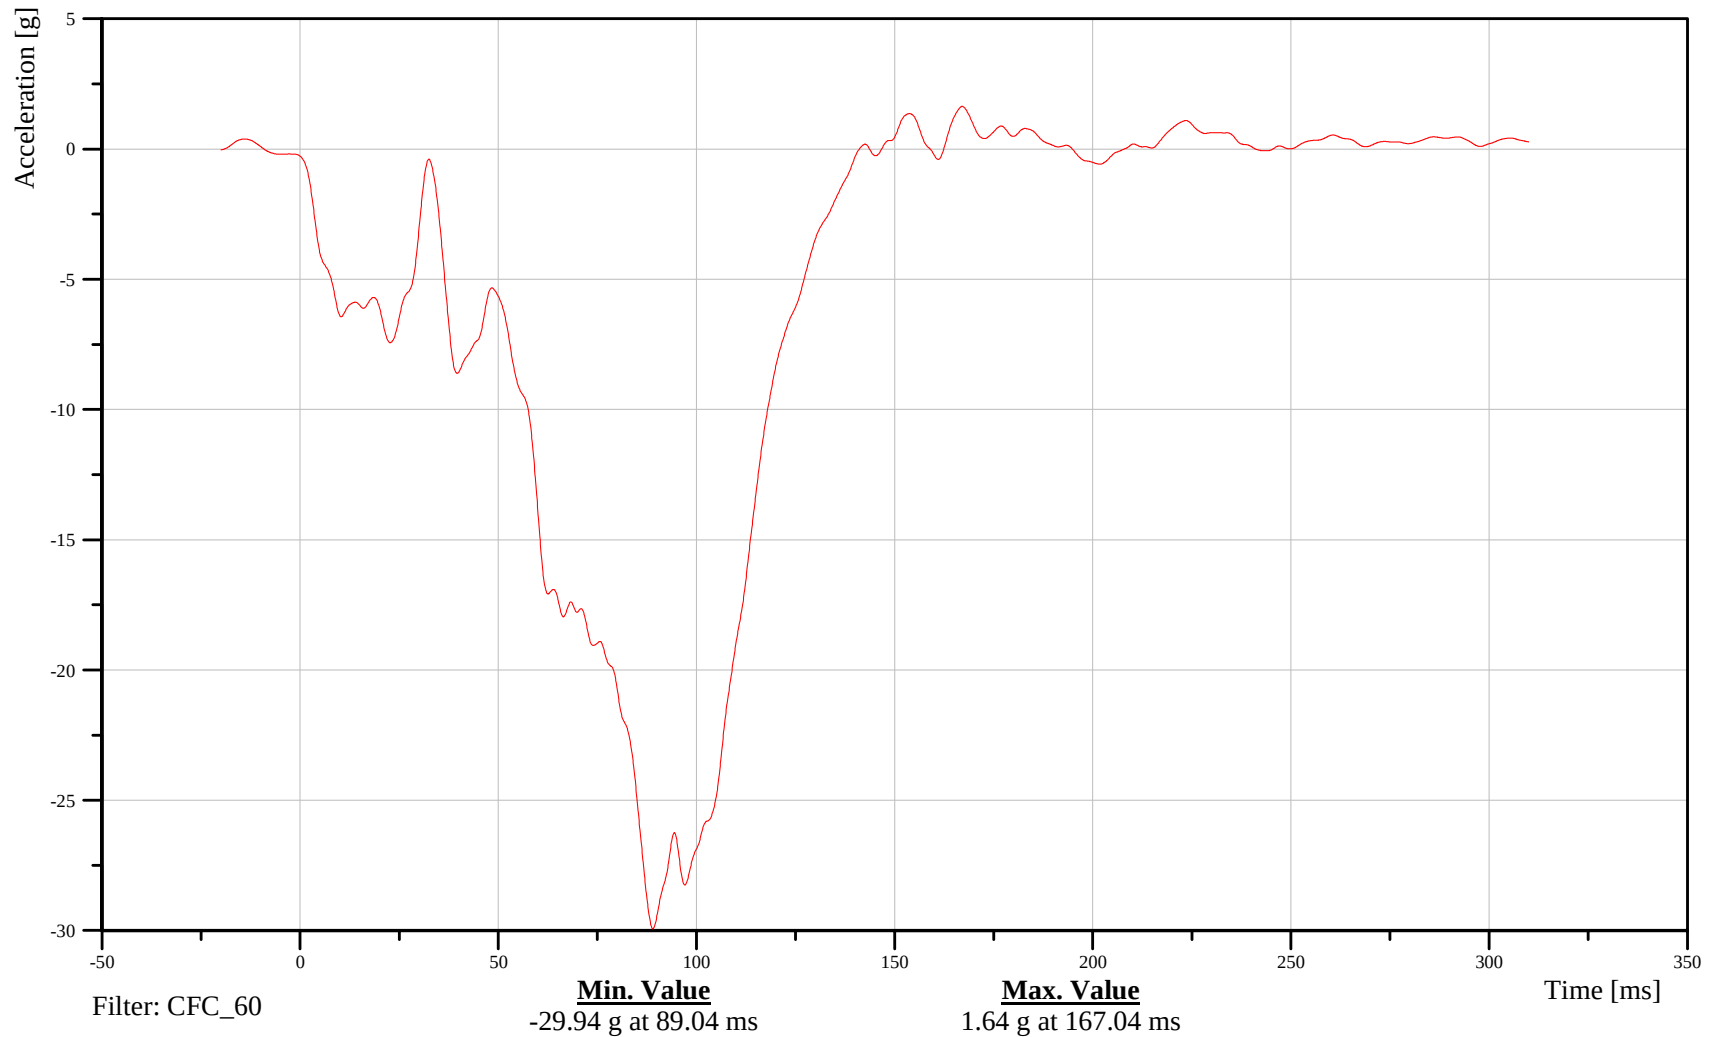

B-84

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Left Rear Seat Cross-Member Z-Axis Acceleration

Customer: Volpe

14CRME000000ACZD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

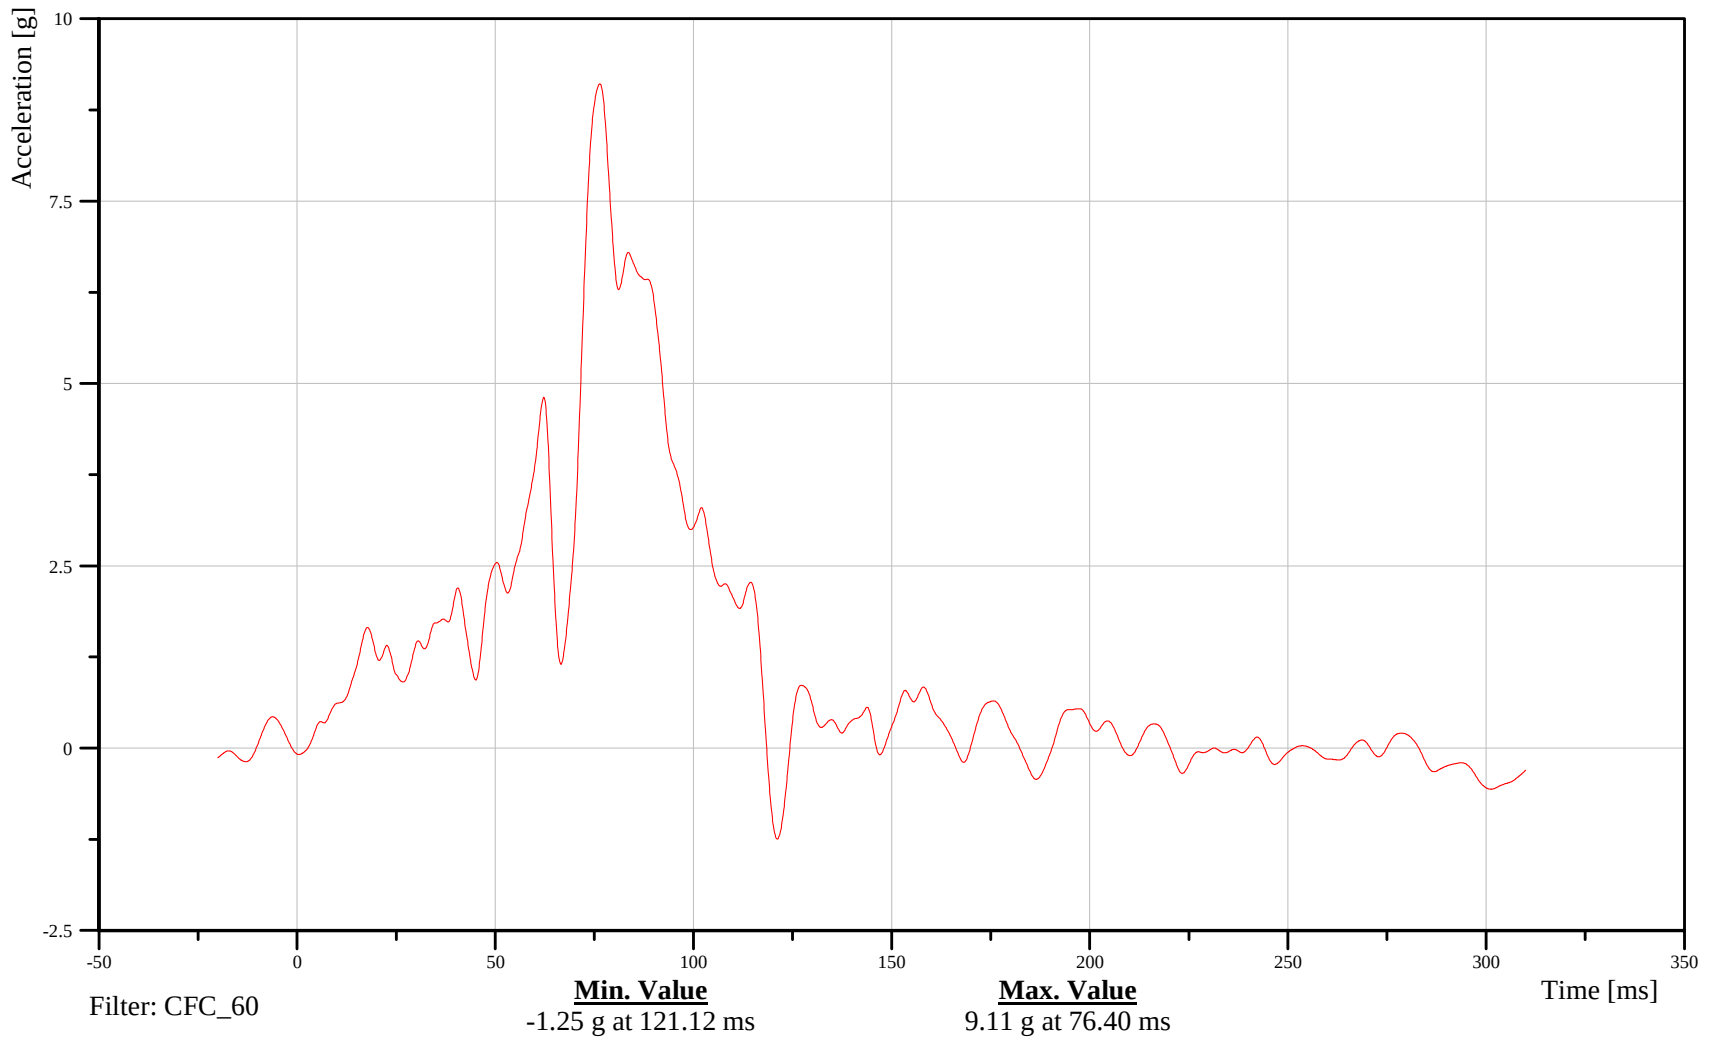

B-85

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Right Rear Seat Cross-Member Z-Axis Acceleration

Customer: Volpe

16CRME000000ACZD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

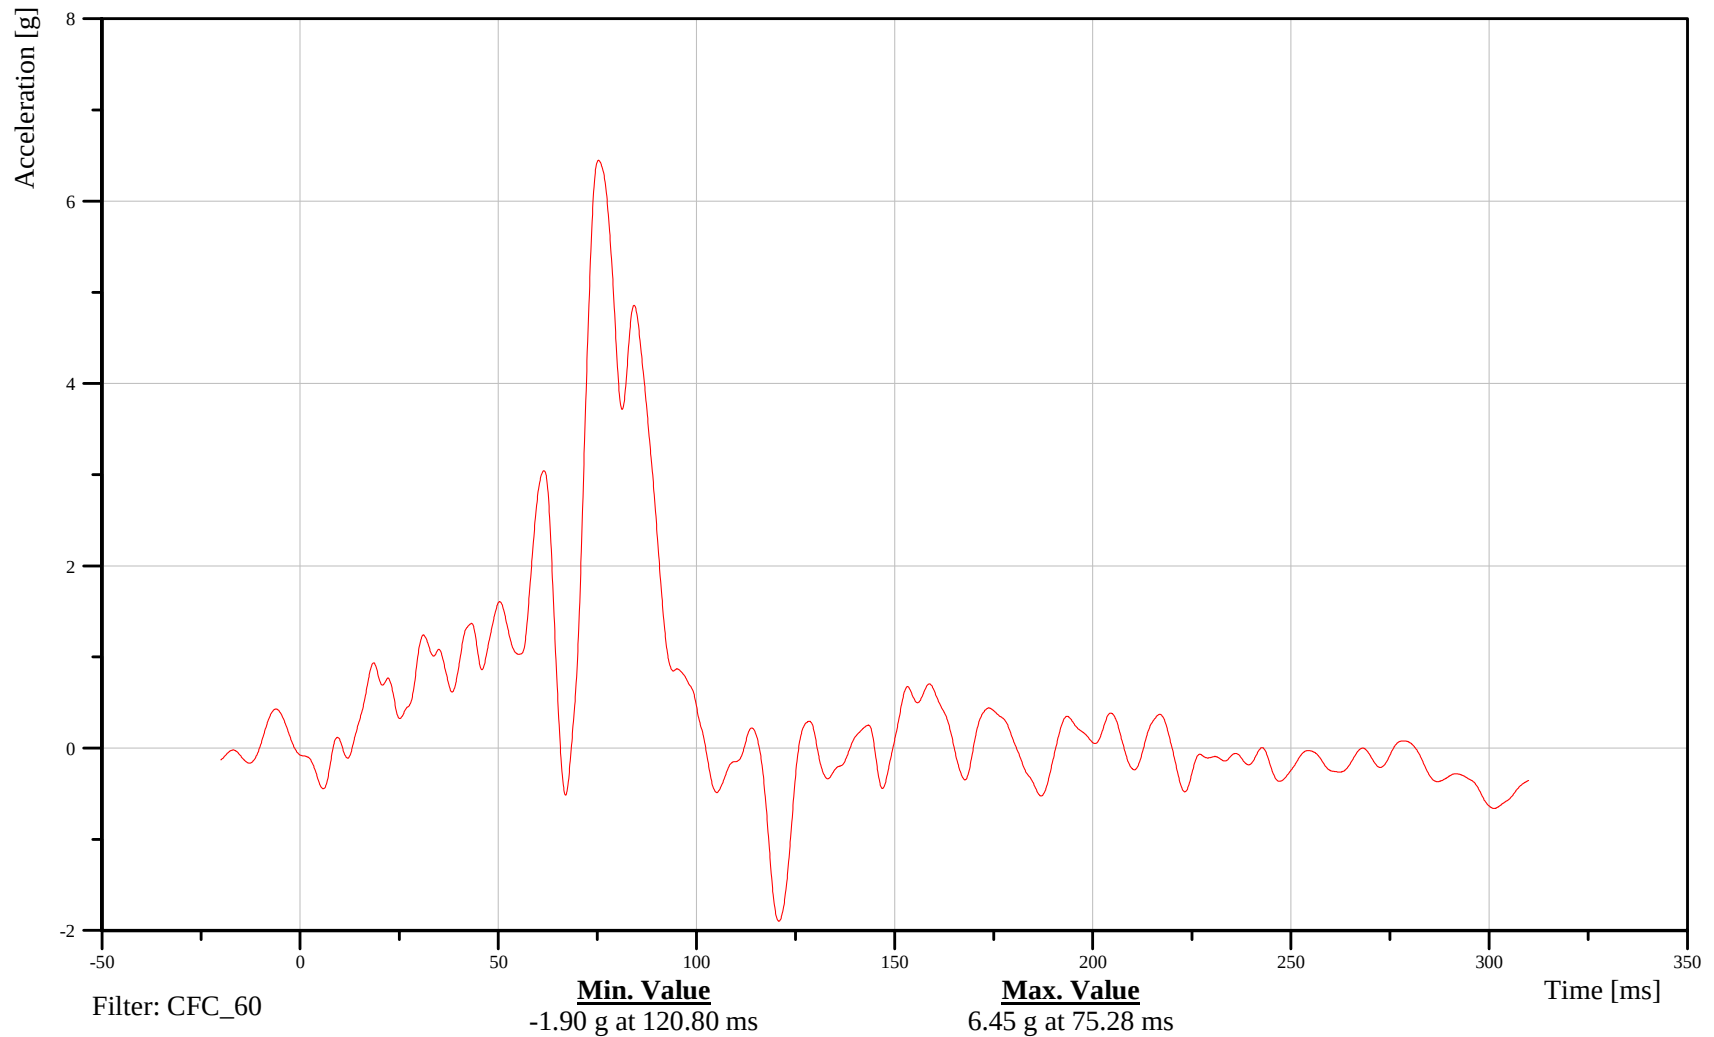

B-86

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Top of Engine Block X-Axis Acceleration

Customer: Volpe

12ENGNTTP0000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

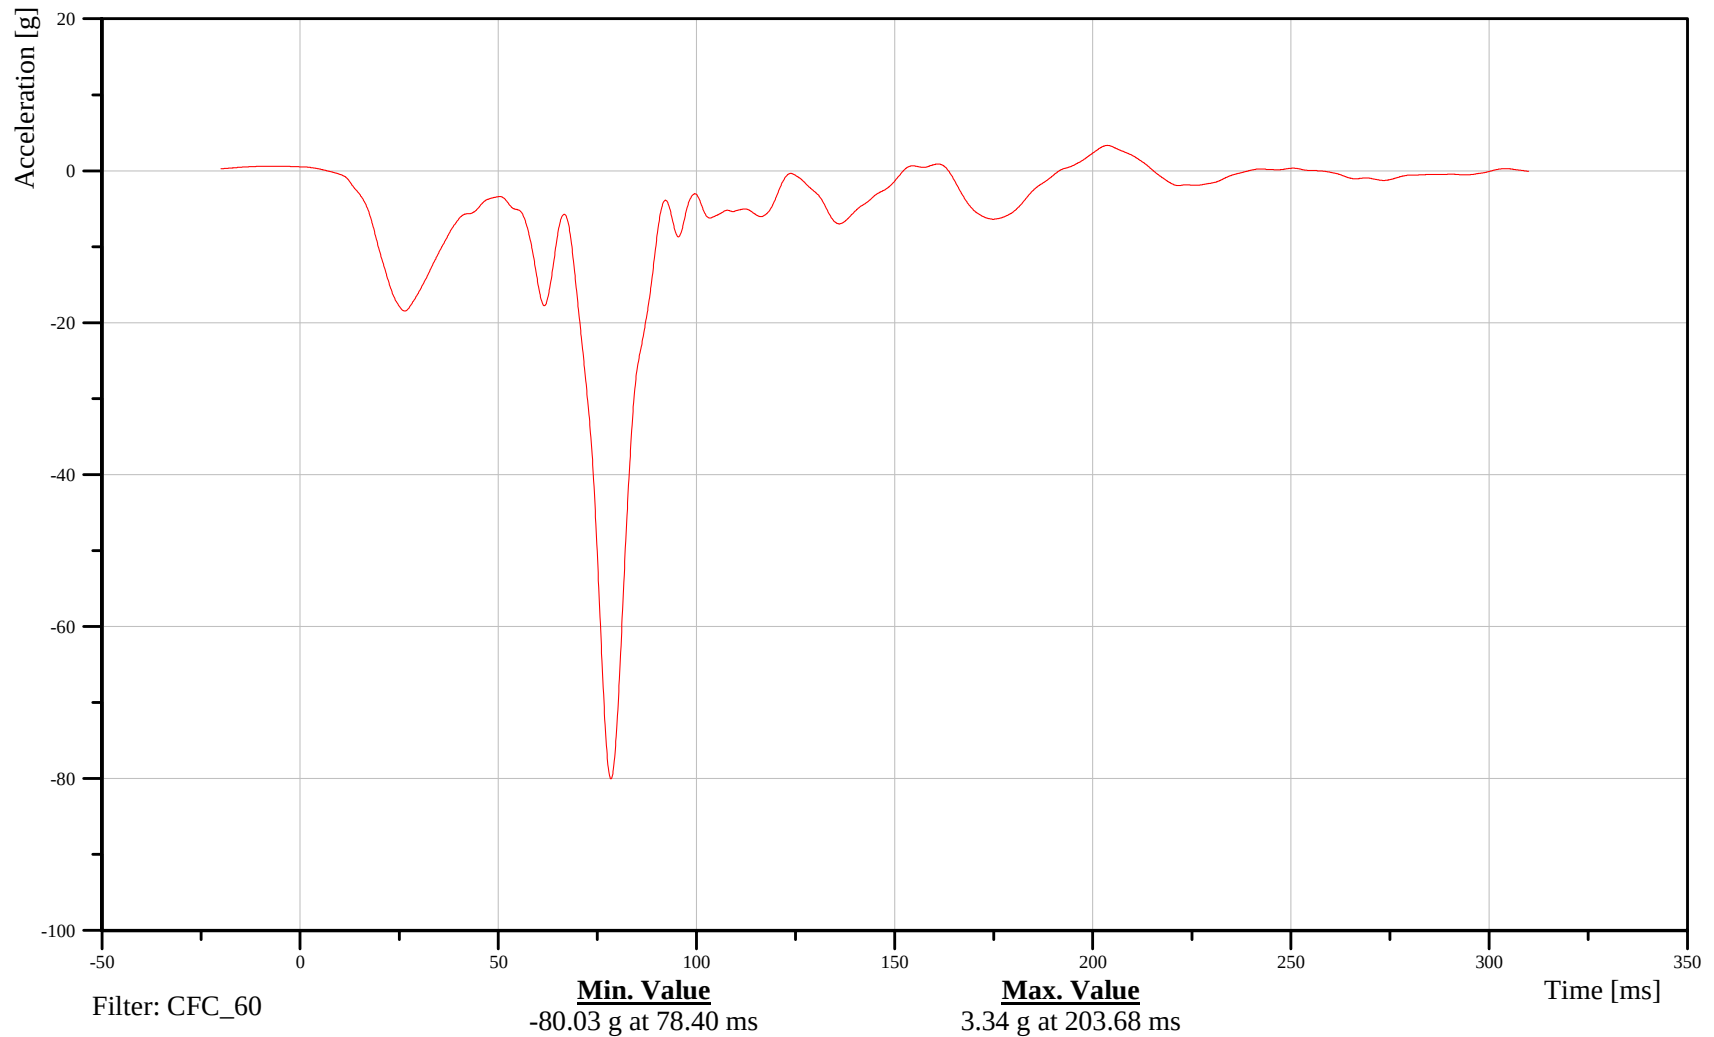

B-87

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Bottom of Engine Block X-Axis Acceleration

Customer: Volpe

12ENGNB00000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

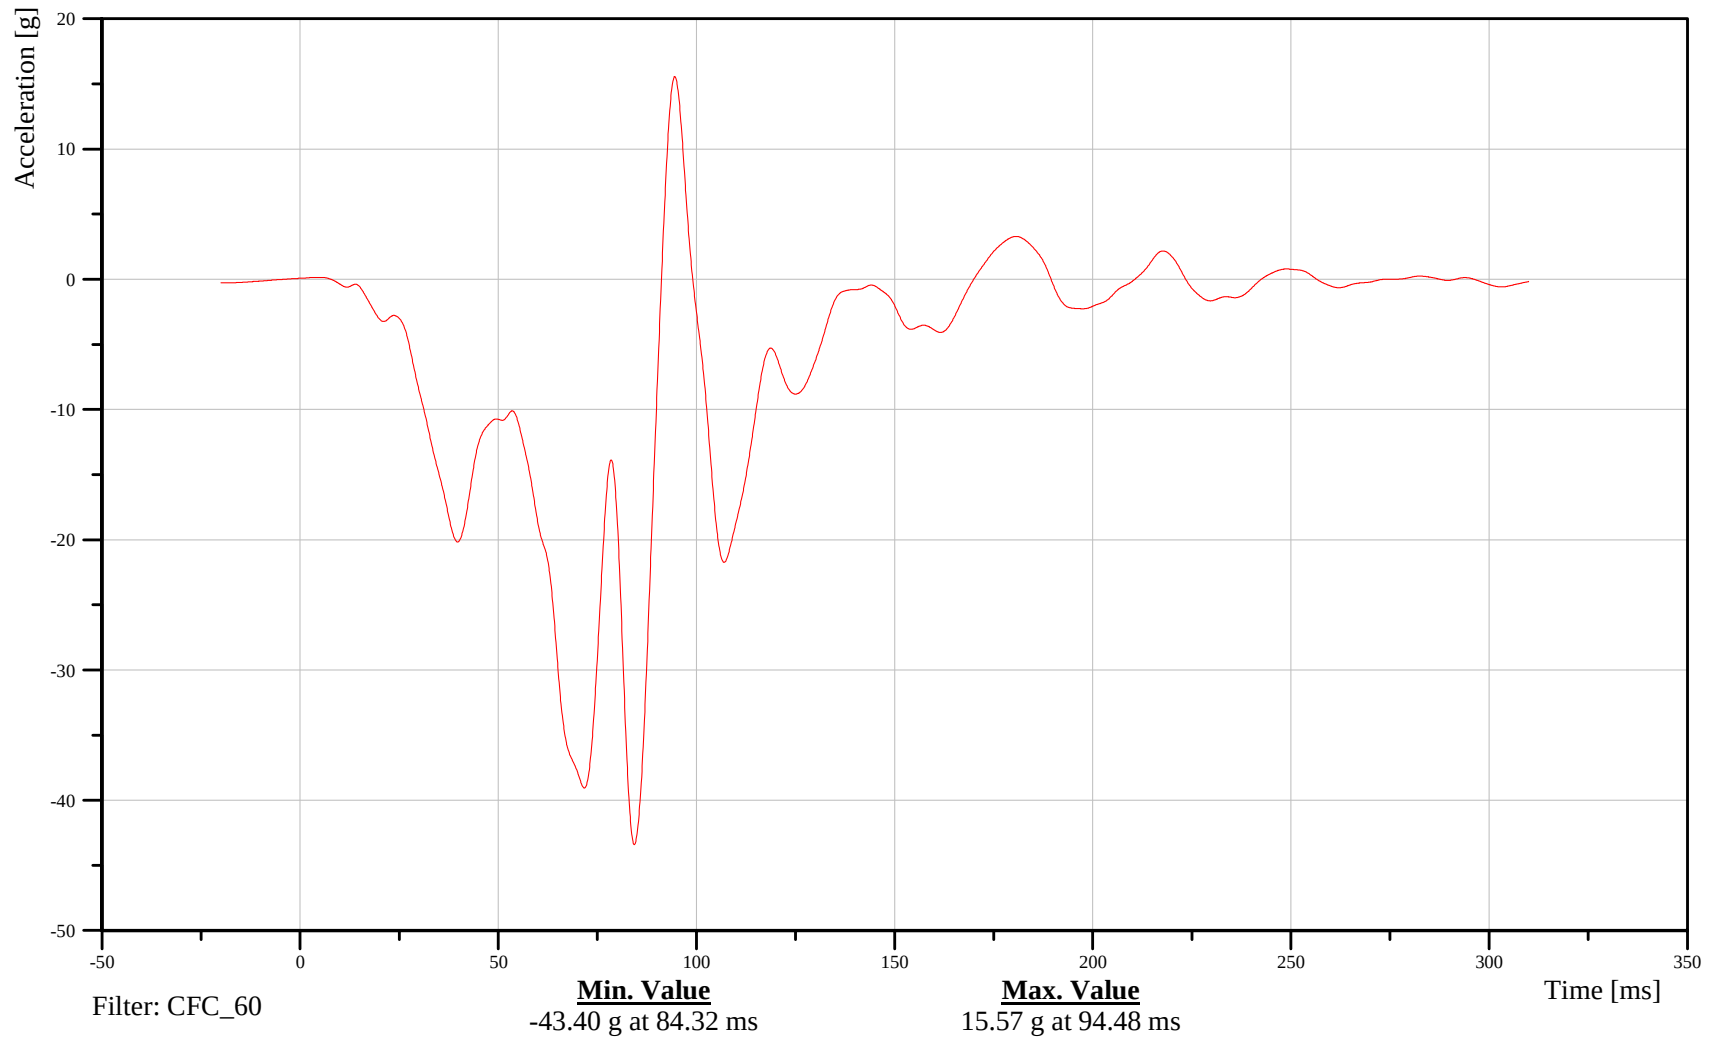

B-88

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Right Brake Caliper X-Axis Acceleration

Customer: Volpe

13VEHCRI0000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

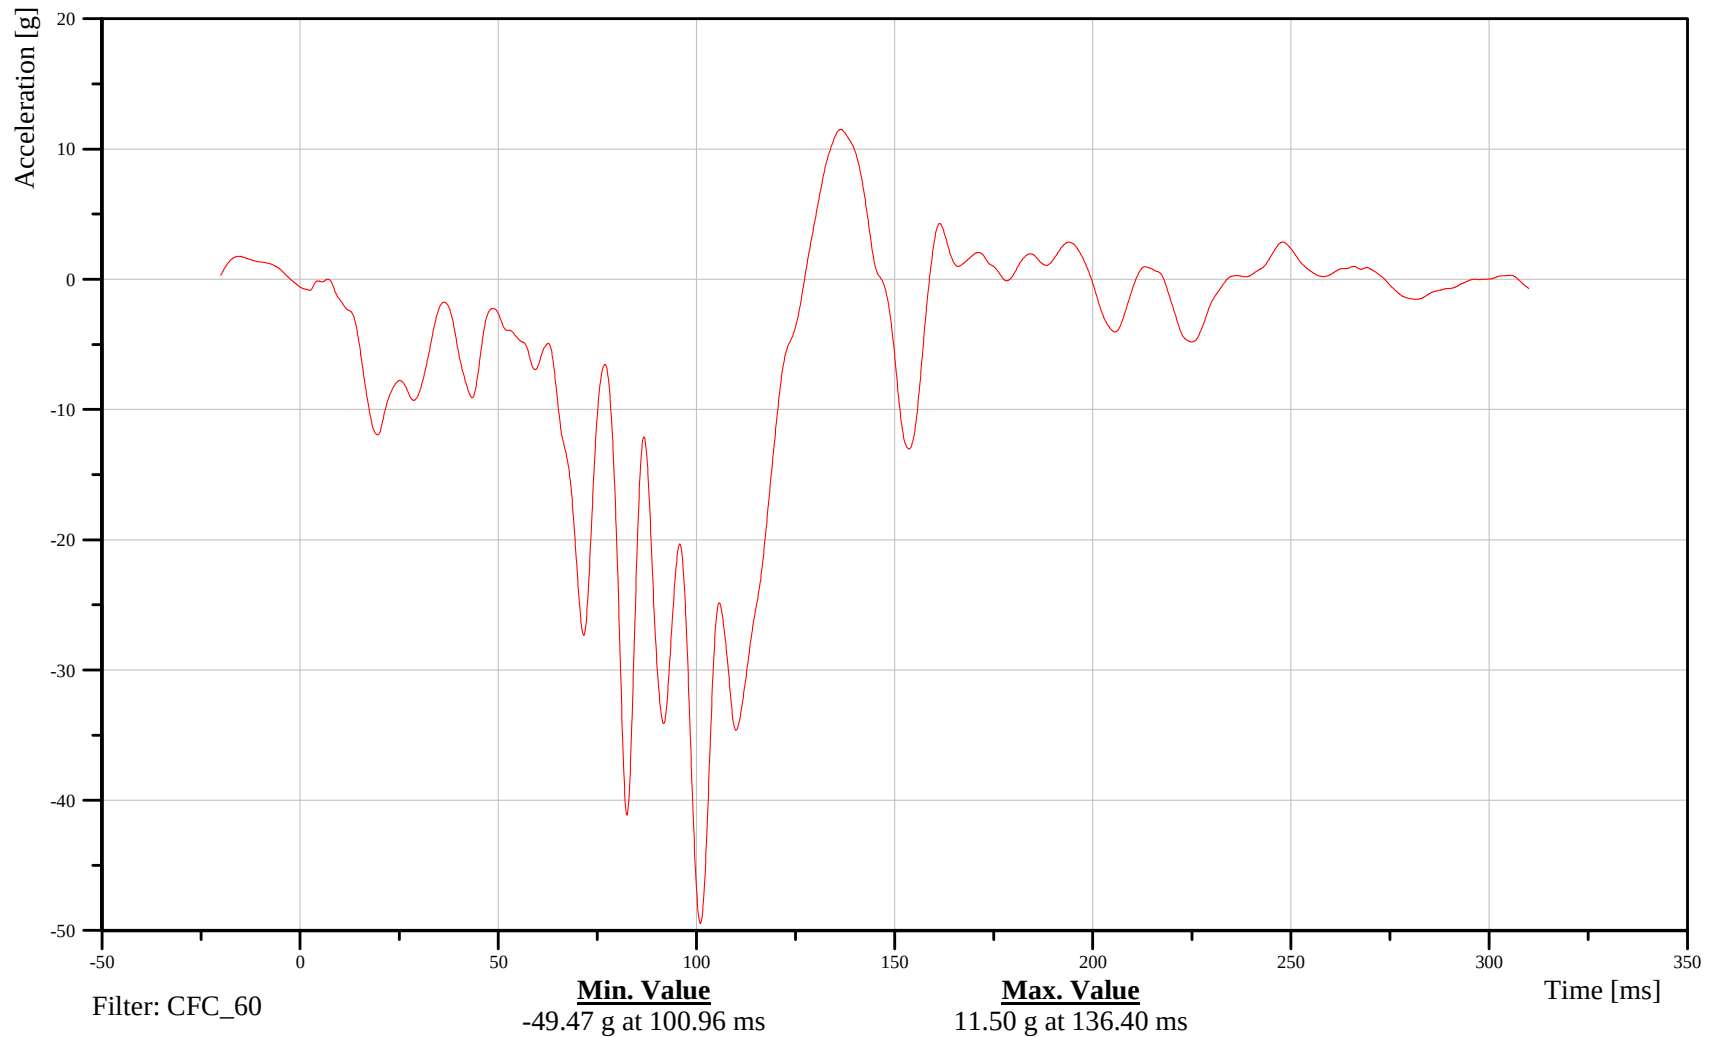

B-89

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Left Brake Caliper X-Axis Acceleration

Customer: Volpe

11VEHICLE0000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

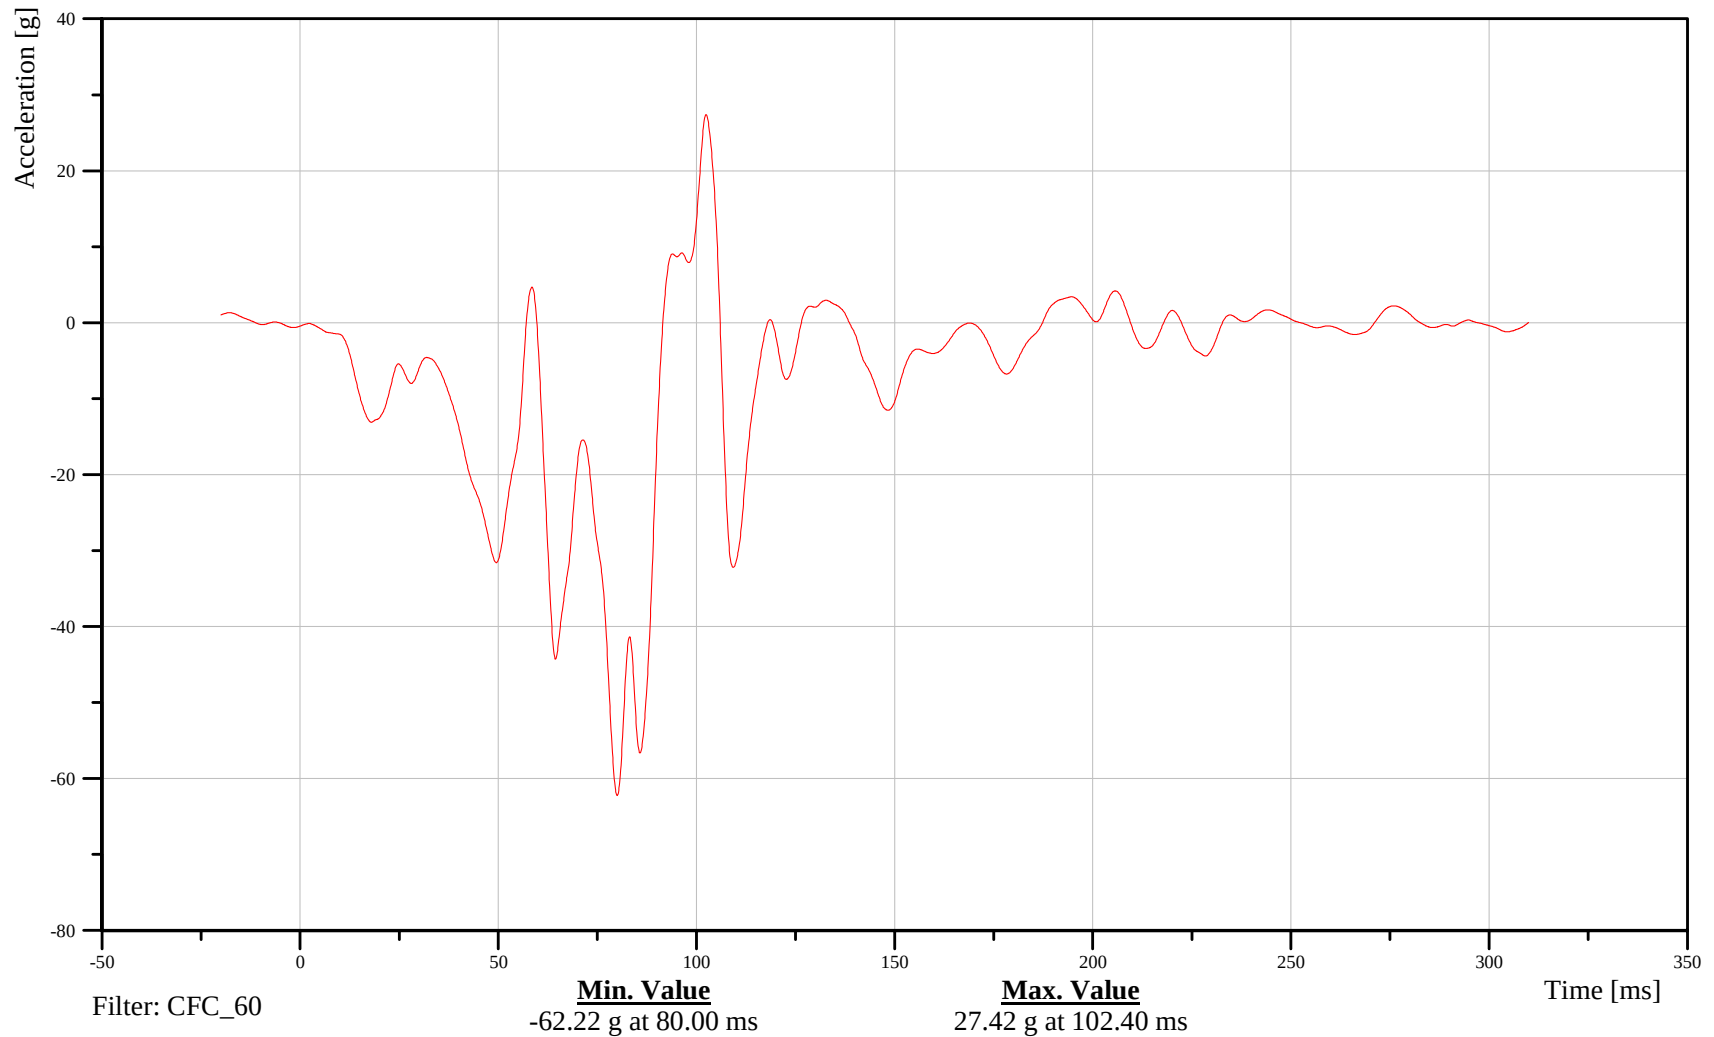

B-90

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Instrument Panel X-Axis Acceleration

Customer: Volpe

12DASH000000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

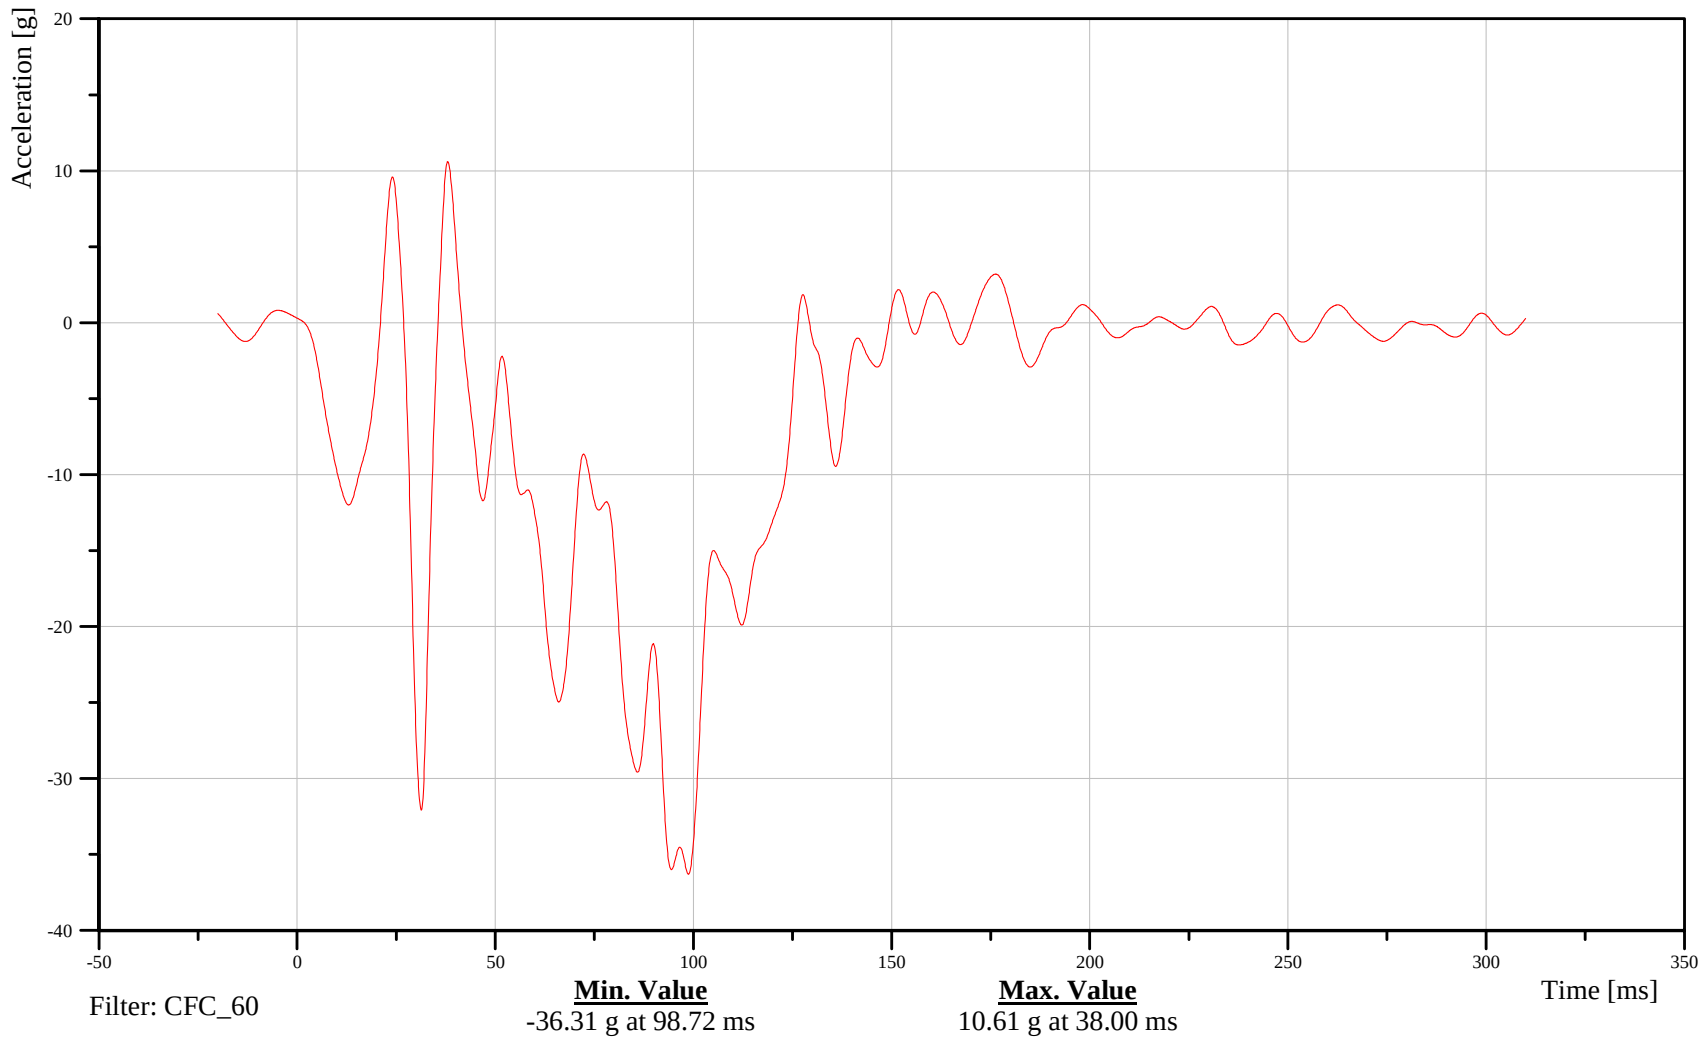

B-91

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Left Side Driver Mid Seat Track X-Axis Acceleration

Customer: Volpe

11SETR000000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

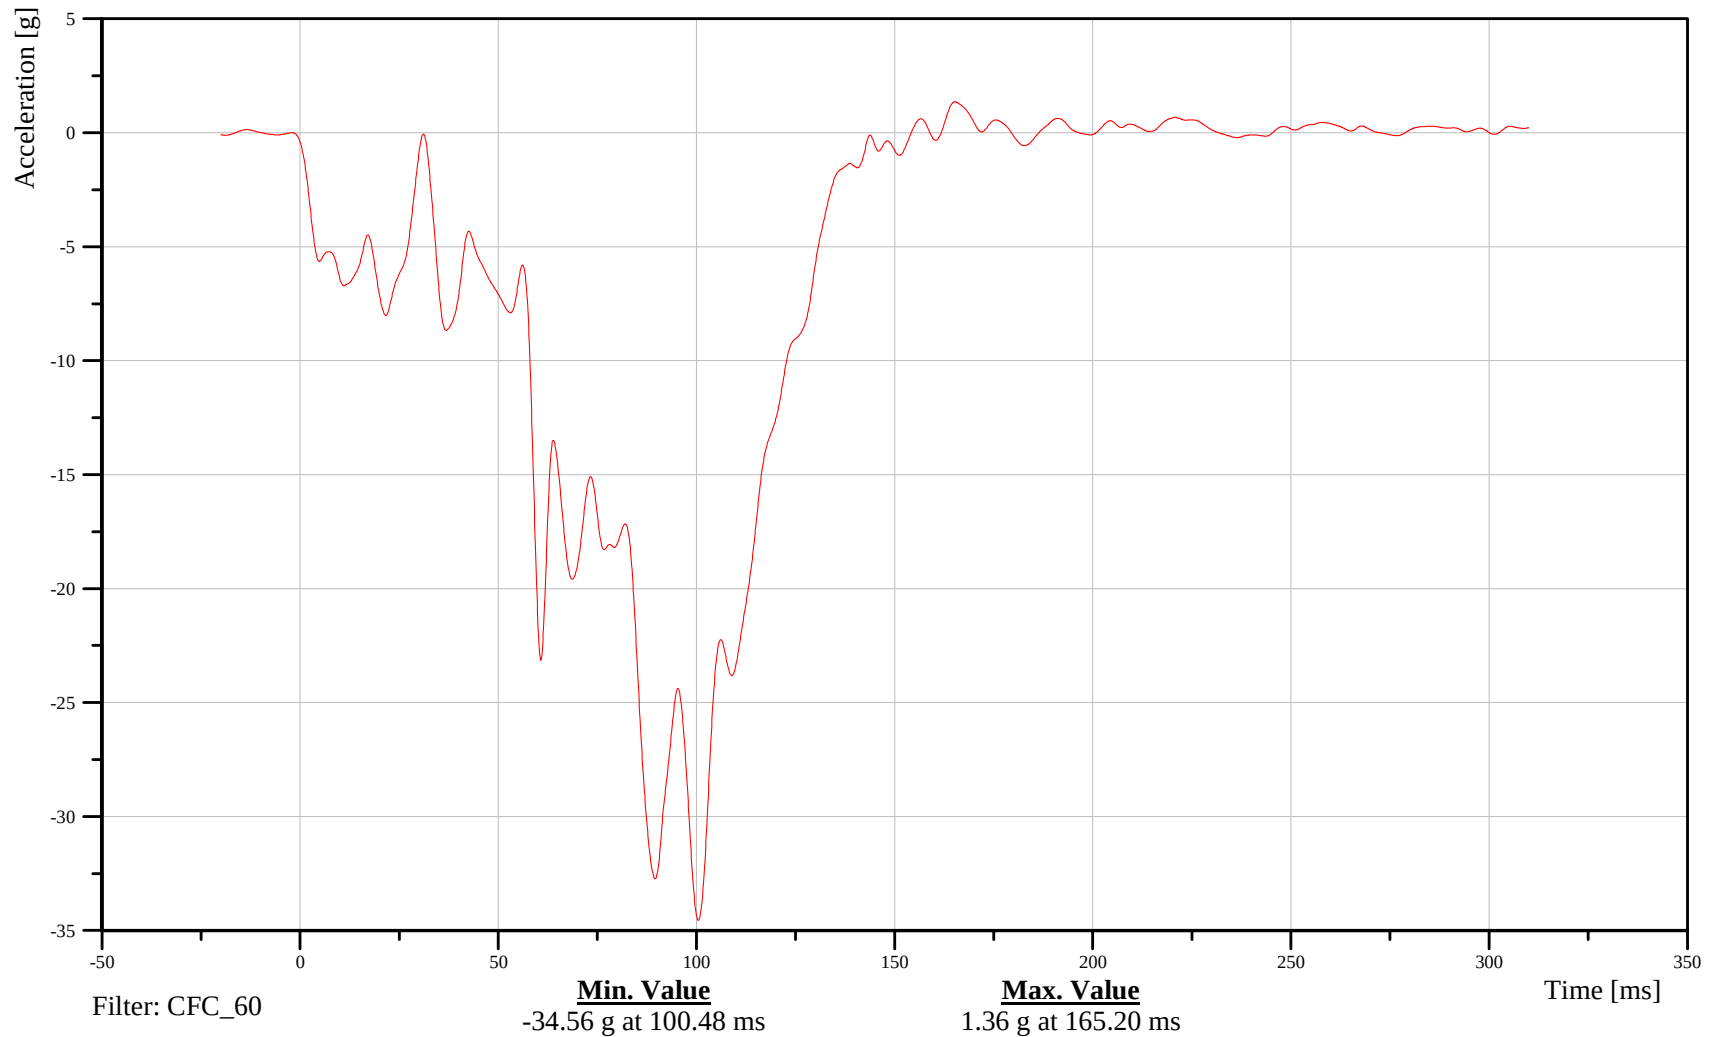

B-92

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG X-Axis Acceleration

Customer: Volpe

10VEHCCG0000ACXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

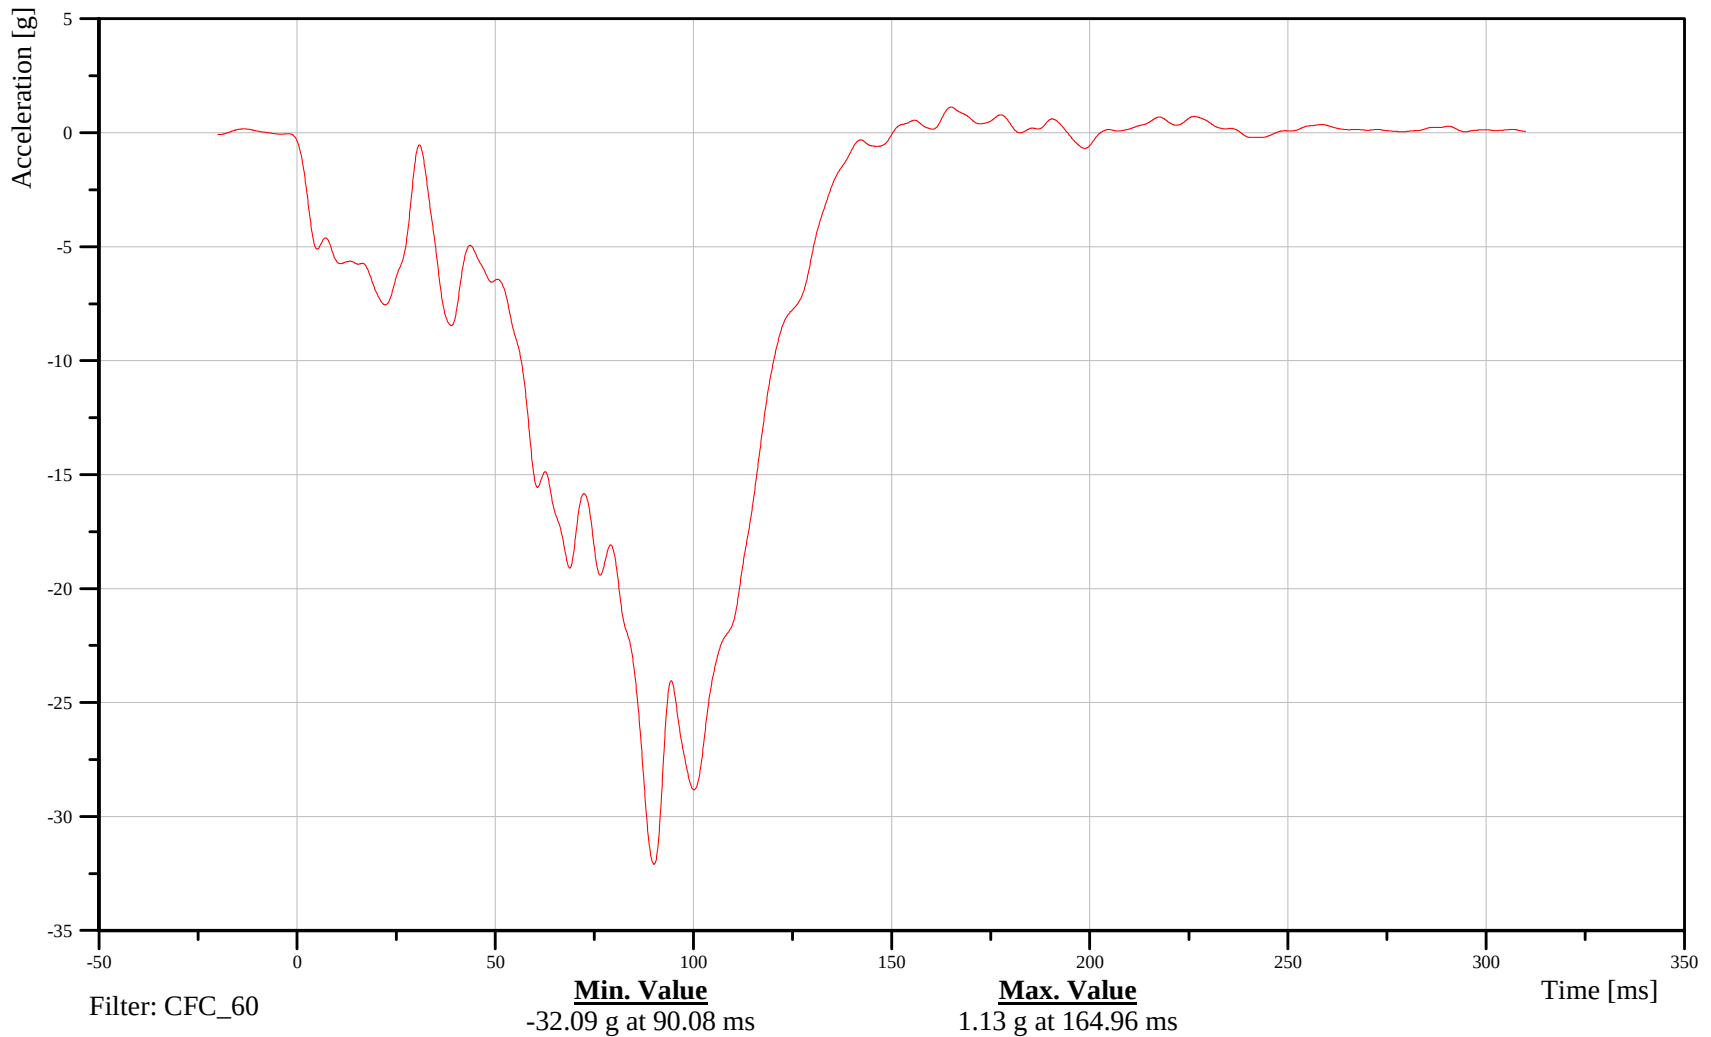

B-93

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG X-Axis Velocity

Customer: Volpe

10VEHCCG0000VEXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

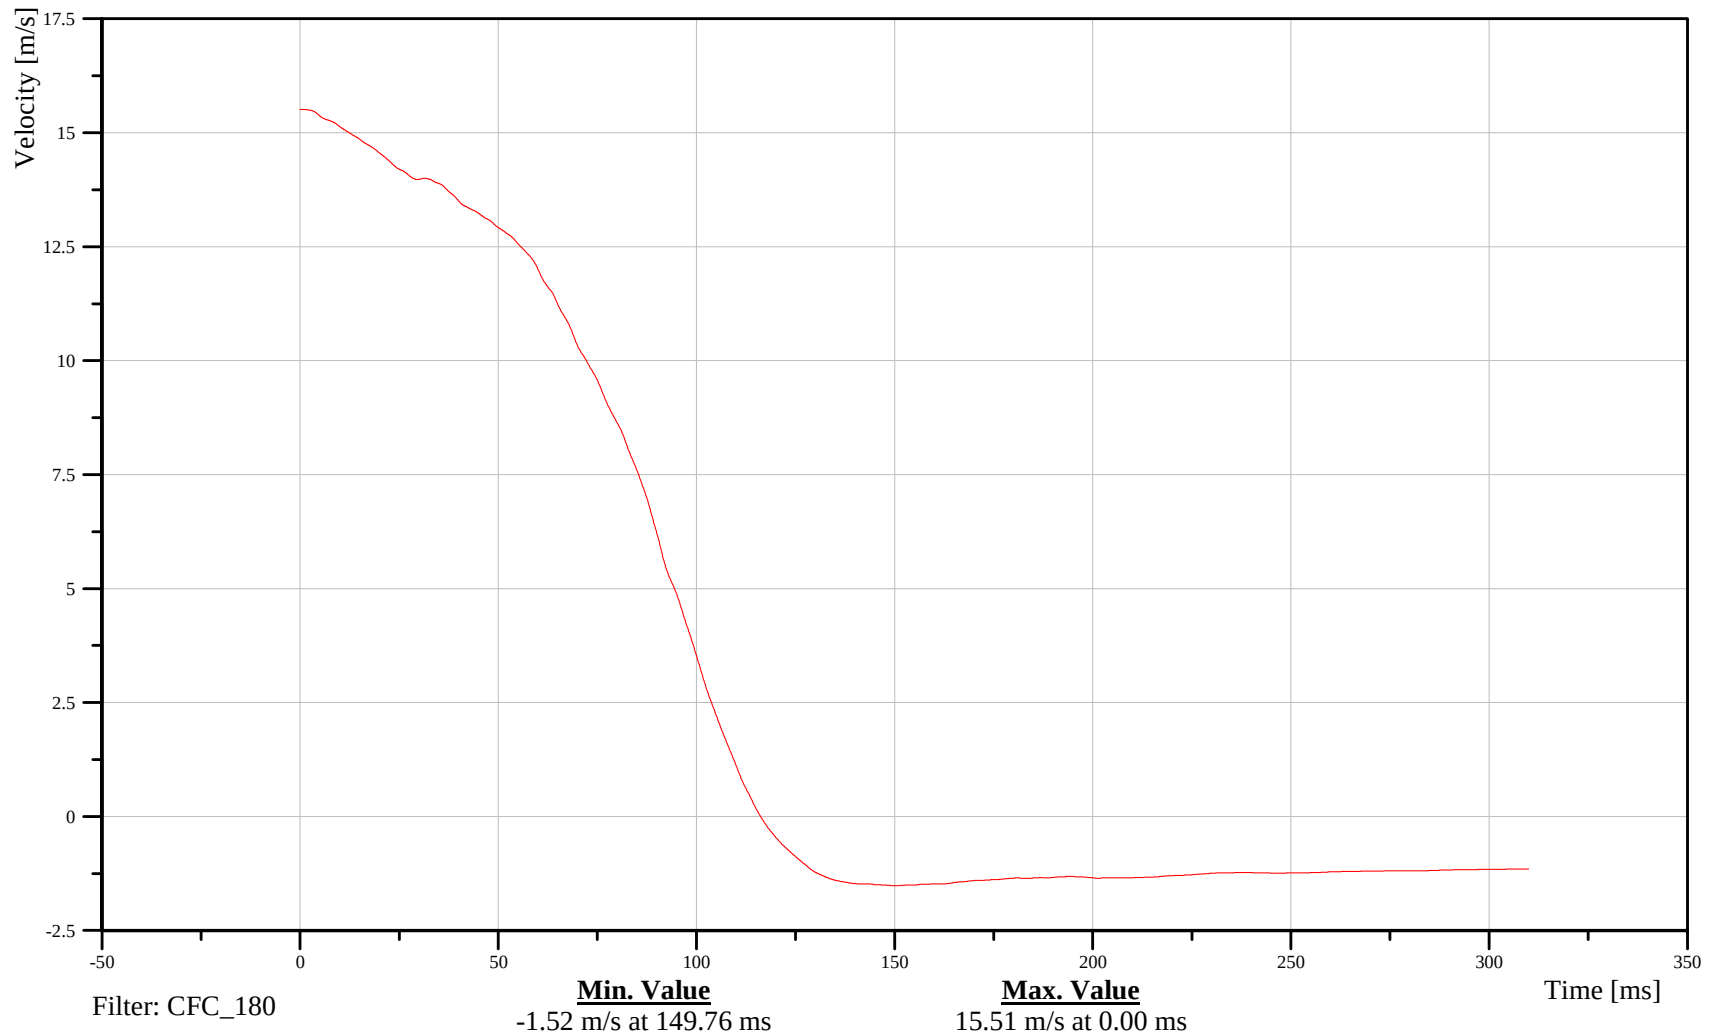

B-94

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG X-Axis Displacement

Customer: Volpe

10VEHCCG0000DCXC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

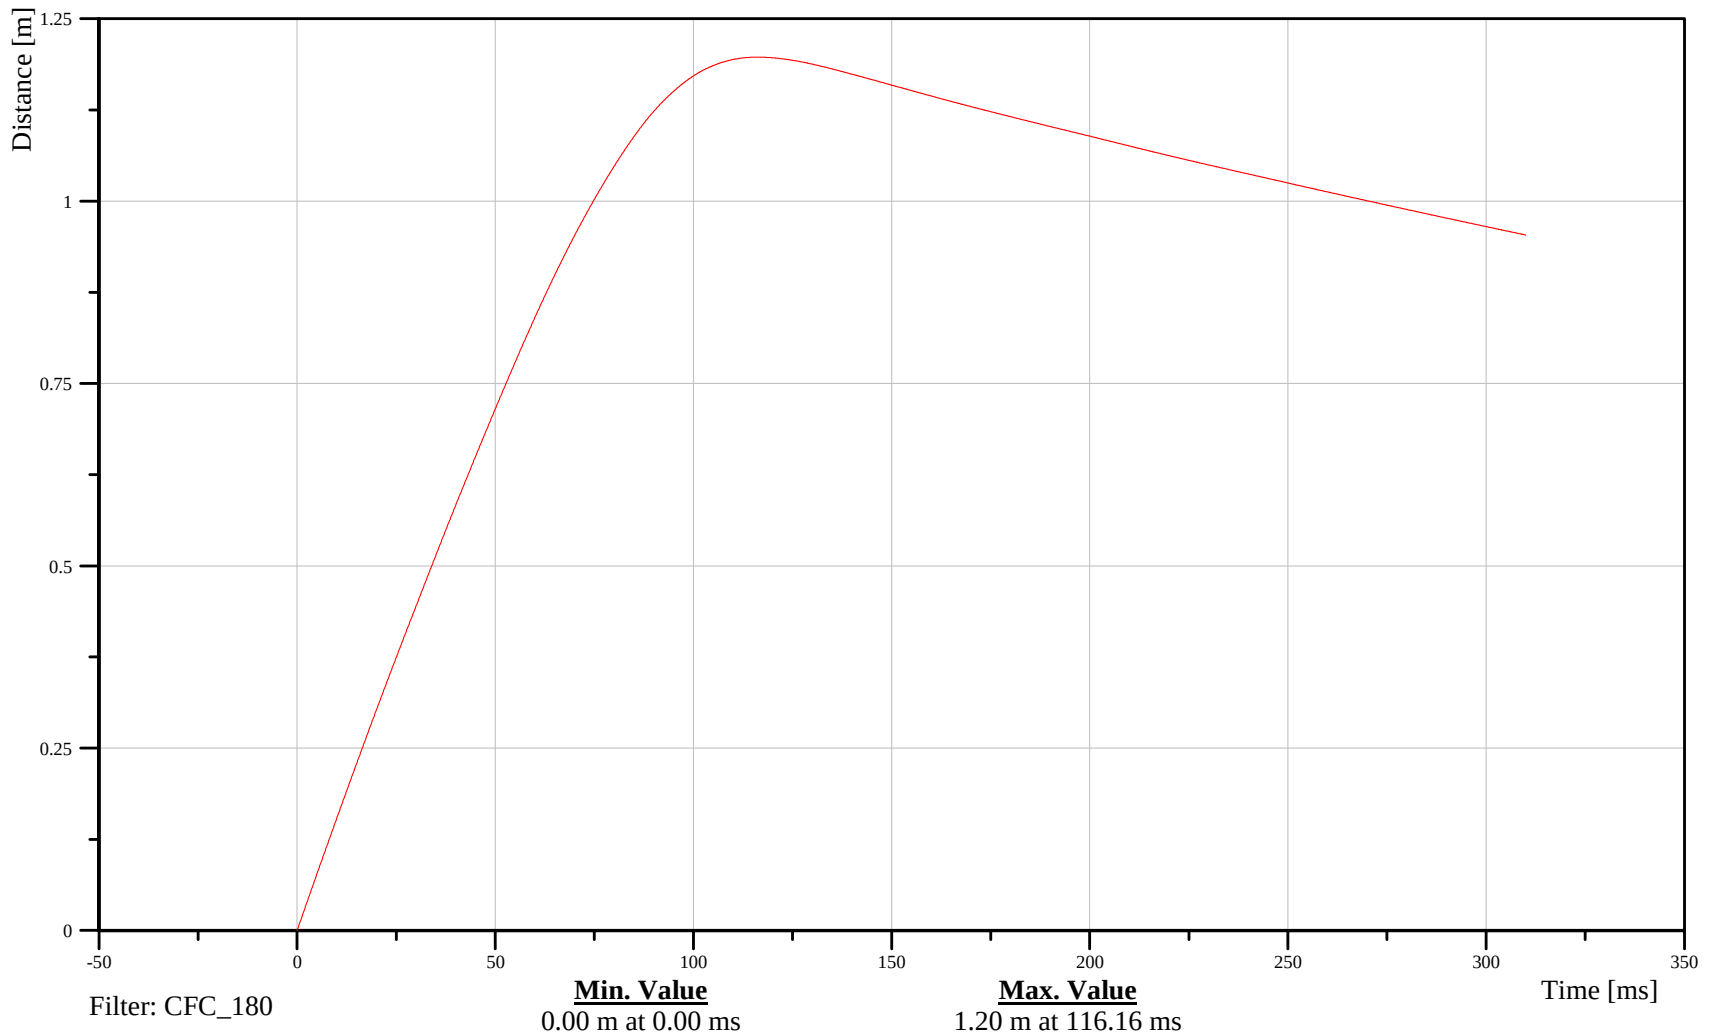

B-95

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Y-Axis Acceleration

Customer: Volpe

10VEHCCG0000ACYD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

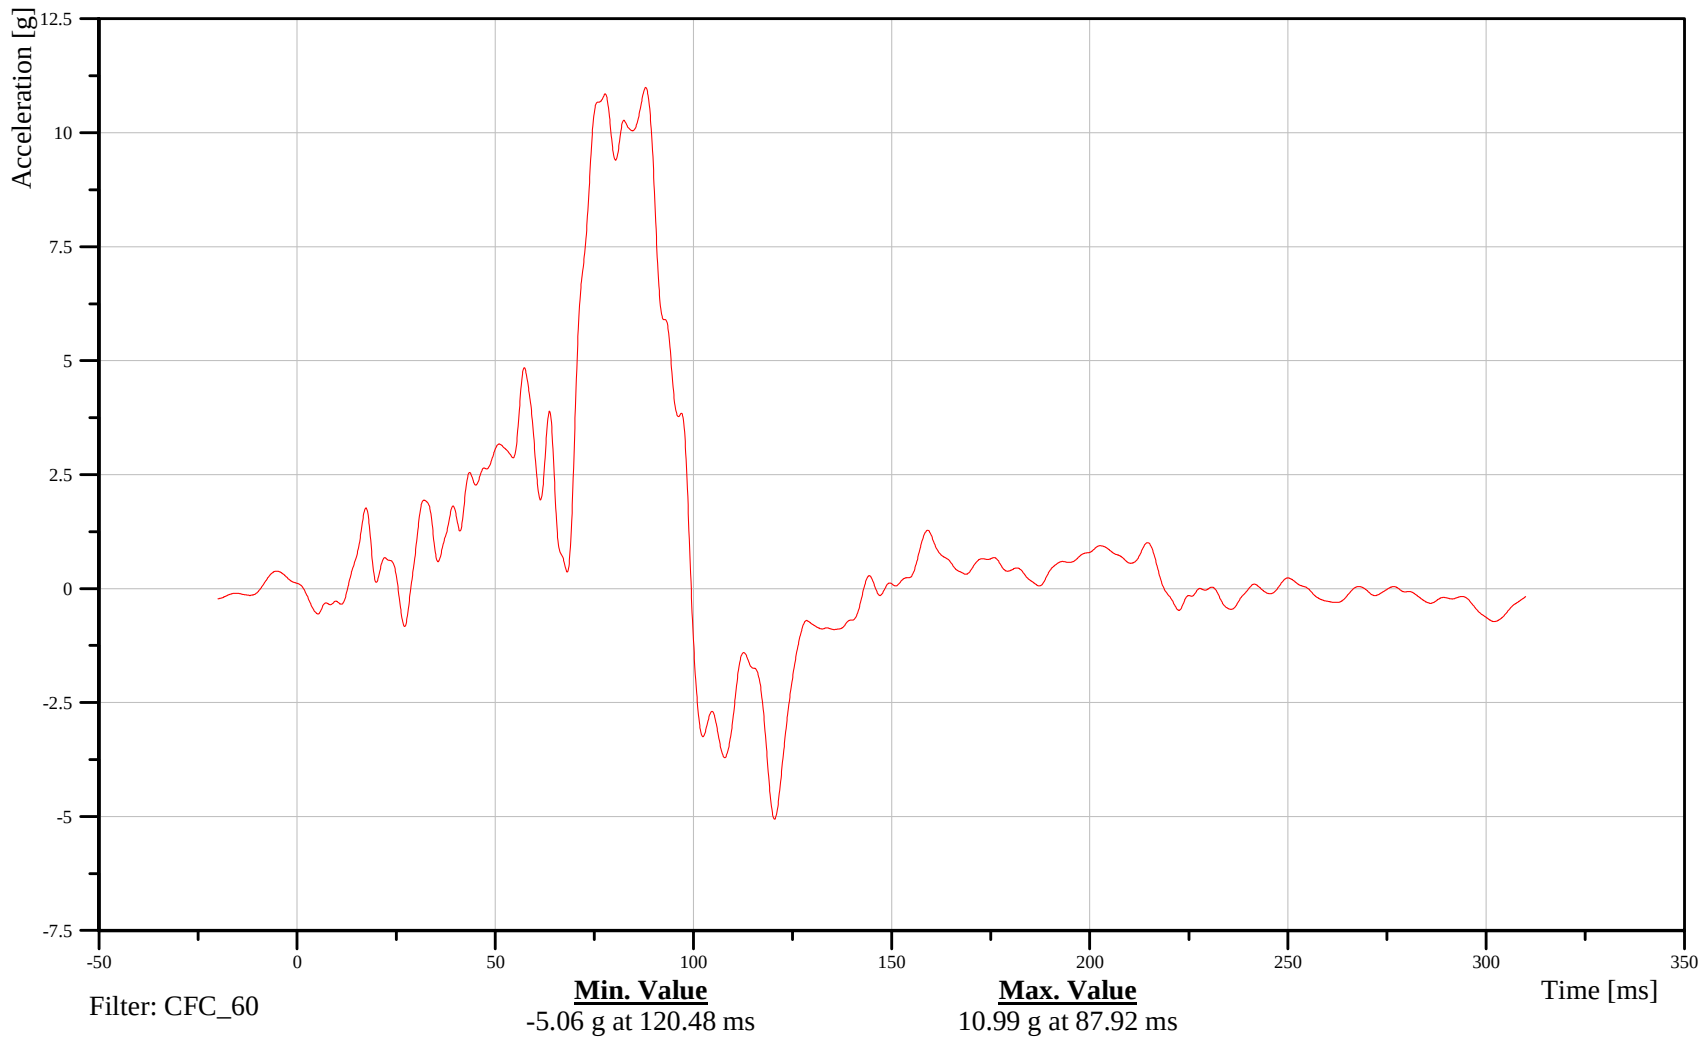

B-96

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Y-Axis Velocity

Customer: Volpe

10VEHCCG0000VEYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

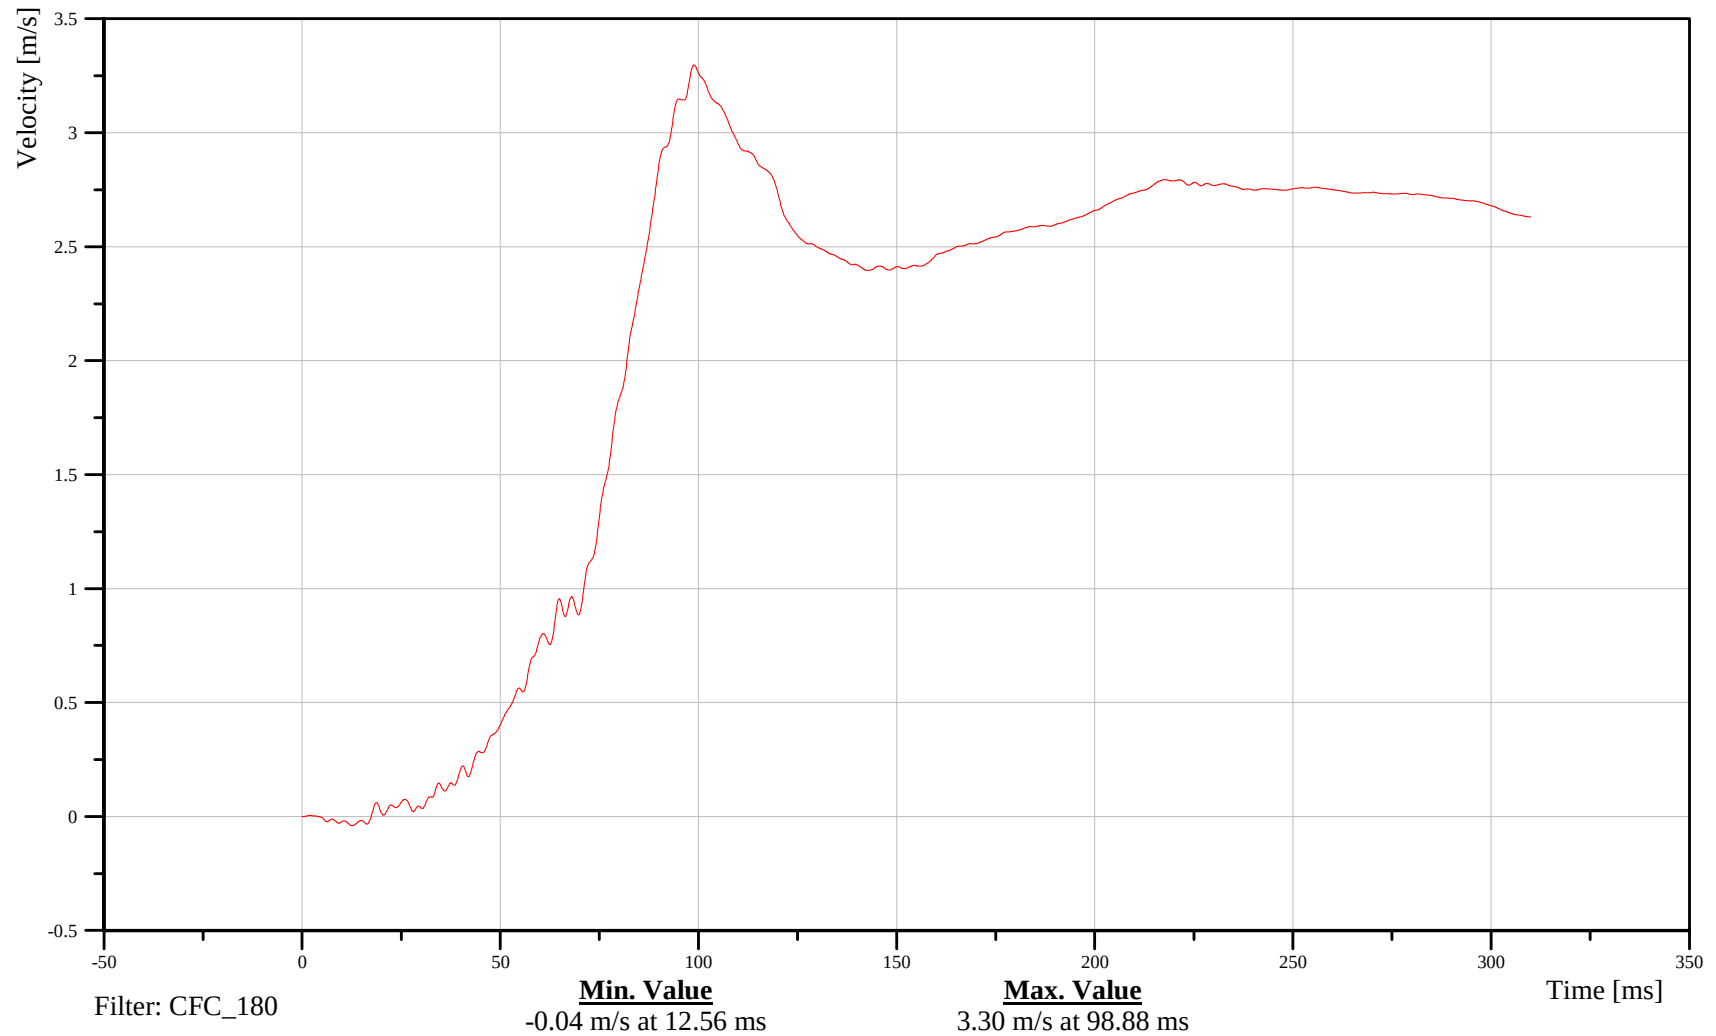

B-97

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Y-Axis Displacement

Customer: Volpe

10VEHCCG0000DCYC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

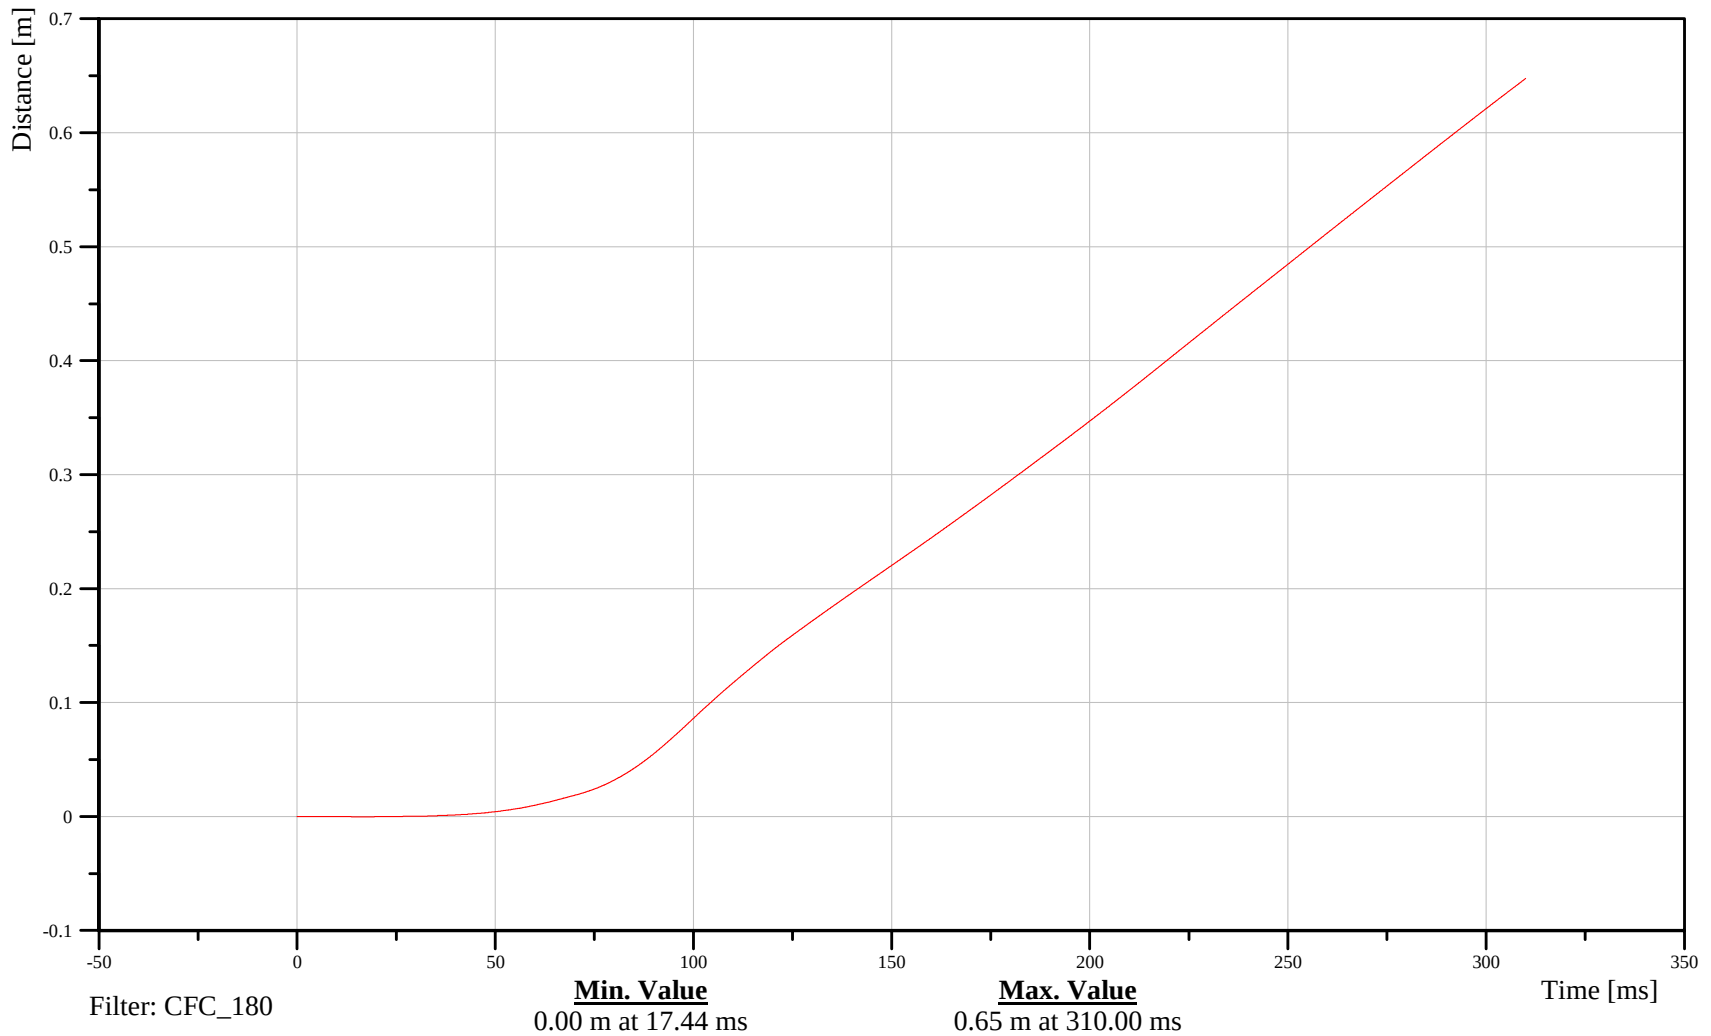

B-98

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Z-Axis Acceleration

Customer: Volpe

10VEHCCG0000ACZD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

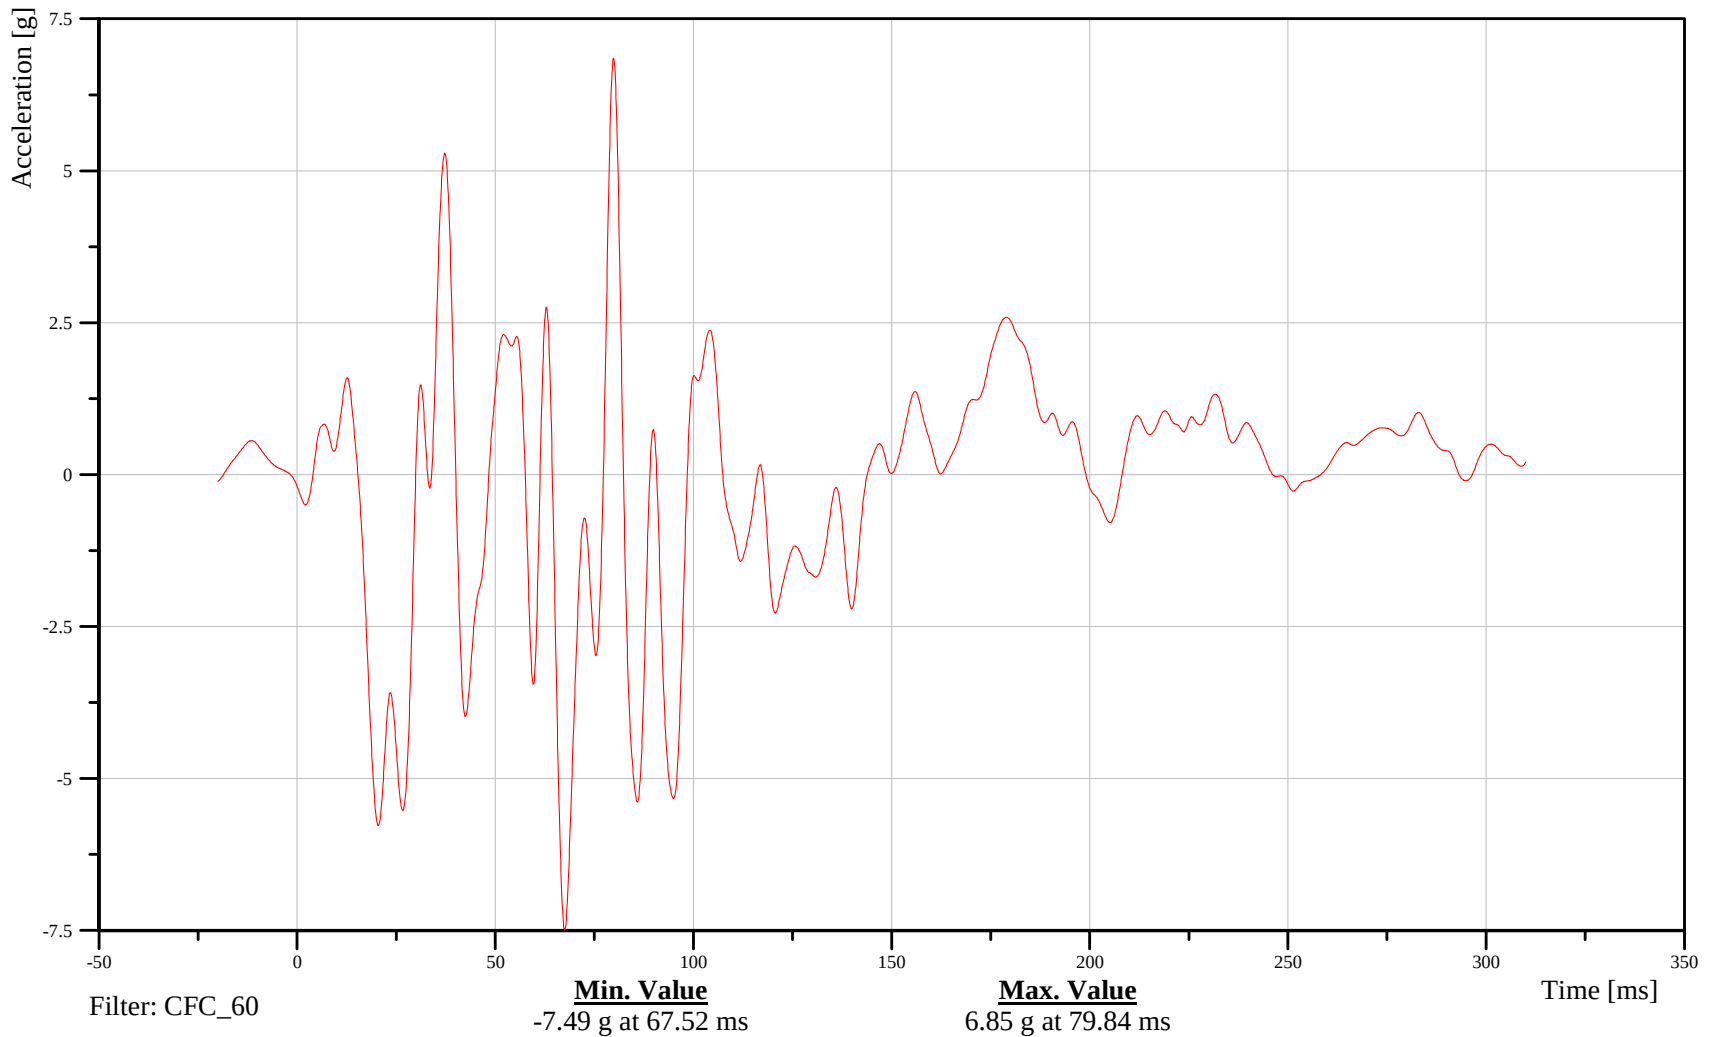

B-99

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Z-Axis Velocity

Customer: Volpe

10VEHCCG0000VEZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

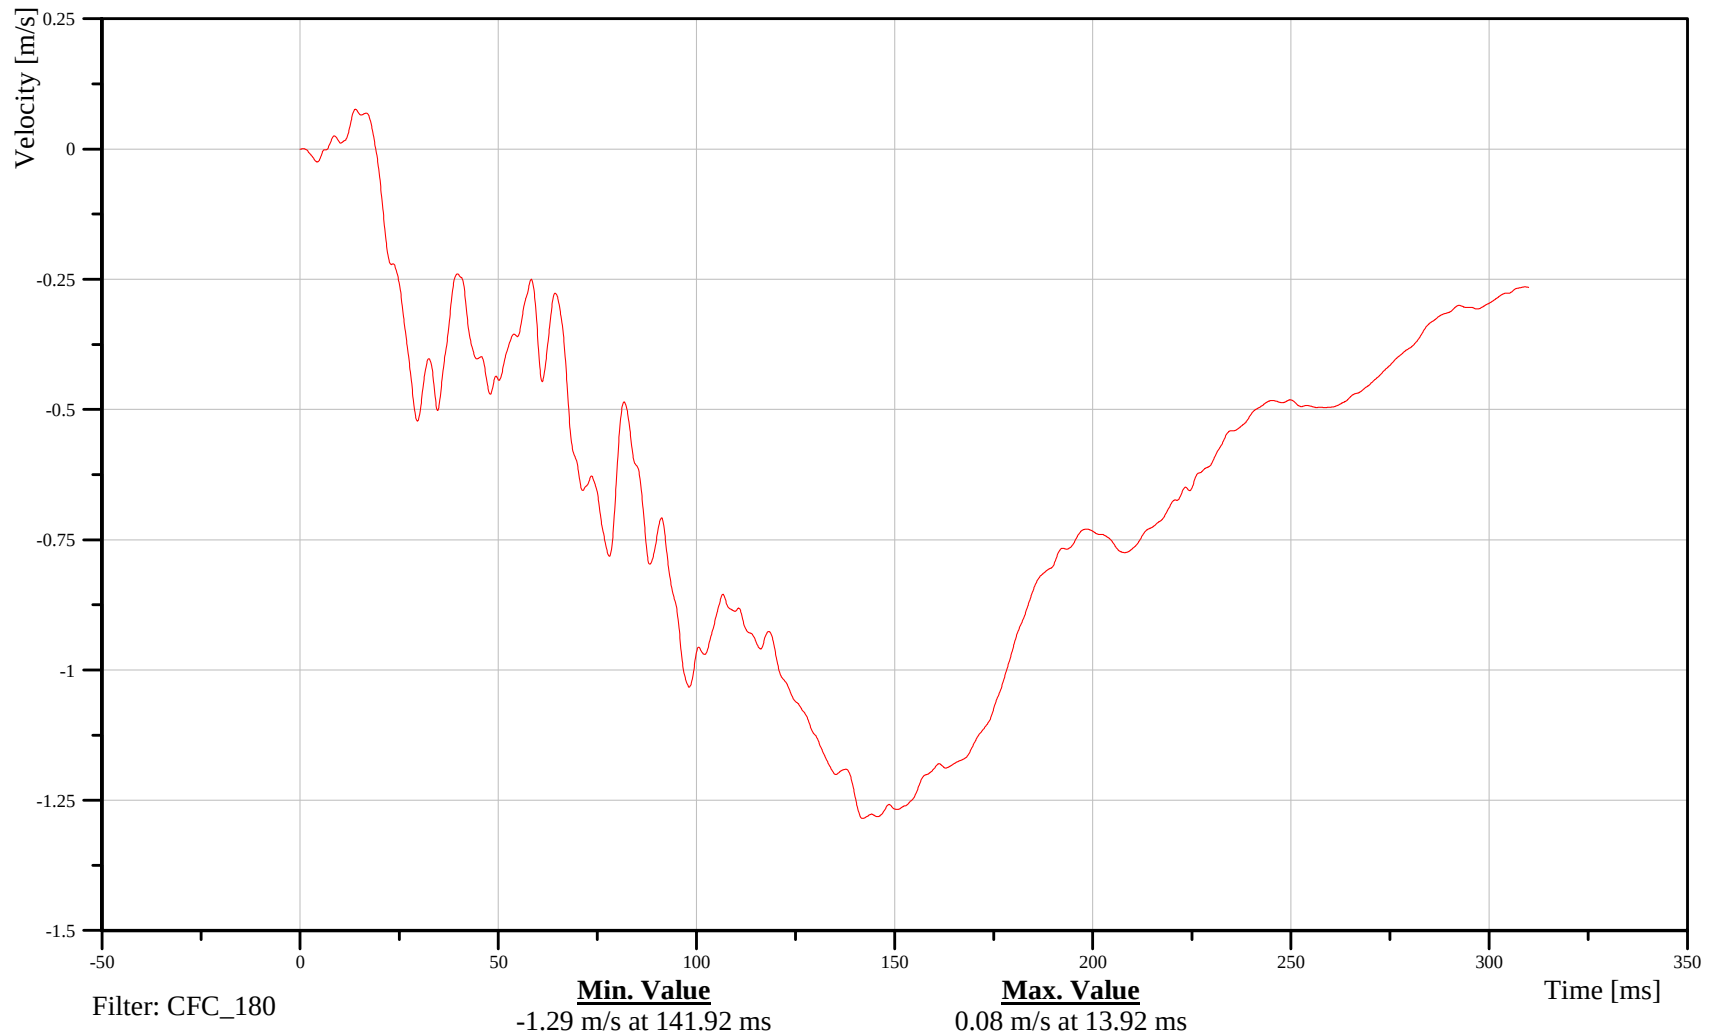

B-100

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Z-Axis Displacement

Customer: Volpe

10VEHCCG0000DCZC

TRC Inc. Test Lab: CTF

Test Number: 060630-2

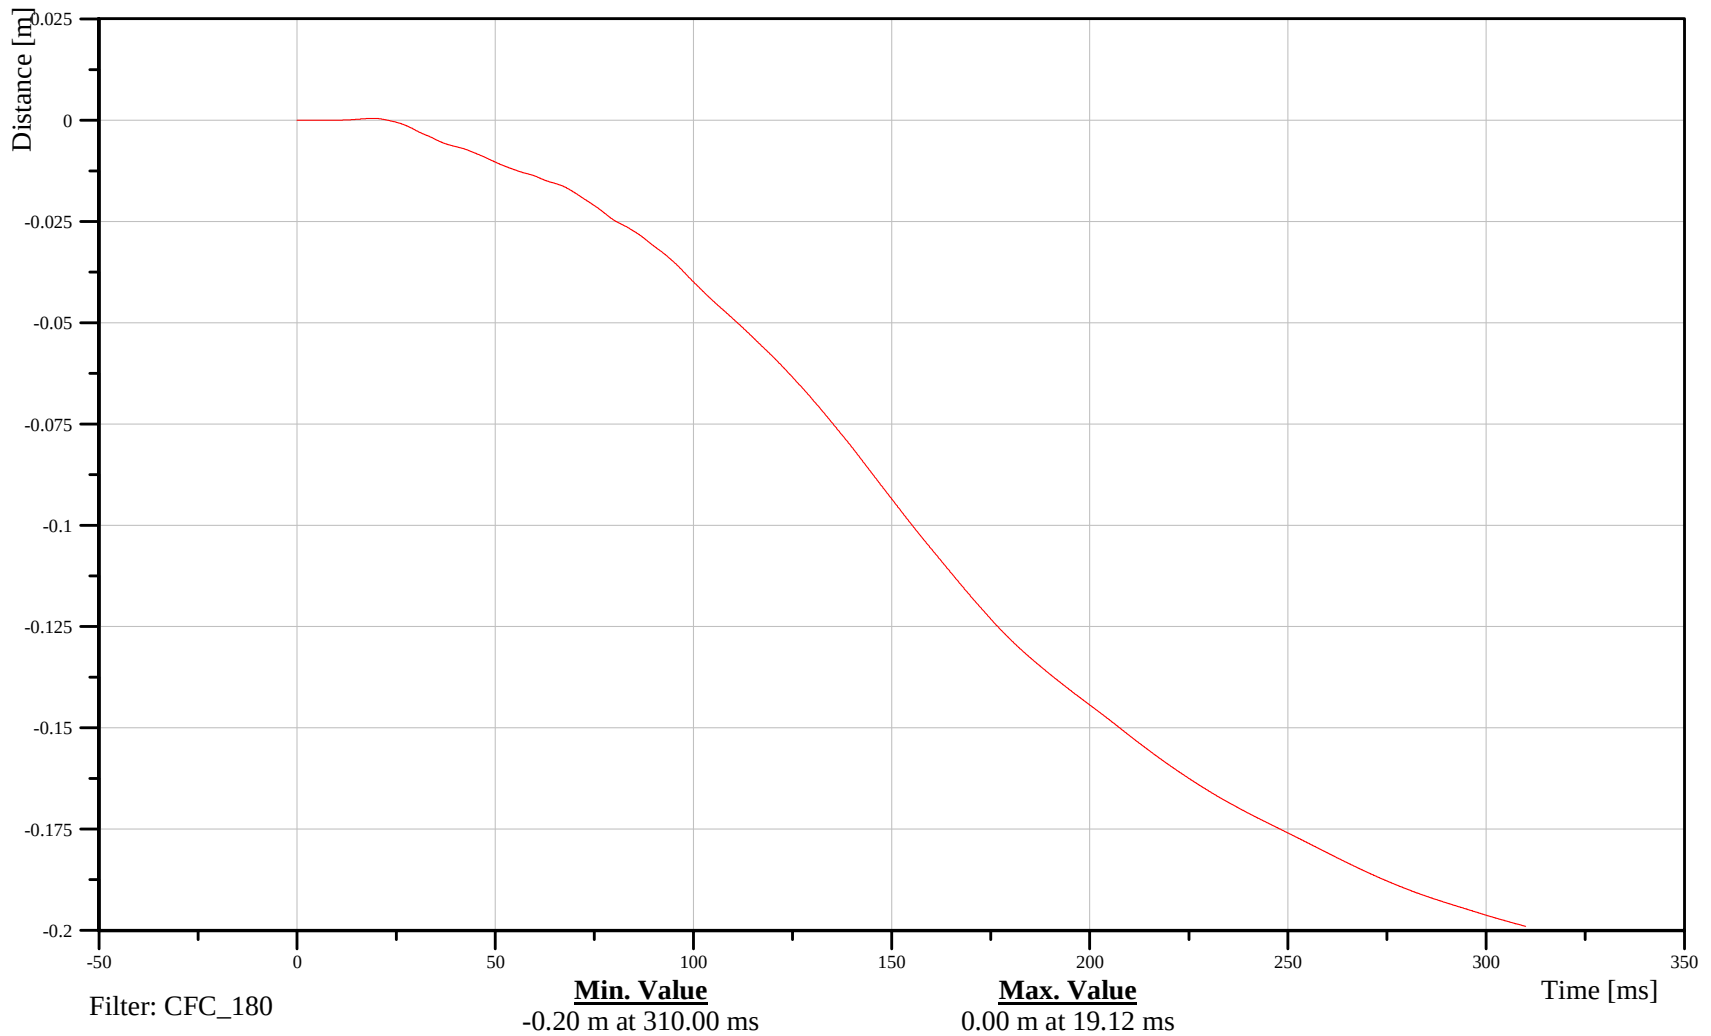

B-101

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Vehicle CG Resultant Acceleration

Customer: Volpe

10VEHCCG0000ACRD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

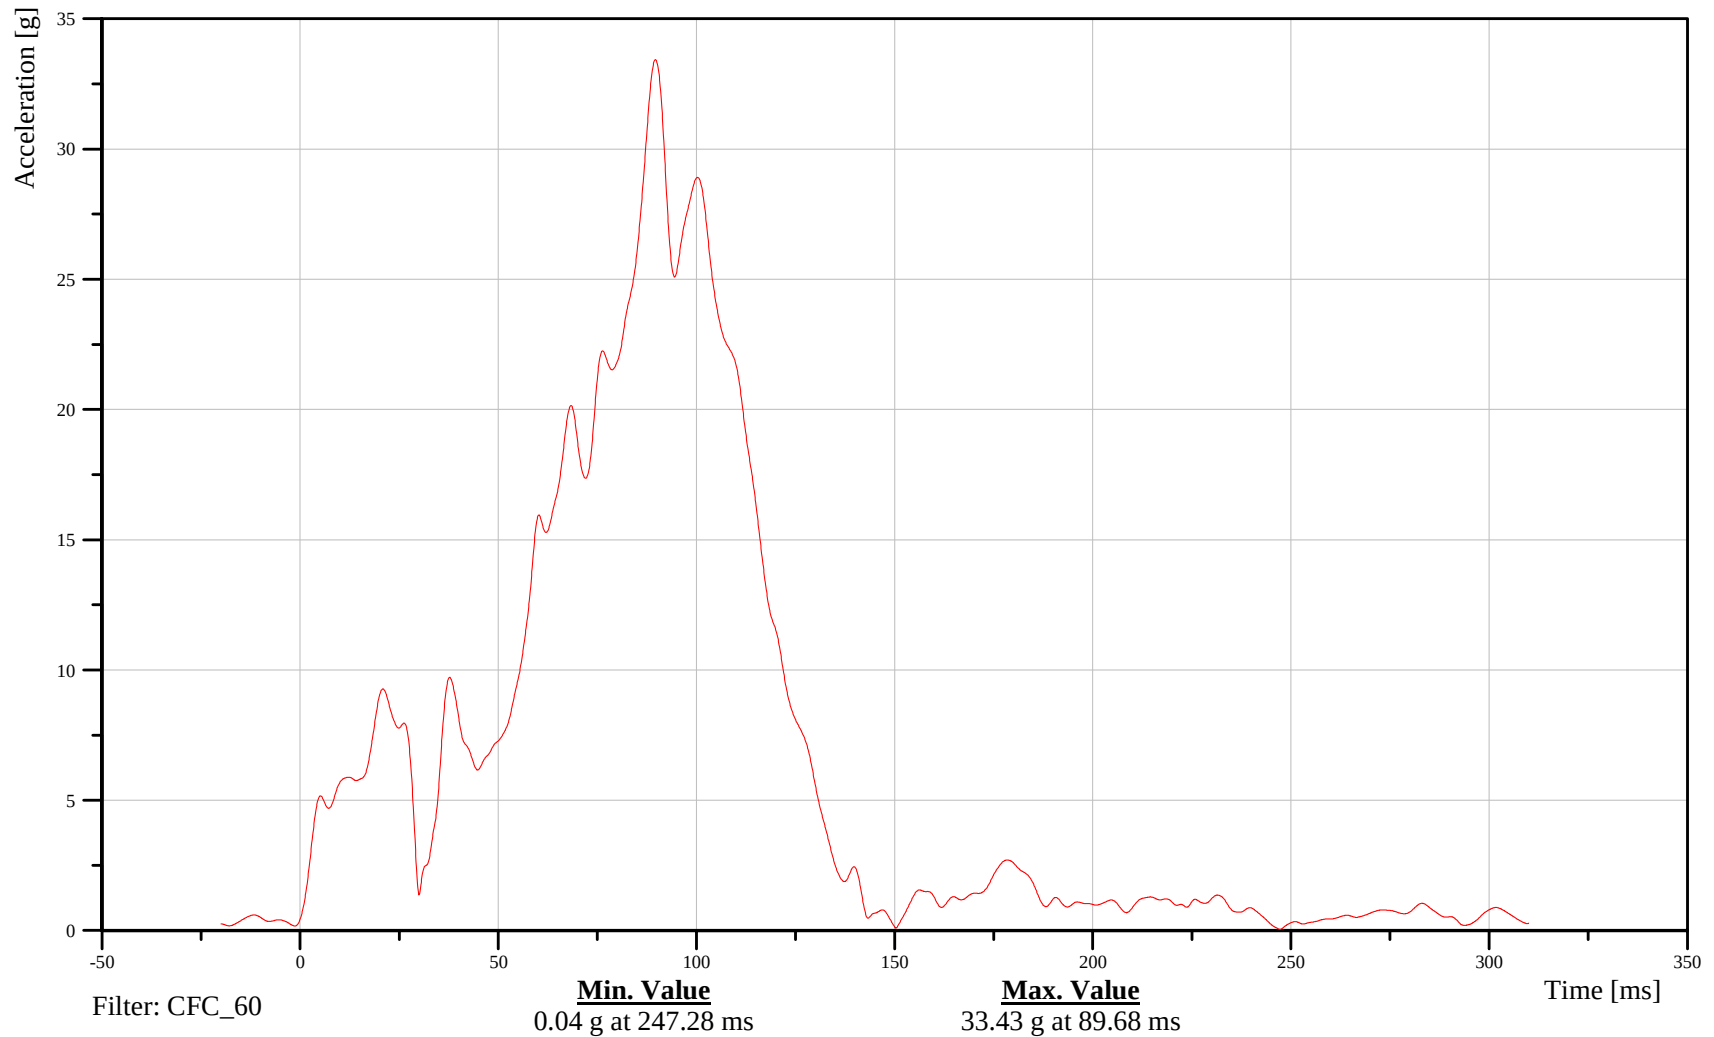

B-102

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Driver Front Airbag 1 Ind

Customer: Volpe

11AIRBFR0100EV0A

TRC Inc. Test Lab: CTF

Test Number: 060630-2

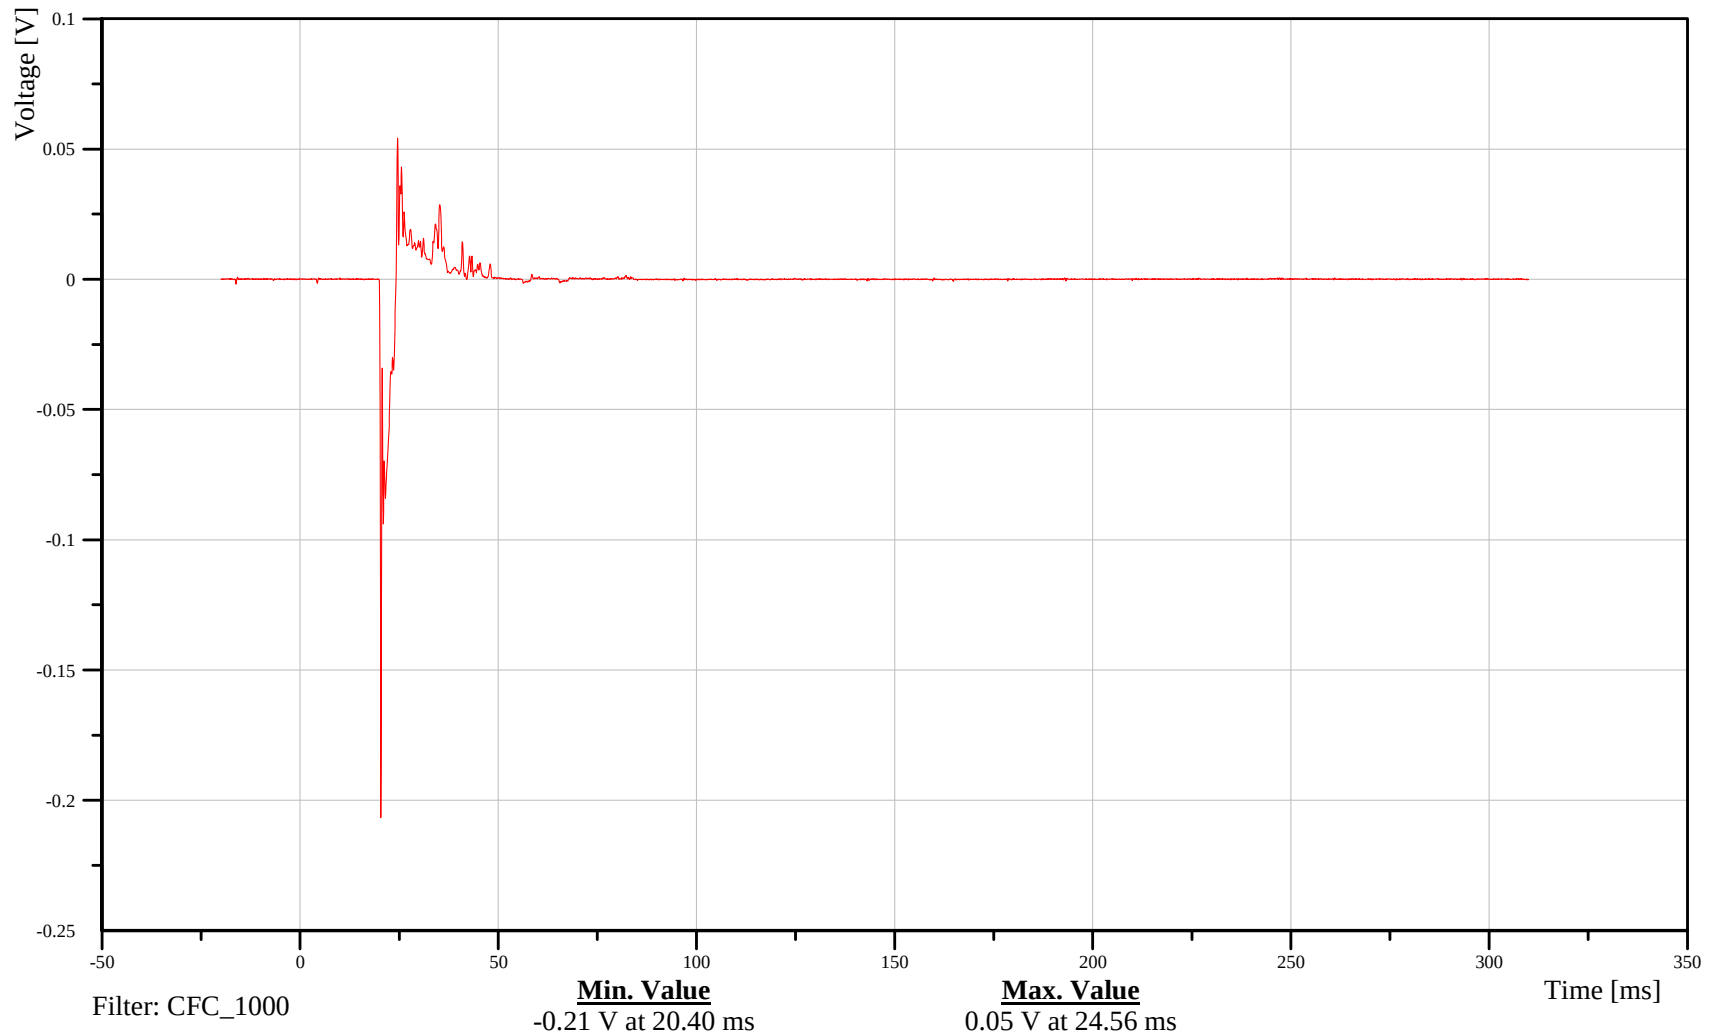

B-103

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Driver Front Airbag 2 Ind

Customer: Volpe

11AIRBFR0200EV0A

TRC Inc. Test Lab: CTF

Test Number: 060630-2

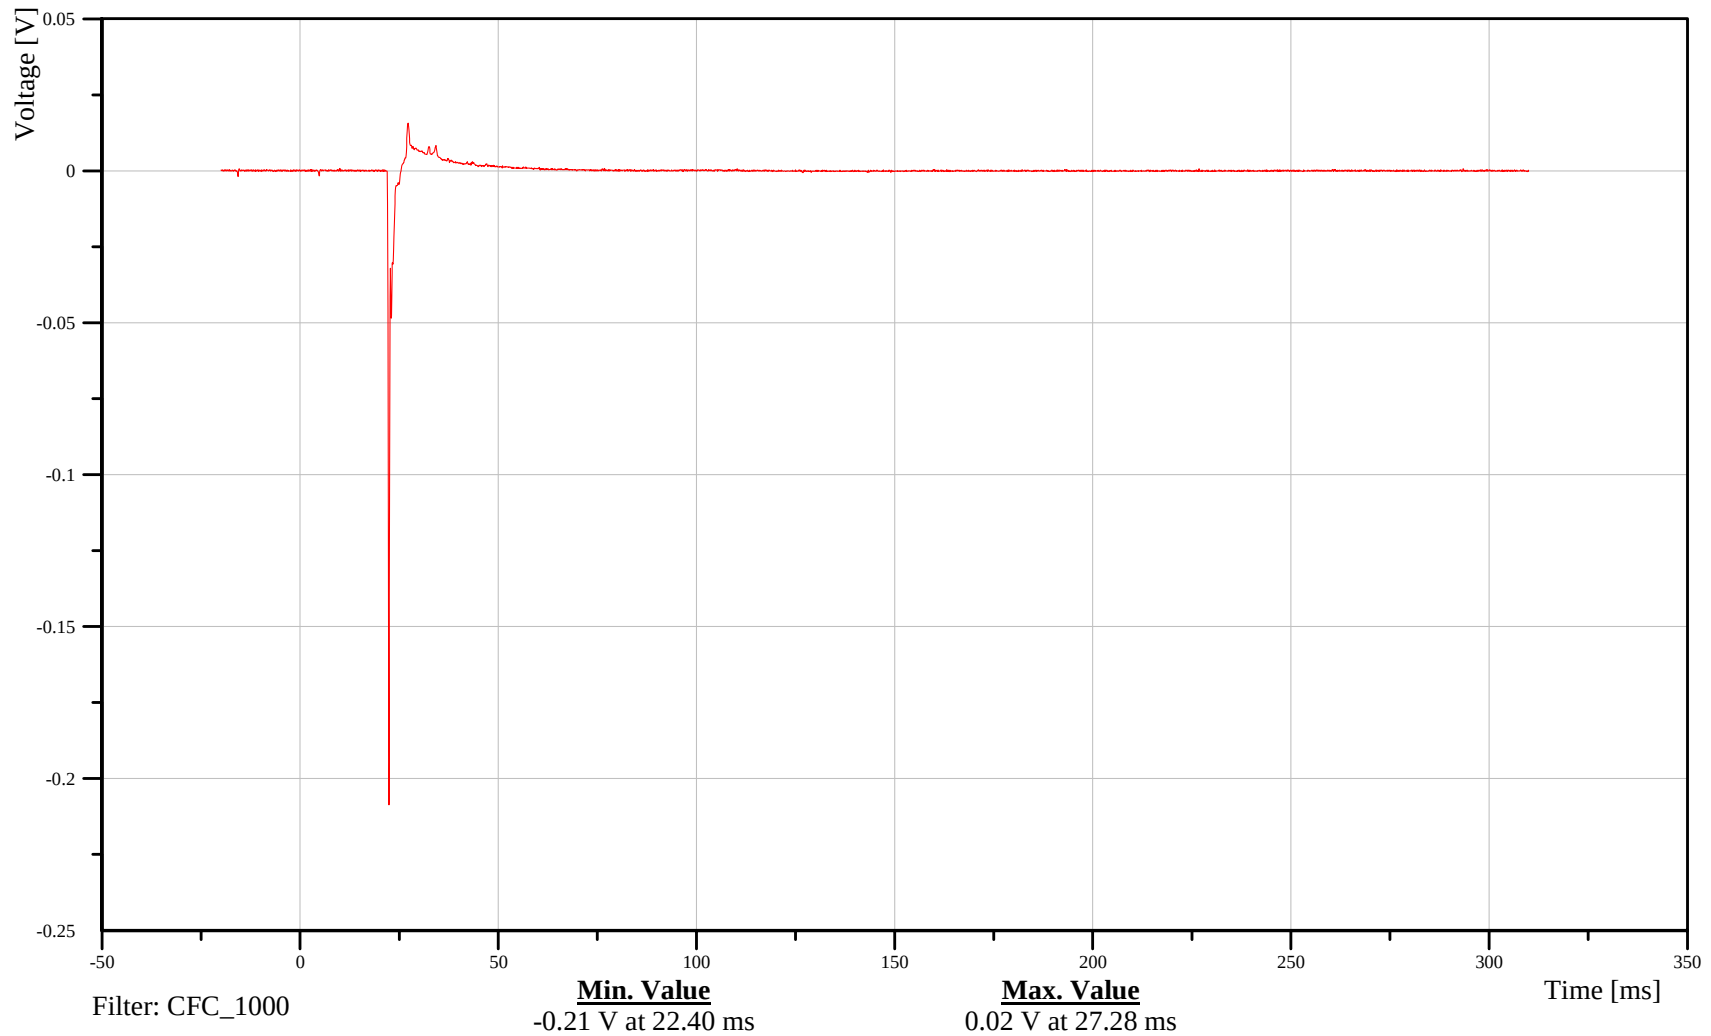

B-104

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Driver Lap Belt

Customer: Volpe

11SEBE0000B5FOOD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

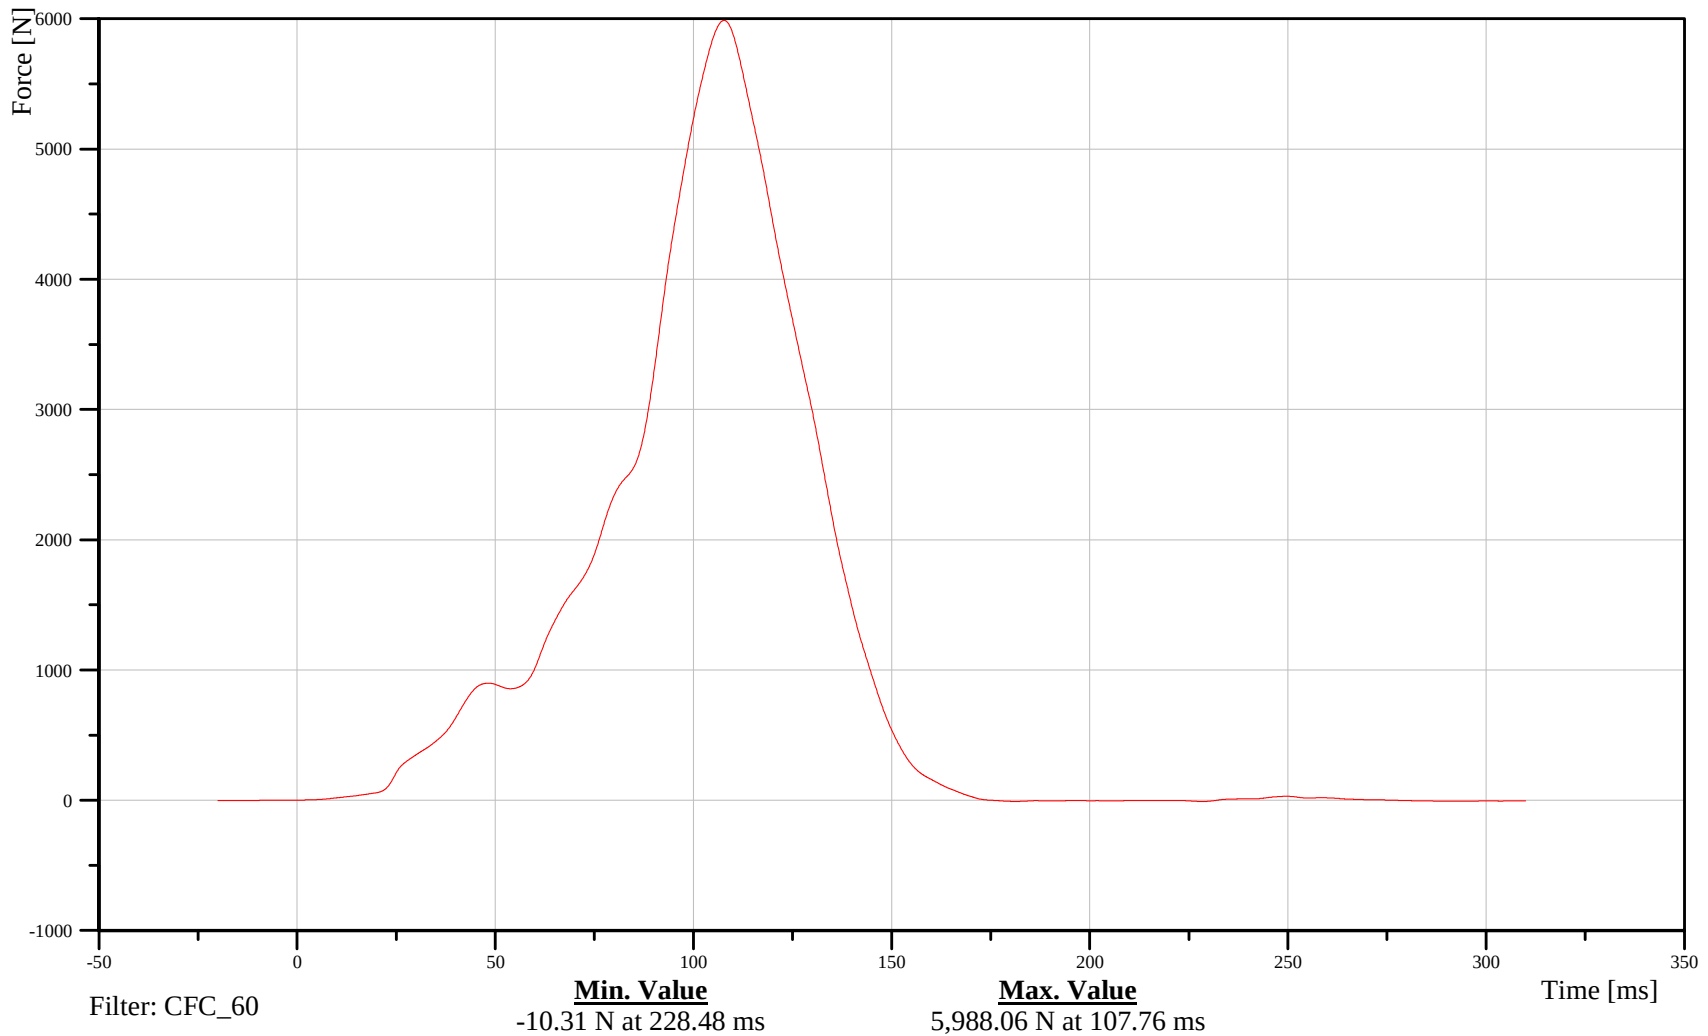

B-105

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Driver Shoulder Belt

Customer: Volpe

11SEBE0000B3FOOD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

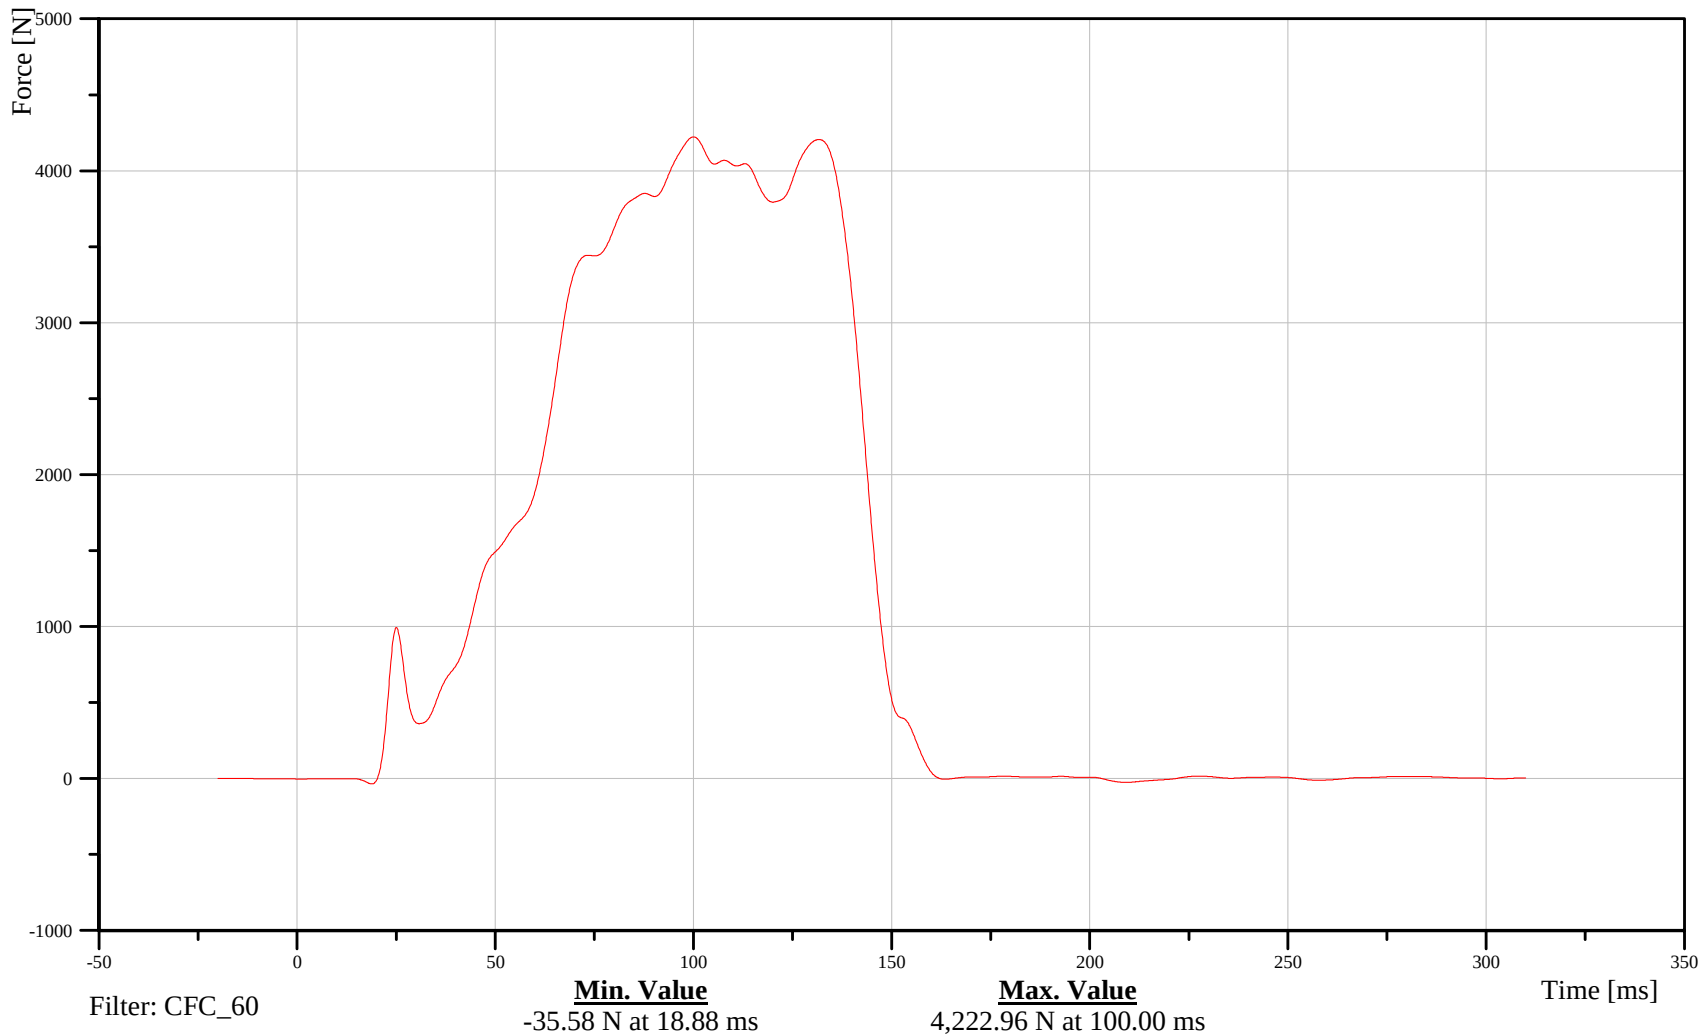

B-106

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 1

Customer: Volpe

L0FBAR000001FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

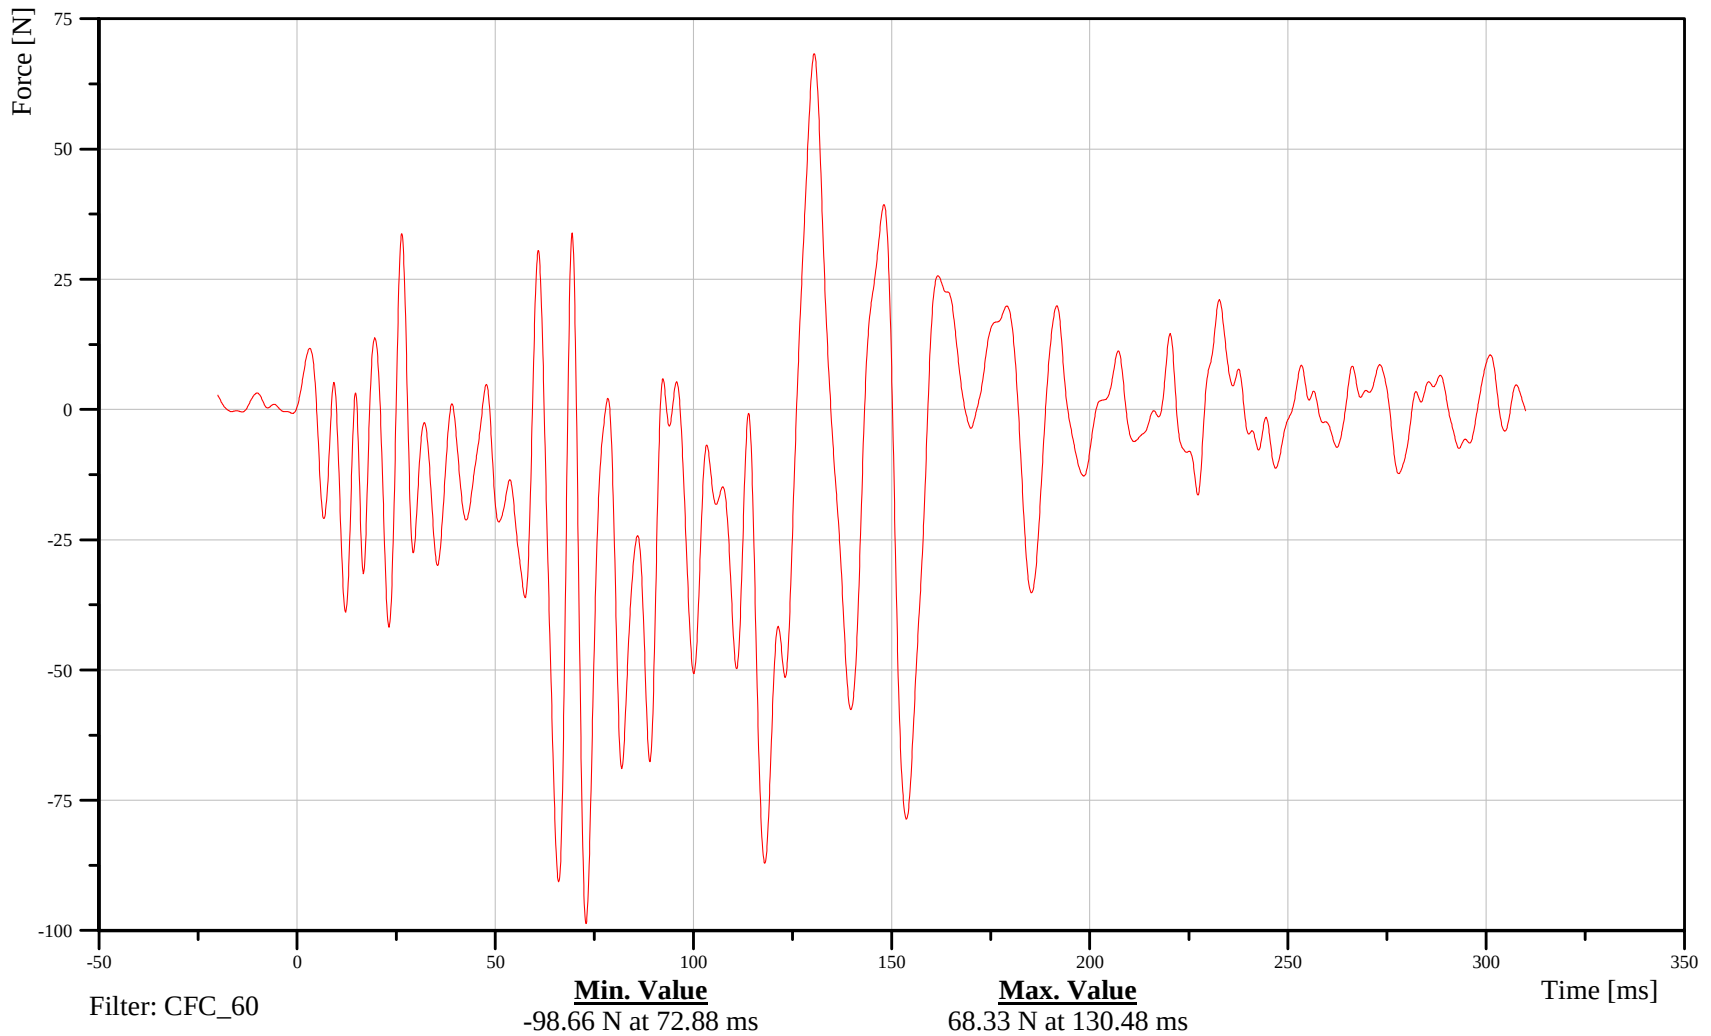

B-107

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 1

Customer: Volpe

L0FBAR000002FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

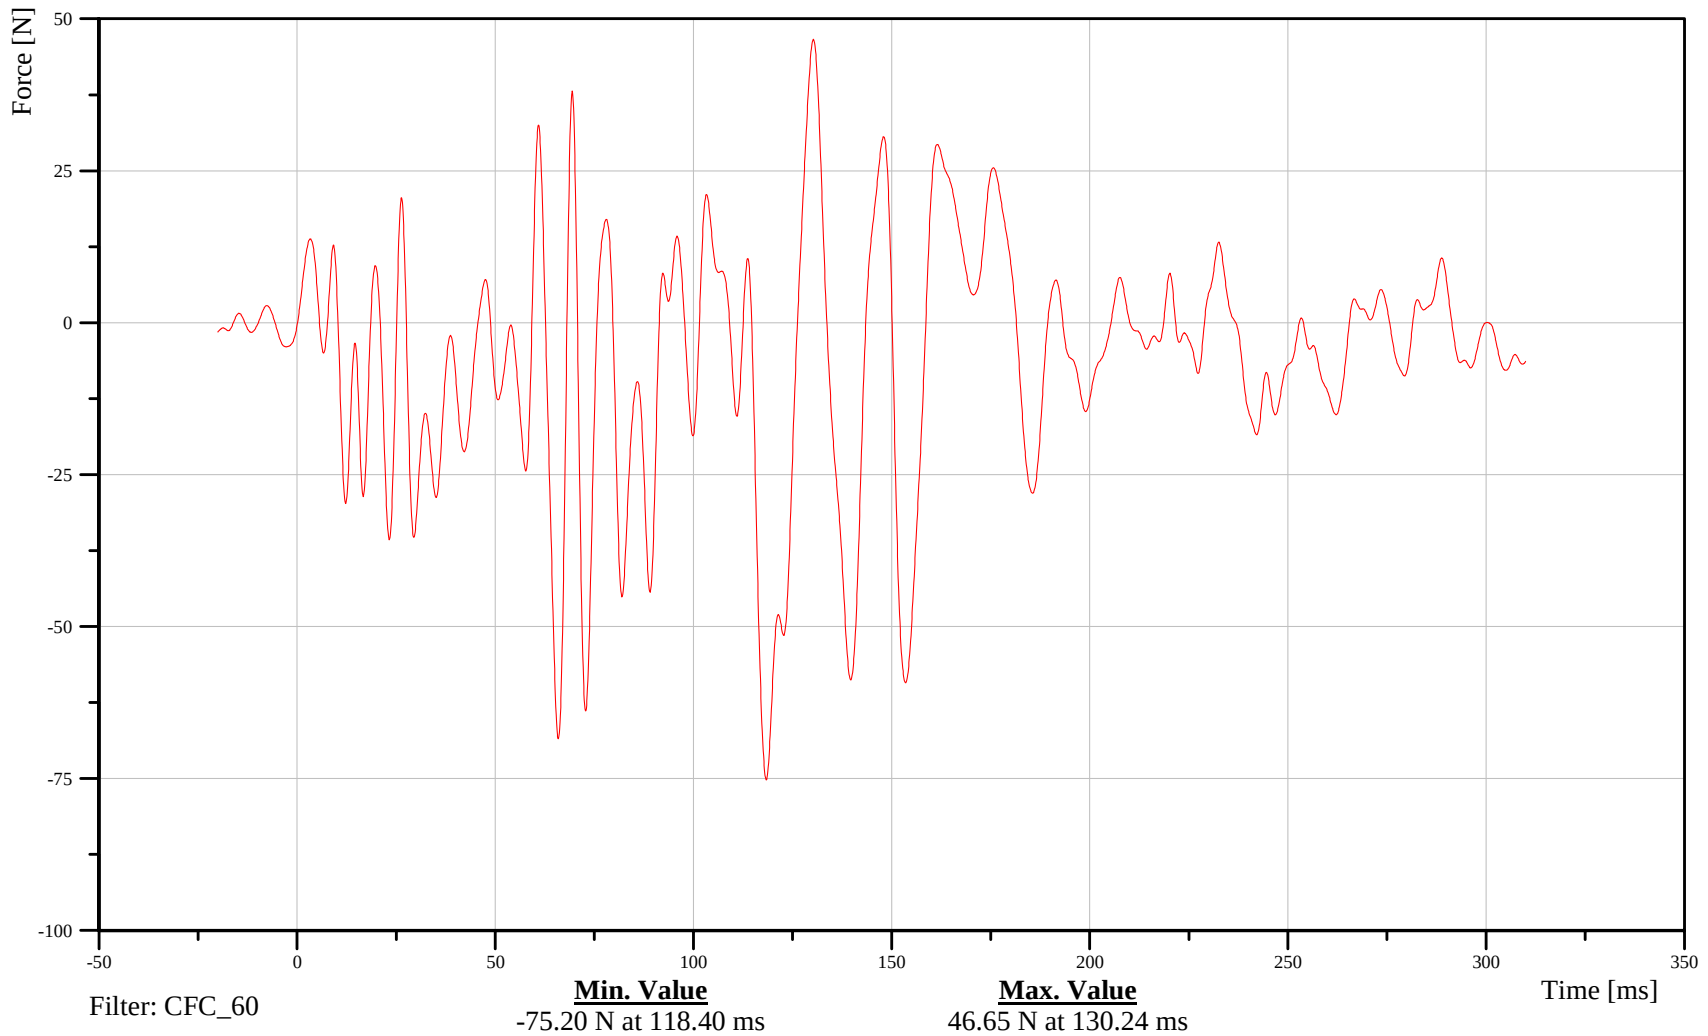

B-108

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 1

Customer: Volpe

L0FBAR000003FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

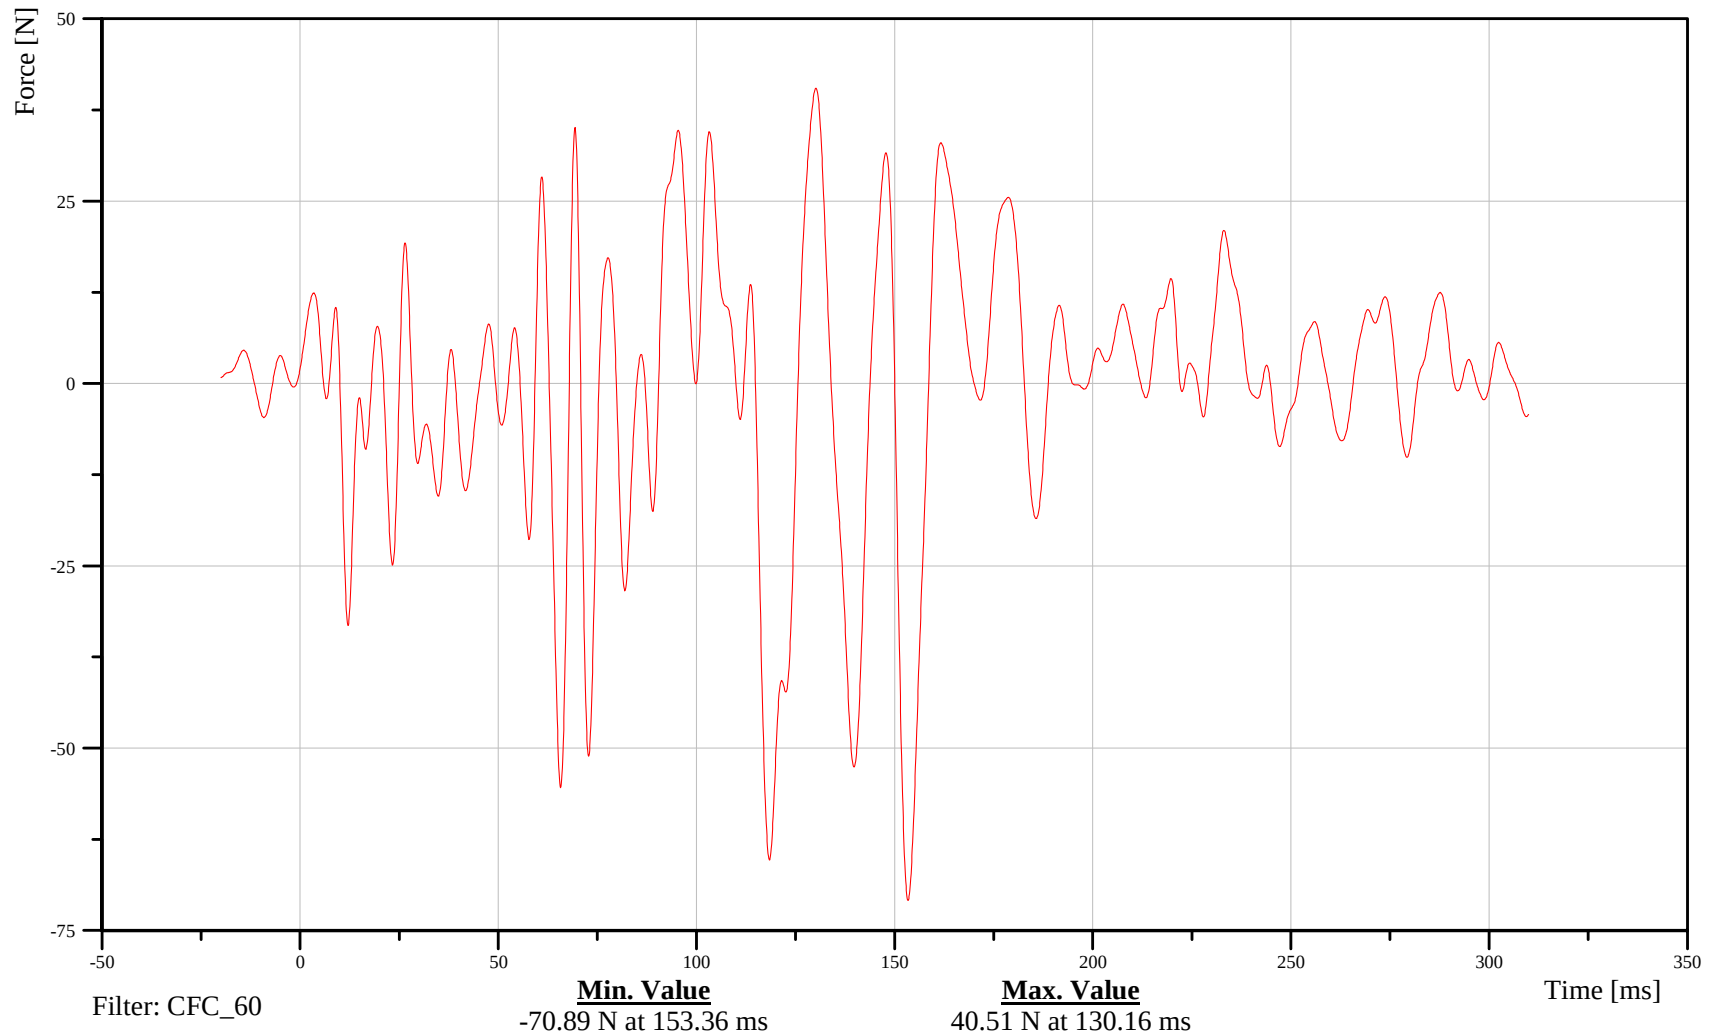

B-109

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 1

Customer: Volpe

L0FBAR000004FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

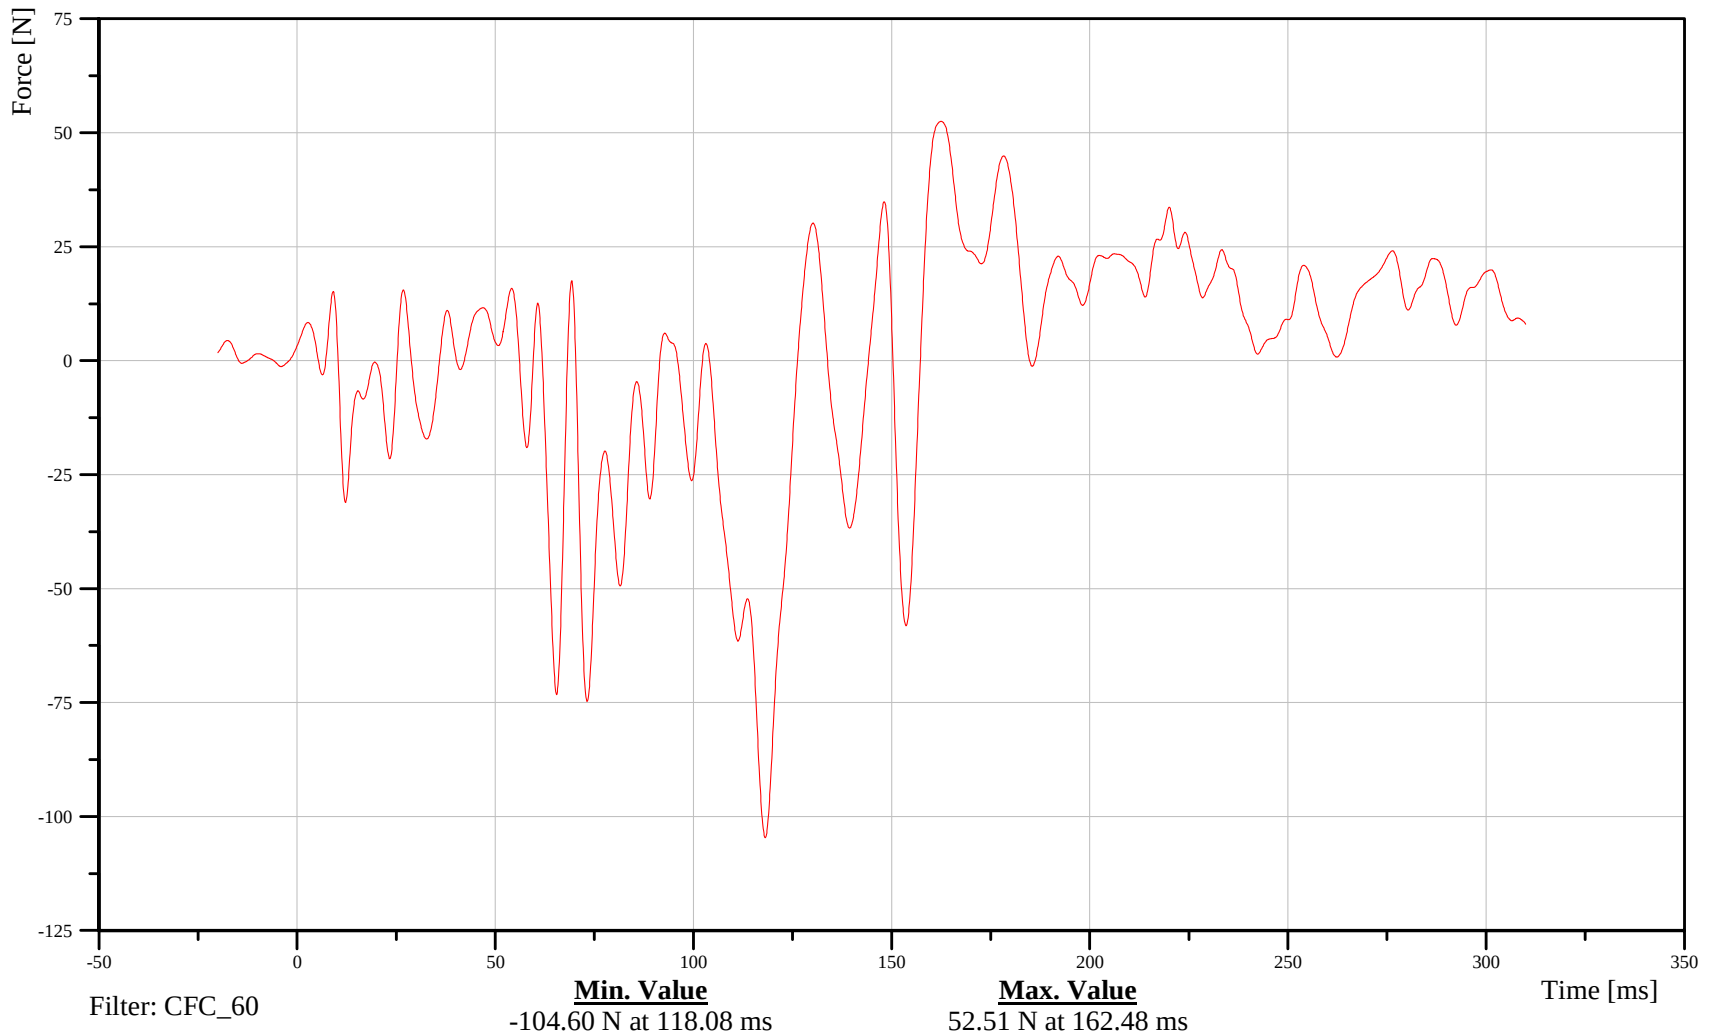

B-110

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 5 Column 1


Time: 18:05

Customer: Volpe

L0FBAR000005FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

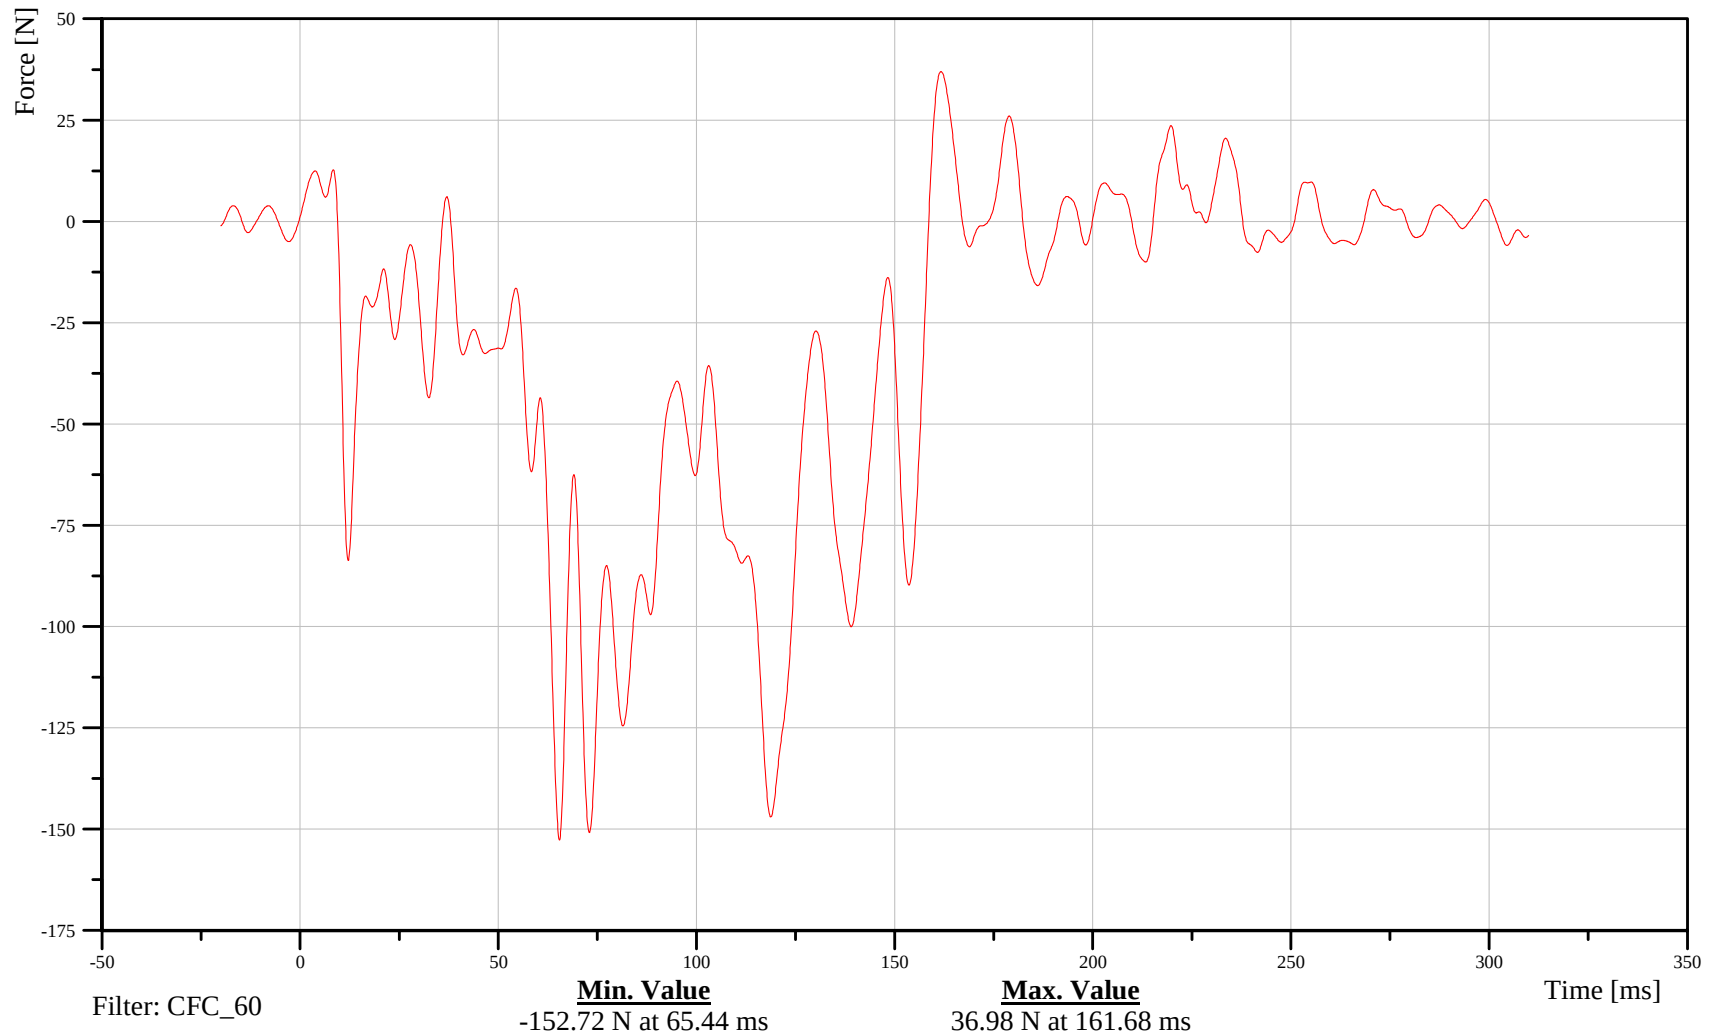

B-111

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 1

Customer: Volpe

L0FBAR000006FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

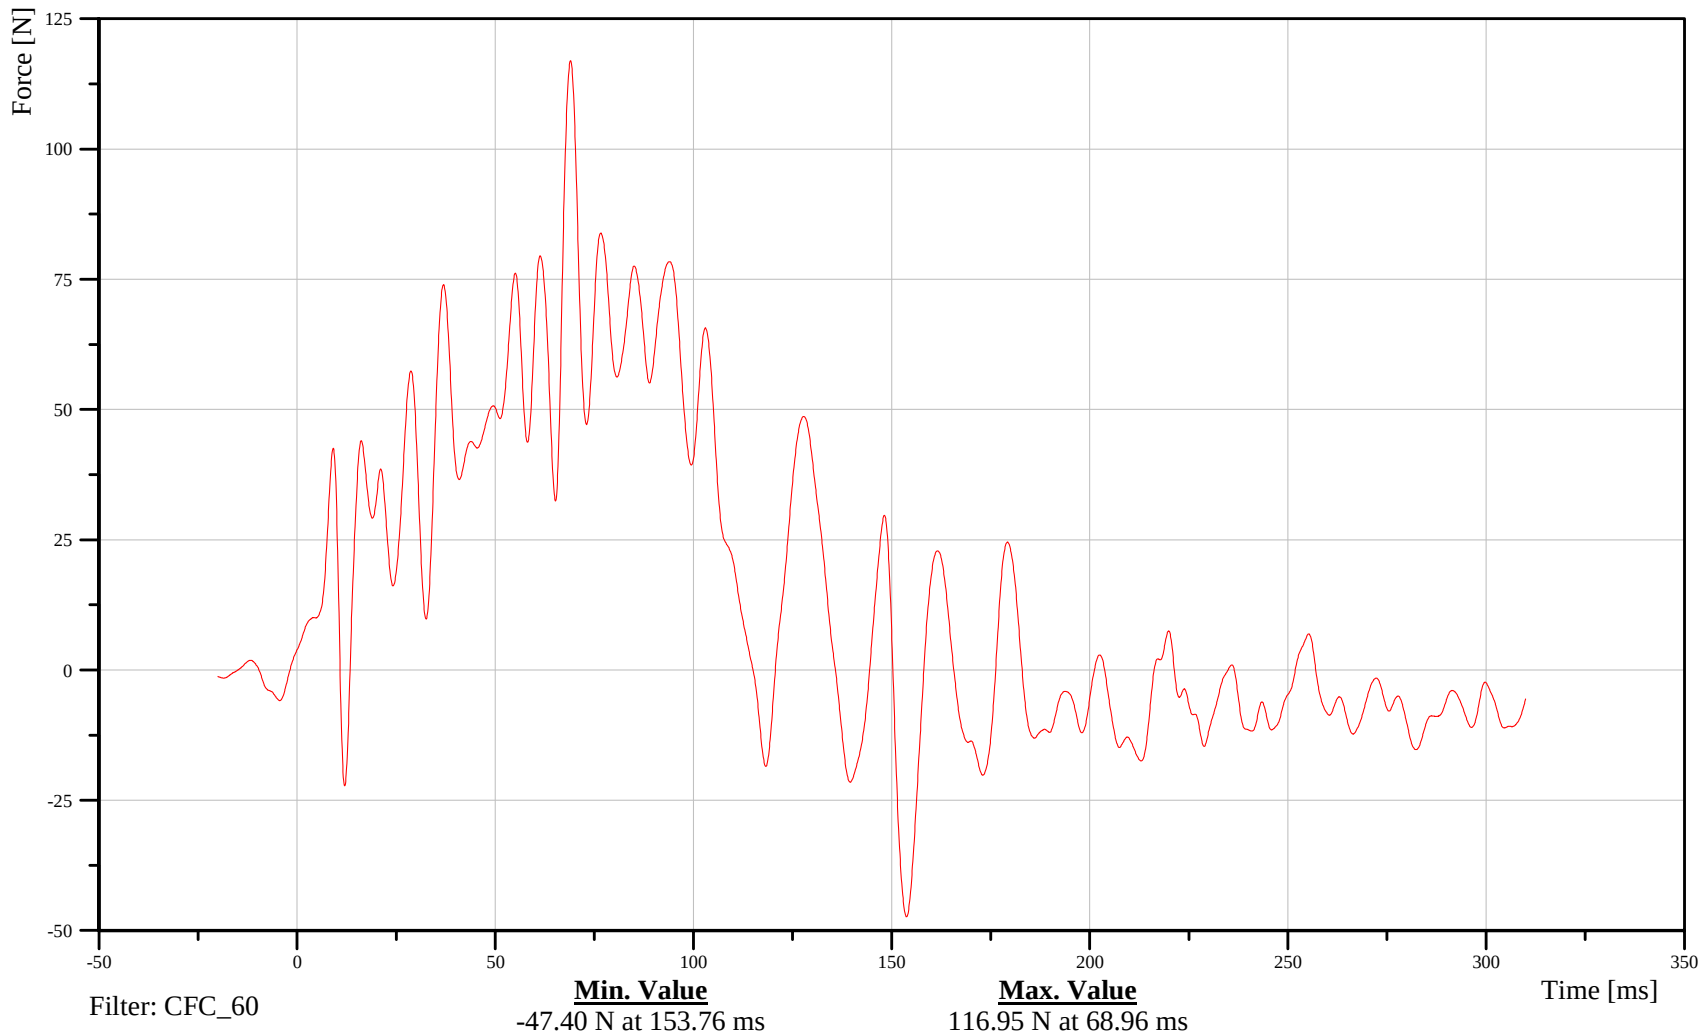

B-112

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 7 Column 1

Customer: Volpe

L0FBAR000007FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

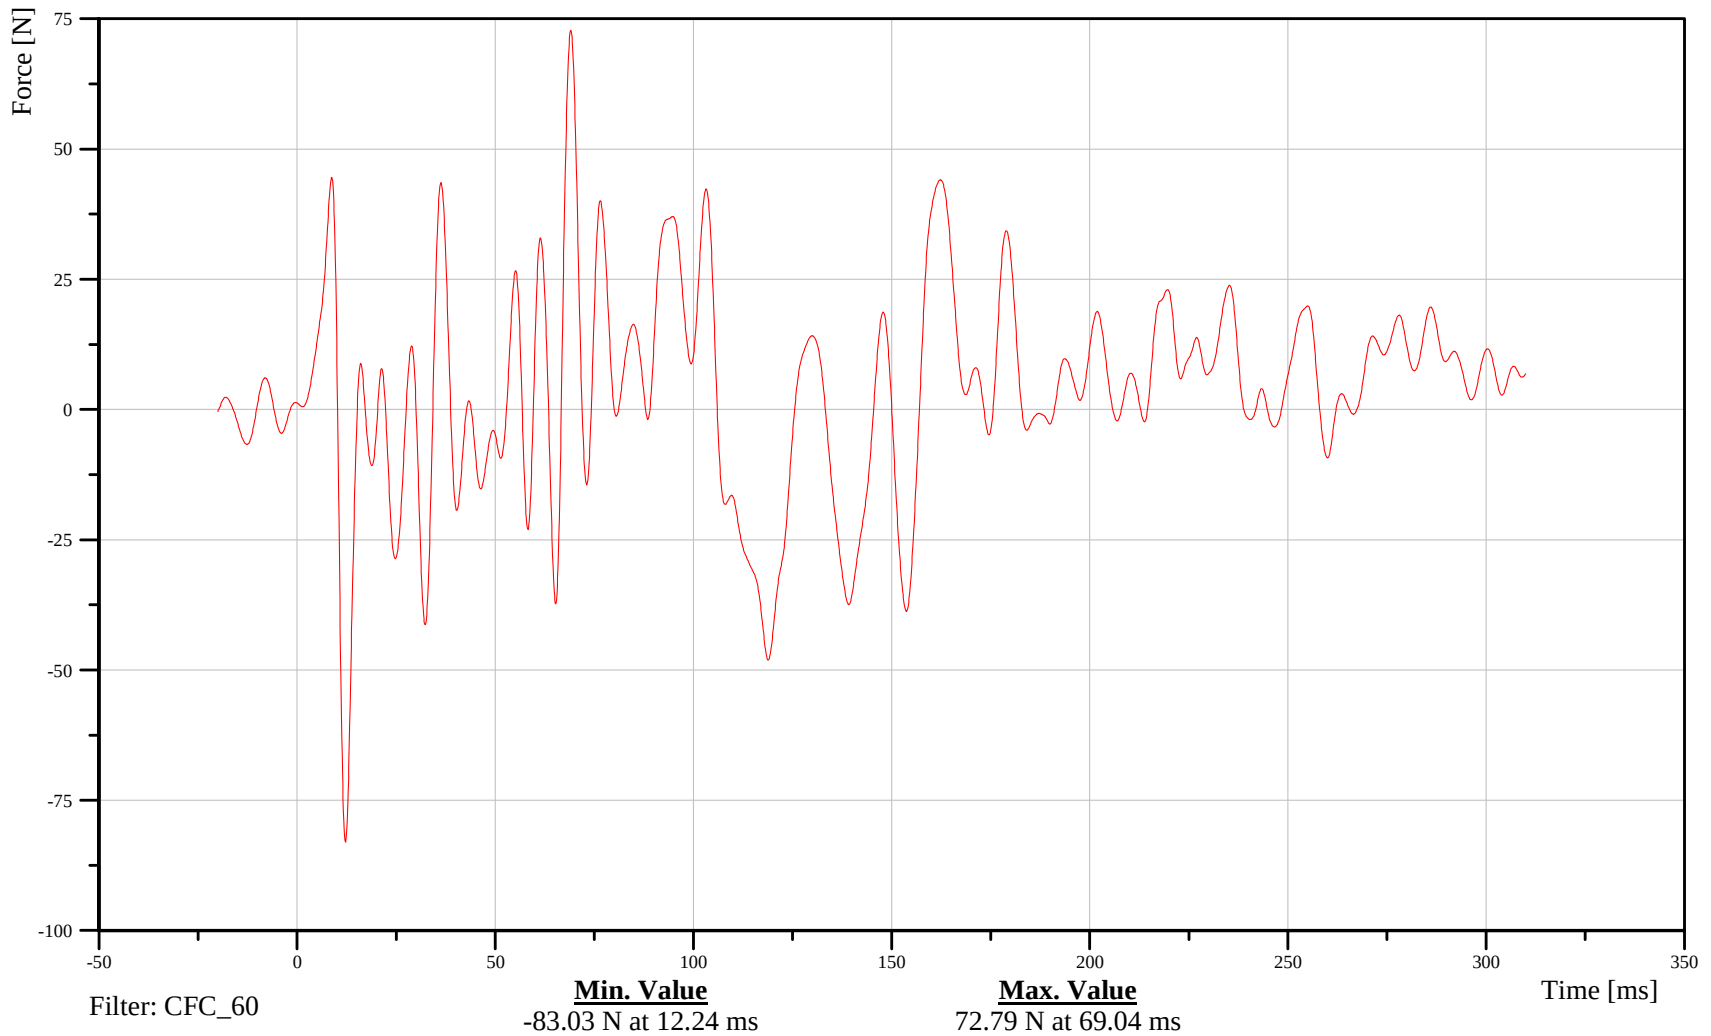

B-113

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 8 Column 1

Customer: Volpe

L0FBAR000008FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

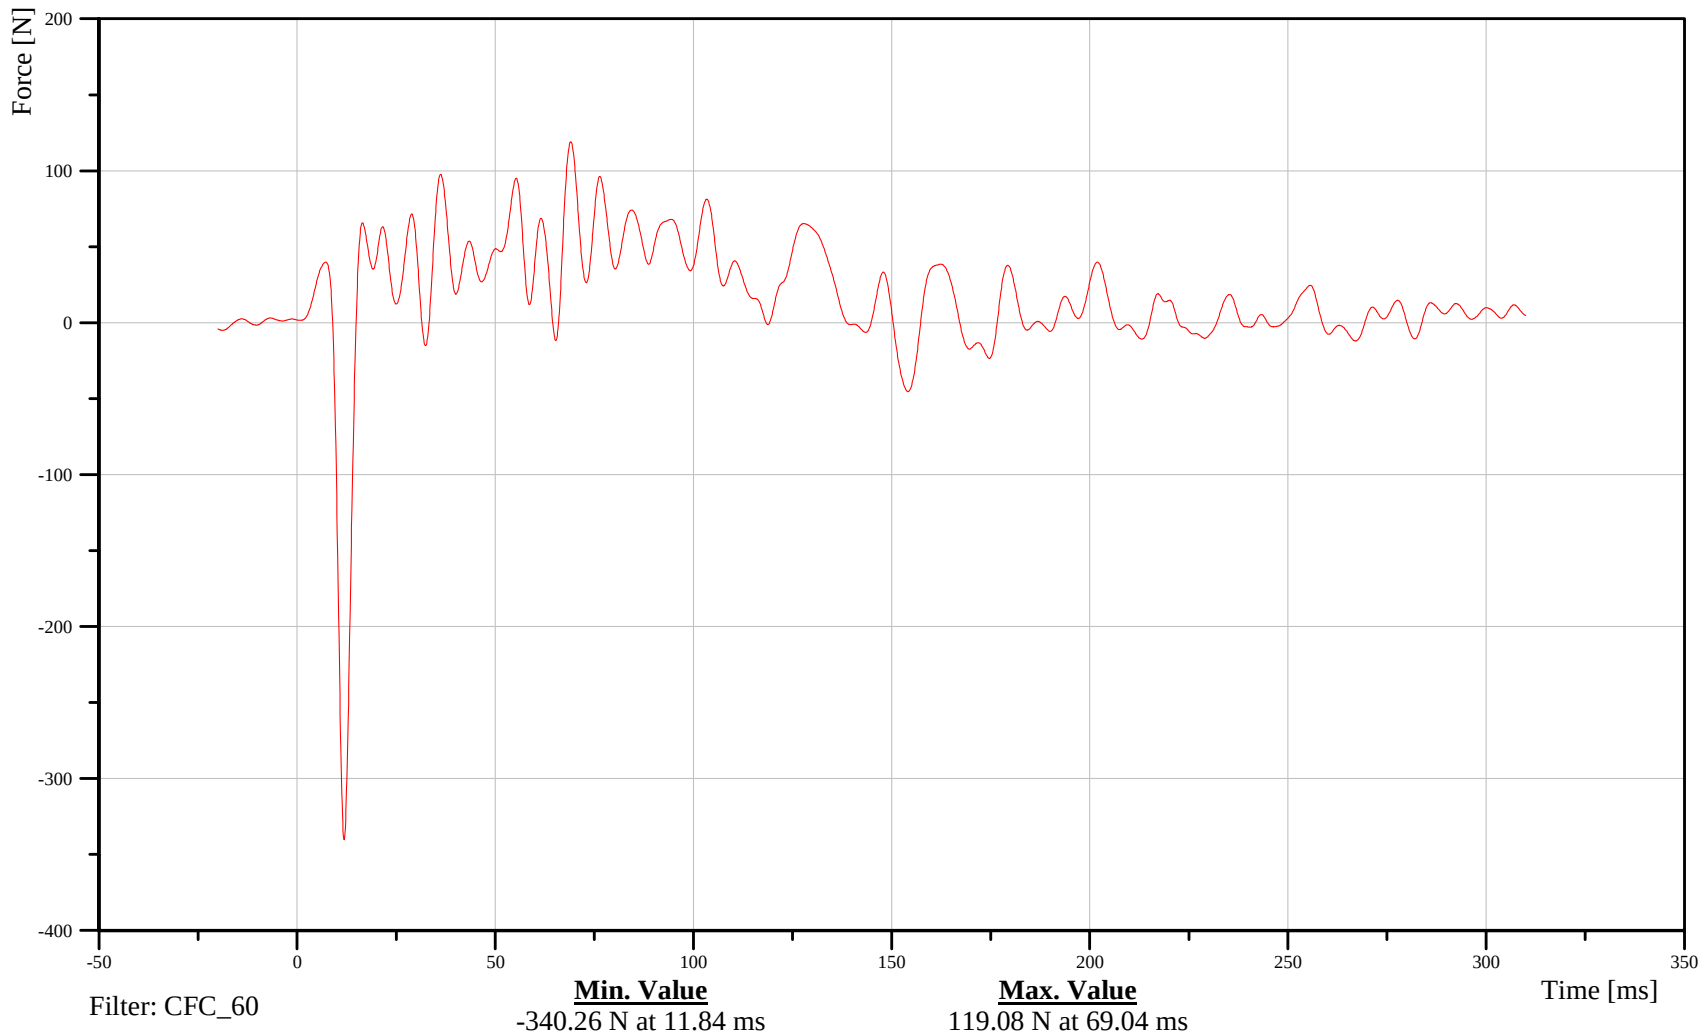

B-114

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 1

Customer: Volpe

L0FBAR000009FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

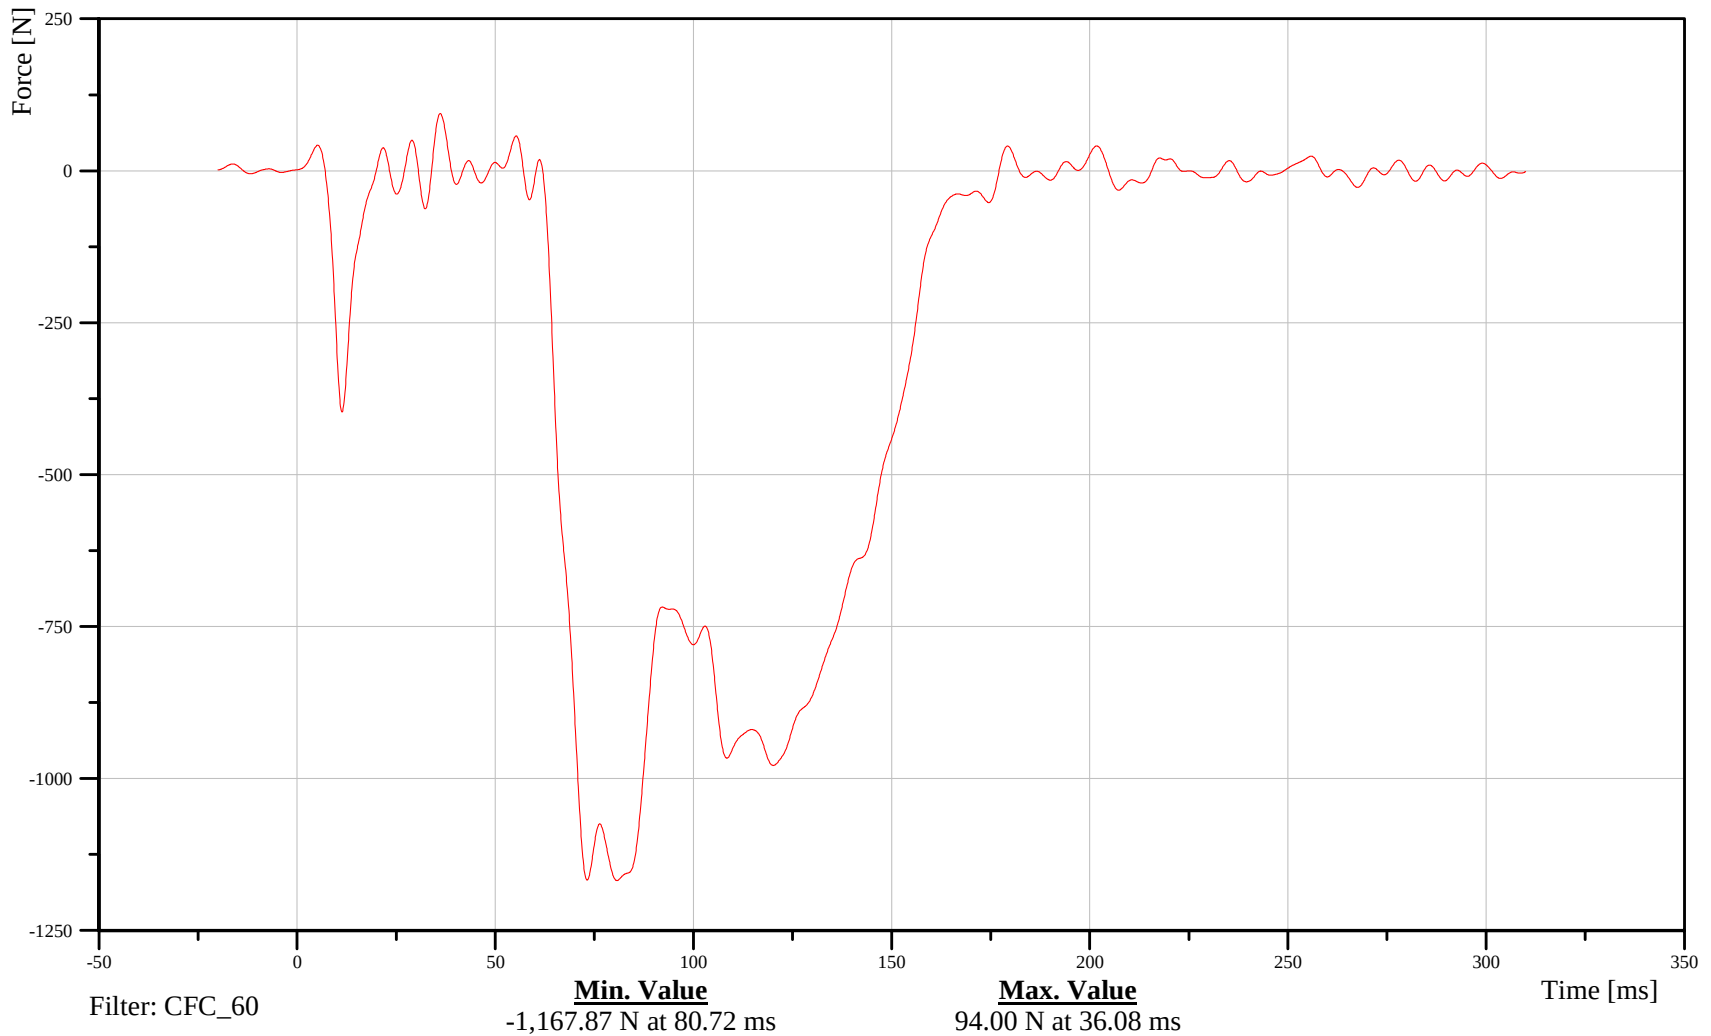

B-115

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 1

Customer: Volpe

L0FBAR000010FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

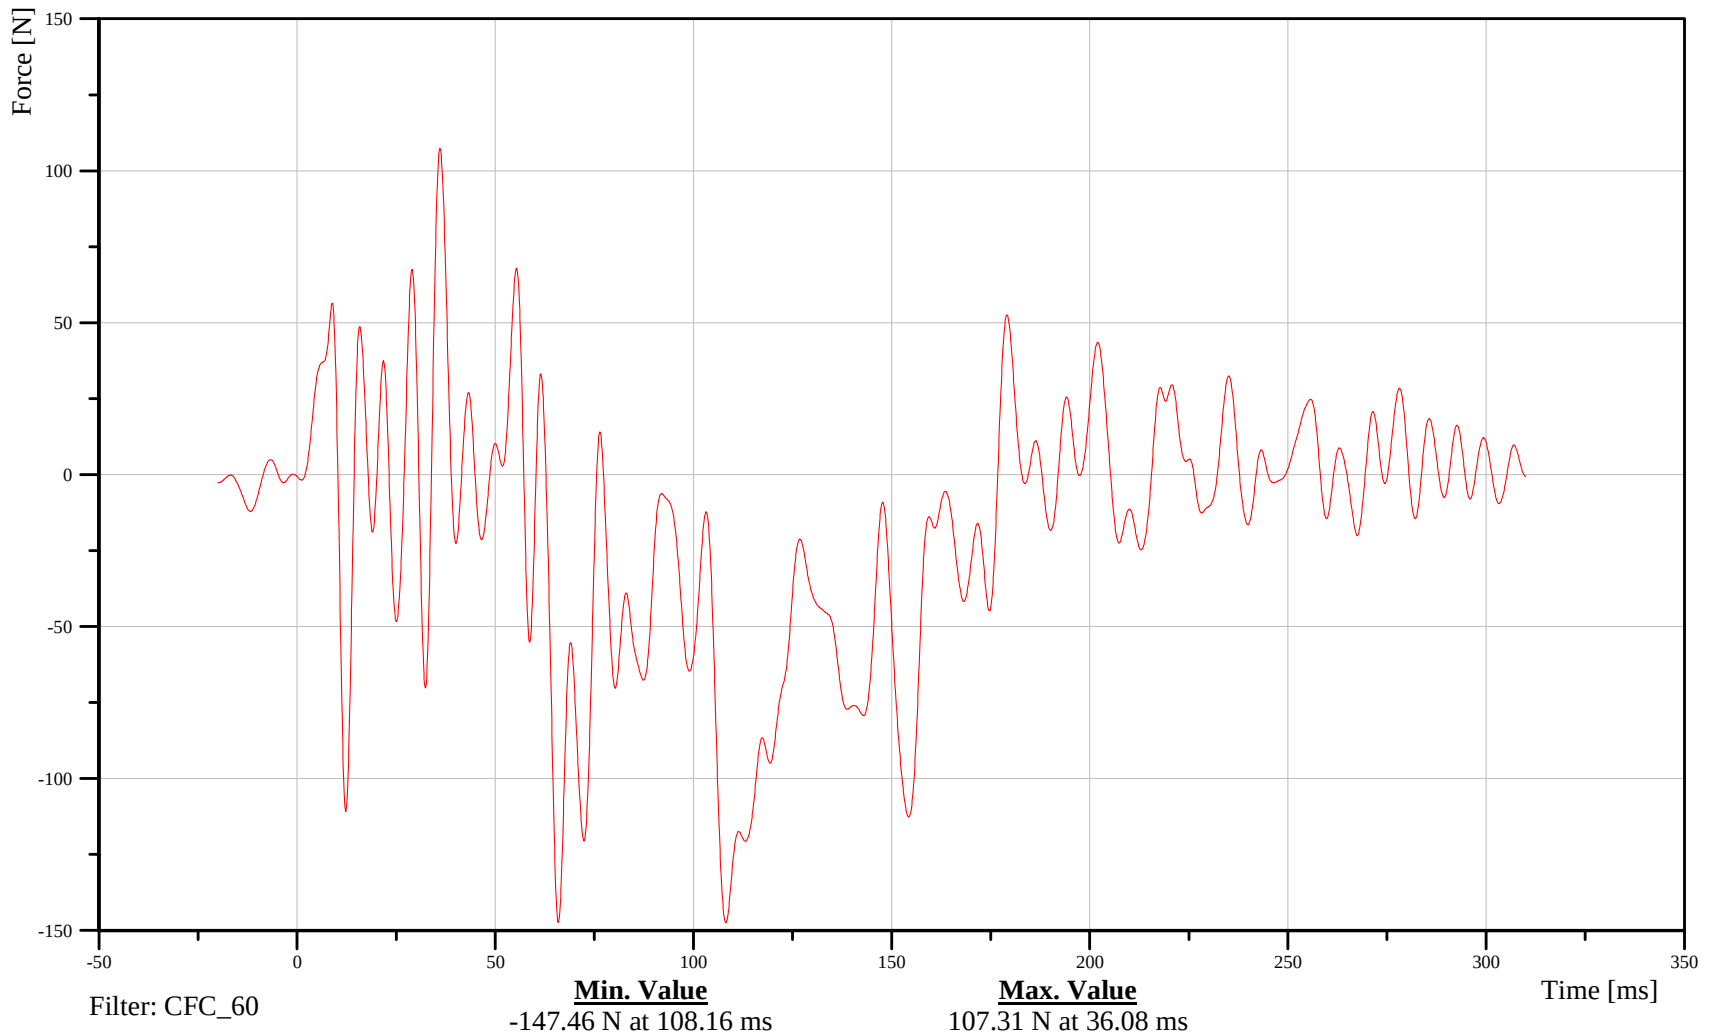

B-116

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 2

Customer: Volpe

L0FBAR000011FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

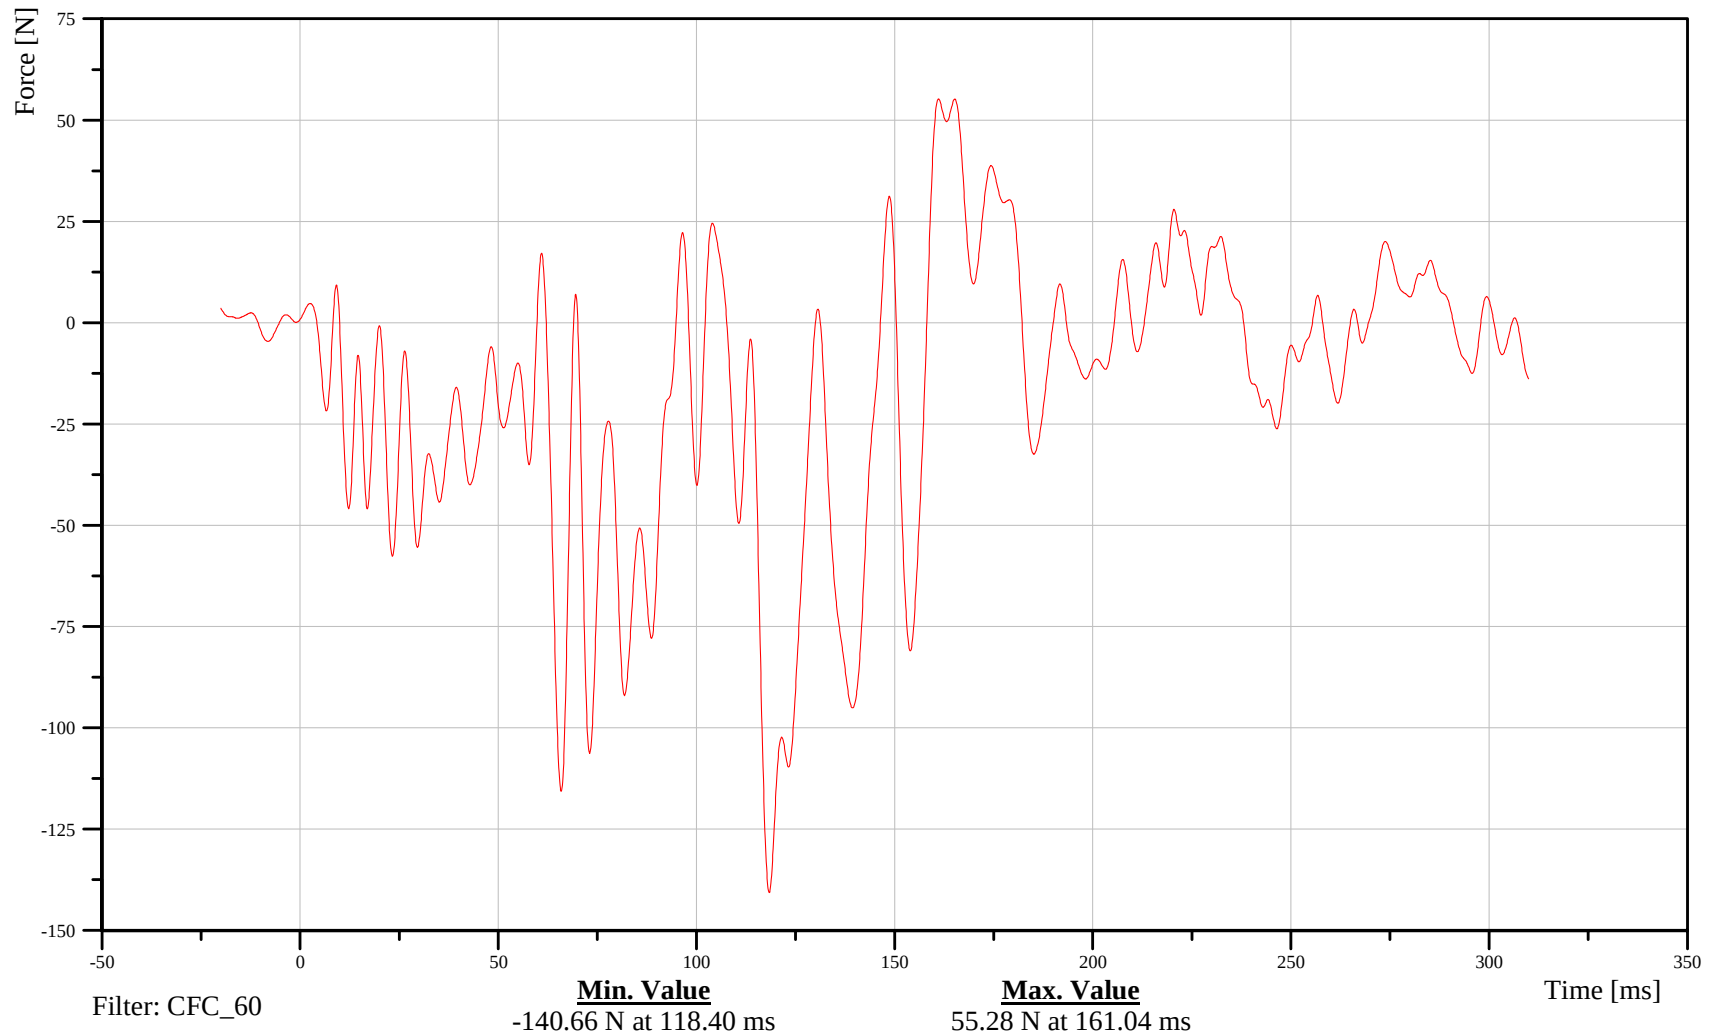

B-117

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 2

Customer: Volpe

L0FBAR000012FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

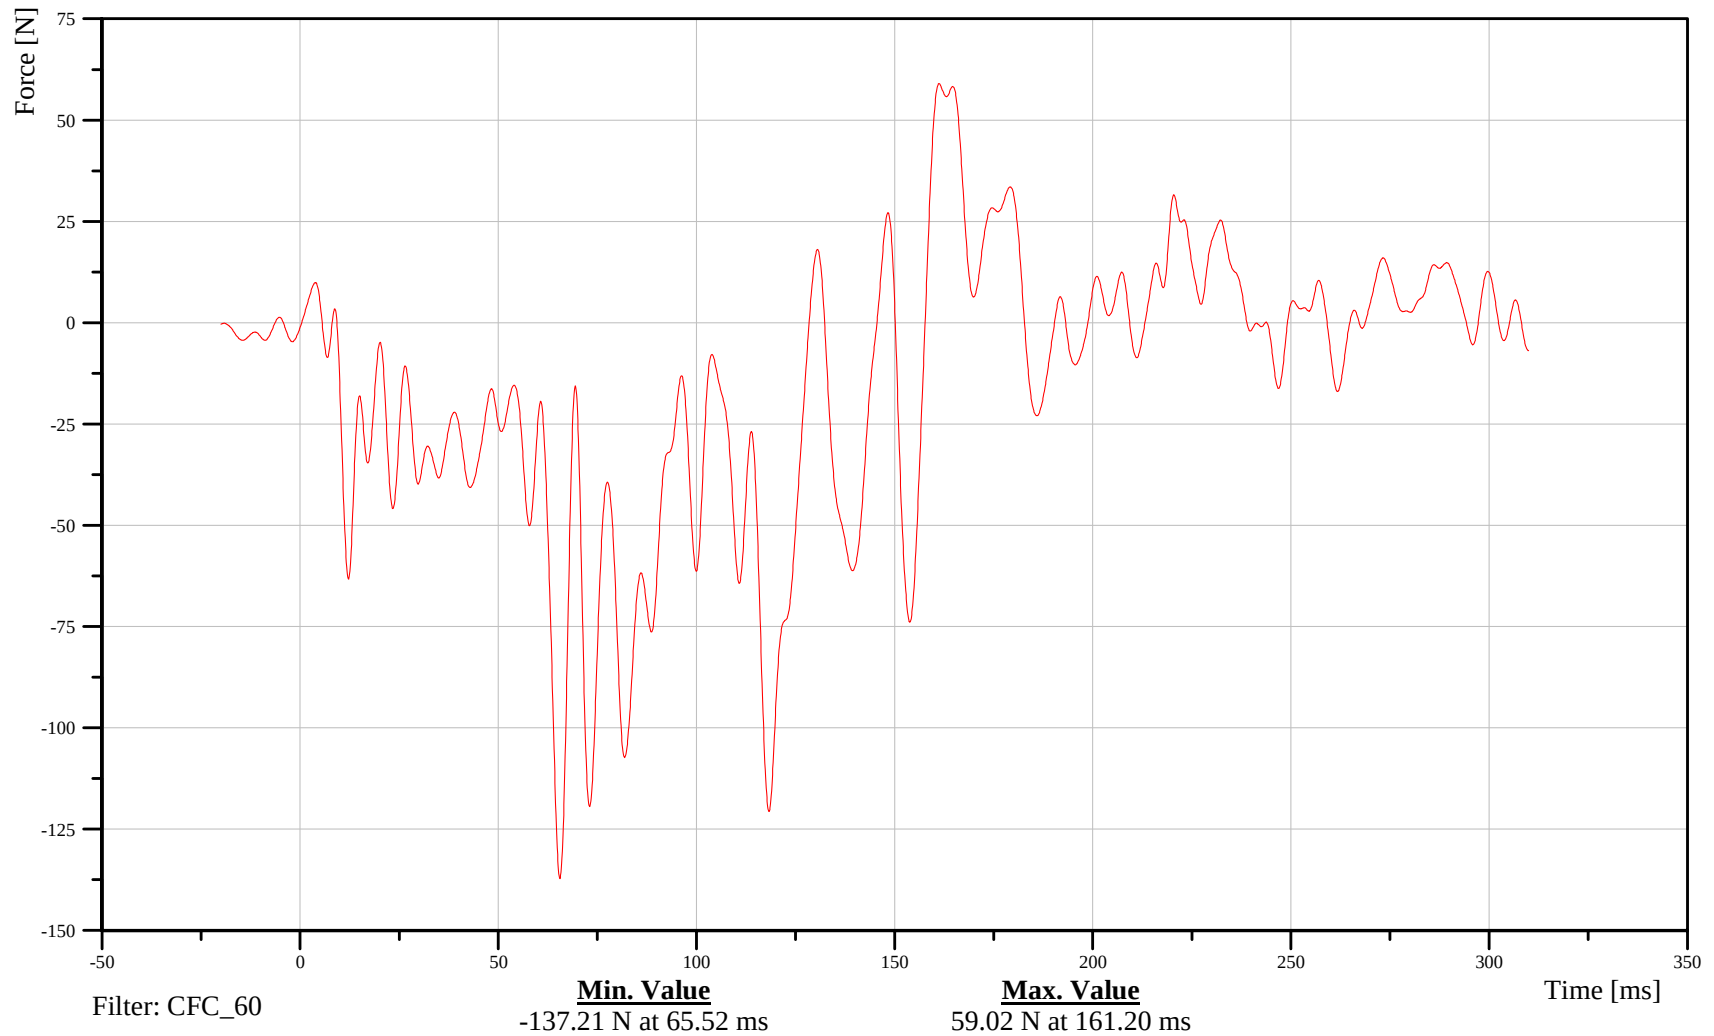

B-118

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 2

Customer: Volpe

L0FBAR000013FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

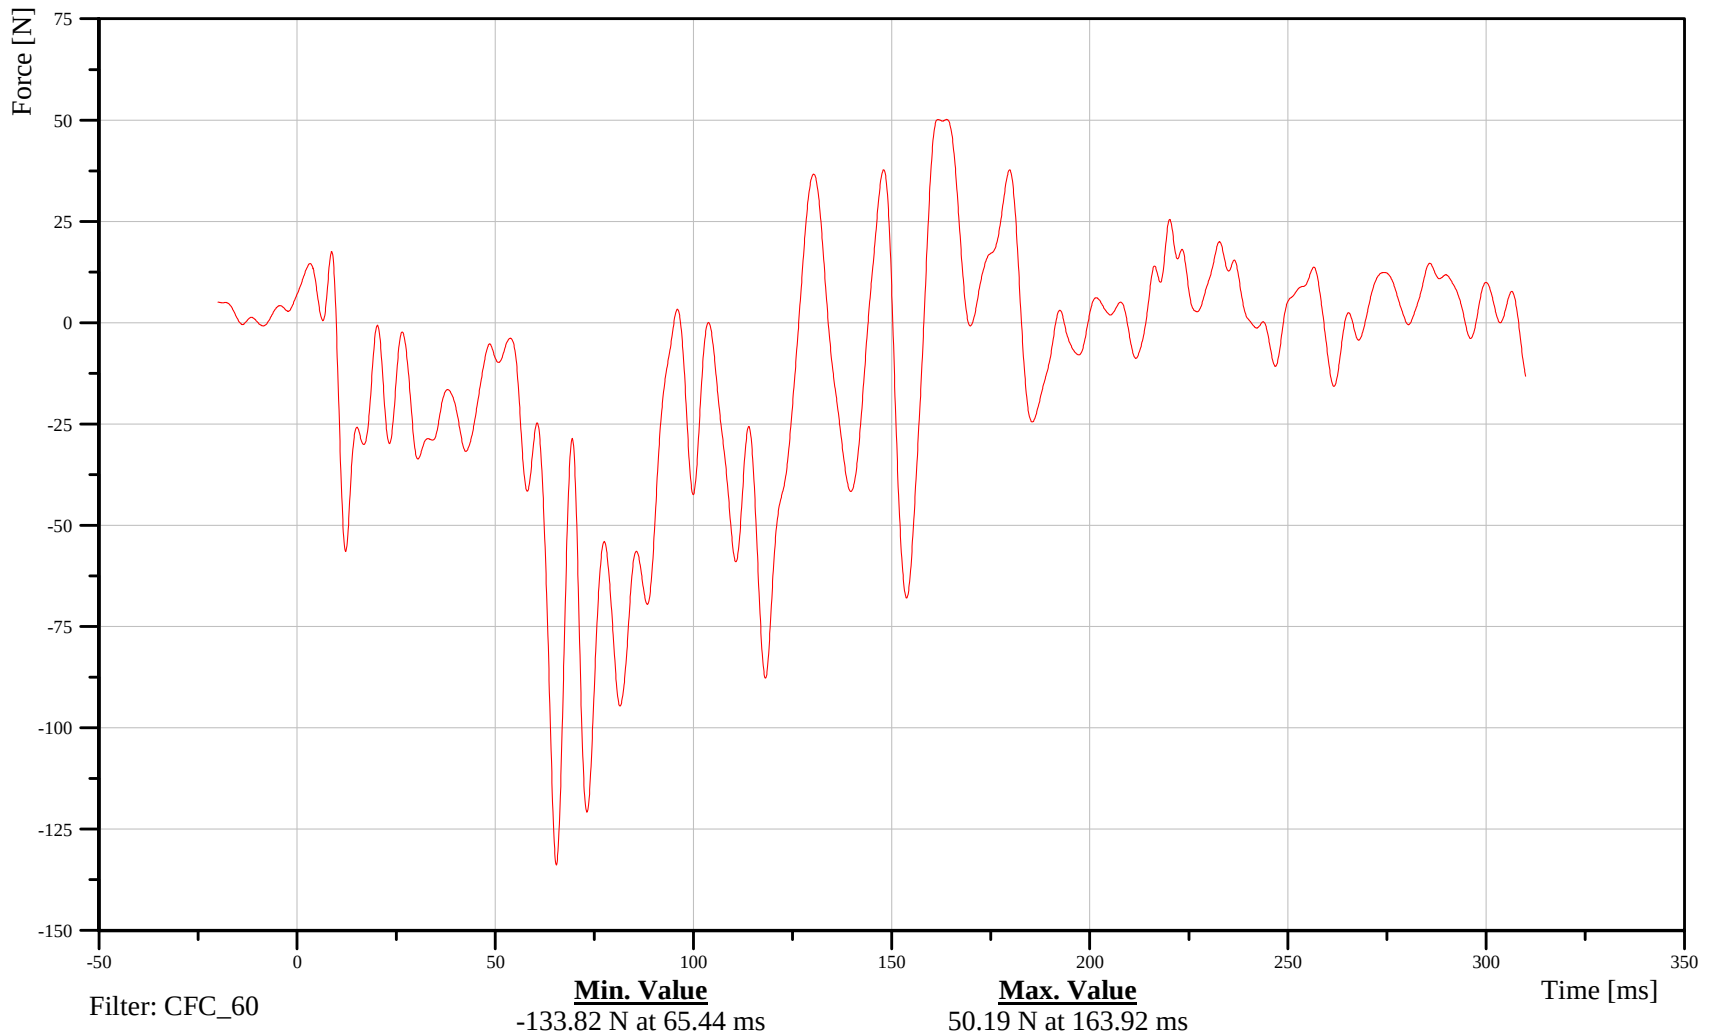

B-119

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 2

Customer: Volpe

L0FBAR000014FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

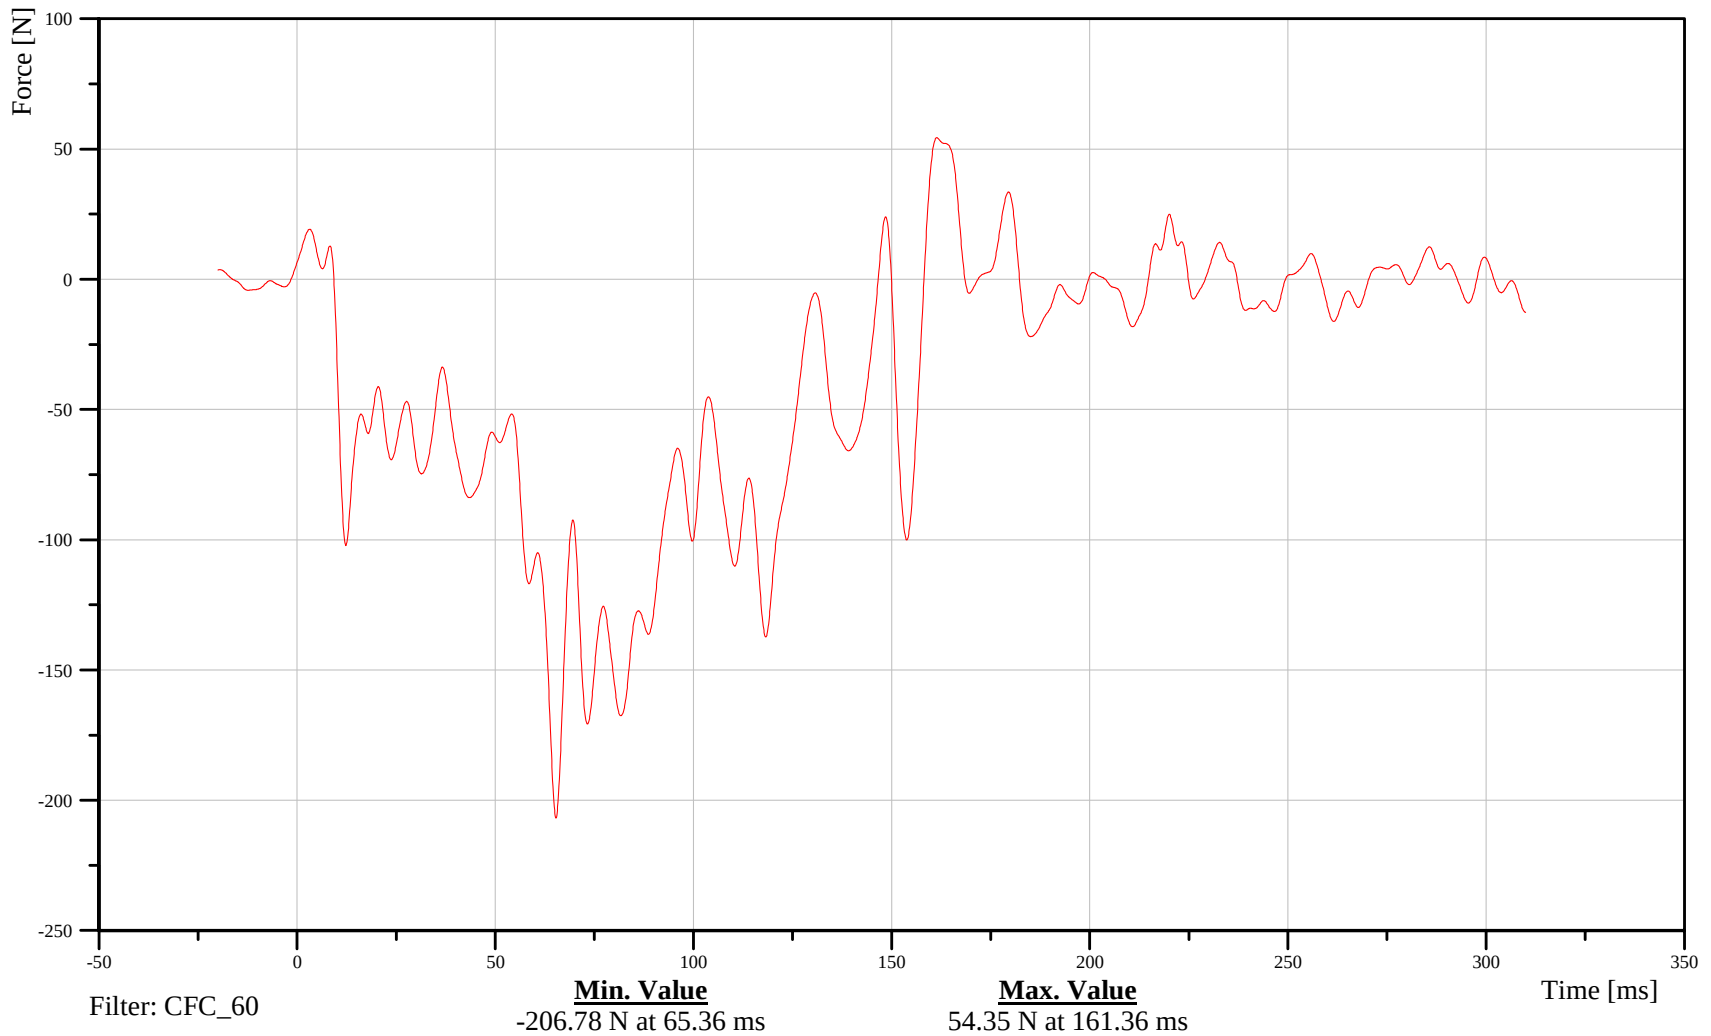

B-120

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 2

Customer: Volpe

L0FBAR000015FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

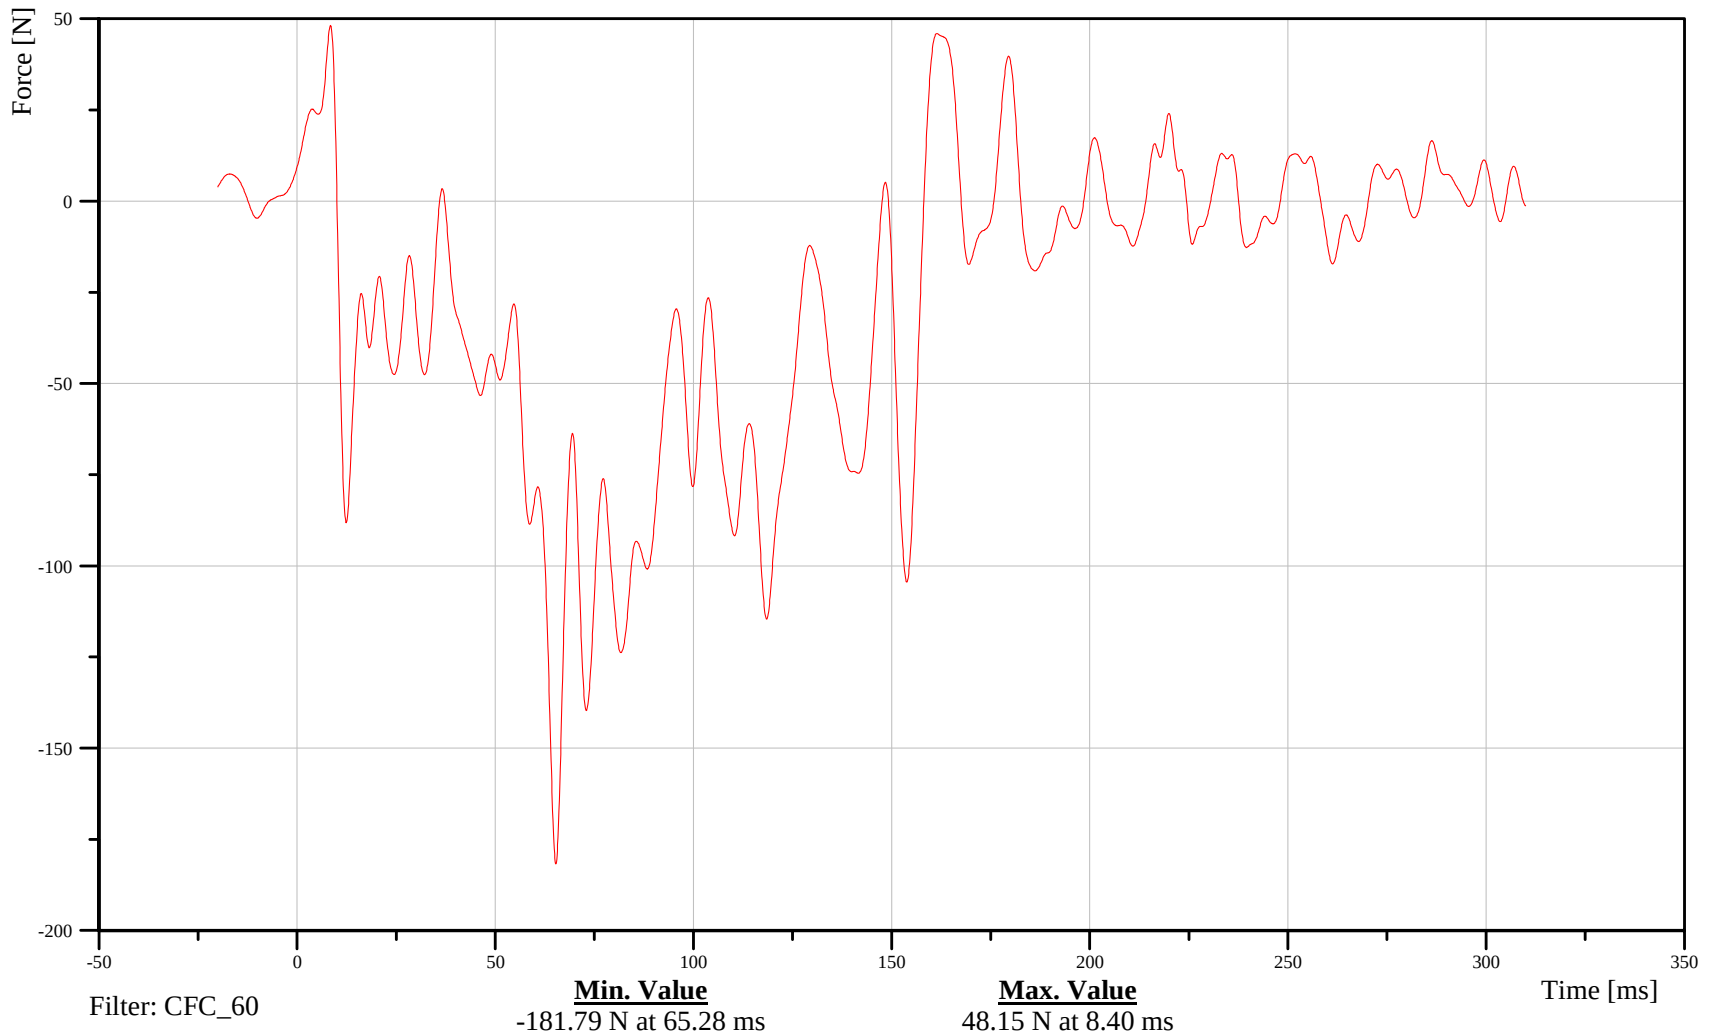

B-121

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 2

Customer: Volpe

L0FBAR000016FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

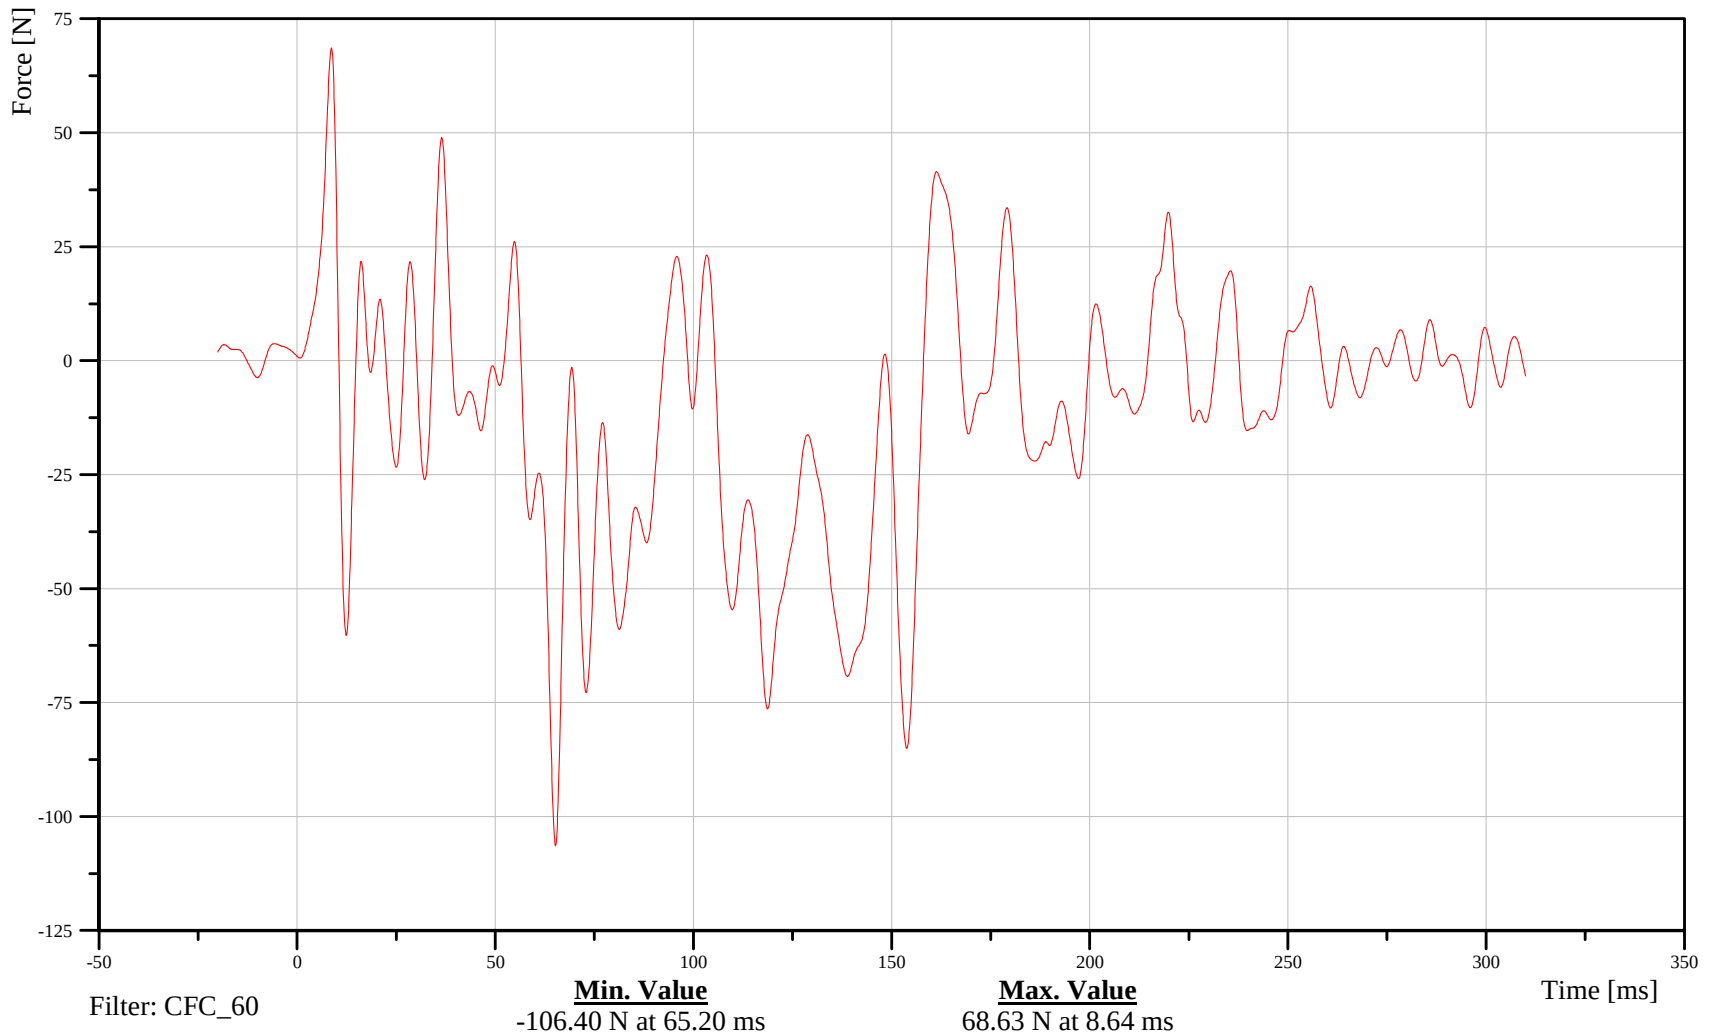

B-122

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 2


Time: 18:05

Customer: Volpe

L0FBAR000017FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

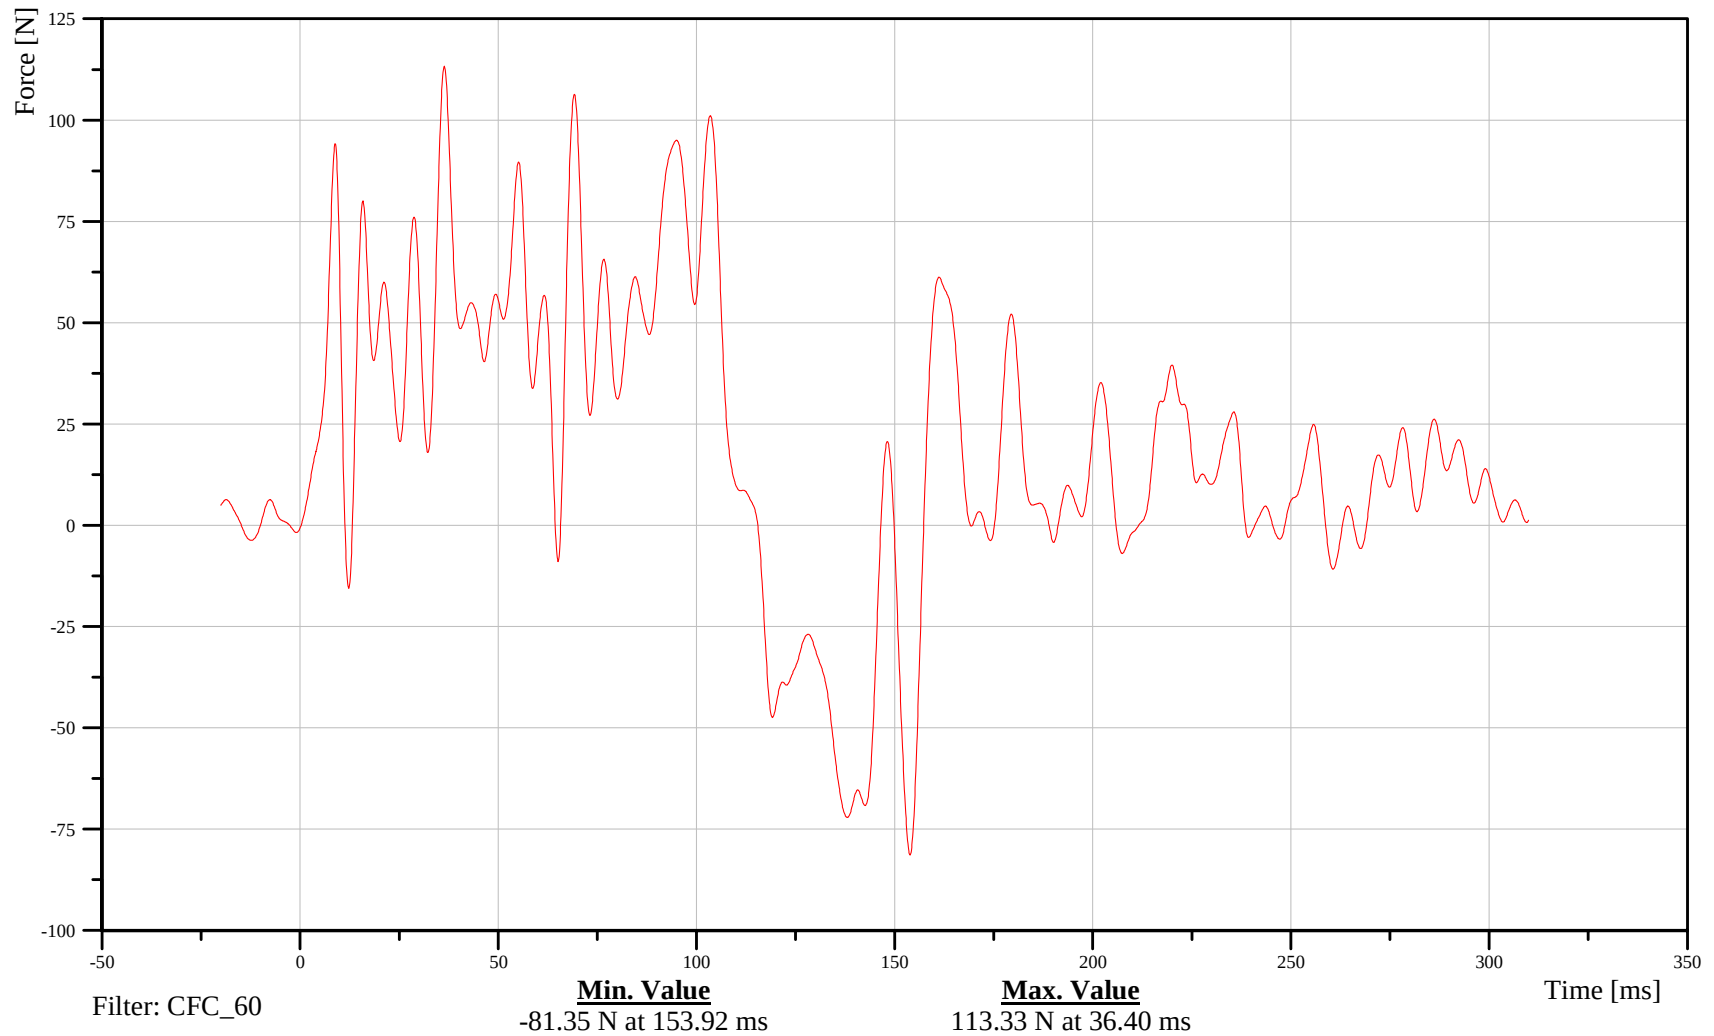

B-123

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 8 Column 2

Customer: Volpe

L0FBAR000018FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

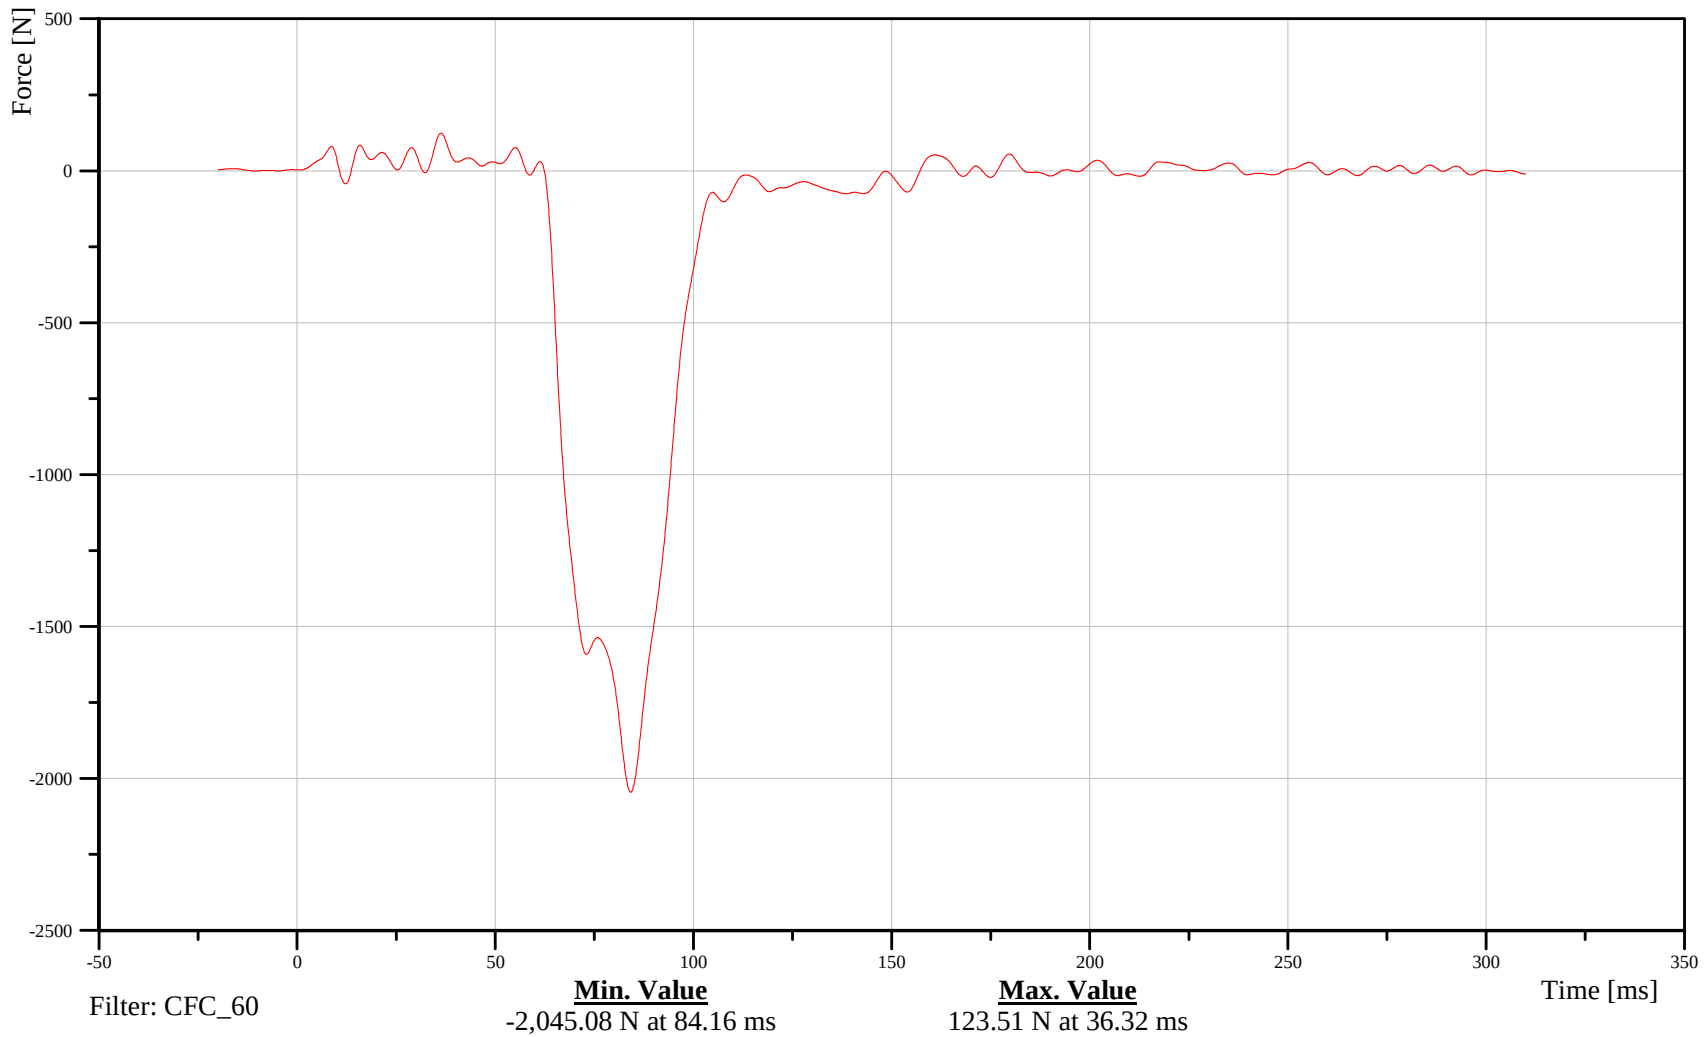

B-124

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 2

Customer: Volpe

L0FBAR000019FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

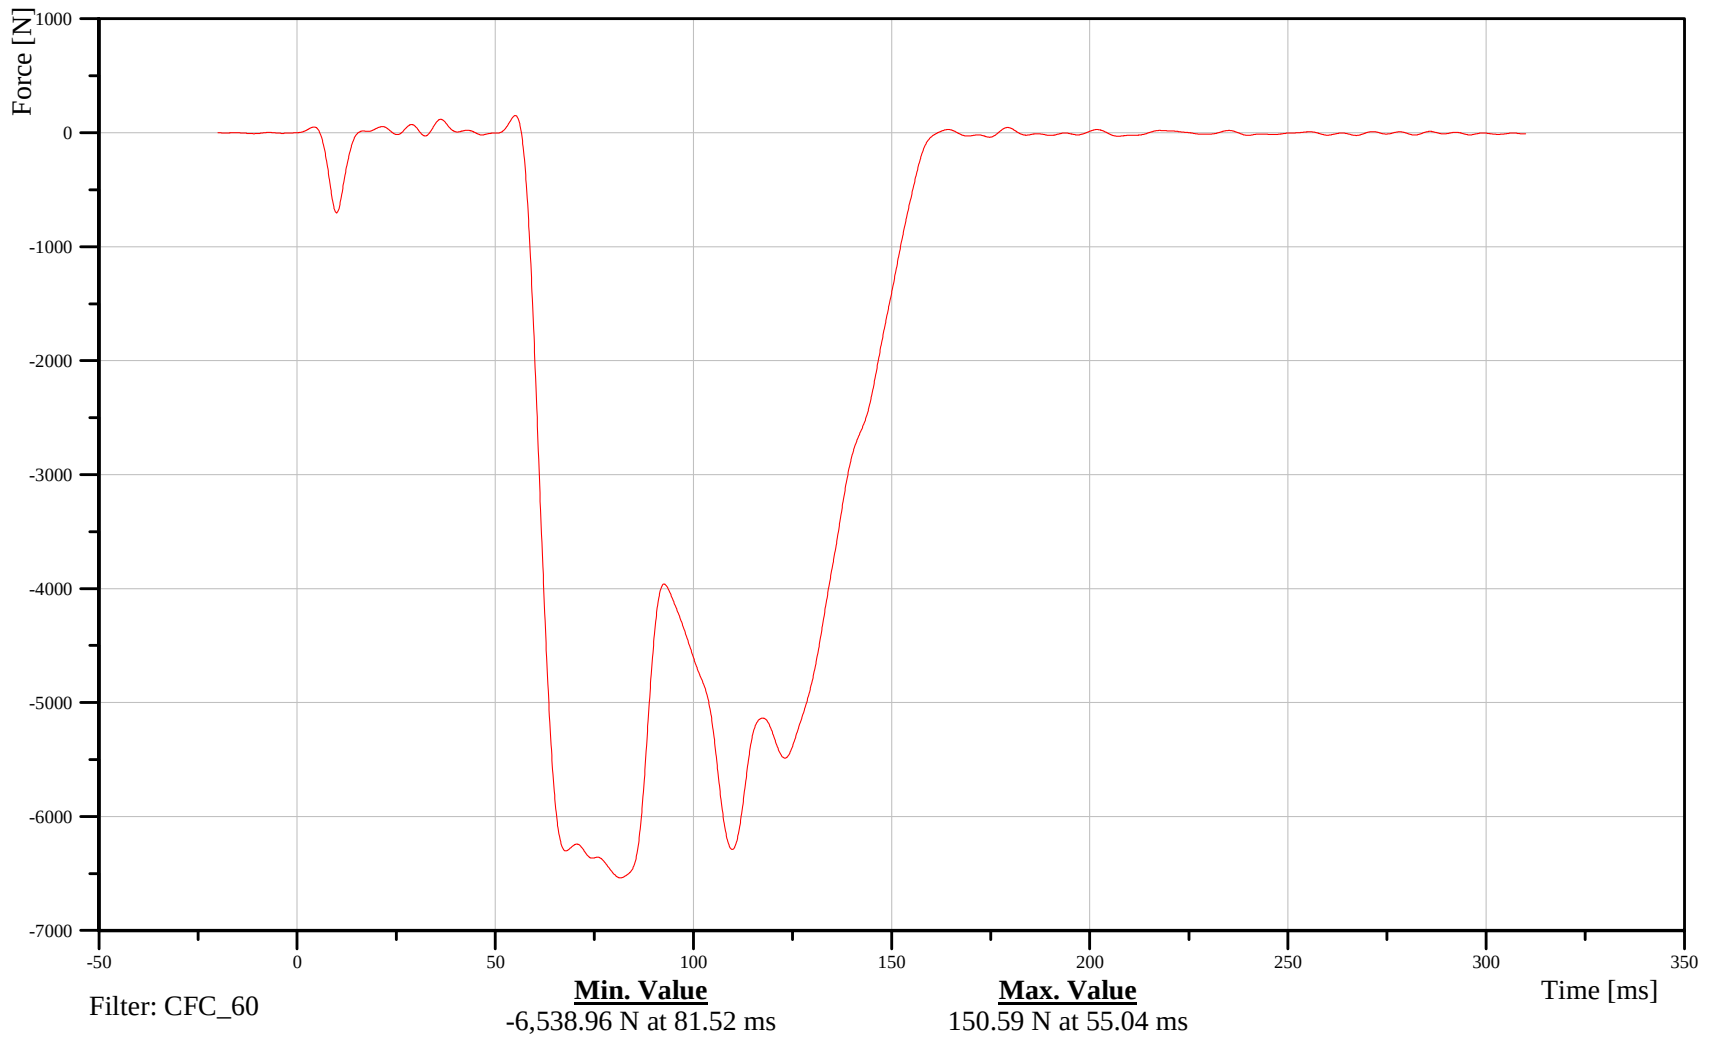

B-125

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 2

Customer: Volpe

L0FBAR000020FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

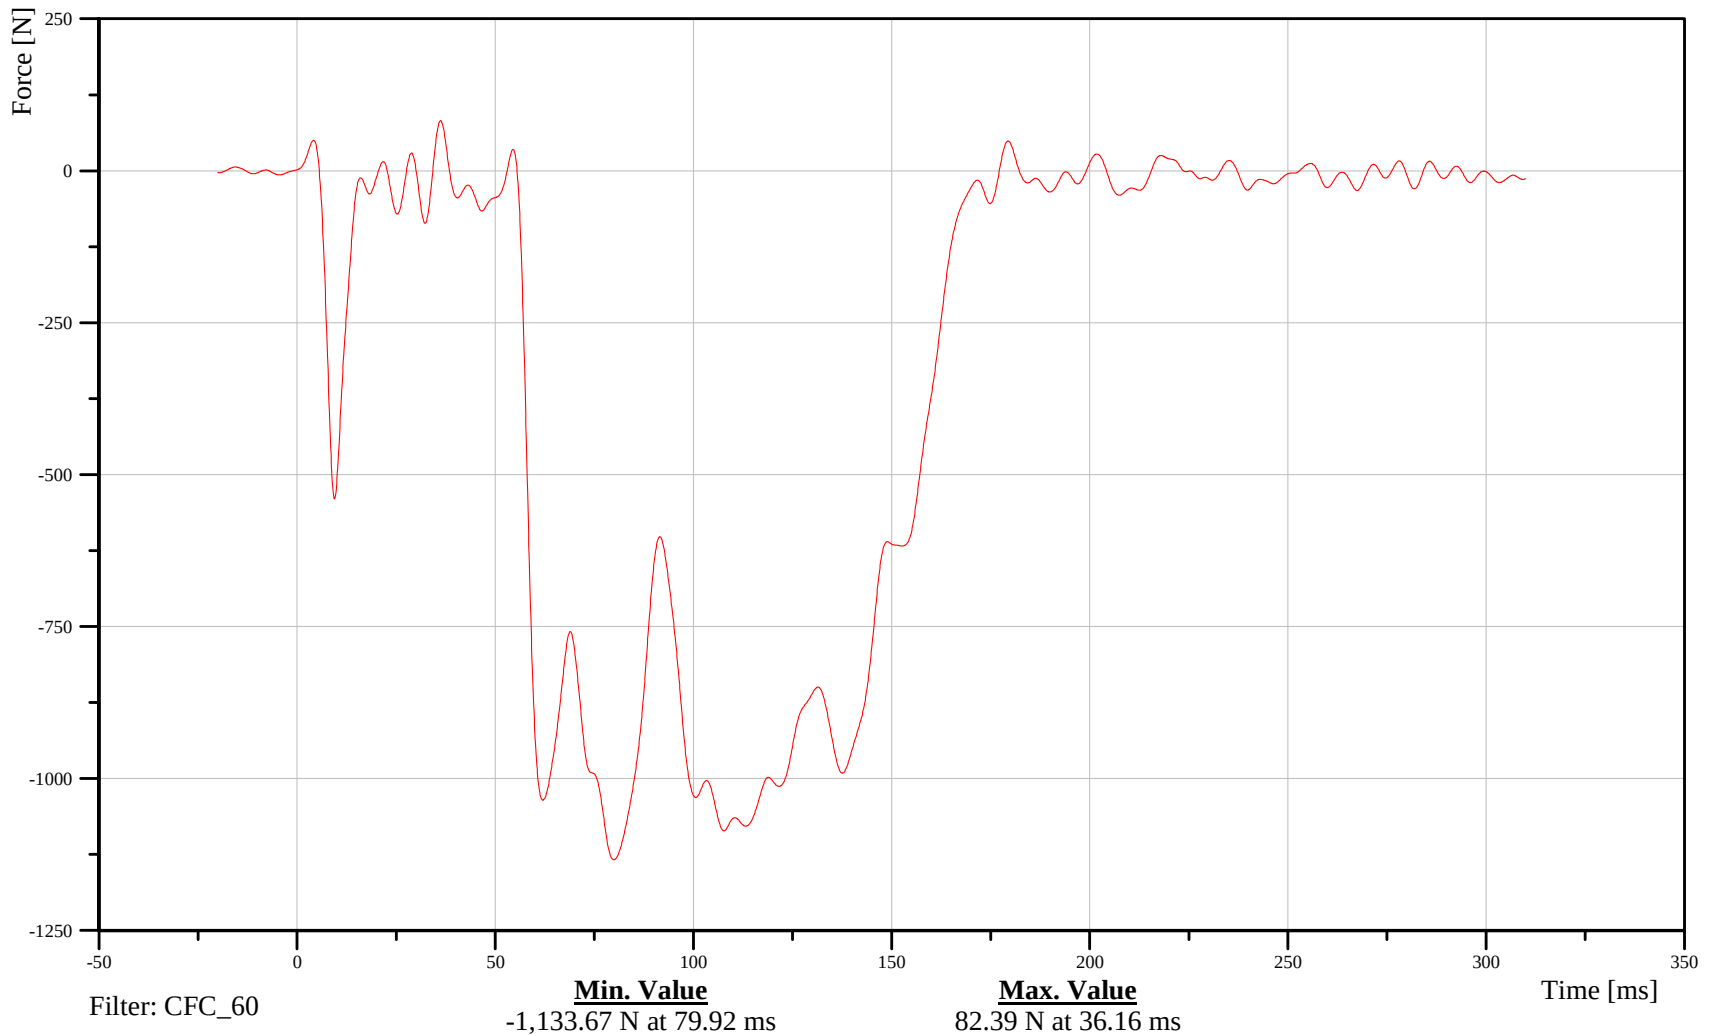

B-126

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 3

Customer: Volpe

L0FBAR000021FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

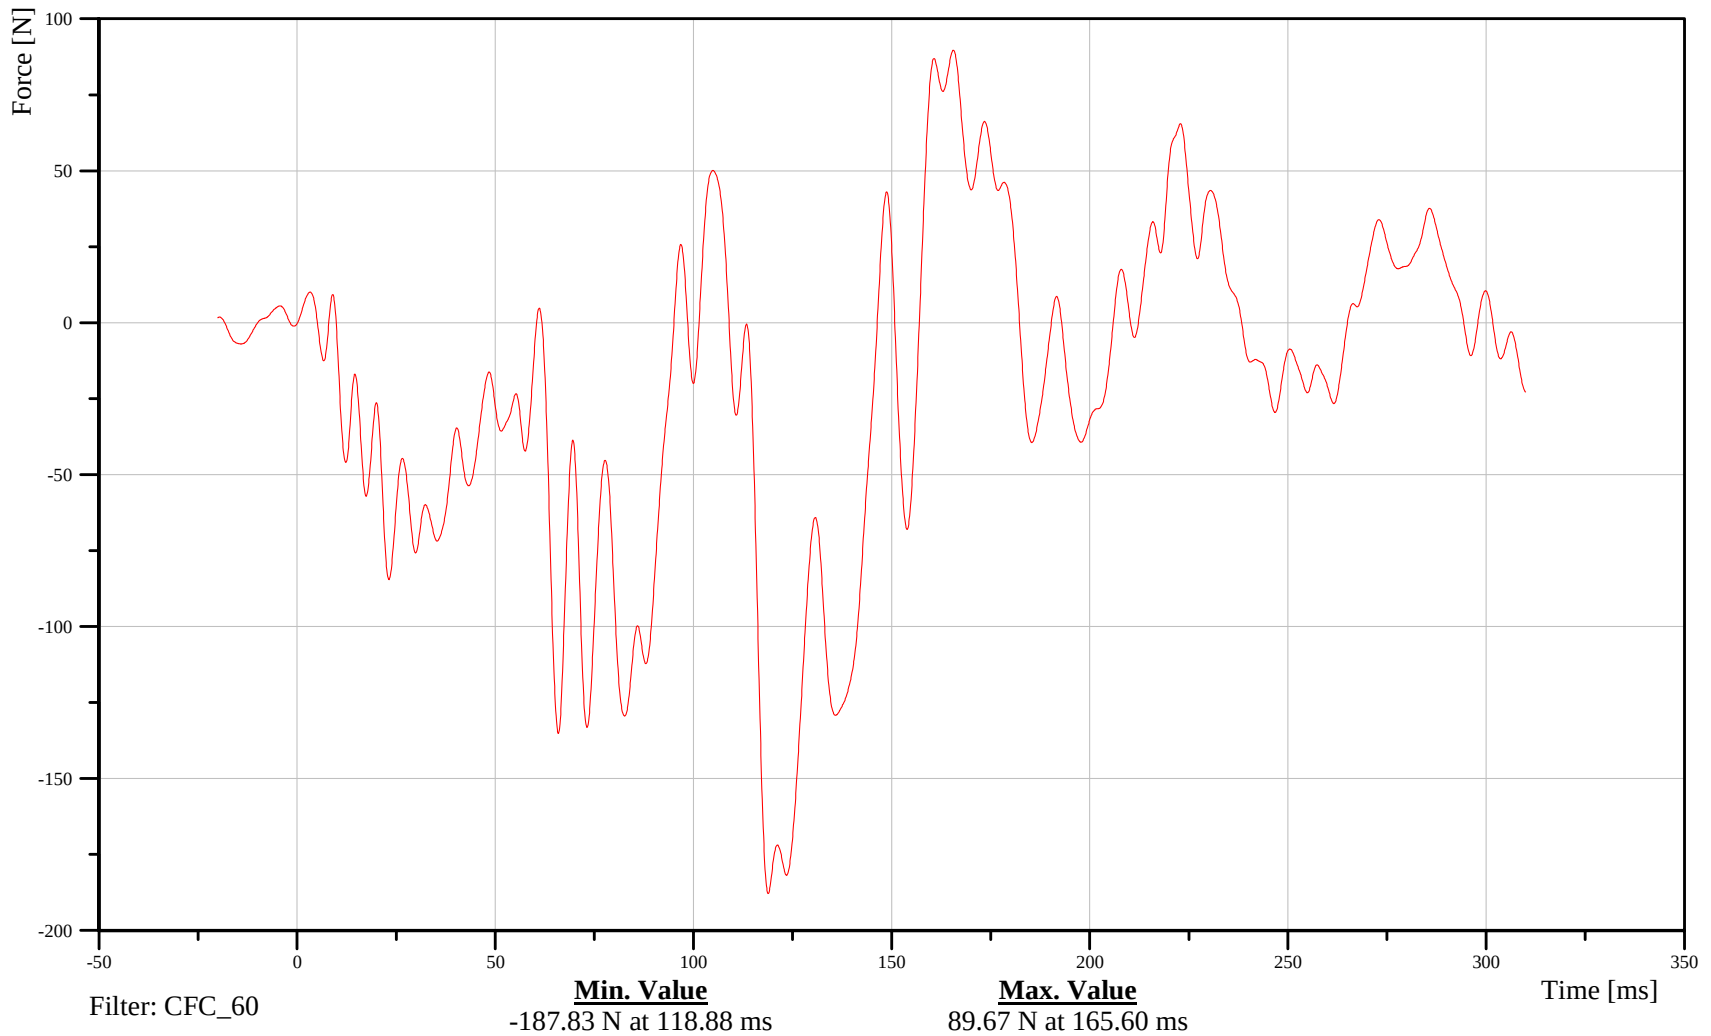

B-127

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 3

Customer: Volpe

L0FBAR000022FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

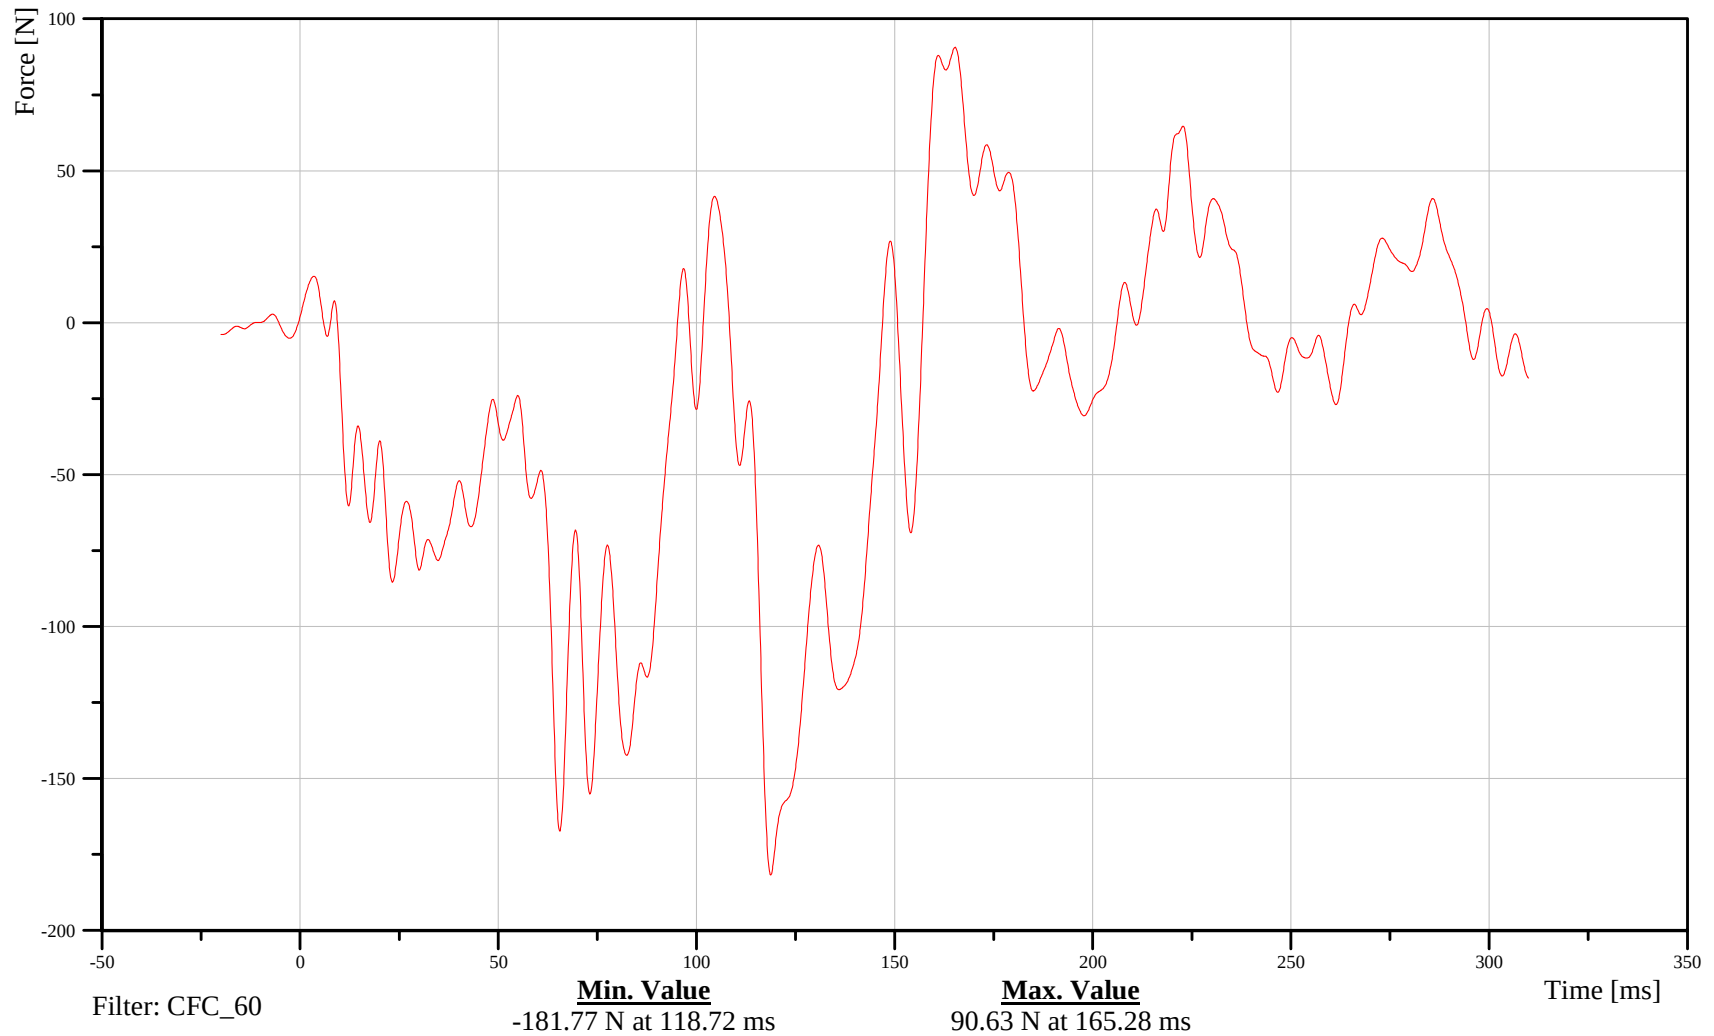

B-128

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 3

Customer: Volpe

L0FBAR000023FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

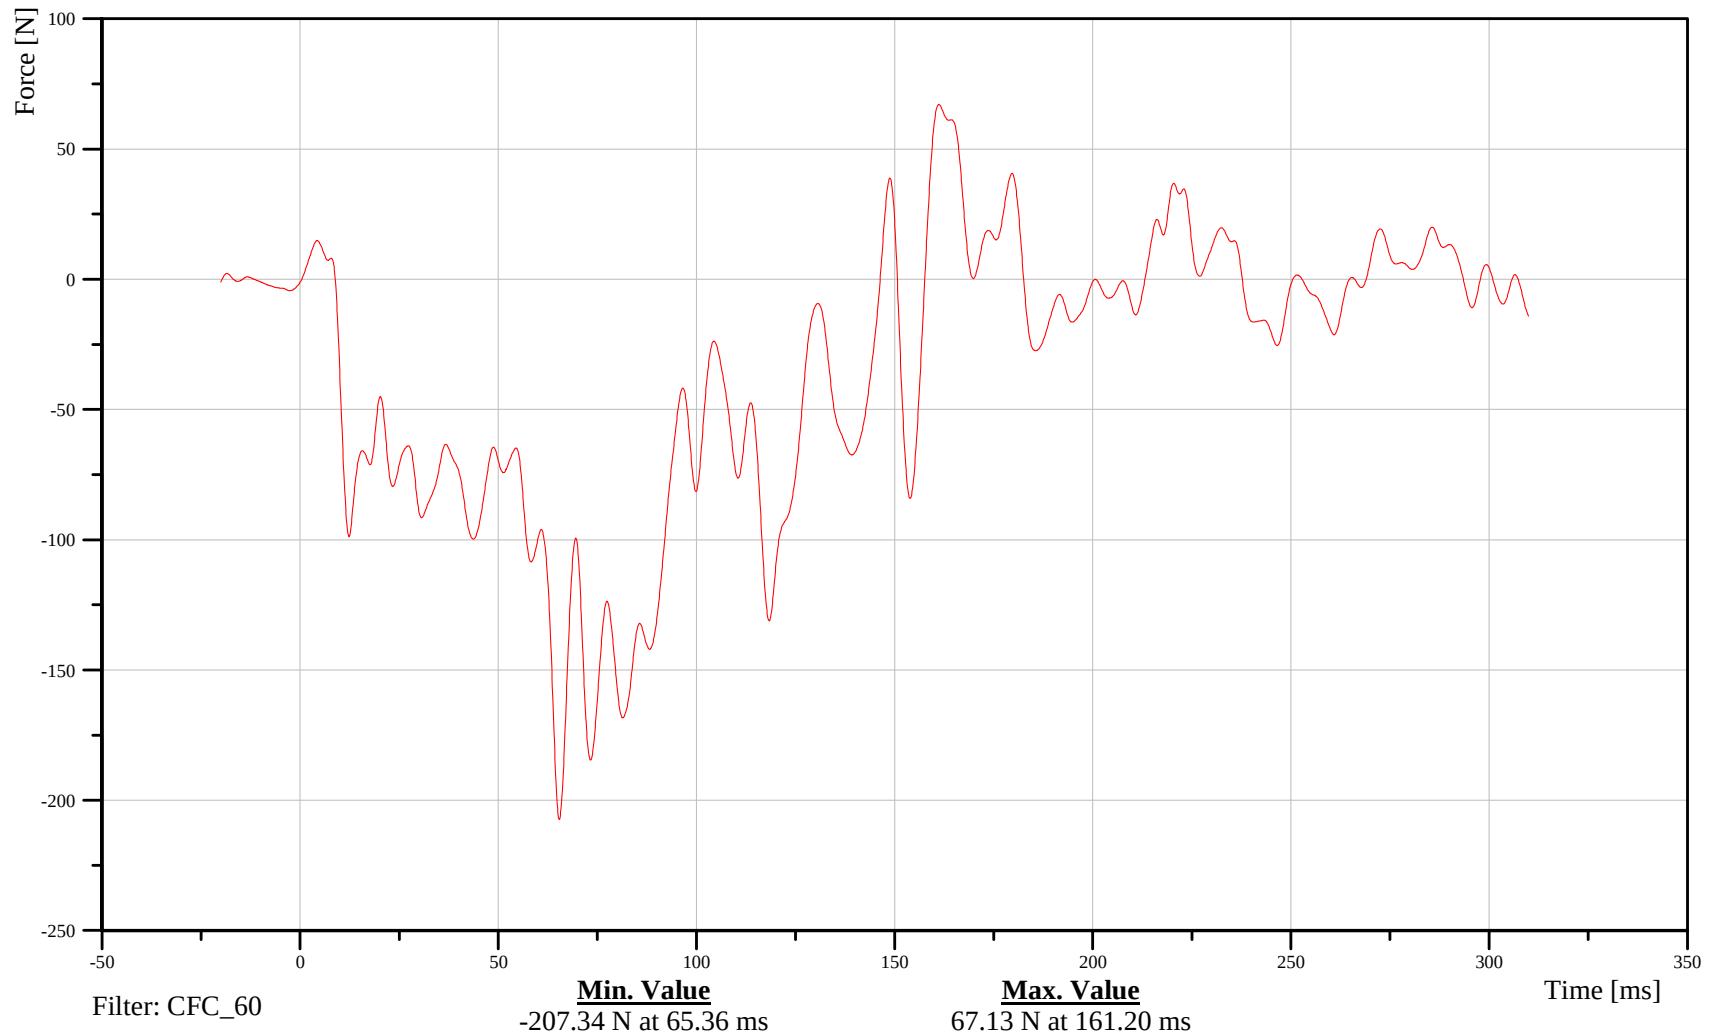

B-129

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 3

Customer: Volpe

L0FBAR000024FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

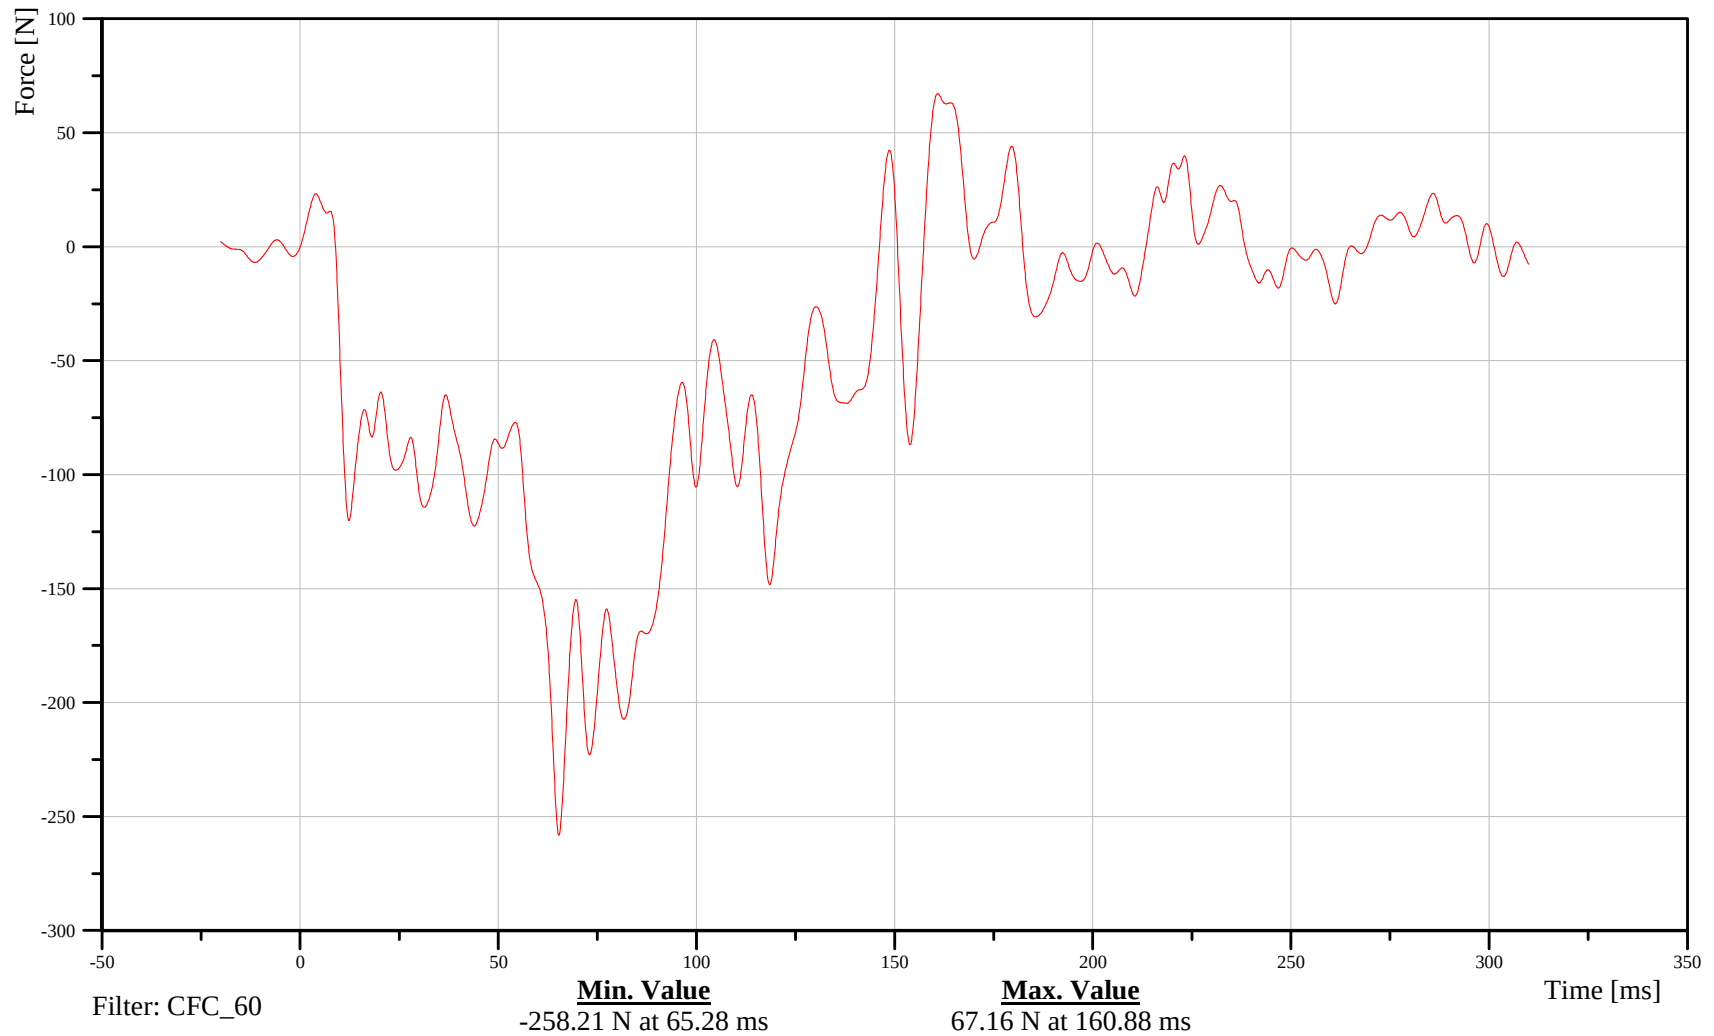

B-130

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 3

Customer: Volpe

L0FBAR000025FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

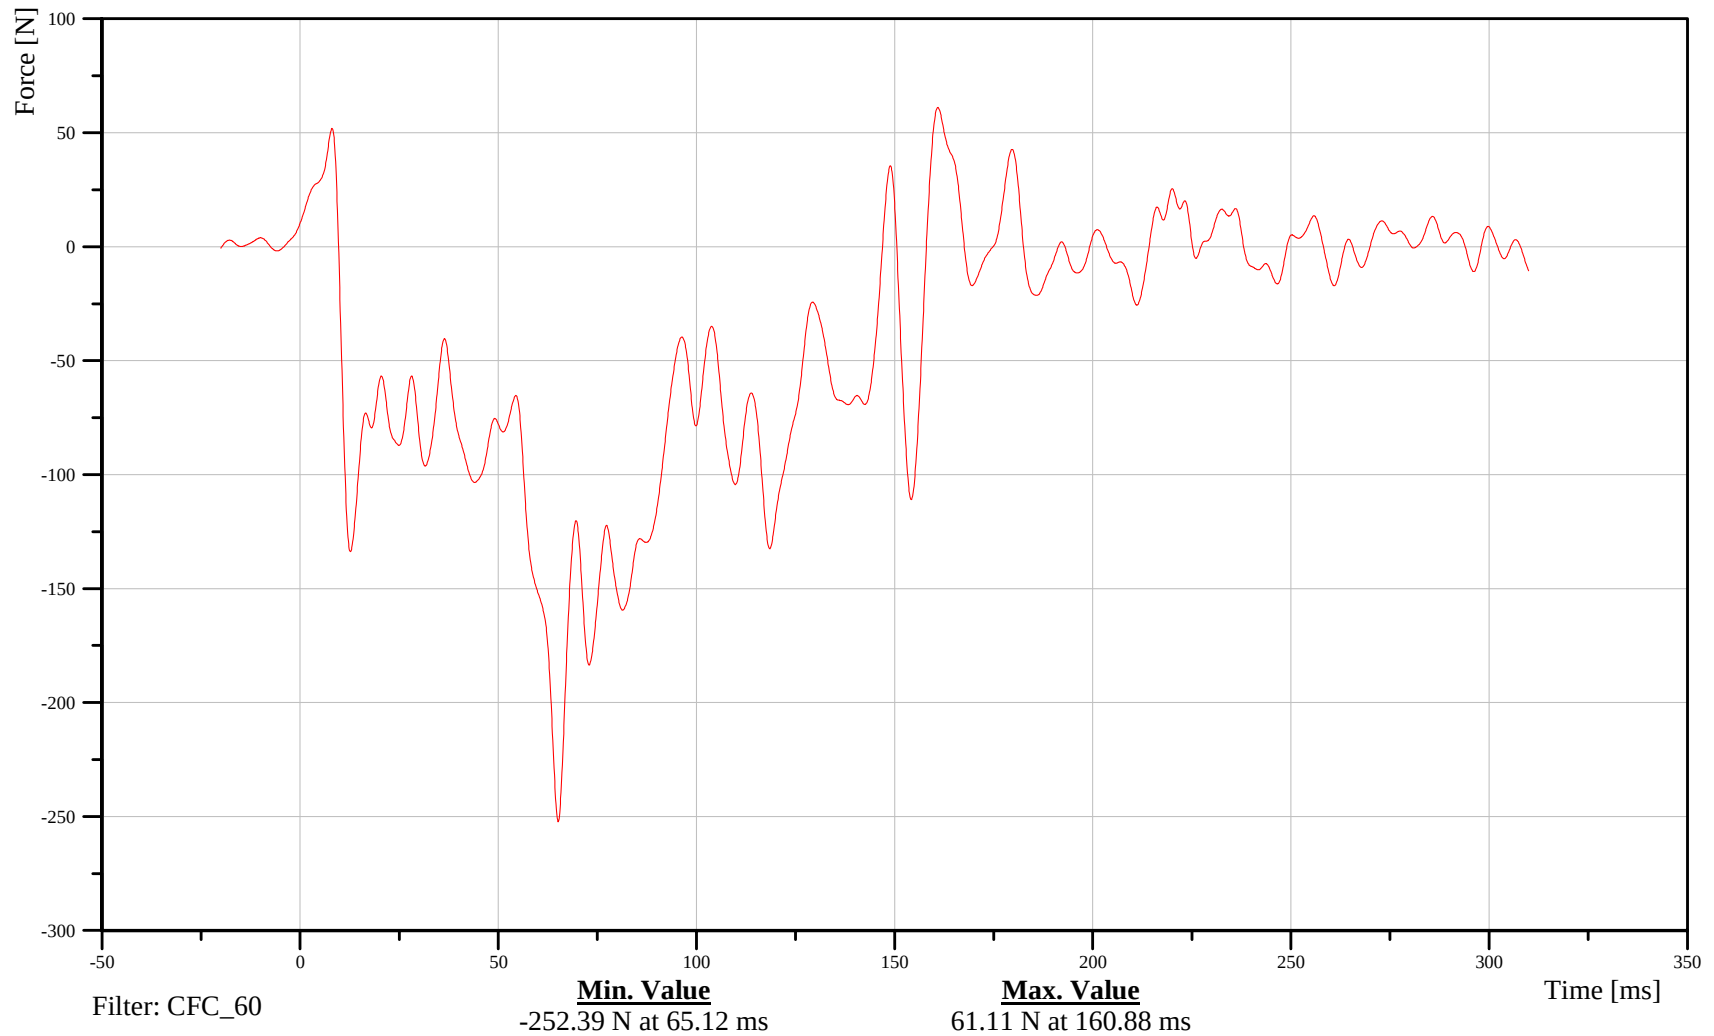

B-131

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 3

Customer: Volpe

L0FBAR000026FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

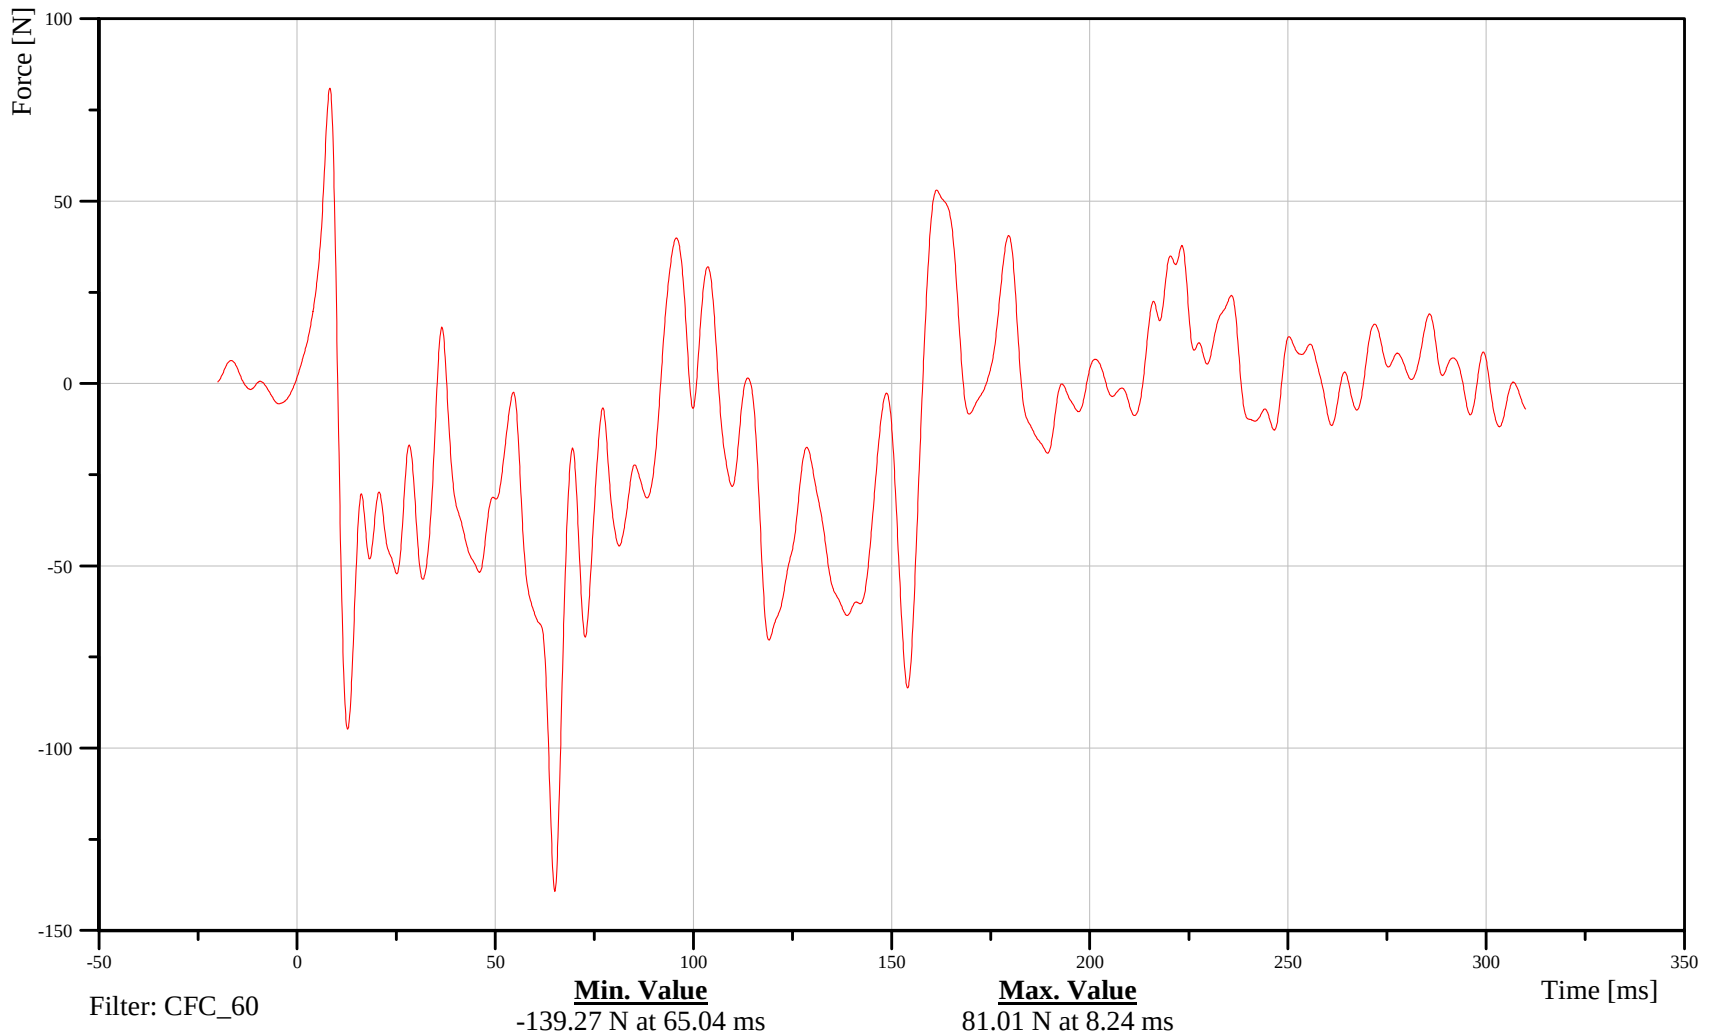

B-132

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 3


Time: 18:05

Customer: Volpe

L0FBAR000027FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

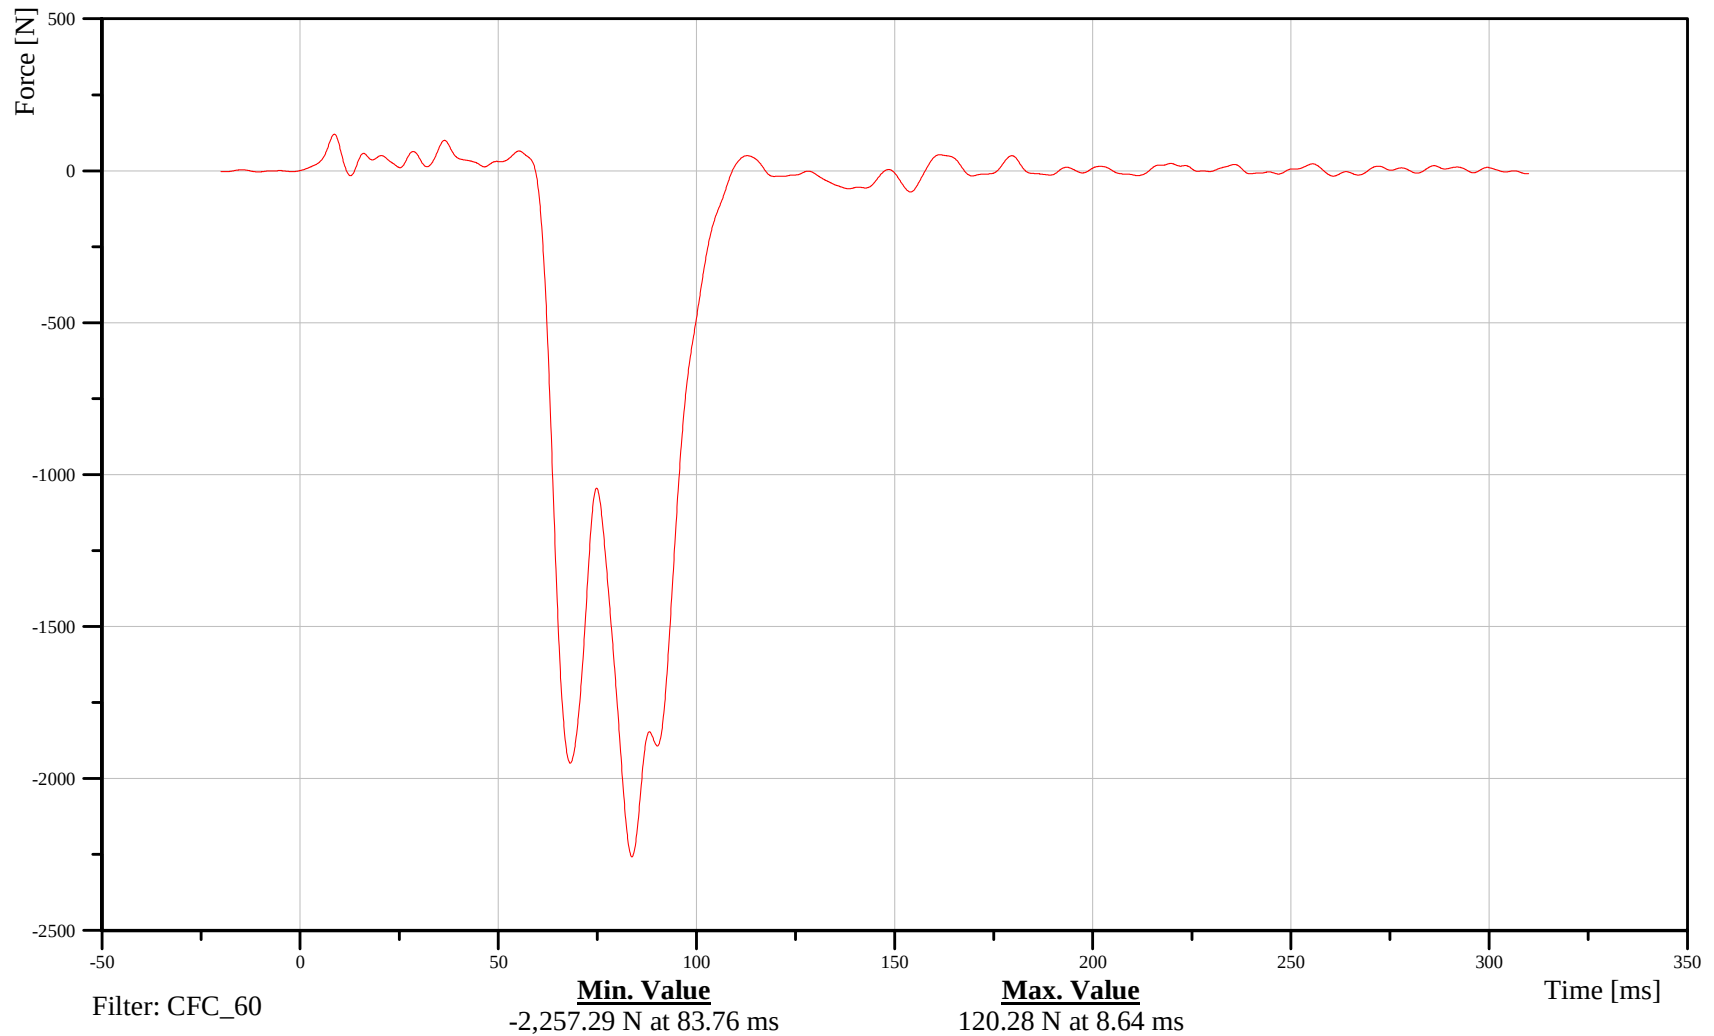

B-133

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 8 Column 3


Time: 18:05

Customer: Volpe

L0FBAR000028FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

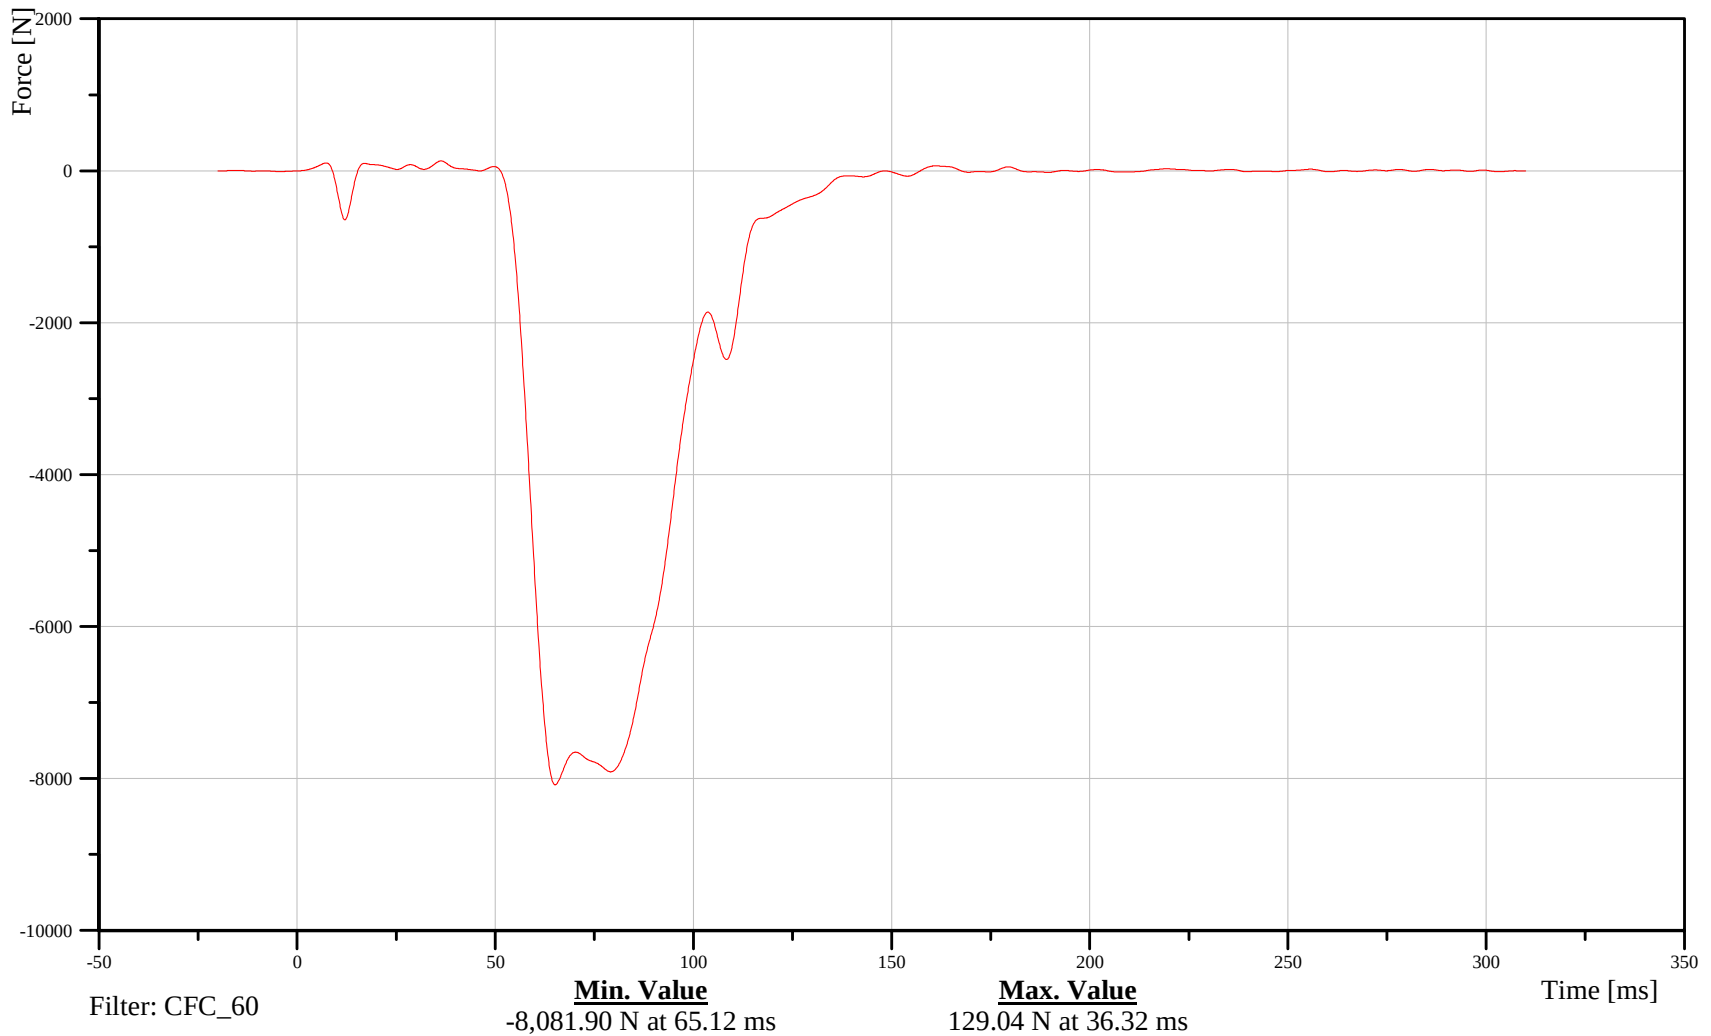

B-134

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 9 Column 3


Time: 18:05

Customer: Volpe

L0FBAR000029FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

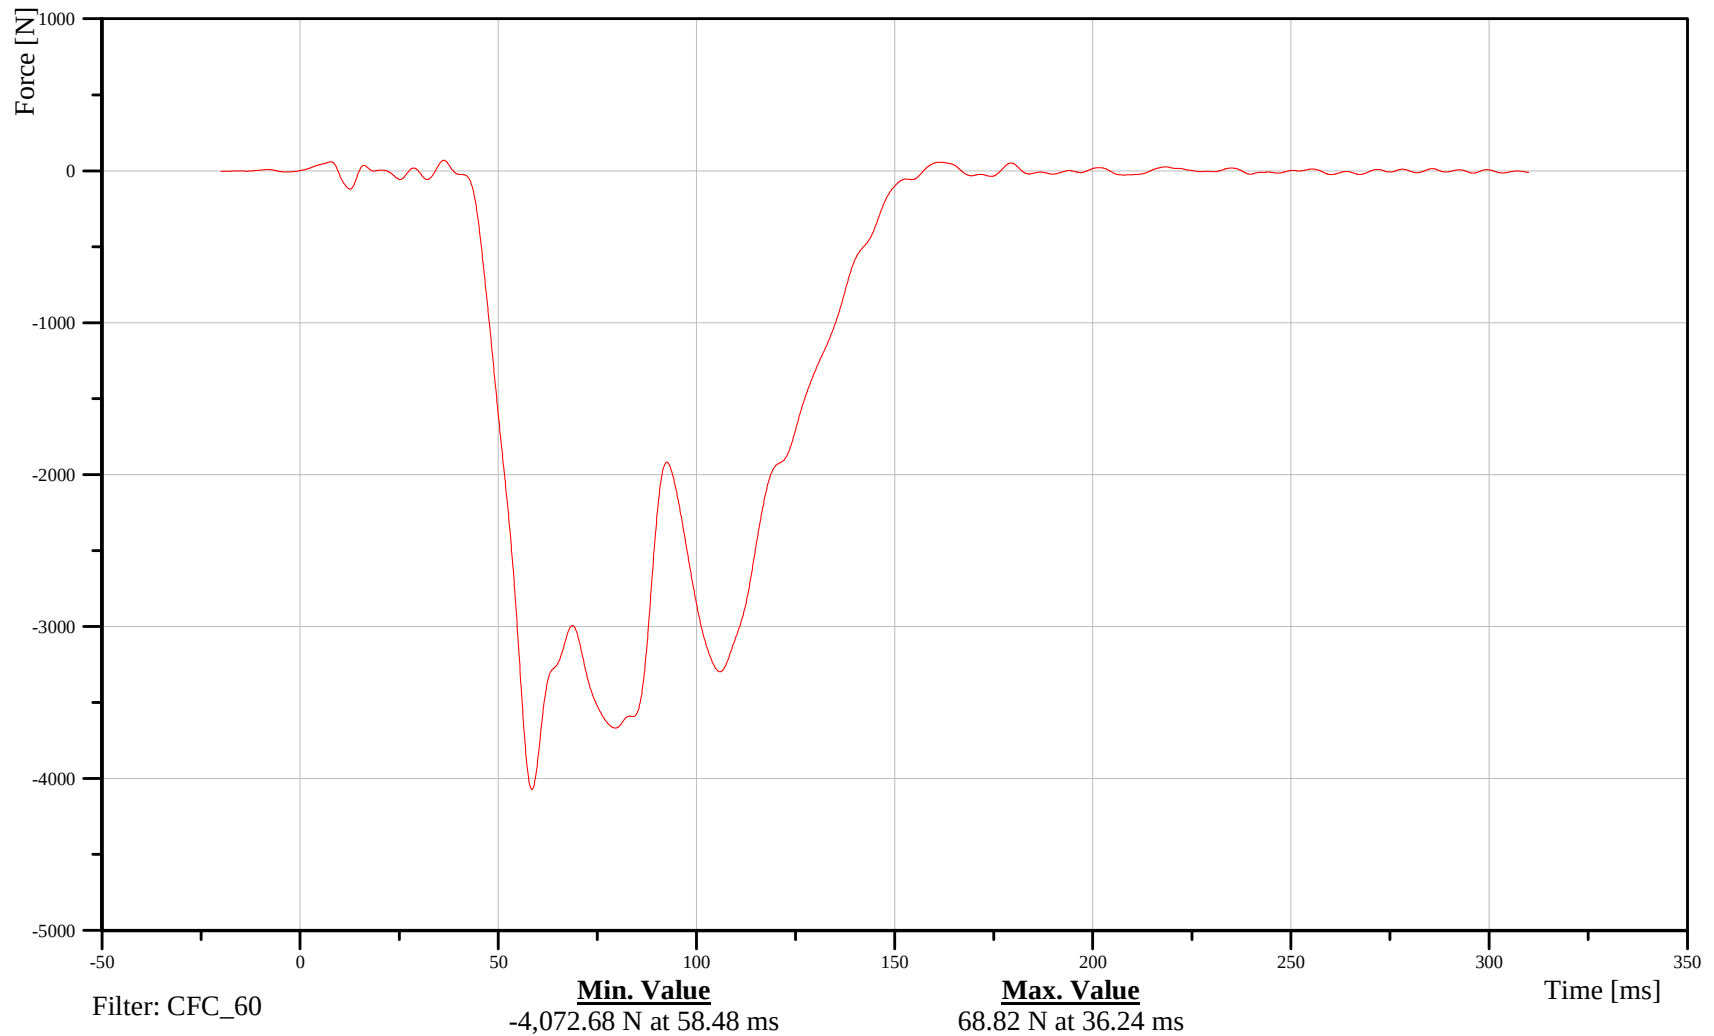

B-135

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 3

Customer: Volpe

L0FBAR000030FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

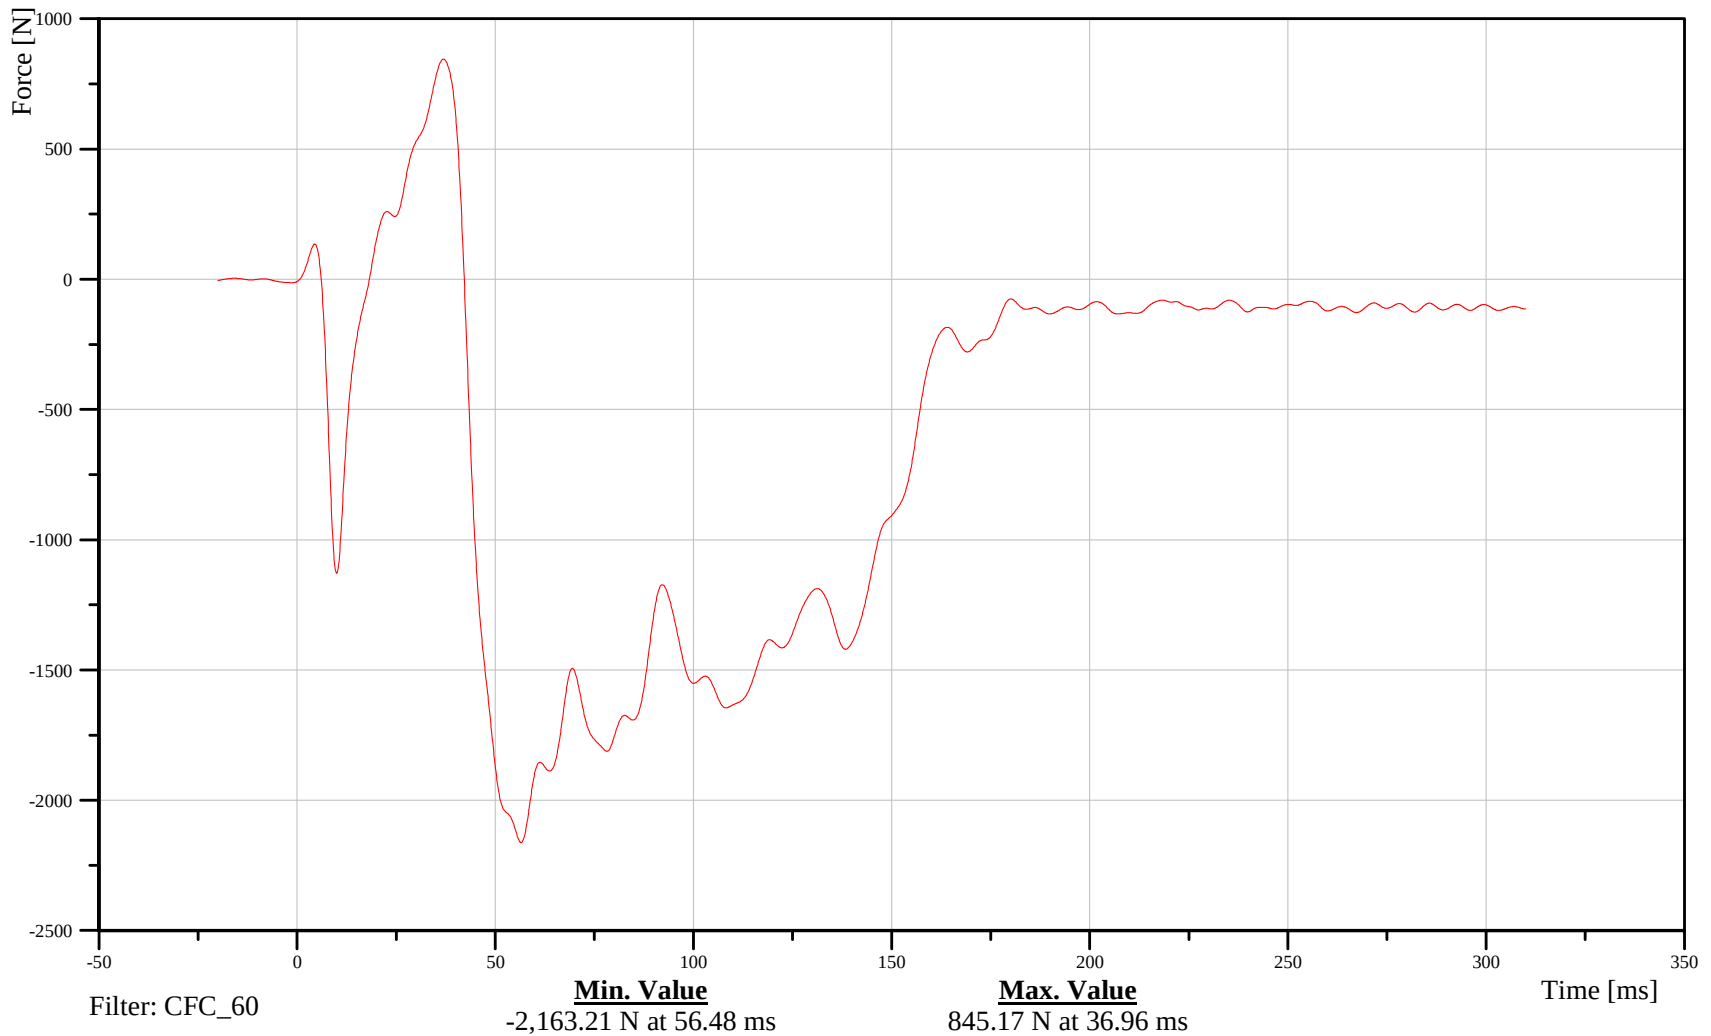

B-136

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 1 Column 4

Customer: Volpe

L0FBAR000031FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

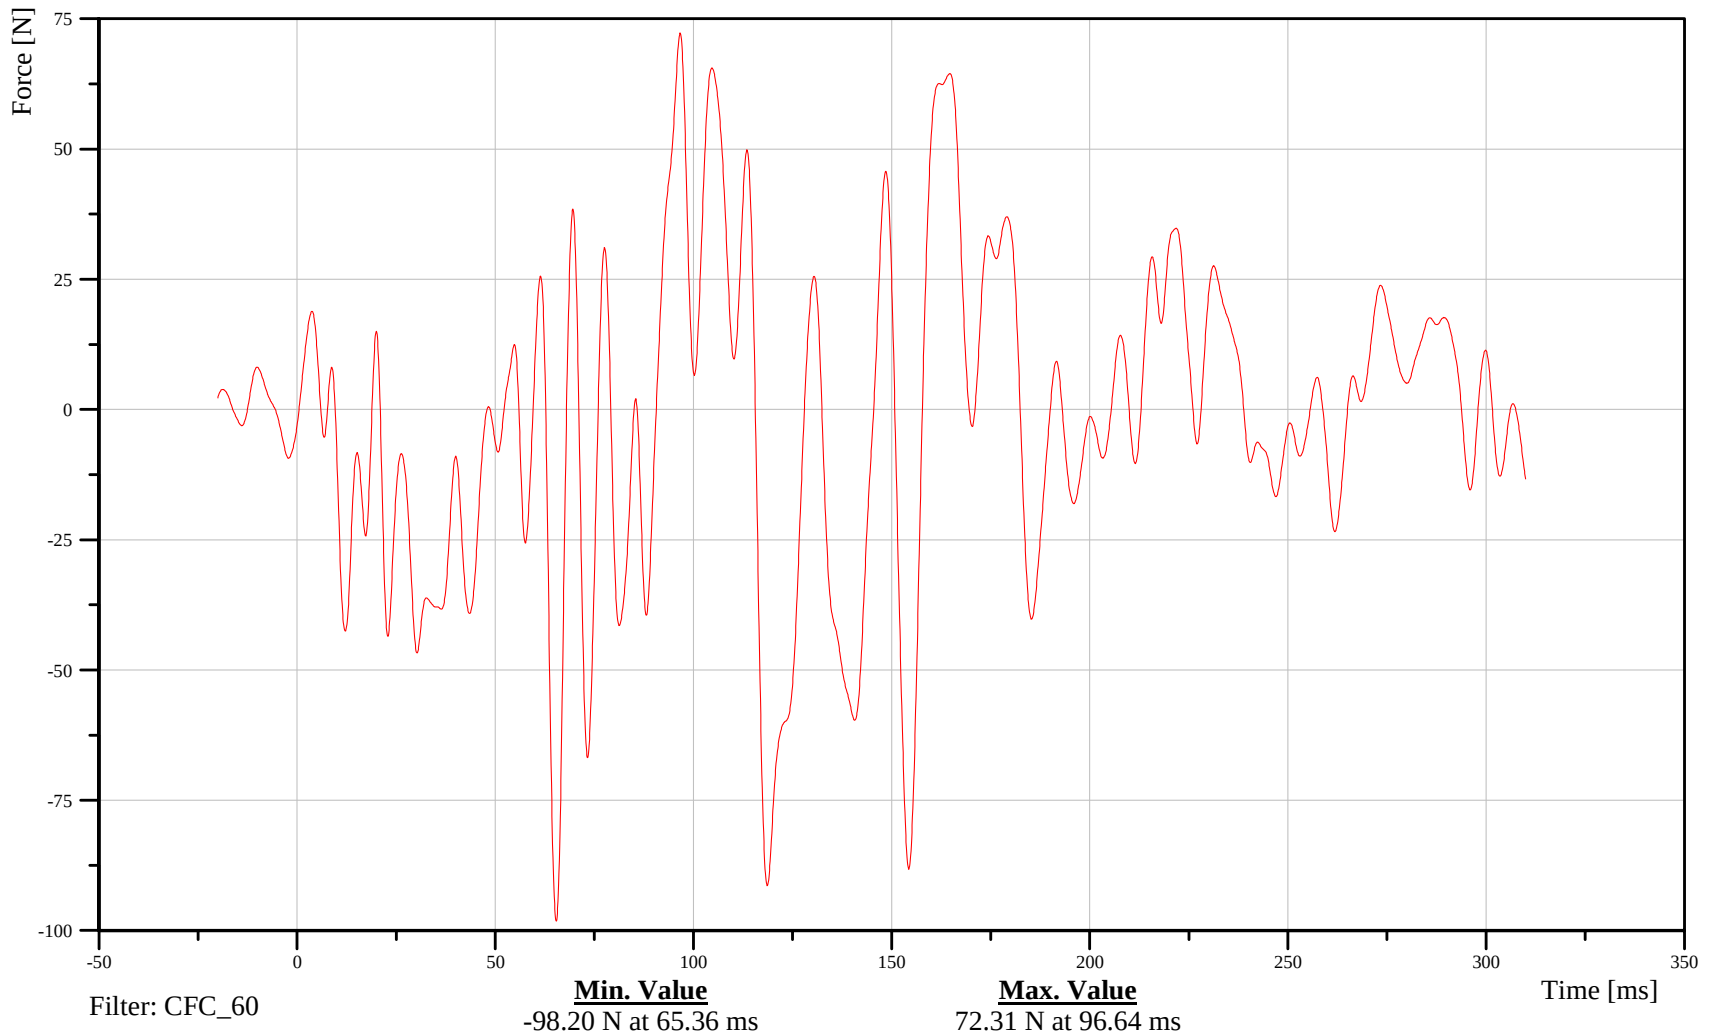

B-137

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 4

Customer: Volpe

L0FBAR000032FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

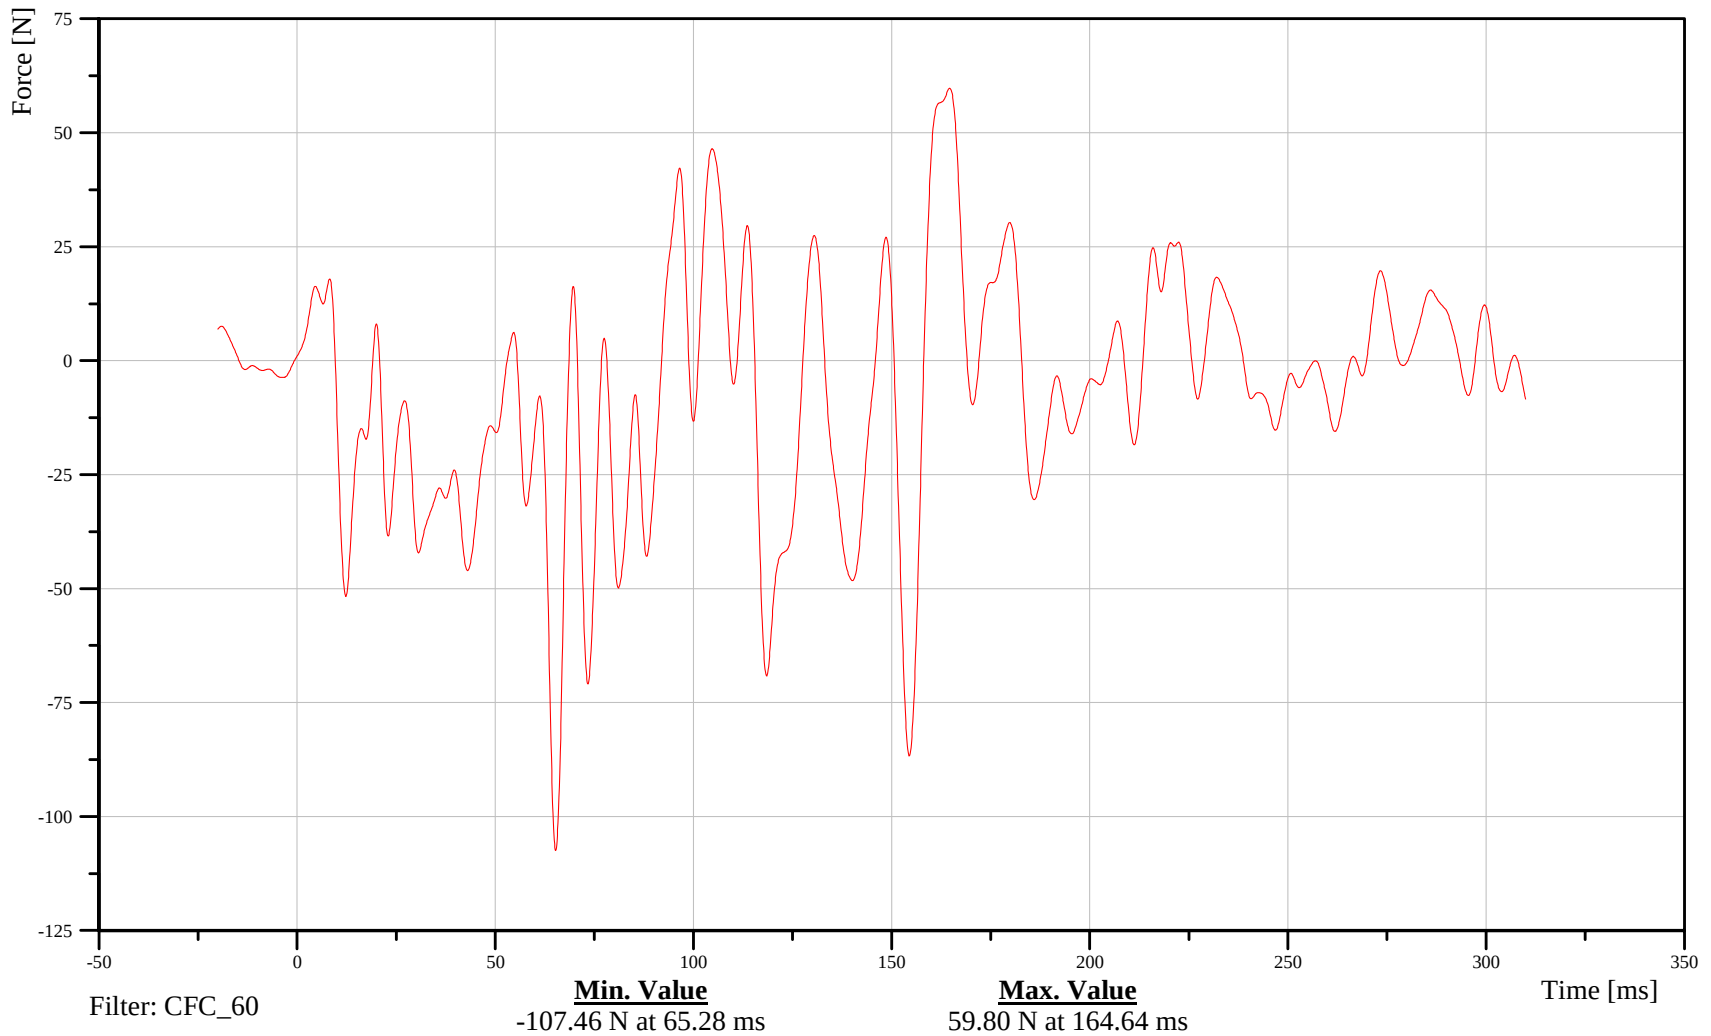

B-138

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 4

Customer: Volpe

L0FBAR000033FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

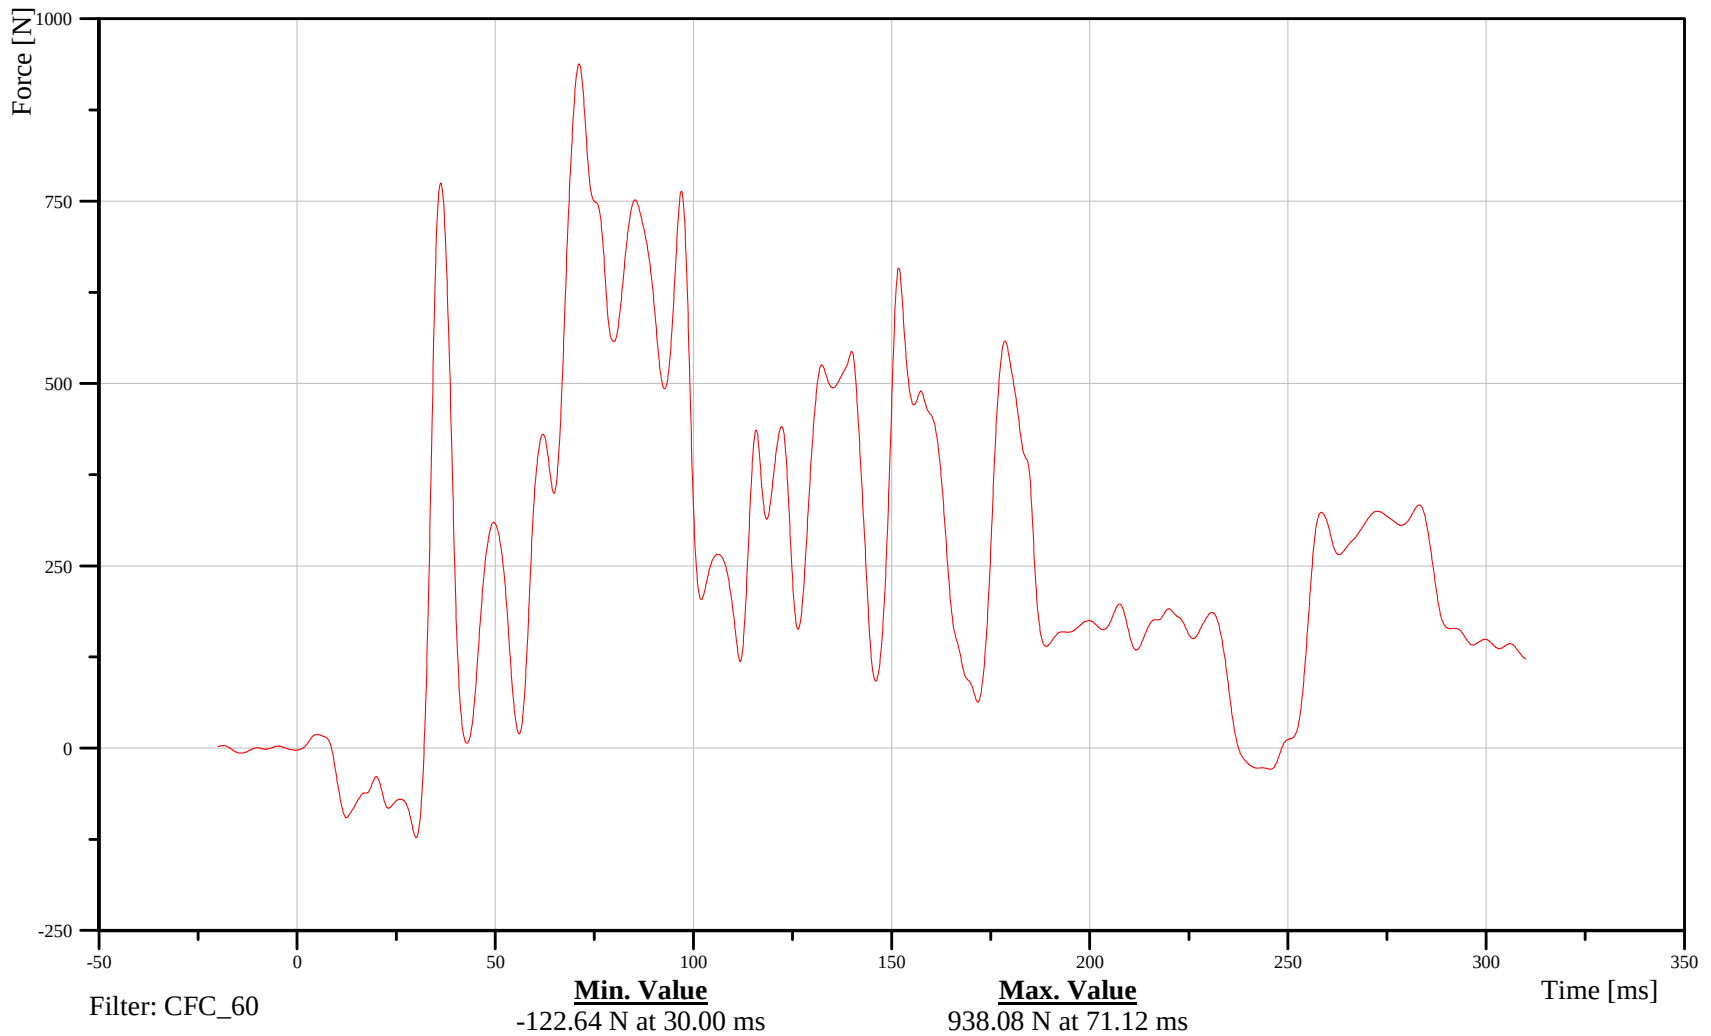

B-139

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 4

Customer: Volpe

L0FBAR000034FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

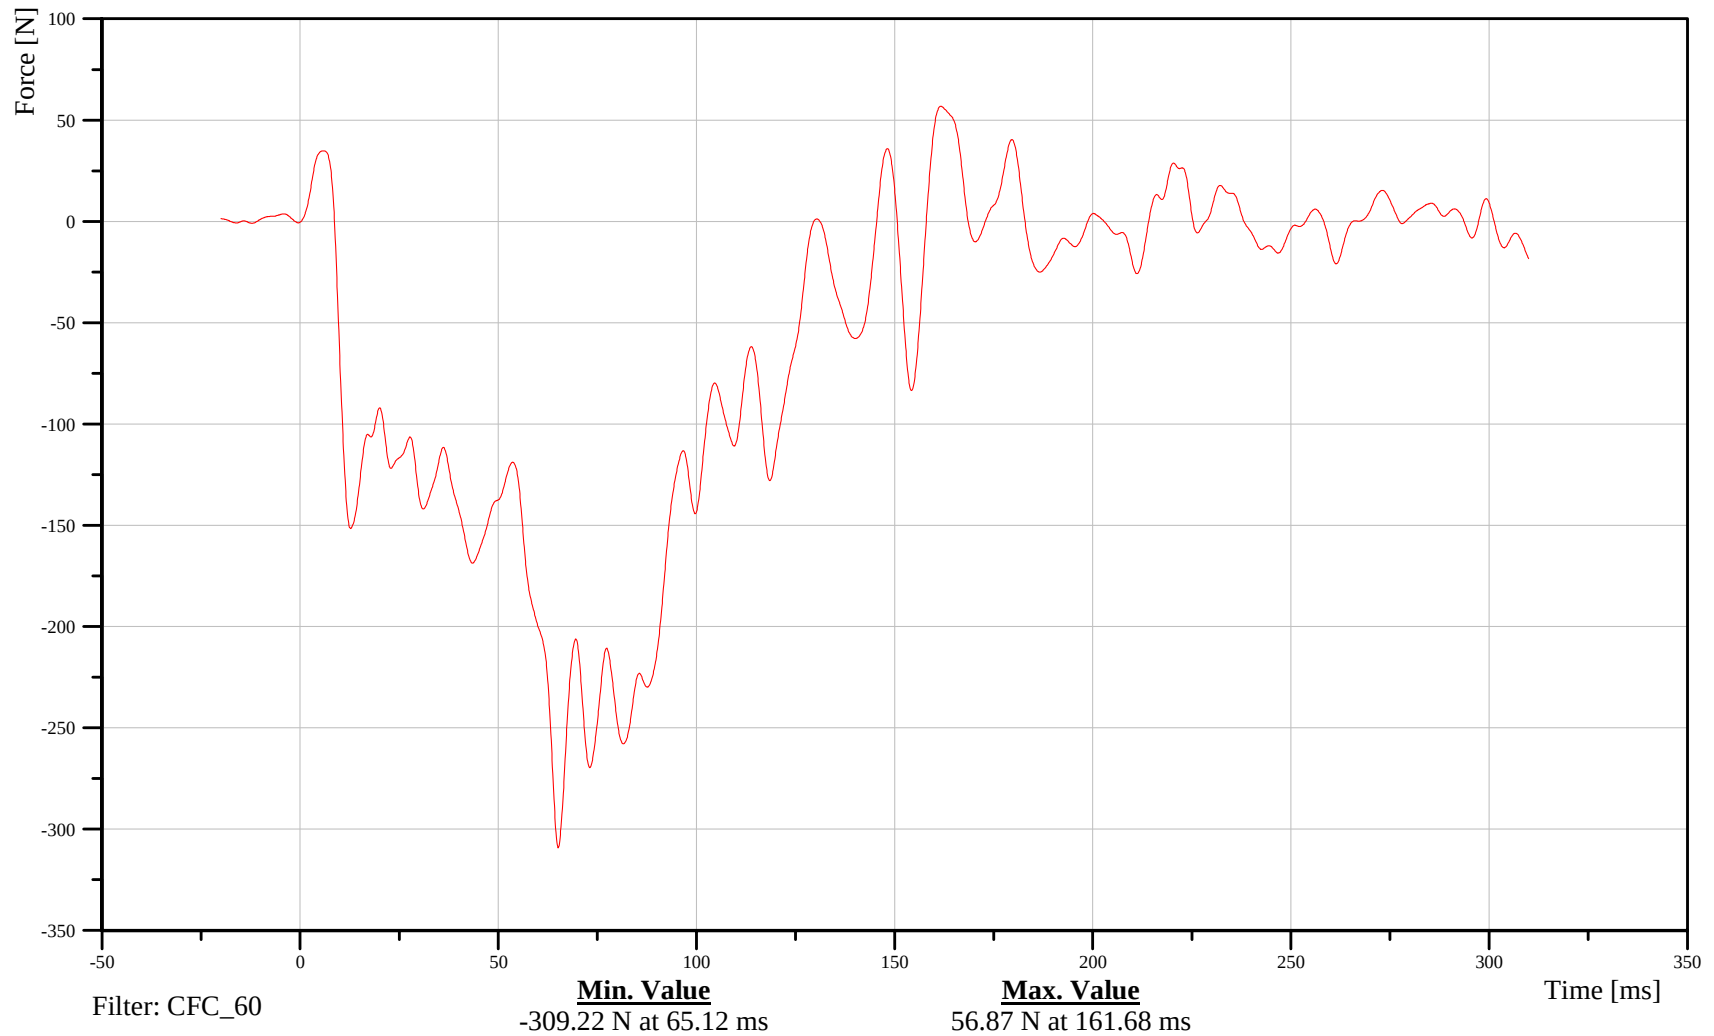

B-140

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 4

Customer: Volpe

L0FBAR000035FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

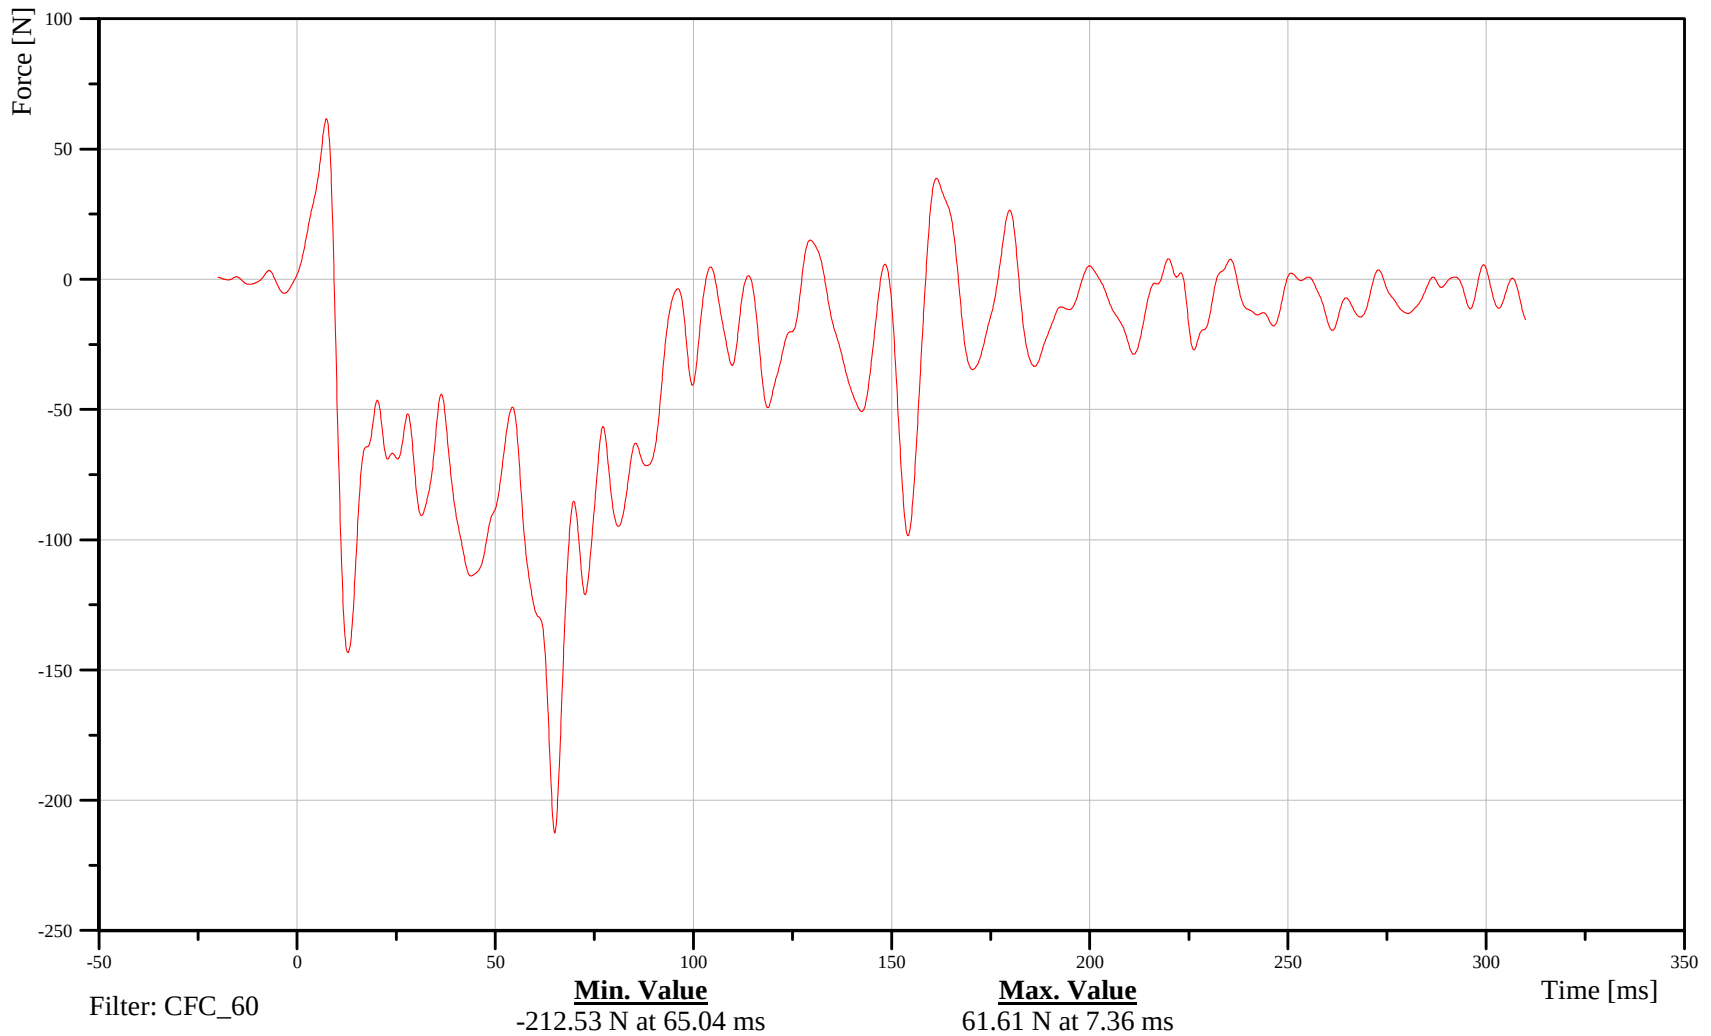

B-141

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 4

Customer: Volpe

L0FBAR000036FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

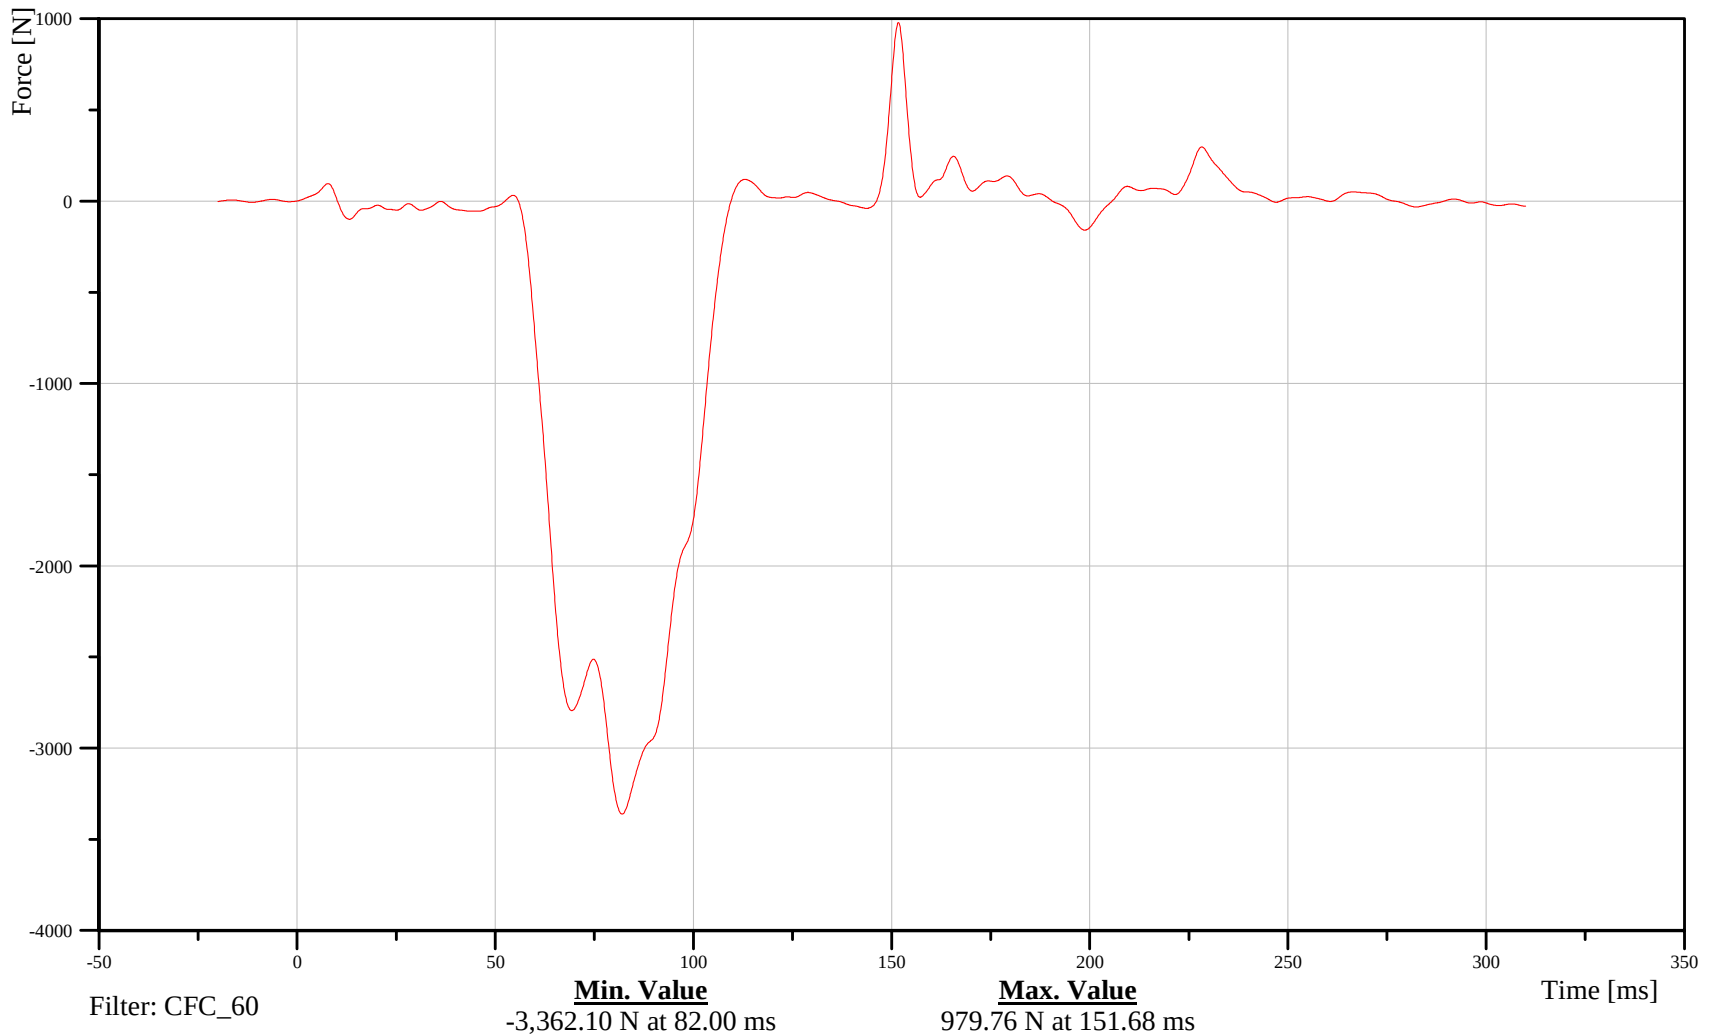

B-142

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 7 Column 4

Customer: Volpe

L0FBAR000037FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

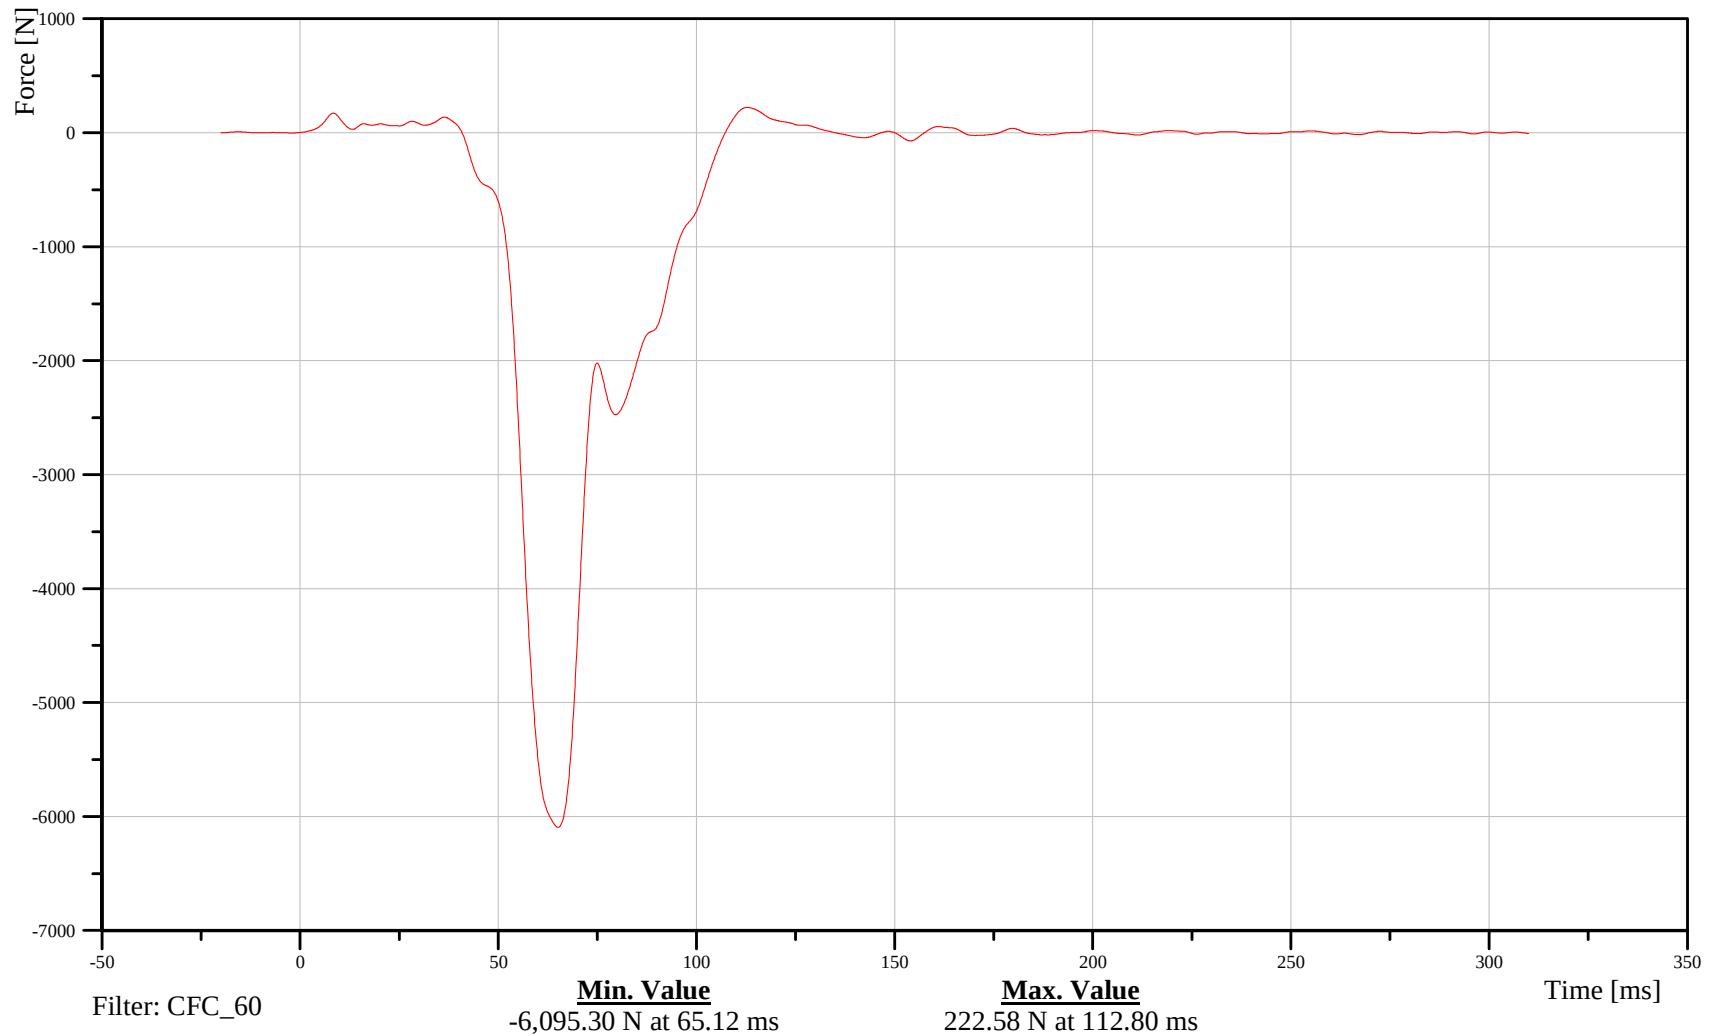

B-143

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 8 Column 4

Customer: Volpe

L0FBAR000038FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

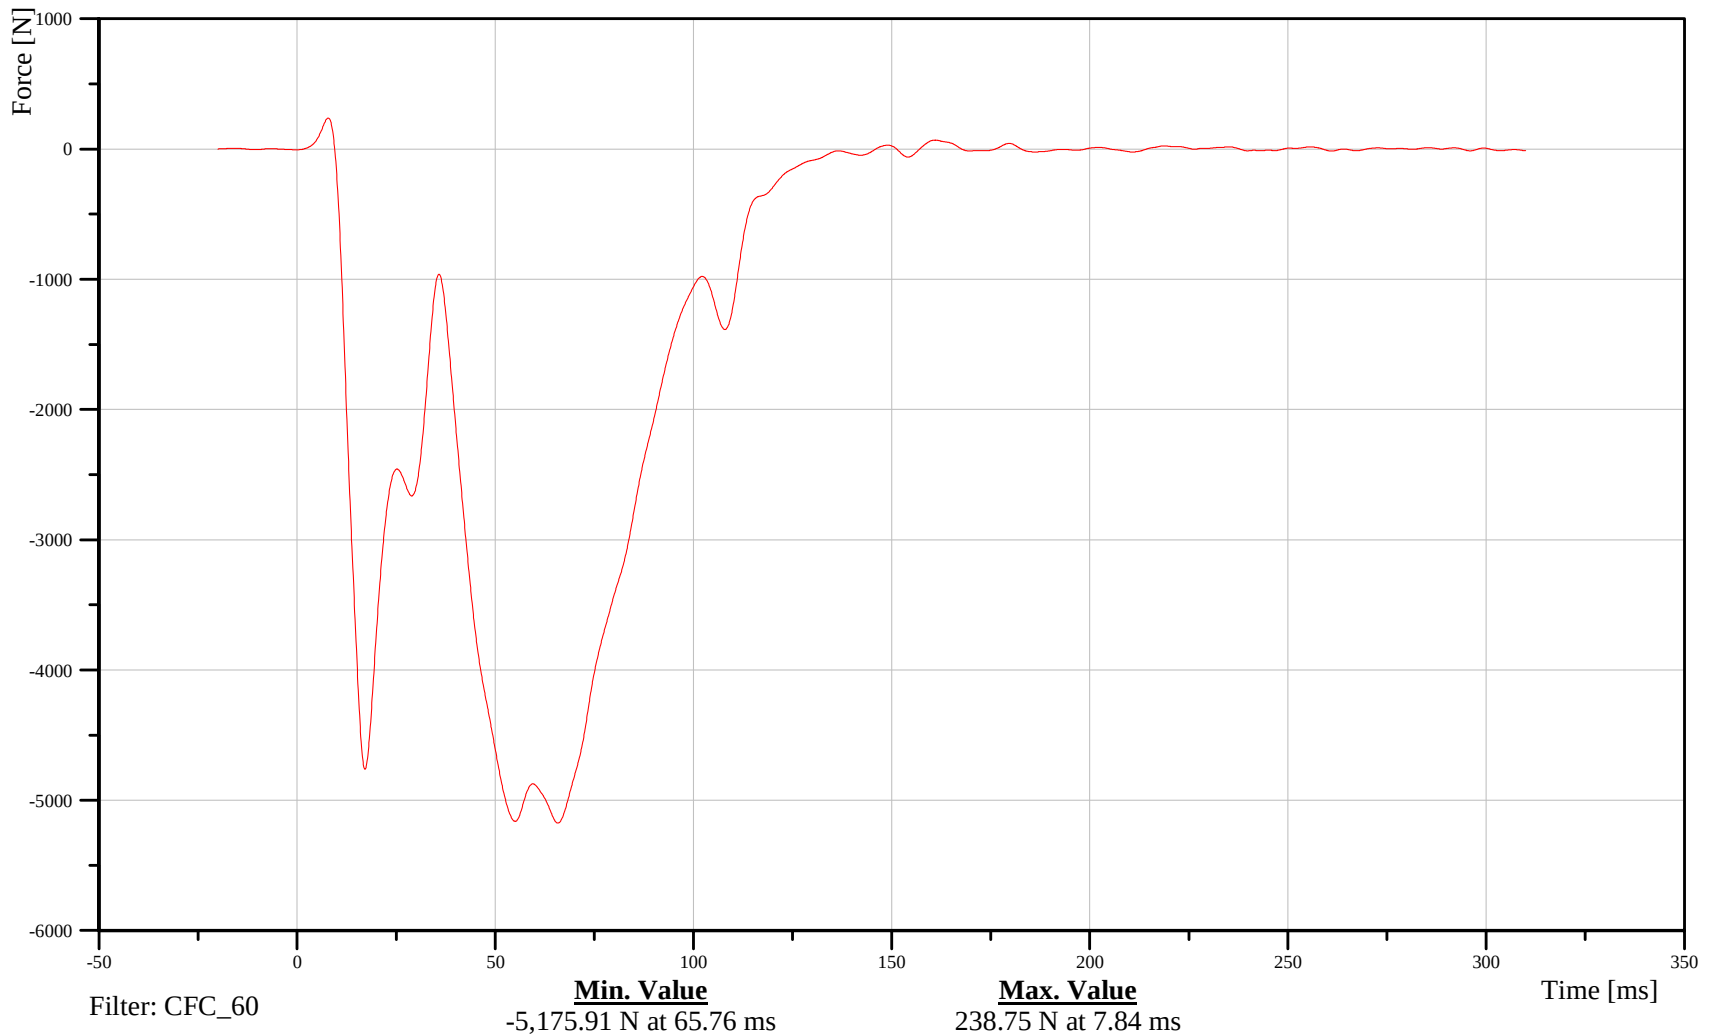

B-144

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 4

Customer: Volpe

L0FBAR000039FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

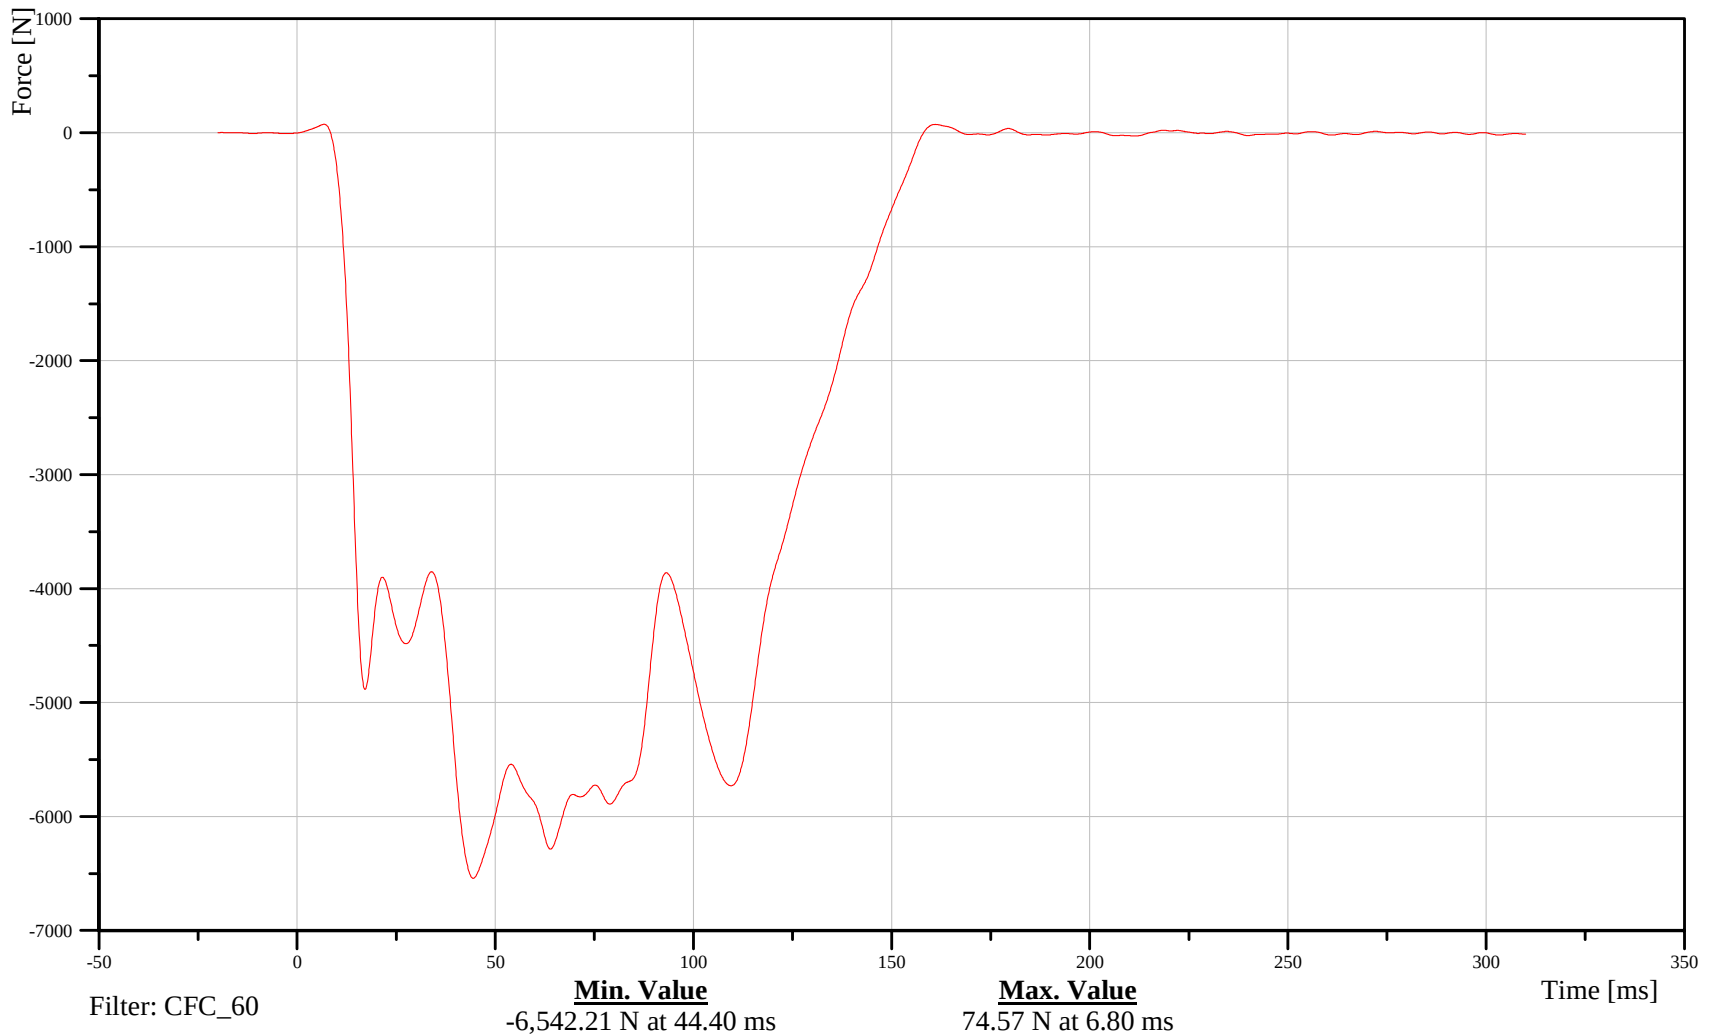

B-145

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 4

Customer: Volpe

L0FBAR000040FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

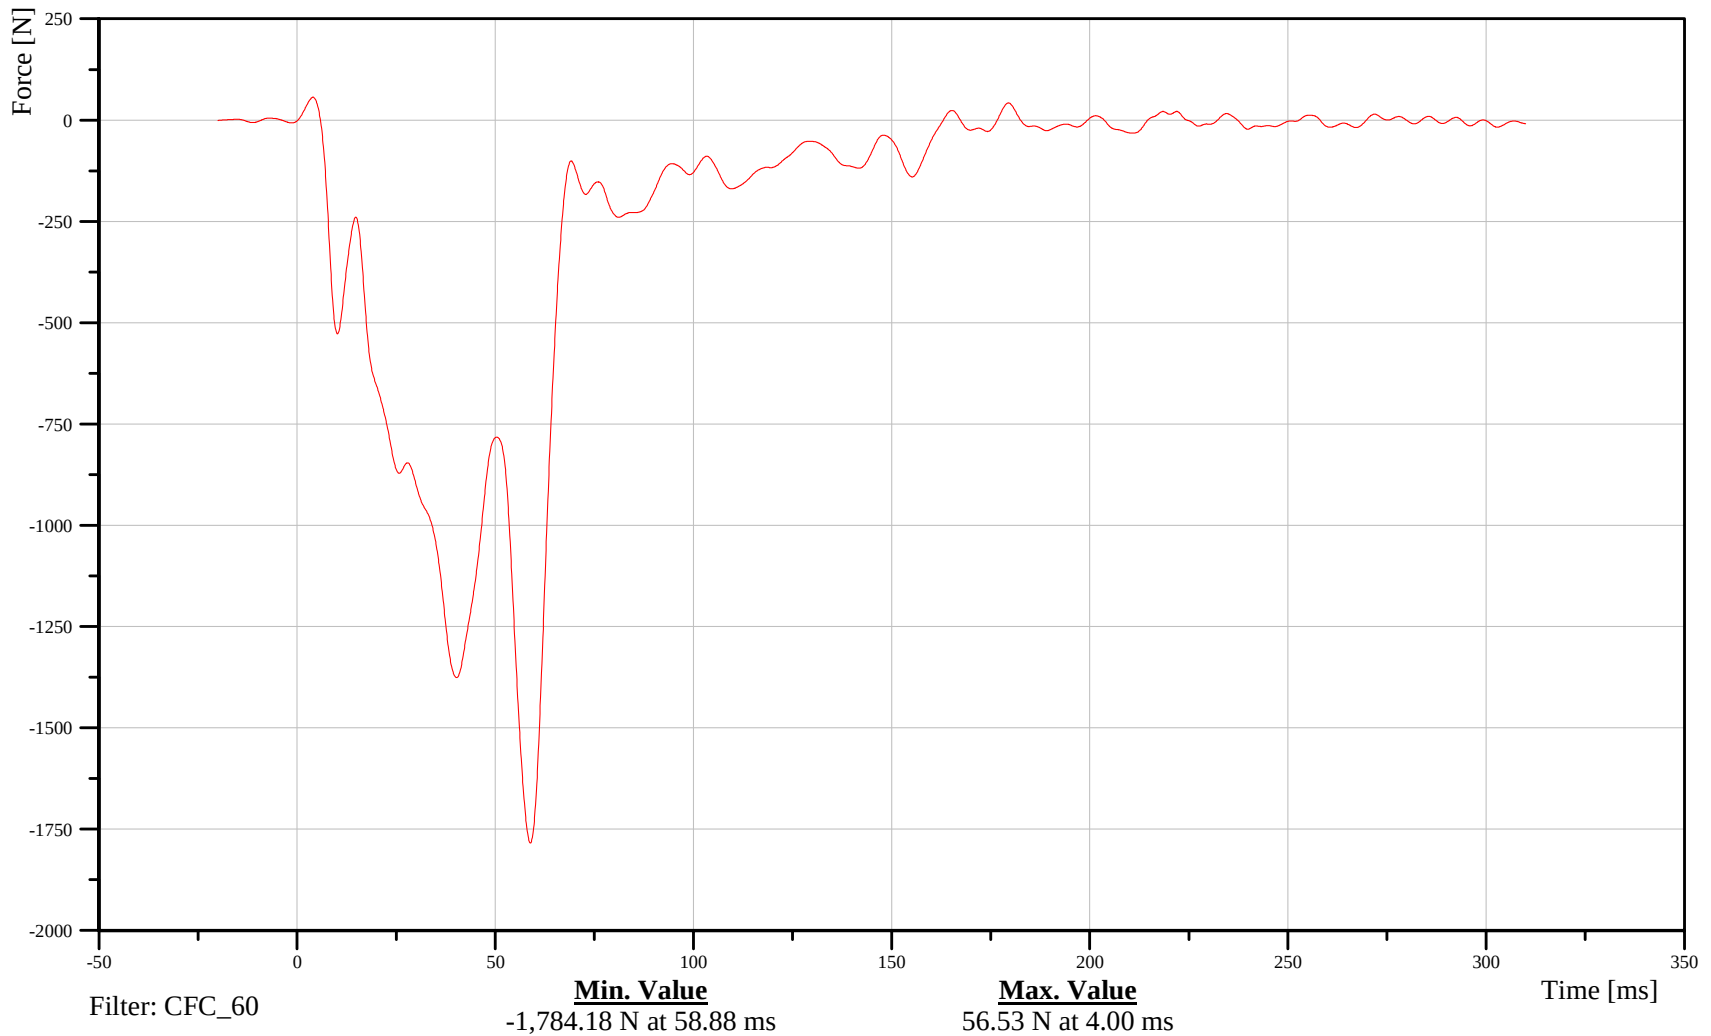

B-146

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 5

Customer: Volpe

L0FBAR000041FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

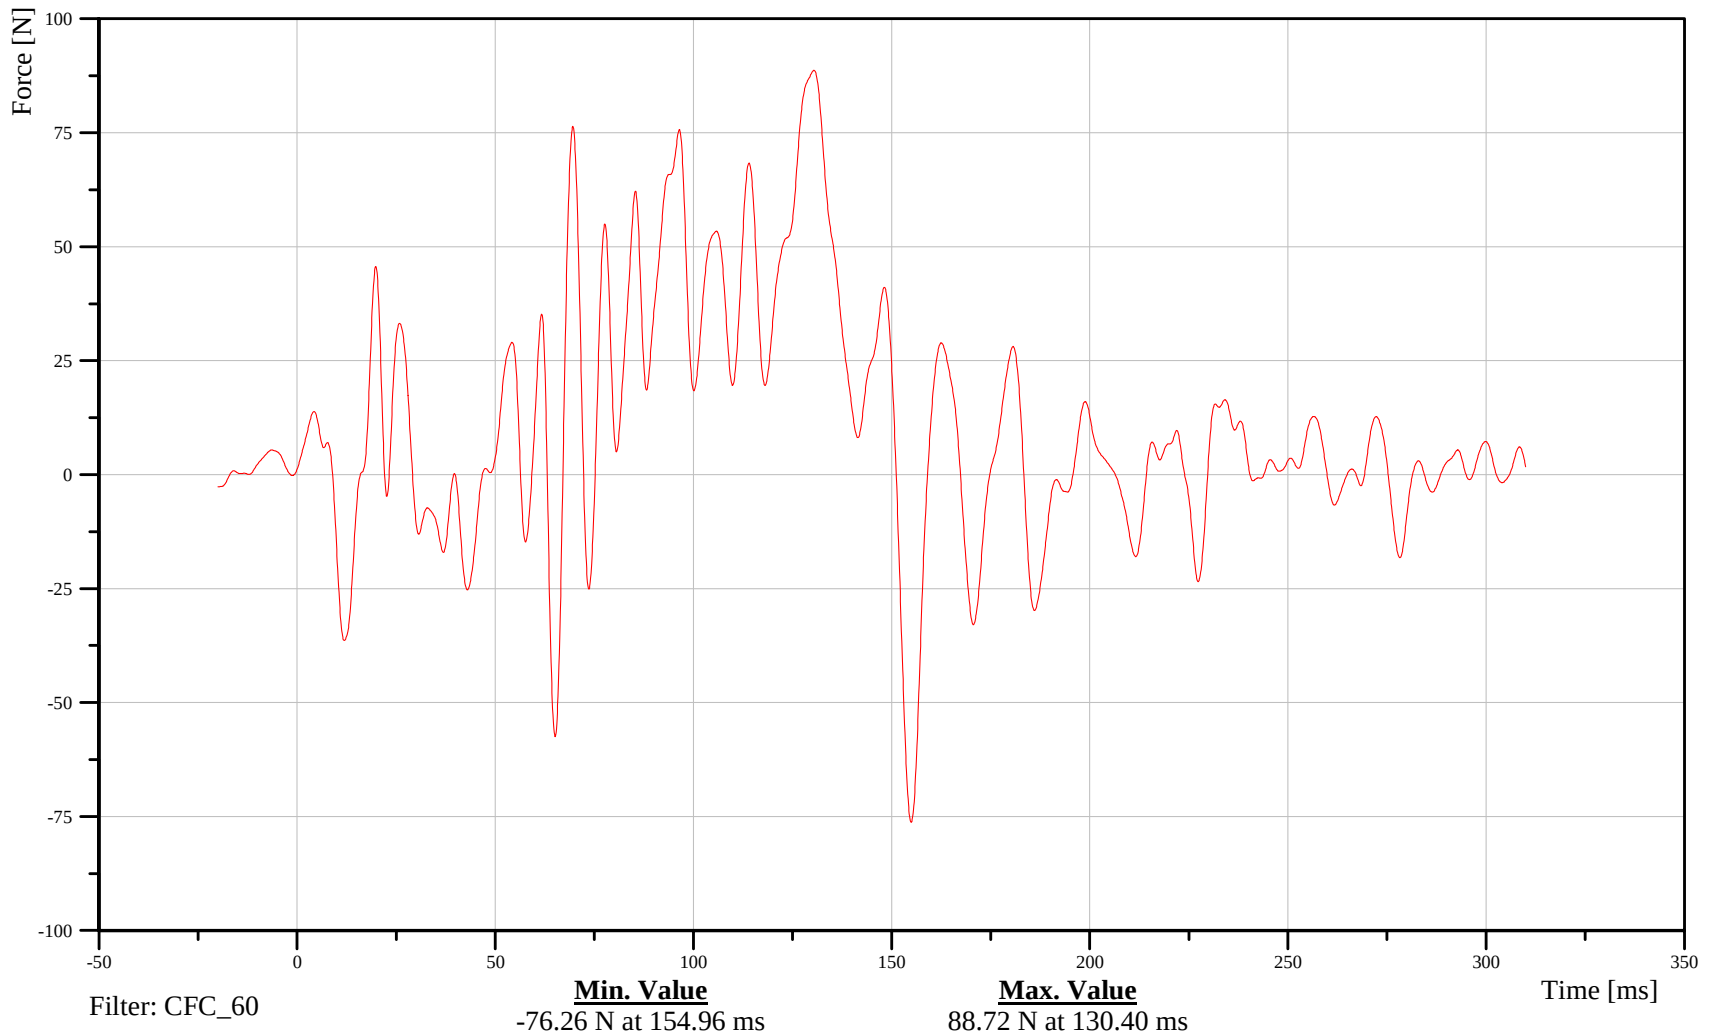

B-147

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 5

Customer: Volpe

L0FBAR000042FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

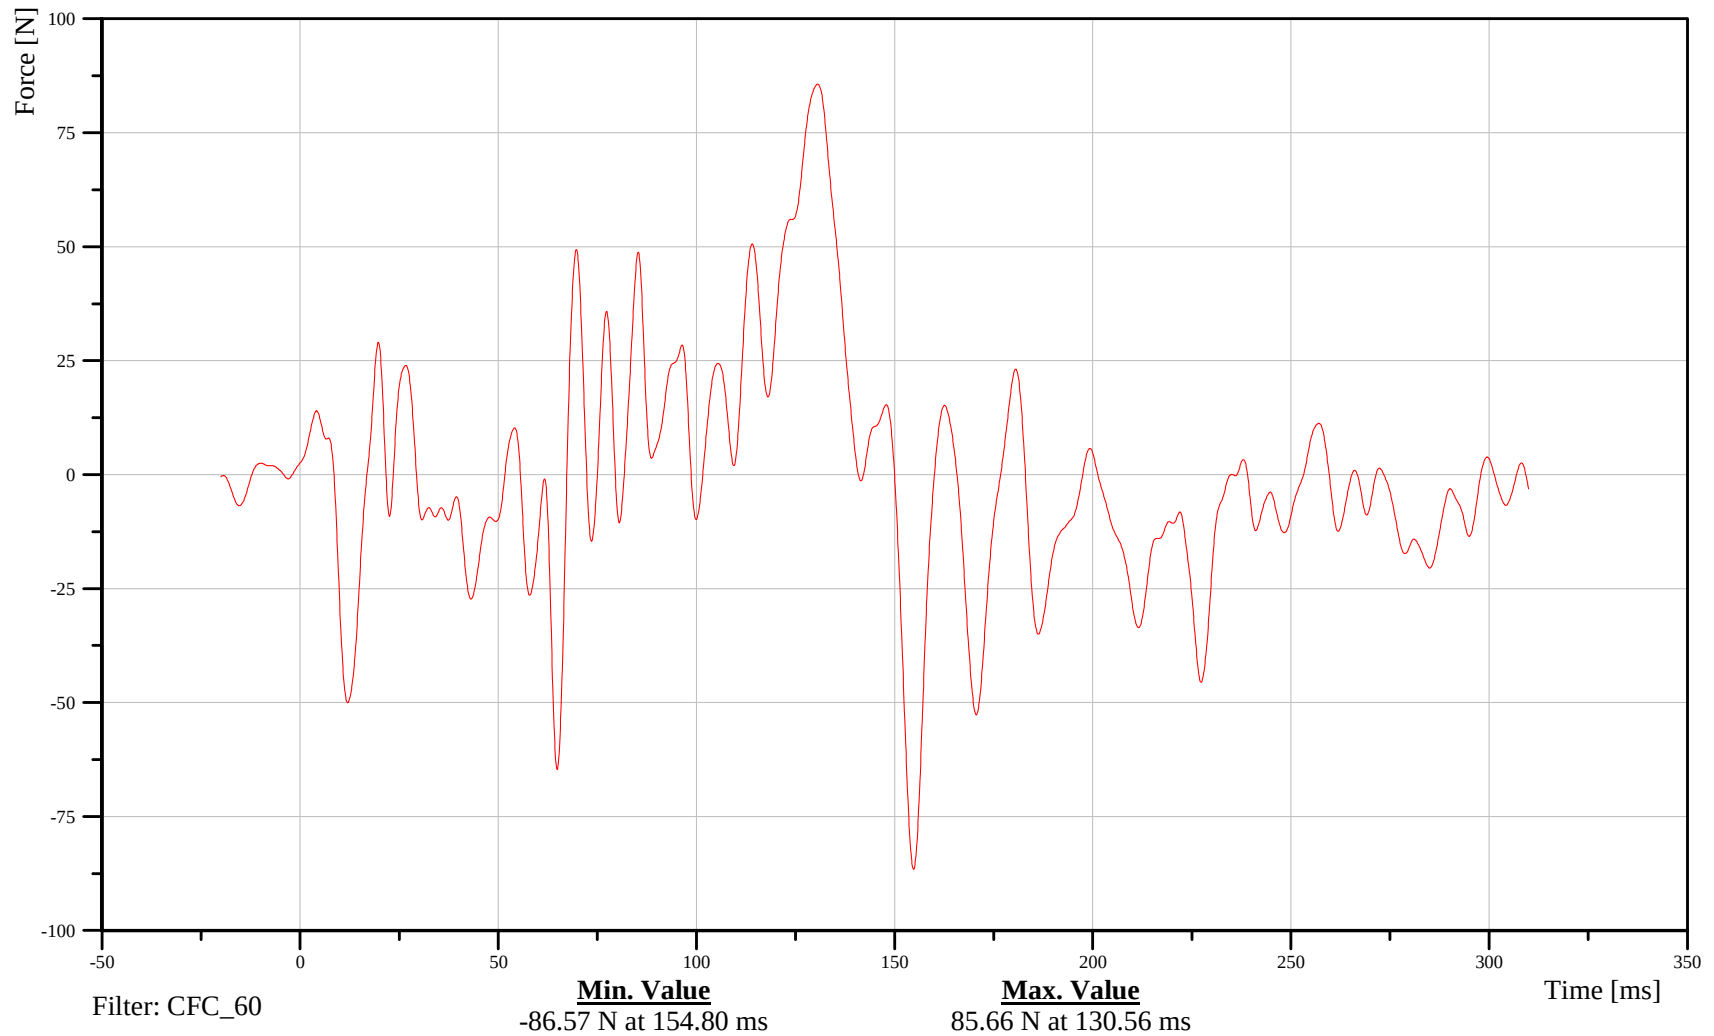

B-148

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 5

Customer: Volpe

L0FBAR000043FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

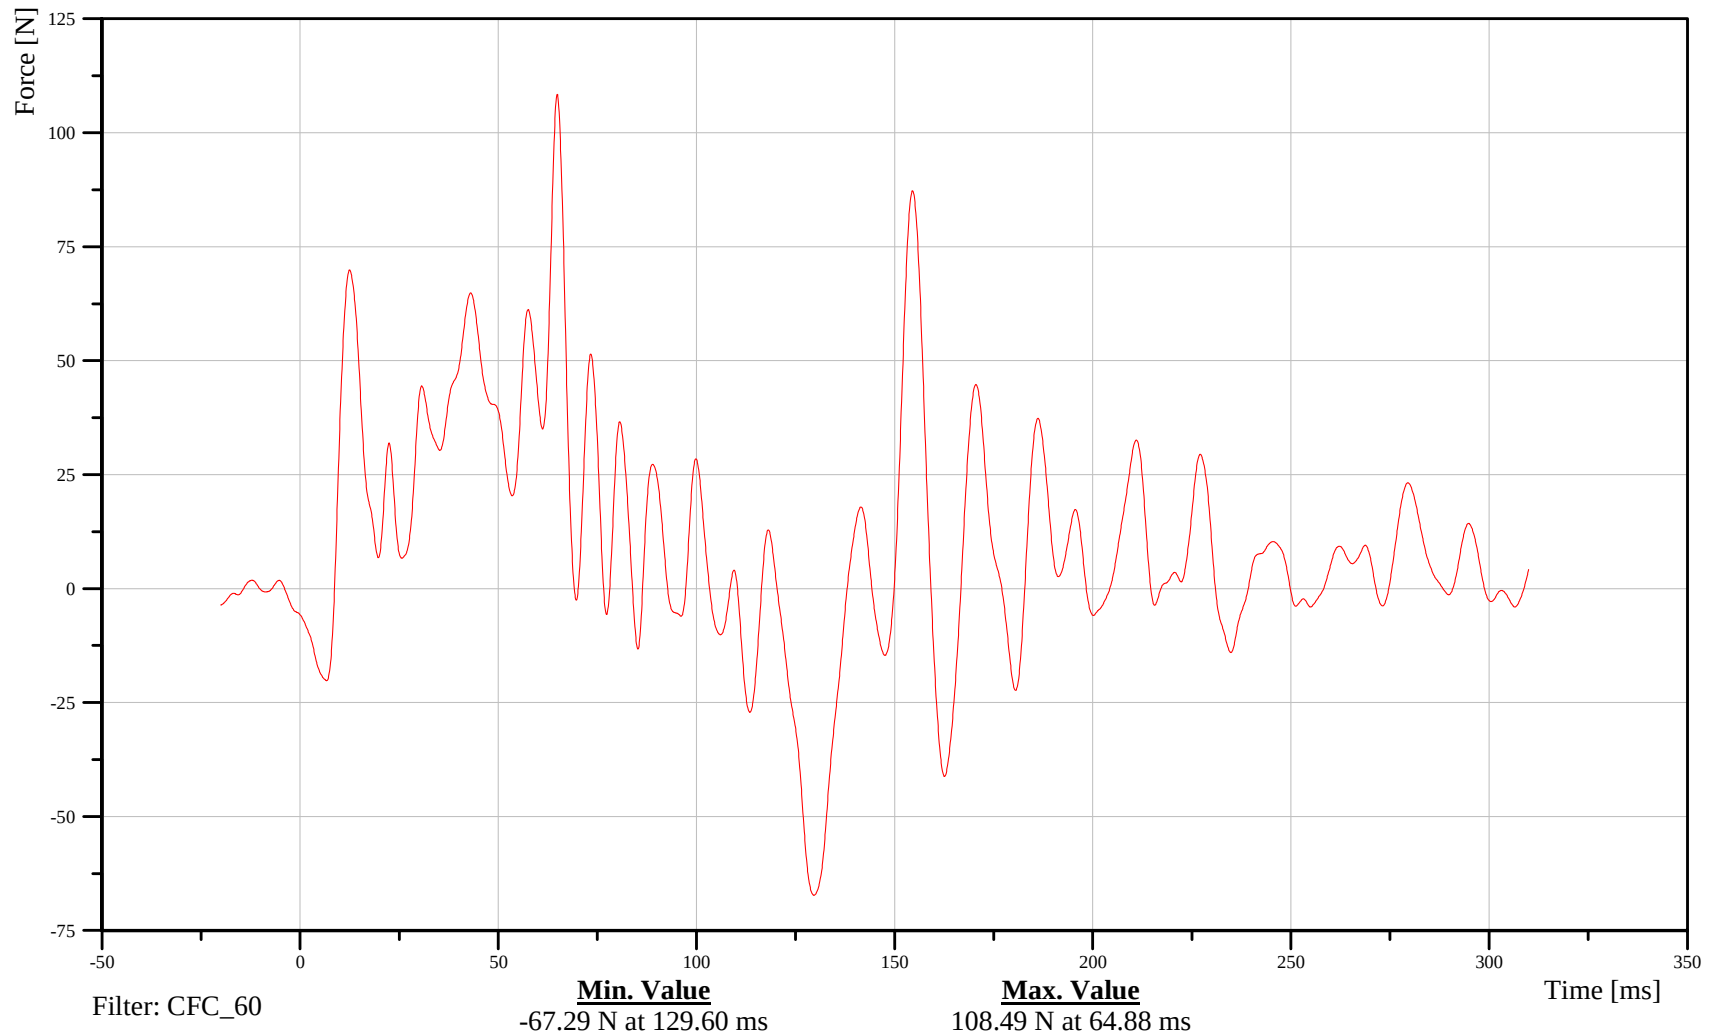

B-149

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 5

Customer: Volpe

L0FBAR000044FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

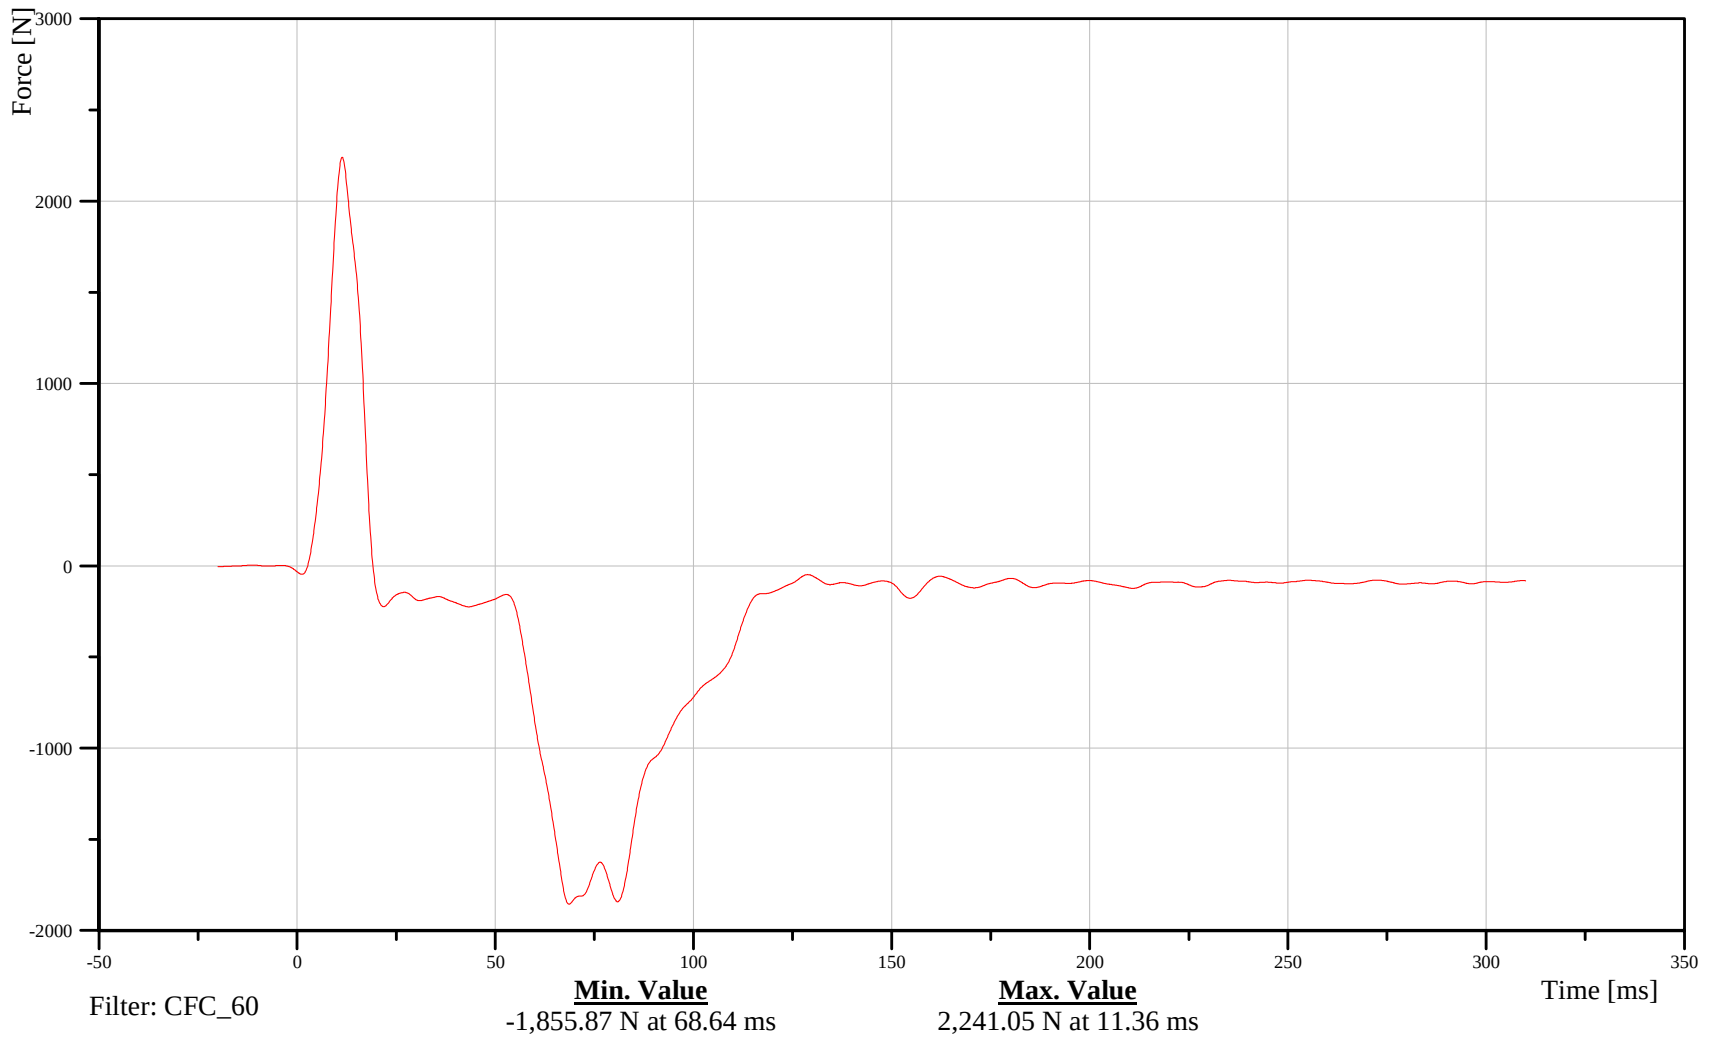

B-150

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 5 Column 5


Time: 18:05

Customer: Volpe

L0FBAR000045FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

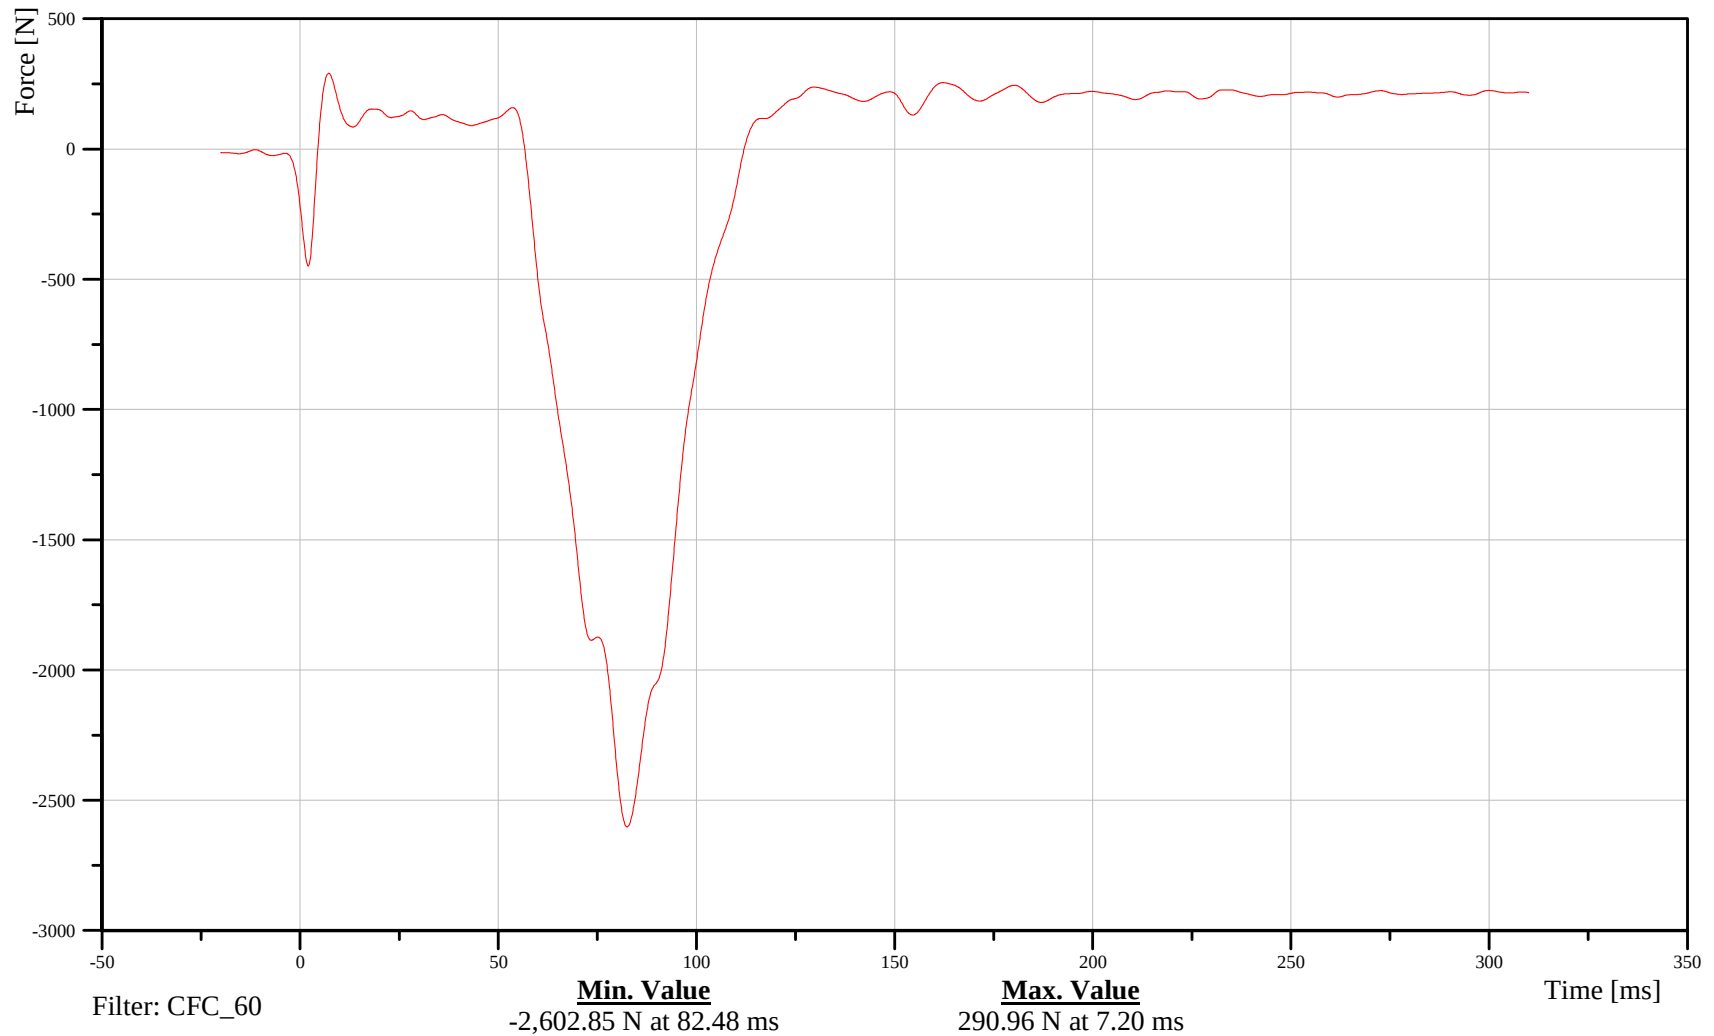

B-151

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 5

Customer: Volpe

L0FBAR000046FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

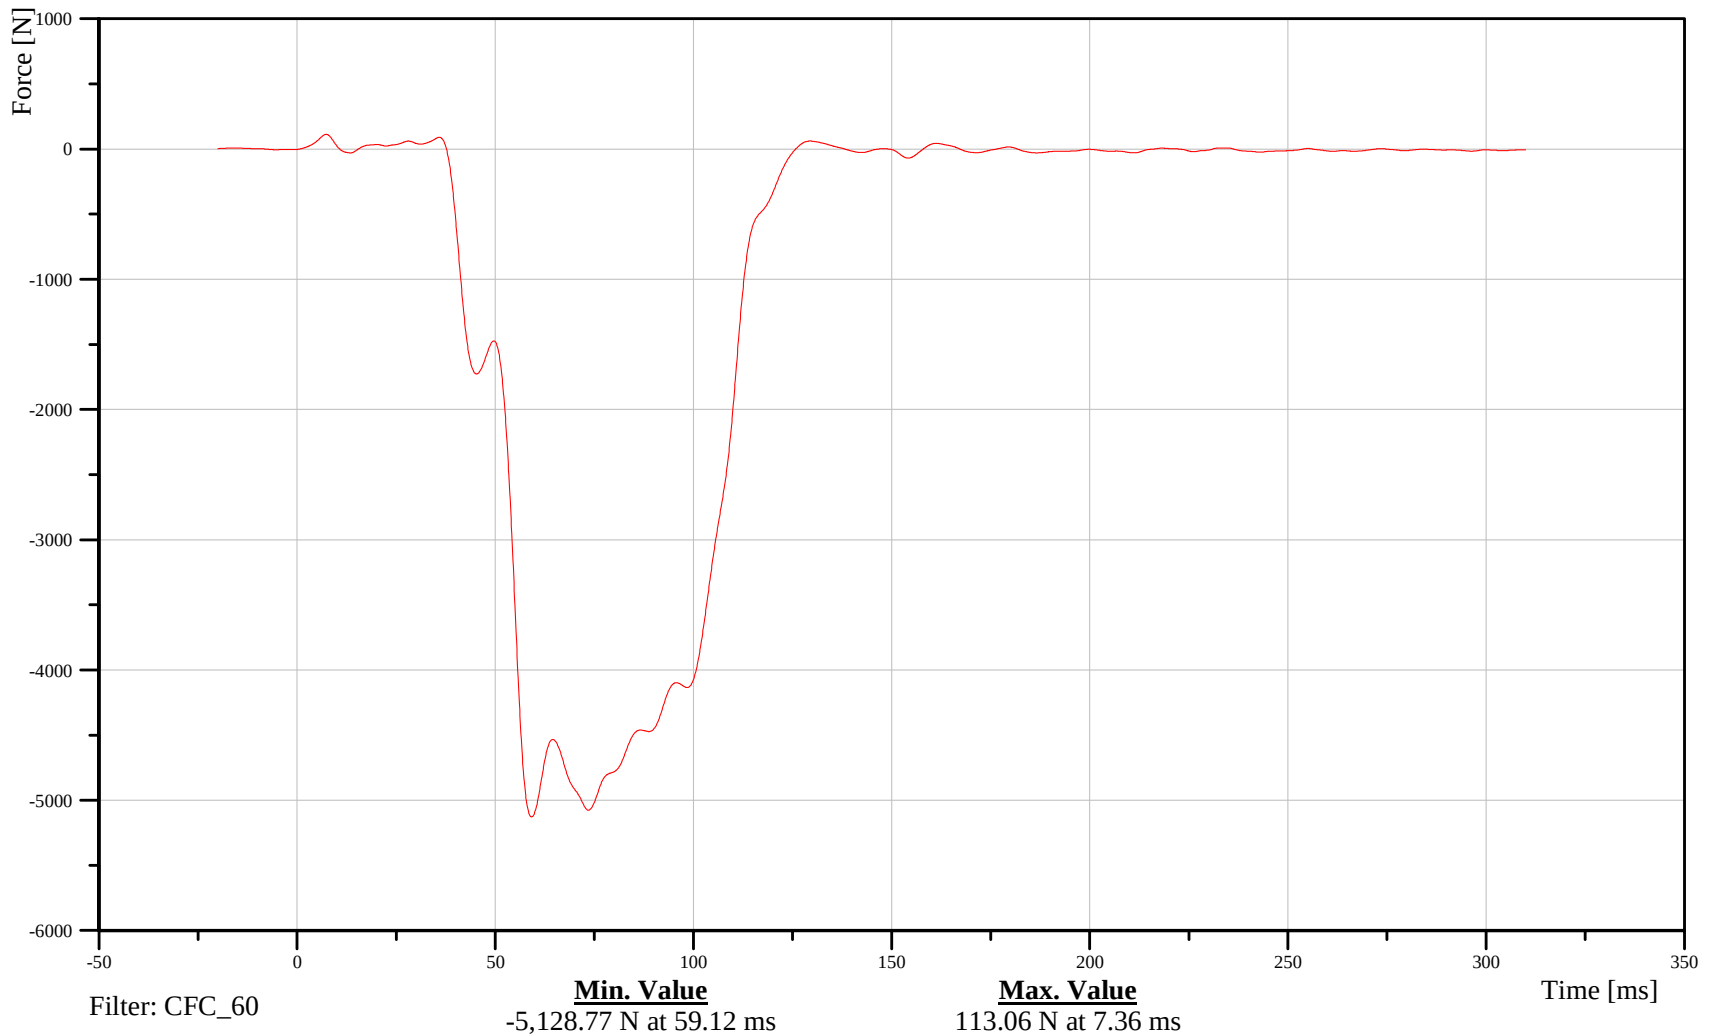

B-152

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 5


Time: 18:05

Customer: Volpe

L0FBAR000047FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

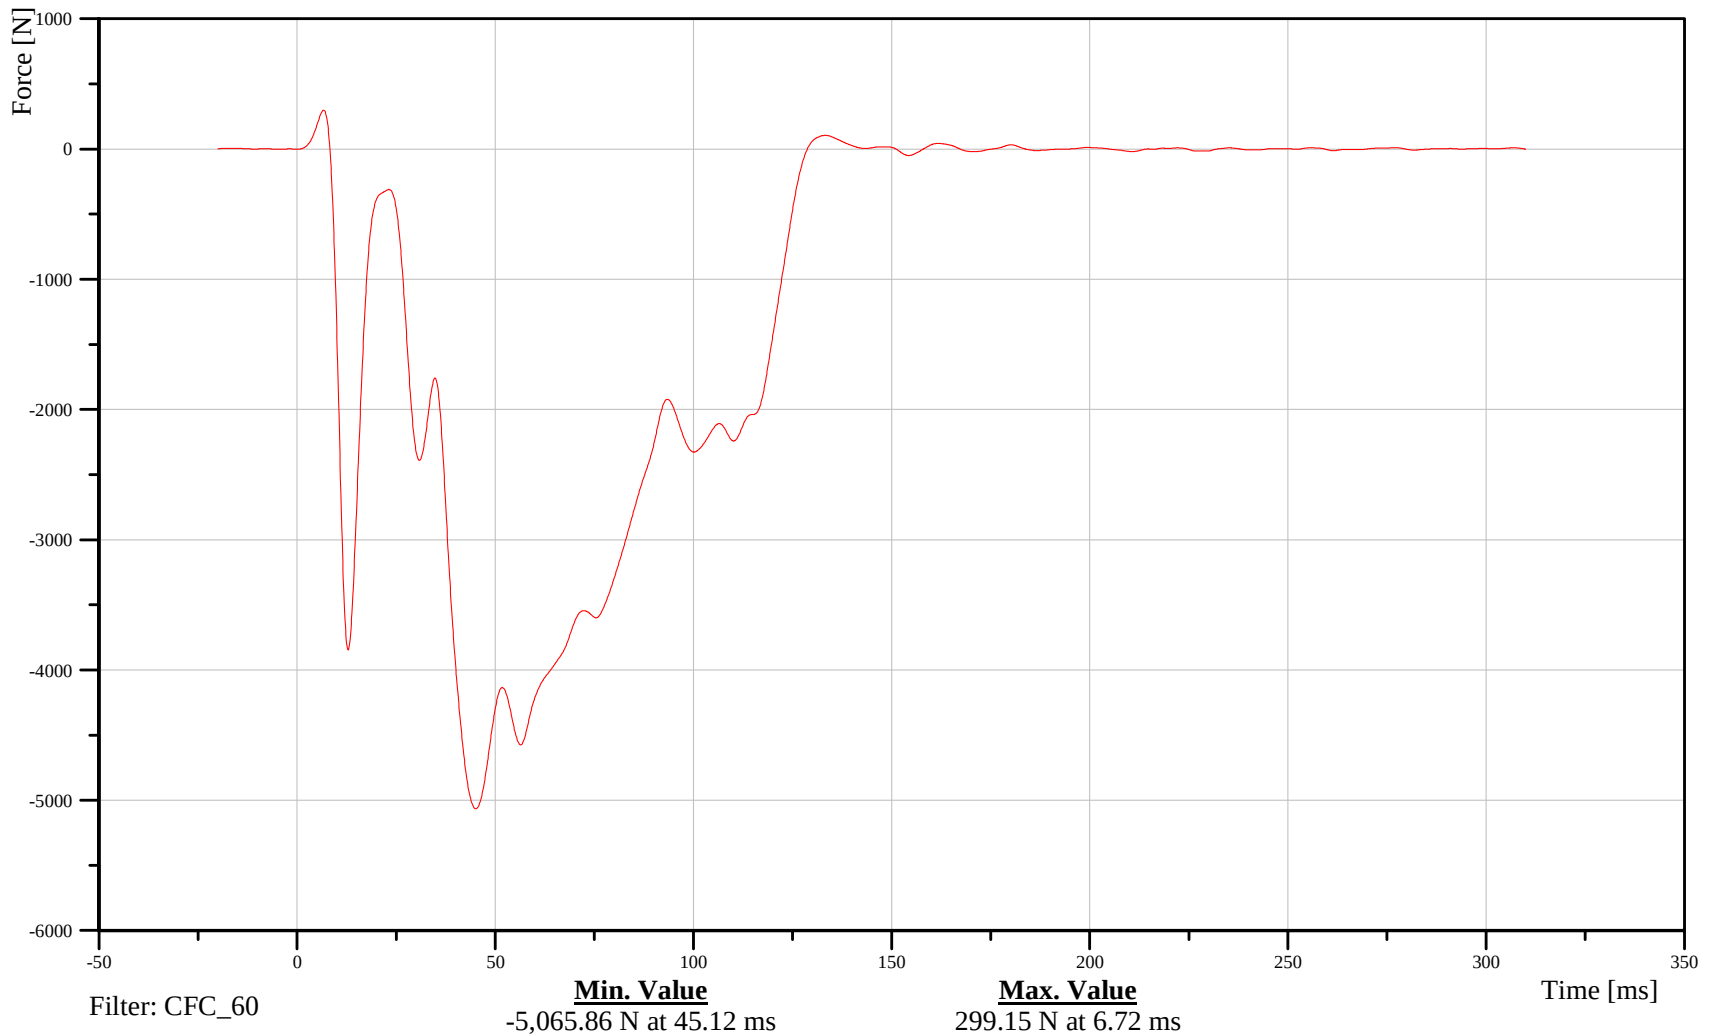

B-153

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 8 Column 5

Customer: Volpe

L0FBAR000048FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

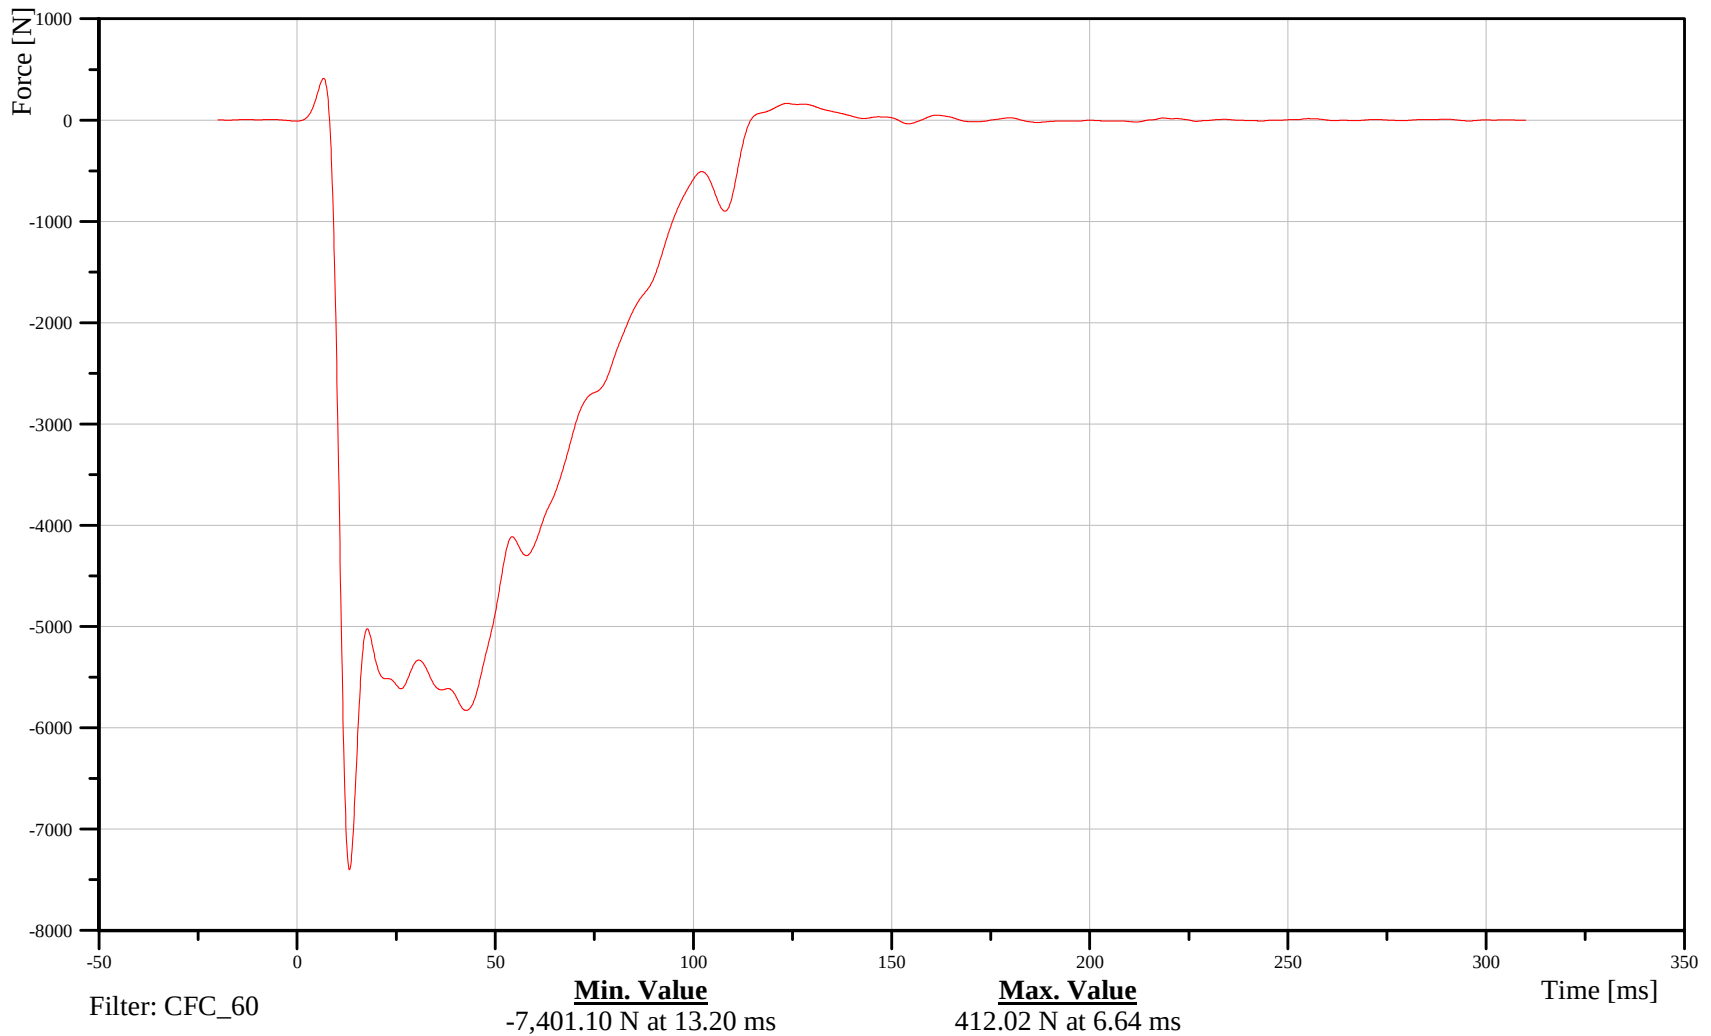

B-154

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 9 Column 5


Time: 18:05

Customer: Volpe

L0FBAR000049FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

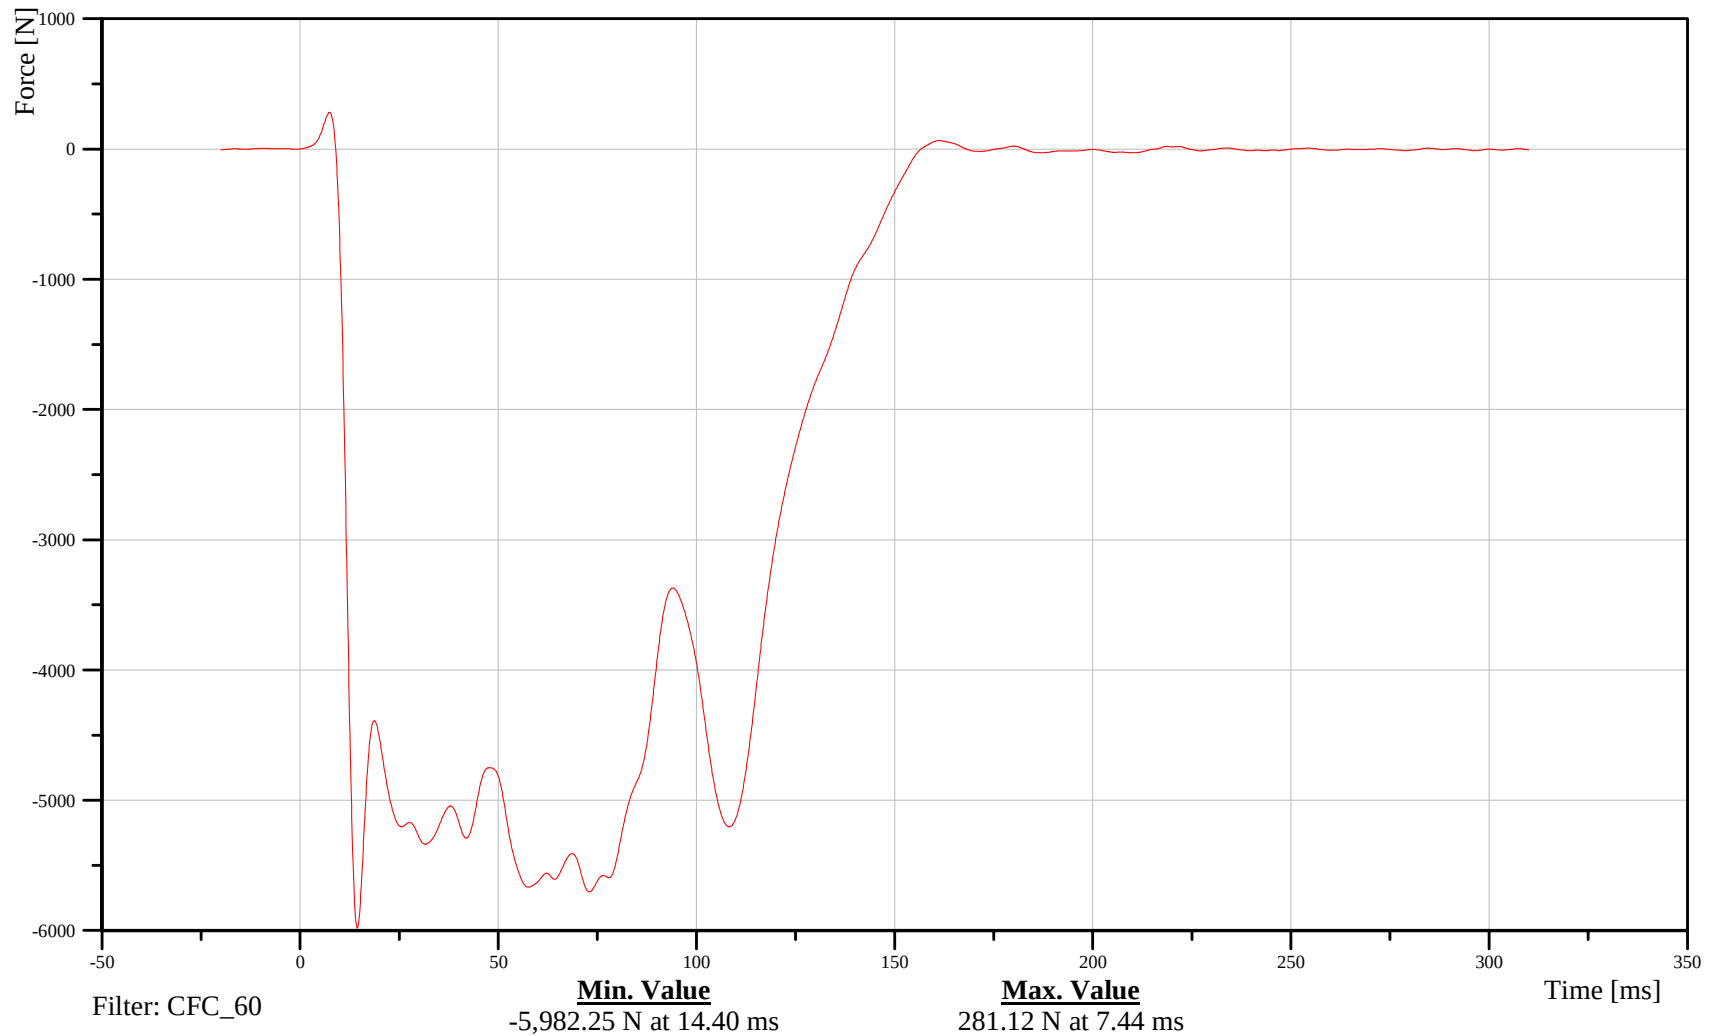

B-155

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 5

Customer: Volpe

L0FBAR000050FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

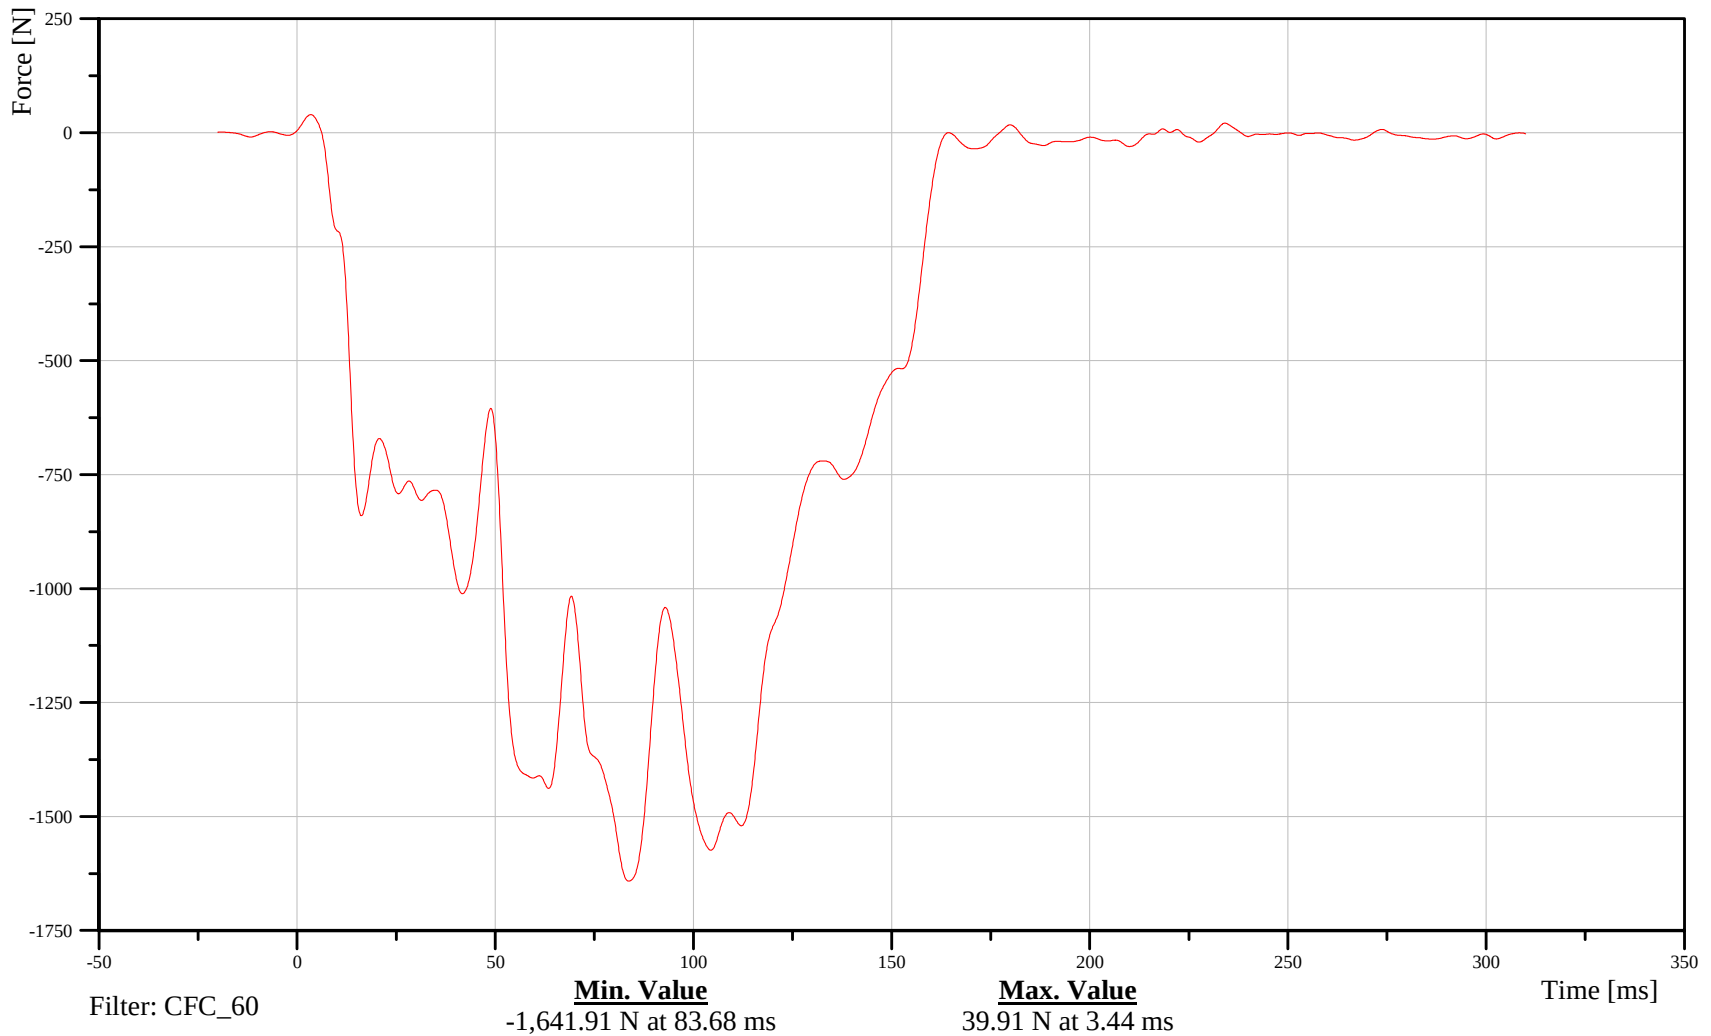

B-156

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 1 Column 6

Customer: Volpe

L0FBAR000051FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

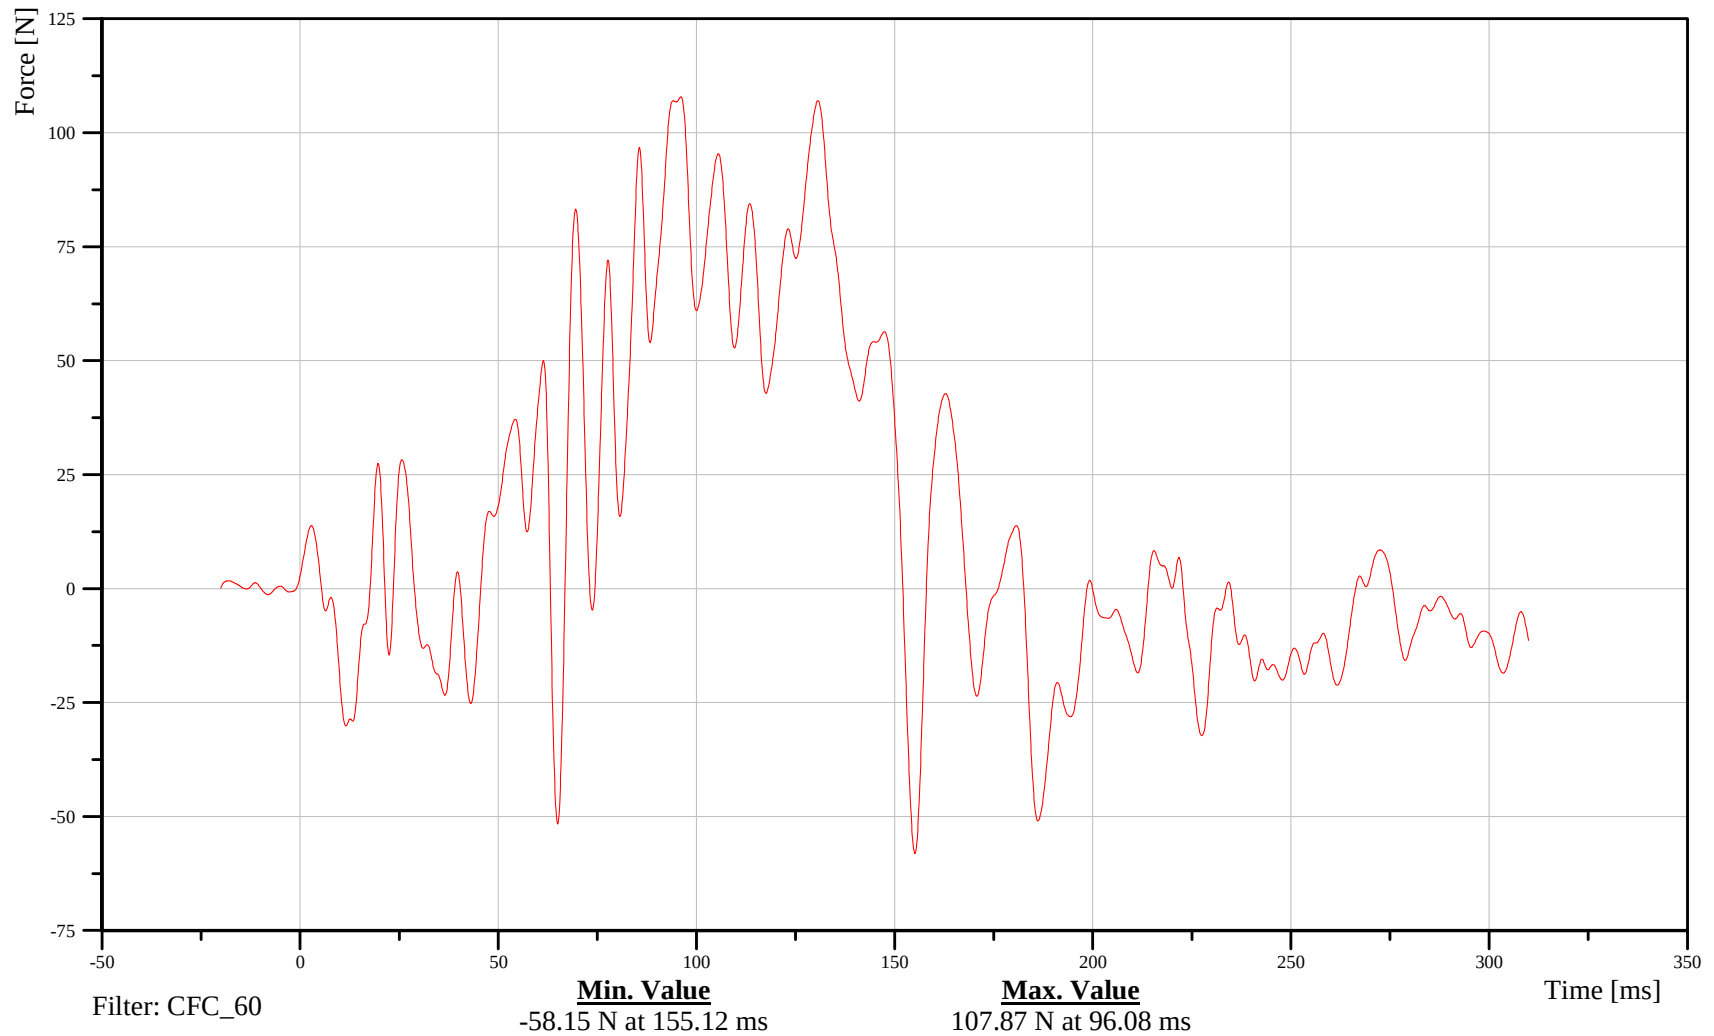

B-157

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 2 Column 6


Time: 18:05

Customer: Volpe

L0FBAR000052FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

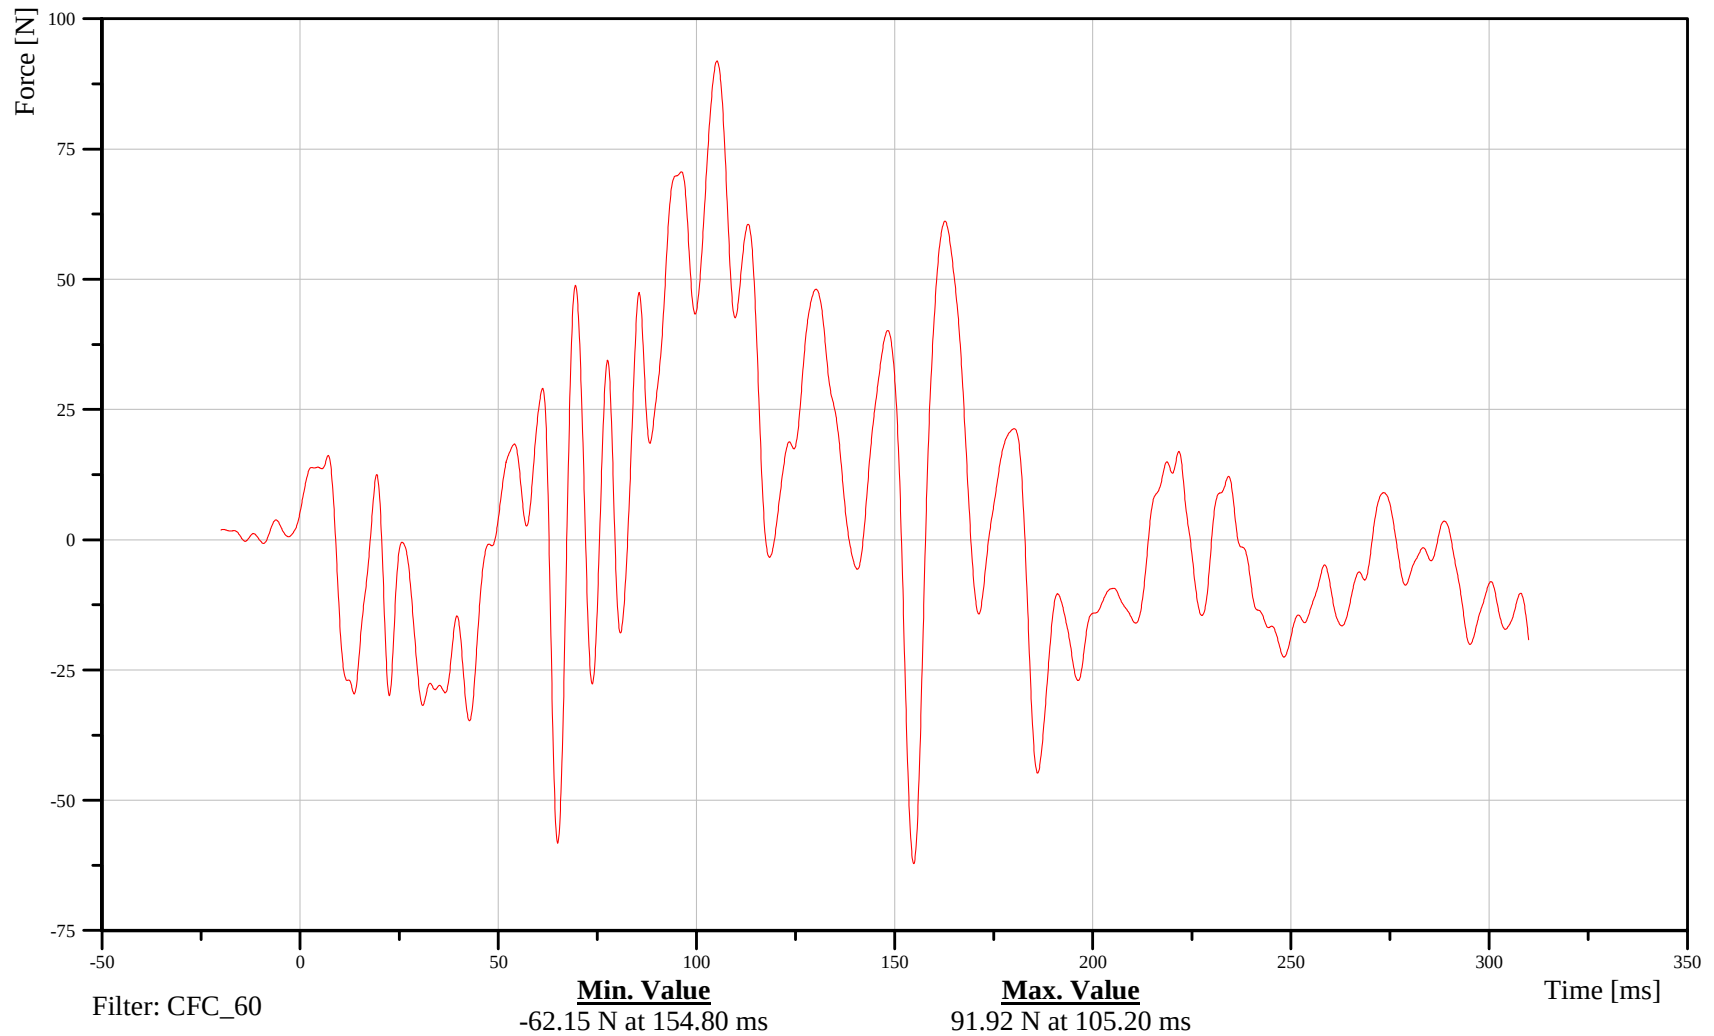

B-158

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 6

Customer: Volpe

L0FBAR000053FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

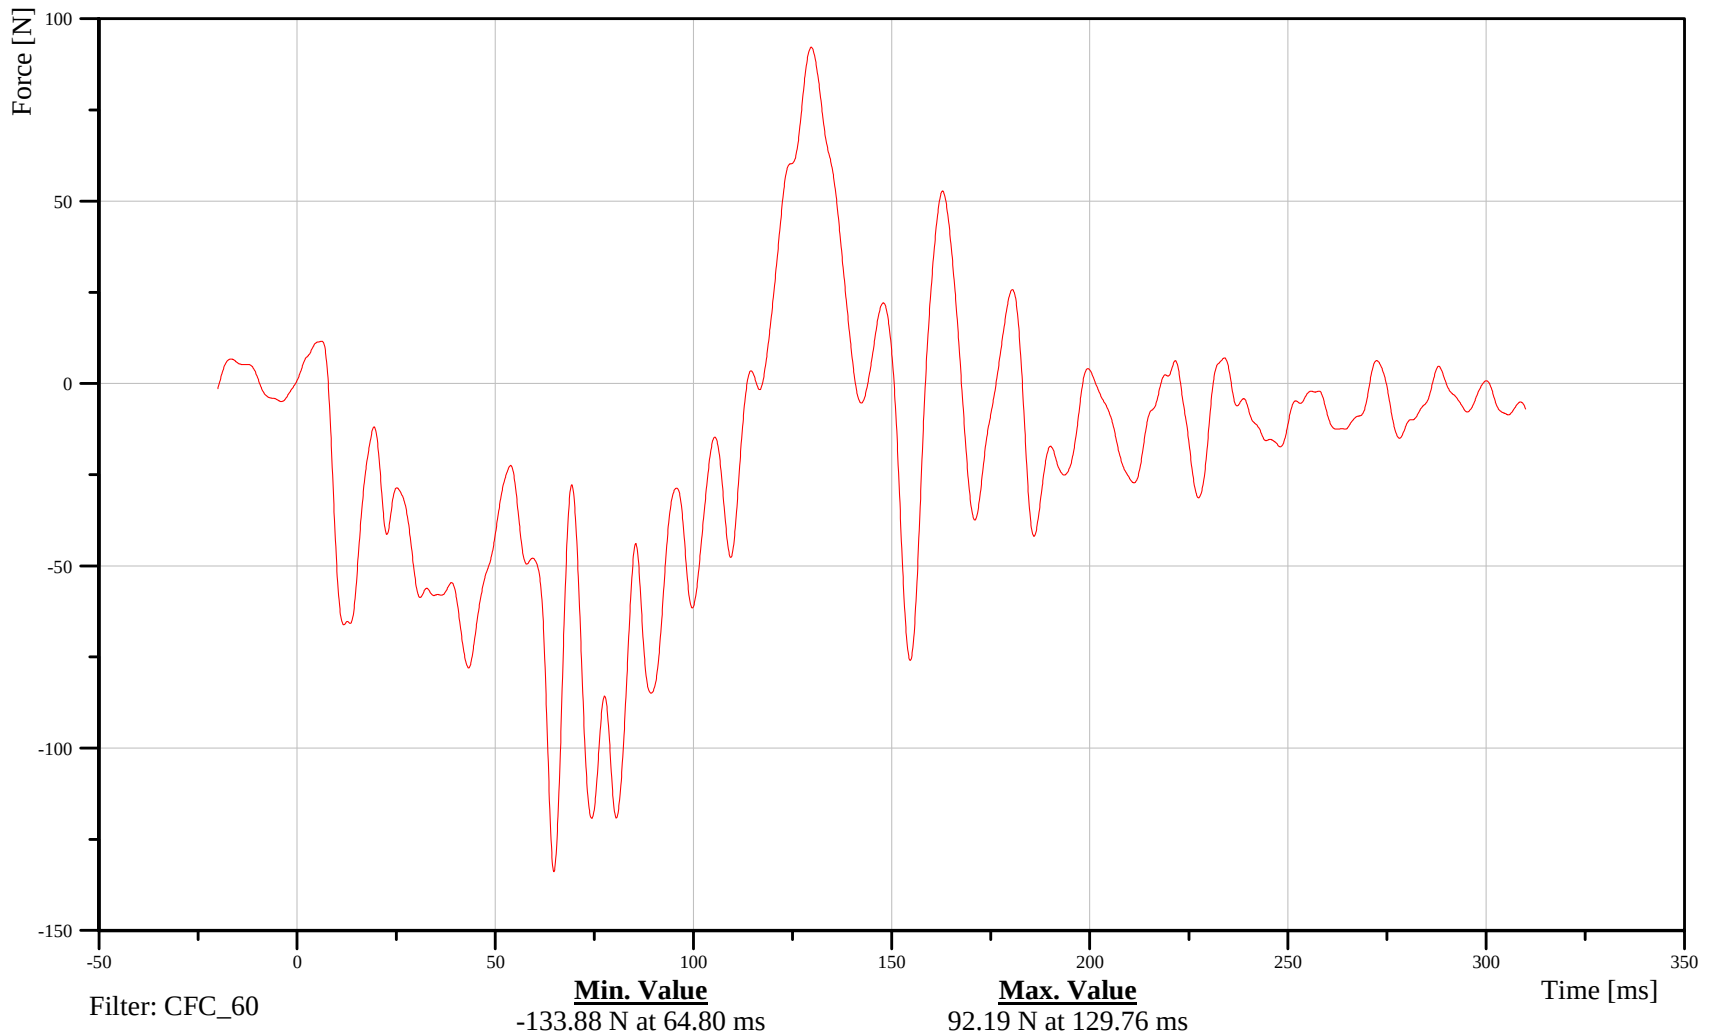

B-159

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 4 Column 6


Time: 18:05

Customer: Volpe

L0FBAR000054FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

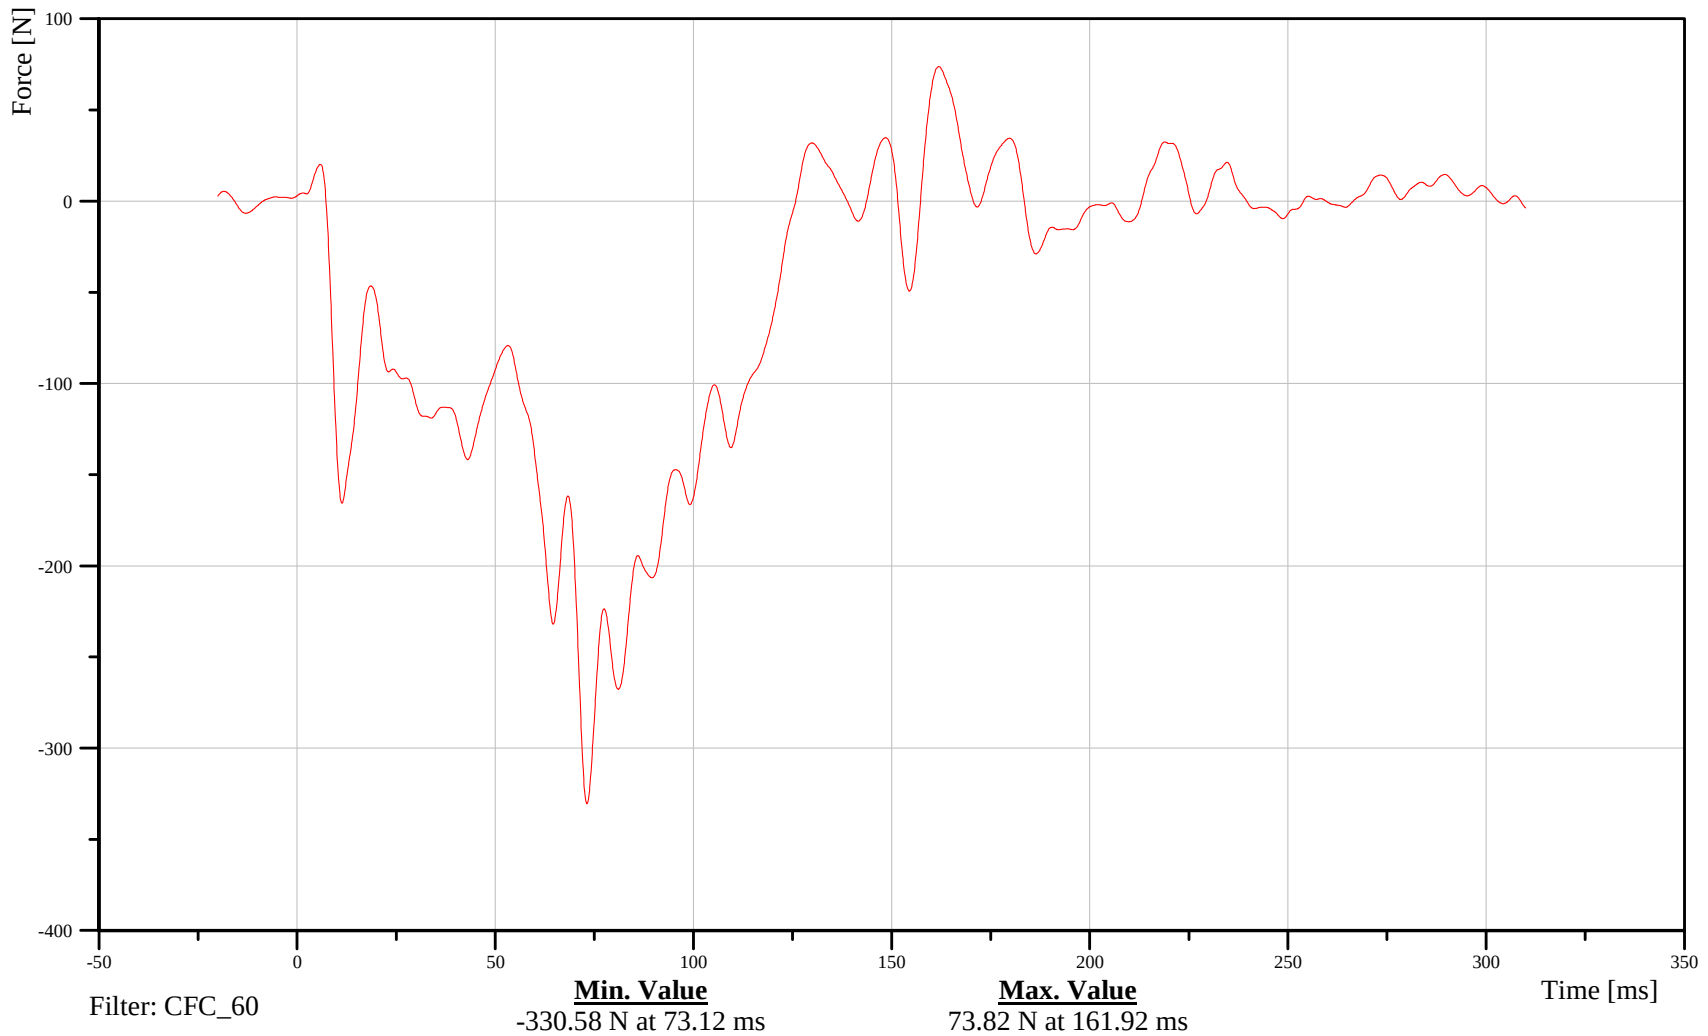

B-160

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 6

Customer: Volpe

L0FBAR000055FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

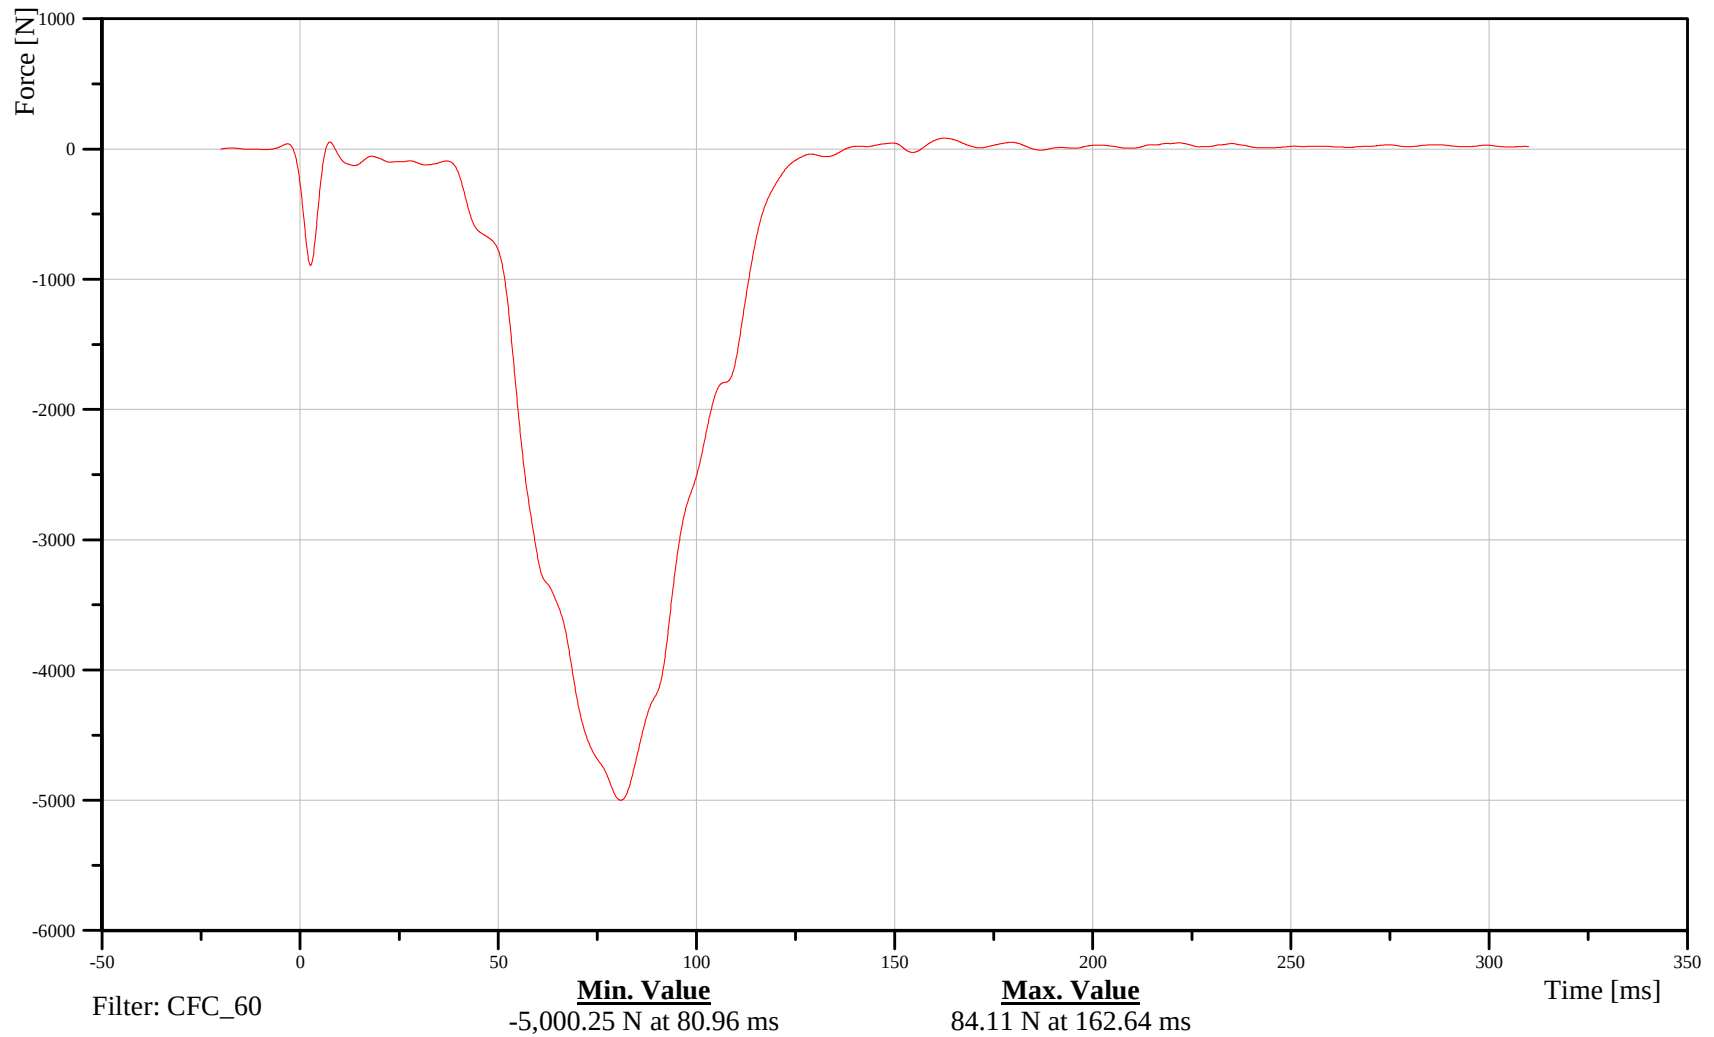

B-161

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 6

Customer: Volpe

L0FBAR000056FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

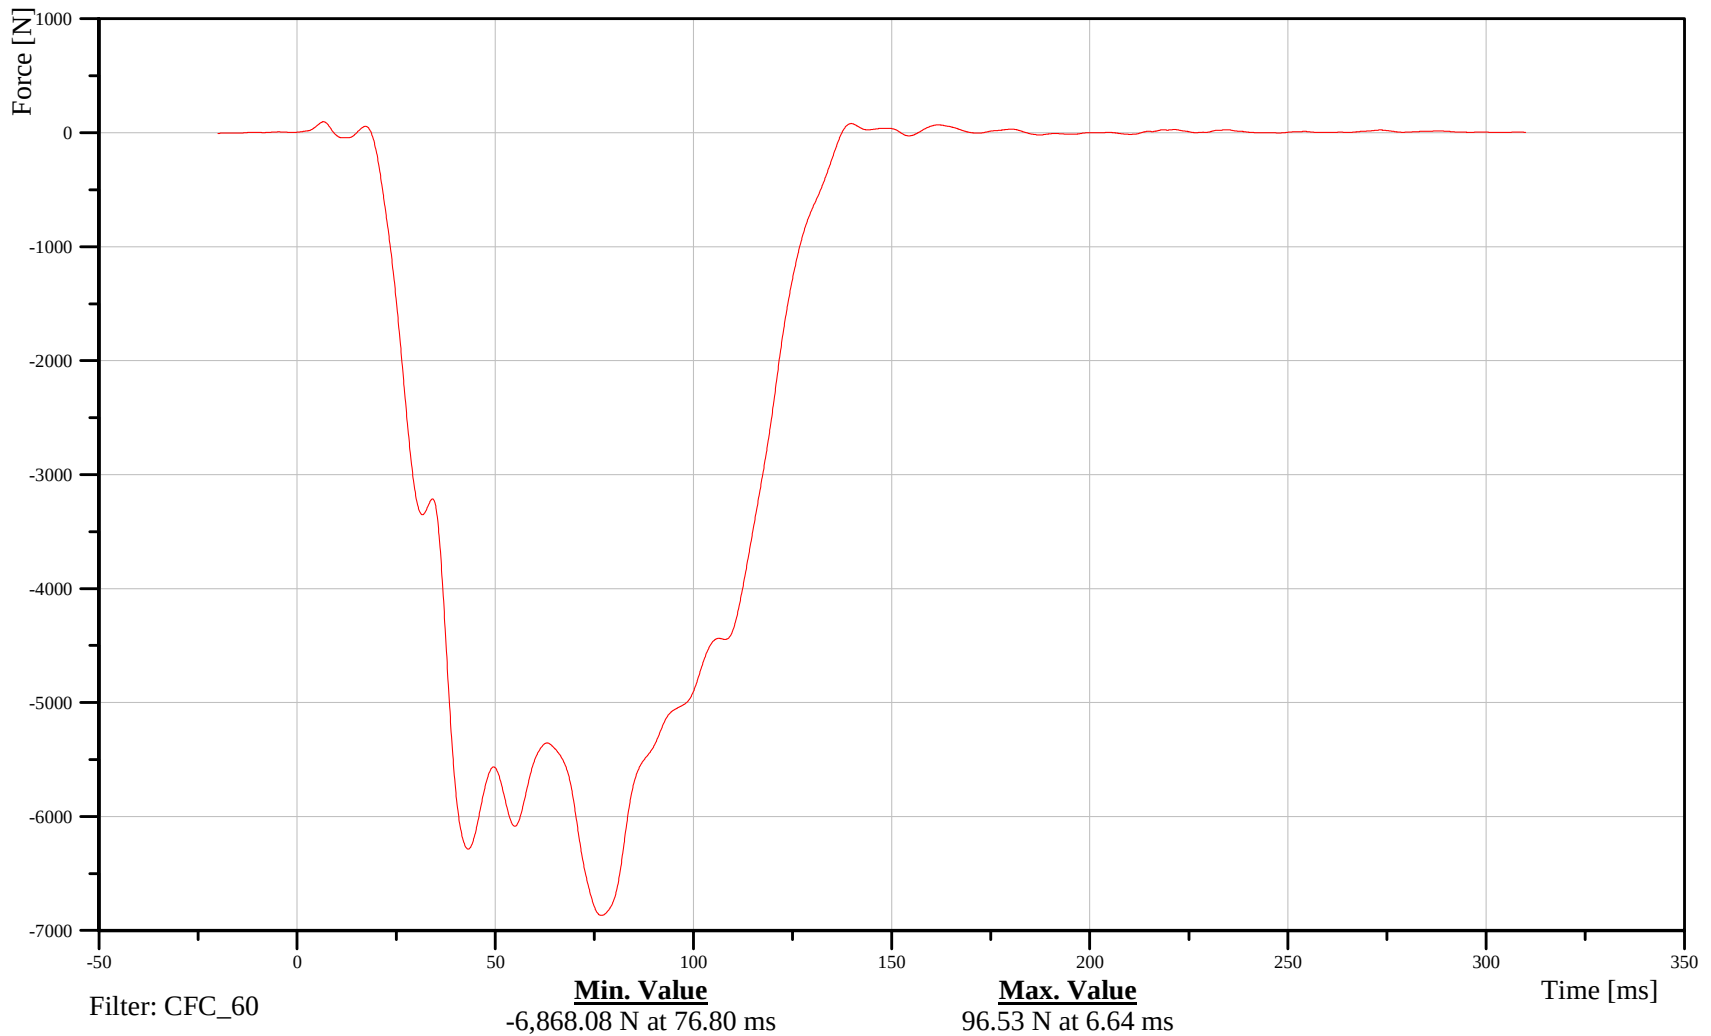

B-162

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 6


Time: 18:05

Customer: Volpe

L0FBAR000057FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

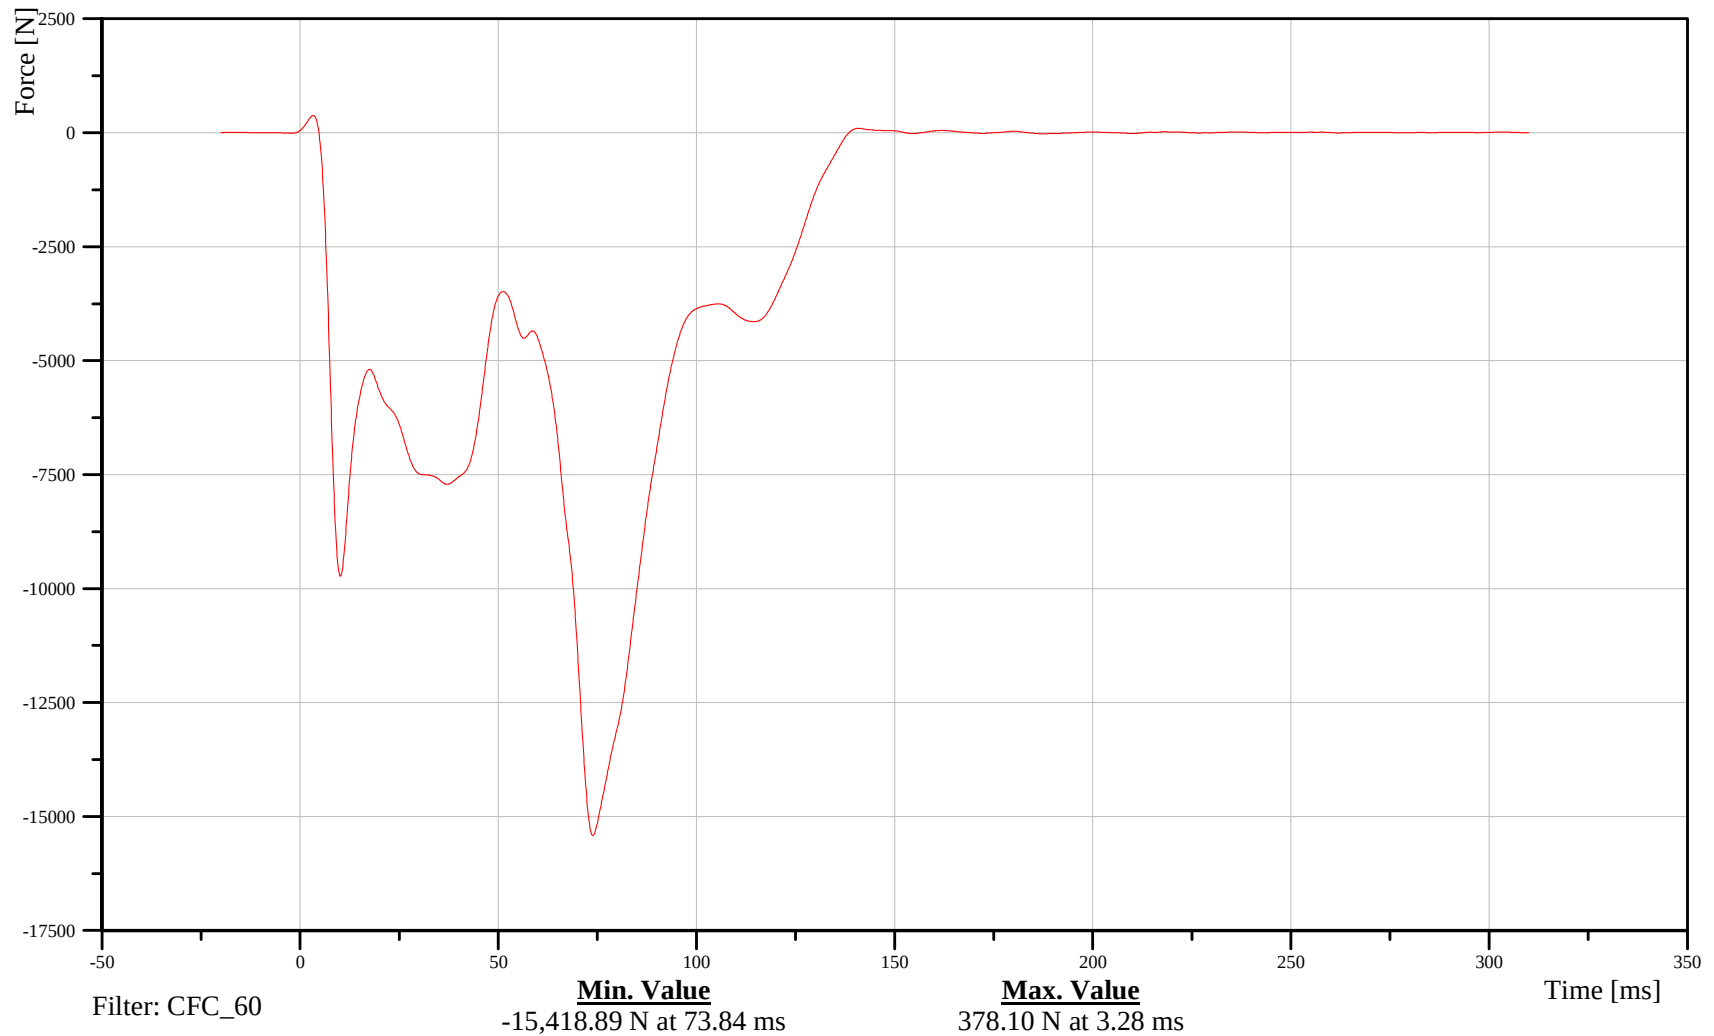

B-163

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 8 Column 6

Customer: Volpe

L0FBAR000058FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

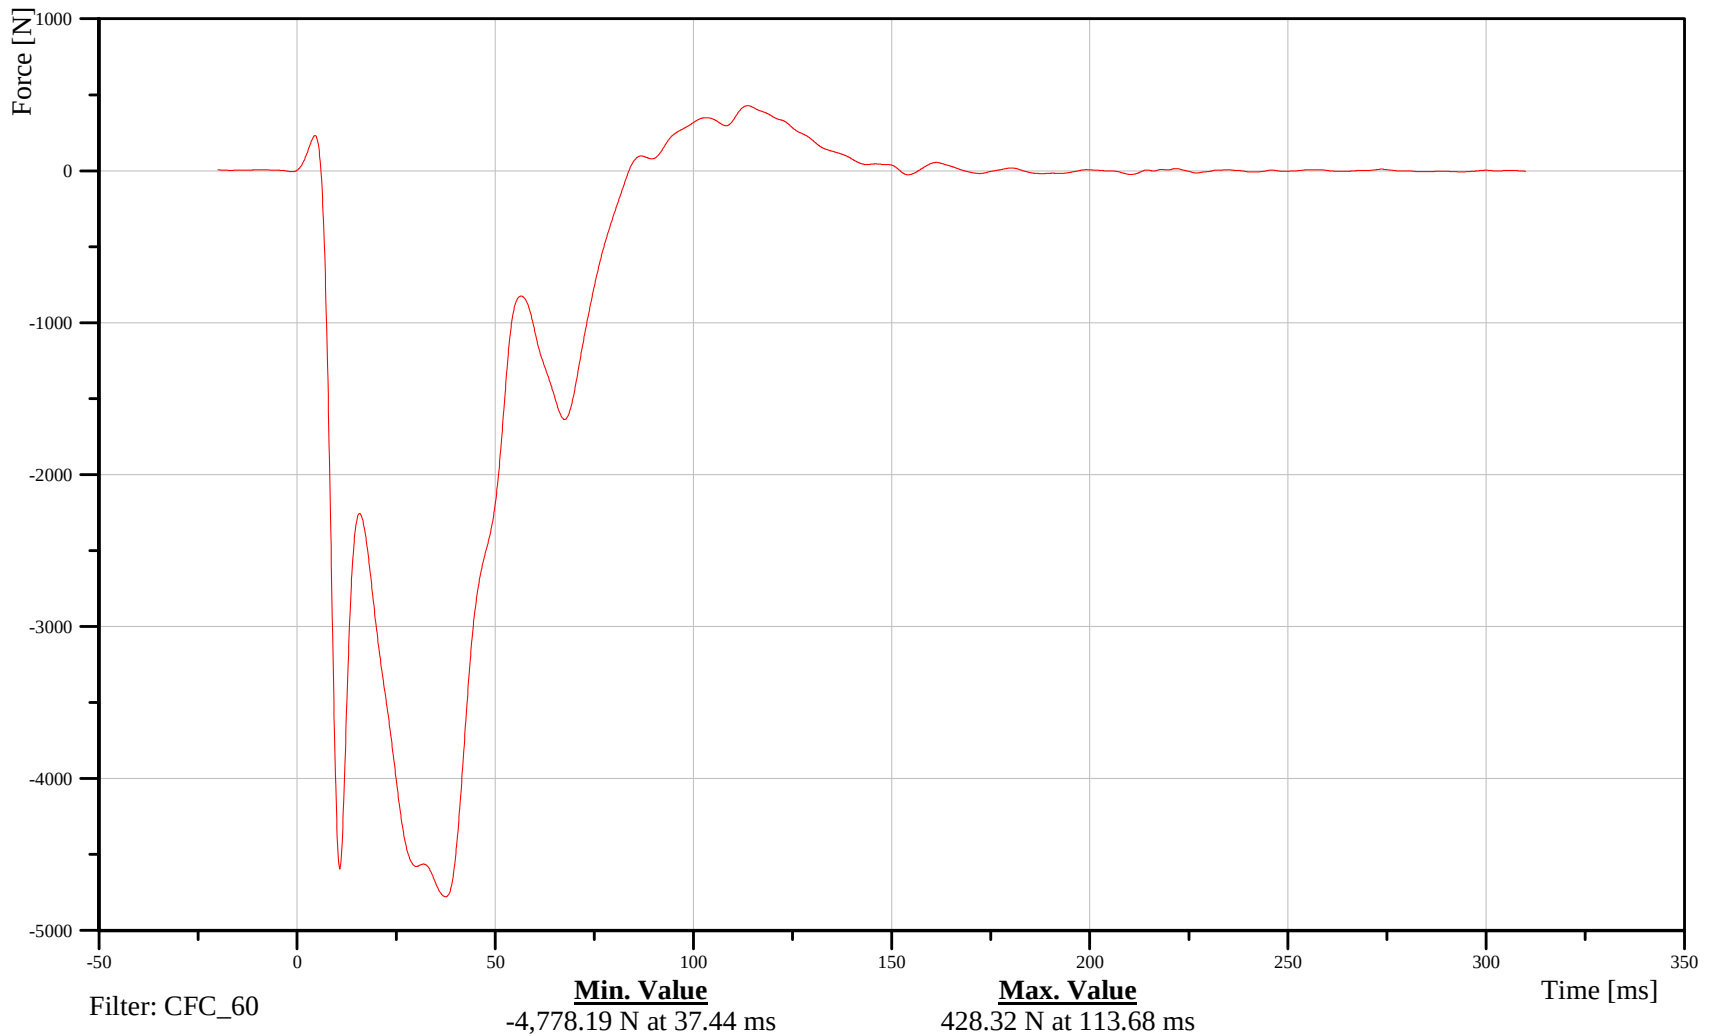

B-164

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 6

Customer: Volpe

L0FBAR000059FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

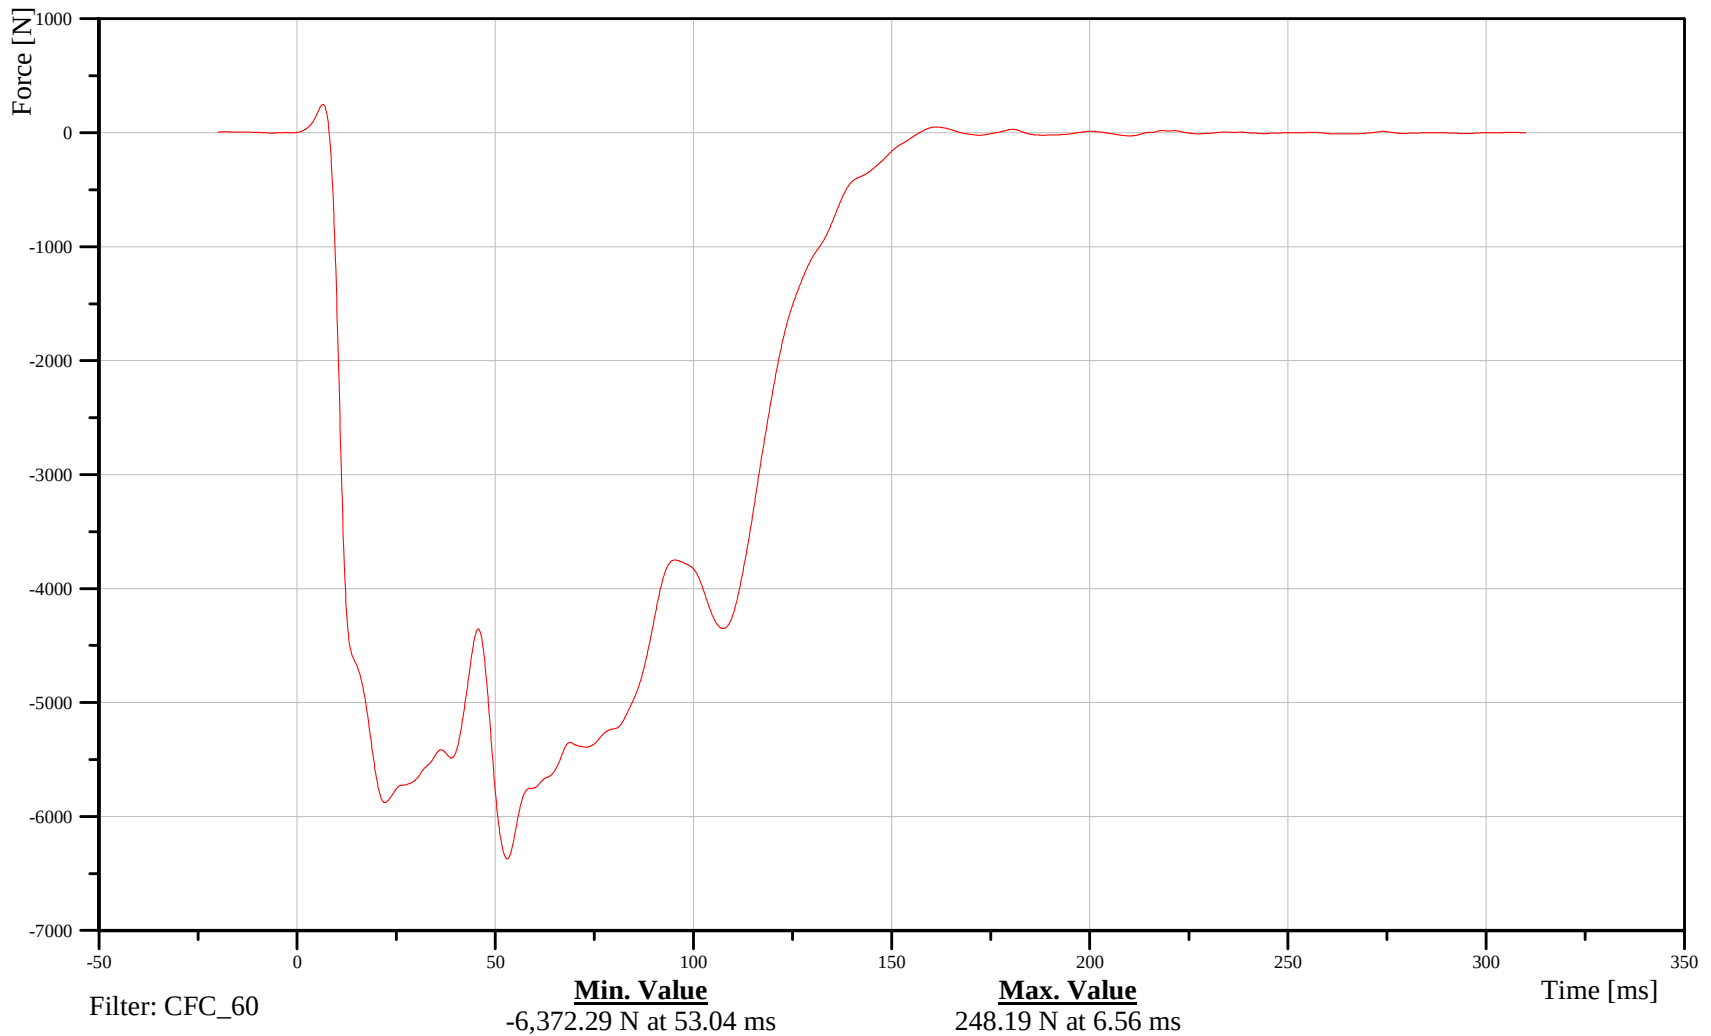

B-165

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 10 Column 6

Customer: Volpe

L0FBAR000060FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

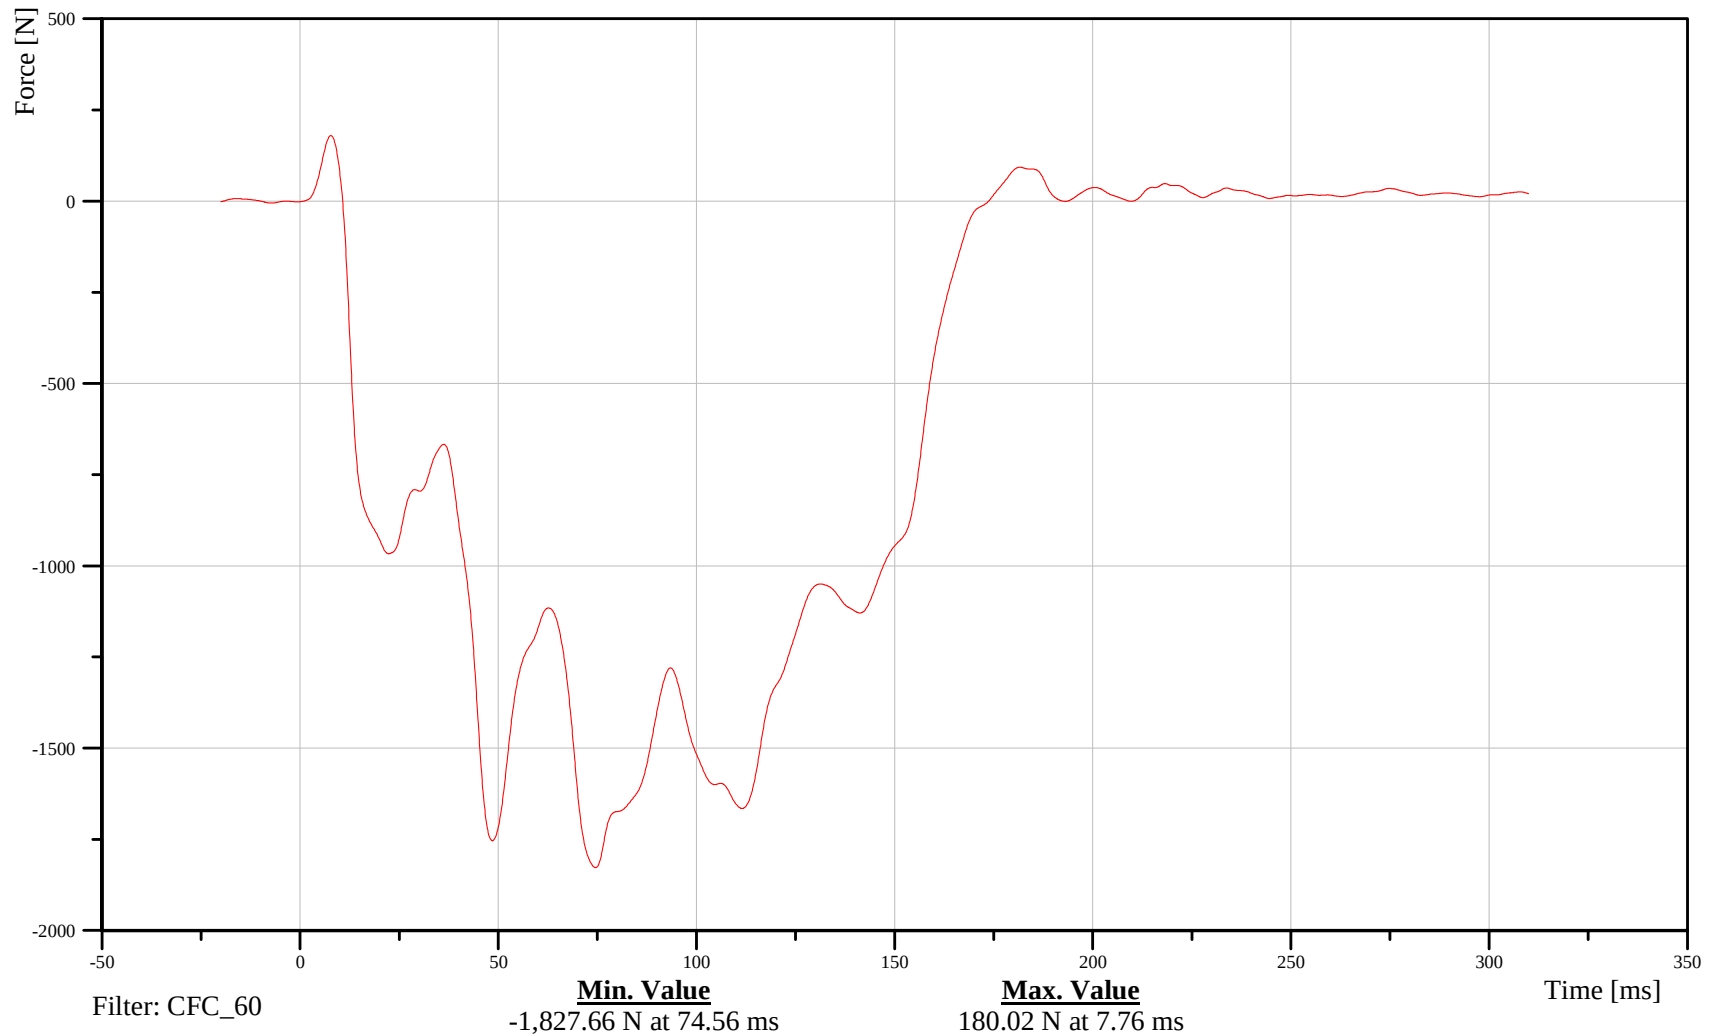

B-166

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 7

Customer: Volpe

L0FBAR000061FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

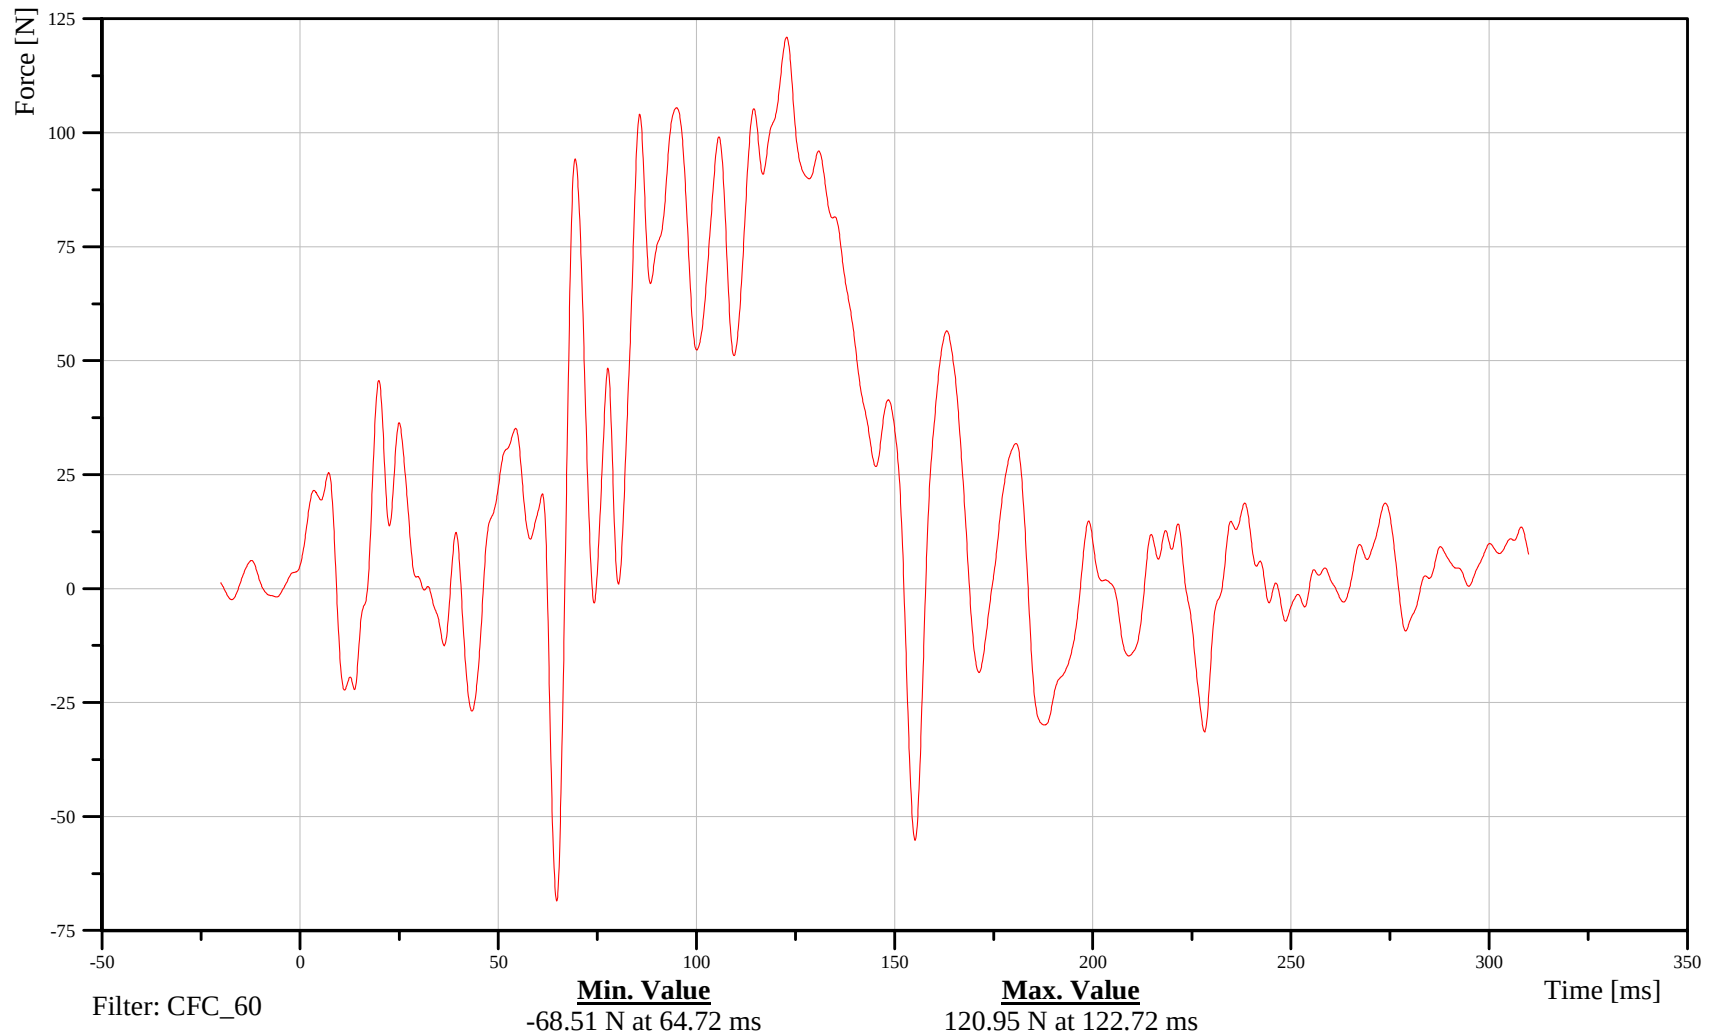

B-167

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 7

Customer: Volpe

L0FBAR000062FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

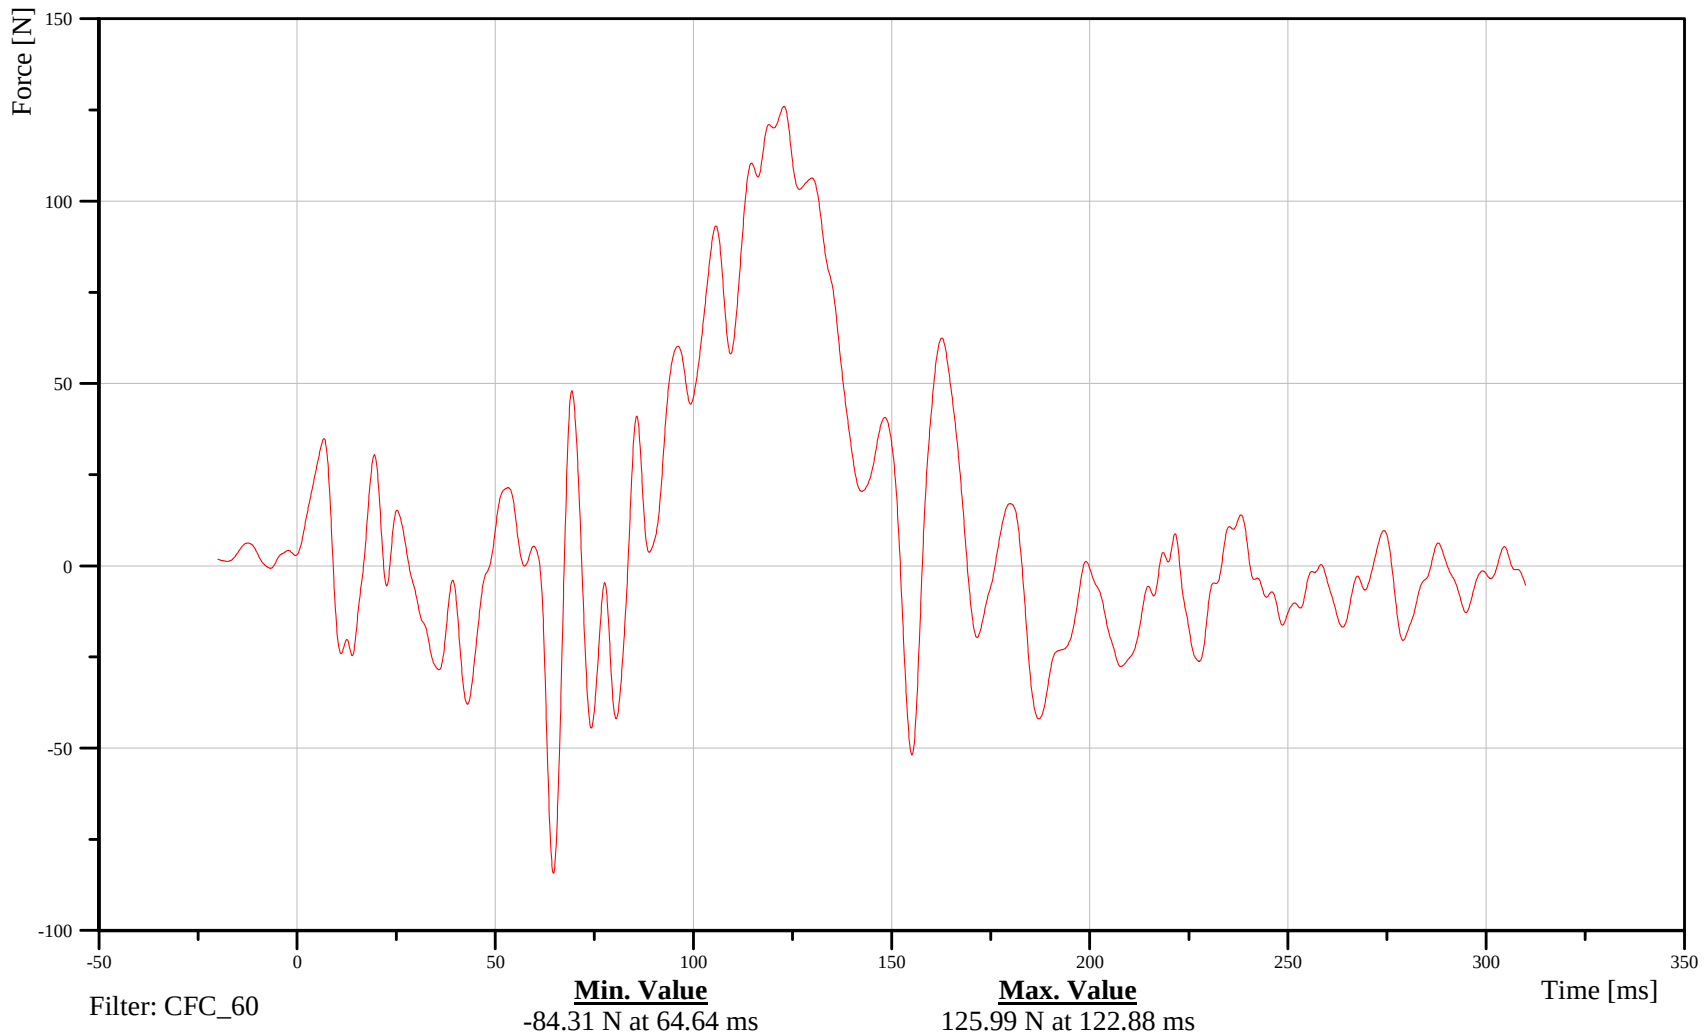

B-168

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 7

Customer: Volpe

L0FBAR000063FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

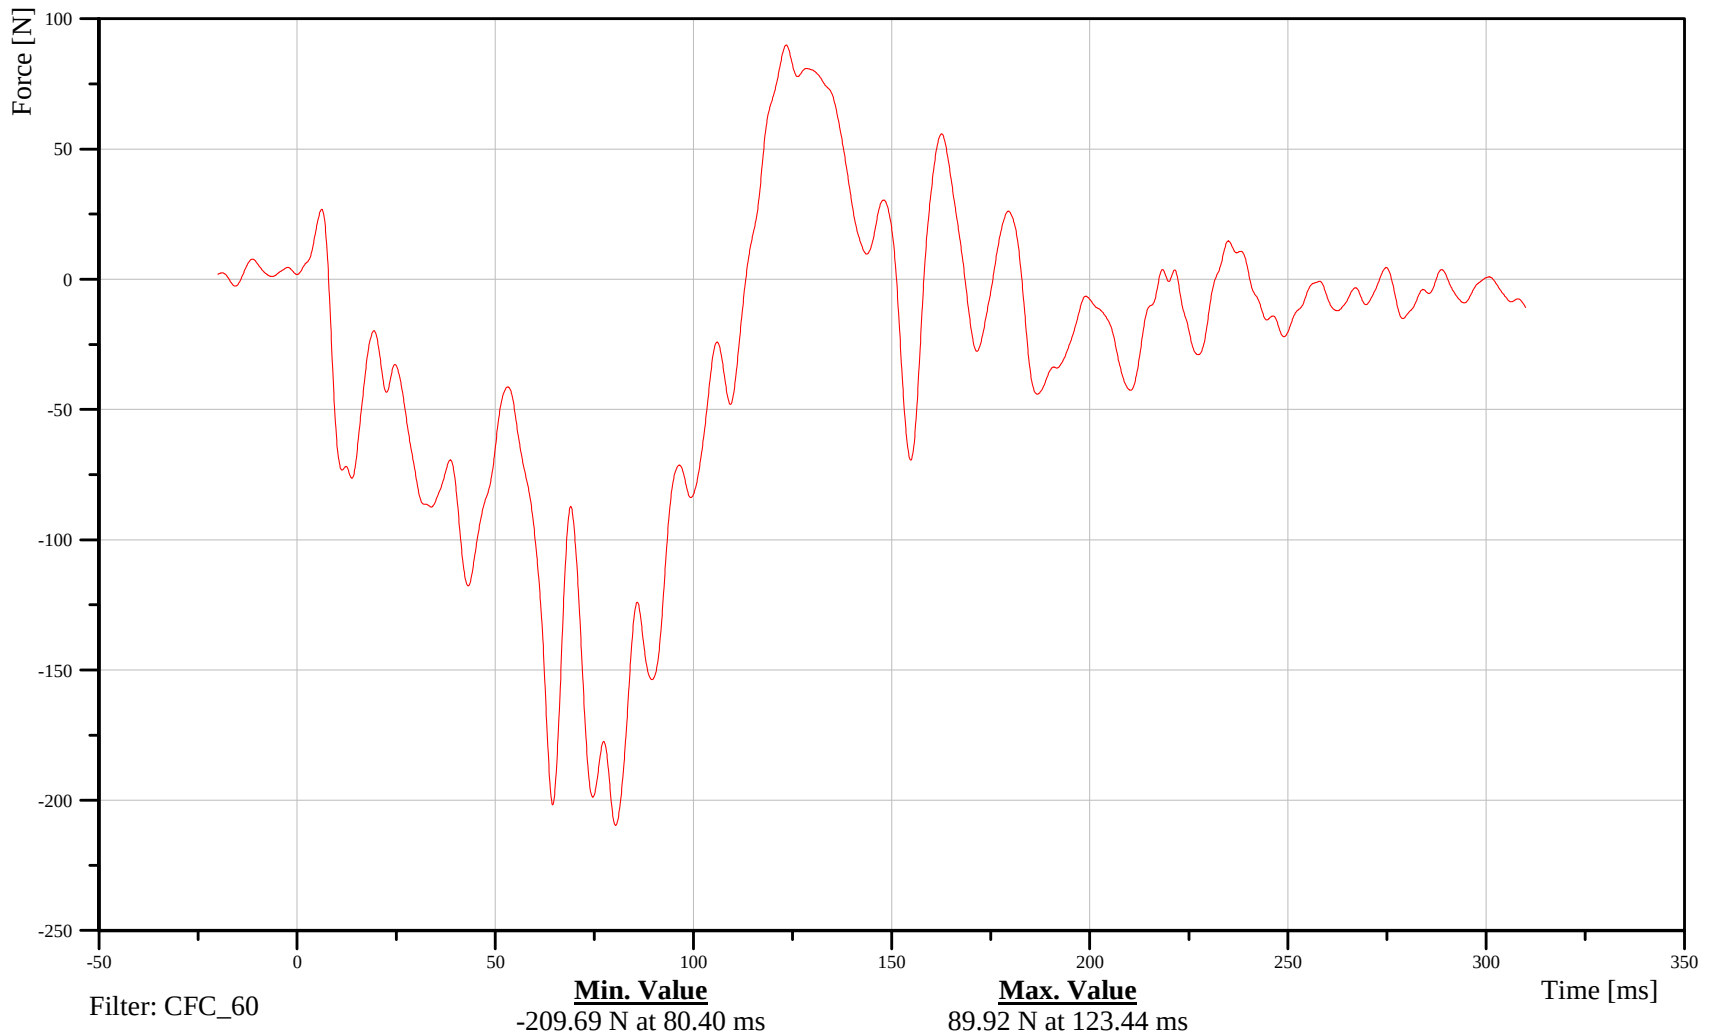

B-169

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 7

Customer: Volpe

L0FBAR000064FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

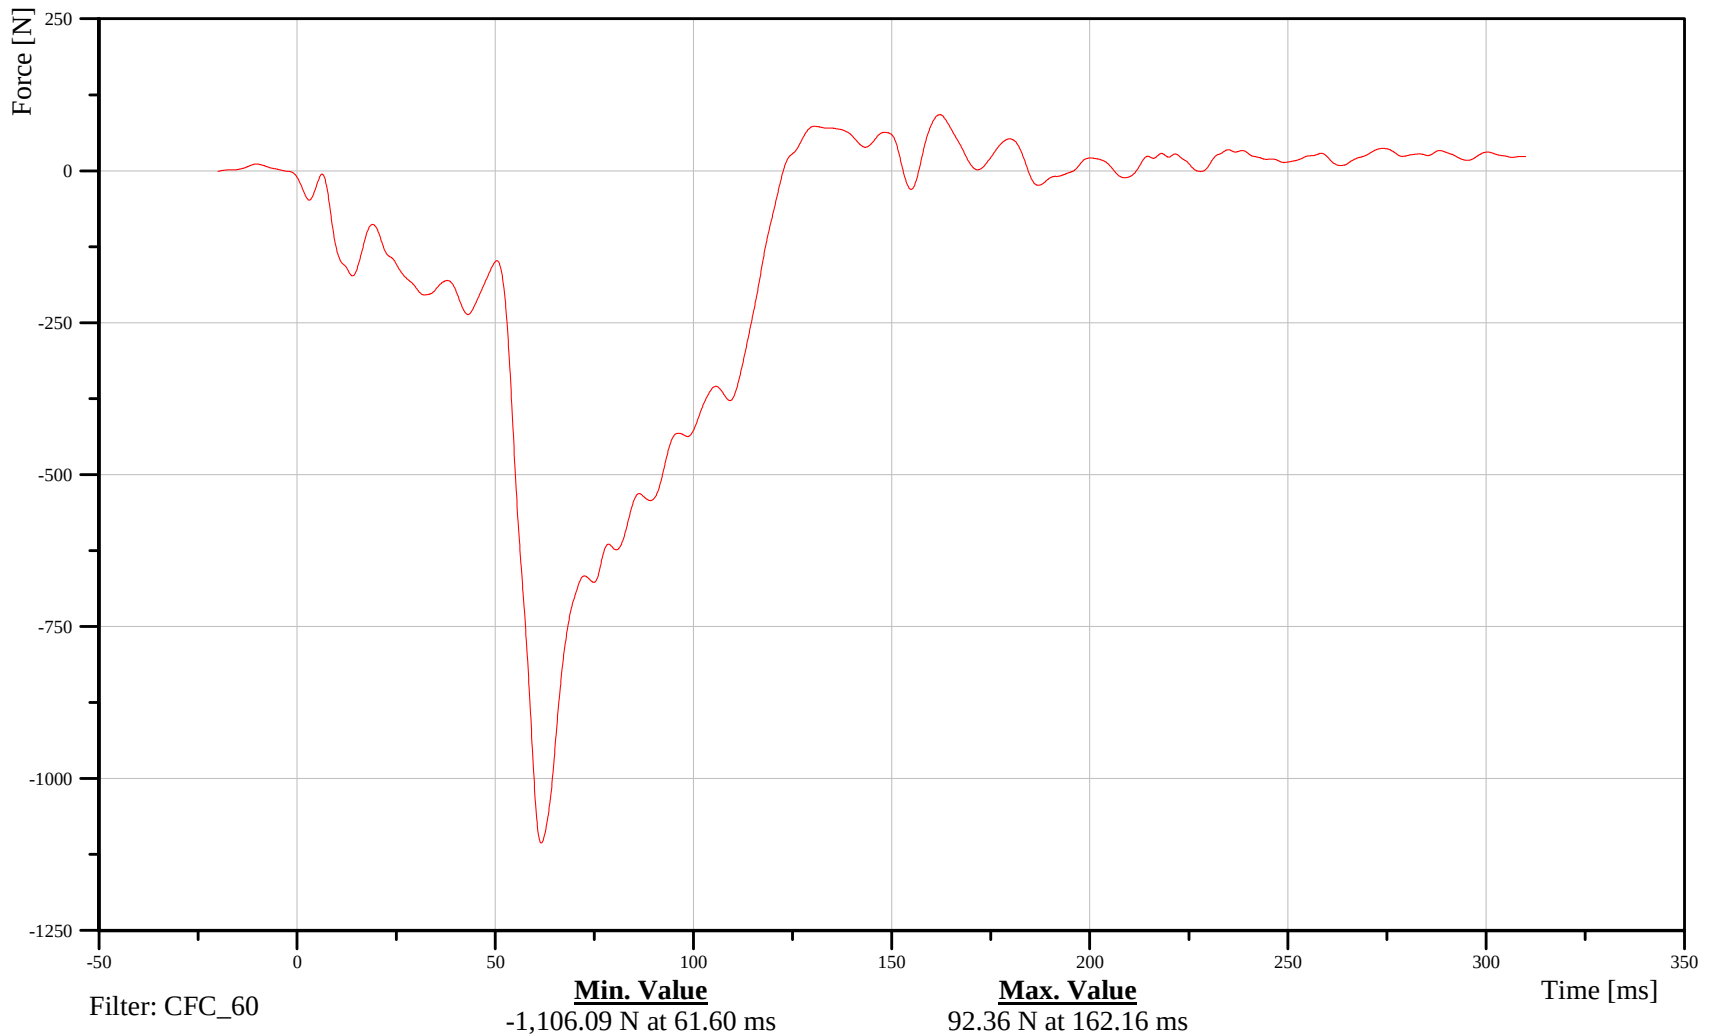

B-170

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 7

Customer: Volpe

L0FBAR000065FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

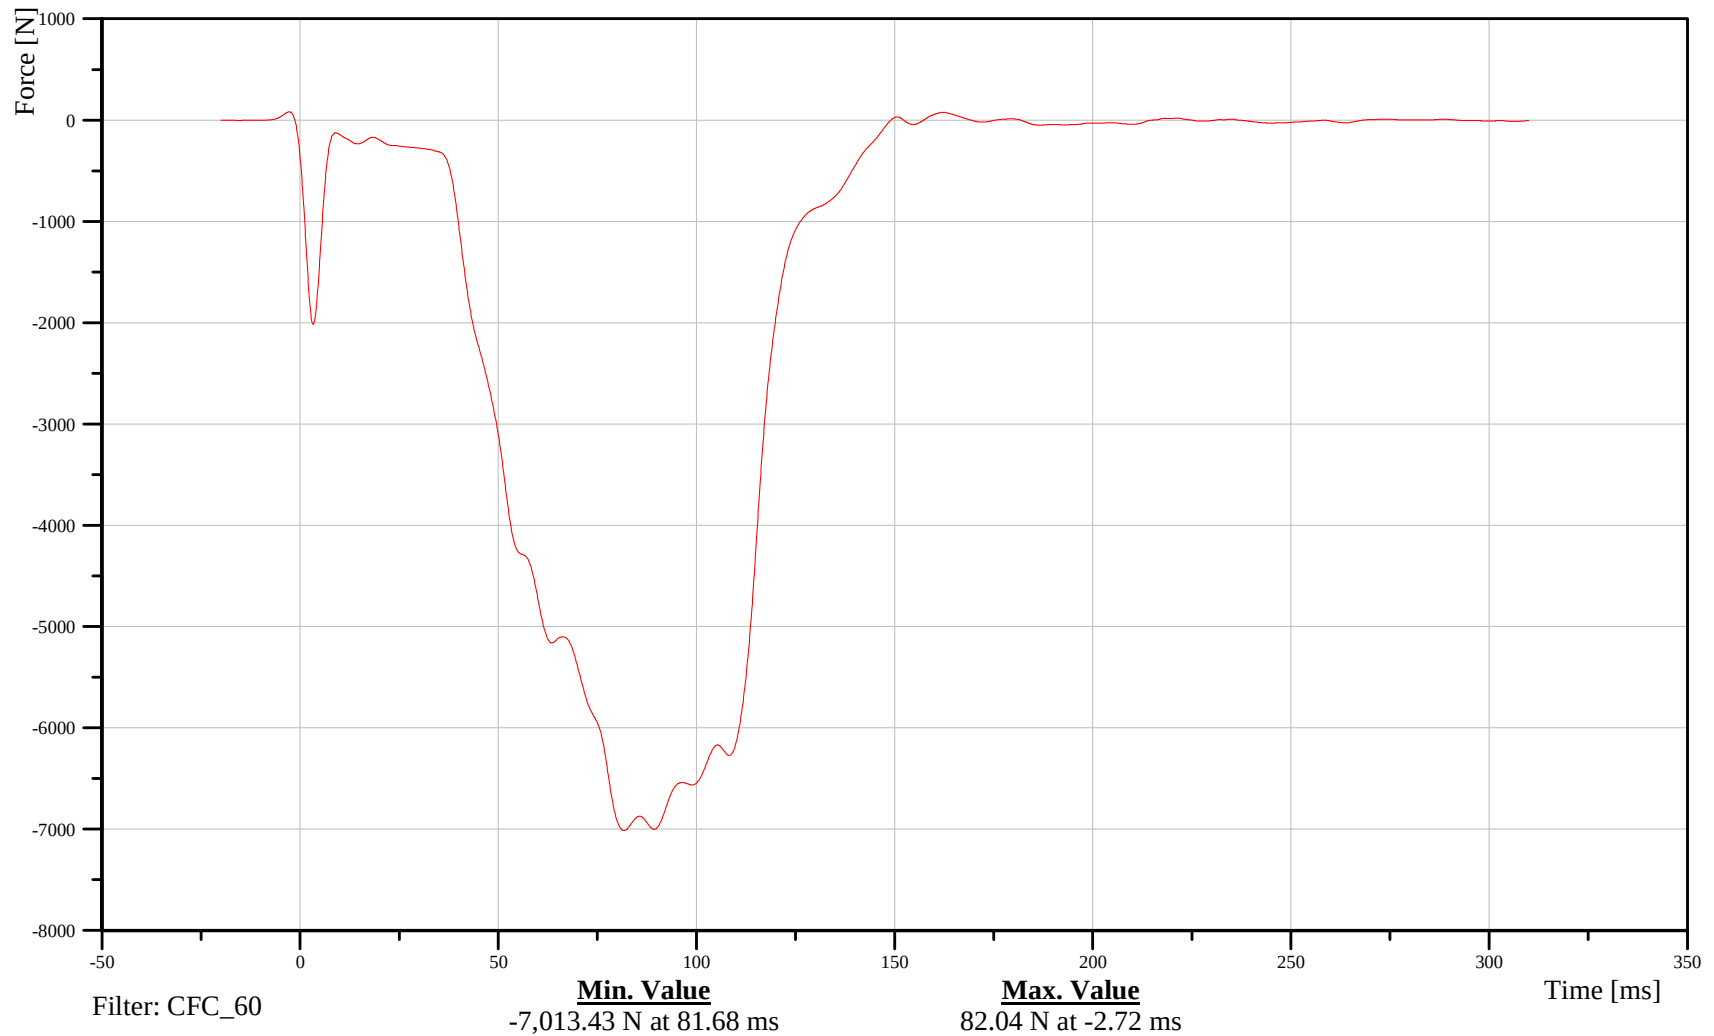

B-171

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 6 Column 7

Customer: Volpe

L0FBAR000066FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

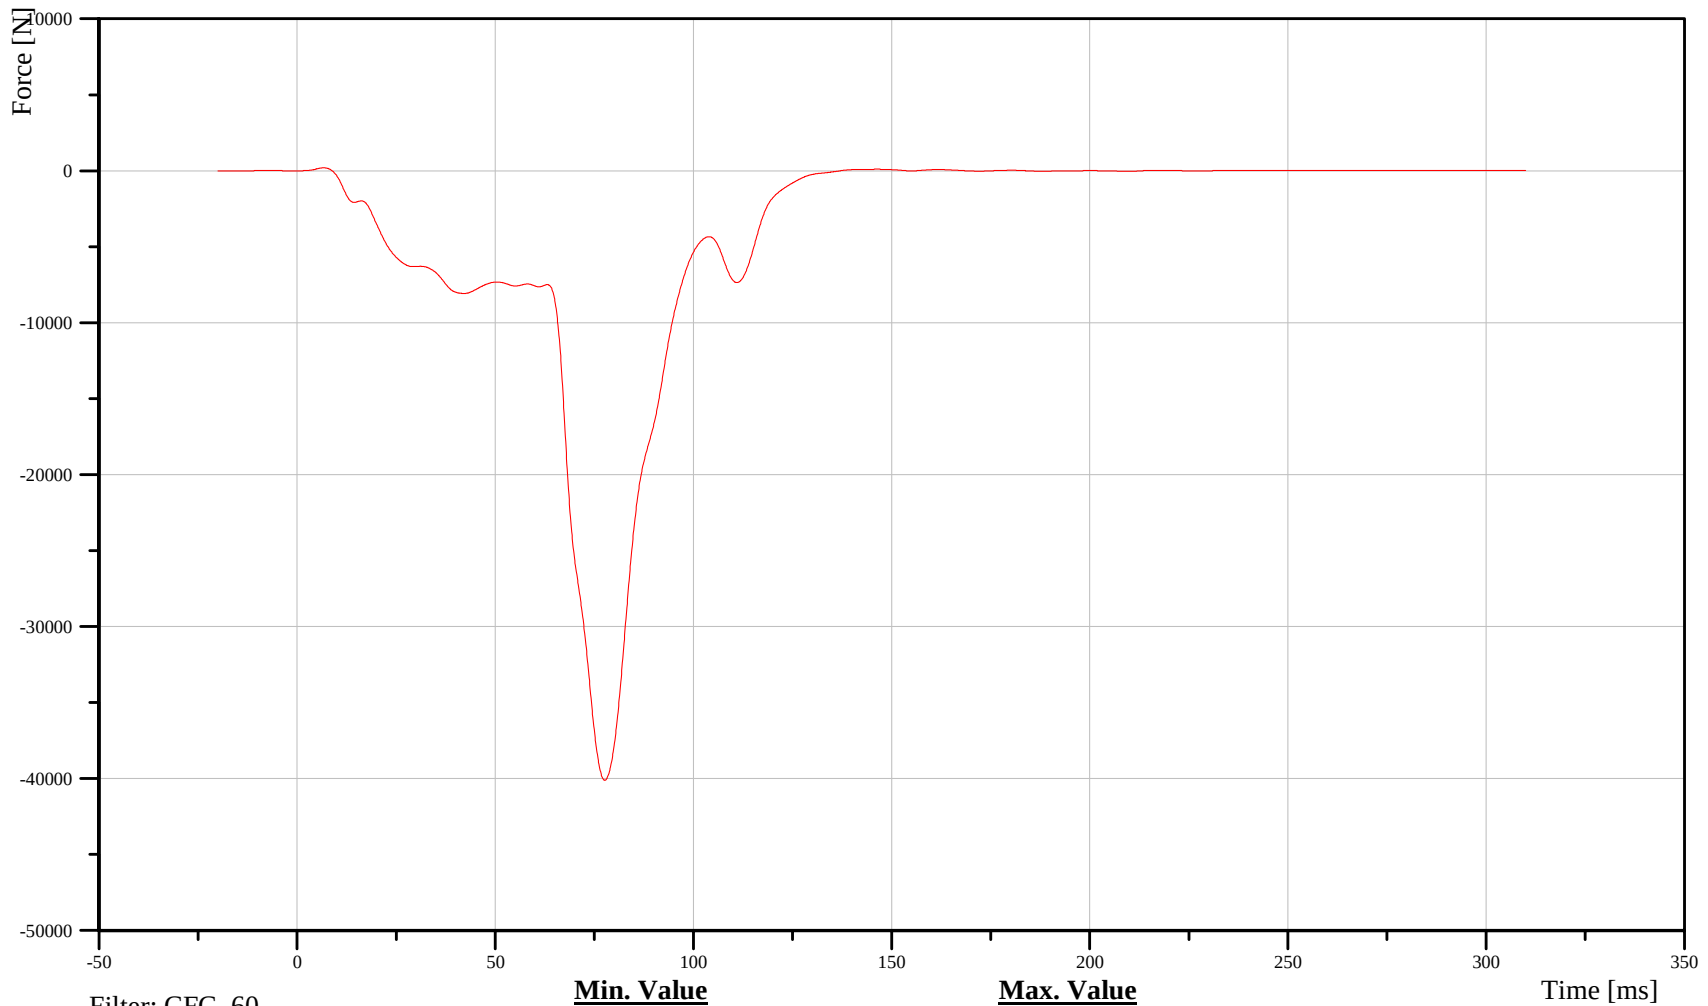

B-172

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 7


Time: 18:05

Customer: Volpe

L0FBAR000067FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

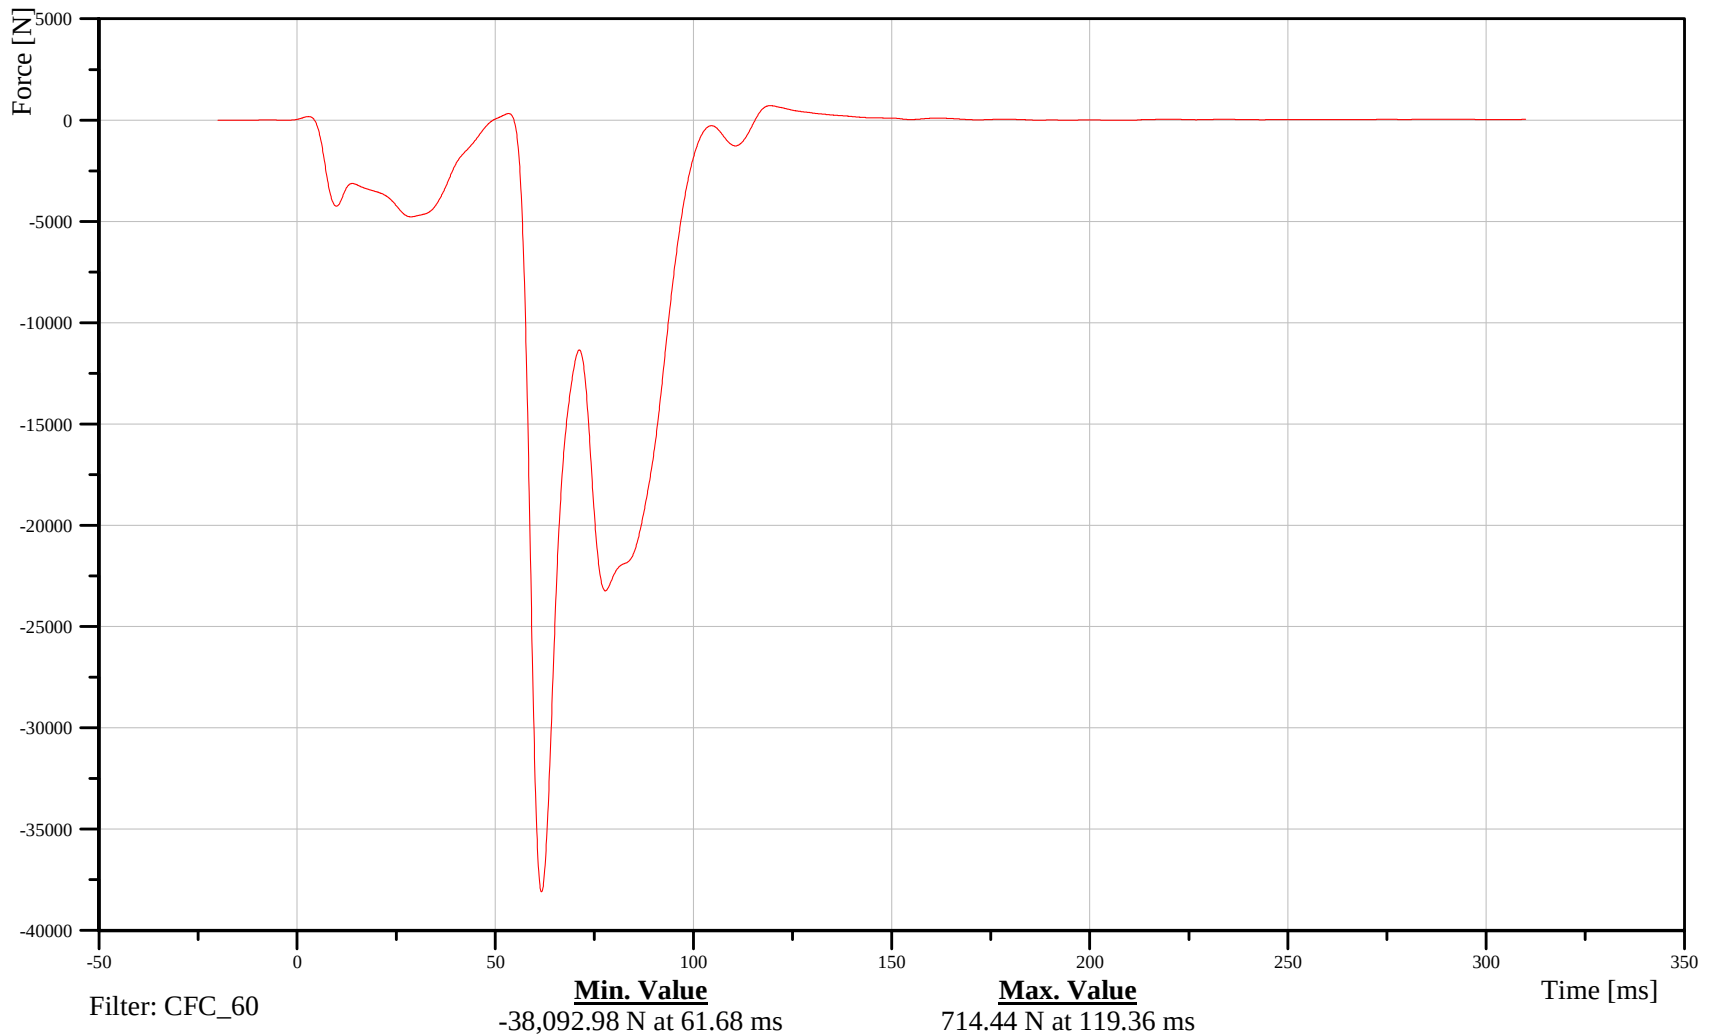

B-173

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 8 Column 7

Customer: Volpe

L0FBAR000068FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

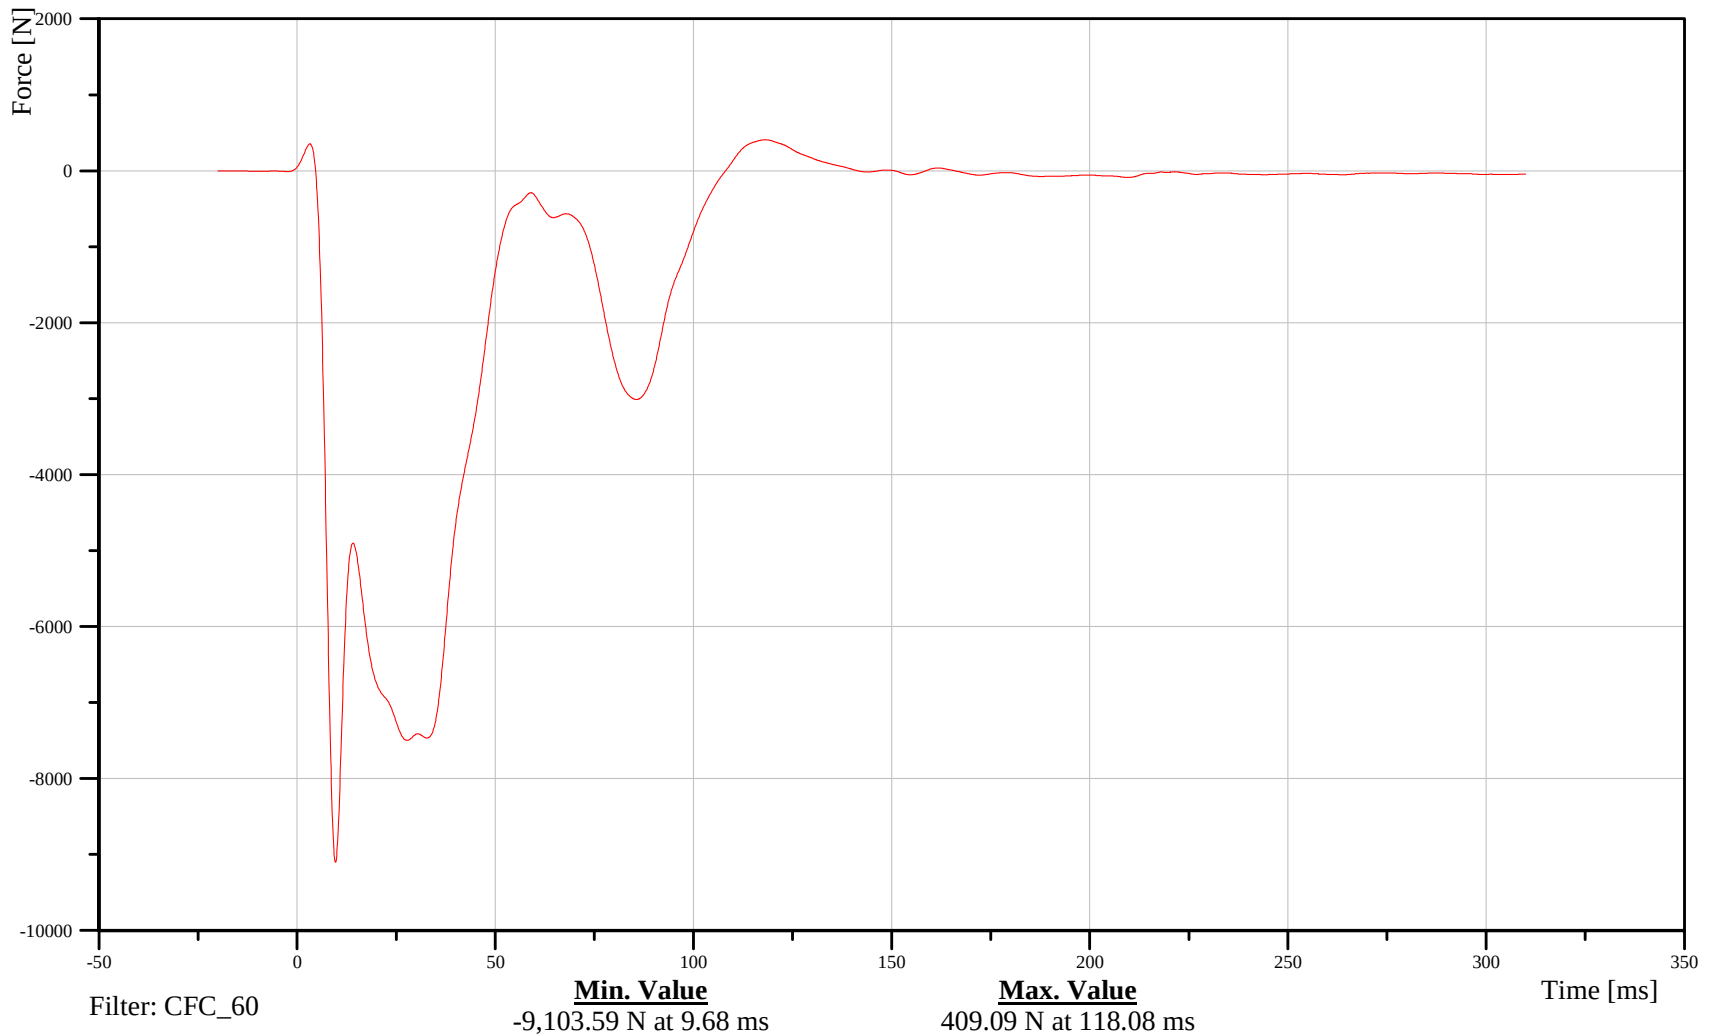

B-174

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 7

Customer: Volpe

L0FBAR000069FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

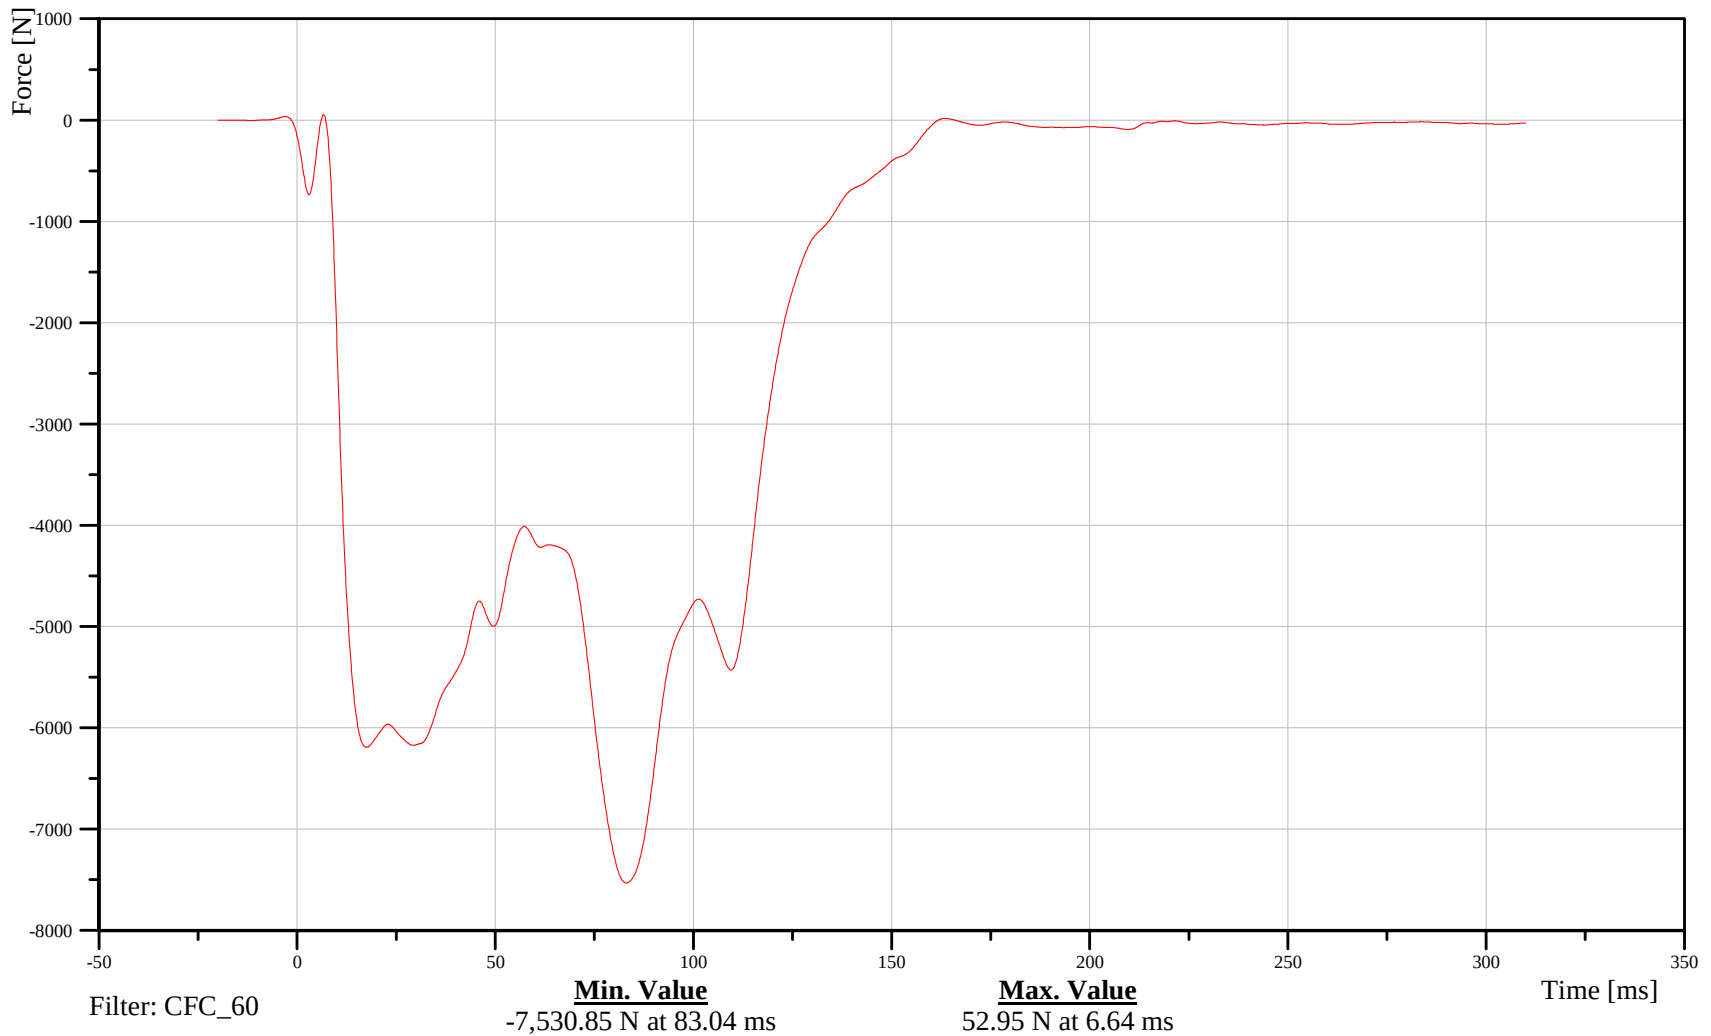

B-175

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 7

Customer: Volpe

L0FBAR000070FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

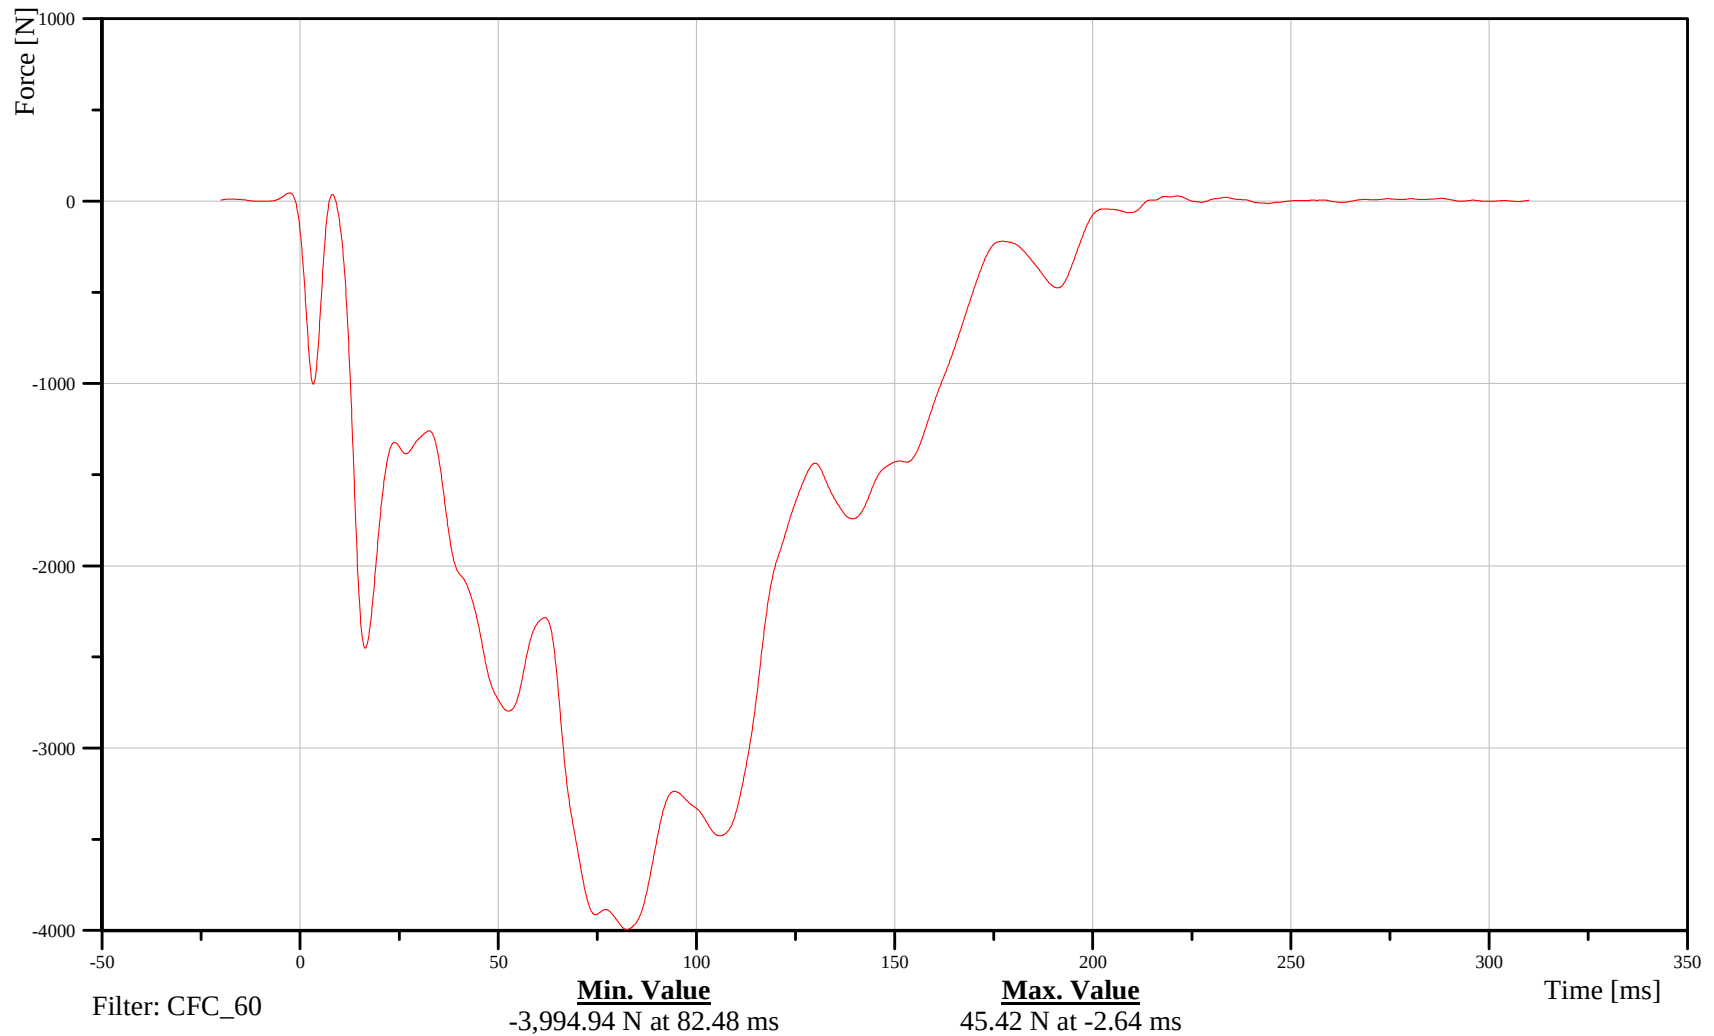

B-176

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 1 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000071FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

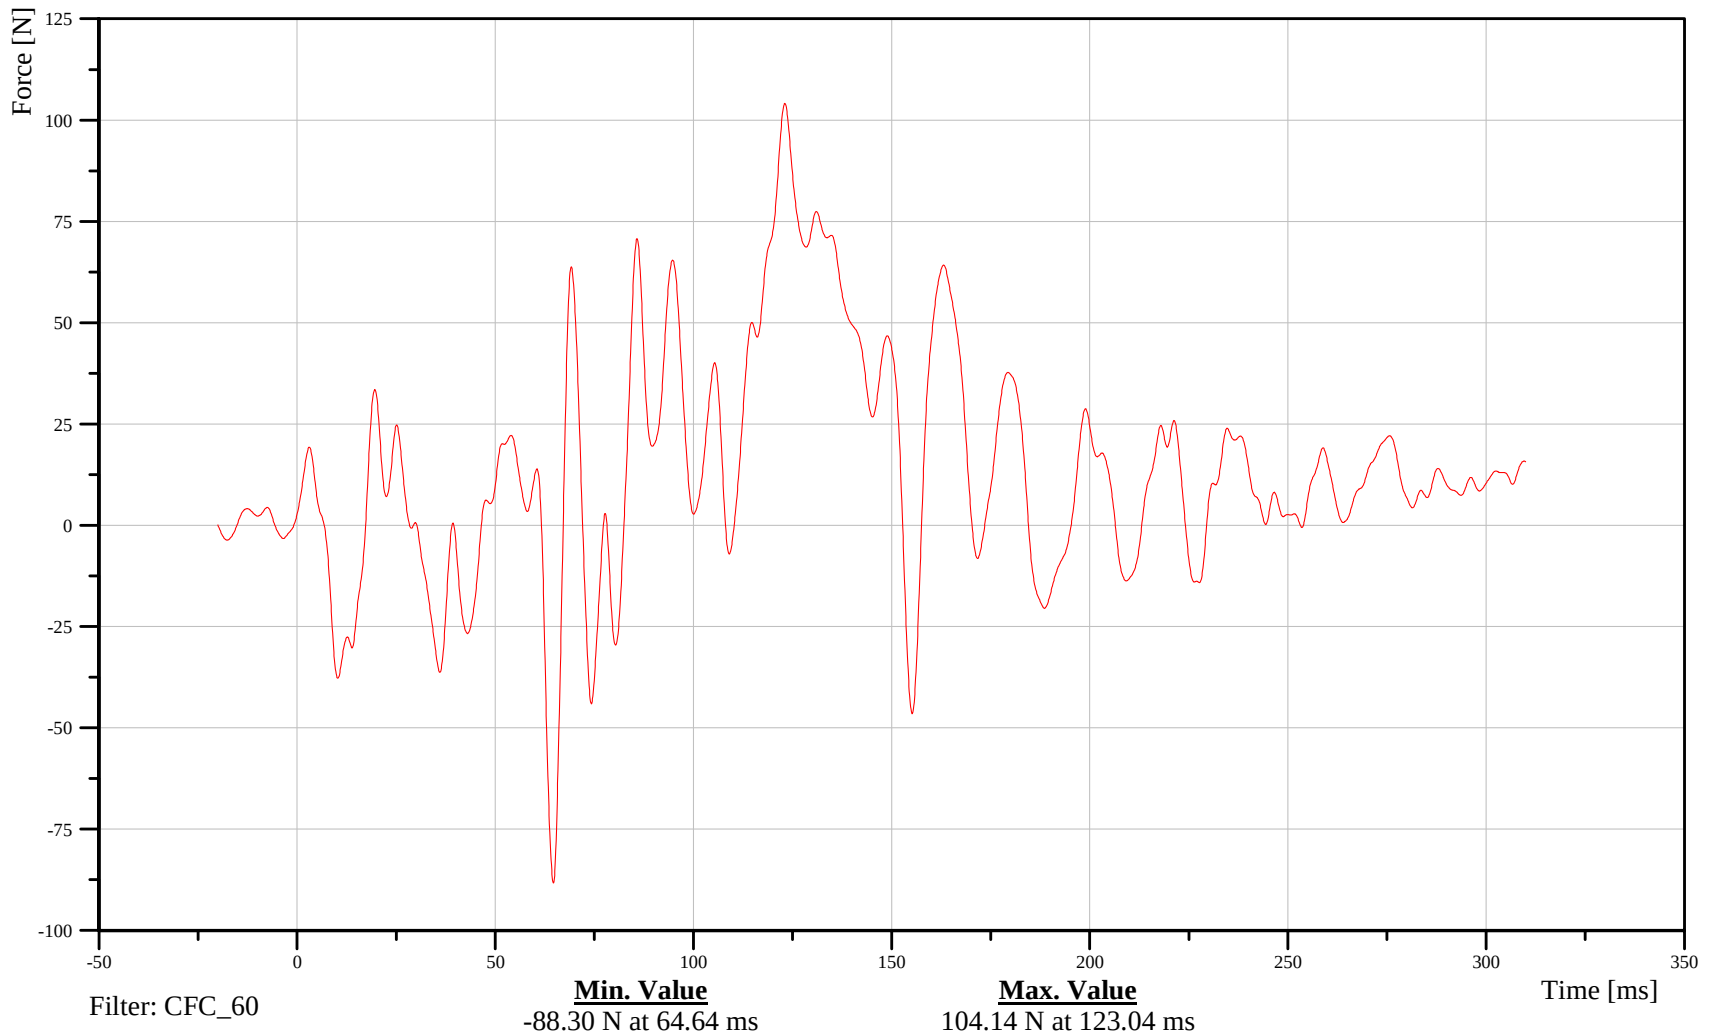

B-177

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 8

Customer: Volpe

L0FBAR000072FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

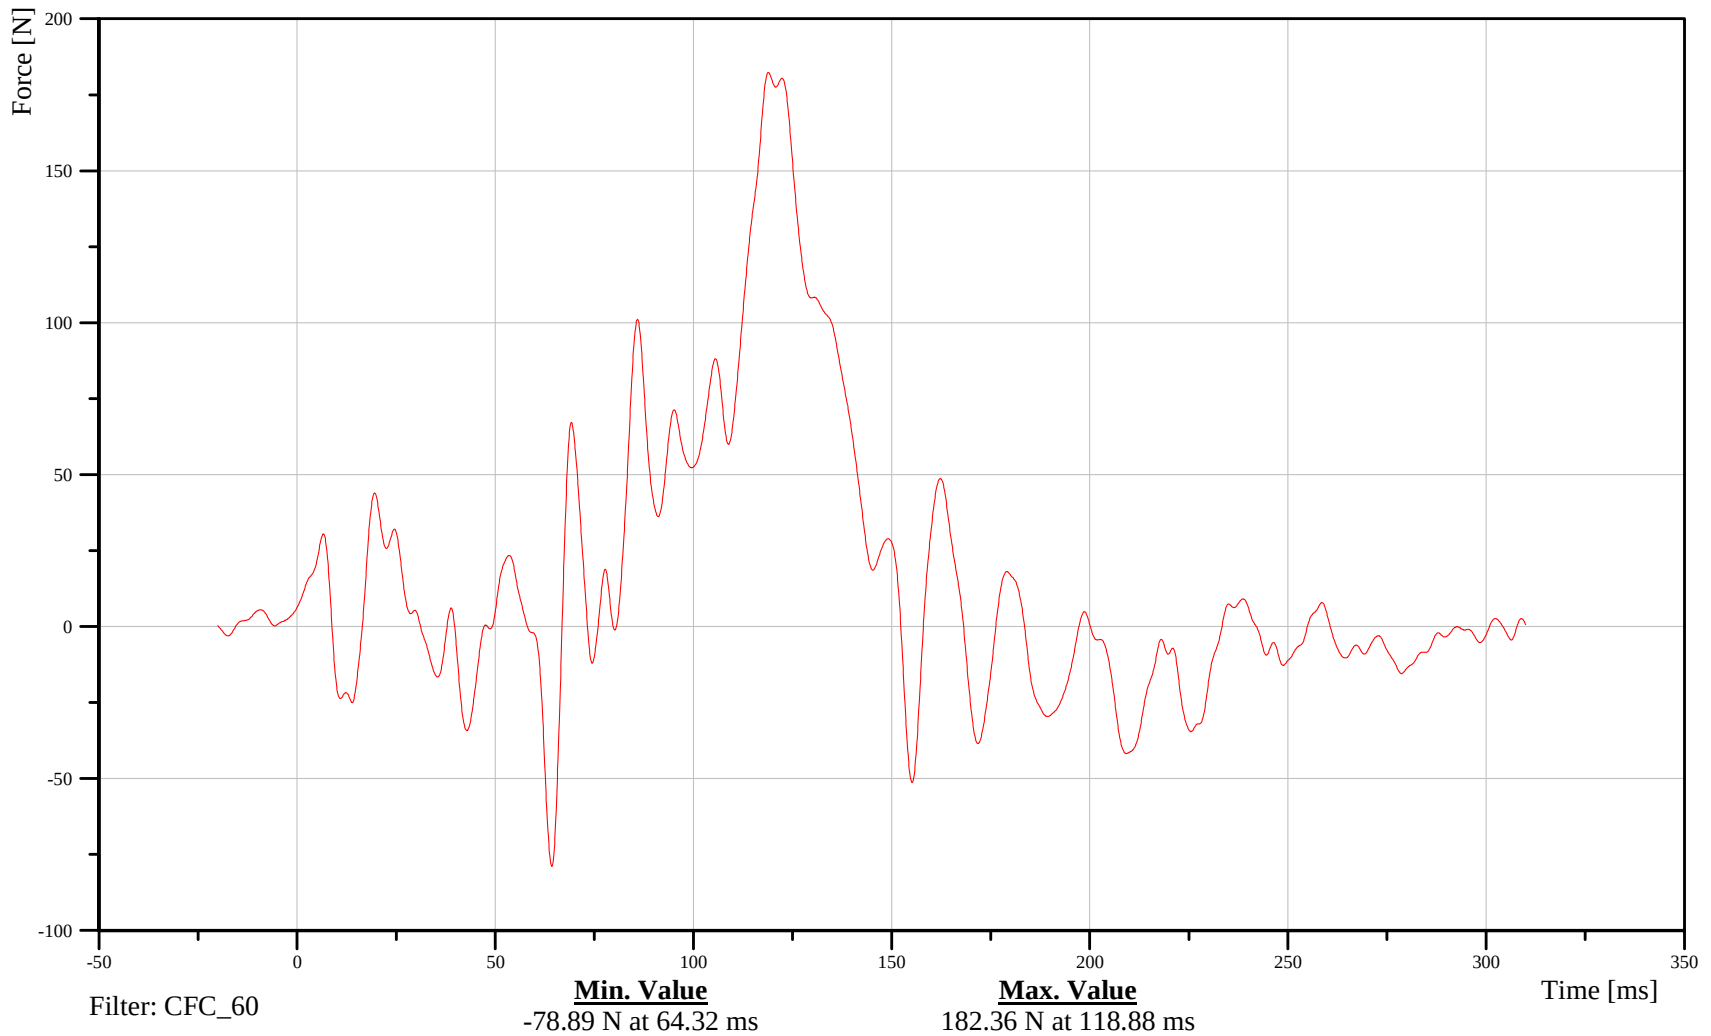

B-178

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 3 Column 8

Customer: Volpe

L0FBAR000073FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

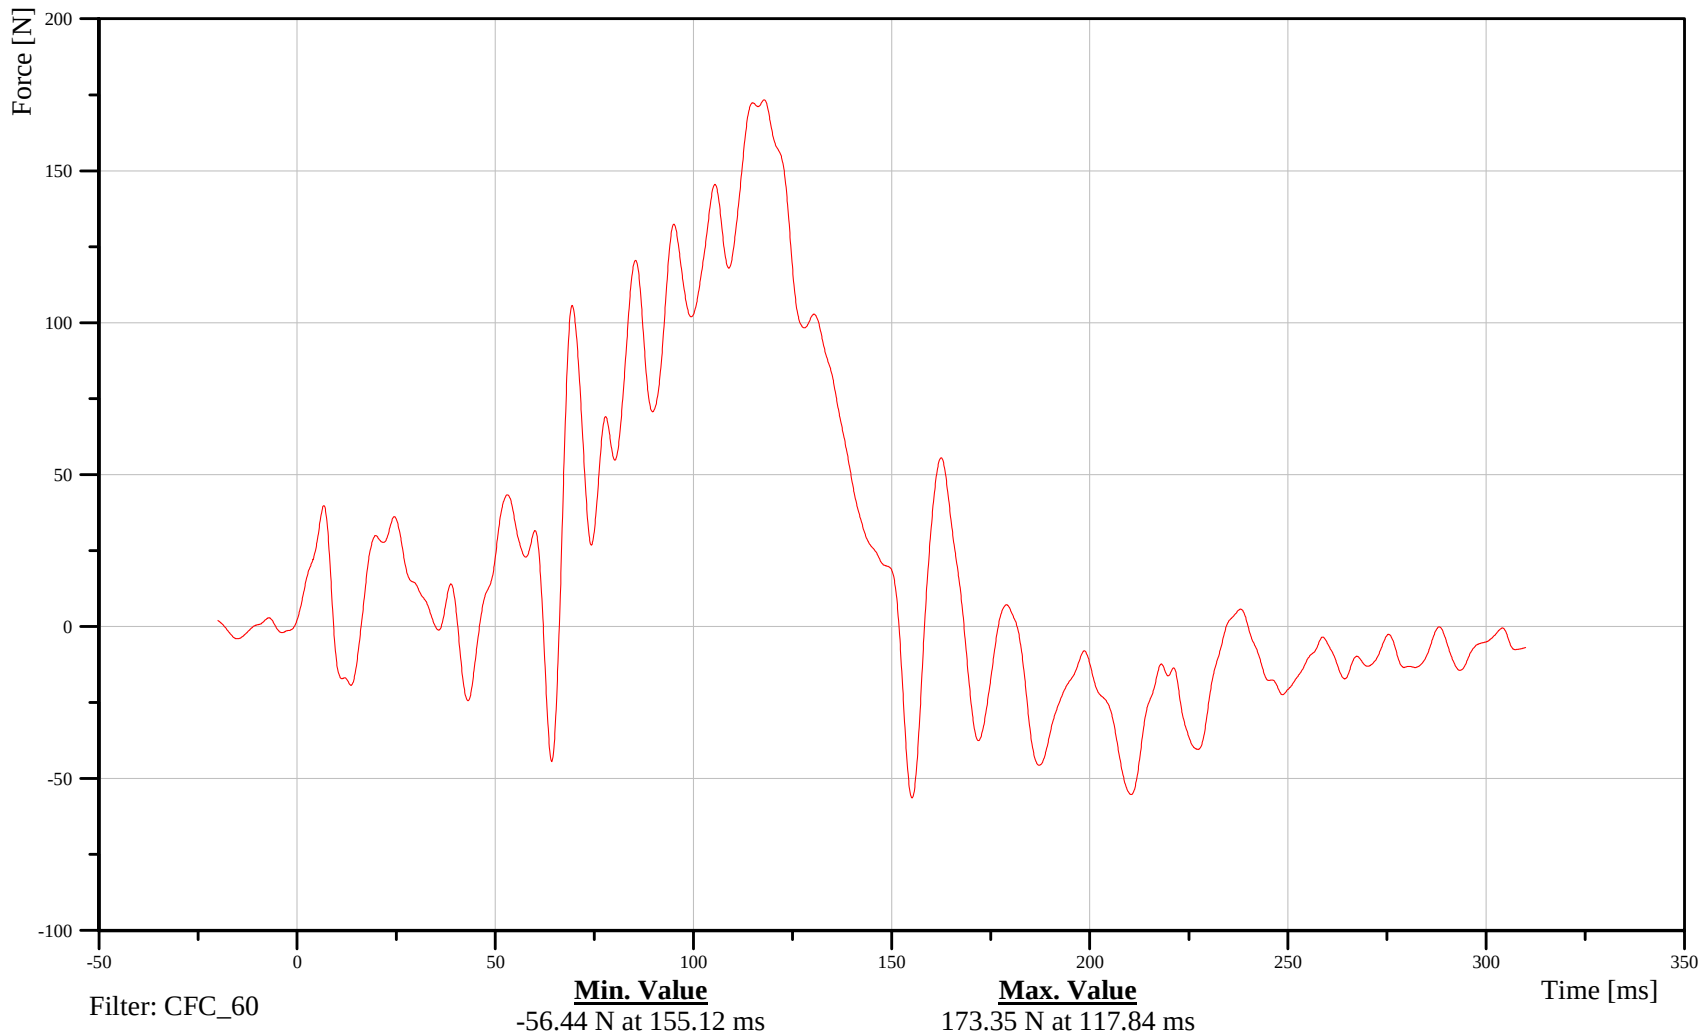

B-179

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 4 Column 8

Customer: Volpe

L0FBAR000074FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

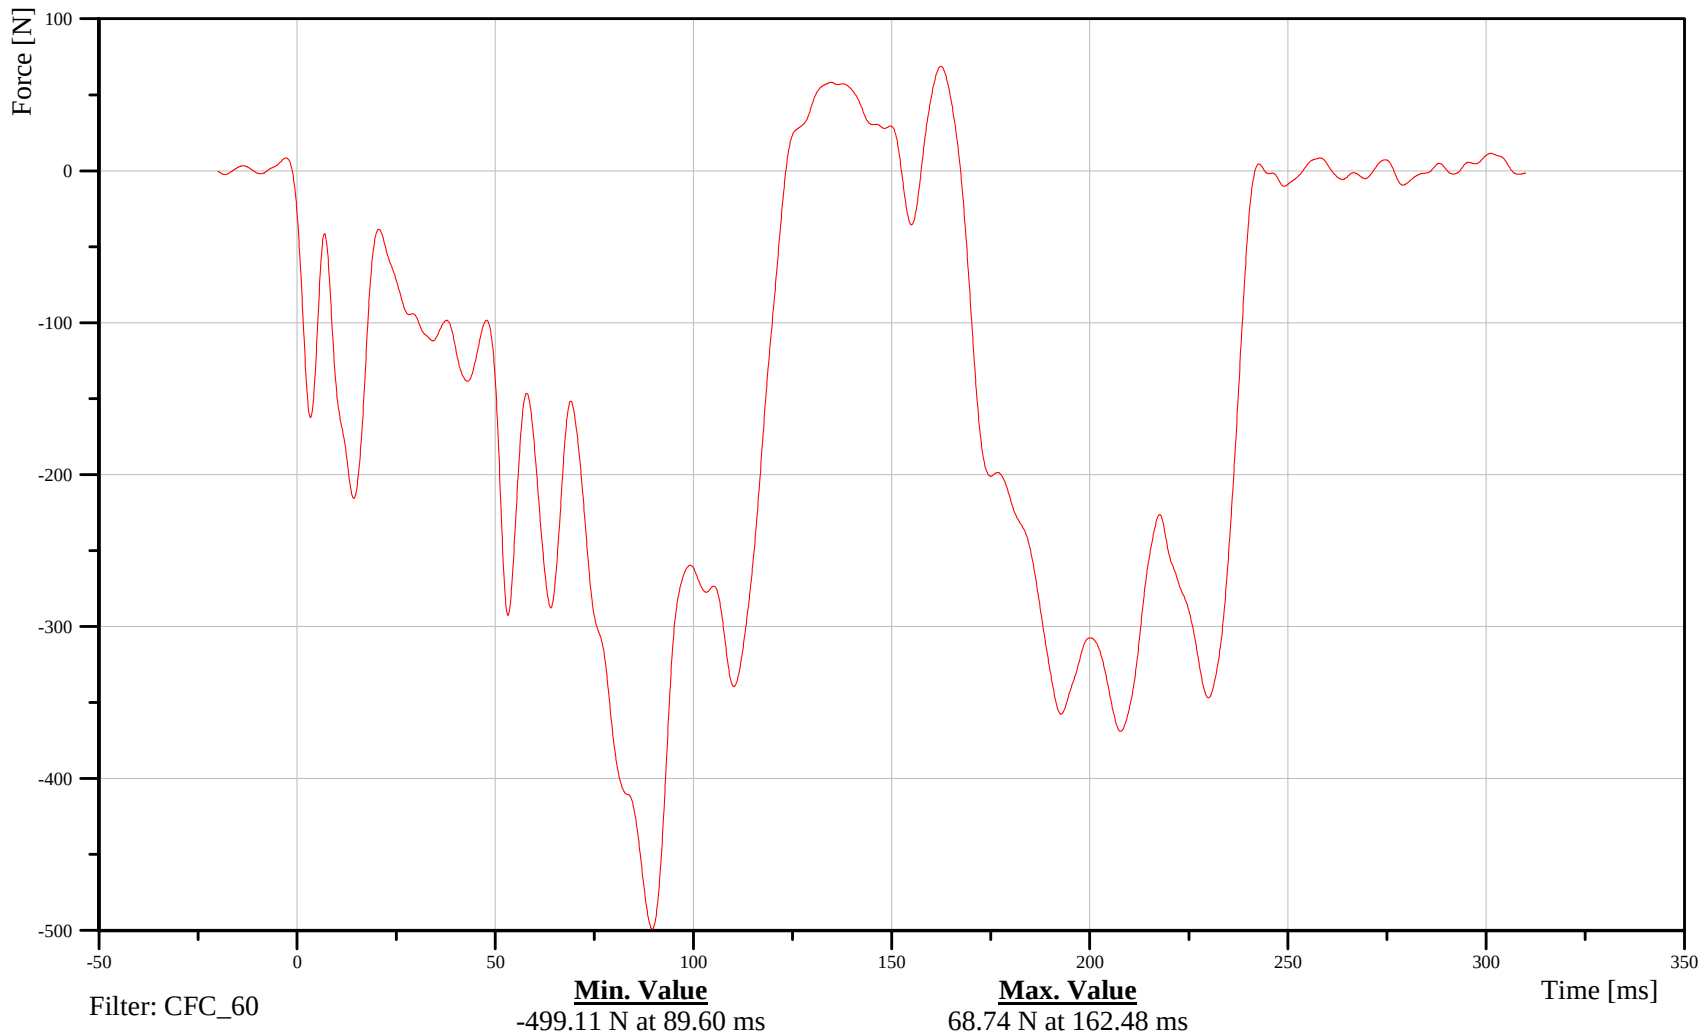

B-180

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 5 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000075FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

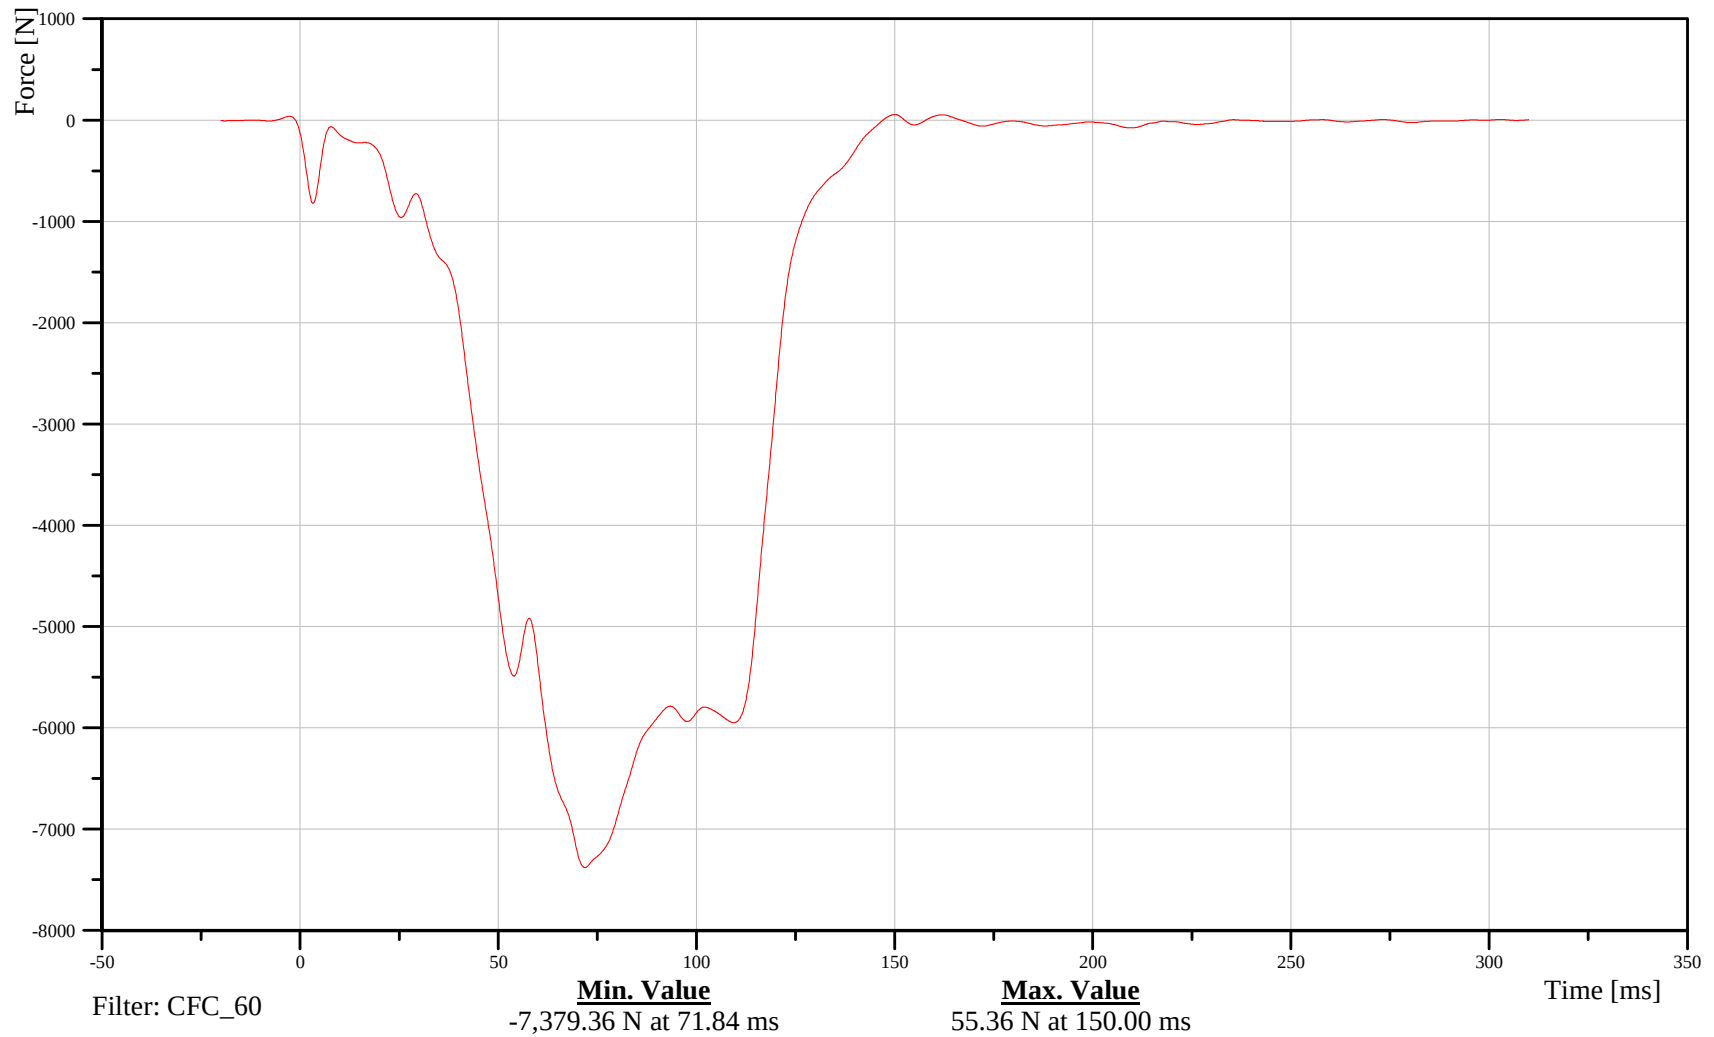

B-181

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 6 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000076FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

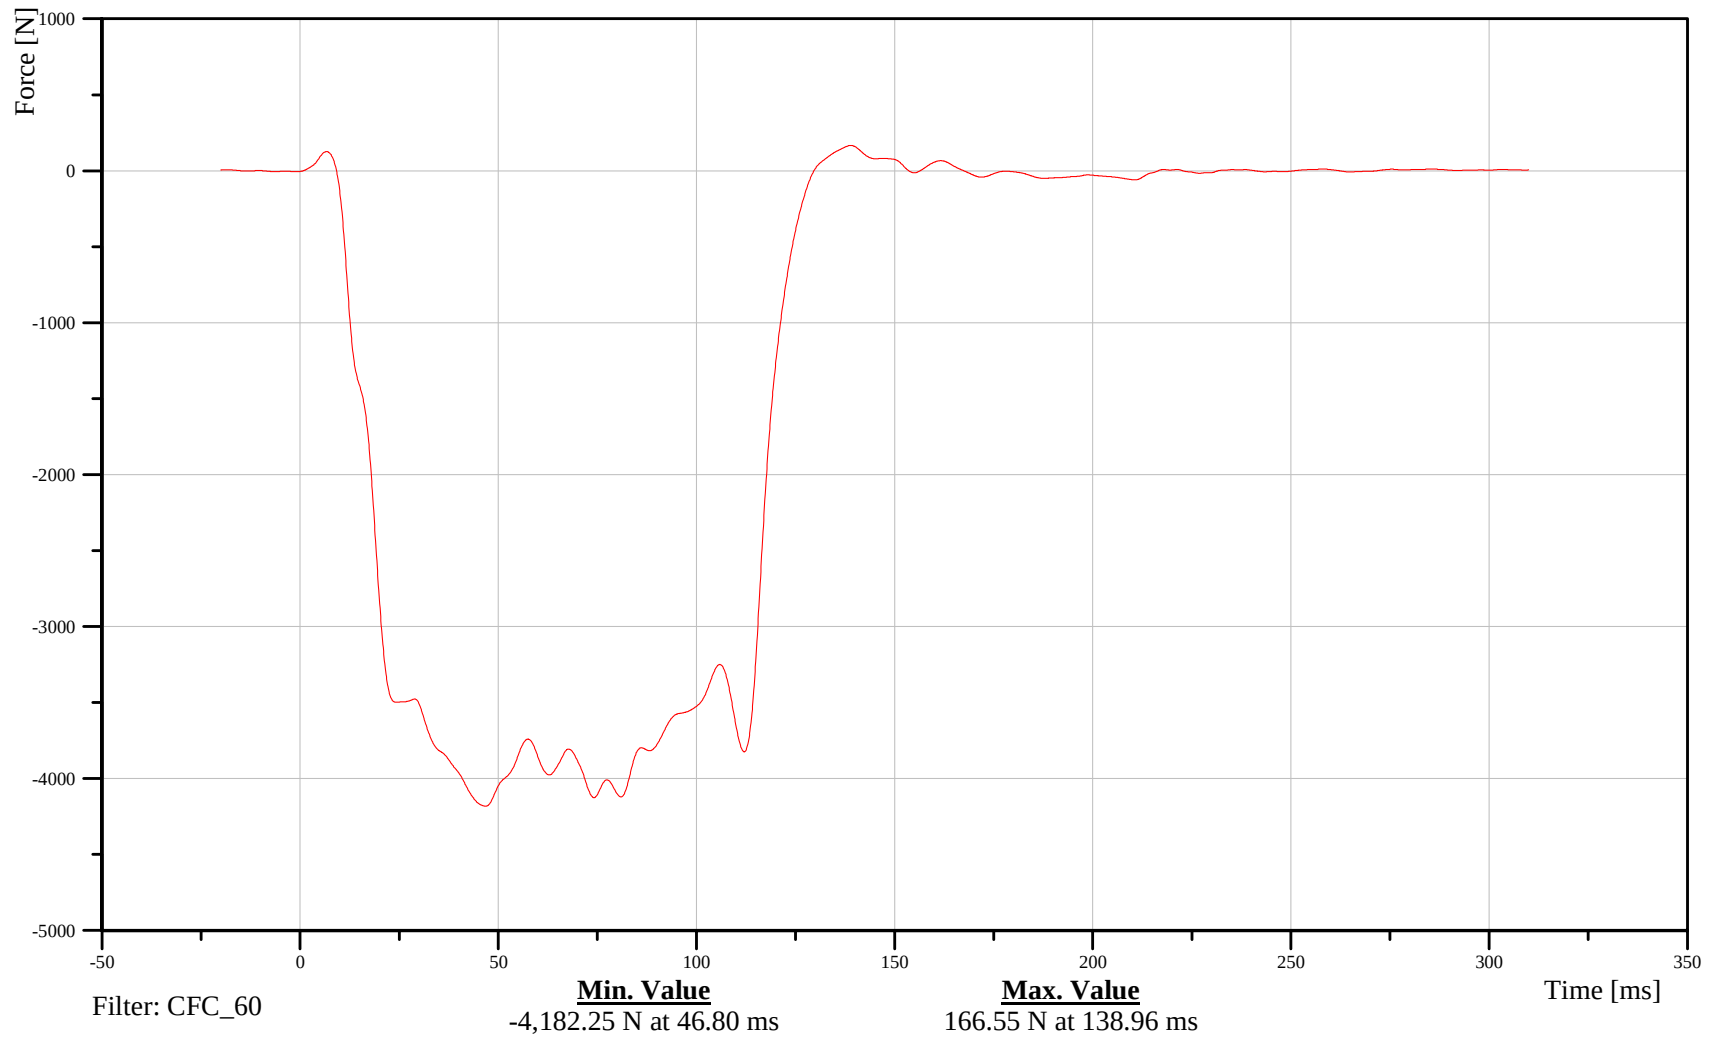

B-182

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 7 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000077FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

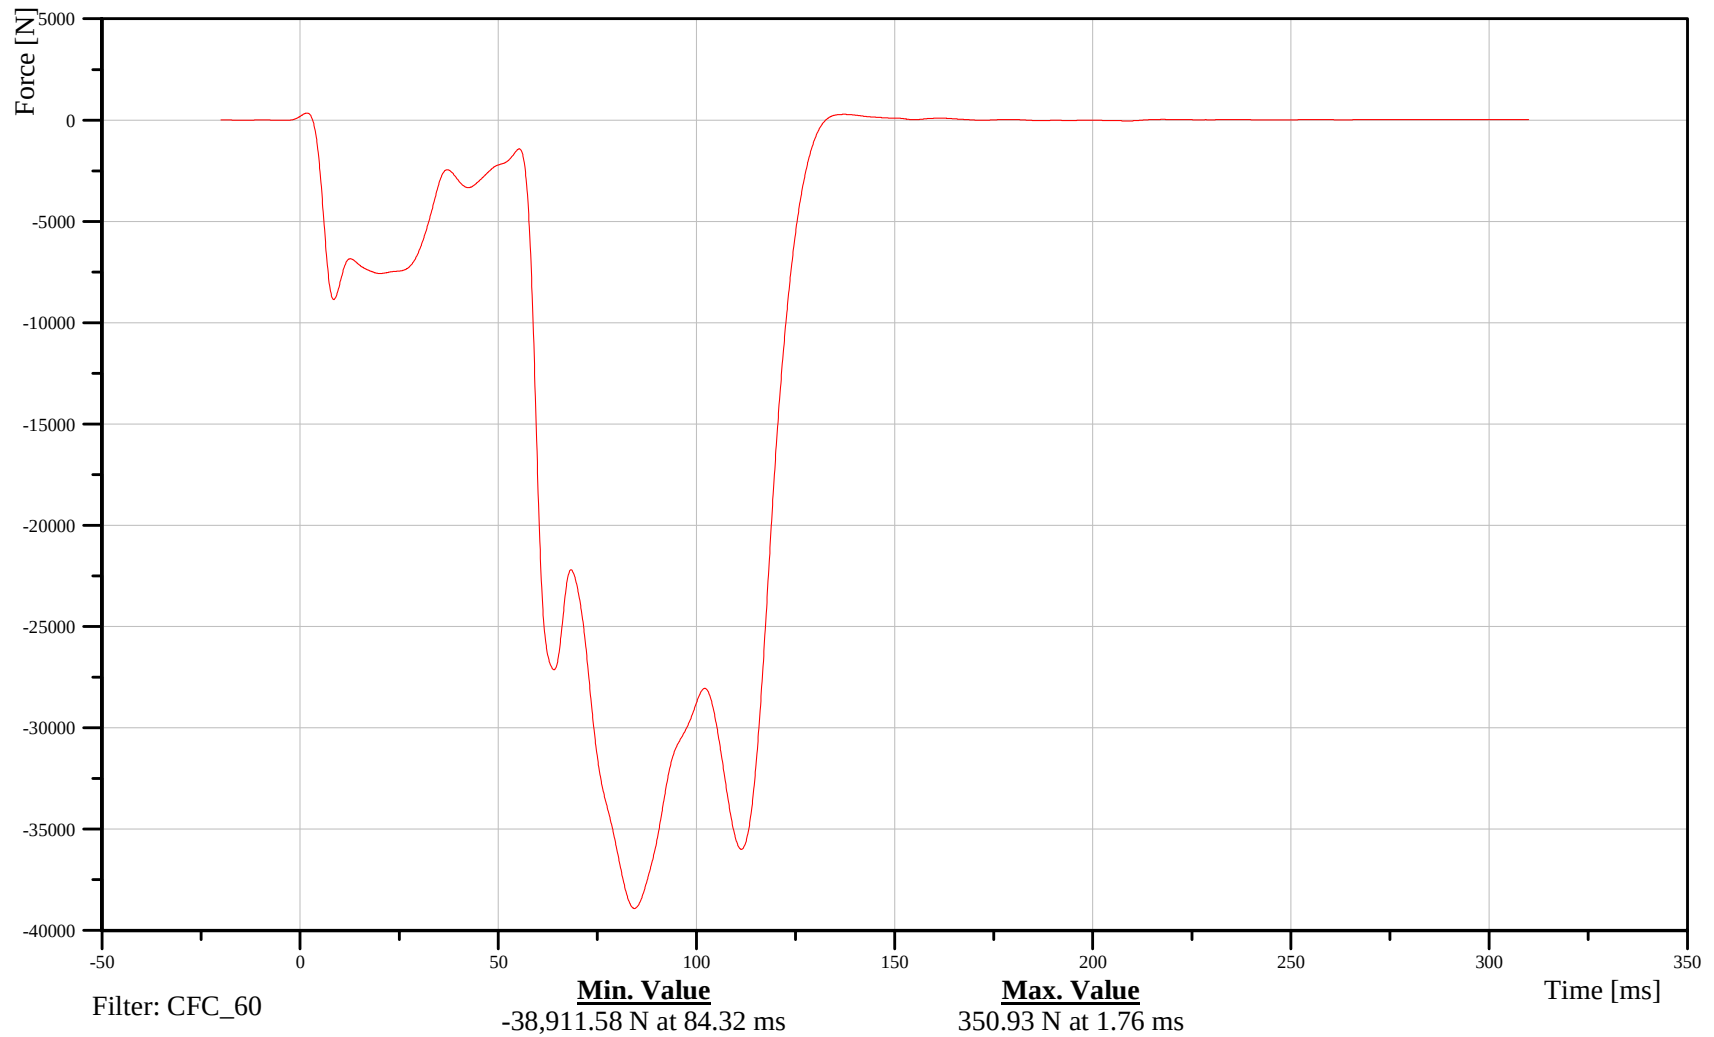

B-183

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 8 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000078FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

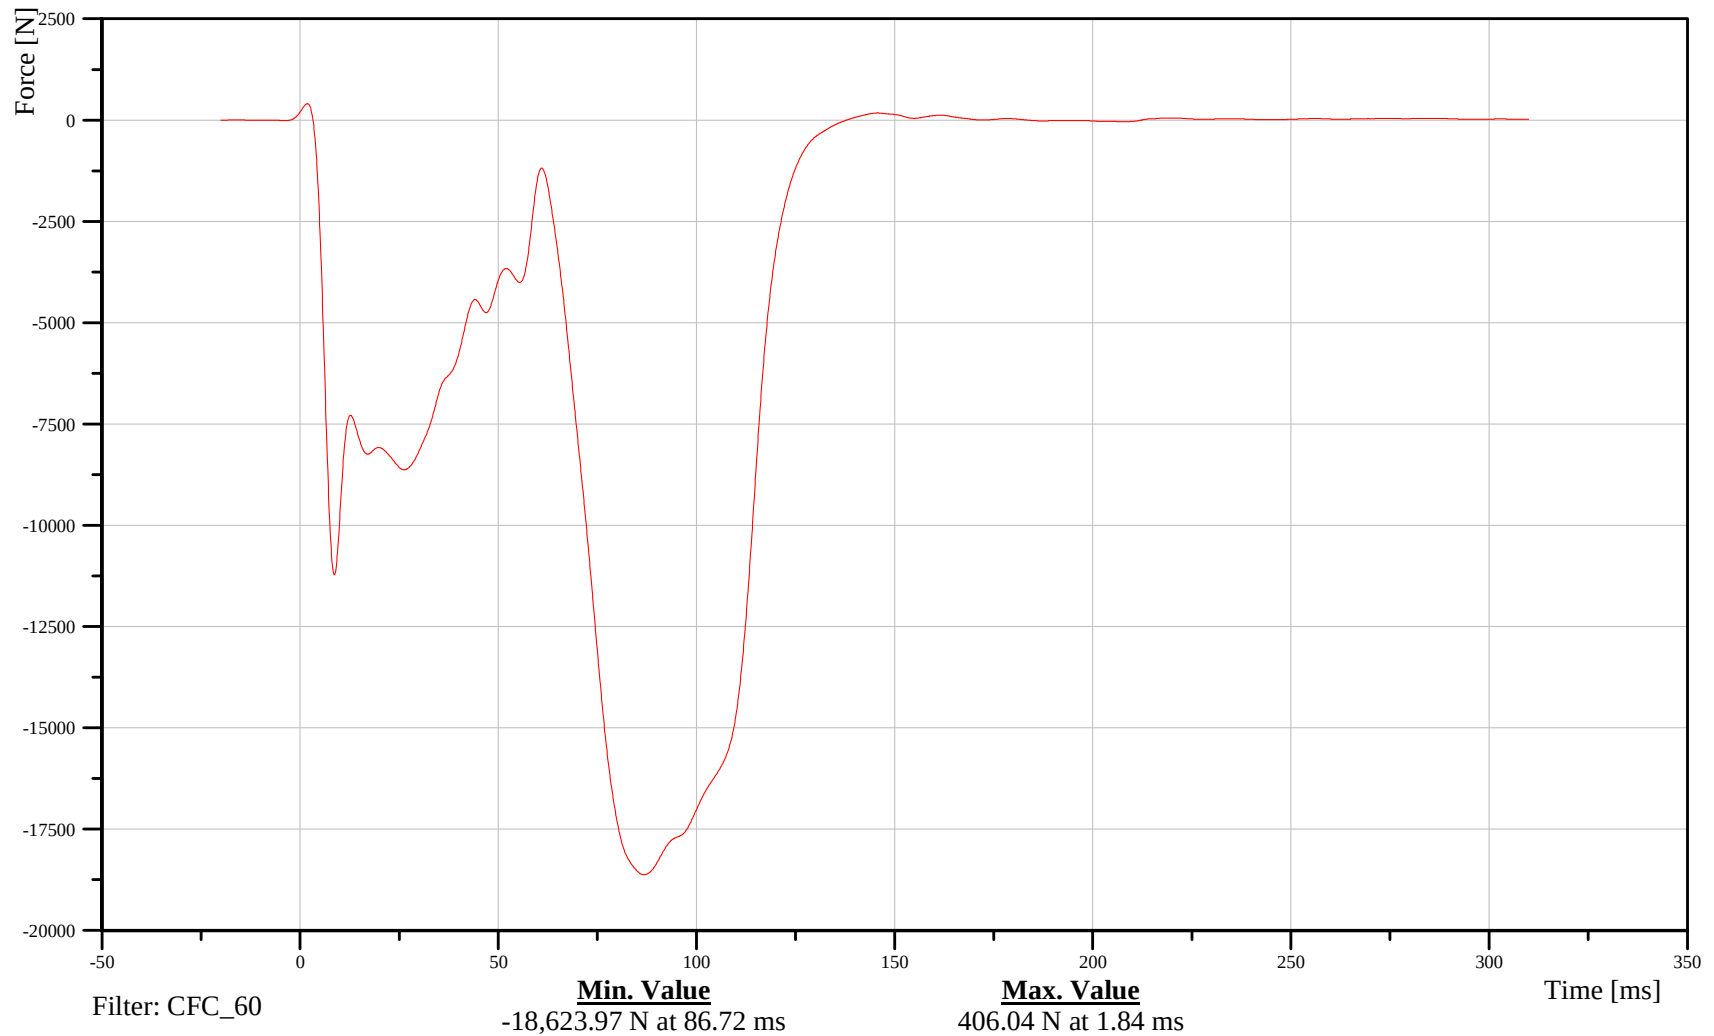

B-184

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 9 Column 8


Time: 18:05

Customer: Volpe

L0FBAR000079FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

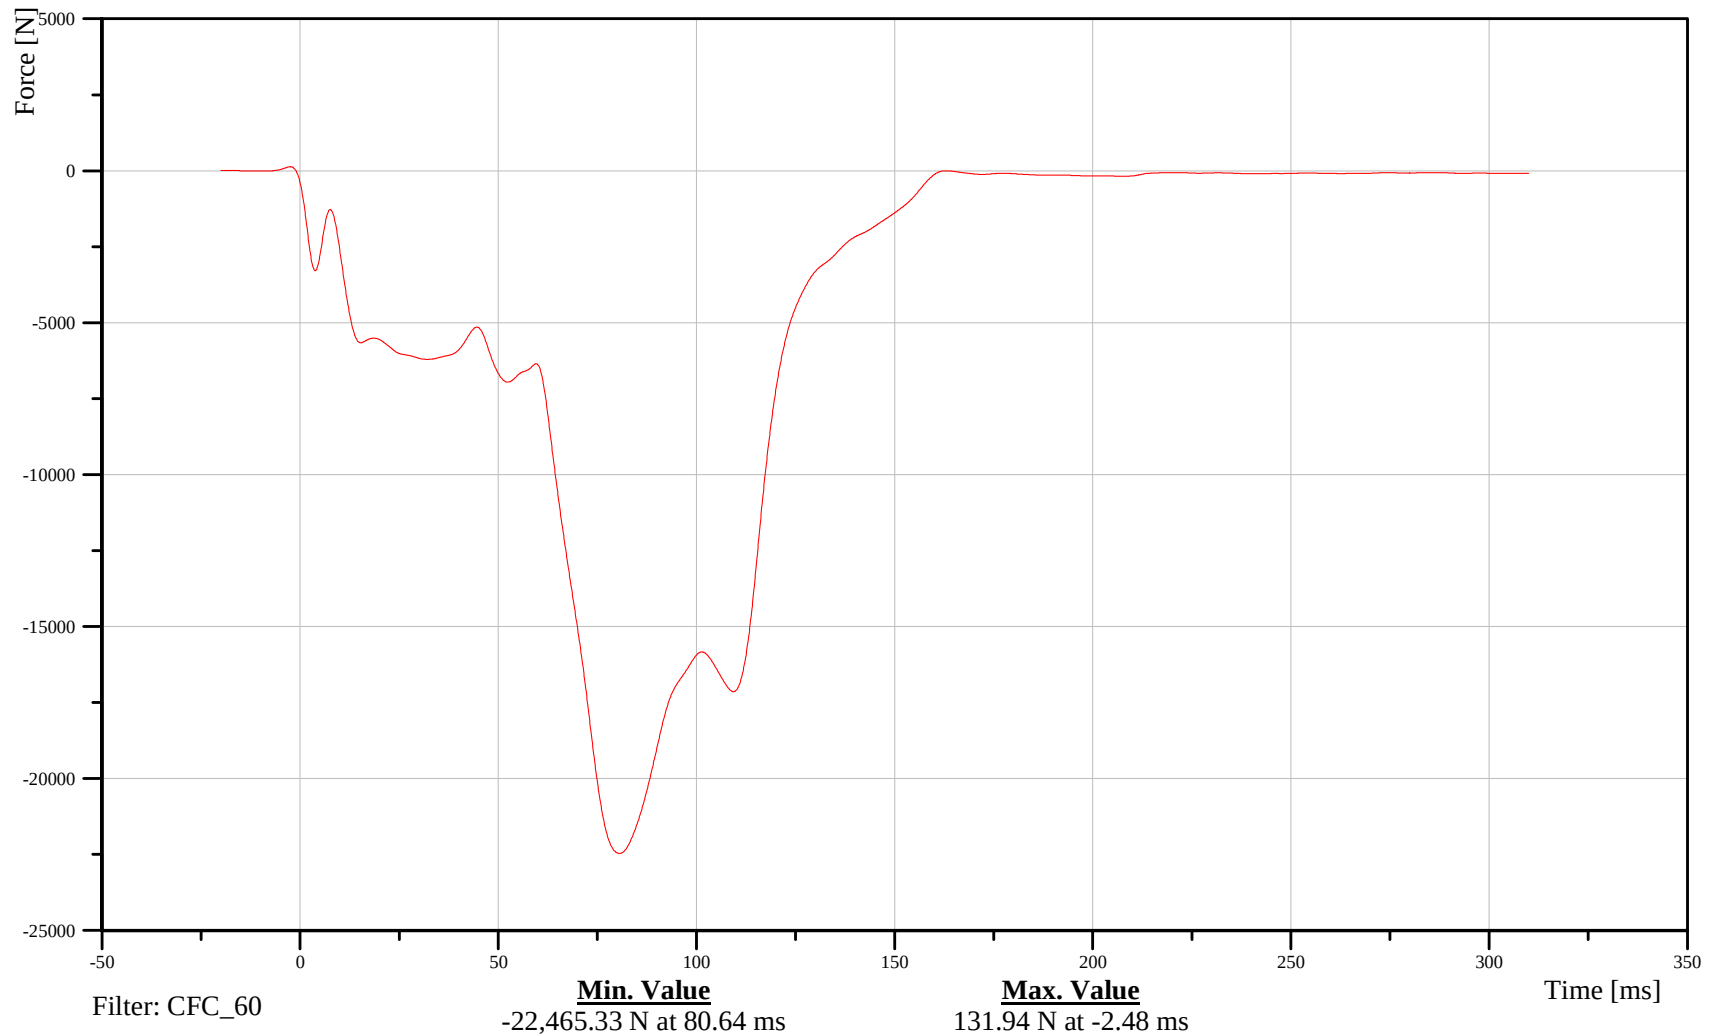

B-185

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 10 Column 8

Customer: Volpe

L0FBAR000080FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

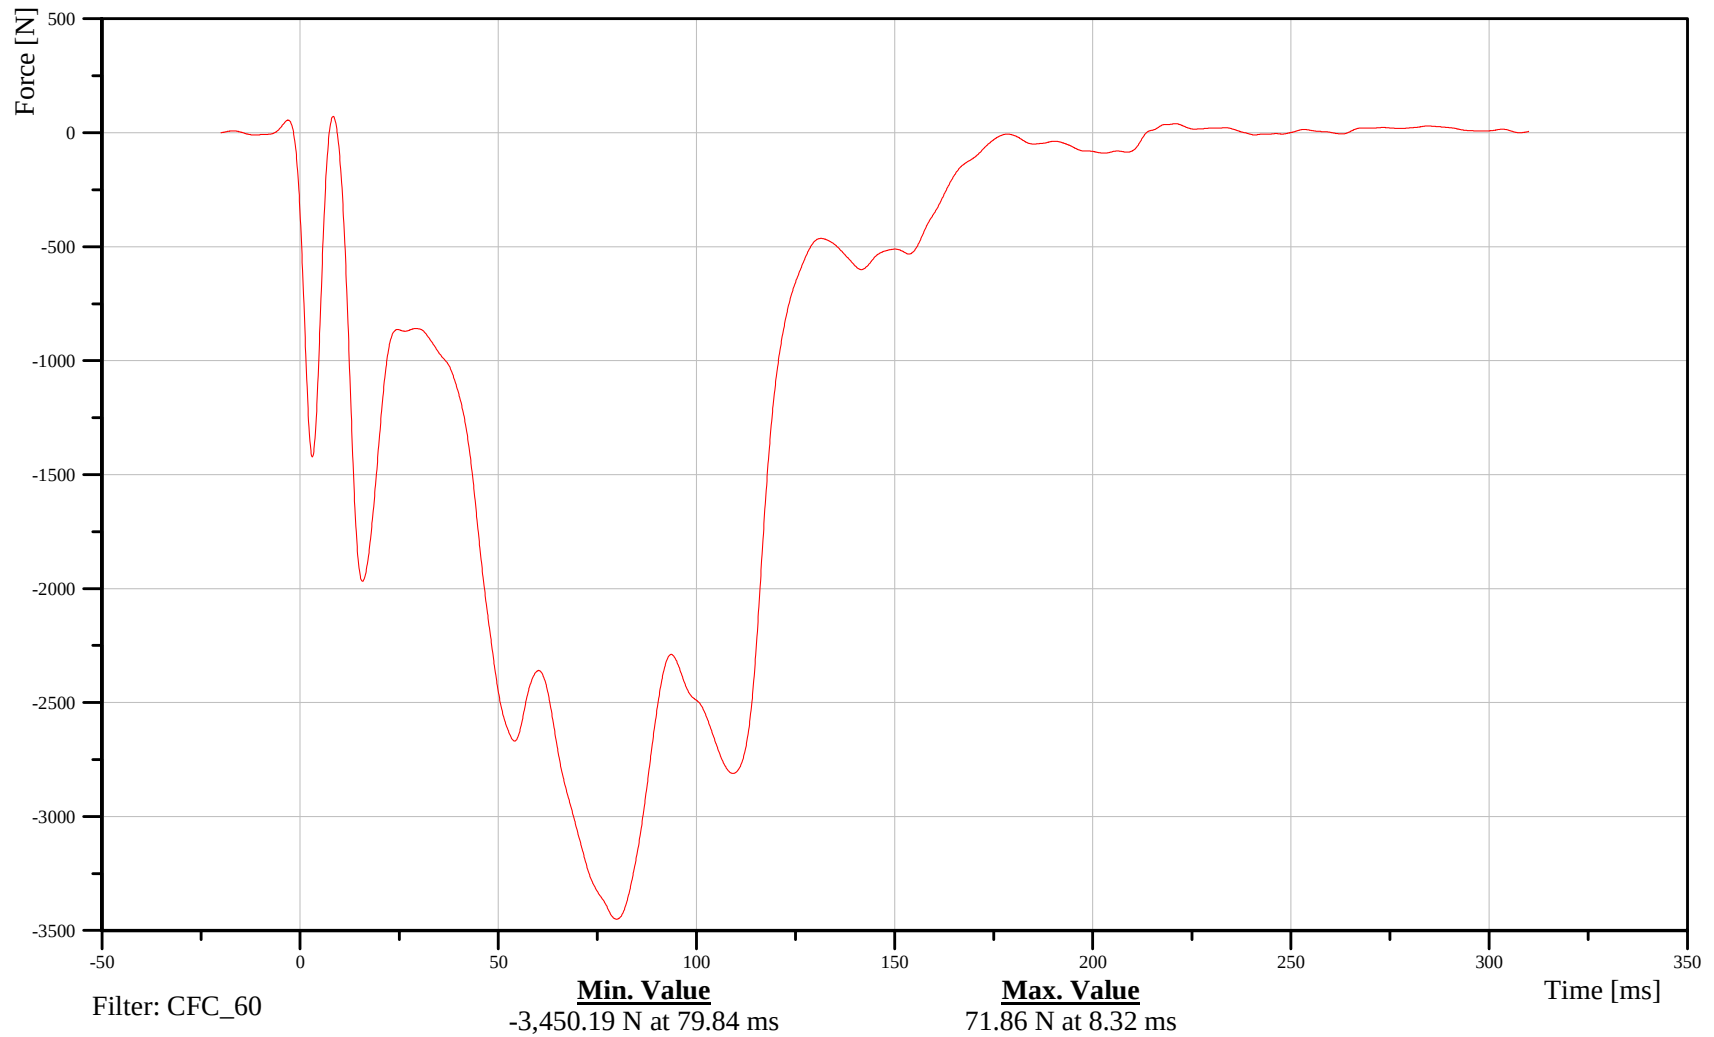

B-186

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 1 Column 9

Customer: Volpe

L0FBAR000081FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

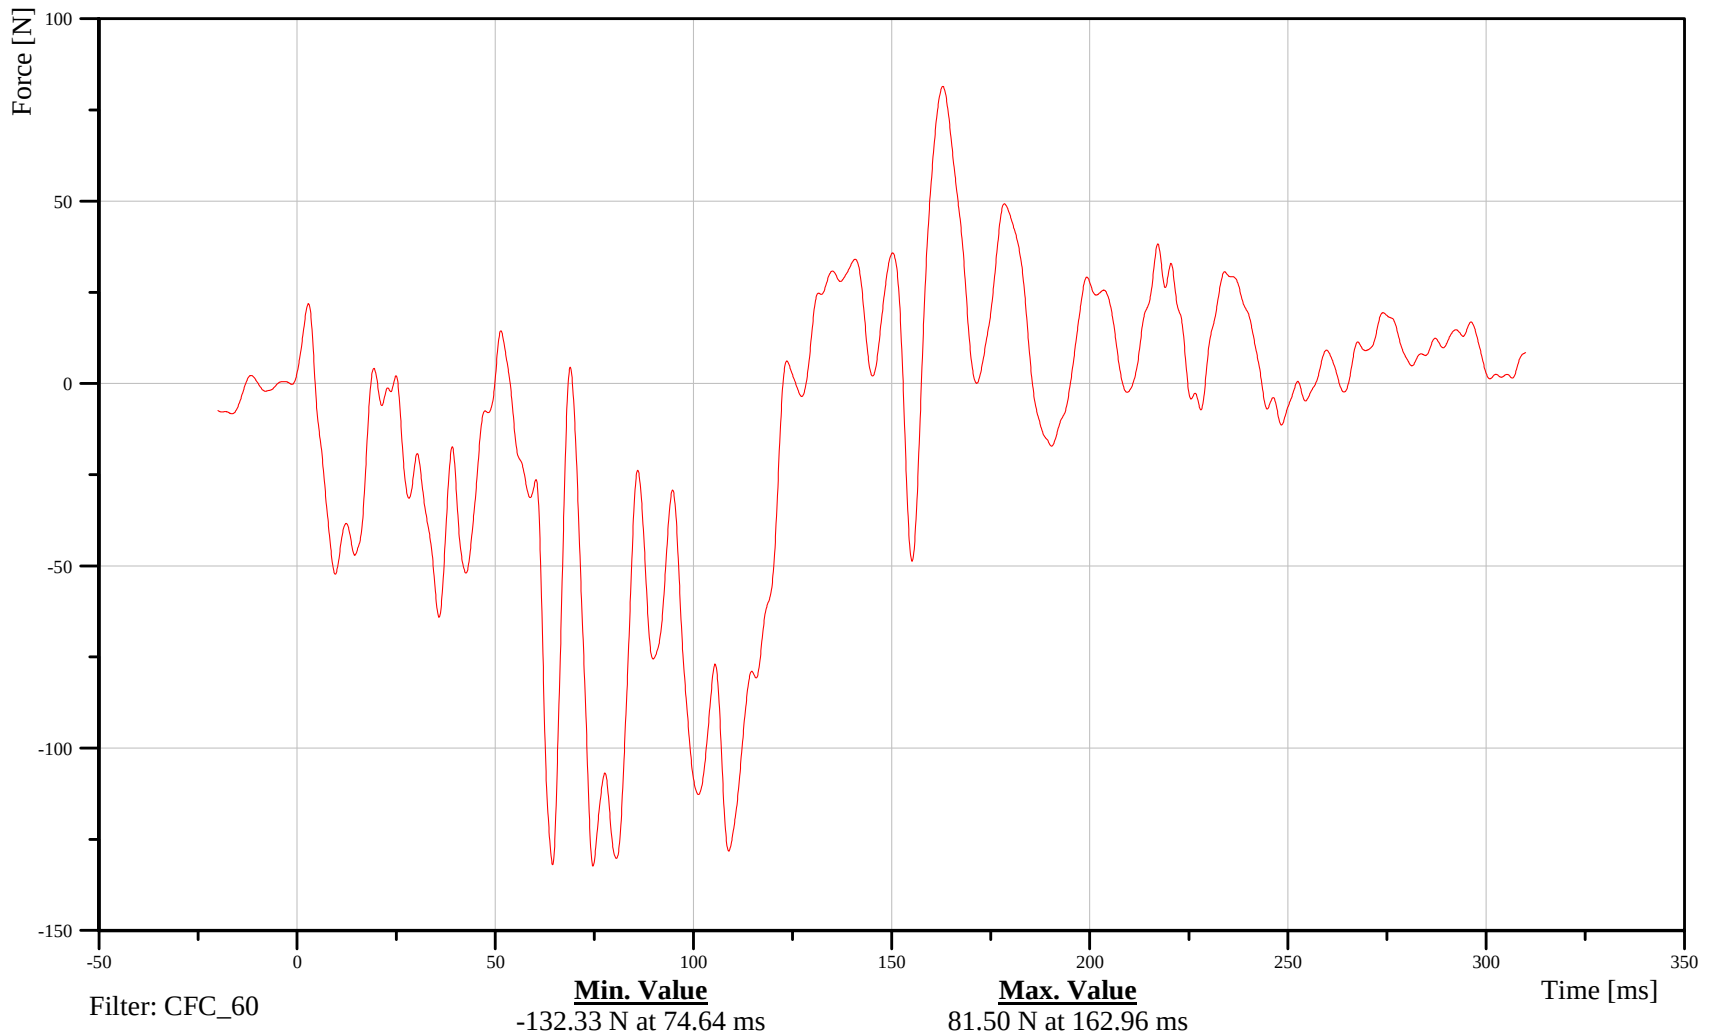

B-187

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 2 Column 9

Customer: Volpe

L0FBAR000082FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

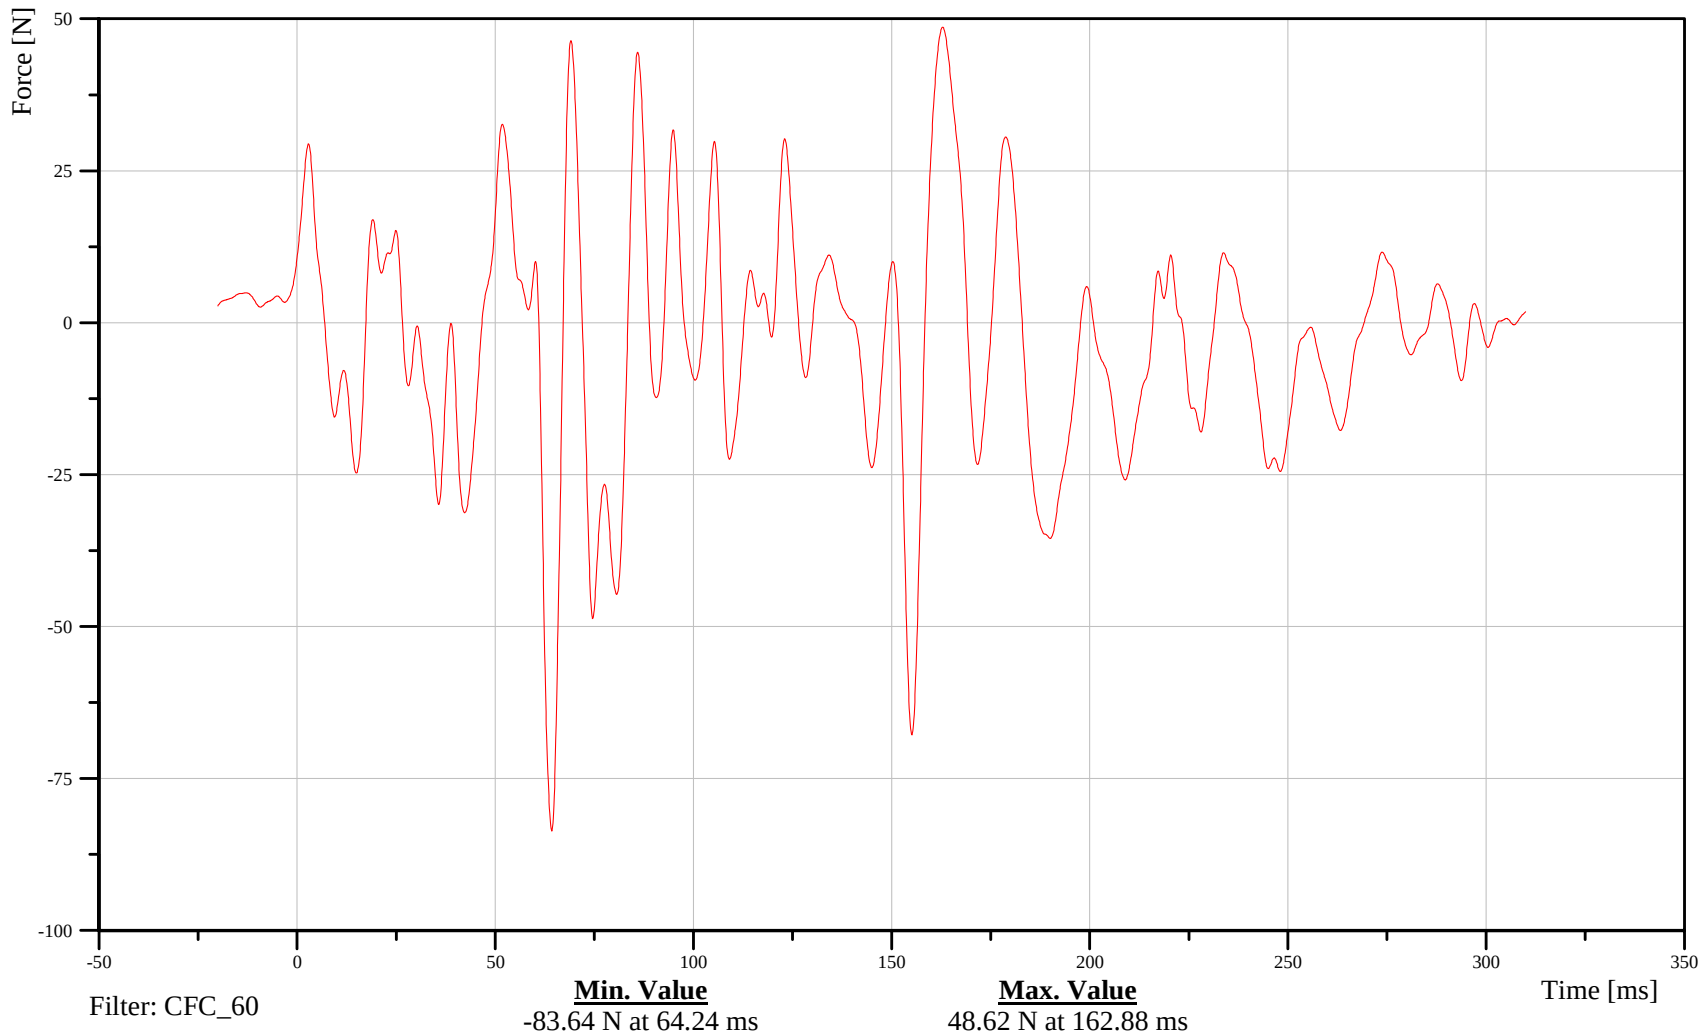

B-188

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 3 Column 9


Time: 18:05

Customer: Volpe

L0FBAR000083FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

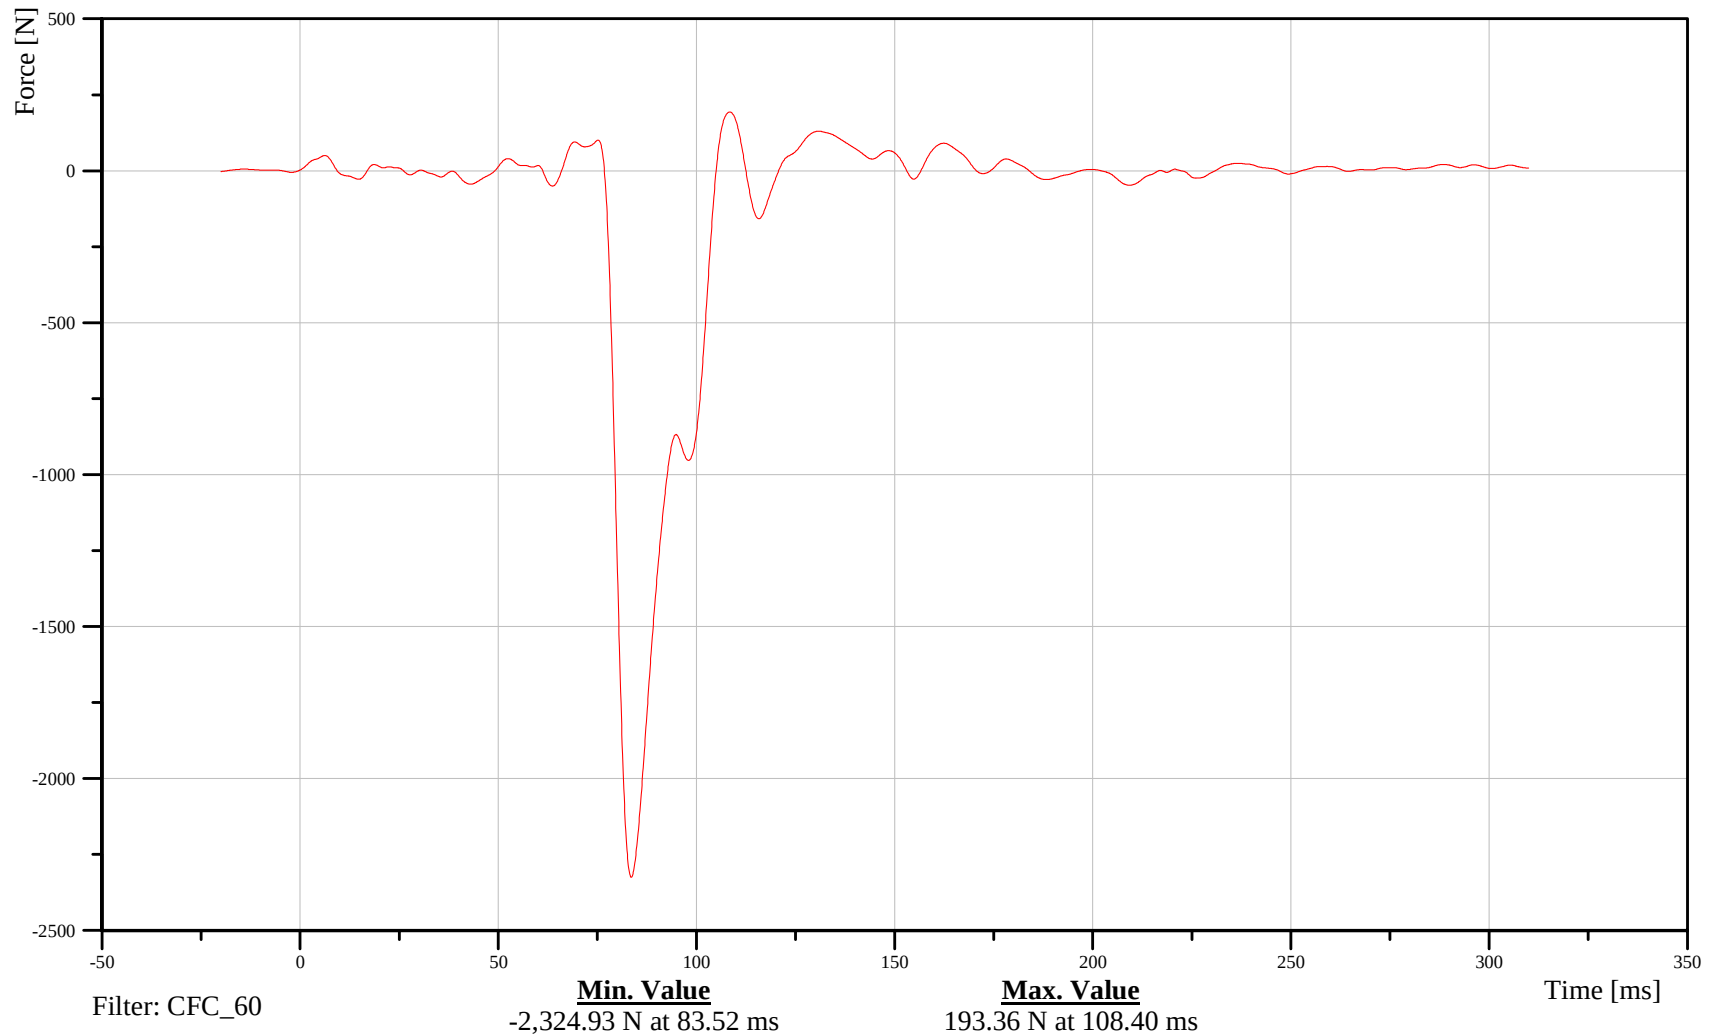

B-189

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 4 Column 9

Customer: Volpe

L0FBAR000084FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

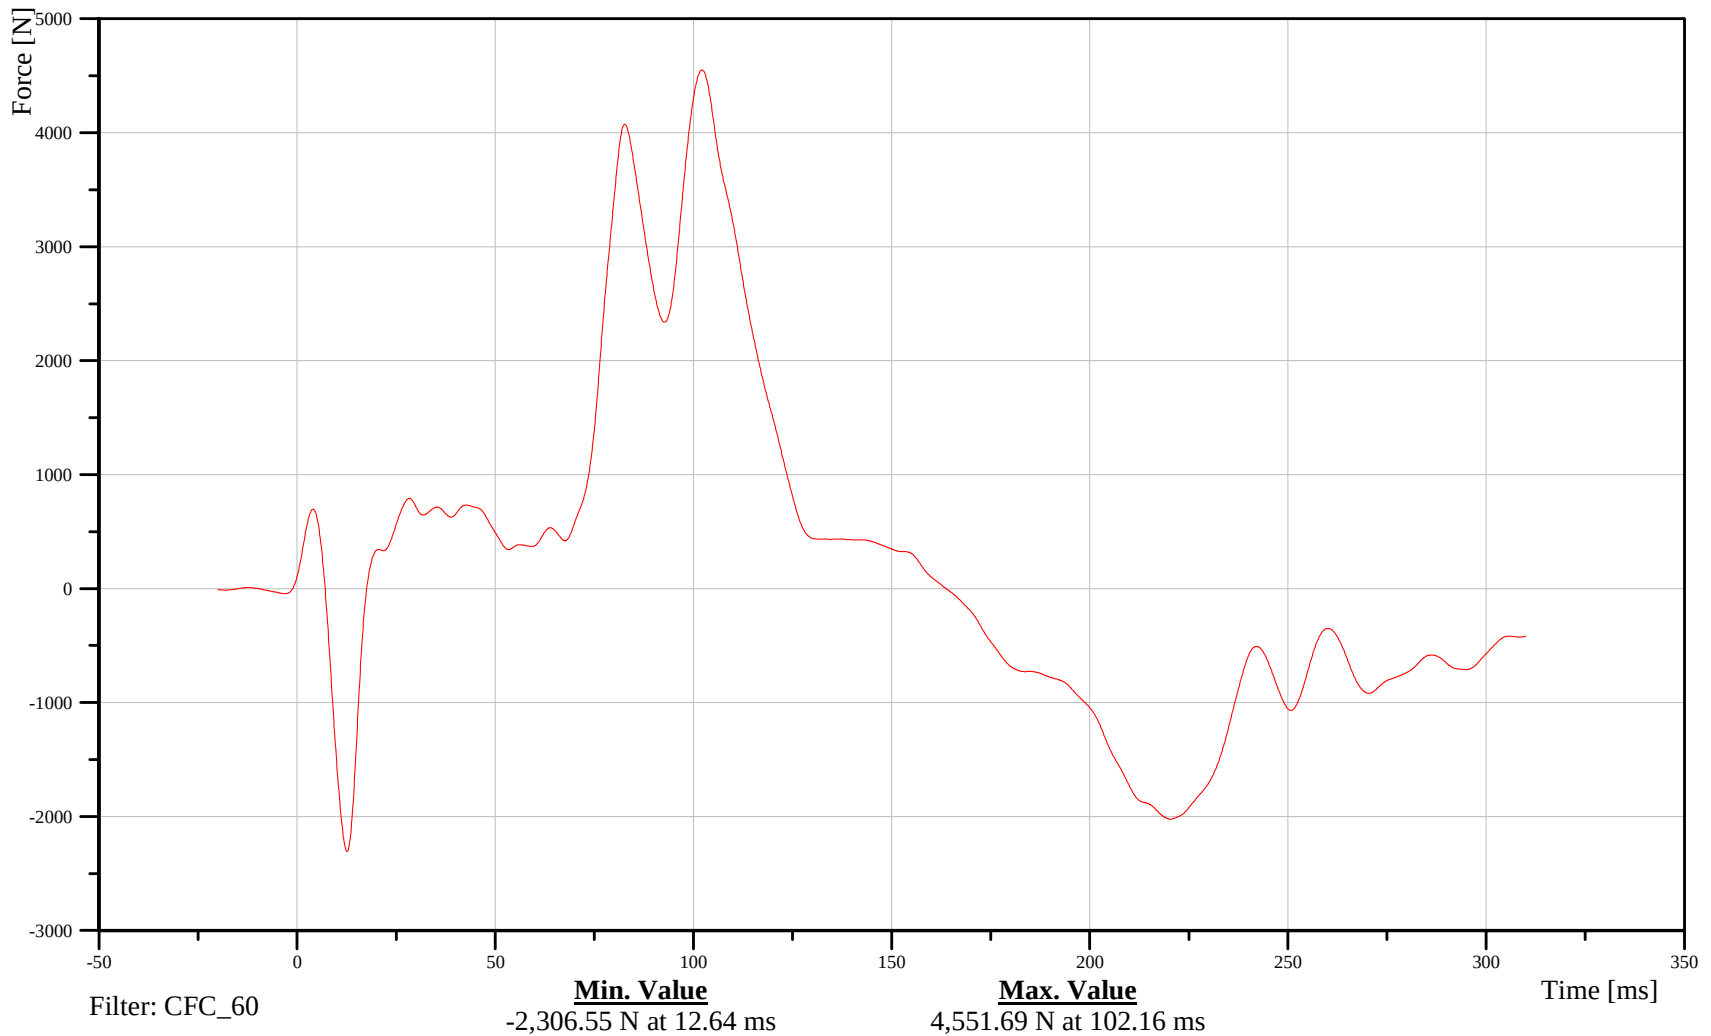

B-190

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 5 Column 9

Customer: Volpe

L0FBAR000085FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

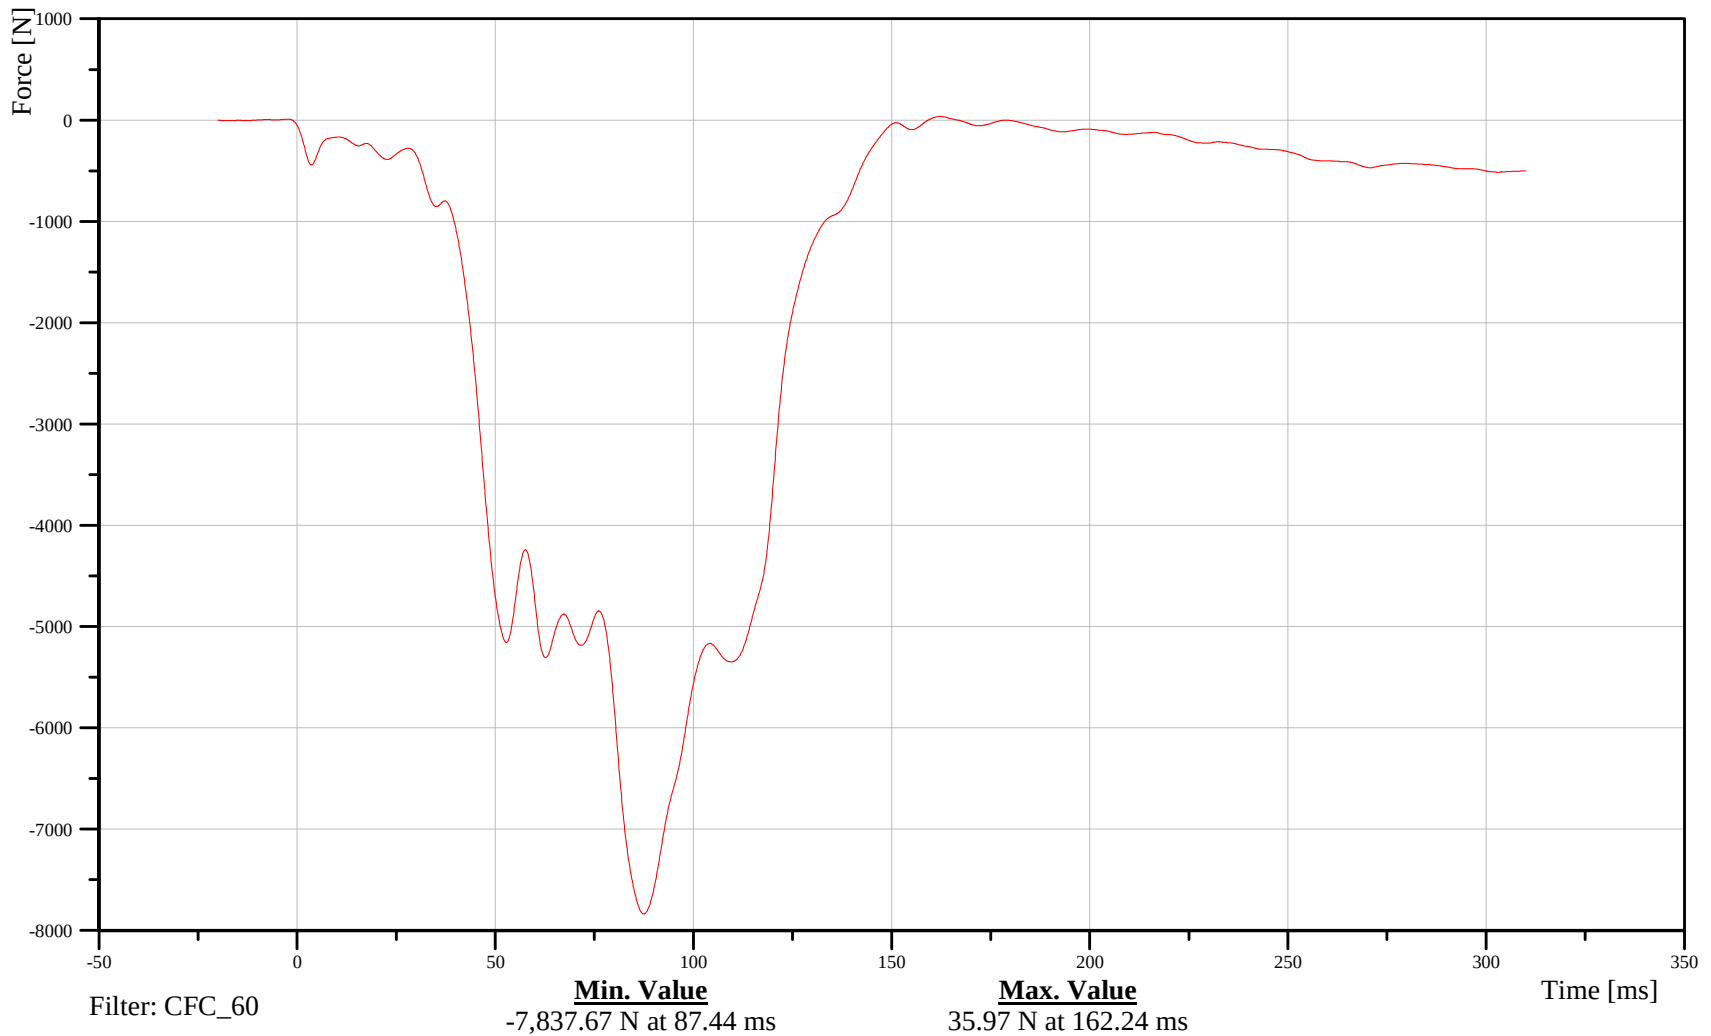

B-191

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 6 Column 9

Customer: Volpe

L0FBAR000086FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

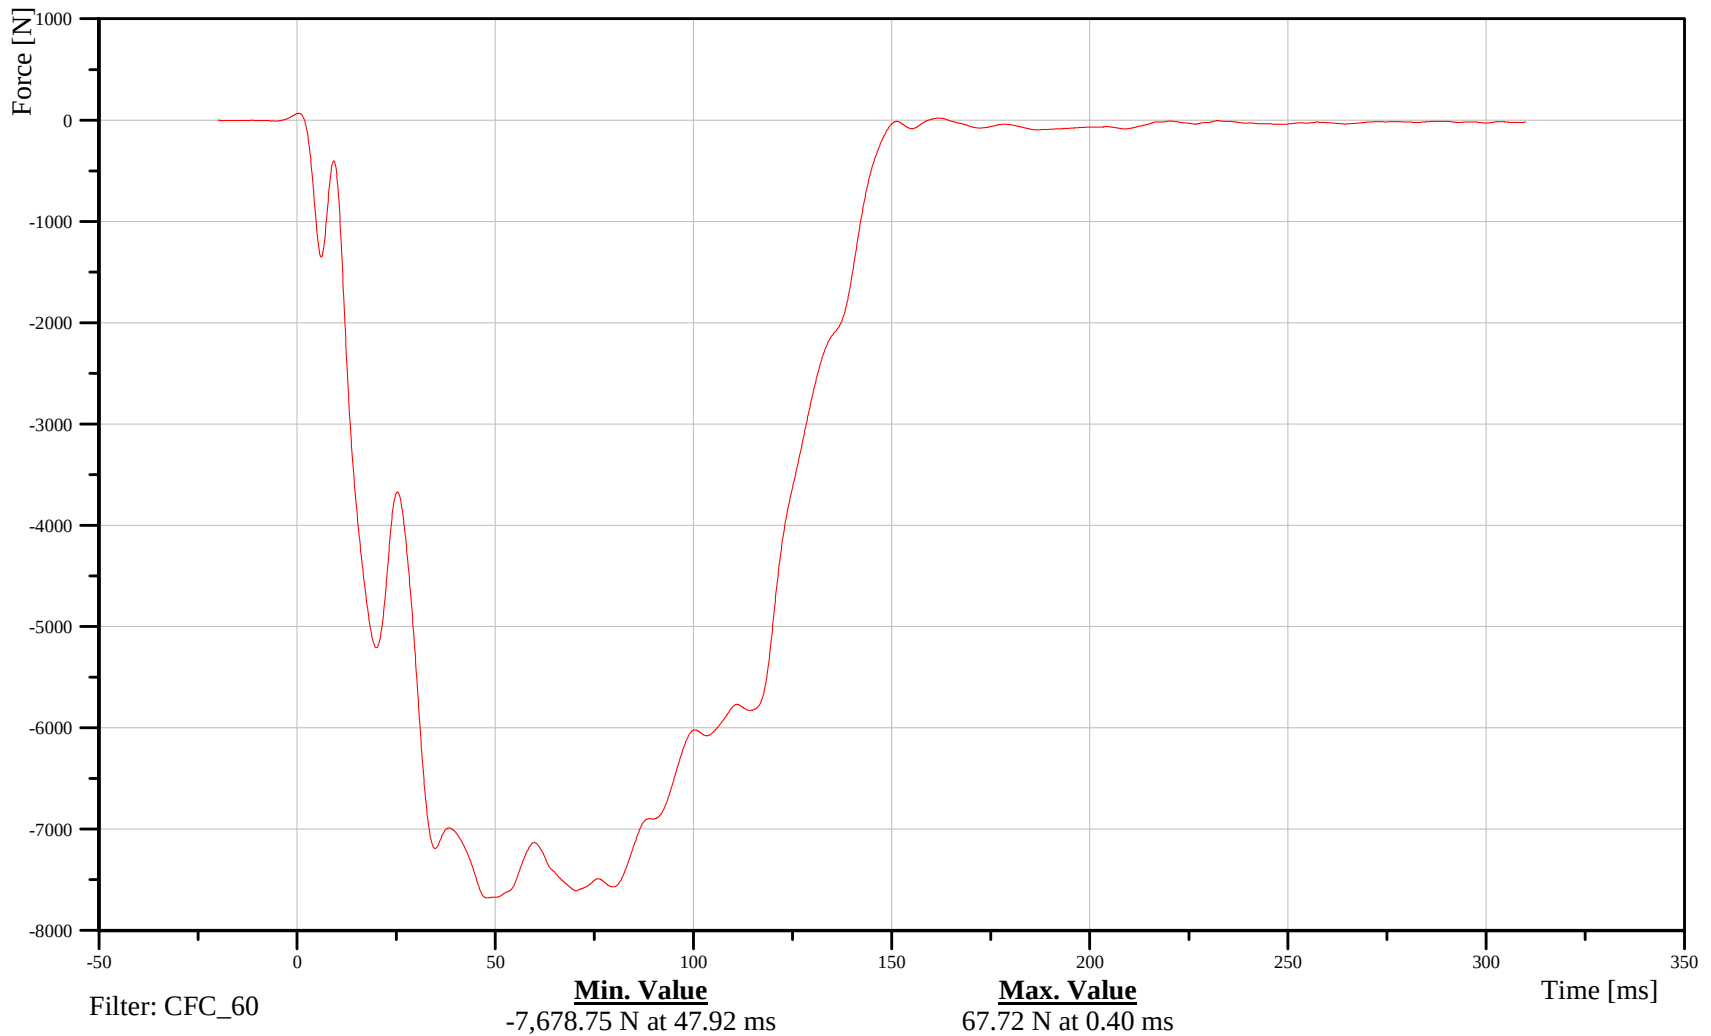

B-192

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 7 Column 9

Customer: Volpe

L0FBAR000087FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

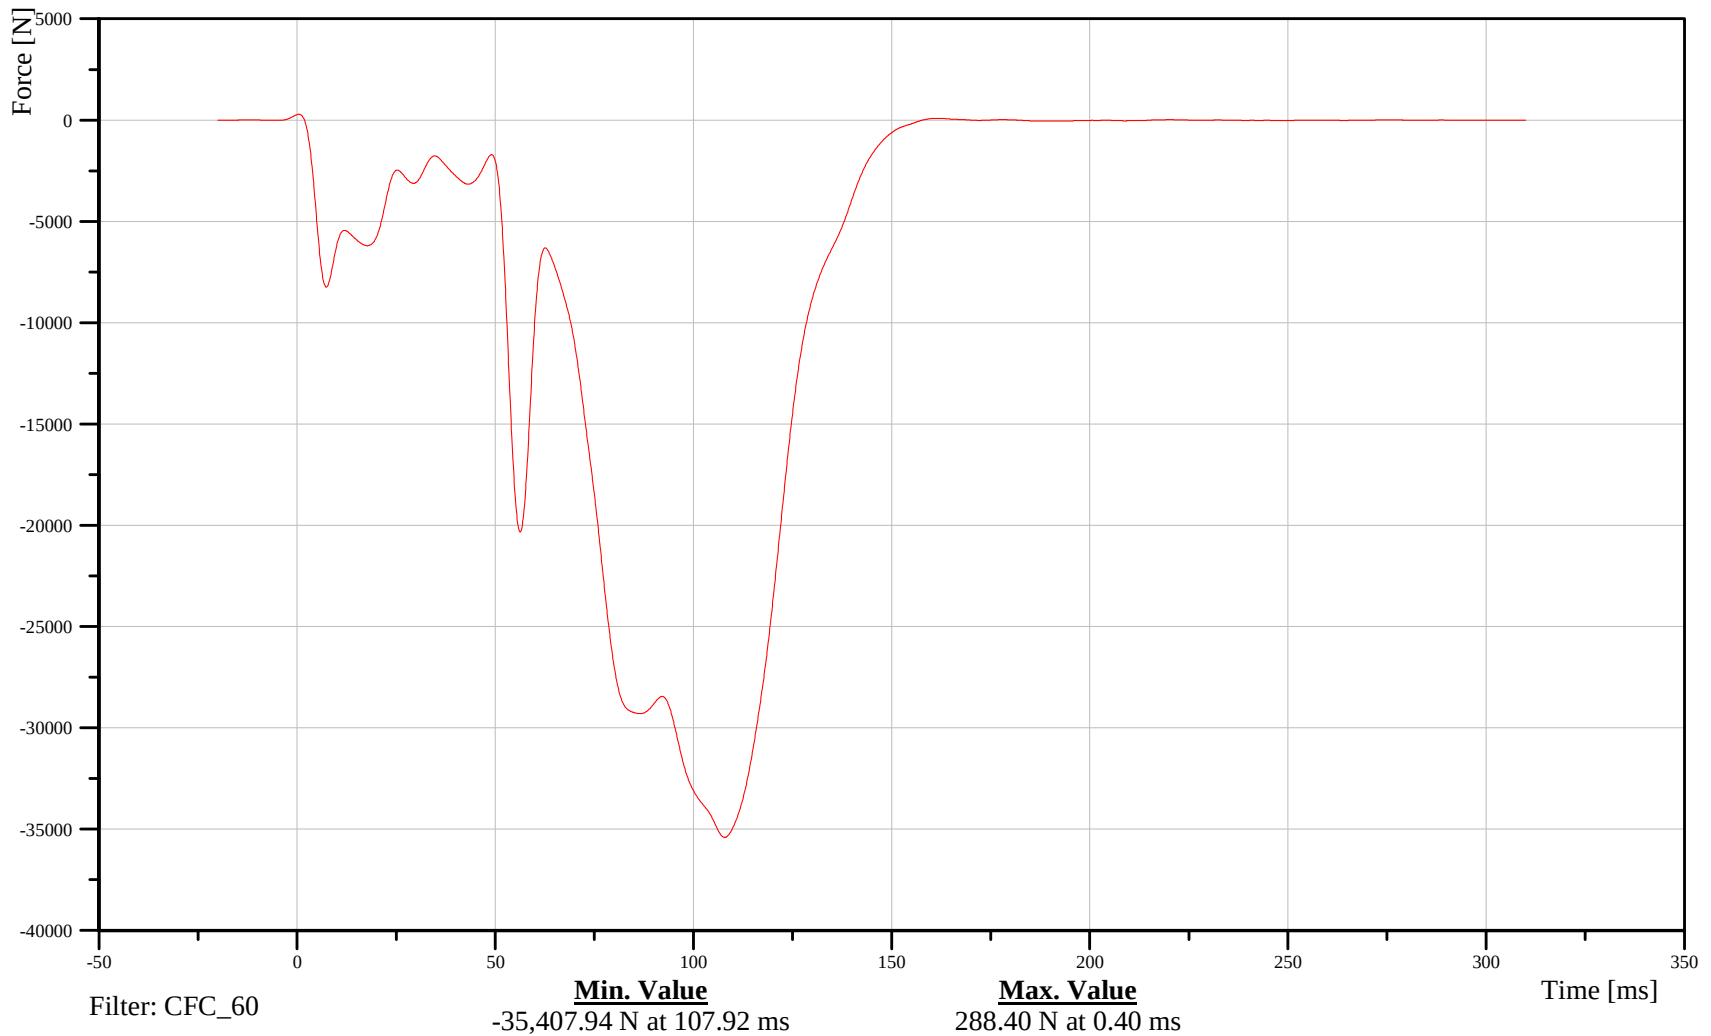

B-193

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Load Cell Row 8 Column 9


Time: 06:05

Customer: Volpe

L0FBAR000088FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

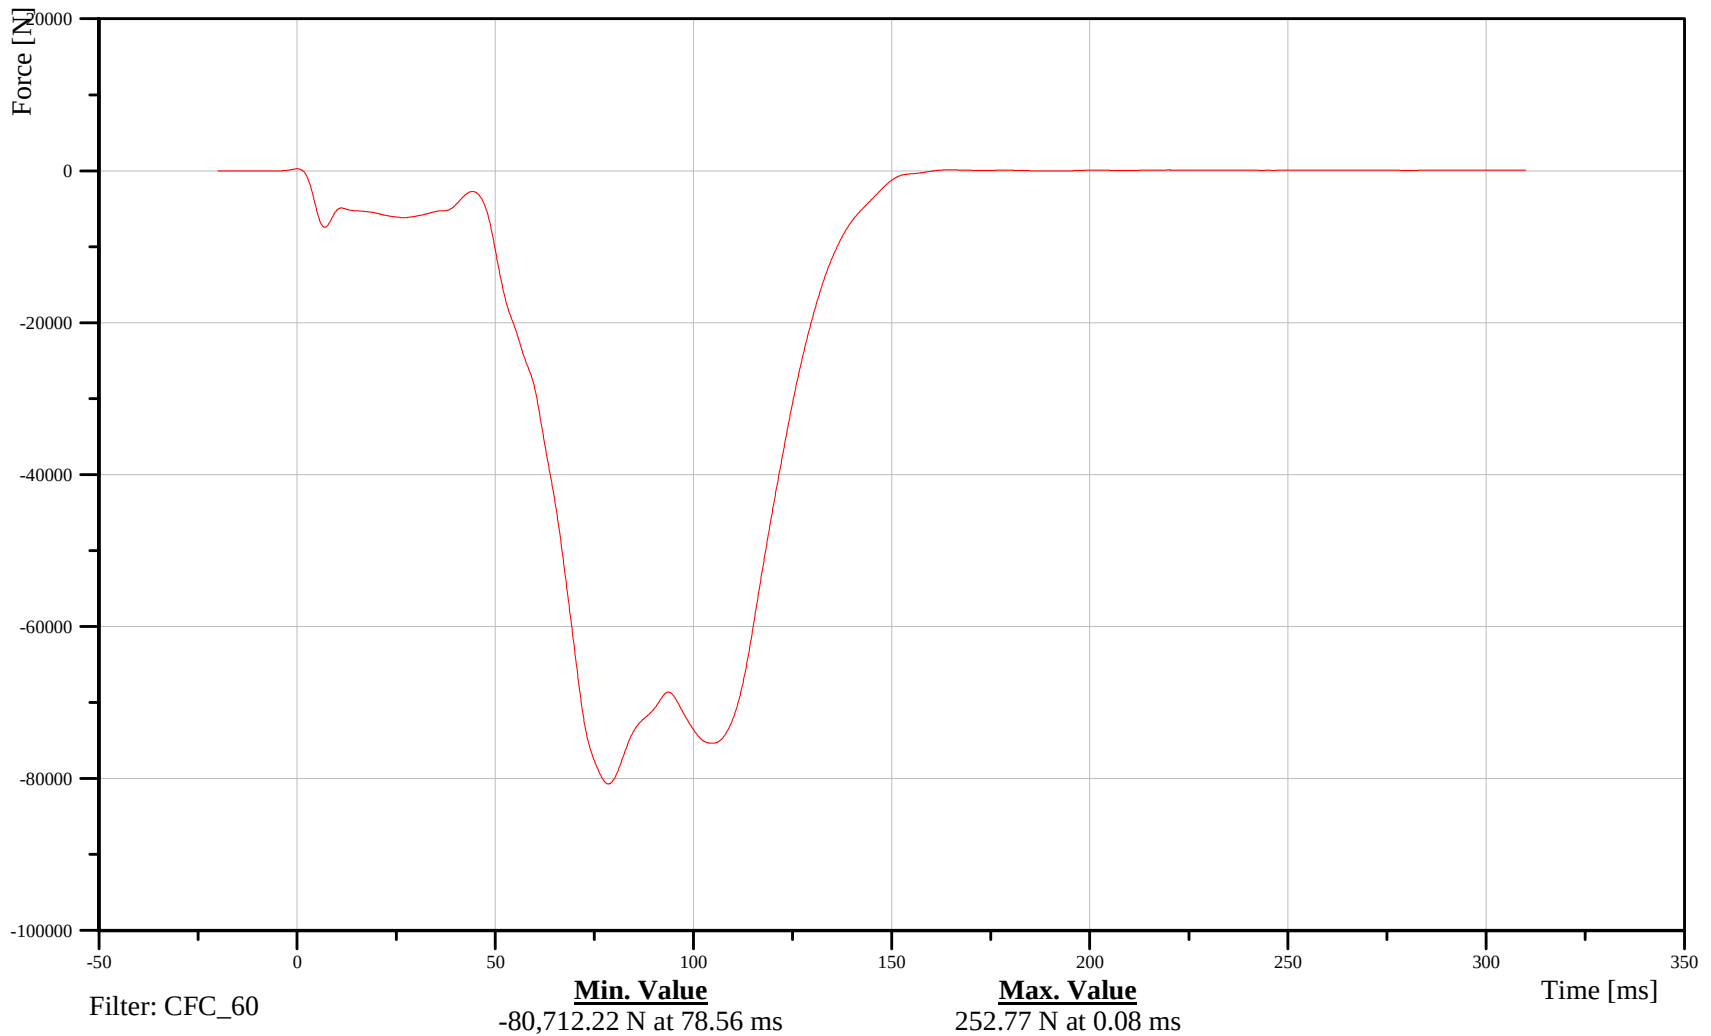

B-194

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006
Time: 18:05


Load Cell Row 9 Column 9

Customer: Volpe

L0FBAR000089FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

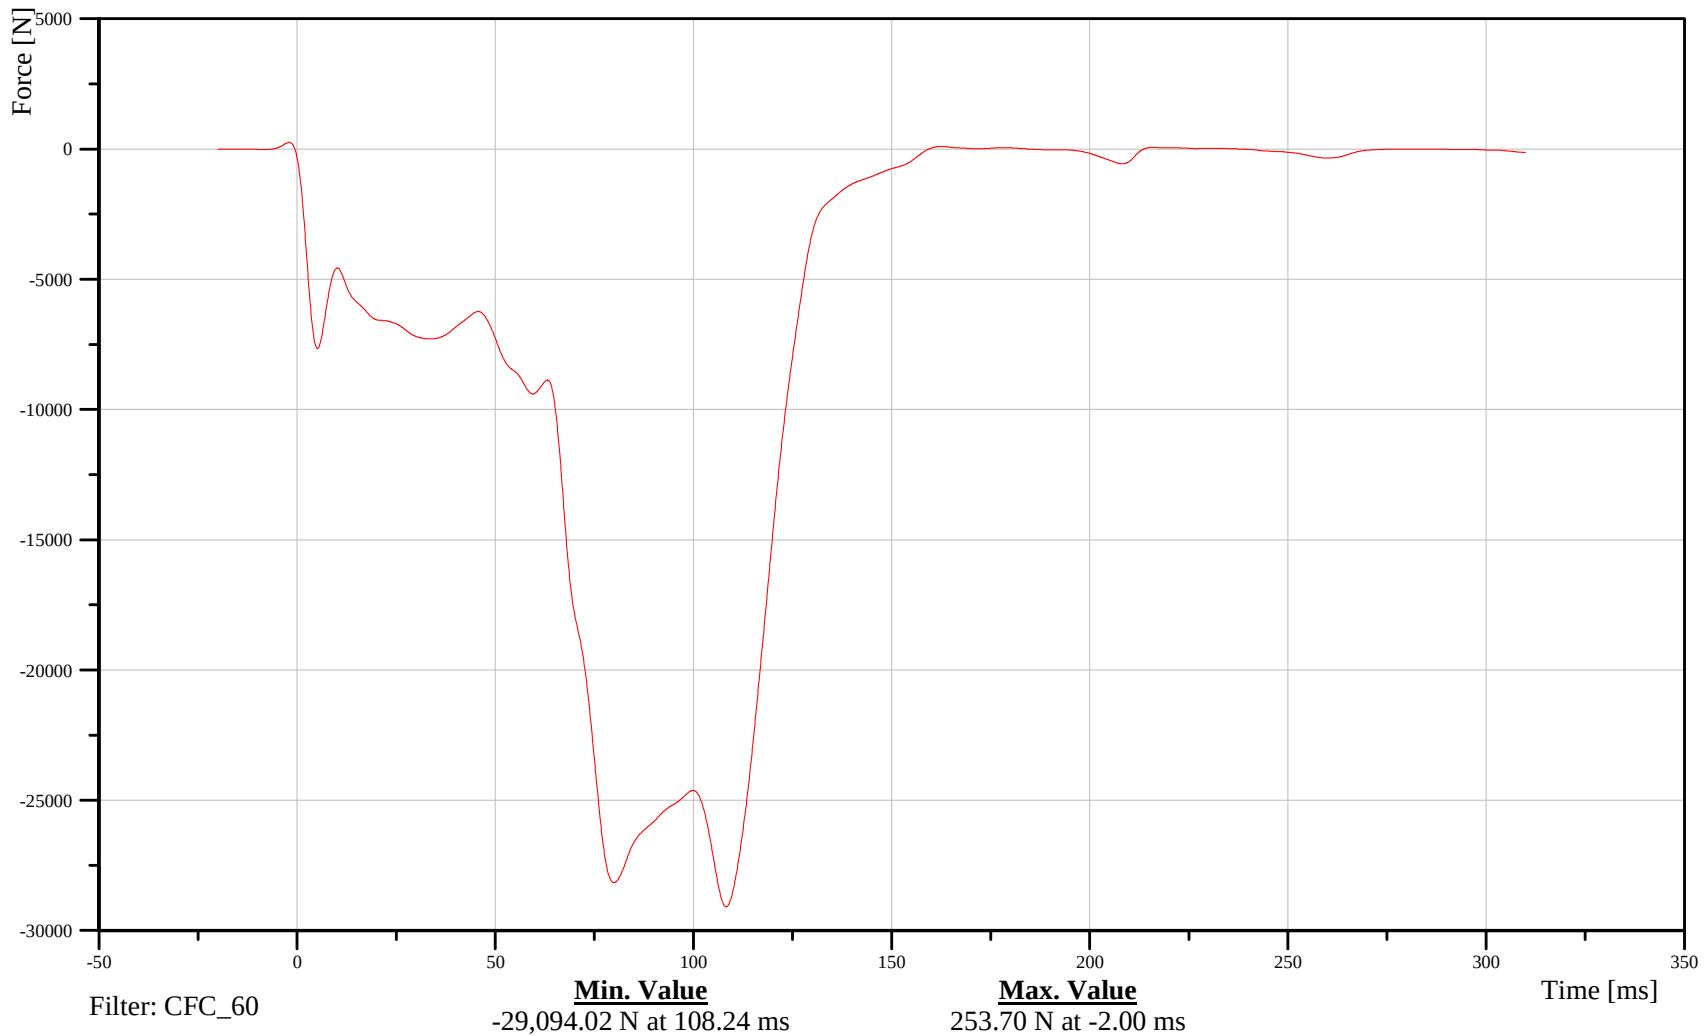

B-195

060630-2



2006 Mitsubishi Galant into Left 40% Offset Deformable LCB at 56 kph

Date: 06/30/2006

Time: 18:05


Load Cell Row 10 Column 9

Customer: Volpe

L0FBAR000090FOXD

TRC Inc. Test Lab: CTF

Test Number: 060630-2

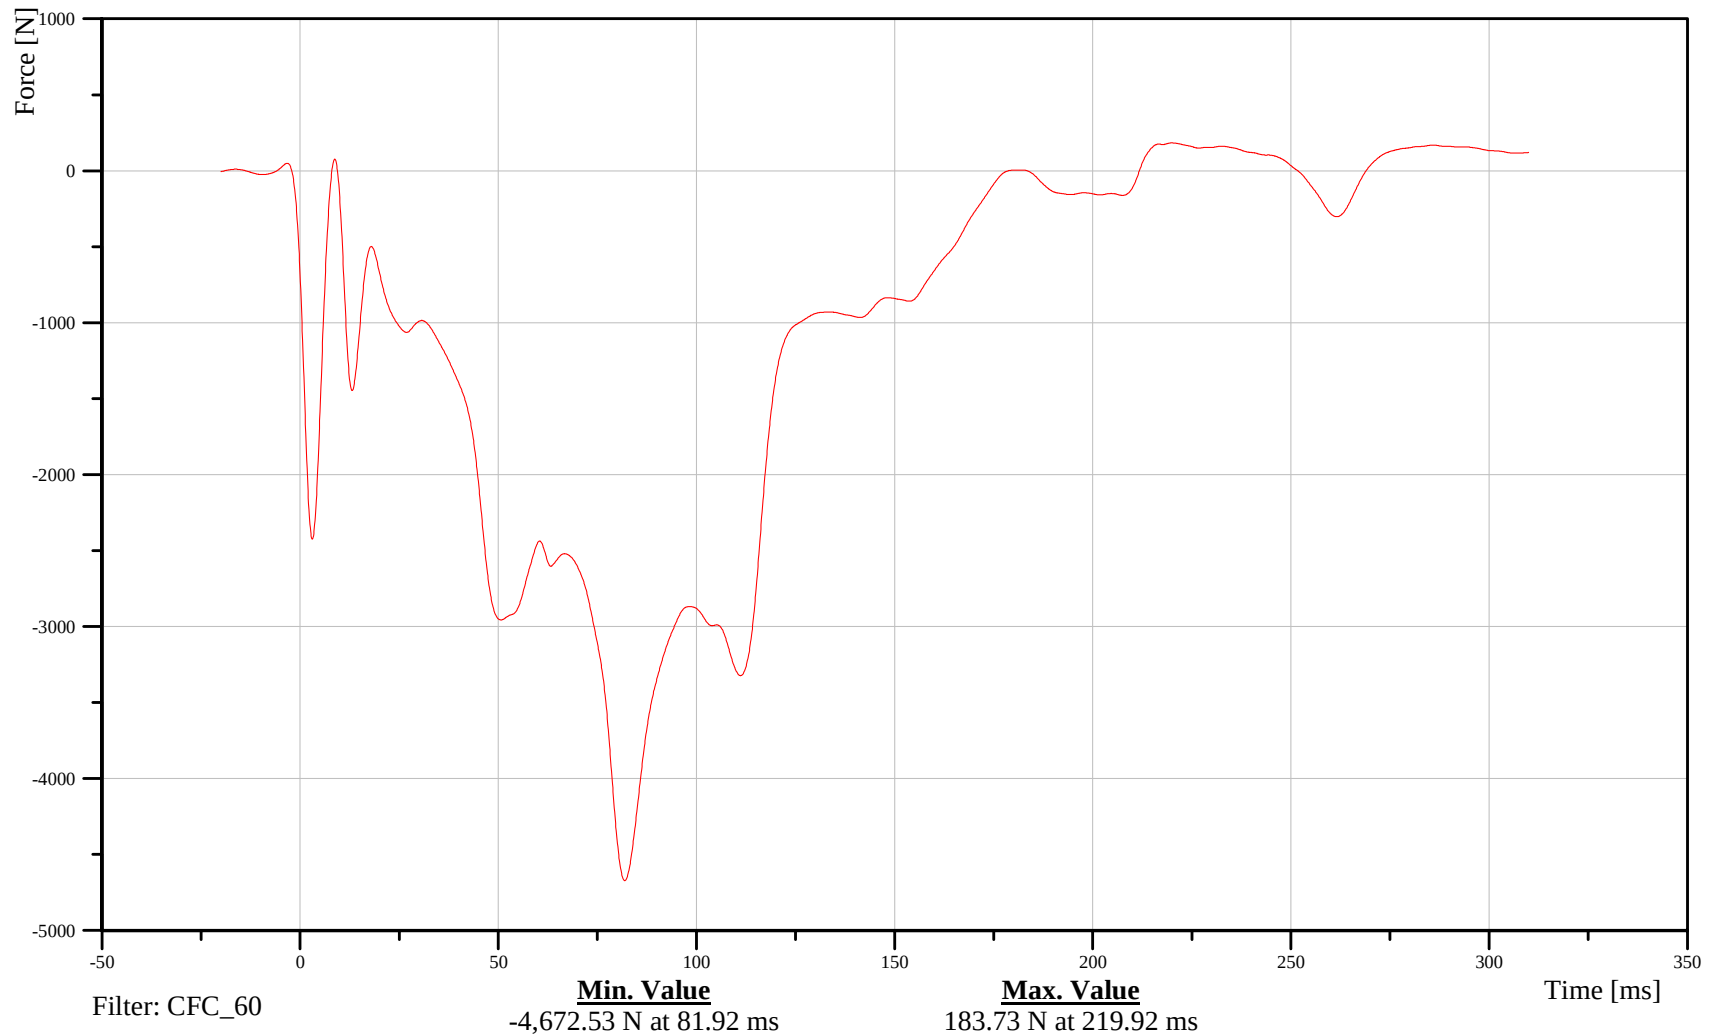

B-196

060630-2

Appendix C

Dummy Certification Data

Pre-test Dummy Configuration and Performance Verification Data

Driver Dummy S/N: 202


Transportation Research Center Inc.
572E HIII 50th Male Dummy
External Dimensions
Serial No. 202 Calibration No. 17

Symbol	Description	Specification	Results	Pass
		mm	mm	
A	Total Sitting Height	878.8 - 889.0	882	Yes
B	Shoulder Pivot Height	505.5 - 520.7	517	Yes
C	H-Point Height	83.8 - 88.9	86	Yes
D	H-Point From Seatback	134.6 - 139.7	136	Yes
E	Shoulder Pivot From Backline	83.8 - 94.0	90	Yes
F	Thigh Clearance	139.7 - 154.9	151	Yes
G	Back Of Elbow To Wrist Pivot	289.6 - 304.8	292	Yes
H	Skull Cap To Backline	40.6 - 45.7	43	Yes
I	Shoulder-Elbow Length	330.2 - 345.4	340	Yes
J	Elbow Rest Height	190.5 - 210.8	198	Yes
K	Buttock Knee Length	579.1 - 604.5	597	Yes
L	Popliteal Height	429.3 - 454.7	440	Yes
M	Knee Pivot Height	485.1 - 500.4	495	Yes
N	Buttock Popliteal Length	452.1 - 477.5	458	Yes
O	Chest Depth	213.4 - 228.6	218	Yes
P	Foot Length	251.5 - 266.7	259	Yes
V	Shoulder Breadth	421.6 - 436.9	431	Yes
W	Foot Breadth	91.4 - 106.7	102	Yes
Y	Chest Circumference	970.3 - 1000.8	993	Yes
Z	Waist Circumference	835.7 - 866.1	844	Yes
AA	Location For Chest Circumference	429.3 - 434.3	432	Yes
BB	Location For Waist Circumference	226.1 - 231.1	229	Yes

Technician



Approved



Transportation Research Center Inc.

Front Head Drop

HIII 50th Serial No. 202 Certification No. 17-1

Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	41 %	Yes
Peak Head Resultant Acceleration	225 - 275 g	257.7 g	Yes
Peak Head Lateral Acceleration	(-15) - 15 g	12.9 g	Yes
Is Acceleration Curve Unimodal within 10% of Peak?	Yes	Yes	Yes


Test meets specifications.

Comments:

Technician



Approved




Transportation Research Center Inc.

Front Head Drop

HHH 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

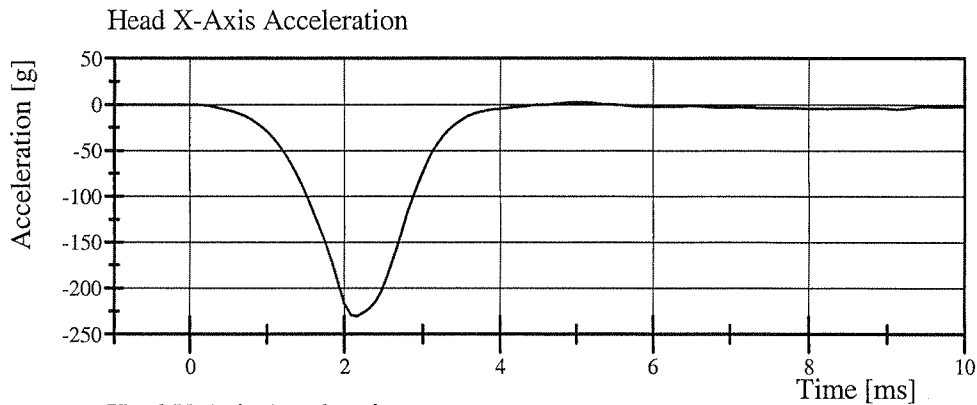

Filter Class: CFC_1000

Max: 2.7 g at 5.0 ms


Min: -230.5 g at 2.2 ms

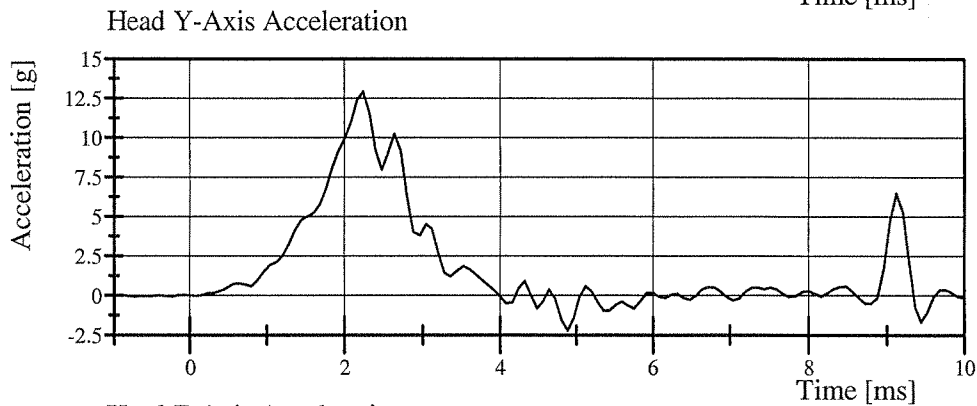

Filter Class: CFC_1000

Max: 12.9 g at 2.2 ms


Min: -2.2 g at 4.9 ms

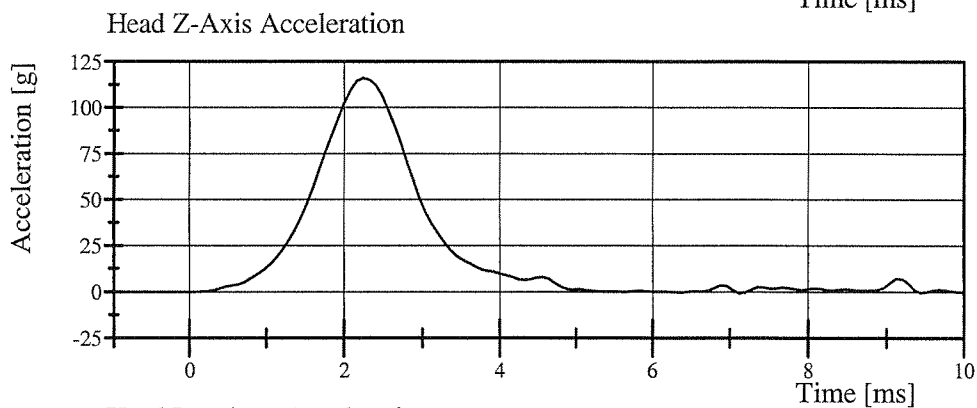

Filter Class: CFC_1000

Max: 116.1 g at 2.2 ms

Min: -0.7 g at 7.1 ms

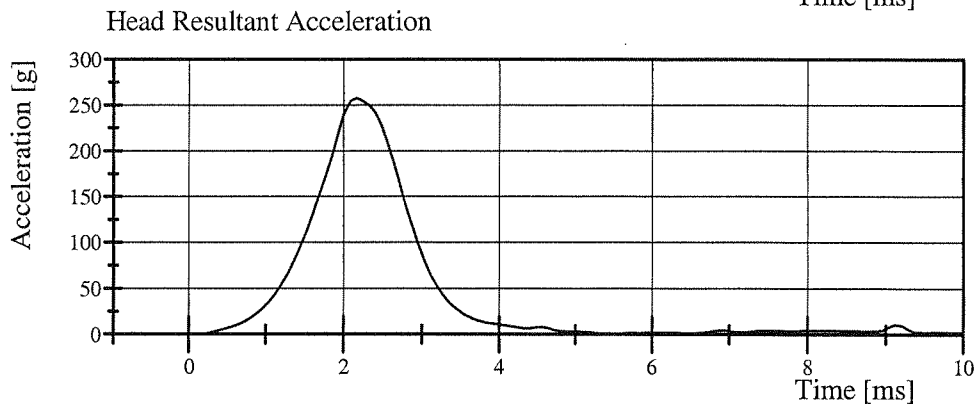

Filter Class: CFC_1000

Max: 257.7 g at 2.2 ms

Min: 0.0 g at -1.0 ms

Transportation Research Center Inc.

Neck Flexion

HHH 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.5 °C	Yes
Relative Humidity	10 - 70 %	44 %	Yes
Pendulum Velocity	6.89 - 7.13 m/s	6.933 m/s	Yes
Pendulum Acceleration Decay Crossing -5g	34 - 42 ms	40.8 ms	Yes
Pendulum Acceleration at 10ms	(-22.5) - (-27.5) g	-23.26 g	Yes
Pendulum Acceleration at 20ms	(-17.6) - (-22.6) g	-20.41 g	Yes
Pendulum Acceleration at 30ms	(-12.5) - (-18.5) g	-14.98 g	Yes
Pendulum Acceleration > 30ms	>= (-29.0) g	-14.98 g	Yes
Total Head D-Plane Rotation Peak	(-64) - (-78) °	-69.4 °	Yes
Time of Peak	57 - 64 ms	57.9 ms	Yes
Total Head D-Plane Rotation Decay to 0°	113 - 128 ms	113.8 ms	Yes
Total Neck Occipital Condyles Moment Peak	88 - 108 N·m	102.4 N·m	Yes
Time of Peak	47 - 58 ms	52.6 ms	Yes
Total Neck Occipital Condyles Moment Decay to 0 N·m	97 - 107 ms	98.0 ms	Yes

Test meets specifications.

Comments:

Technician



Approved




Transportation Research Center Inc.


Neck Flexion

HIII 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

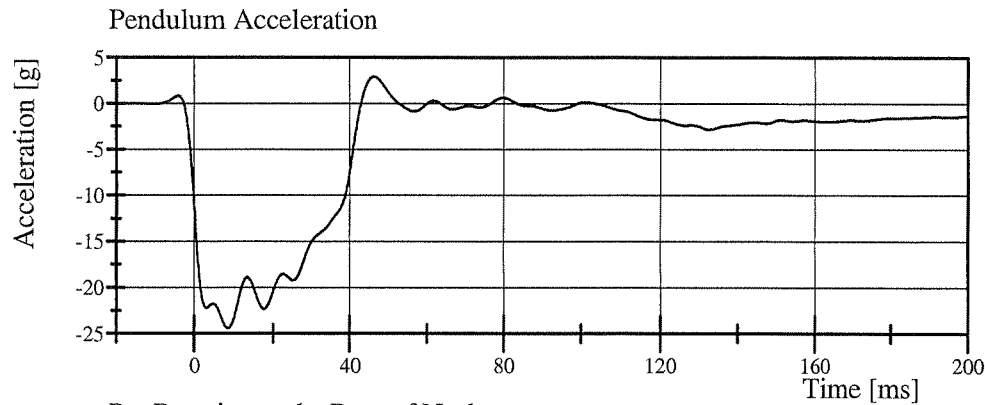


Filter Class: CFC_60
Max: 2.9 g at 46.2 ms
Min: -24.4 g at 8.5 ms

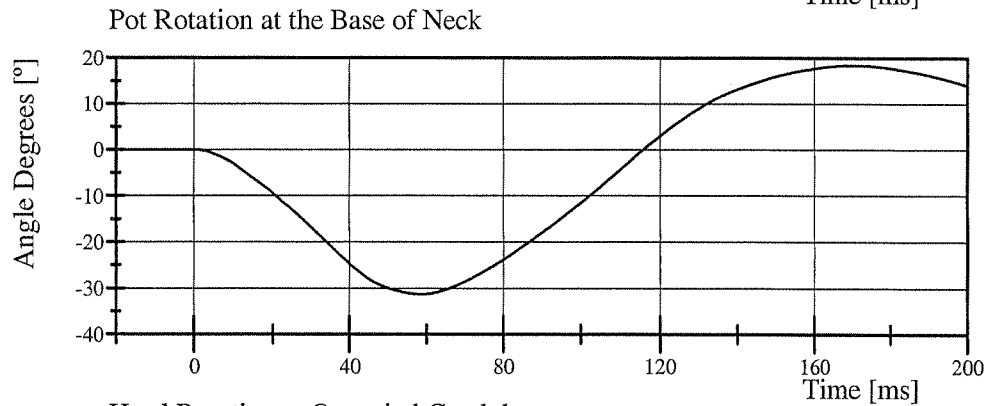

Filter Class: CFC_60
Max: 18.4 ° at 170.0 ms
Min: -31.3 ° at 58.9 ms

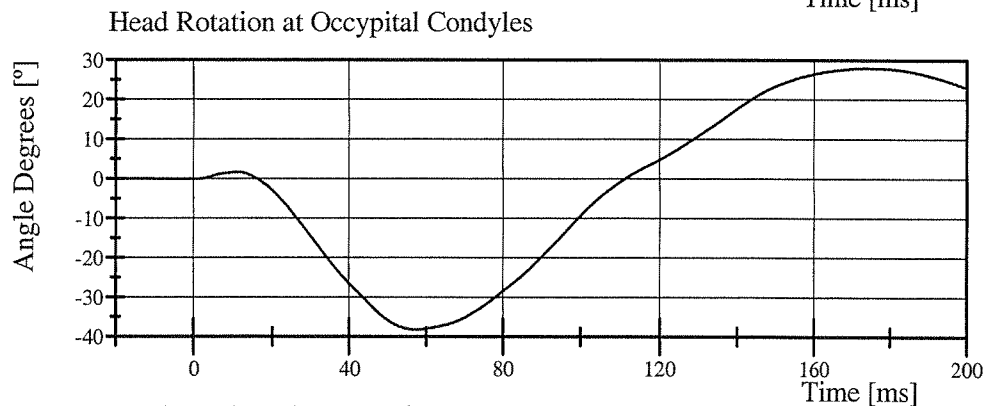

Filter Class: CFC_60
Max: 28.0 ° at 173.8 ms
Min: -38.1 ° at 57.3 ms

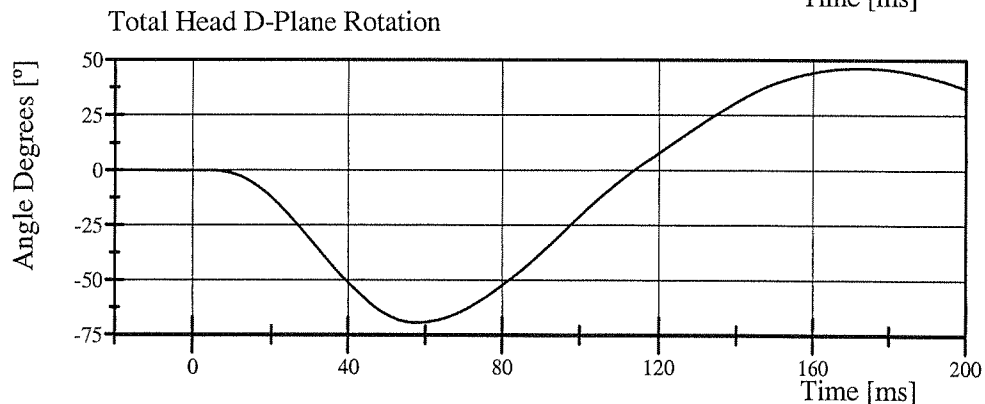


Filter Class: CFC_60
Max: 46.4 ° at 172.6 ms
Min: -69.4 ° at 57.9 ms

Transportation Research Center Inc.

Neck Flexion

HIH 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

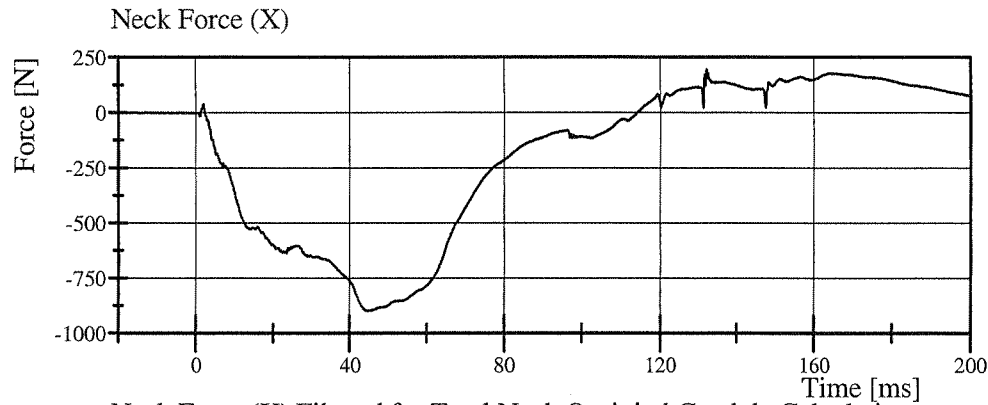

Filter Class: CFC_1000

Max: 195.7 N at 132.2 ms


Min: -898.9 N at 44.7 ms

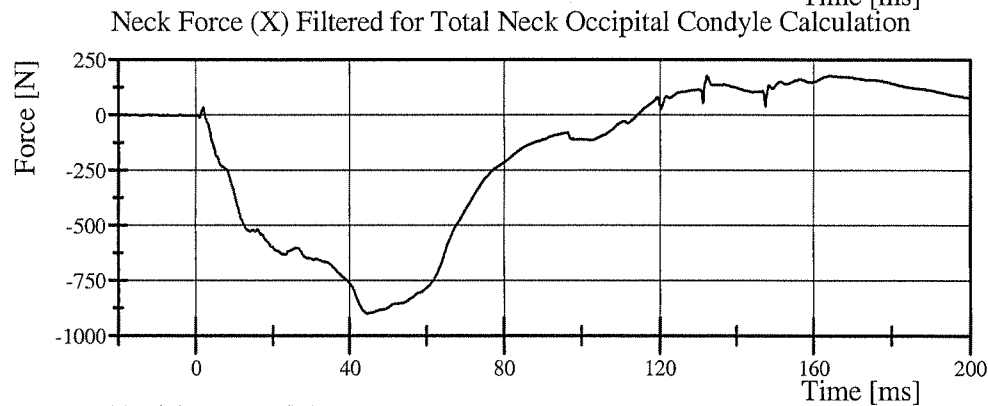

Filter Class: CFC_600

Max: 177.7 N at 164.4 ms


Min: -898.6 N at 44.6 ms

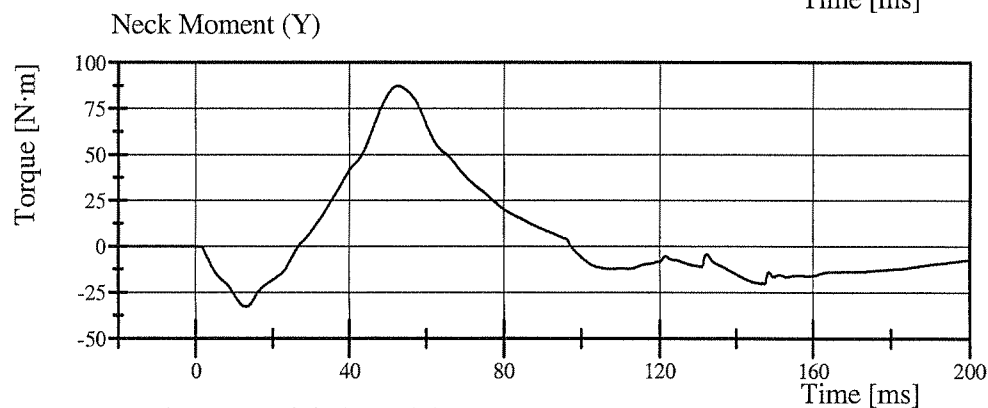

Filter Class: CFC_600

Max: 87.3 N·m at 52.6 ms

Min: -32.8 N·m at 13.0 ms

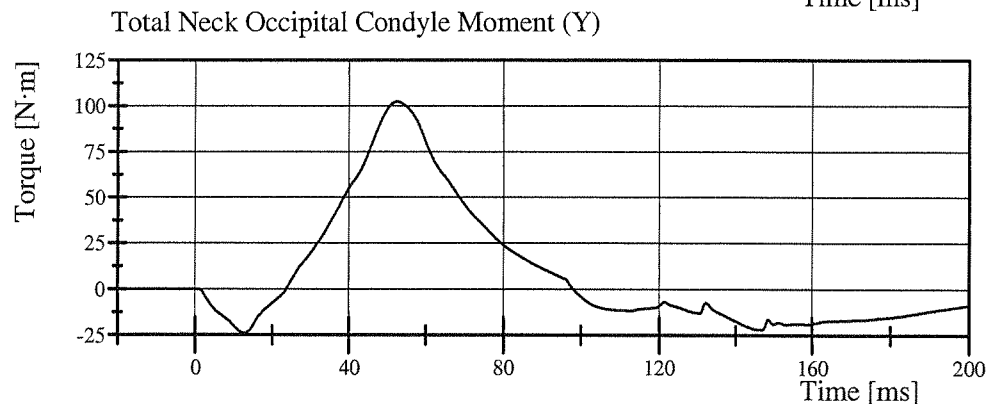

Filter Class: CFC_600

Max: 102.4 N·m at 52.6 ms

Min: -23.8 N·m at 12.8 ms

Transportation Research Center Inc.

Neck Extension

HHH 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.4 °C	Yes
Relative Humidity	10 - 70 %	44 %	Yes
Pendulum Velocity	(-5.95) - (-6.18) m/s	-5.999 m/s	Yes
Pendulum Acceleration Decay			
Crossing 5g	38 - 46 ms	42.3 ms	Yes
Pendulum Acceleration at 10ms	17.2 - 21.2 g	18.71 g	Yes
Pendulum Acceleration at 20ms	14.0 - 19.0 g	15.80 g	Yes
Pendulum Acceleration at 30ms	11.0 - 16.0 g	14.24 g	Yes
Pendulum Acceleration > 30ms	<= 22.0 g	14.24 g	Yes
Total Head D-Plane Rotation			
Peak	81 - 106 °	95.9 °	Yes
Time of Peak	72 - 82 ms	76.8 ms	Yes
Total Head D-Plane Rotation			
Decay to 0°	147 - 174 ms	156.6 ms	Yes
Total Neck Occipital Condyles Moment			
Peak	(-53) - (-80) N·m	-65.1 N·m	Yes
Time of Peak	65 - 79 ms	71.9 ms	Yes
Total Neck Occipital Condyles Moment			
Decay to 0 N·m	120 - 148 ms	141.8 ms	Yes


Test meets specifications.

Comments:

Technician

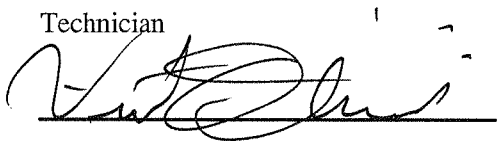

Approved




Transportation Research Center Inc.


Neck Extension

HIII 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

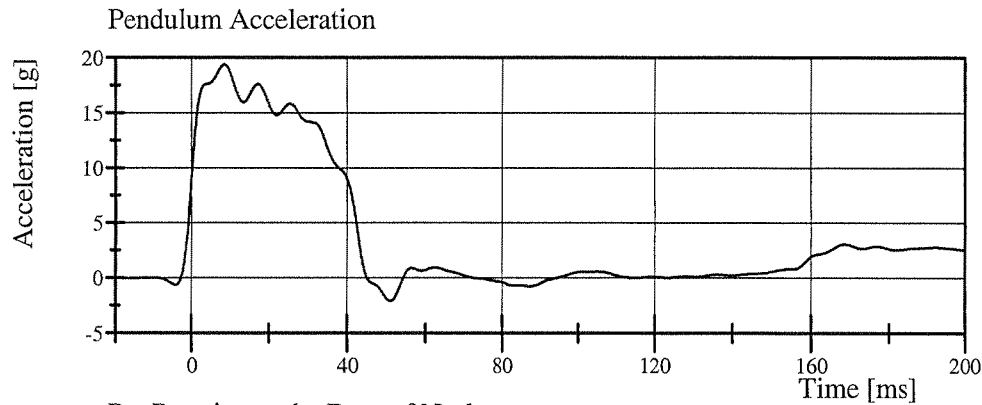


Filter Class: CFC_60
Max: 19.4 g at 8.6 ms
Min: -2.1 g at 50.9 ms

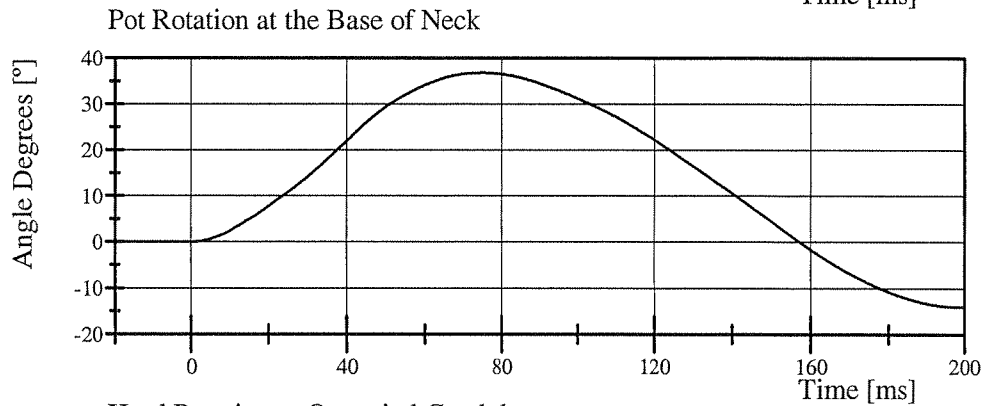

Filter Class: CFC_60
Max: 36.8 ° at 75.0 ms
Min: -14.1 ° at 199.3 ms

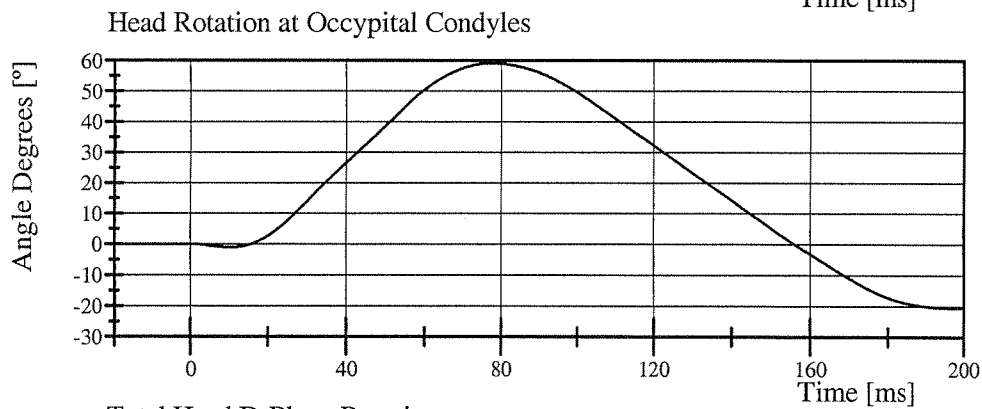

Filter Class: CFC_60
Max: 59.1 ° at 77.6 ms
Min: -20.5 ° at 197.5 ms

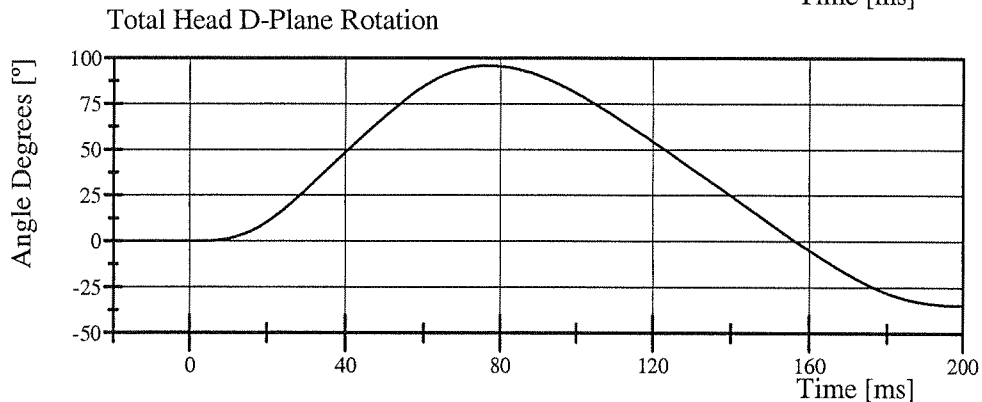


Filter Class: CFC_60
Max: 95.9 ° at 76.8 ms
Min: -34.6 ° at 198.4 ms

Transportation Research Center Inc.

Neck Extension

HIH 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

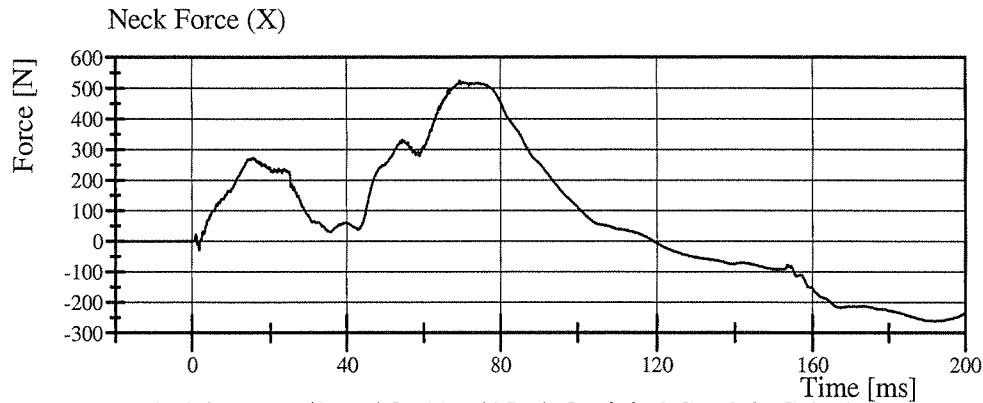

Filter Class: CFC_1000

Max: 524.3 N at 69.5 ms


Min: -262.3 N at 191.8 ms

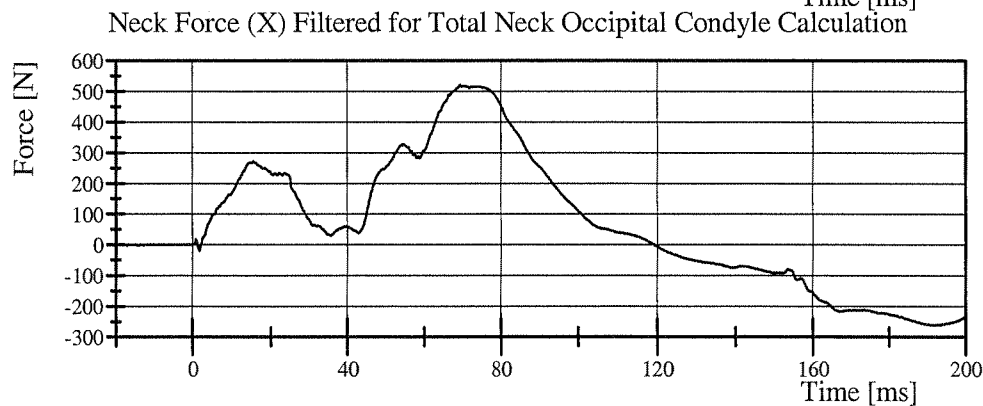

Filter Class: CFC_600

Max: 521.1 N at 69.5 ms


Min: -262.1 N at 191.9 ms

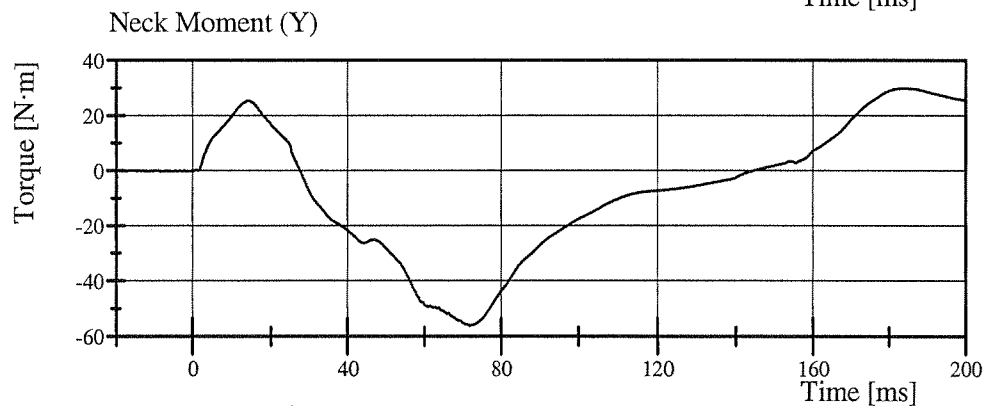

Filter Class: CFC_600

Max: 29.9 N·m at 184.0 ms

Min: -56.1 N·m at 71.9 ms

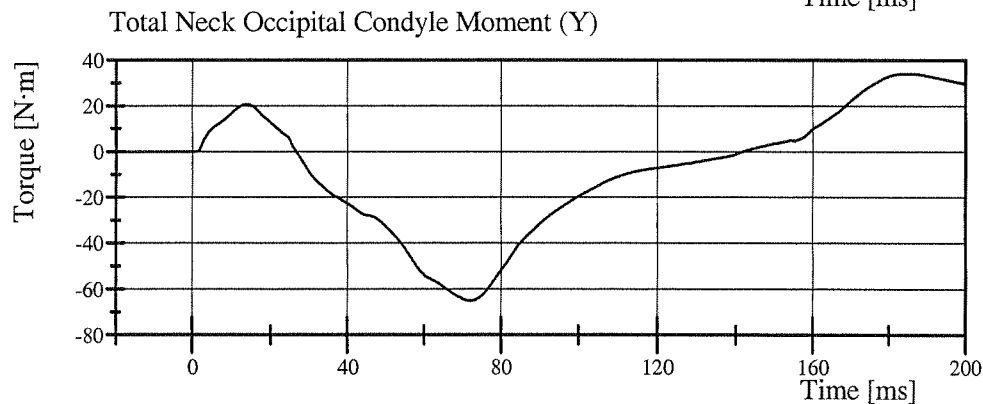

Filter Class: CFC_600

Max: 34.2 N·m at 185.0 ms

Min: -65.1 N·m at 71.9 ms

Transportation Research Center Inc.

Front Thorax

HHH 50th Serial No. 202 Certification No. 17-1

Test Date: 05/25/2006

Test Parameter	Specification	Test Results	Pass
Temperature	20.6 - 22.2 °C	21.3 °C	Yes
Relative Humidity	10 - 70 %	47 %	Yes
Probe Velocity	6.59 - 6.83 m/s	6.600 m/s	Yes
Probe Force Peak	(-5,160) - (-5,893) N	-5,845.6 N	Yes
Maximum Chest Compression	(-63.5) - (-72.6) mm	-65.92 mm	Yes
Internal Hysteresis	65 - 85 %	75.1 %	Yes


Test meets specifications.

Comments:

Technician



Approved




Transportation Research Center Inc.

Front Thorax

HIII 50th Serial No. 202 Certification No. 17-1


Test Date: 05/25/2006

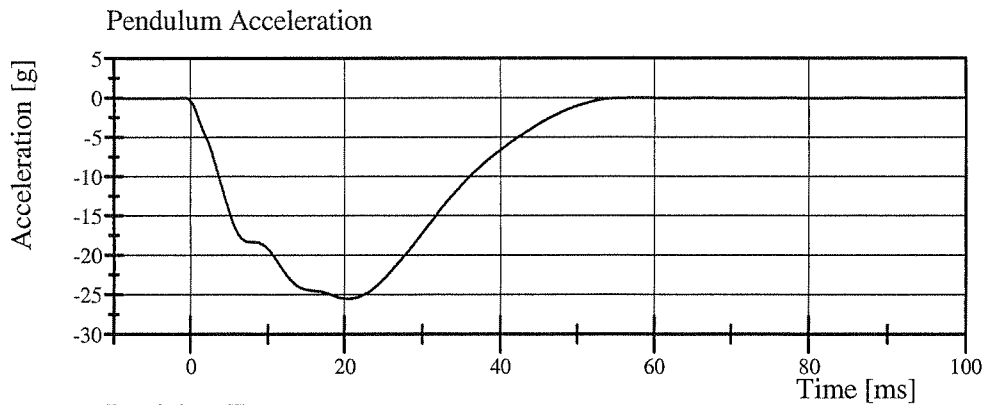

Filter Class: CFC_180

Max: 0.0 g at -0.9 ms


Min: -25.5 g at 20.5 ms

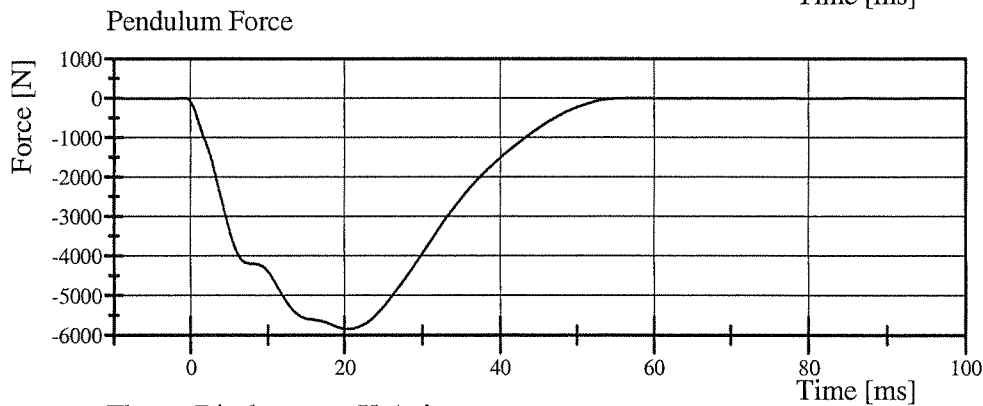

Filter Class: CFC_180

Max: 7.9 N at -0.9 ms


Min: -5,845.6 N at 20.5 ms

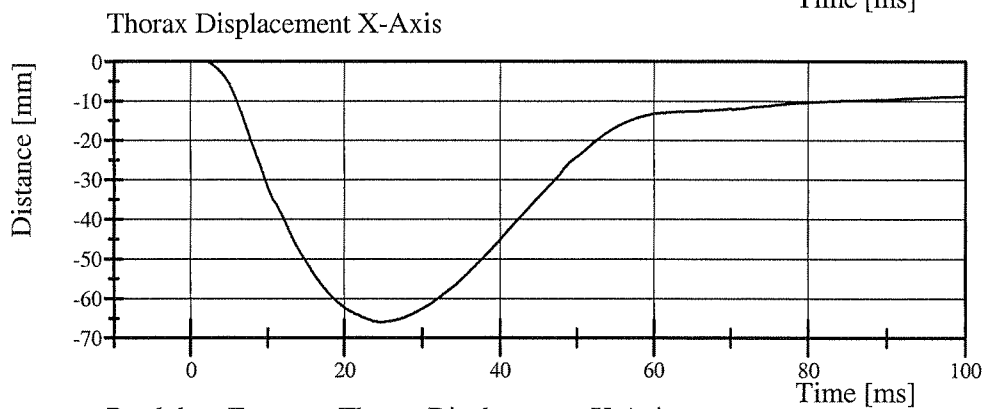

Filter Class: CFC_600

Max: 0.0 mm at 1.7 ms

Min: -65.9 mm at 24.6 ms

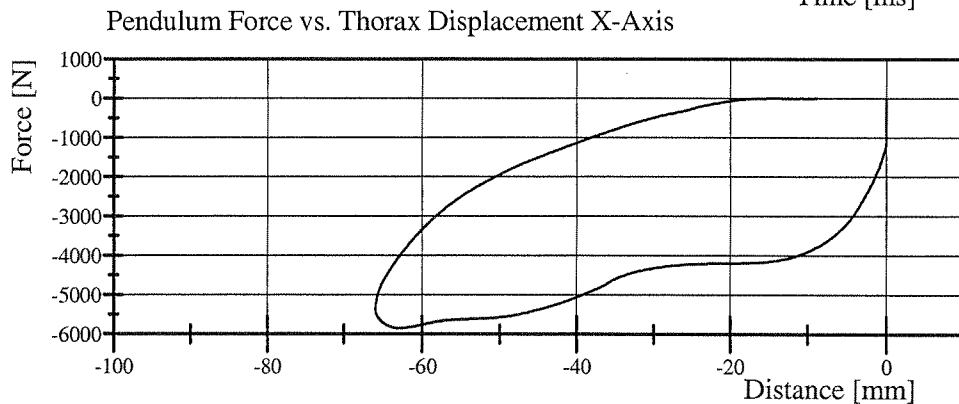

Filter Class: CFC_180

Max: 7.9 N at -0.0 mm

Min: -5,845.6 N at -62.9 mm

Applied Safety Technologies Corp.



Hybrid III Hip Range of Motion

Serial Number: 202L
Test Number: 202C17
Comments:

Date: 05/09/2006
Time: 14:44

TEST PARAMETER	SPECIFICATION	TEST RESULTS
Temperature	18.9 - 25.6	21.5 °C Pass
Humidity	10 - 70	41 % Pass
Moment at 30 deg	<= 94.9	90.7 Nm Pass
Angle at 203 Nm	40.0 - 50.0	40.2 deg Pass
Average Velocity	5.0 - 10.0	7.5 deg/sec Pass

Moment About H-Point
Peak Moment: 210.2 Nm at 40.6 deg
Peak Angle: 40.6 deg at 210.2 Nm

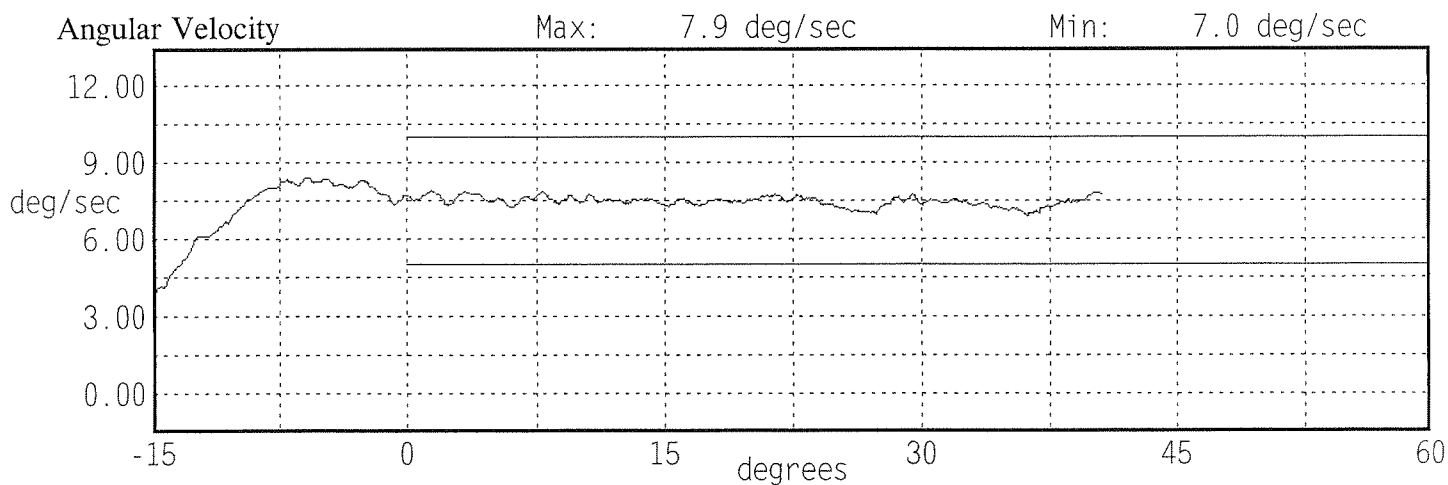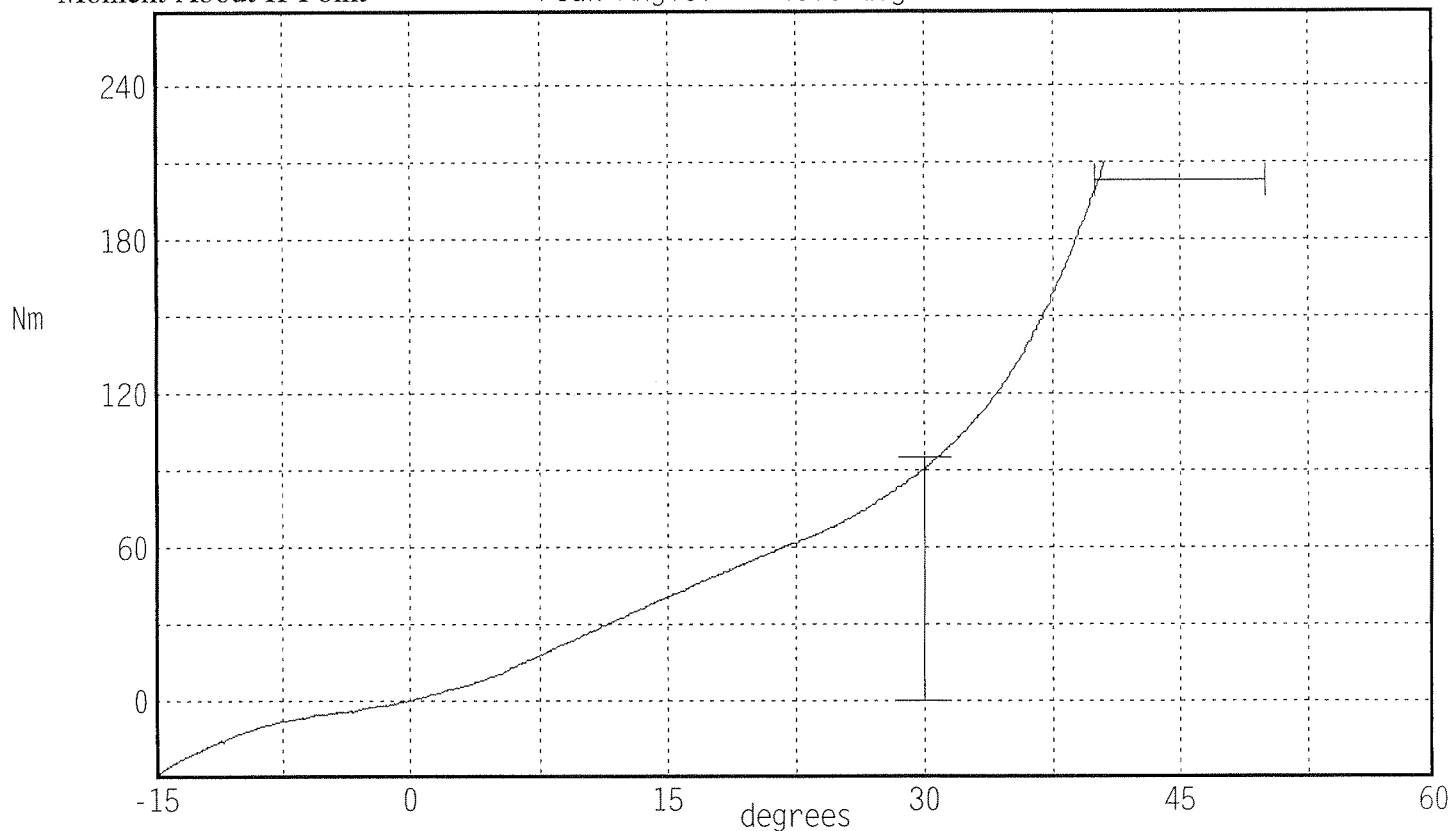

Applied Safety Technologies Corp.

Hybrid III Hip Range of Motion

Serial Number: 202R

Date: 05/09/2006

Test Number: 202C17

Time: 14:39


Comments:

TEST PARAMETER	SPECIFICATION	TEST RESULTS
Temperature	18.9 - 25.6	21.5 °C Pass
Humidity	10 - 70	41 % Pass
Moment at 30 deg	<= 94.9	94.2 Nm Pass
Angle at 203 Nm	40.0 - 50.0	40.7 deg Pass
Average Velocity	5.0 - 10.0	7.5 deg/sec Pass

Peak Moment: 210.5 Nm at 41.1 deg

Peak Angle: 41.1 deg at 210.5 Nm


Moment About H-Point

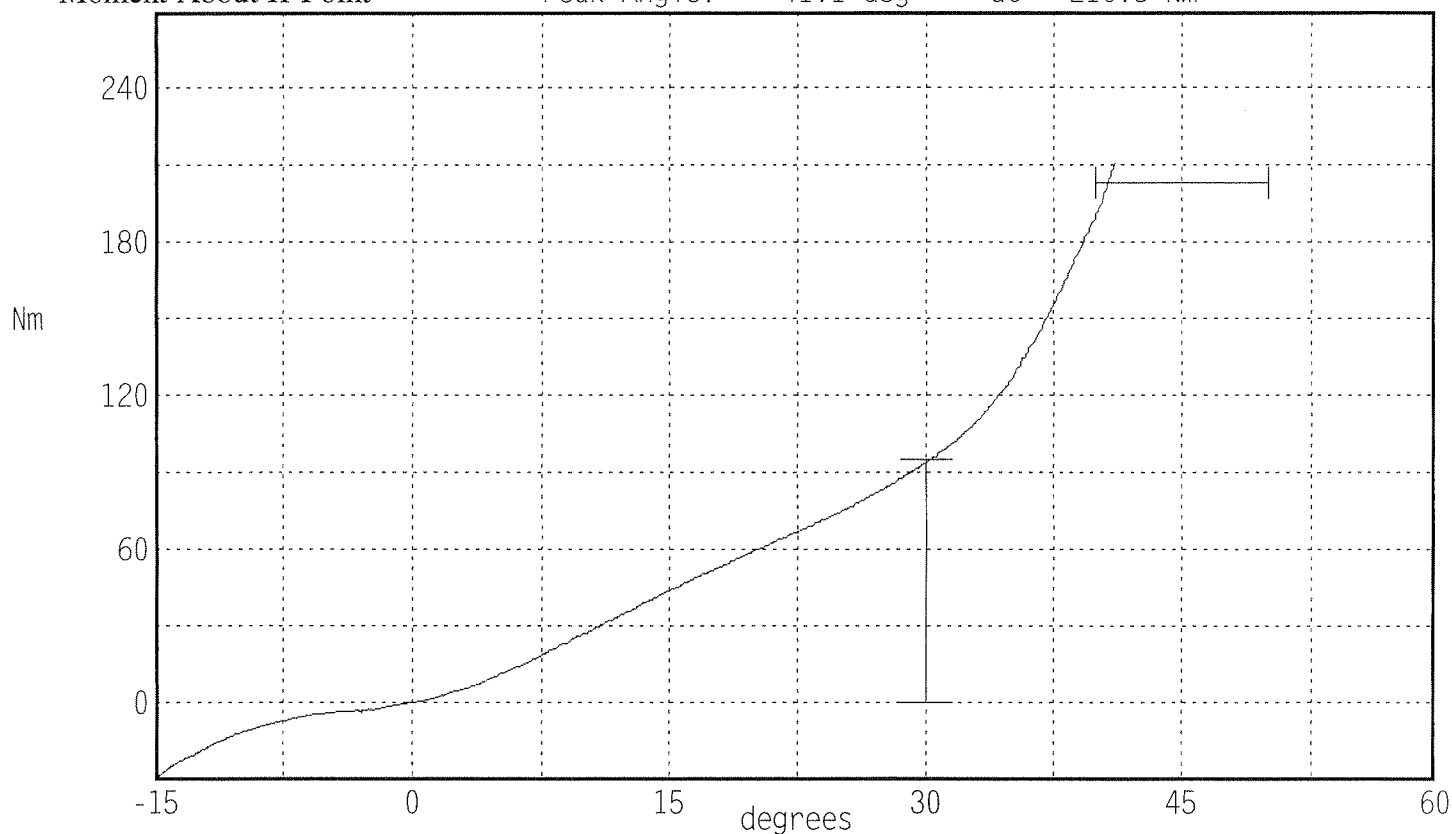

Angular Velocity

Max: 8.0 deg/sec

Min: 7.0 deg/sec

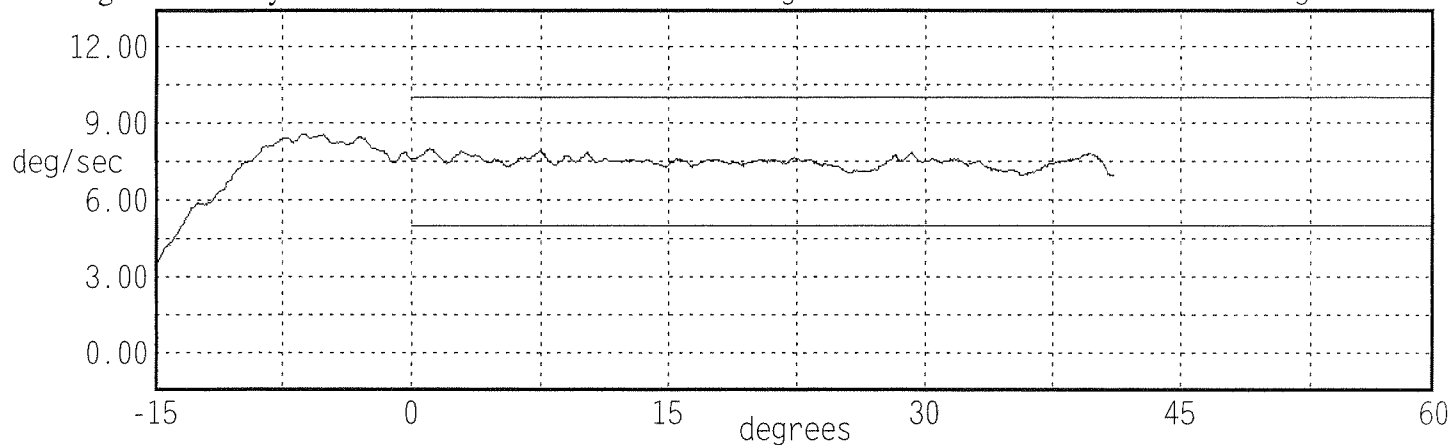

Transportation Research Center Inc.

Left Knee Femur Response Test

HHH 50th Serial No. 202 Certification No. 17-1

Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.6 °C	Yes
Relative Humidity	10 - 70 %	42 %	Yes
Probe Velocity	2.08 - 2.13 m/s	2.102 m/s	Yes
Peak Femur Force	(-4,715.2) - (-5,782.6) N	-5,416.24 N	Yes

Test meets specifications.

Comments:

Technician



Approved





Transportation Research Center Inc.

Left Knee Femur Response Test

HIII 50th Serial No. 202 Certification No. 17-1

Test Date: 05/09/2006

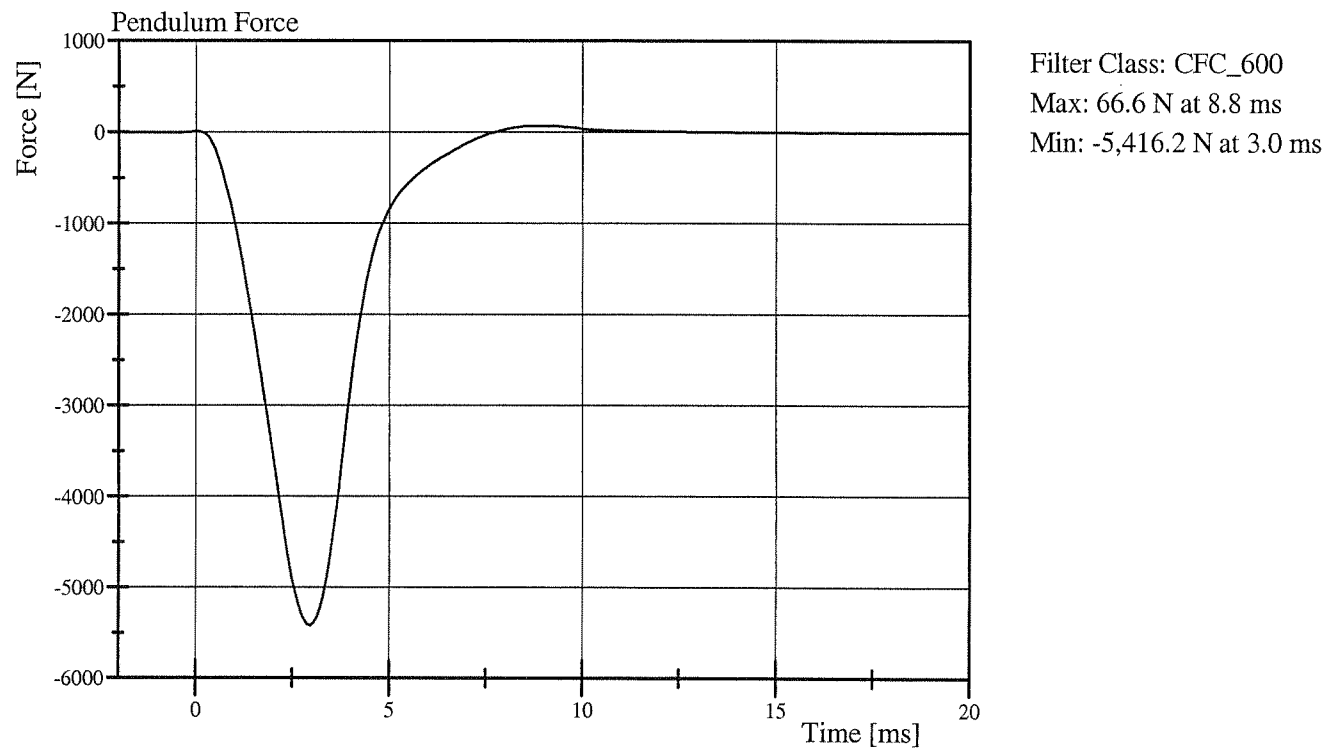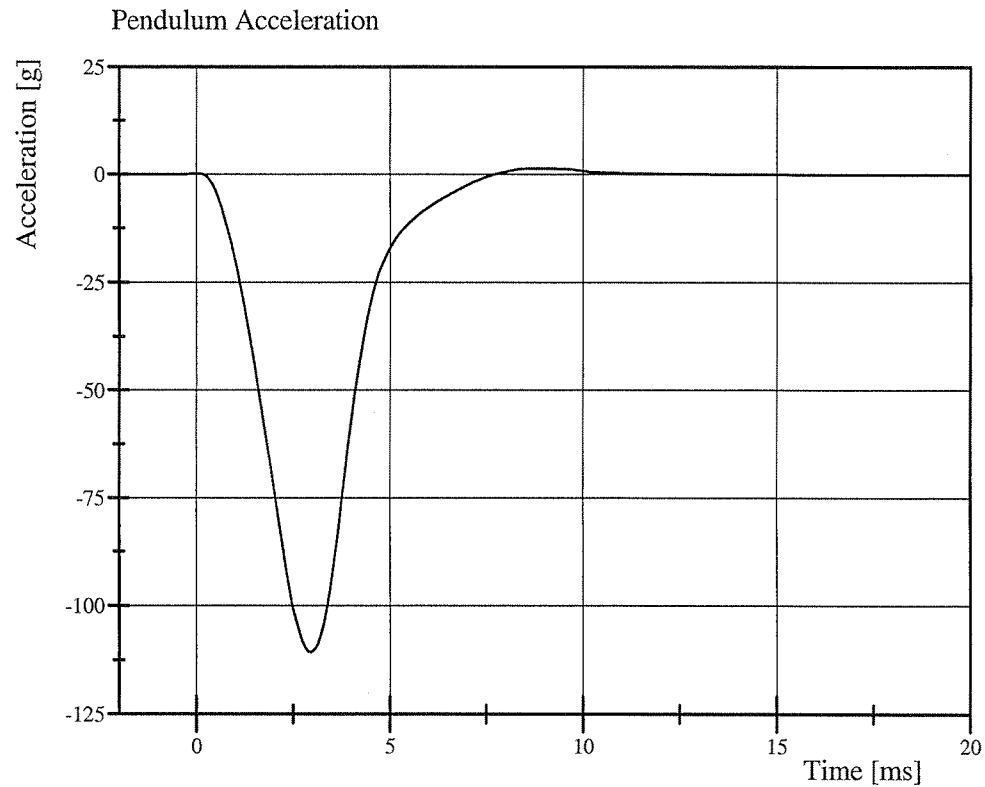

Transportation Research Center Inc.

Right Knee Femur Response Test
HIII 50th Serial No. 202 Certification No. 17-3
Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.7 °C	Yes
Relative Humidity	10 - 70 %	43 %	Yes
Probe Velocity	2.08 - 2.13 m/s	2.083 m/s	Yes
Peak Femur Force	(-4,715.2) - (-5,782.6) N	-5,736.42 N	Yes

Test meets specifications.

Comments:

Technician




Approved




Transportation Research Center Inc.

Right Knee Femur Response Test
HIII 50th Serial No. 202 Certification No. 17-3
Test Date: 05/09/2006

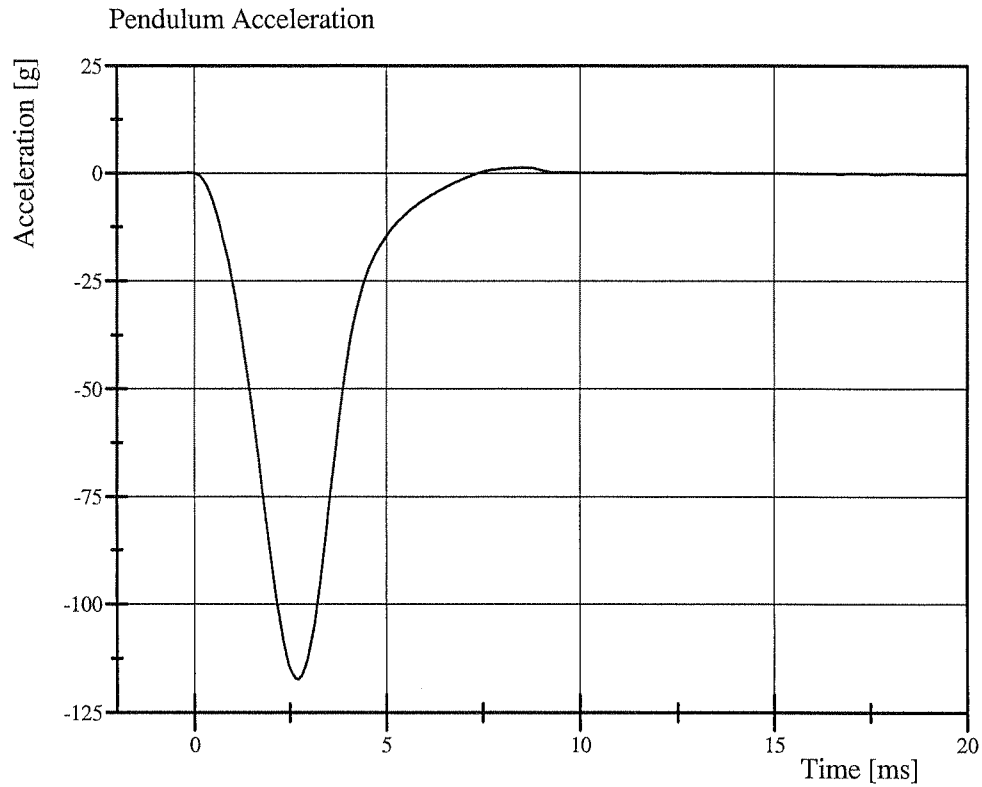

Filter Class: CFC_600
Max: 1.3 g at 8.6 ms
Min: -117.2 g at 2.7 ms

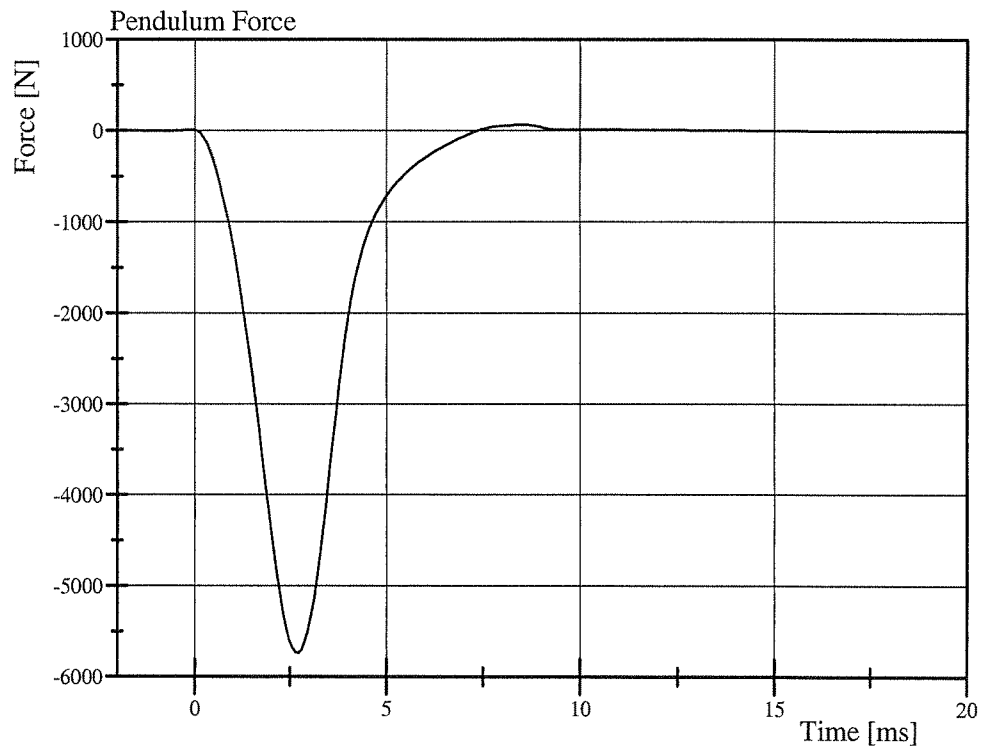

Filter Class: CFC_600
Max: 64.7 N at 8.6 ms
Min: -5,736.4 N at 2.7 ms

Transportation Research Center Inc.

Left Knee Slider

HHH 50th Serial No. 202 Certification No. 17-2

Test Date: 05/12/2006

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.1 °C	Yes
Relative Humidity	10 - 70 %	39 %	Yes
Probe Velocity	2.70 - 2.80 m/s	2.766 m/s	Yes
Force Peak at 10.0 mm Deflection	(-1,260) - (-1,720) N	-1,553.1 N	Yes
Force Peak at 18.0 mm Deflection	(-2,270) - (-3,100) N	-3,051.5 N	Yes


Test meets specifications.

Comments:

Technician



Approved




Transportation Research Center Inc.

Left Knee Slider

HIII 50th Serial No. 202 Certification No. 17-2


Test Date: 05/12/2006

Knee Slider Displacement

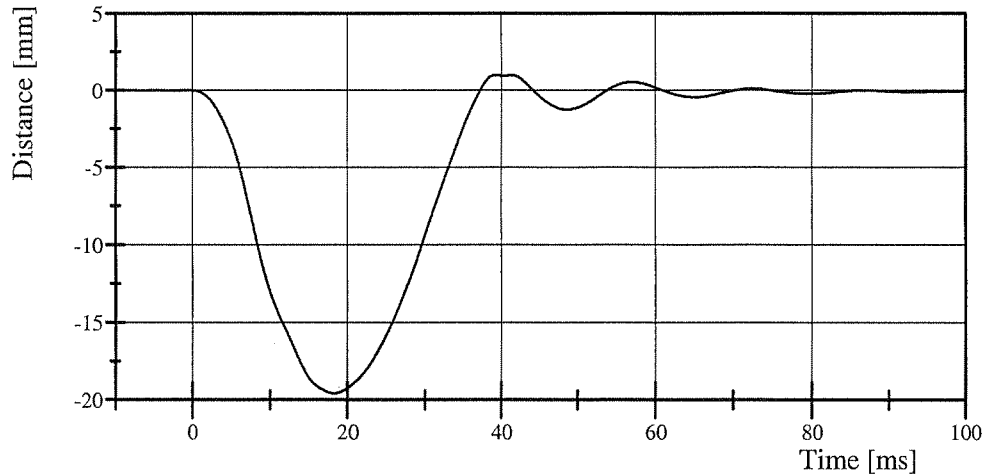


Filter Class: CFC_180
Max: 1.0 mm at 39.3 ms
Min: -19.6 mm at 18.2 ms

Femur Force

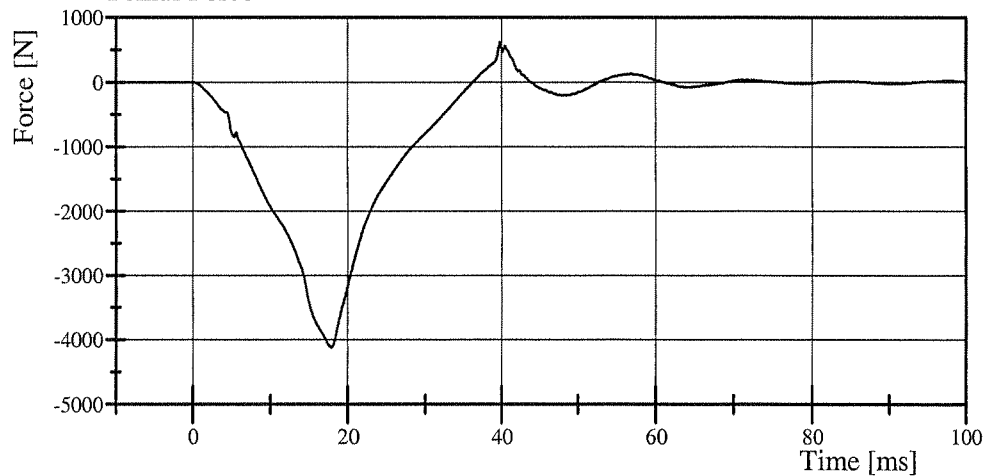

Filter Class: CFC_600
Max: 619.0 N at 39.8 ms
Min: -4,117.2 N at 17.8 ms

Femur Force vs. Knee Slider Displacement

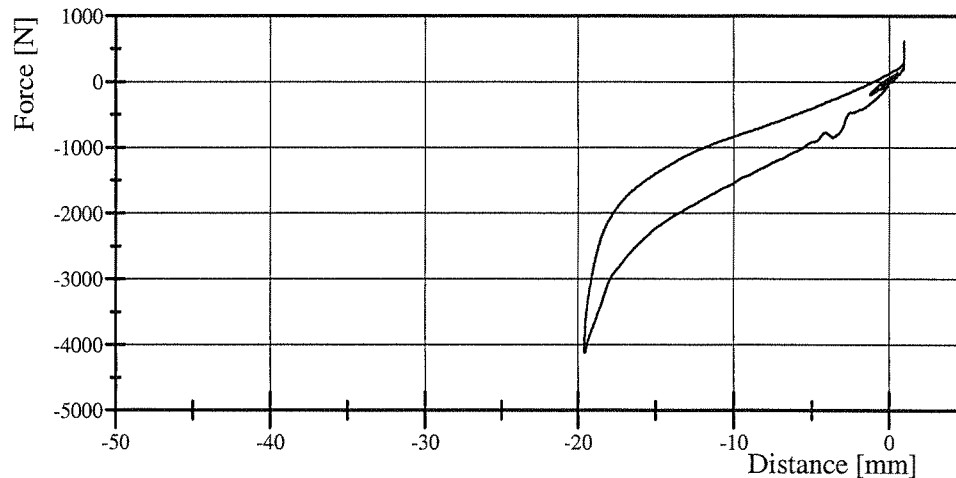

Filter Class: CFC_600
Max: 619.0 N at 1.0 mm
Min: -4,117.2 N at -19.6 mm

Transportation Research Center Inc.

Right Knee Slider

HIII 50th Serial No. 202 Certification No. 17-1

Test Date: 05/09/2006

Test Parameter	Specification	Test Results	Pass
Temperature	18.9 - 25.5 °C	21.2 °C	Yes
Relative Humidity	10 - 70 %	44 %	Yes
Probe Velocity	2.70 - 2.80 m/s	2.728 m/s	Yes
Force Peak at 10.0 mm Deflection	(-1,260) - (-1,720) N	-1,357.6 N	Yes
Force Peak at 18.0 mm Deflection	(-2,270) - (-3,100) N	-2,897.5 N	Yes


Test meets specifications.

Comments:

Technician



Approved




Transportation Research Center Inc.

Right Knee Slider

HIII 50th Serial No. 202 Certification No. 17-1


Test Date: 05/09/2006

Knee Slider Displacement

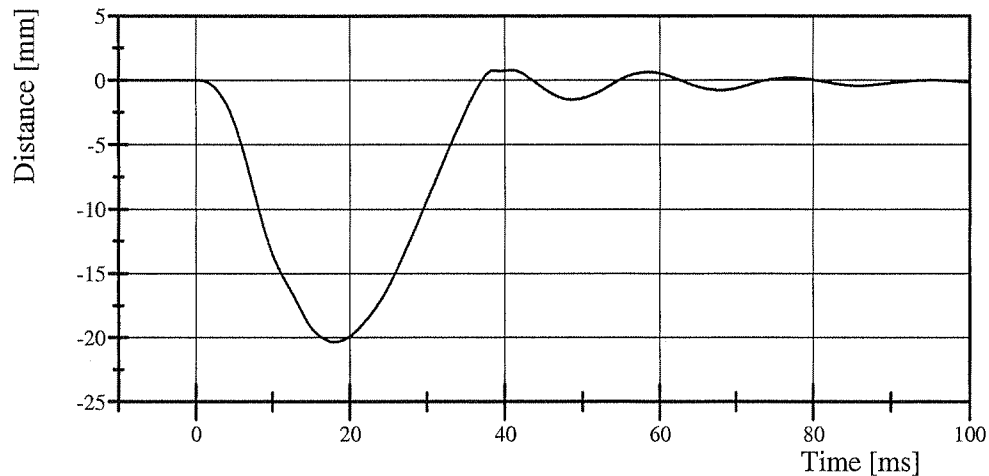


Filter Class: CFC_180
Max: 0.8 mm at 41.0 ms
Min: -20.3 mm at 18.1 ms

Femur Force

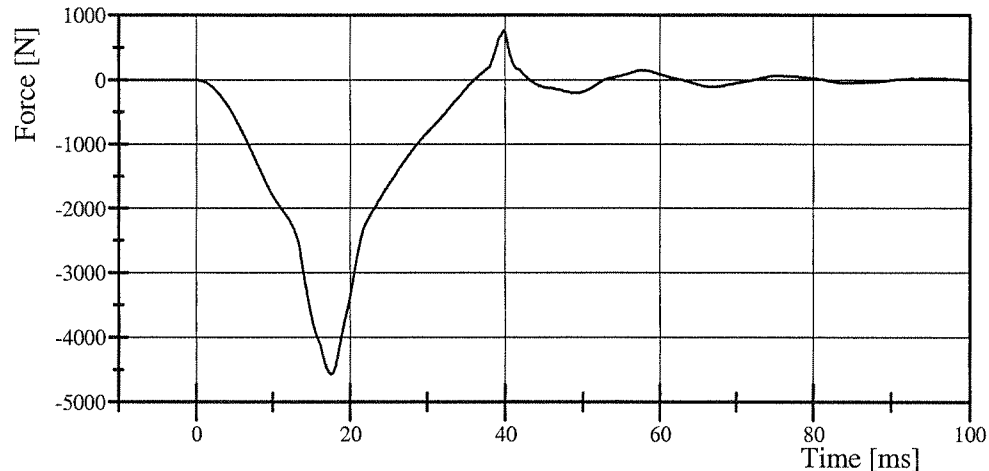

Filter Class: CFC_600
Max: 763.5 N at 39.8 ms
Min: -4,563.1 N at 17.6 ms

Femur Force vs. Knee Slider Displacement

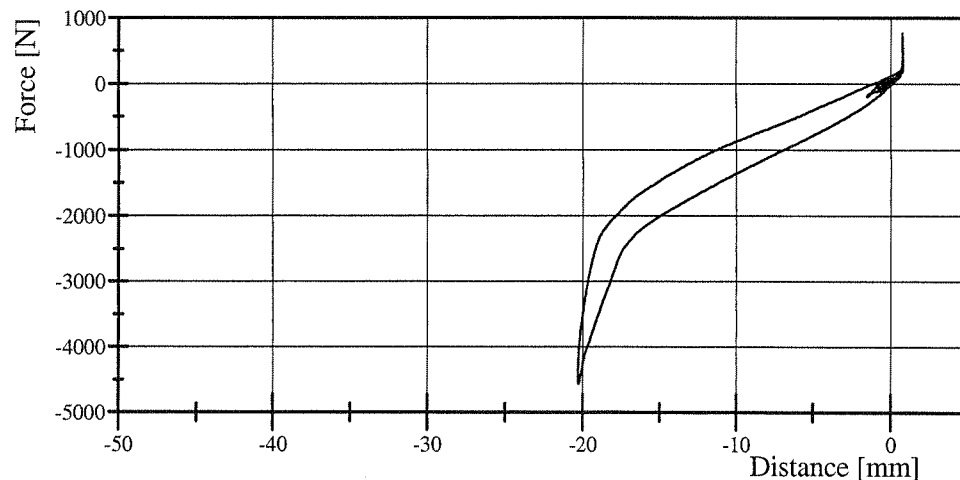

Filter Class: CFC_600
Max: 763.5 N at 0.7 mm
Min: -4,563.1 N at -20.3 mm


Ball of Foot Impact Probe weight 5.00 +/- .02kg or 11.02 +/- .04lbs				Temperature	Humidity	Impact Speed m/sec	Peak Tibia Compressive Load	Peak Ankle Resistive Moment	Peak Ankle Y-axis Rotation	Time between tests	
					%		N	Nm	deg		
				Soak for 4 hours @ 69° - 72° F	N/A	4.9 - 5.1	Class 600	Class 600	Class 180	30 min	
							2956 - 3613	77.1 - 94.2	32.7 - 39.9		
Test No.	Leg No.	Test Performer	Date of Cal.								Comments
LX0045NOV302005DORSI_02	LX0045	RP	11/30/2005	70	31	5.08	-3191.79	78.31	33.43		
LX0046DEC012005DORSI_02	LX0046	RP	12/1/2005	70	33	5.08	-3173.77	81.16	34.41		

Heel Impact				Probe weight 5.00	Temperature	Humidity	Impact Speed	Peak Tibia Compressive Load	Time between tests	Comments
+/- .02kg or 11.02 +/- .04lbs				%		m/sec	N			
				Soak for 4 hours @ 69° - 72° F			Class 600			
Test No.	Leg No.	Test Performer	Date of Cal.		N/A	3.9 - 4.1	2738 - 3346	30 min		
LX0045DEC052005HEEL_01	LX0045	RP	12/5/2005	70	37	3.91	-3291.55			
LX0046DEC012005HEEL_05	LX0046	RP	12/1/2005	70	35	3.91	-3864.23			

24 Inversion				Probe weight 5.00 +/- .02kg or 11.02 +/- .04lbs		Temperature	Humidity	Impact Speed	Peak Tibia Compressive Load	Peak Ankle Resistive Moment	Peak Ankle X-axis Rotation	Time between tests	
							%	m/sec	N	Nm	deg		
				Soak for 4 hours @ 69° - 72° F	N/A	1.9 - 2.1	Class 600	Class 600	Class 180				
Test No.	Leg No.	Test Performer	Date of Cal.				552 - 675	36.3 - 44.4	30.3 - 37.0	30 min	Comments		
LX0045NOV302005INVER_01	LX0045	RP	11/30/2005	70	31	1.95	-549.26	38.66	-34.29				
LX0046DEC012005INVER_01	LX0046	RP	12/1/2005	70	32	1.95	-586.6	-42.18	33.37				


Eversion				Probe weight	Temperature	Humidity	Impact Speed	Peak Tibia Compressive Load	Peak Ankle Resistive Moment	Peak Ankle X-axis Rotation	Time between tests	
5.00 +/- .02kg or 11.02 +/- .04lbs				%		m/sec	N	Nm	deg			
				Soak for 4 hours @ 69° - 72° F			Class 600	Class 600	Class 180			
Test No.	Leg No.	Test Performer	Date of Cal.				N/A	1.9 - 2.1	552 - 675	36.3 - 44.4	30.3 - 37.0	30 min
LX0045NOV302005EVER_01	LX0045	RP	11/30/2005	70	32	1.95	-575.84	-41.89	33.3			
LX0046DEC012005EVER_01	LX0046	RP	11/28/2005	70	32	1.95	-628.14	43.53	-34.1			

Specs were created by Dan Rhule. These specs. are preliminary.

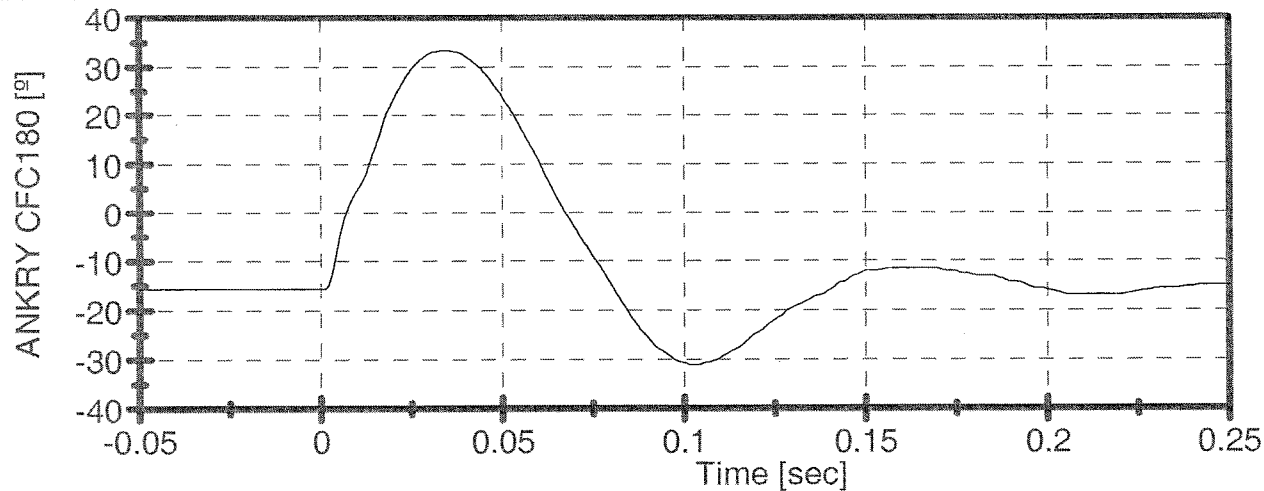


Min = -31.1463758345392

Max = 33.4315740156824

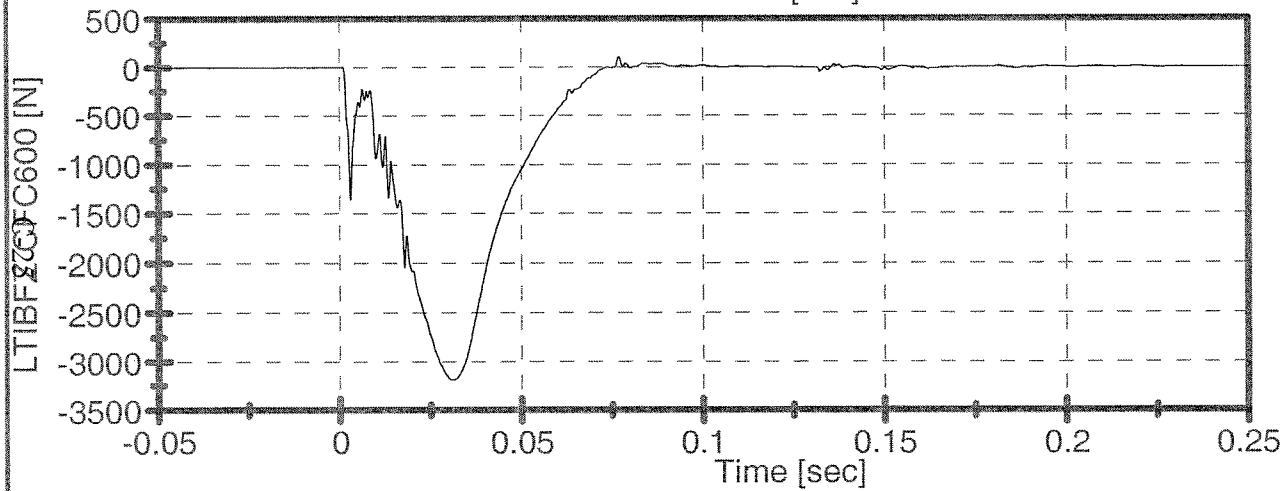

Min = -3191.79388857251

Max = 107.506925895931



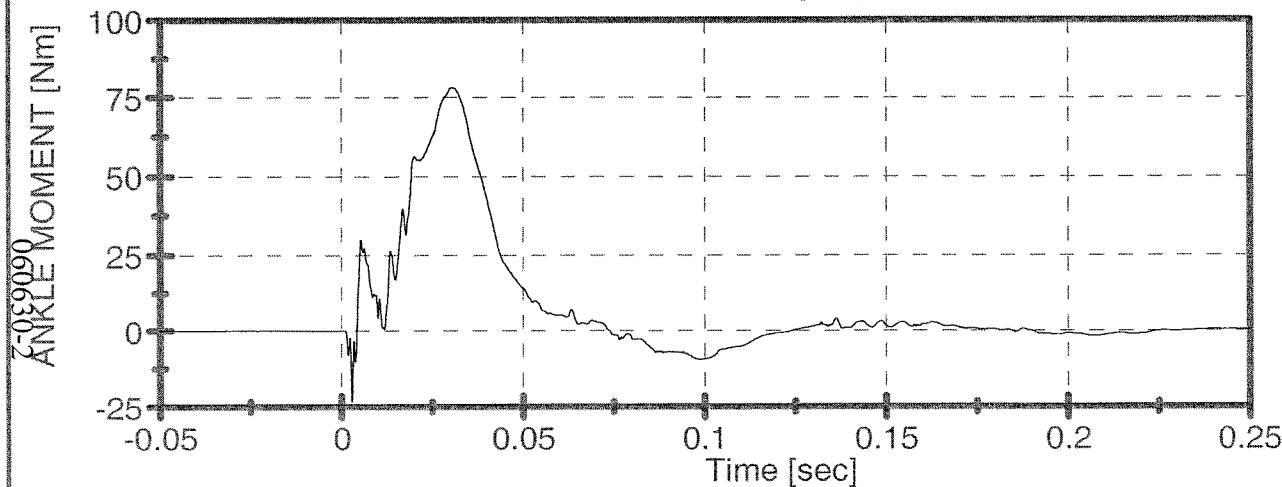


Min = -23.0033410232309


Max = 78.3111948708584

LX0045NOV302005DORSI_02

LX0045NOV302005INVER_01

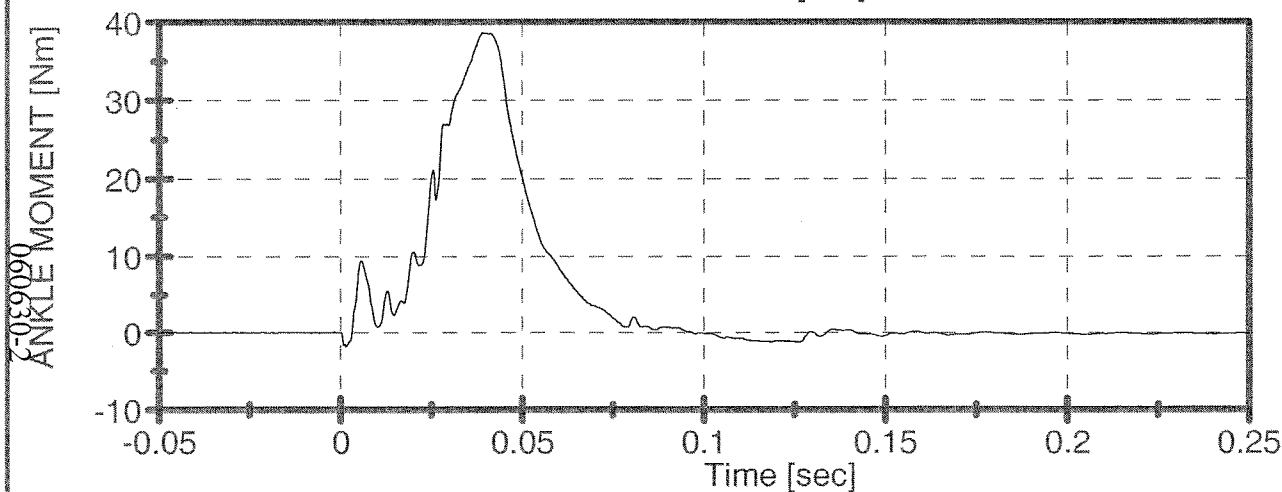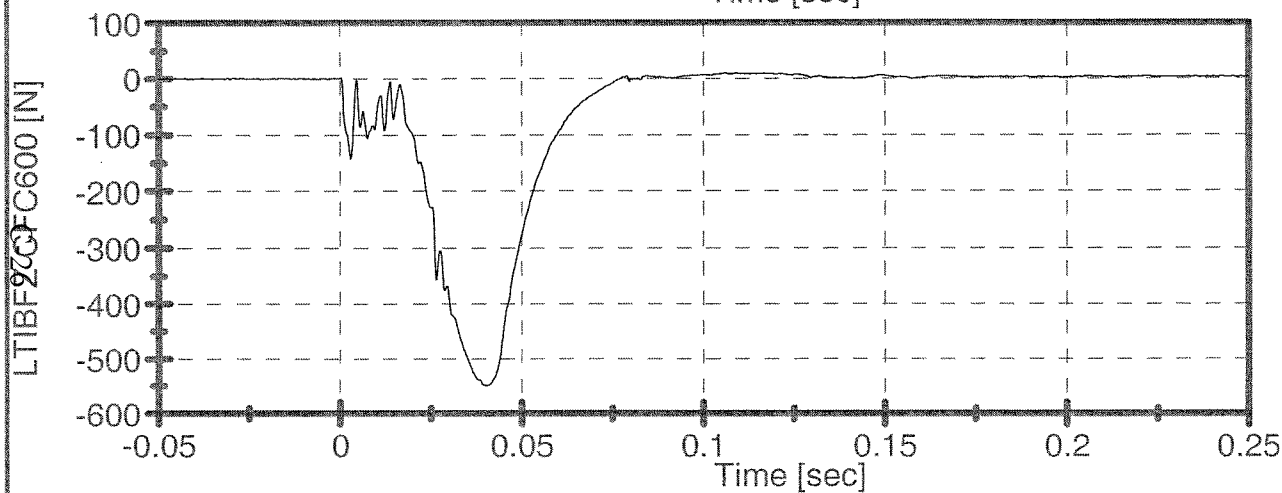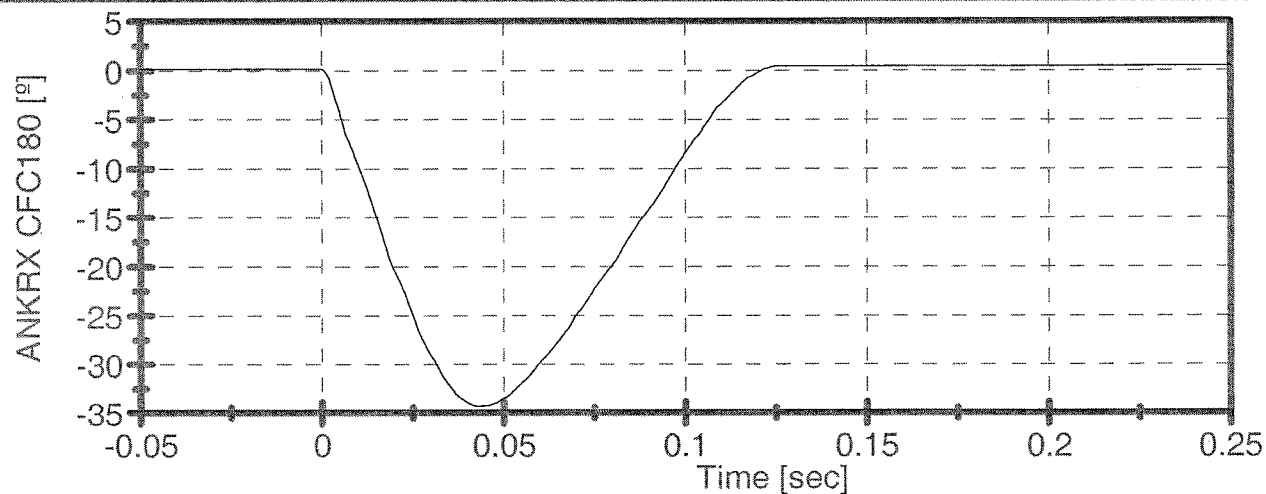


LX0045NOV302005EVER_01

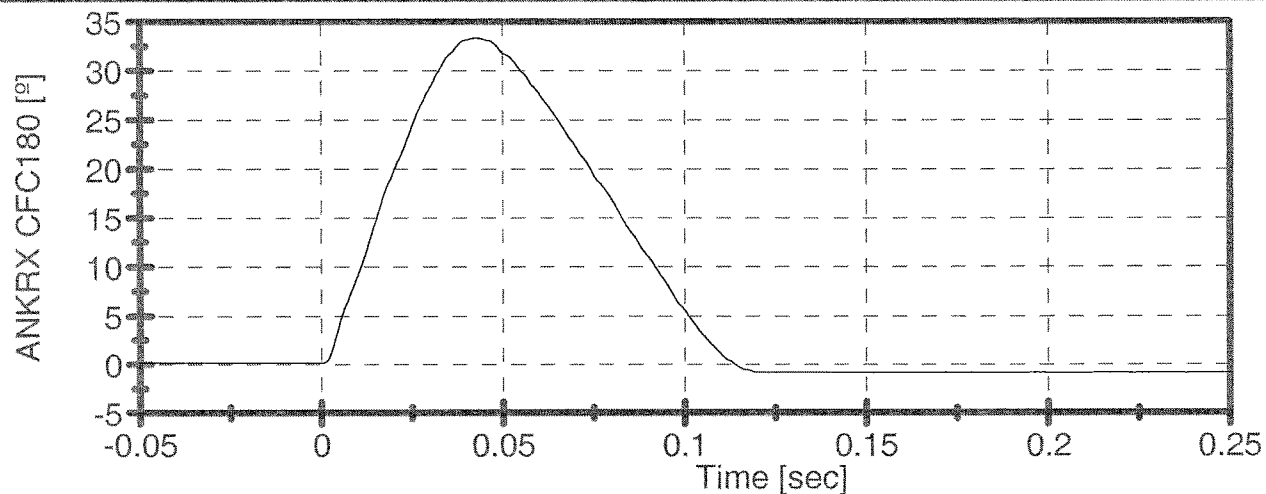


Min = -0.859372482563251

Max = 33.3017342322621

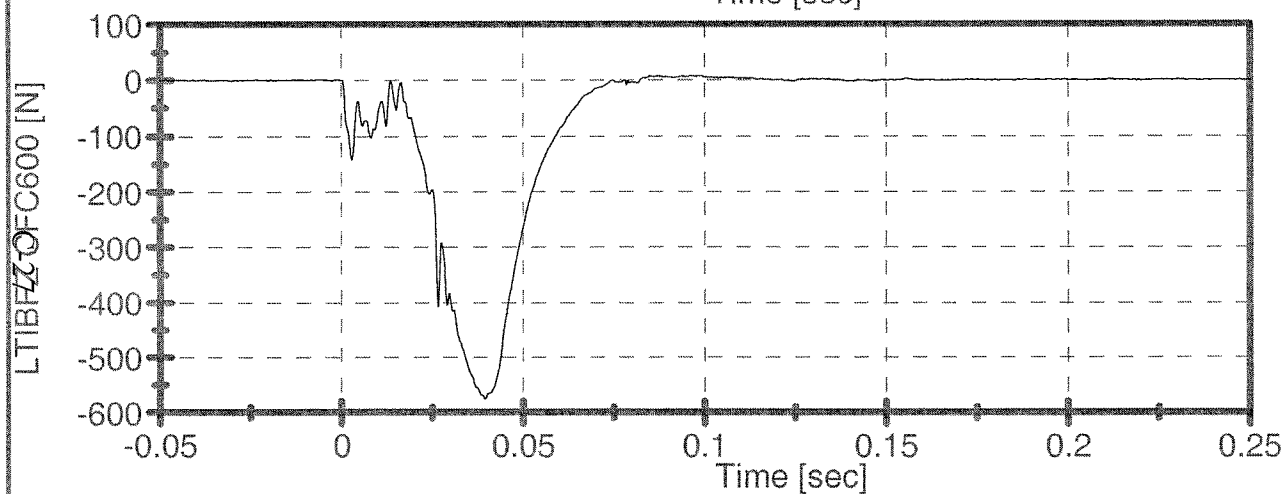

Min = -575.844365543668


Max = 8.05351440679311

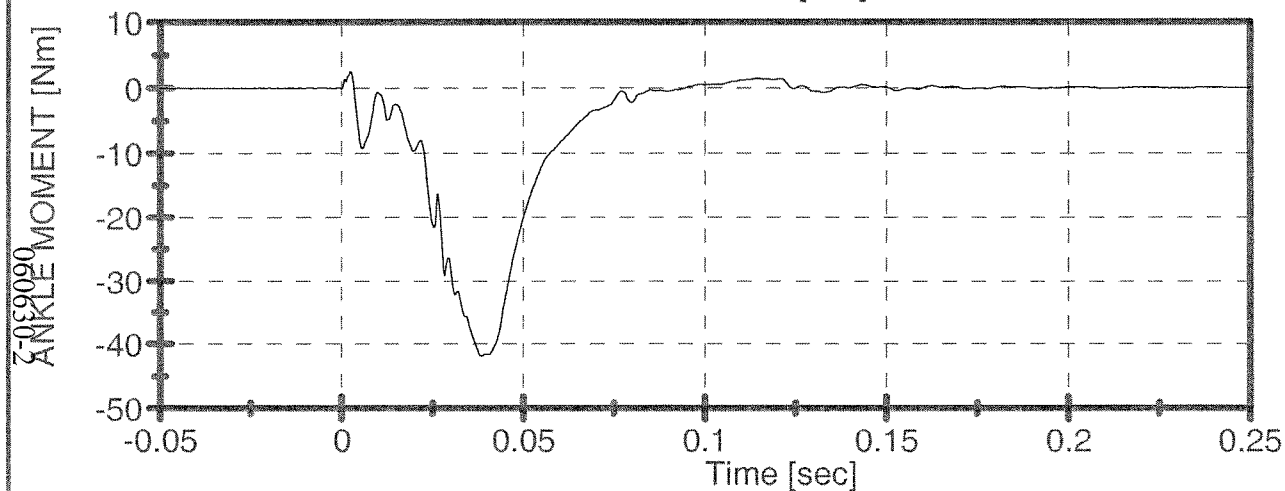

Min = -41.8949447665471


Max = 2.54298134187598

LX0045DEC052005HEEL_01

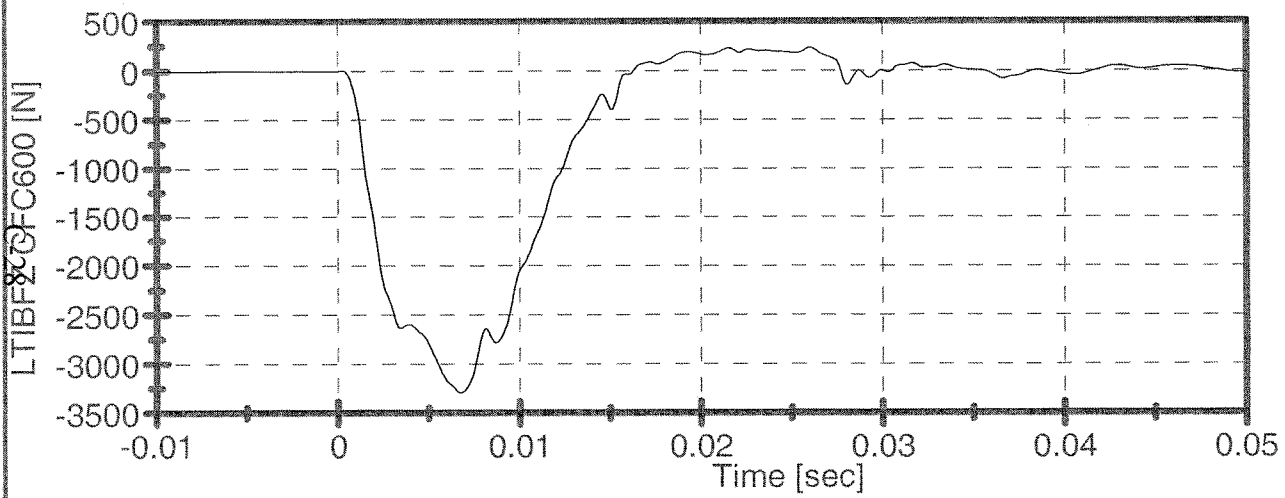

Min = -3291.55482318782

Max = 235.613526770538

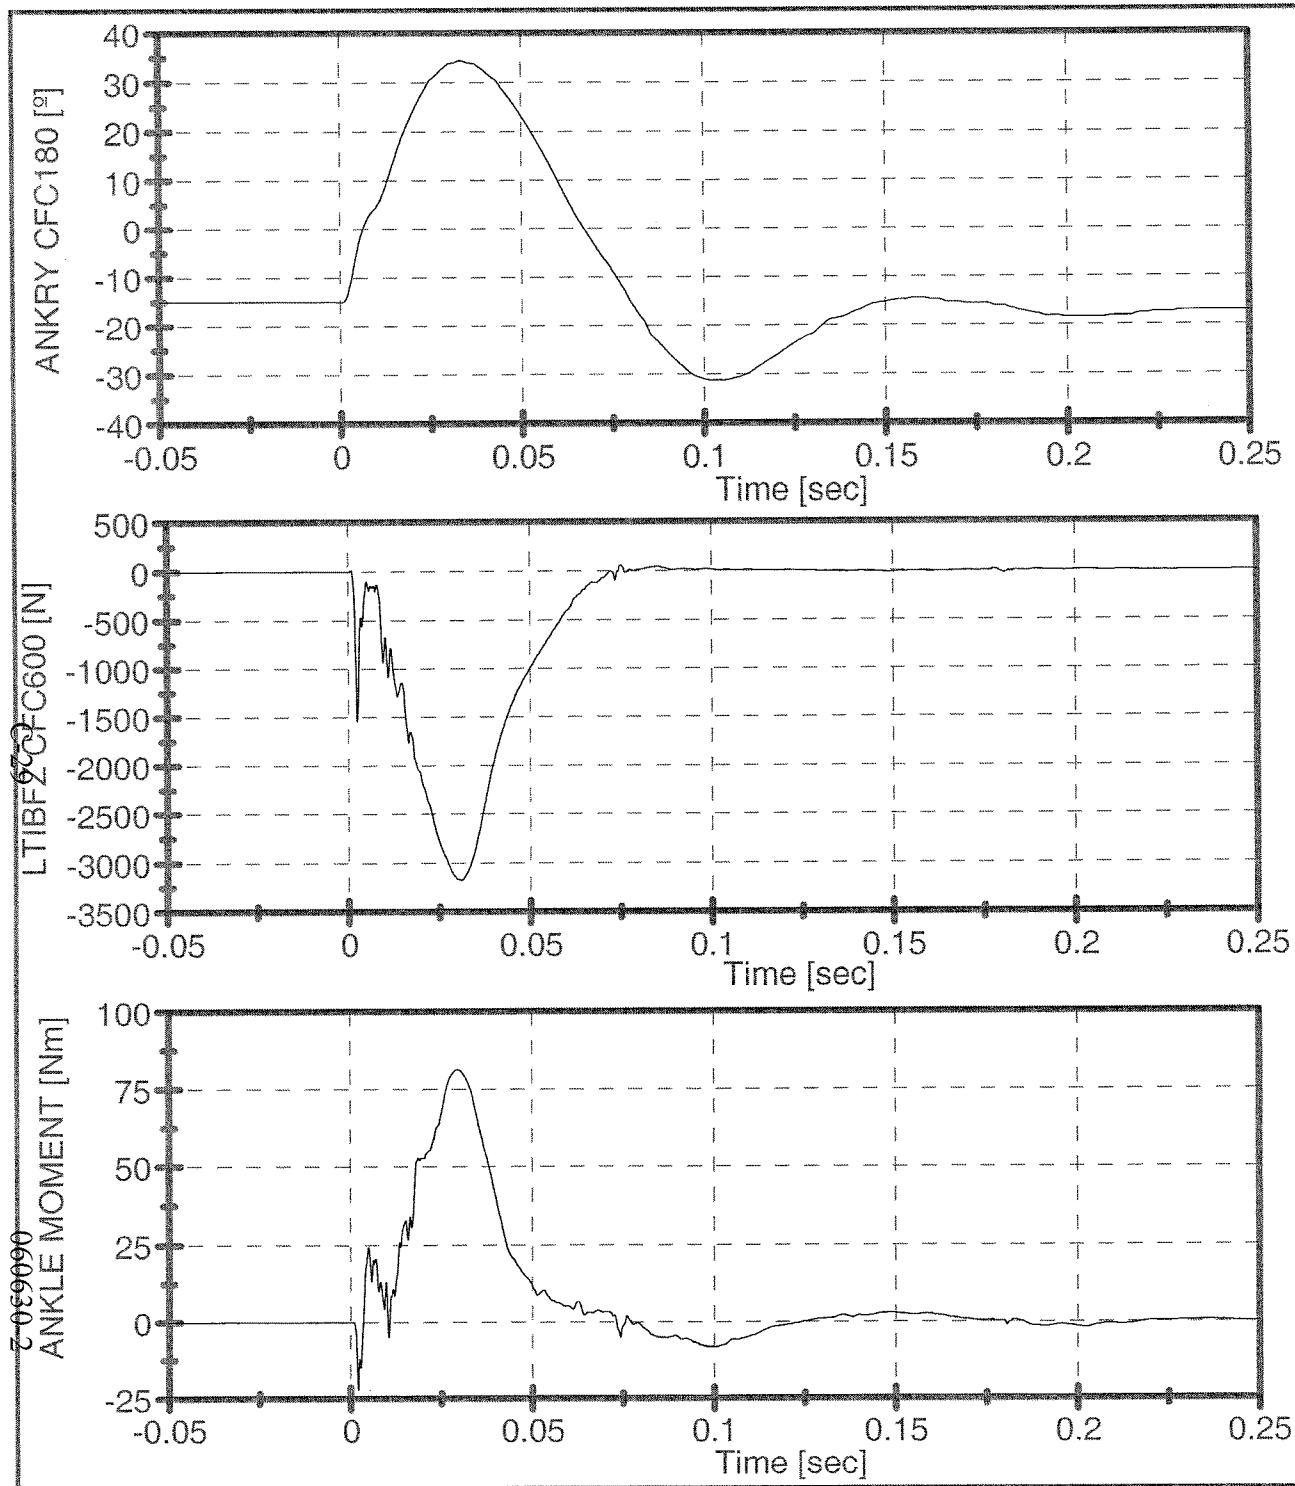

Min = -31.3396679194813

Max = 34.4181558438497

Min = -3173.77643306494




Max = 66.1238200727544


Min = -22.018288643543

Max = 81.1666103171652

LX0046DEC012005DORSI_02

LX0046DEC012005INVER_01

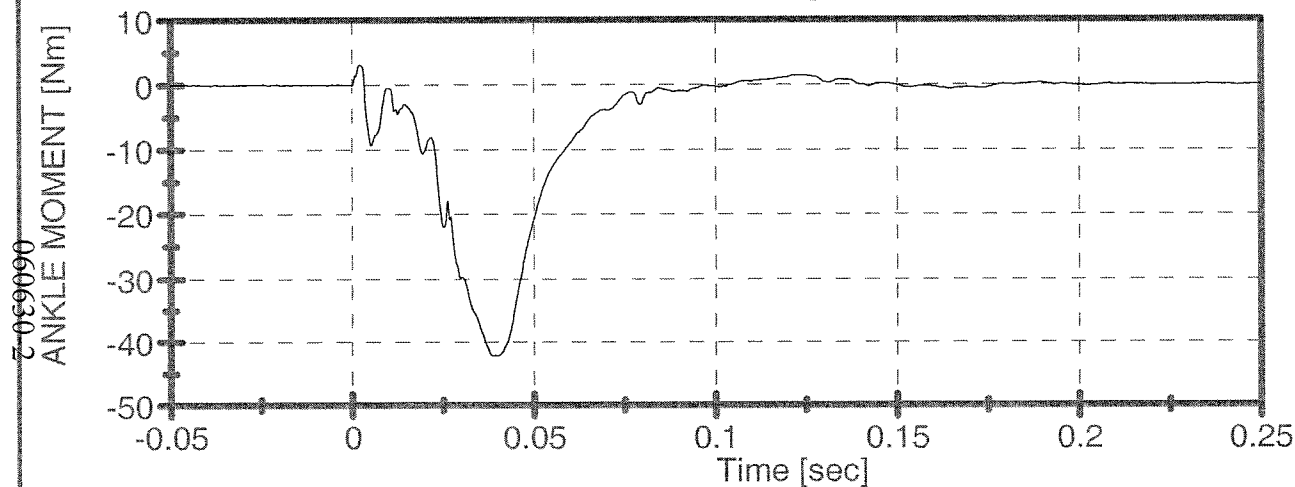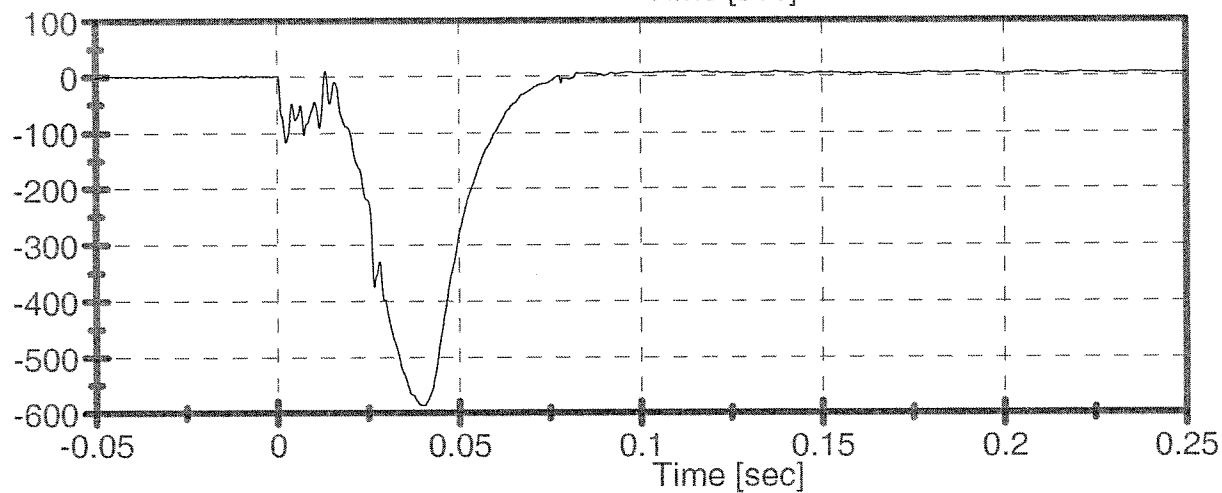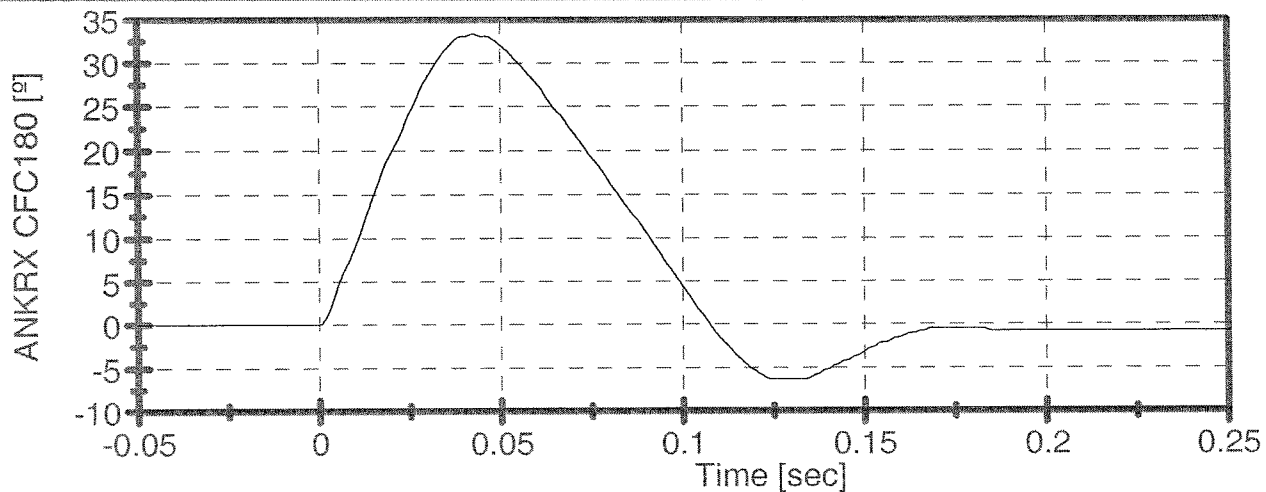

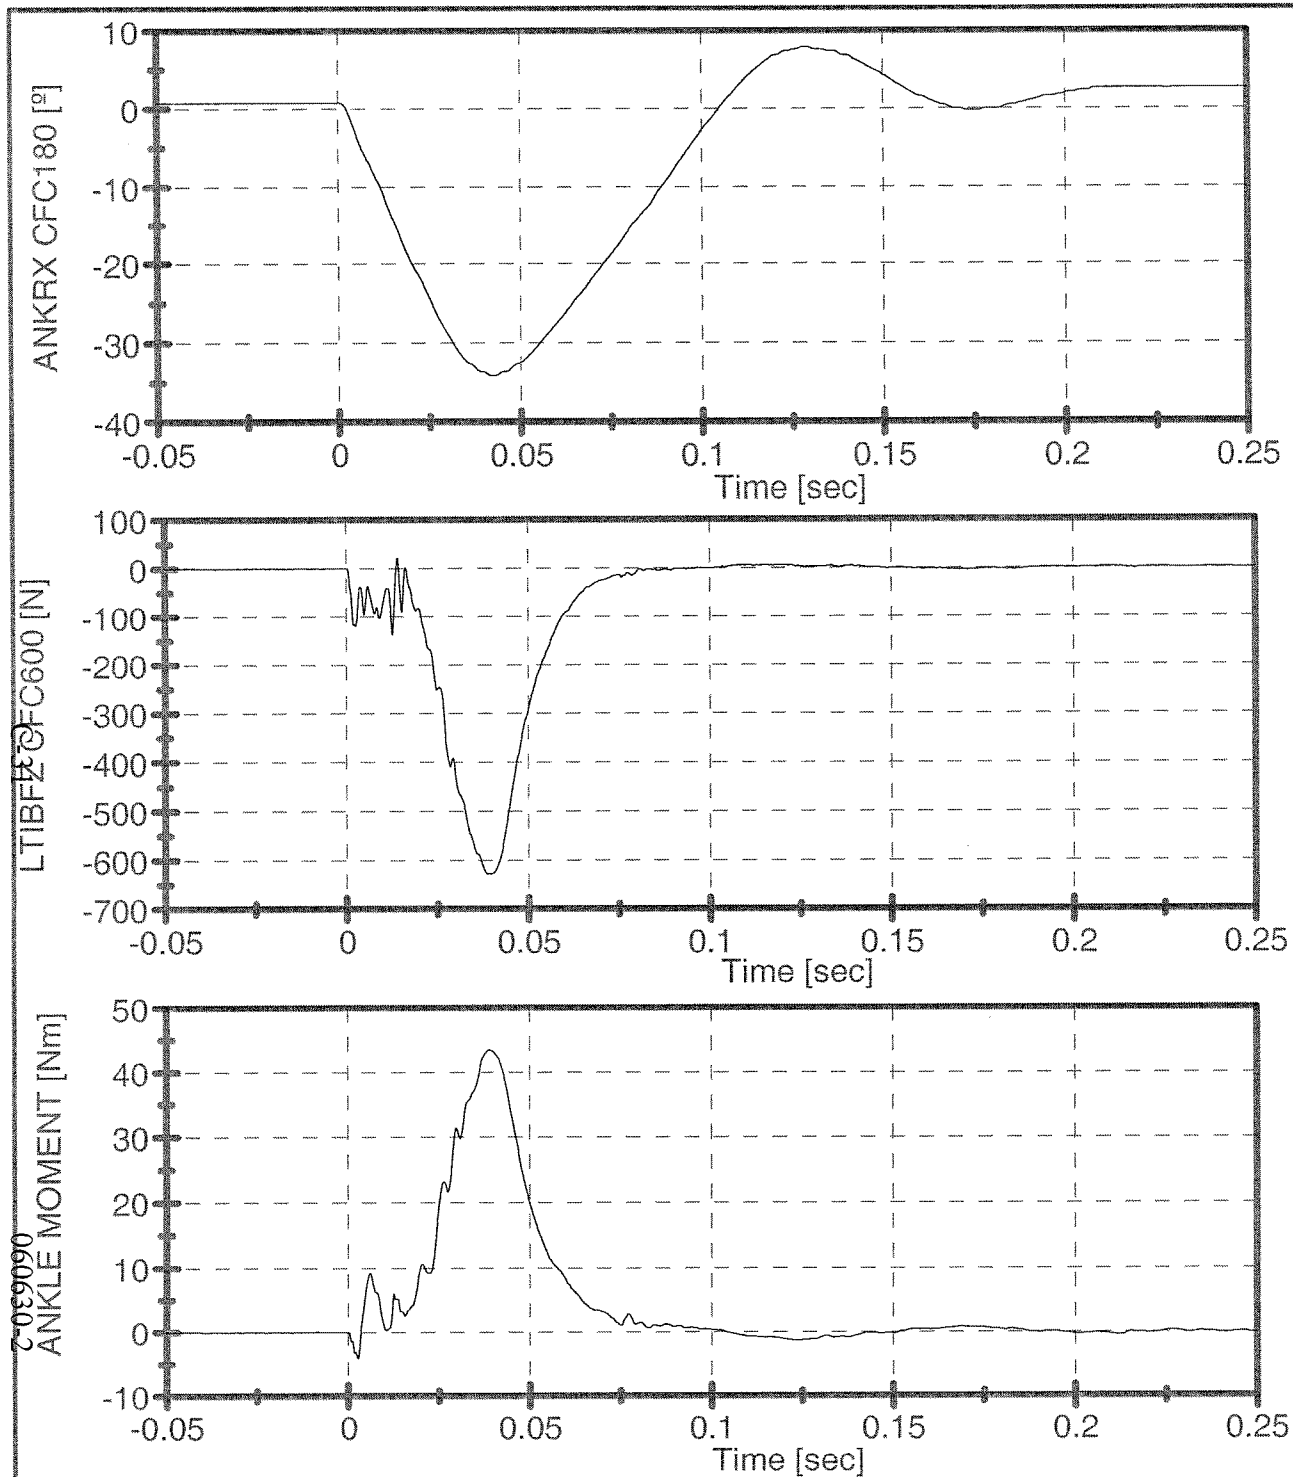

Min = -34.1048787127703

Max = 7.90503396601157

Min = -628.14108606457


Max = 22.5522632446148

Min = -4.06126125463868

Max = 43.5382923401219

LX0046DEC012005EVER_01

LX0046DEC012005HEEL_05

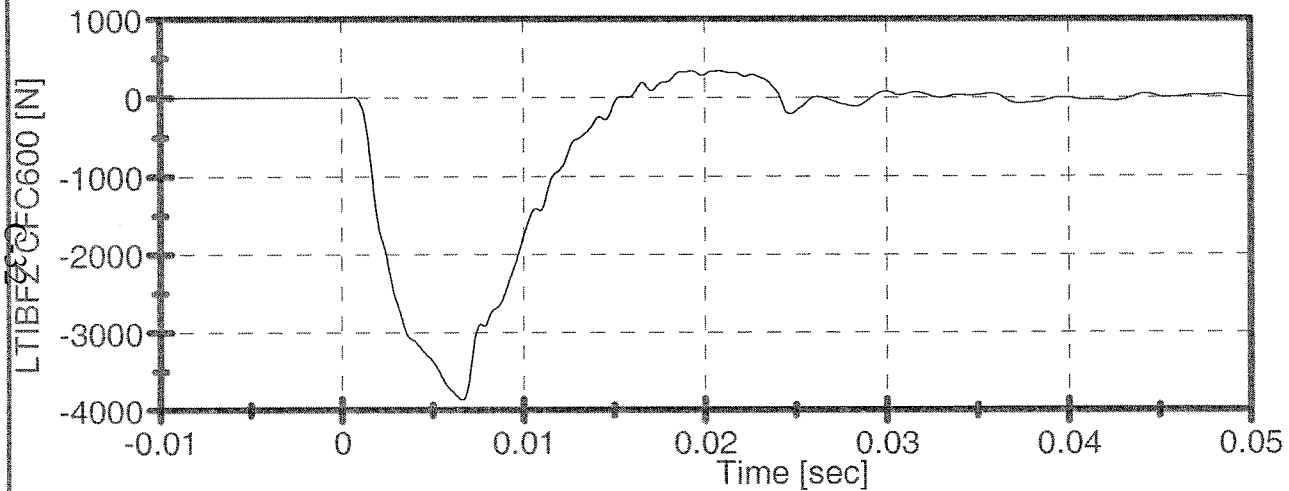

Min = -3864.23552407864

Max = 338.175272393699

Transportation Research Center Inc.
Hybrid III Dummy Pre-Use Inspection

Type: HIII 50th S/N: 202 Mfg.: ASTC Test Date: 06/30/06
 Proj./Seg. No.: 20040479-1060 Test Eng. William Millis

ITEM	PRE-USE
HEAD:	
Skull Cap Bolts	X
Head Skin Condition	X
Accel. Cable Exit (left or right)	X
NECK:	
* Bracket at specified setting, Serration Alignment, Bolt	N/A
* Condyle Pin, Set Screws	X
* Rubber Condition	X
* Neck Cable Torque (5 th /50 th /95 th : 10 – 14 in-lb / 6YO 1.8 – 2.2 in-lb) Actual: 11	X
* Nodding Blocks Condition and Position	X
ARMS AND HANDS:	
Clavicle and Shoulder Bumpers Condition	X
Range of Motion Stops: Elbow, Top and Rear Shoulder	X
THORAX:	
Front and Rear Rib Bolts, Rib Ends Position, Rib Spacing	X
Chest Pot Arm, Ball Movement, Set Screws	X
Sternum Bolts and Sternum Bumpers Condition	X
Jacket Condition	X
Abdominal Insert Condition	X
Rib Damping Material and Stiffeners Condition	X
Accel. Mount Bolts	X
Lumbar Spine Rubber Condition, Spine Angle, (4) Attachment Bolts	X
PELVIS:	
Iliac Crest Bone	X
Flesh Condition	X
Accel. Mount Bolt	X
Lumbar Block Bolts	X
LEGS AND FEET:	
* Femur Load Cell Bolts (5 th /50 th /95 th : 30 ft-lb / 6YO: 16 ft-lb)	X
Knee Joint Function and Range of Motion	X
Knee Skins, Inserts and Castings Condition	X
Knee Slider Zero Position	X
Ankle Range of Motion, Bumper Condition	X
Foot Condition	X
OTHER:	
Cleanliness / Skin Condition & Position	X
Target Position	X
Clothes Blue	X
Shoes	X
One G Joint Adjustments	X
Check connectors for integrity (intact & labeled)	X
Verify channels against assembly	X
ATTACH TEMPERATURE LOGGER TO DUMMY	X

* Items to be checked during calibration.

Inspection Completed By: Ron Stoner

Date: 06/29/06

Transportation Research Center Inc.

Hybrid III Dummy Post-Use Inspection

Type: HIII 50th S/N: 202 Mfg.: ASTC Test Date: 06/30/06
 Proj./Seg. No.: 20040479-1060 Test Eng. William Millis

ITEM	POST-USE
HEAD:	
Head Skin Condition	X
NECK:	
Rubber Condition	X
Nodding Blocks Condition and Position	X
Nodding Joint Function (no lateral motion)	X
Adjustable (upper and lower) Neck Bracket	X
ARMS AND HANDS:	
Skin Condition	X
THORAX:	
Jacket Condition	X
Rib Damping Material and Stiffeners Condition	X
Chest Pot Arm and Ball Movement	X
Spine Condition	X
Sternum Assembly Condition	X
PELVIS:	
Flesh Condition	X
Iliac Crest Bone	X
Range of Motion Bumpers and Leg Cavity	X
LEGS AND FEET:	
Knee Skins, Inserts, and Castings Condition	X
Leg Skin Condition and Position	X
Foot Condition	X
Temperature Data	
Download temperature data logger	X

NOTES: No damage found.

Inspection Completed By: Ron Stoner Date: 07/13/06

Appendix D

Customer Provided Seating Procedure

A.2 Driver side (with Brake and clutch pedals in place while avoiding pedal interaction)

- ___1. Position the seat's adjustable lumbar supports so that the lumbar supports are in the lowest, retracted or deflated adjustment positions. (S16.2.10.1, S20.1.9.1, S20.4.1, S22.1.7.1)
___ N/A – No lumbar adjustment
- ___2. Position any adjustable parts of the seat that provide additional support so that they are in the lowest or most open adjustment position. (S16.2.10.2, S20.1.9.2, S20.4.1, S22.1.7.1, S22.4.2.1, S22.4.3.1, S24.4.2.1, S26.2.3, S26.3.1)
___ N/A – No additional support adjustment
- ___3. Position an adjustable leg support system in its rearmost position. (8/27/04 interpretation to Toyota)
___ N/A – No adjustable leg support system
- ___4. Mark a point (seat cushion reference point) on the side of the seat cushion that is between 150 mm and 250 mm from the front edge of the seat cushion. (S16.3.1.12)
- ___5. Draw a line (seat cushion reference line) through the seat cushion reference point. (S16.3.1.13)
- ___6. Use only the controls that primarily move the seat in the fore-aft direction to move the seat cushion reference point to the rearmost position. (S16.2.10.3.1, S22.1.7.3)
- ___7. If the seat cushion adjusts fore-aft, independent of the seat back, use only the controls that primarily move the seat cushion in the fore-aft direction to move the seat cushion reference point to the rearmost position. (S16.2.10.3.1, S20.1.9.3)
___ N/A – No independent fore-aft seat cushion adjustment
- ___8. Use any part of any control, other than the parts just used for fore-aft positioning, to determine the range of angles of the seat cushion reference line and to set the seat cushion reference line at the mid-angle. (S16.2.10.3.1)
Maximum angle _____
Minimum angle _____
Mid-angle _____
- ___9. If the seat and/or seat cushion height is adjustable, use any part of any control other than the parts which primarily move the seat or seat cushion fore-aft, to put the seat cushion reference point in its lowest position with the seat cushion reference line angle at the mid-angle found in 8. (S16.2.10.3.1)
___ N/A – No seat height adjustment
- ___10. Use only the controls that primarily move the seat in the fore-aft direction to verify the seat is in the rearmost position.
- ___12. Use only the controls that primarily move the seat in the fore-aft direction to place the seat in the rearmost position.
- ___14. Visually mark for future reference the seat back angle at the manufacturer's nominal design riding position for a 50th percentile adult male in the manner specified by the manufacturer for the rearmost seat position. (S20.1.9.5, S22.1.7.5, S22.4.2.1, S22.4.3.1, S24.1.2, S24.4.2.1, S26.2.3, S26.3.1)
___ N/A – No seat back angle adjustment
Manufacturer's design seat back angle _____
- ___15. Is the seat a bucket seat?
___ Yes, go to 16 and skip 17
___ No, go to 17 and skip 16
- ___16. Bucket seats:
Locate and mark for future reference the longitudinal centerline of the seat cushion. The intersection of the vertical longitudinal plane that passes through the SgRP and the seat cushion upper surface determines the longitudinal centerline of a bucket seat cushion. (S16.3.1.10 & S20.1.10)
- ___17. Bench seats
Locate and mark for future reference the longitudinal line on the seat cushion that marks

- the intersection of the vertical longitudinal plane through the centerline of the steering wheel and the seat cushion upper surface.
- ___18. Head Restraint Position
 - ___N/A Vehicle contains automatic head restraints.
 - ___N/A, there is no head restraint adjustment
 - ___Adjust the head restraint to its highest position. (S8.1.3)
 - ___19. Place any adjustable seat belt anchorages at the vehicle manufacturer's nominal design position for a 50th percentile adult male occupant (S8.1.3)
 - ___N/A – No adjustable upper seat belt anchorage
 - Manufacturer's specified anchorage position. _____
 - Tested anchorage position _____
 - ___20. Place adjustable pedals in the full forward position (towards the front of the vehicle.)
 - ___N/A – the pedals are not adjustable.
 - ___21. Locate and mark the right heel point (RHP) on the carpet.

Flat accelerator pedals: Extend a line through the axis of symmetry (that is closest to the vertical plane) of the accelerator pedal. The RHP is the intersection of that line with the floorpan.

Curved accelerator pedals: Construct a line in the side view tangent to the accelerator pedal such that the distance from the contact point on the pedal to the floorpan, along the tangent line, is 200 mm. The RHP is at the intersection of this tangent line and the floorpan
 - ___22. Locate a longitudinal line L1 and a transverse line T1 on the floorpan through the RHP. Locate a Left Heel Point (LHP) point on the line T1 that is to the left of the seat centerline at the same distance from the seat centerline as the RHP. Locate a longitudinal line L2 through the LHP.
 - ___23. Set the steering wheel hub at the geometric center of the full range of driving positions including any telescoping positions as determined in data sheet 14.3.
 - ___24. Verify that the seat is in the rearmost seat track position and full down height adjustment with the seat cushion at the mid-angle with the seat back at the manufacturer's nominal seat back angle.
 - ___25. With the seat in the rearmost, full down, mid-angle position, determine the H-point using SAE J826 and the FMVSS 208 leg and thigh dimensions.
 - ___26. Place the dummy in the seat such that the midsagittal plane is coincident with the longitudinal seat cushion markings and the upper torso resting against the seat back. (S10.4.1.1 & S10.4.1.2)
 - ___27. Rest the thighs on the seat cushion. (S10.5)
 - ___28. Set the distance between the outboard knee clevis flange surfaces at 10.6 inches.
 - ___measured distance (10.6 inches) (S10.5)
 - ___29. Set the heels of the feet on the floor pan.
 - ___30. Position the H-point of the dummy within 0.5 inch of the vertical dimension and 0.5 inch of the horizontal dimension of a point 0.25 inch below the H-point determined in Data Sheet 15. (S10.4.2.1)

Then measure the pelvic angle with respect to the horizontal using the pelvic angle gage. Adjust the dummy position until these three measurements are within the specifications. (S10.4.2.1 and S10.4.2.2)

 - ___horizontal inches from the point 0.25 below the determined H-point (0.5 inch max.) (S10.4.2.1)
 - ___vertical inches from the point 0.25 below the determined H-point (0.5 inch max.) (S10.4.2.1)
 - ___pelvic angle (20° to 25°)

The H-point and pelvic angle are not adjusted after this step.
 - ___31. Set the left and right feet in the neutral position (longitudinal centerline of foot in the same plane as the lower leg/thigh, foot at -15 degrees +/- 2 degrees to lower leg), as determined by the output of the potentiometers at the ankle.
 - ___32. Without moving the seat, and while keeping the right thigh and leg in the same vertical plane, set the right foot heel on Line L1.

- ___ 32.1. Without moving the seat, and while keeping the left thigh and leg in the same vertical plane, move the left foot laterally to the left until
- The right edge of the foot is clear of the brake or clutch pedal by 0.25" laterally
 - The left heel is on Line L2
 - The left edge of the shoe contacts the vehicle interior
- whichever occurs first.
- ___ 33. Place a 100 N +0, -5N weight (e.g. 100 N shot bag), no larger than 4" x 4", on each knee-
- ___ 34. Raise the heels off the floor pan so that the seat can be moved forward.
- ___ 35. Using only the control that primarily moves the seat in the fore-aft direction, move the seat forward and rest the rearmost point of the right foot heel on the floor pan such that:
- the heel is on the line L1
 - the foot is in the same plane as the lower leg/thigh, foot at -15 degrees +/- 2 degrees (about the Y- axis) to lower leg,
 - foot is contacting the accelerator pedal
 - the thighs are resting on the seat cushion
 - the thigh, leg and foot are in the same vertical plane
- If the heel is unable to reach line L1 because the foot contacts the vehicle interior, place the foot as close to the line L1 as possible while maintaining a gap of no more than 5 mm between the shoe and the vehicle interior.
- If the left foot contacts the brake or clutch pedals or the vehicle interior, then stop the forward movement of the left foot, raising the left knee off the seat cushion if needed. The pedals should not be depressed.
- ___ 36. If the right foot does not reach the accelerator pedal, move the adjustable pedal until it contacts the foot. Locate a new heel point. Repeat steps 21 – 35 to re-position the seat. If the pedals are not adjustable, place the heel at the point closest to the pedal, in the same longitudinal vertical plane as the line L1.
- ___ N/A – the accelerator pedal is not adjustable
 - ___ N/A – the accelerator pedal did not need to be moved.
- ___ 37. Verify that the left thigh and leg are in a vertical longitudinal plane, the foot in the neutral position (longitudinal centerline of foot in the same plane as the lower leg/thigh, foot at -15 degrees +/- 2 degrees (Y-axis) to lower leg), the heel on the floor pan, and the heel is on the line L2, unless the left edge of the shoe contacts the vehicle, preventing the heel from reaching Line L2.
- ___ 38. Remove the leg weights.
- ___ 39. Verify that the right foot is in the neutral position and is contacting the accelerator pedal. If the foot is not contacting the accelerator pedal, move the seat forward to rest the right foot on the accelerator pedal, keeping the foot in the neutral position
- ___ 40. While holding the thighs in place, push with a 50 lb force on a 3 inch diameter area of the chest that is centered 5" (127mm) vertically below the chin on the midsagittal plane of the dummy.
- ___ 41.1 Fasten the seat belt around the dummy.
- ___ 41.2 Remove all slack from the lap belt portion. (S10.9)
- ___ 41.3 Pull the upper torso webbing out of the retractor and allow it to retract; repeat this four times. (S10.9)
- ___ 41.4 Apply a 2 to 4 pound tension load to the lap belt. (S10.9)
- ___ pound load applied
- ___ 41.5 Is the belt system equipped with a tension-relieving device?
- ___ Yes, continue
 - ___ No, go to 42
- ___ 41.6 Introduce the maximum amount of slack into the upper torso belt that is recommended by the vehicle manufacturer in the vehicle owner's manual. (S10.9).
- ___ 42. Place the upper arms adjacent to the torso with the centerline as close to a vertical plane as possible. (S10.2.1)
- ___ 43. Adjust the head level within ± 0.5 degrees using the seat back adjustment. Check the head angle after pushing on the chest with a 50 lb force on a 3 inch diameter area of the

- the chest that is centered 5" (127mm) vertically below the chin on the midsagittal plane of dummy, while holding the thighs in place, and releasing.
- ___43.1 No seat back adjustment. Adjust the neck bracket to achieve head level within ± 0.5 degrees. Record neck bracket setting. _____
 - ___44. Maintaining the head alignment as determined above, place the right hand with the palm in contact with the steering wheel at the rim's horizontal centerline and with the thumb over the steering wheel. (S10.3.1)
 - ___45. Maintaining the head alignment as determined above place the left hand with the palm in contact with the steering wheel at the rim's horizontal centerline and with the thumb over the steering wheel. (S10.3.1)
 - ___46. If the hands don't reach the steering wheel at the horizontal centerline, maintaining the head alignment place them at symmetric location on the wheel, below the horizontal centerline.
 - ___47. Tape the thumb of each hand to the steering wheel by using masking tape with a width of 0.25 inch. The length of the tape shall only be enough to go around the thumb and steering wheel one time.
 - ___48. Verify that the feet are in the neutral position (± 2 deg) and the head is level (± 0.5 deg). Adjust and repeat until the feet and head angles are within this range.

Appendix E

Test Equipment and Instrumentation Information

Sign Convention
SAE J211 MAR95

Accelerometers:

+X: Forward
+Y: Rightward
+Z: Downward

Potentiometers:

+Chest longitudinal deflection: Outward
+Chest lateral deflection: Rightward
+Seat belt displacement: Outward
+Seat belt extension: Elongation
+Knee slider displacement: Distance between femur and tibia increased (in relation to a seated dummy)

Rotation potentiometers:

+About the X-axis: Left foot-eversion
Right foot-inversion
+About the Y-axis: Left/right foot-dorsiflexion
+About the Z-axis: Left foot-internal
Right foot-external

Load cells:

+Femur force: Tension
+Seat belt force: Tension
+Barrier force: Tension

Neck load cells:

+X force: Head pushed rearward
+Y force: Head pushed leftward
+Z force: Head pulled upward (tension on neck)
+X moment: Left ear rotating toward left shoulder
+Y moment: Chin rotating toward chest
+Z moment: Chin rotating toward left shoulder

Tibia load cells:

+X force: Ankle forward, knee rearward
+Y force: Ankle rightward, knee leftward
+Z force: Tension
+X moment: Bottom of tibia moving leftward
+Y moment: Bottom of tibia moving rearward

Frequency Response Classes
SAE J211 MAR95

<u>Typical Test Measurements</u>	<u>Channel Class</u>
Vehicle Structural Accelerations for use in:	
Total vehicle comparison	60
Collision simulation input	60
Component analysis	600
Integration for velocity or displacement	180
Barrier Face Forces	60
Belt Restraint System Loads	60
Anthropomorphic Test Device	
Head accelerations (linear and angular)	1000
Neck	
Forces	1000
Moments	600
Thorax	
Spine accelerations	180
Rib accelerations	1000
Sternum accelerations	1000
Deflections	600
Lumbar	
Forces	1000
Moments	1000
Pelvis	
Accelerations	1000
Forces	1000
Moments	1000
Femur/Knee/Tibia/Ankle	
Forces	600
Moments	600
Displacements	180
Sled Accelerations	60
Steering Column Loads	600
Head form Accelerations	1000

The direction column on the following sheets describes the transducer output as mounted and wired in the test location. The polarity column indicates whether a polarity change occurred during data acquisition to conform to J211 MAR95. See Report Sign Convention sheet for description of data output as presented in the report: occasionally channels have been adjusted in post-acquisition processing to conform to J211 MAR95.

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS		Assembly
						Flip	Positive Polarity	
1	Trig D1	0ZERO00000VO0A?	EVENT		1 Logic	+	Bipolar	
2	05G15-L07	11HEADCG00H3ACXA	Head Accel X	1000	g	+	Forward	1-202 HIII 50th ASTC.001
3	03E03E18-F05	11HEADCG00H3ACYA	Head Accel Y	1000	g	-	Leftward	1-202 HIII 50th ASTC.002
4	05I07-Z17	11HEADCG00H3ACZA	Head Accel Z	1000	g	-	Upward	1-202 HIII 50th ASTC.003
5	03E03E18-F10	11HEADCGRDH3ACXA	Head Accel X Red	1000	g	+	Forward	1-202 HIII 50th ASTC.004
6	01G25-N10	11HEADCGRDH3ACYA	Head Accel Y Red	1000	g	-	Leftward	1-202 HIII 50th ASTC.005
7	02I02I16-A12	11HEADCGRDH3ACZA	Head Accel Z Red	1000	g	-	Upward	1-202 HIII 50th ASTC.006
8	05G20-L21	11HEADFR00H3ACYA	Head (FT) Accel Y	1000	g	-	Leftward	1-202 HIII 50th ASTC.007
9	05H25-L15	11HEADFR00H3ACZA	Head (FT) Accel Z	1000	g	-	Upward	1-202 HIII 50th ASTC.008
10	05I07-Z05	11HEADUP00H3ACXA	Head (TP) Accel X	1000	g	+	Forward	1-202 HIII 50th ASTC.009
11	05G20-L01	11HEADUP00H3ACYA	Head (TP) Accel Y	1000	g	-	Leftward	1-202 HIII 50th ASTC.010
12	05G29-X51	11HEADLE00H3ACXA	Head (LT) Accel X	1000	g	+	Forward	1-202 HIII 50th ASTC.011
13	05G20-L18	11HEADLE00H3ACZA	Head (LT) Accel Z	1000	g	-	Upward	1-202 HIII 50th ASTC.012
14	1716A-1872-FX	11NECKUP00H3FOXA	Neck Force X	8896	N	-	Head forward, chest rearward	1-202 HIII 50th ASTC.013
15	1716A-1872-FY	11NECKUP00H3FOYA	Neck Force Y	8896	N	+	Head leftward, chest rightward	1-202 HIII 50th ASTC.014
16	1716A-1872-FZ	11NECKUP00H3FOZA	Neck Force Z	13344	N	+	Head upward, chest downward	1-202 HIII 50th ASTC.015
17	1716A-1872-MX	11NECKUP00H3MOXA	Neck Moment X	282	N·m	-	Right ear toward right shoulder	1-202 HIII 50th ASTC.016
18	1716A-1872-MY	11NECKUP00H3MOYA	Neck Moment Y	282	N·m	+	Chin toward sternum	1-202 HIII 50th ASTC.017
19	1716A-1872-MZ	11NECKUP00H3MOZA	Neck Moment Z	282	N·m	+	Chin toward left shoulder	1-202 HIII 50th ASTC.018
20	1794S-078-FX	11NECKLO00H3FOXA	Neck Lower Force X	13344	N	+	Head rearward, chest forward	1-202 HIII 50th ASTC.019
21	1794S-078-FY	11NECKLO00H3FOYA	Neck Lower Force Y	13344	N	+	Head leftward, chest rightward	1-202 HIII 50th ASTC.020
22	1794S-078-FZ	11NECKLO00H3FOZA	Neck Lower Force Z	13344	N	+	Head upward, chest downward	1-202 HIII 50th ASTC.021
23	1794S-078-MX	11NECKLO00H3MOXA	Neck Lower Moment X	452	Nm	+	Left ear toward left shoulder	1-202 HIII 50th ASTC.022
24	1794S-078-MY	11NECKLO00H3MOYA	Neck Lower Moment Y	452	Nm	+	Chin toward sternum	1-202 HIII 50th ASTC.023
25	1794S-078-MZ	11NECKLO00H3MOZA	Neck Lower Moment Z	452	Nm	+	Chin toward left shoulder	1-202 HIII 50th ASTC.024
26	03E03E02-N01	11CHSTCG00H3ACXA	Chest Accel X	1000	g	+	Forward	1-202 HIII 50th ASTC.025
27	03E03E02-N06	11CHSTCG00H3ACYA	Chest Accel Y	1000	g	-	Leftward	1-202 HIII 50th ASTC.026
28	03E03E02-N02	11CHSTCG00H3ACZA	Chest Accel Z	1000	g	-	Upward	1-202 HIII 50th ASTC.027
29	02I02I05-F02	11CHSTCGRDH3ACXA	Chest Accel X Red.	1000	g	-	Rearward	1-202 HIII 50th ASTC.028
30	03E03E02-N04	11CHSTCGRDH3ACYA	Chest Accel Y Red.	1000	g	-	Leftward	

E-5

060630-2

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FS	Scale	Units	DAS		Assembly
							Flip	Positive Polarity	
31	03E03E02-N15	11CHSTCGRDH3ACZA	Chest Accel Z Red.	1000	g	-	-	Upward	1-202 HIII 50th ASTC.030
32	CST202	11CHST0000H3DSXA	Chest Deflection X	84	mm	+	+	Forward	1-202 HIII 50th ASTC.031
33	2121AJ-1520	11FEMRLL00H3FOZA	Left Femur Force Z	13344	N	+	+	Knee forward, pelvis rearward	1-202 HIII 50th ASTC.032
34	2121AJ-1517	11FEMRRL00H3FOZA	Right Femur Force Z	13344	N	+	+	Knee forward, pelvis rearward	1-202 HIII 50th ASTC.052
35	150-0121VR-018026	11KNSLLE00H3DSXA	Left Knee Displacement X	40	mm	-	-	Hold femur in place, tibia rearward	1-202 HIII 50th ASTC.033
36	4509J-107-FX	11TIBILULXH3FOXA	Left Upper Tibia Force X	11120	N	+	+	Tibia forward, knee rearward	1-202 HIII 50th ASTC.034
37	4509J-107-FZ	11TIBILULXH3FOZA	Left Upper Tibia Force Z	11120	N	+	+	Tibia downward, femur upward	1-202 HIII 50th ASTC.036
38	4509J-107-MX	11TIBILULXH3MOXA	Left Upper Tibia Moment X	395	Nm	+	+	Ankle leftward, hold knee in place	1-202 HIII 50th ASTC.037
39	4509J-107-MY	11TIBILULXH3MOYA	Left Upper Tibia Moment Y	395	Nm	+	+	Ankle forward, hold knee in place	1-202 HIII 50th ASTC.038
40	01G18-F15	11TIBILELXH3ACXA	Left Tibia Accel X	1000	g	+	+	Tibia forward	1-202 HIII 50th ASTC.039
41	05I07-Z13	11TIBILELXH3ACYA	Left Tibia Accel Y	1000	g	+	+	Tibia right	1-202 HIII 50th ASTC.040
42	4929J-139-FX	11TIBILLXH3FOXA	Left Lower Tibia Force X	11120	N	+	+	Ankle forward, knee rearward	1-202 HIII 50th ASTC.041
43	4929J-139-FY	11TIBILLXH3FOYA	Left Lower Tibia Force Y	11120	N	+	+	Ankle rightward, knee leftward	1-202 HIII 50th ASTC.042
44	4929J-139-FZ	11TIBILLXH3FOZA	Left Lower Tibia Force Z	11120	N	+	+	Ankle downward, knee upward	1-202 HIII 50th ASTC.043
45	4929J-139-MX	11TIBILLXH3MOXA	Left Lower Tibia Moment X	395	Nm	+	+	Ankle leftward, hold knee in place	1-202 HIII 50th ASTC.044
46	4929J-139-MY	11TIBILLXH3MOYA	Left Lower Tibia Moment Y	395	Nm	+	+	Ankle forward, hold knee in place	1-202 HIII 50th ASTC.045
47	PD210-4B-426	11FOOTLELXH3ANXA	Left Foot Angular Dis. X	318	°	-	-	Inversion	1-202 HIII 50th ASTC.046
48	PD210-4B-424	11FOOTLELXH3ANYA	Left Foot Angular Dis. Y	318	°	+	+	Dorsiflexion	1-202 HIII 50th ASTC.047
49	PD210-4B-423	11FOOTLELXH3ANZA	Left Foot Angular Dis. Z	318	°	-	-	External rotation	1-202 HIII 50th ASTC.048
50	05G20-L14	11FOOTLELXH3ACXA	Left Foot Accel X	1000	g	+	+	Foot forward	1-202 HIII 50th ASTC.049
51	05G20-L12	11FOOTLELXH3ACYA	Left Foot Accel Y	1000	g	+	+	Foot rightward	1-202 HIII 50th ASTC.050
52	06A04-R12	11FOOTLELXH3ACZA	Left Foot Accel Z	1000	g	+	+	Foot down	1-202 HIII 50th ASTC.051
53	150-0121VL-33646	11KNSLRI00H3DSXA	Right Knee Displacement X	40	mm	-	-	Hold femur in place, tibia rearward	1-202 HIII 50th ASTC.053

E-6

060630-2

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS Flip	Positive Polarity	Assembly
54	4509J-104-FX	11TIBIRULXH3FOXA	Right Upper Tibia Force X	11120	N	+	Tibia forward, knee rearward	1-202 HIII 50th ASTC.054
55	4509J-104-FZ	11TIBIRULXH3FOZA	Right Upper Tibia Force Z	11120	N	+	Tibia downward, femur upward	1-202 HIII 50th ASTC.056
56	4509J-104-MX	11TIBIRULXH3MOXA	Right Upper Tibia Moment X	395	Nm	+	Ankle leftward, hold knee in place	1-202 HIII 50th ASTC.057
57	4509J-104-MY	11TIBIRULXH3MOYA	Right Upper Tibia Moment Y	395	Nm	+	Ankle forward, hold knee in place	1-202 HIII 50th ASTC.058
58	05G20-L06	11TIBIRILXH3ACXA	Right Tibia Accel X	1000	g	+	Tibia forward	1-202 HIII 50th ASTC.059
59	05I07-Z23	11TIBIRILXH3ACYA	Right Tibia Accel Y	1000	g	+	Tibia right	1-202 HIII 50th ASTC.060
60	4929J-138-FX	11TIBIRLLXH3FOXA	Right Lower Tibia Force X	11120	N	+	Ankle forward, knee rearward	1-202 HIII 50th ASTC.061
61	4929J-138-FY	11TIBIRLLXH3FOYA	Right Lower Tibia Force Y	11120	N	+	Ankle rightward, knee leftward	1-202 HIII 50th ASTC.062
62	4929J-138-FZ	11TIBIRLLXH3FOZA	Right Lower Tibia Force Z	11120	N	+	Ankle downward, knee upward	1-202 HIII 50th ASTC.063
63	4929J-138-MX	11TIBIRLLXH3MOXA	Right Lower Tibia Moment X	395	Nm	+	Ankle leftward, hold knee in place	1-202 HIII 50th ASTC.064
64	4929J-138-MY	11TIBIRLLXH3MOYA	Right Lower Tibia Moment Y	395	Nm	+	Ankle forward, hold knee in place	1-202 HIII 50th ASTC.065
65	PD210-4B-427	11FOOTRILXH3ANXA	Right Foot Angular Dis. X	318	°	-	Eversion	1-202 HIII 50th ASTC.066
66	PD210-4B-425	11FOOTRILXH3ANYA	Right Foot Angular Dis. Y	318	°	+	Dorsiflexion	1-202 HIII 50th ASTC.067
67	PD210-4B-422	11FOOTRILXH3ANZA	Right Foot Angular Dis. Z	318	°	-	Internal rotation	1-202 HIII 50th ASTC.068
68	05I07-Z07	11FOOTRILXH3ACXA	Right Foot Accel X	1000	g	+	Foot forward	1-202 HIII 50th ASTC.069
69	05H31-Z12	11FOOTRILXH3ACYA	Right Foot Accel Y	1000	g	+	Foot rightward	1-202 HIII 50th ASTC.070
70	05G20-L03	11FOOTRILXH3ACZA	Right Foot Accel Z	1000	g	+	Foot down	1-202 HIII 50th ASTC.071
71	P50613	14CRME000000ACXA	Left Rear Seat Cross-member X-axis Acceleration	1000	g	+	Forward	
72	P50875	16CRME000000ACXA	Right Rear Seat Cross-member X-axis Acceleration	1000	g	+	Forward	
73	P50965	14CRME000000ACYA	Left Rear Seat Cross-member Y-axis Acceleration	1000	g	-	Leftward	
74	P50865	16CRME000000ACYA	Right Rear Seat Cross-member Y-axis Acceleration	1000	g	-	Leftward	
75	P49647	12ENGNTPO0000ACXA	Top of Engine Block X-axis acceleration	1500	g	+	Forward	
76	P50849	12ENGNB00000ACXA	Bottom of Engine Block X-axis acceleration	1500	g	-	Rearward	
77	P50908	13VEHCRI0000ACXA	Right Brake Caliper X-axis Acceleration	1500	g	-	Rearward	
78	P50961	11VEHCLE0000ACXA	Left Brake Caliper X-axis Acceleration	1500	g	-	Rearward	
79	P50291	12DASH000000ACXA	Instrumnet Pannel X-axis Acceleration	1500	g	-	Rearward	
80	P25259	11SETR000000ACXA	Left Side Driver Mid Seat Track X-axis Acceleration	1500	g	+	Forward	
81	P50432	10VEHCCG0000ACXA	Vehicle CG X-axis acceleration	1000	g	+	Forward	
82	P50305	10VEHCCG0000ACYA	Vehicle CG Y-axis acceleration	1000	g	-	Leftward	

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS		Assembly
						Flip	Positive Polarity	
83	P50873	10VEHCCG0000ACZA	Vehicle CG Z-axis acceleration	1000	g	-	Upward	
84	3419-835	11SEBE0000B5FOOA	Driver lap belt	15568	N	+	Tension	
85	3419-837	11SEBE0000B3FOOA	Driver shoulder belt	15568	N	+	Tension	
86	ABFire1	11AIRBFR0100EV0A	DRIV. FRONT AIRBAG1 IND (IP 36)	5	V	+	Bipolar	
87	ABFire2	11AIRBFR0200EV0A	DRIV. FRONT AIRBAG2 IND (IP 112)	5	V	+	Bipolar	
88	476830002	L0FBAR000001FOXA	Load Cell Row 1 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.001
89	476830008	L0FBAR000002FOXA	Load Cell Row 2 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.002
90	476830086	L0FBAR000003FOXA	Load Cell Row 3 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.003
91	476830071	L0FBAR000004FOXA	Load Cell Row 4 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.004
92	476830044	L0FBAR000005FOXA	Load Cell Row 5 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.005
93	476830038	L0FBAR000006FOXA	Load Cell Row 6 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.006
94	476830036	L0FBAR000007FOXA	Load Cell Row 7 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.007
95	476830082	L0FBAR000008FOXA	Load Cell Row 8 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.008
96	476830065	L0FBAR000009FOXA	Load Cell Row 9 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.009
97	476830068	L0FBAR000010FOXA	Load Cell Row 10 Column 1	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.010
98	476830069	L0FBAR000011FOXA	Load Cell Row 1 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.011
99	476830080	L0FBAR000012FOXA	Load Cell Row 2 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.012
100	476830023	L0FBAR000013FOXA	Load Cell Row 3 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.013
101	476830012	L0FBAR000014FOXA	Load Cell Row 4 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.014
102	476830015	L0FBAR000015FOXA	Load Cell Row 5 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.015
103	476830043	L0FBAR000016FOXA	Load Cell Row 6 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.016
104	476830088	L0FBAR000017FOXA	Load Cell Row 7 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.017
105	476830017	L0FBAR000018FOXA	Load Cell Row 8 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.018

E-8

060630-2

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS		Assembly
						Flip	Positive Polarity	
106	476830034	L0FBAR000019FOXA	Load Cell Row 9 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.019
107	476830007	L0FBAR000020FOXA	Load Cell Row 10 Column 2	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.020
108	476830018	L0FBAR000021FOXA	Load Cell Row 1 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.021
109	476830016	L0FBAR000022FOXA	Load Cell Row 2 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.022
110	476830089	L0FBAR000023FOXA	Load Cell Row 3 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.023
111	476830026	L0FBAR000024FOXA	Load Cell Row 4 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.024
112	476830009	L0FBAR000025FOXA	Load Cell Row 5 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.025
113	476830067	L0FBAR000026FOXA	Load Cell Row 6 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.026
114	476830051	L0FBAR000027FOXA	Load Cell Row 7 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.027
115	476830003	L0FBAR000028FOXA	Load Cell Row 8 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.028
116	476830021	L0FBAR000029FOXA	Load Cell Row 9 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.029
117	476830013	L0FBAR000030FOXA	Load Cell Row 10 Column 3	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.030
118	476830019	L0FBAR000031FOXA	Load Cell Row 1 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.031
119	476830042	L0FBAR000032FOXA	Load Cell Row 2 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.032
120	476830070	L0FBAR000033FOXA	Load Cell Row 3 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.033
121	476830075	L0FBAR000034FOXA	Load Cell Row 4 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.034
122	476830063	L0FBAR000035FOXA	Load Cell Row 5 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.035
123	476830027	L0FBAR000036FOXA	Load Cell Row 6 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.036
124	476830052	L0FBAR000037FOXA	Load Cell Row 7 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.037
125	476830059	L0FBAR000038FOXA	Load Cell Row 8 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.038
126	476830029	L0FBAR000039FOXA	Load Cell Row 9 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.039

E-9

060630-2

Channel Report Test Number 060630-2

	Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS		Assembly
							Flip	Positive Polarity	
E-10	127	476830072	L0FBAR000040FOXA	Load Cell Row 10 Column 4	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.040
	128	476830028	L0FBAR000041FOXA	Load Cell Row 1 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.041
	129	476830011	L0FBAR000042FOXA	Load Cell Row 2 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.042
	130	476830053	L0FBAR000043FOXA	Load Cell Row 3 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.043
	131	476830076	L0FBAR000044FOXA	Load Cell Row 4 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.044
	132	476830049	L0FBAR000045FOXA	Load Cell Row 5 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.045
	133	476830058	L0FBAR000046FOXA	Load Cell Row 6 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.046
	134	476830048	L0FBAR000047FOXA	Load Cell Row 7 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.047
	135	476830001	L0FBAR000048FOXA	Load Cell Row 8 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.048
	136	476830006	L0FBAR000049FOXA	Load Cell Row 9 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.049
	137	476830014	L0FBAR000050FOXA	Load Cell Row 10 Column 5	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.050
	138	476830032	L0FBAR000051FOXA	Load Cell Row 1 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.051
	139	476830037	L0FBAR000052FOXA	Load Cell Row 2 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.052
	140	476830083	L0FBAR000053FOXA	Load Cell Row 3 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.053
	141	476830064	L0FBAR000054FOXA	Load Cell Row 4 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.054
	142	476830087	L0FBAR000055FOXA	Load Cell Row 5 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.055
	143	476830091	L0FBAR000056FOXA	Load Cell Row 6 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.056
060630-2	144	476830004	L0FBAR000057FOXA	Load Cell Row 7 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.057
	145	476830041	L0FBAR000058FOXA	Load Cell Row 8 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.058
	146	476830024	L0FBAR000059FOXA	Load Cell Row 9 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.059
	147	476830054	L0FBAR000060FOXA	Load Cell Row 10 Column 6	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.060

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS		Assembly
						Flip	Positive Polarity	
148	476830040	L0FBAR000061FOXA	Load Cell Row 1 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.061
149	476830005	L0FBAR000062FOXA	Load Cell Row 2 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.062
150	476830061	L0FBAR000063FOXA	Load Cell Row 3 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.063
151	476830050	L0FBAR000064FOXA	Load Cell Row 4 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.064
152	476830090	L0FBAR000065FOXA	Load Cell Row 5 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.065
153	476830073	L0FBAR000066FOXA	Load Cell Row 6 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.066
154	476830055	L0FBAR000067FOXA	Load Cell Row 7 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.067
155	476830085	L0FBAR000068FOXA	Load Cell Row 8 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.068
156	476830056	L0FBAR000069FOXA	Load Cell Row 9 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.069
157	476830084	L0FBAR000070FOXA	Load Cell Row 10 Column 7	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.070
158	476830093	L0FBAR000071FOXA	Load Cell Row 1 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.071
159	476830074	L0FBAR000072FOXA	Load Cell Row 2 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.072
160	476830047	L0FBAR000073FOXA	Load Cell Row 3 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.073
161	476830057	L0FBAR000074FOXA	Load Cell Row 4 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.074
162	476830030	L0FBAR000075FOXA	Load Cell Row 5 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.075
163	476830039	L0FBAR000076FOXA	Load Cell Row 6 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.076
164	476830025	L0FBAR000077FOXA	Load Cell Row 7 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.077
165	476830045	L0FBAR000078FOXA	Load Cell Row 8 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.078
166	476830079	L0FBAR000079FOXA	Load Cell Row 9 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.079
167	476830010	L0FBAR000080FOXA	Load Cell Row 10 Column 8	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.080
168	476830020	L0FBAR000081FOXA	Load Cell Row 1 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.081

E-11

060630-2

Channel Report Test Number 060630-2

Ref	Transducer ID	ISO Signal Identifier	Description	FScale	Units	DAS Flip	Positive Polarity	Assembly
169	476830046	L0FBAR000082FOXA	Load Cell Row 2 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.082
170	476830033	L0FBAR000083FOXA	Load Cell Row 3 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.083
171	476830092	L0FBAR000084FOXA	Load Cell Row 4 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.084
172	476830031	L0FBAR000085FOXA	Load Cell Row 5 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.085
173	476830035	L0FBAR000086FOXA	Load Cell Row 6 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.086
174	476830078	L0FBAR000087FOXA	Load Cell Row 7 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.087
175	476830062	L0FBAR000088FOXA	Load Cell Row 8 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.088
176	476830022	L0FBAR000089FOXA	Load Cell Row 9 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.089
177	476830060	L0FBAR000090FOXA	Load Cell Row 10 Column 9	311376	N	-	Compression force	0-Barrier VRTC 90 channel Offset.090

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
1	11HEADCG00H3ACXA	Head X-Axis Acceleration	1000	+	yes	1000
2	11HEADCG00H3ACYA	Head Y-Axis Acceleration	1000	+	yes	1000
3	11HEADCG00H3ACZA	Head Z-Axis Acceleration	1000	+	yes	1000
3A	11HEADCG00H3ACRA	Head Resultant Acceleration	1000			
4	11HEADCGRDH3ACXA	Head X-Axis Redundant Acceleration	1000	+	yes	1000
5	11HEADCGRDH3ACYA	Head Y-Axis Redundant Acceleration	1000	+	yes	1000
6	11HEADCGRDH3ACZA	Head Z-Axis Redundant Acceleration	1000	+	yes	1000
6A	11HEADCGRDH3ACRA	Head Redundant Resultant Acceleration	1000			
7	11HEADFR00H3ACYA	Head (FT) Y-Axis Acceleration	1000	+	yes	1000
8	11HEADFR00H3ACZA	Head (FT) Z-Axis Acceleration	1000	+	yes	1000
9	11HEADUP00H3ACXA	Head (TP) X-Axis Acceleration	1000	+	yes	1000
10	11HEADUP00H3ACYA	Head (TP) Y-Axis Acceleration	1000	+	yes	1000
11	11HEADLE00H3ACXA	Head (LT) X-Axis Acceleration	1000	+	yes	1000
12	11HEADLE00H3ACZA	Head (LT) Z-Axis Acceleration	1000	+	yes	1000
13	11NECKUP00H3FOXA	Upper Neck X-Axis Force	1000	+	yes	8896
14	11NECKUP00H3FOYA	Upper Neck Y-Axis Force	1000	+	yes	8896
15	11NECKUP00H3FOZA	Upper Neck Z-Axis Force	1000	+	yes	13344
16	11NECKUP00H3MOXA	Upper Neck Moment About X Axis	600	+	yes	282
17	11NECKUP00H3MOYA	Upper Neck Moment About Y Axis	600	+	yes	282
18	11NECKUP00H3MOZA	Upper Neck Moment About Z Axis	600	+	yes	282
19	11NECKLO00H3FOXA	Lower Neck X-Axis Force	1000	+	yes	13344
20	11NECKLO00H3FOYA	Lower Neck Y-Axis Force	1000	+	yes	13344
21	11NECKLO00H3FOZA	Lower Neck Z-Axis Force	1000	+	yes	13344
22	11NECKLO00H3MOXA	Lower Neck Moment About X Axis	600	+	yes	452
23	11NECKLO00H3MOYA	Lower Neck Moment About Y Axis	600	+	yes	452
24	11NECKLO00H3MOZA	Lower Neck Moment About Z Axis	600	+	yes	452
25	11CHSTCG00H3ACXA	Chest X-Axis Acceleration	180	+	yes	1000
26	11CHSTCG00H3ACYA	Chest Y-Axis Acceleration	180	+	yes	1000
27	11CHSTCG00H3ACZA	Chest Z-Axis Acceleration	180	+	yes	1000
27A	11CHSTCG00H3ACRA	Chest Resultant Acceleration	180			
28	11CHSTCGRDH3ACXA	Chest X-Axis Redundant Acceleration	180	+	yes	1000

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
29	11CHSTCGRDH3ACYA	Chest Y-Axis Redundant Acceleration	180	+	yes	1000
30	11CHSTCGRDH3ACZA	Chest Z-Axis Redundant Acceleration	180	+	yes	1000
30A	11CHSTCGRDH3ACRA	Chest Redundant Resultant Acceleration	180			
31	11CHST0000H3DSXA	Chest Displacement	600	+	yes	84
32	11FEMRLL00H3FOZA	Left Femur Z-Axis Force	600	+	yes	13344
33	11FEMRRL00H3FOZA	Right Femur Z-Axis Force	600	+	yes	13344
34	11KNSLLE00H3DSXA	Left Knee Displacement	180	+	yes	40
35	11TIBILULXH3FOXA	Left Upper Tibia X-Axis Force	600	+	yes	11120
36	11TIBILULXH3FOZA	Left Upper Tibia Z-Axis Force	600	+	yes	11120
37	11TIBILULXH3MOXA	Left Upper Tibia Moment About X Axis	600	+	yes	395
38	11TIBILULXH3MOYA	Left Upper Tibia Moment About Y Axis	600	+	yes	395
39	11TIBILELXH3ACXA	Left Tibia X-Axis Acceleration	1000	+	yes	1000
40	11TIBILELXH3ACYA	Left Tibia Y-Axis Acceleration	1000	+	yes	1000
41	11TIBILLXH3FOXA	Left Lower Tibia X-Axis Force	600	+	yes	11120
42	11TIBILLXH3FOYA	Left Lower Tibia Y-Axis Force	600	+	yes	11120
43	11TIBILLXH3FOZA	Left Lower Tibia Z-Axis Force	600	+	yes	11120
44	11TIBILLXH3MOXA	Left Lower Tibia Moment About X Axis	600	+	yes	395
45	11TIBILLXH3MOYA	Left Lower Tibia Moment About Y Axis	600	+	yes	395
46	11FOOTLELXH3ANXA	Left Foot X-Axis Rotation	180	+	no	318
47	11FOOTLELXH3ANYA	Left Foot Y-Axis Rotation	180	+	no	318
48	11FOOTLELXH3ANZA	Left Foot Z-Axis Rotation	180	+	no	318
49	11FOOTLELXH3ACXA	Left Foot X-Axis Acceleration	1000	+	yes	1000
50	11FOOTLELXH3ACYA	Left Foot Y-Axis Acceleration	1000	+	yes	1000
51	11FOOTLELXH3ACZA	Left Foot Z-Axis Acceleration	1000	+	yes	1000
51A	11FOOTLELXH3ACRA	Left Foot Resultant Acceleration	1000			
52	11KNSLRI00H3DSXA	Right Knee Displacement	180	+	yes	40
53	11TIBIRULXH3FOXA	Right Upper Tibia X-Axis Force	600	+	yes	11120
54	11TIBIRULXH3FOZA	Right Upper Tibia Z-Axis Force	600	+	yes	11120
55	11TIBIRULXH3MOXA	Right Upper Tibia Moment About X Axis	600	+	yes	395
56	11TIBIRULXH3MOYA	Right Upper Tibia Moment About Y Axis	600	+	yes	395
57	11TIBIRILXH3ACXA	Right Tibia X-Axis Acceleration	1000	+	yes	1000

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
58	11TIBIRILXH3ACYA	Right Tibia Y-Axis Acceleration	1000	+	yes	1000
59	11TIBIRLLXH3FOXA	Right Lower Tibia X-Axis Force	600	+	yes	11120
60	11TIBIRLLXH3FOYA	Right Lower Tibia Y-Axis Force	600	+	yes	11120
61	11TIBIRLLXH3FOZA	Right Lower Tibia Z-Axis Force	600	+	yes	11120
62	11TIBIRLLXH3MOXA	Right Lower Tibia Moment About X Axis	600	+	yes	395
63	11TIBIRLLXH3MOYA	Right Lower Tibia Moment About Y Axis	600	+	yes	395
64	11FOOTRILXH3ANXA	Right Foot X-Axis Rotation	180	+	no	318
65	11FOOTRILXH3ANYA	Right Foot Y-Axis Rotation	180	+	no	318
66	11FOOTRILXH3ANZA	Right Foot Z-Axis Rotation	180	+	no	318
67	11FOOTRILXH3ACXA	Right Foot X-Axis Acceleration	1000	+	yes	1000
68	11FOOTRILXH3ACYA	Right Foot Y-Axis Acceleration	1000	+	yes	1000
69	11FOOTRILXH3ACZA	Right Foot Z-Axis Acceleration	1000	+	yes	1000
69A	11FOOTRILXH3ACRA	Right Foot Resultant Acceleration	1000			
70	14CRME000000ACXA	Left Rear Seat Cross-Member X-Axis Acceleration	60	+	yes	1000
71	16CRME000000ACXA	Right Rear Seat Cross-Member X-Axis Acceleration	60	+	yes	1000
72	14CRME000000ACZA	Left Rear Seat Cross-Member Z-Axis Acceleration	60	+	yes	1000
73	16CRME000000ACZA	Right Rear Seat Cross-Member Z-Axis Acceleration	60	+	yes	1000
74	12ENGNTPO000ACXA	Top of Engine Block X-Axis Acceleration	60	+	yes	1500
75	12ENGNB00000ACXA	Bottom of Engine Block X-Axis Acceleration	60	+	yes	1500
76	13VEHCRI0000ACXA	Right Brake Caliper X-Axis Acceleration	60	+	yes	1500
77	11VEHCLE0000ACXA	Left Brake Caliper X-Axis Acceleration	60	+	yes	1500
78	12DASH000000ACXA	Instrument Panel X-Axis Acceleration	60	+	yes	1500
79	11SETR000000ACXA	Left Side Driver Mid Seat Track X-Axis Acceleration	60	+	yes	1500
80	10VEHCCG0000ACXA	Vehicle CG X-Axis Acceleration	60	+	yes	1000
80A	10VEHCCG0000VEXA	Vehicle CG X-Axis Velocity	180			
80B	10VEHCCG0000DCXA	Vehicle CG X-Axis Displacement	180			
81	10VEHCCG0000ACYA	Vehicle CG Y-Axis Acceleration	60	+	yes	1000
81A	10VEHCCG0000VEYA	Vehicle CG Y-Axis Velocity	180			
81B	10VEHCCG0000DCYA	Vehicle CG Y-Axis Displacement	180			
82	10VEHCCG0000ACZA	Vehicle CG Z-Axis Acceleration	60	+	yes	1000
82A	10VEHCCG0000VEZA	Vehicle CG Z-Axis Velocity	180			

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
82B	10VEHCCG0000DCZA	Vehicle CG Z-Axis Displacement	180			
82C	10VEHCCG0000ACRA	Vehicle CG Resultant Acceleration	60			
83	11AIRBFR0100EV0A	Driver Front Airbag 1 Ind	1000	+	no	5
84	11AIRBFR0200EV0A	Driver Front Airbag 2 Ind	1000	+	no	5
85	11SEBE0000B5FOOA	Driver Lap Belt	60	+	yes	15568
86	11SEBE0000B3FOOA	Driver Shoulder Belt	60	+	yes	15568
87	L0FBAR000001FOXA	Load Cell Row 1 Column 1	60	+	yes	311376
88	L0FBAR000002FOXA	Load Cell Row 2 Column 1	60	+	yes	311376
89	L0FBAR000003FOXA	Load Cell Row 3 Column 1	60	+	yes	311376
90	L0FBAR000004FOXA	Load Cell Row 4 Column 1	60	+	yes	311376
91	L0FBAR000005FOXA	Load Cell Row 5 Column 1	60	+	yes	311376
92	L0FBAR000006FOXA	Load Cell Row 6 Column 1	60	+	yes	311376
93	L0FBAR000007FOXA	Load Cell Row 7 Column 1	60	+	yes	311376
94	L0FBAR000008FOXA	Load Cell Row 8 Column 1	60	+	yes	311376
95	L0FBAR000009FOXA	Load Cell Row 9 Column 1	60	+	yes	311376
96	L0FBAR000010FOXA	Load Cell Row 10 Column 1	60	+	yes	311376
97	L0FBAR000011FOXA	Load Cell Row 1 Column 2	60	+	yes	311376
98	L0FBAR000012FOXA	Load Cell Row 2 Column 2	60	+	yes	311376
99	L0FBAR000013FOXA	Load Cell Row 3 Column 2	60	+	yes	311376
100	L0FBAR000014FOXA	Load Cell Row 4 Column 2	60	+	yes	311376
101	L0FBAR000015FOXA	Load Cell Row 5 Column 2	60	+	yes	311376
102	L0FBAR000016FOXA	Load Cell Row 6 Column 2	60	+	yes	311376
103	L0FBAR000017FOXA	Load Cell Row 7 Column 2	60	+	yes	311376
104	L0FBAR000018FOXA	Load Cell Row 8 Column 2	60	+	yes	311376
105	L0FBAR000019FOXA	Load Cell Row 9 Column 2	60	+	yes	311376
106	L0FBAR000020FOXA	Load Cell Row 10 Column 2	60	+	yes	311376
107	L0FBAR000021FOXA	Load Cell Row 1 Column 3	60	+	yes	311376
108	L0FBAR000022FOXA	Load Cell Row 2 Column 3	60	+	yes	311376
109	L0FBAR000023FOXA	Load Cell Row 3 Column 3	60	+	yes	311376
110	L0FBAR000024FOXA	Load Cell Row 4 Column 3	60	+	yes	311376
111	L0FBAR000025FOXA	Load Cell Row 5 Column 3	60	+	yes	311376

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
112	L0FBAR000026FOXA	Load Cell Row 6 Column 3	60	+	yes	311376
113	L0FBAR000027FOXA	Load Cell Row 7 Column 3	60	+	yes	311376
114	L0FBAR000028FOXA	Load Cell Row 8 Column 3	60	+	yes	311376
115	L0FBAR000029FOXA	Load Cell Row 9 Column 3	60	+	yes	311376
116	L0FBAR000030FOXA	Load Cell Row 10 Column 3	60	+	yes	311376
117	L0FBAR000031FOXA	Load Cell Row 1 Column 4	60	+	yes	311376
118	L0FBAR000032FOXA	Load Cell Row 2 Column 4	60	+	yes	311376
119	L0FBAR000033FOXA	Load Cell Row 3 Column 4	60	+	yes	311376
120	L0FBAR000034FOXA	Load Cell Row 4 Column 4	60	+	yes	311376
121	L0FBAR000035FOXA	Load Cell Row 5 Column 4	60	+	yes	311376
122	L0FBAR000036FOXA	Load Cell Row 6 Column 4	60	+	yes	311376
123	L0FBAR000037FOXA	Load Cell Row 7 Column 4	60	+	yes	311376
124	L0FBAR000038FOXA	Load Cell Row 8 Column 4	60	+	yes	311376
125	L0FBAR000039FOXA	Load Cell Row 9 Column 4	60	+	yes	311376
126	L0FBAR000040FOXA	Load Cell Row 10 Column 4	60	+	yes	311376
127	L0FBAR000041FOXA	Load Cell Row 1 Column 5	60	+	yes	311376
128	L0FBAR000042FOXA	Load Cell Row 2 Column 5	60	+	yes	311376
129	L0FBAR000043FOXA	Load Cell Row 3 Column 5	60	+	yes	311376
130	L0FBAR000044FOXA	Load Cell Row 4 Column 5	60	+	yes	311376
131	L0FBAR000045FOXA	Load Cell Row 5 Column 5	60	+	yes	311376
132	L0FBAR000046FOXA	Load Cell Row 6 Column 5	60	+	yes	311376
133	L0FBAR000047FOXA	Load Cell Row 7 Column 5	60	+	yes	311376
134	L0FBAR000048FOXA	Load Cell Row 8 Column 5	60	+	yes	311376
135	L0FBAR000049FOXA	Load Cell Row 9 Column 5	60	+	yes	311376
136	L0FBAR000050FOXA	Load Cell Row 10 Column 5	60	+	yes	311376
137	L0FBAR000051FOXA	Load Cell Row 1 Column 6	60	+	yes	311376
138	L0FBAR000052FOXA	Load Cell Row 2 Column 6	60	+	yes	311376
139	L0FBAR000053FOXA	Load Cell Row 3 Column 6	60	+	yes	311376
140	L0FBAR000054FOXA	Load Cell Row 4 Column 6	60	+	yes	311376
141	L0FBAR000055FOXA	Load Cell Row 5 Column 6	60	+	yes	311376
142	L0FBAR000056FOXA	Load Cell Row 6 Column 6	60	+	yes	311376


Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
143	L0FBAR000057FOXA	Load Cell Row 7 Column 6	60	+	yes	311376
144	L0FBAR000058FOXA	Load Cell Row 8 Column 6	60	+	yes	311376
145	L0FBAR000059FOXA	Load Cell Row 9 Column 6	60	+	yes	311376
146	L0FBAR000060FOXA	Load Cell Row 10 Column 6	60	+	yes	311376
147	L0FBAR000061FOXA	Load Cell Row 1 Column 7	60	+	yes	311376
148	L0FBAR000062FOXA	Load Cell Row 2 Column 7	60	+	yes	311376
149	L0FBAR000063FOXA	Load Cell Row 3 Column 7	60	+	yes	311376
150	L0FBAR000064FOXA	Load Cell Row 4 Column 7	60	+	yes	311376
151	L0FBAR000065FOXA	Load Cell Row 5 Column 7	60	+	yes	311376
152	L0FBAR000066FOXA	Load Cell Row 6 Column 7	60	+	yes	311376
153	L0FBAR000067FOXA	Load Cell Row 7 Column 7	60	+	yes	311376
154	L0FBAR000068FOXA	Load Cell Row 8 Column 7	60	+	yes	311376
155	L0FBAR000069FOXA	Load Cell Row 9 Column 7	60	+	yes	311376
156	L0FBAR000070FOXA	Load Cell Row 10 Column 7	60	+	yes	311376
157	L0FBAR000071FOXA	Load Cell Row 1 Column 8	60	+	yes	311376
158	L0FBAR000072FOXA	Load Cell Row 2 Column 8	60	+	yes	311376
159	L0FBAR000073FOXA	Load Cell Row 3 Column 8	60	+	yes	311376
160	L0FBAR000074FOXA	Load Cell Row 4 Column 8	60	+	yes	311376
161	L0FBAR000075FOXA	Load Cell Row 5 Column 8	60	+	yes	311376
162	L0FBAR000076FOXA	Load Cell Row 6 Column 8	60	+	yes	311376
163	L0FBAR000077FOXA	Load Cell Row 7 Column 8	60	+	yes	311376
164	L0FBAR000078FOXA	Load Cell Row 8 Column 8	60	+	yes	311376
165	L0FBAR000079FOXA	Load Cell Row 9 Column 8	60	+	yes	311376
166	L0FBAR000080FOXA	Load Cell Row 10 Column 8	60	+	yes	311376
167	L0FBAR000081FOXA	Load Cell Row 1 Column 9	60	+	yes	311376
168	L0FBAR000082FOXA	Load Cell Row 2 Column 9	60	+	yes	311376
169	L0FBAR000083FOXA	Load Cell Row 3 Column 9	60	+	yes	311376
170	L0FBAR000084FOXA	Load Cell Row 4 Column 9	60	+	yes	311376
171	L0FBAR000085FOXA	Load Cell Row 5 Column 9	60	+	yes	311376
172	L0FBAR000086FOXA	Load Cell Row 6 Column 9	60	+	yes	311376
173	L0FBAR000087FOXA	Load Cell Row 7 Column 9	60	+	yes	311376

Command File Test Number 060630-2

Channel	ISO Mnemonic	Channel Title	Filter Class	Flip	Zero	Full Scale
174	L0FBAR000088FOXA	Load Cell Row 8 Column 9	60	+	yes	311376
175	L0FBAR000089FOXA	Load Cell Row 9 Column 9	60	+	yes	311376
176	L0FBAR000090FOXA	Load Cell Row 10 Column 9	60	+	yes	311376

2006 MITSUBISHI GALANT INTO LEFT 40% OFFSET DEFORMABLE LCB AT 56 KPH

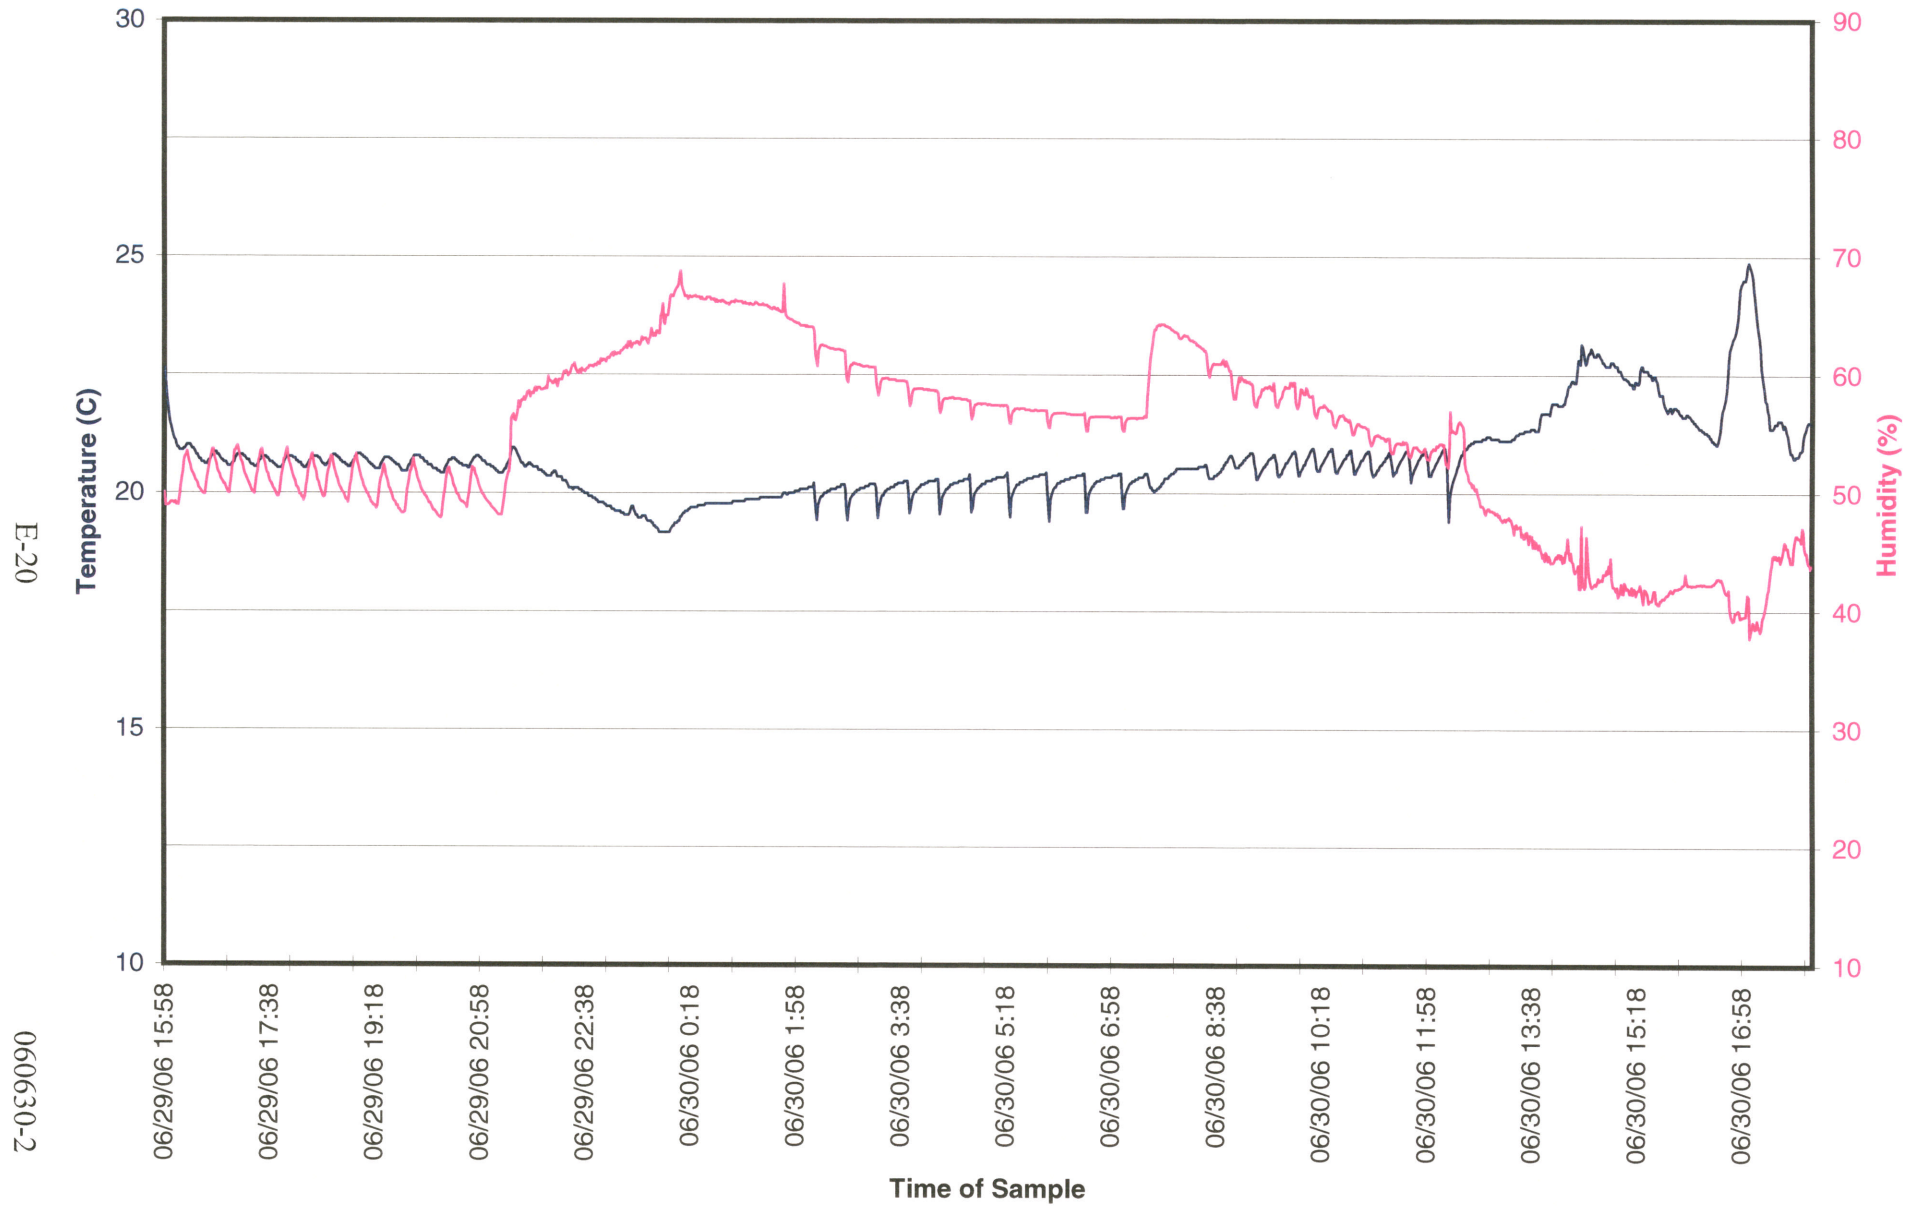



**BEST BACKED
CARS IN THE WORLD™**

- * 10-year/100,000 mile Powertrain Limited Warranty
- * 5-year/60,000 mile New Vehicle Limited Warranty
- * 5-year/Unlimited mile Roadside Assistance Plan
- * See participating retailer for Limited Warranty and Roadside Assistance terms and conditions

CONSUMER INFORMATION

Gasoline, license and title fees, applicable federal, state and local taxes and dealer and distributor installed options and accessories are not included in the manufacturer's suggested retail price. This label has been applied to this vehicle pursuant to federal law and cannot be moved or altered prior to delivery to ultimate purchaser.

PARTS CONTENT INFORMATION

For vehicles in this carline:
U.S./Canadian Parts Content: 55%
Major Sources of Foreign Parts Content:
JAPAN 34%

For this vehicle:
Final Assembly Point: **NORMAL, IL USA**
Country of Origin:
Engine: **JAPAN**
Transmission: **JAPAN**

Note: Parts content does not include final assembly, distribution, or other non-parts cost.

Compare this vehicle to others in the **FREE FUEL ECONOMY GUIDE** available at the dealer.

CITY MPG

23

Actual mileage will vary with options, driving conditions, driving habits and vehicle condition. Results reported to EPA indicated that the majority of vehicles with these estimates will achieve between

na and na mpg in the city,
and between
na and na mpg on the
highway.



2006 MITSUBISHI GALANT DE
4-DOOR SEDAN
2.4L SOHC MPI MIVEC
4-SPD.ELECT CNTRLD AUTO O/D TRANS

Estimated Annual Fuel Cost
1320

HIGHWAY MPG

30

For Comparison Shopping,
all vehicles classified as
MID-SIZE CAR
have been issued
mileage ratings
ranging from

NA to NA mpg city
and
NA to NA mpg
highway.

See www.fueleconomy.gov

MITSUBISHI

Year/Model **2006 GALANT DE**

4-DOOR SEDAN

Color **LIQUID SILVER**

2.4L SOHC MPI MIVEC

4-SPD ELECT CNTRLD AUTO O/D TRANS

BLACK INTERIOR

STANDARD EQUIPMENT & INSTALLED OPTIONS

MANUFACTURER'S SUGGESTED RETAIL PRICE (MSRP) **\$ 19,399.00**

SAFETY FEATURES

◆ ADVANCED DUAL STAGE FRONT AIR BAGS	INCLUDED
◆ DUAL FRONT SIDE AIR BAGS WITH HEAD PROTECTION	INCLUDED
◆ FRONT & REAR CRUMPLE ZONES	INCLUDED
◆ SIDE IMPACT DOOR BEAMS	INCLUDED
◆ CHILD SAFETY LOCKS	INCLUDED
◆ LATCH SYSTEM FOR CHILD SEATS	INCLUDED
◆ 3-POINT SAFETY BELTS FOR ALL OCCUPANTS	INCLUDED
◆ ENGINE IMMOBILIZER	INCLUDED

PERFORMANCE/HANDLING

◆ 4-WHEEL POWER ASSISTED DISC BRAKES	INCLUDED
◆ 4-WHEEL INDEPENDENT SUSPENSION	INCLUDED
◆ POWER ASSIST RACK/PINION STEERING	INCLUDED
◆ FRONT & REAR STABILIZER BARS	INCLUDED

COMFORT/CONVENIENCE

◆ AIR CONDITIONING	INCLUDED
◆ AM/FM/CD AUDIO WITH 4 SPEAKERS	INCLUDED
◆ VANITY MIRRORS W/EXTENSIONS	INCLUDED
◆ POWER WINDOWS WITH 30 SECOND POWER RESERVE	INCLUDED
◆ 12V ACCESSORY OUTLETS	INCLUDED
◆ 6-WAY ADJUSTABLE DRIVER SEAT	INCLUDED
◆ FRONT CENTER CONSOLE W/ARMREST STORAGE & DUAL CUPHOLDERS	INCLUDED
◆ FLOOR MATS	INCLUDED
◆ REAR ARMREST W/CUPHOLDERS & TRUNK PASS THROUGH	INCLUDED
◆ POWER DOOR LOCKS/SIDEVIEW MIRRORS	INCLUDED
◆ REMOTE KEYLESS ENTRY/TRUNK RELEASE & PANIC FEATURE	INCLUDED

EXTERIOR FEATURES

◆ COLOR-KEYED BUMPERS	INCLUDED
◆ BLACK SIDEVIEW MIRRORS & DOOR HANDLES	INCLUDED
◆ AUTO-OFF HEADLAMPS	INCLUDED
◆ INTEGRATED REAR-WINDOW ANTENNA	INCLUDED
◆ 215/60 R16 ALL SEASON TIRES	INCLUDED
◆ 16" STEEL WHEELS W/FULL COVER	INCLUDED

Sub-Total	\$ 19,399.00
Destination/Handling	\$ 595.00

TOTAL	\$ 19,994.00
--------------	---------------------

Ship To:

16037 (DBA) FAMILY MITSUBISHI-NORTH
13927 TRADE CENTER DRIVE
FISHERS, IN 460384548

Case #: 6E012740

Method of Transport:

Plant/Port of Entry: NORMAL, IL

Sold To: (Same unless indicated)



VIN: 4A3AB26F16E012740



CERTIFICATE OF CONFORMITY

Certificate No. 26724
Serial No. FL137

Cellbond Composites Ltd
5 Stukeley Business Centre
Blackstone Road
Huntingdon
Cambridgeshire
PE29 6EF
United Kingdom

Product Description	Frontal ODB painted grey
Cellbond Part No.	70EEVCFIUS

telephone
+44 (0) 1480 435302
telefax
+44 (0) 1480 450181
email
sales@cellbond.com
website
www.cellbond.com

	Test Results	GR No.	Blk No.
1	8032-8	CHC0303103GB	N/A
2	7558-8	CHC0511016FL	N/A

Declaration.

The above moving deformable barrier has been manufactured in accordance with the provisions of the European Parliament and Council No 96/79/EC Directive (Regulation ECE R94)


Additional Information...

company registration
England 1944904

registered office
5 Stukeley Business Centre
Blackstone Road
Huntingdon
Cambridgeshire
PE29 6EF

Cellbond Offices
United Kingdom
United States of America



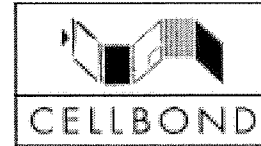

EEVC DEFORMABLE FRONTAL BARRIER
ALUMINIUM HONEYCOMB CERTIFICATION
STATIC TEST RESULTS

MAIN BLOCK
Core: 1.8 3/4 3003

Required Crush Strength
0.308 MPa to 0.342 MPa

Test No: 8032-8

GR No : CHC0303103GB
Block No: N/A

	Crush Strength (MPa)			RESULT
	6.4 to 9.7 mm	9.7 to 13.2 mm	13.2 to 16.5 mm	
Sample* 1	0.3292	0.3267	0.3288	PASS
Sample 2	0.3441	0.3404	0.3296	FAIL
Sample 3	0.3194	0.3247	0.3188	PASS
Sample 4	0.3306	0.3288	0.3270	PASS
Sample 5	0.3380	0.3330	0.3383	PASS
Sample 6	0.3391	0.3365	0.3335	PASS
Sample 7	0.3355	0.3379	0.3325	PASS
Sample 8	0.3260	0.3314	0.3331	PASS

Seven out of the eight samples must fulfil the crush strength
requirement in order to pass the block certification

*Sample size and location as per R94.

RESULT: PASSED

EEVC DEFORMABLE FRONTAL BARRIER MAIN BLOCK









Honeycomb Type: 1.8 3/4 3003
Higher Acceptable Crush Strength Limit: 0.342 MPa
Lower Acceptable Crush Strength Limit: 0.308 MPa


Section 1: 6.4 - 9.7mm
Section 2: 9.7 - 13.2mm
Section 3: 13.2 - 16.5mm
Speed: 6.35 mm/min

Test No: 8032-8

GR No: CHC0303103GB

Block No: N/A

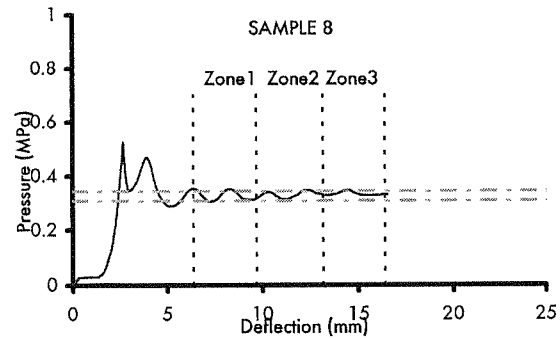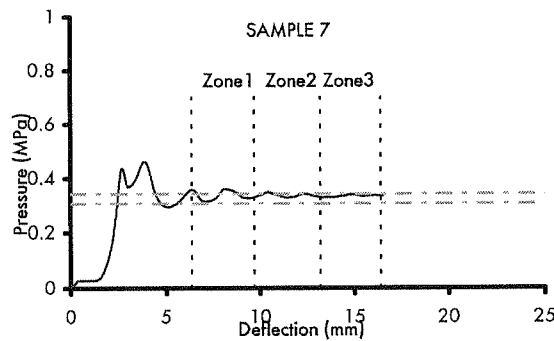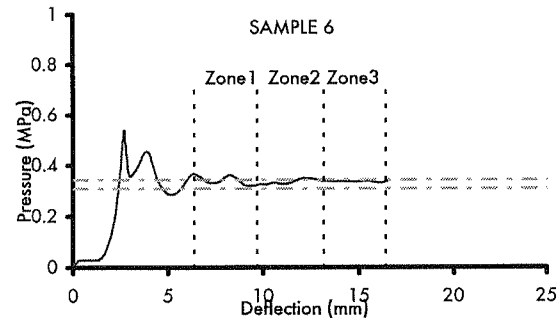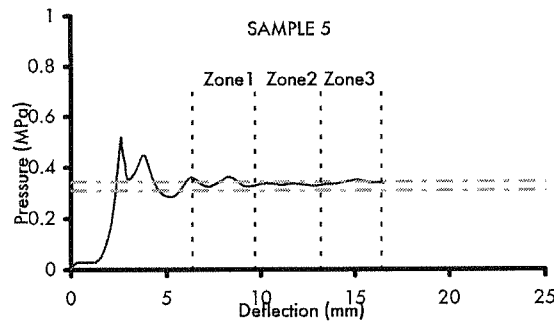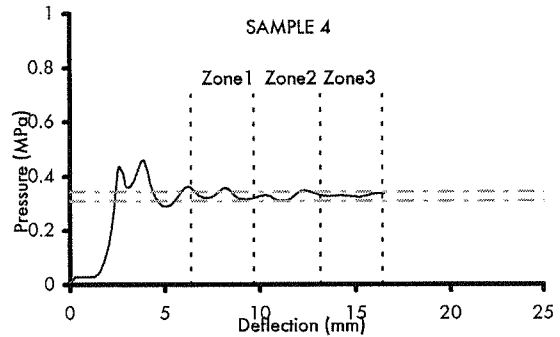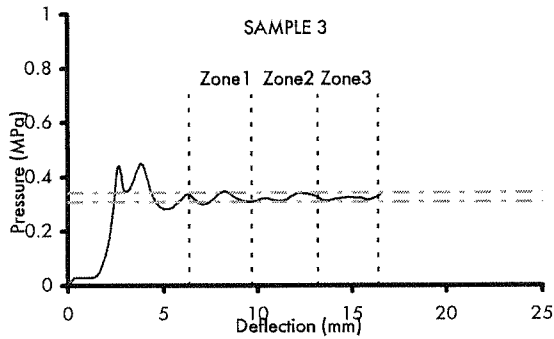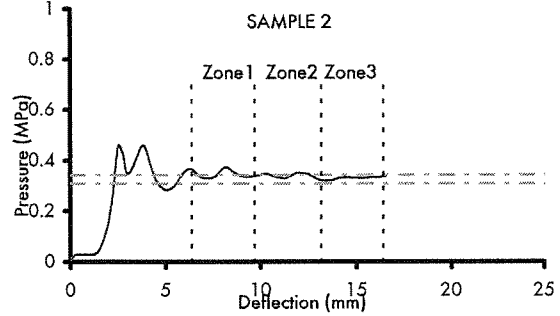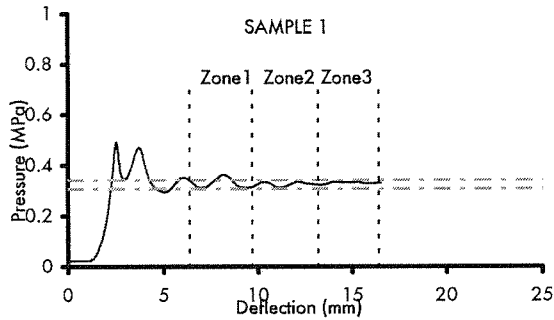

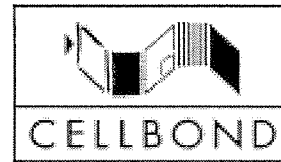

EEVC DEFORMABLE FRONTAL BARRIER
ALUMINIUM HONEYCOMB CERTIFICATION
STATIC TEST RESULTS

BUMPER
Core: 5.2 1/4 3003

Required Crush Strength
1.540 MPa to 1.711 MPa

Test No: 7558-8

GR No: CHC0511016FL
Block No: N/A

	Crush Strength (MPa)			RESULT
	6.4 to 9.7 mm	9.7 to 13.2 mm	13.2 to 16.5 mm	
Sample* 1	1.697	1.713	1.709	FAIL
Sample 2	1.548	1.549	1.567	PASS
Sample 3	1.630	1.636	1.639	PASS
Sample 4	1.552	1.554	1.580	PASS
Sample 5	1.572	1.559	1.549	PASS
Sample 6	1.573	1.572	1.569	PASS
Sample 7	1.573	1.596	1.567	PASS
Sample 8	1.543	1.549	1.541	PASS

Seven out of the eight samples must fulfil the crush strength
requirement in order to pass the block certification

*Sample size and location as per R94.

RESULT: PASSED









EEVC DEFORMABLE FRONTAL BARRIER BUMPER

Honeycomb Type: 5.2 1/4 3003
Higher Acceptable Crush Strength Limit: 1.711 MPa
Lower Acceptable Crush Strength Limit: 1.540 MPa

Section 1: 6.4 - 9.7mm
Section 2: 9.7 - 13.2mm
Section 3: 13.2 - 16.5mm
Speed: 6.35 mm/min
Block No: N/A

Test No: 7558-8

GR No: CHC0511016FL

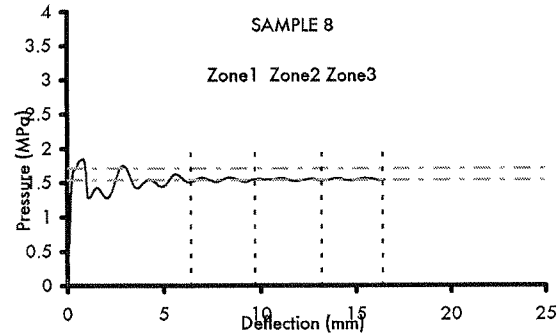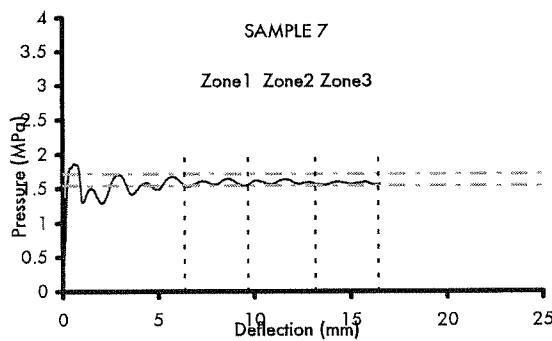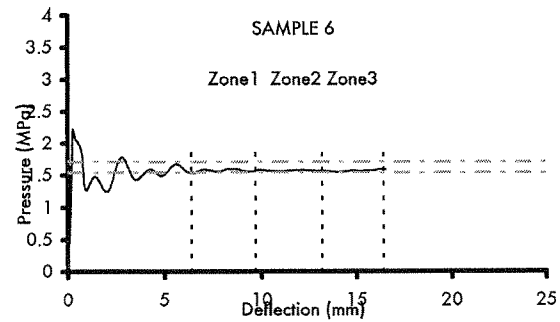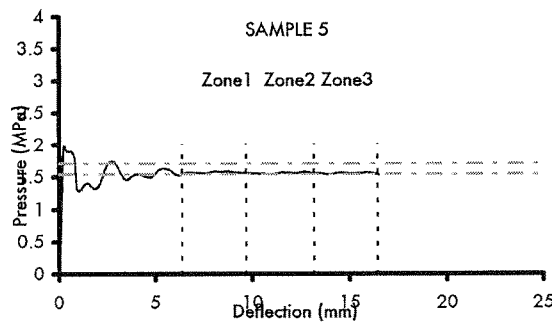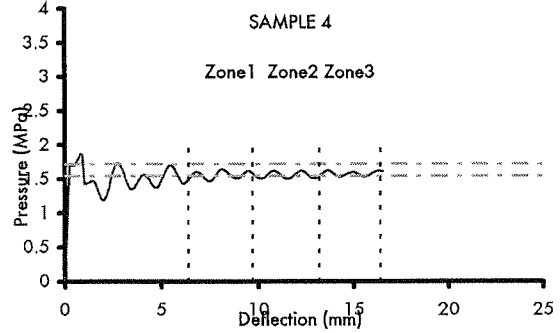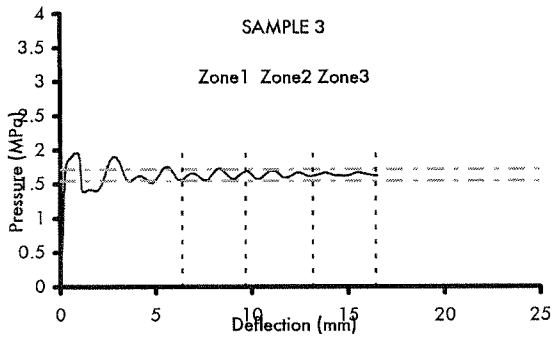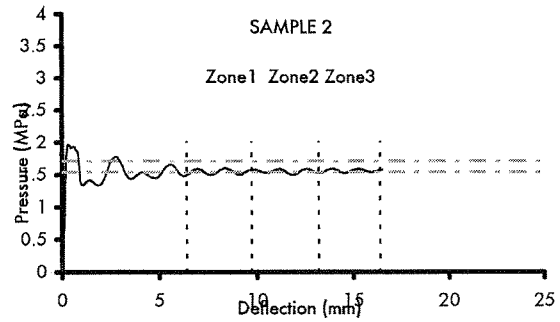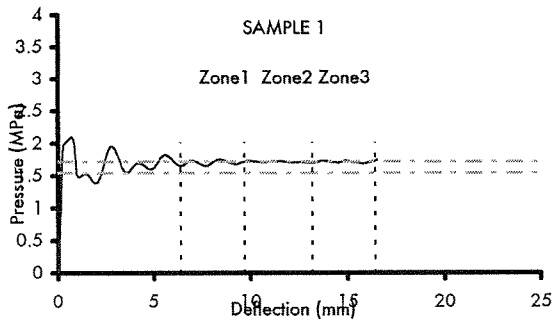

Procedure For Vehicle Interior Intrusion Measurements

The interior intrusion measurement locations are marked on both the driver and passenger side of the vehicle and are to be recorded using a coordinate measuring machine (CMM). The coordinate system for intrusion measurements is based on SAE J211 vehicle and laboratory coordinates. The X-direction is positive from the left of the vehicle to the right of the vehicle. The Z-direction is positive from the top of the vehicle to the ground. The frame of reference for the vehicle coordinate system is the non-deforming part of the vehicle.

The Contractor shall level the vehicle (Note: do not use suspension) and locate the vehicle coordinate system on a rigid surface of the vehicle's bumper at centerline of the vehicle. The post-test intrusion measurement points shall be measured using the same reference coordinate system by leveling the vehicle to the same pretest condition. The before and after impact measurements are in millimeters in the range -10,000 to 10,000 millimeters. A unique intrusion point number (IPNO) further identifies an intrusion point within each possible intrusion point location. The unique IPNO codes are identified in Table E1. The locations of the toe pan intrusion points are depicted in Figure E1. The Contractor shall record the intrusion measurements described in Figure E1. The COTR reserves the right to modify these measurements and the procedure.

Table E1: Intrusion Point Numbers (IPNO) Codes

Intrusion Point Number (IPNO) Format: Integer	Description
1	Toe pan point A1 (See Figure E1)
2	Toe pan point B1 (See Figure E1)
3	Toe pan point C1 (See Figure E1)
4	Toe pan point D1 (See Figure E1)
5	Toe pan point A2 (See Figure E1)
6	Toe pan point B2 (See Figure E1)
7	Toe pan point C2 (See Figure E1)
8	Toe pan point D2 (See Figure E1)
9	Toe pan point A3 (See Figure E1)
10	Toe pan point B3 (See Figure E1)
11	Toe pan point C3 (See Figure E1)
12	Toe pan point D3 (See Figure E1)
13	Floorboard point A4 (See Figure E1)
14	Floorboard point B4 (See Figure E1)
15	Floorboard point C4 (See Figure E1)
16	Floorboard point D4 (See Figure E1)
17	Floorboard point A5 (See Figure E1)
18	Floorboard point B5 (See Figure E1)
19	Floorboard point C5 (See Figure E1)
20	Floorboard point D5 (See Figure E1)
21	Geometric center of brake pedal (See Figure E1)
22	Upper instrument panel (IP) left knee (located above where dummy's knees contact dash)
23	Upper IP right knee (located above where dummy's knees contact dash)
24	Steering column
25	Front outboard seat attachment point

Procedure for Marking Toe Pan and Floorboard

1. Locate and mark point D1 (column D row 1): Project a line 45 degrees (from the horizontal) down and forward from the center of the top accelerometer pedal in x-z plane until the line intersects the interior of the vehicle. Mark this point by cutting a small "v" in the carpet and underlying padding and peeling back and exposing the floor. The carpet and padding are then refitted prior to crash.
2. ST plane: The ST plane is a y-z plane that passes through the front edge of the right seat track.
3. AP1 plane: The AP1 plane is a y-z plane that passes through point D1.
4. AP2 plane: The AP2 plane is an x-z plane that passes through point D1.
5. AP3 plane: The AP3 plane is an x-y plane that passes through point D1.
6. MP plane: The MP plane is a y-z plane located halfway between the ST plane and AP1 plane.

7. CF plane: The CF plane is an x-z plane that passes through the center of the footrest. If there is no visible footrest, locate the x-z plane to pass through a point located 64 mm measured along the MP plane in the y-direction from the intersection of the door sill and floorboard.
8. BP plane: The BP plane is an x-z plane that passes through the center of the brake pedal.
9. TP plane: The TP plane is a y-z plane at the intersection of the BP plane and the intersection of the toe pan and floorboard.
10. Column A is at the intersection of the vehicle and the CF plane.
11. Column D is at the intersection of the vehicle and the AP2 plane.
12. Row 1 is at the intersection of the vehicle and the AP3 plane.
13. Row 3 is at the intersection of the vehicle and the TP plane.
14. Row 5 is at the intersection of the vehicle and MP plane.
15. Columns B and C are evenly spaced between Columns A and D.
16. Row 2 is evenly spaced between Row 1 and Row 3.
17. Row 4 is evenly spaced between Row 3 and Row 5.
18. Map and mark additional driver points:
 - a. Mark the center of the brake pedal.
 - b. Mark the left upper IP located above where dummy's knees contact the dash.
 - c. Mark the right upper IP located above where dummy's knees contact the dash.
 - d. Mark the center of the steering wheel.
 - e. Mark the front outboard seat attachment point.
19. Map all driver side toe pan and floorboard points to the passenger side from the center line of the vehicle.
20. Map and mark additional driver points:
 - a. Mark the left upper IP located above where dummy's knees contact dash.
 - b. Mark the right upper IP located above where dummy's knees contact dash.
 - c. Mark the front outboard seat attachment point.

Data Submission

For each intrusion point, six measurements may be taken. The Contractor shall submit a table that describes the data from three pre-test and three post-test measurements in the test report. The data shall be submitted in ENTRÉE format:

- Notes: (1) If no data is taken for one of the coordinate systems please leave blank - do not put a zero.
(2) VEHNO denotes Vehicle Number
(3) TSTREF denotes Test Reference Number
(4) Table E2 defines IPLOC
(5) Table E3 defines measurement format

Table E2: Intrusion Point Location Format

Intrusion Point Locations (IPLOC) Format: Text	Description
C	Steering Column
D	Driver Side
P	Passenger Side

Table E3: Intrusion Measurement Format

Intrusion Measurements (Millimeters) Format: Integer	Description
BIX, BIY, BIZ	Pre-test measurements for x, y, z axis respectively
AIX, AIY, AIZ	Post-test measurements for x, y, z axis respectively

Appendix F

INSIA Report on Structural Measurements



STRUCTURAL SURVEY OF CARS. MEASUREMENT METHODOLOGY OF THE MAIN RESISTANT ELEMENTS IN THE CAR BODY

**APARICIO IZQUIERDO, FRANCISCO
PÁEZ AYUSO, FRANCISCO JAVIER**

**INSIA
Carretera de Valencia, km. 7
Campus Sur de la Universidad Politécnica de Madrid
28031 – MADRID – (SPAIN)**

March, 1999

REPORT DOCUMENTATION PAGE	
Title:	<i>STRUCTURAL SURVEY OF CARS. MEASUREMENT METHODOLOGY OF THE MAIN RESISTANT ELEMENTS IN THE CAR BODY</i>
Author(s):	Aparicio Izquierdo, Francisco Páez Ayuso, Francisco Javier
Performing Organisation name and address:	INSIA – University Institute for Automobile Research Carretera de Valencia, Km. 7 – Campus Sur de la Universidad Politécnica de Madrid 28031 – Madrid – Spain
Supplementary notes:	Under contract to: THE EUROPEAN COMMUNITY Project: “Improvement of Crash Compatibility between Cars” Contract N°: RO – 97 – SC.1064
Abstract:	The main aim of this working package -<i>Structural Survey of Cars</i>- is the reduction of incompatibilities, both structural and geometric, between passenger vehicles and their potential collision partners. The understanding of these incompatibilities needs a previous step for the knowledge of the existing car fleet. Firstly, it is necessary to select the main resistant elements in the car body. These elements have to be chosen from the point of view of the sort of collision that we want to study, that is to say, frontal and side impacts. Detailed measurements have been taken from exterior and interior elements, spread to a total number of 74 models selected from the main vehicle manufacturers at Spain. All of them are being sold this year. Using the information available from the previous measurements in vehicles, the geometric characteristics of the main resistant elements involved in the geometric compatibility between cars will be defined. This report shows the methodology followed to get these measurements.
Subject terms:	Crash compatibility, geometric compatibility, resistant elements, measure methodology
Date:	March, 1999

1.- METHODOLOGY.

Detailed measurements have been taken from exterior and interior elements. Using the information available from the previous measurements in vehicles, the geometric characteristics of the main resistant elements involved in the geometric compatibility between cars have been defined. These elements are presented in the following figures, and have been divided in two main groups according to the vehicle zones studied in this project.

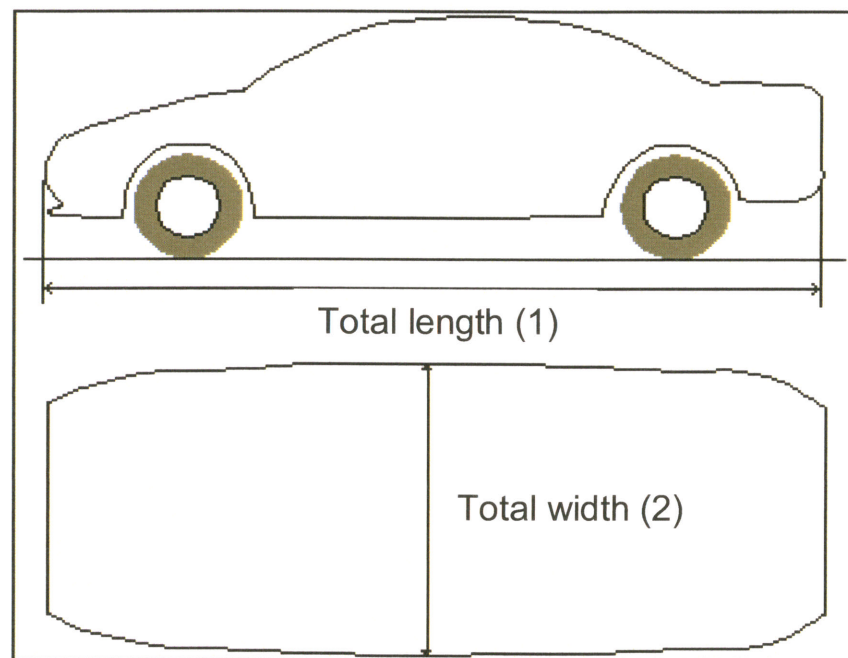


Figure 1.- Definition of the main resistant elements. General dimensions.

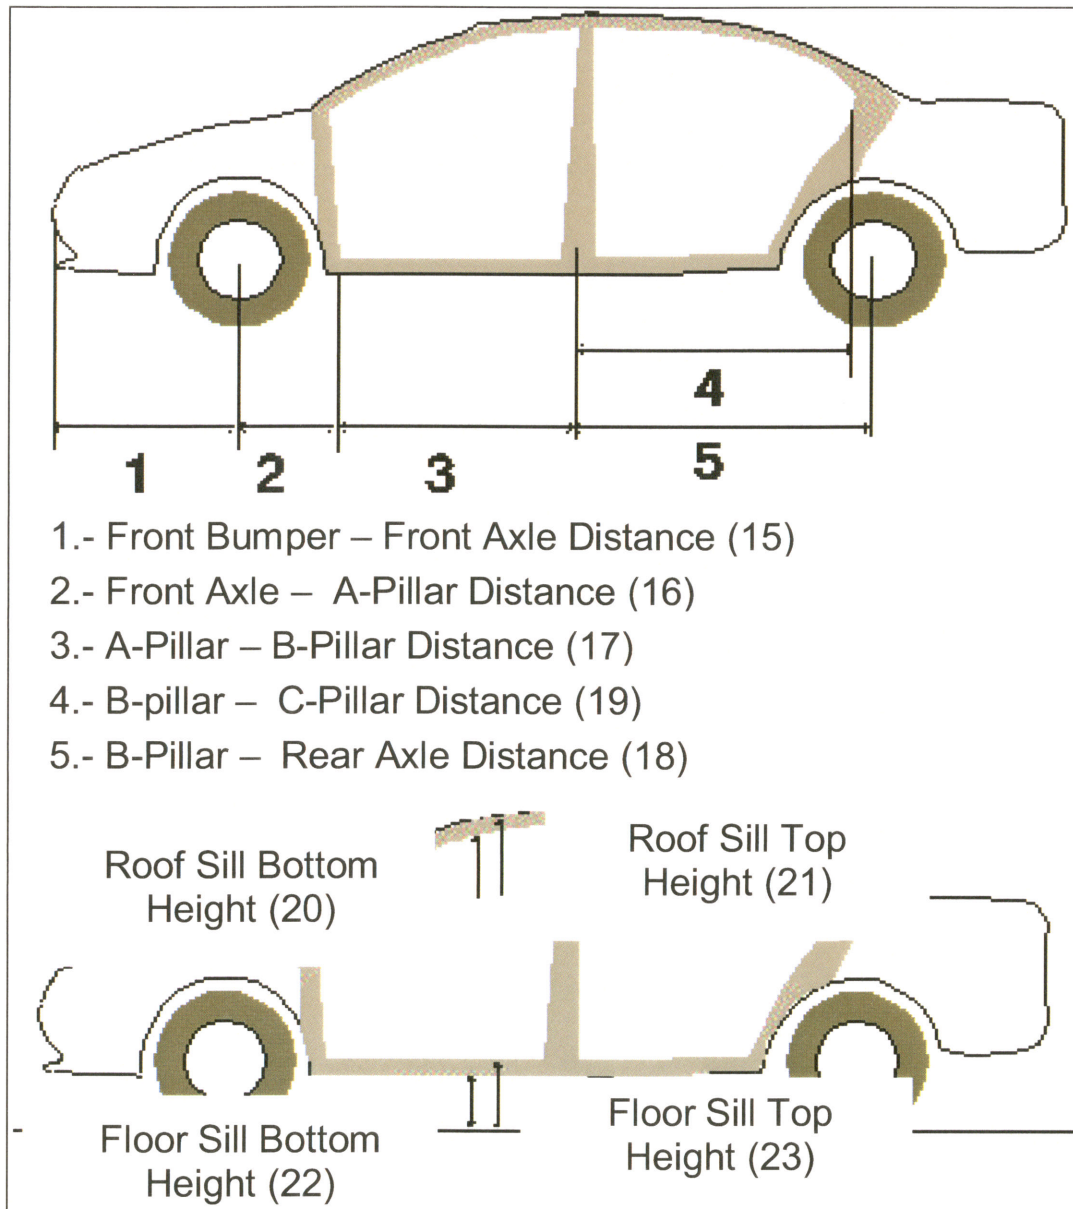


Figure 2.- Definition of the main resistant elements. Side elements.

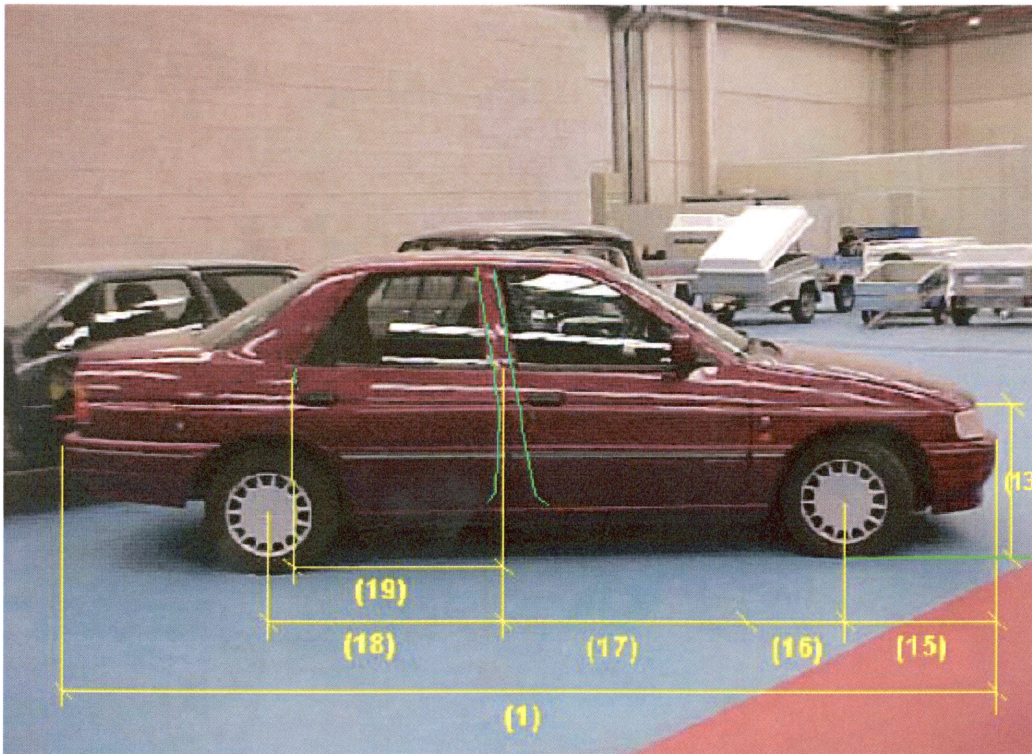


Figure 3.-
Measurements of
the side resistant
elements (outer).

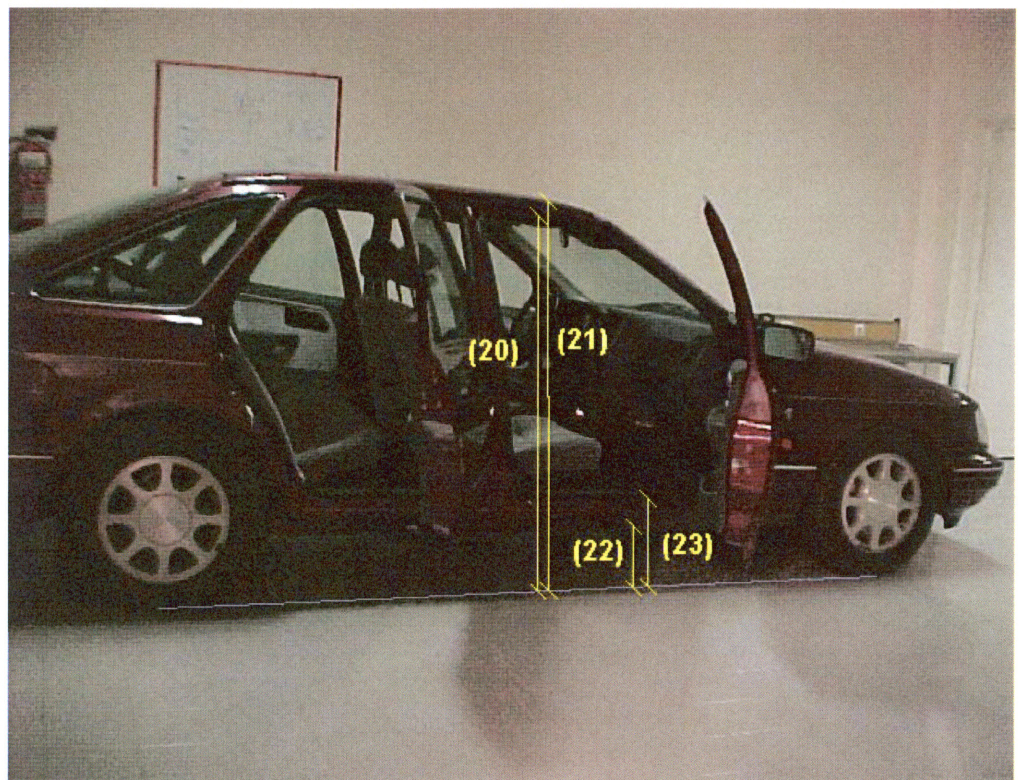


Figure 4.- Measurements
of the side resistant
elements (inner).

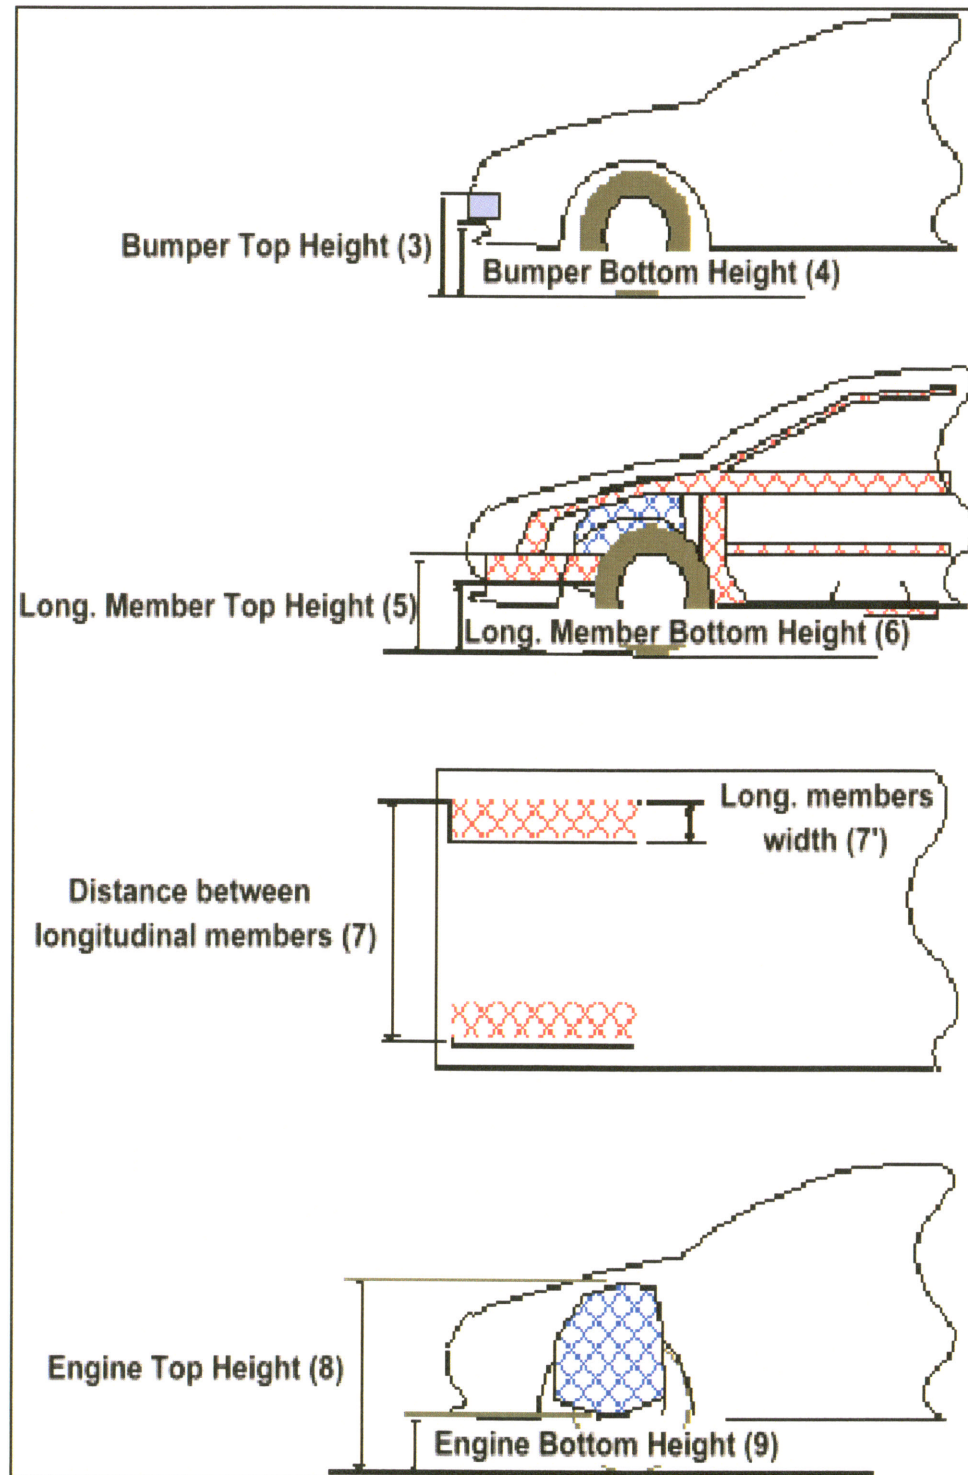


Figure 5.- Definition of the main resistant elements. Front elements.

Figure 6.-
Measurements of the
main resistant elements.
Front elements 1.

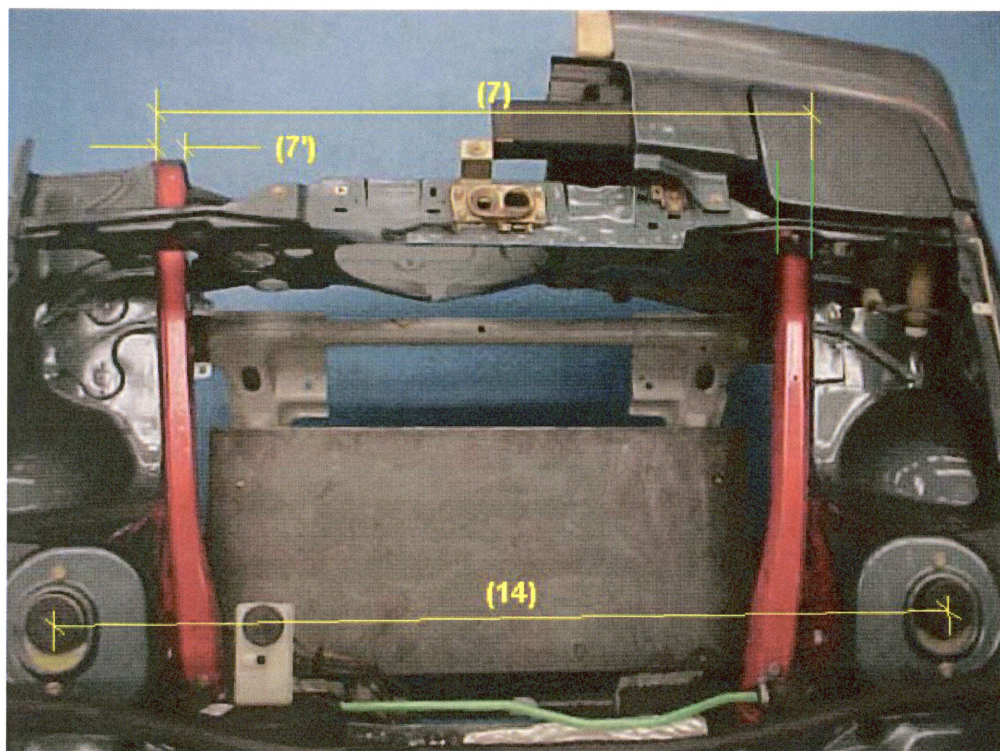
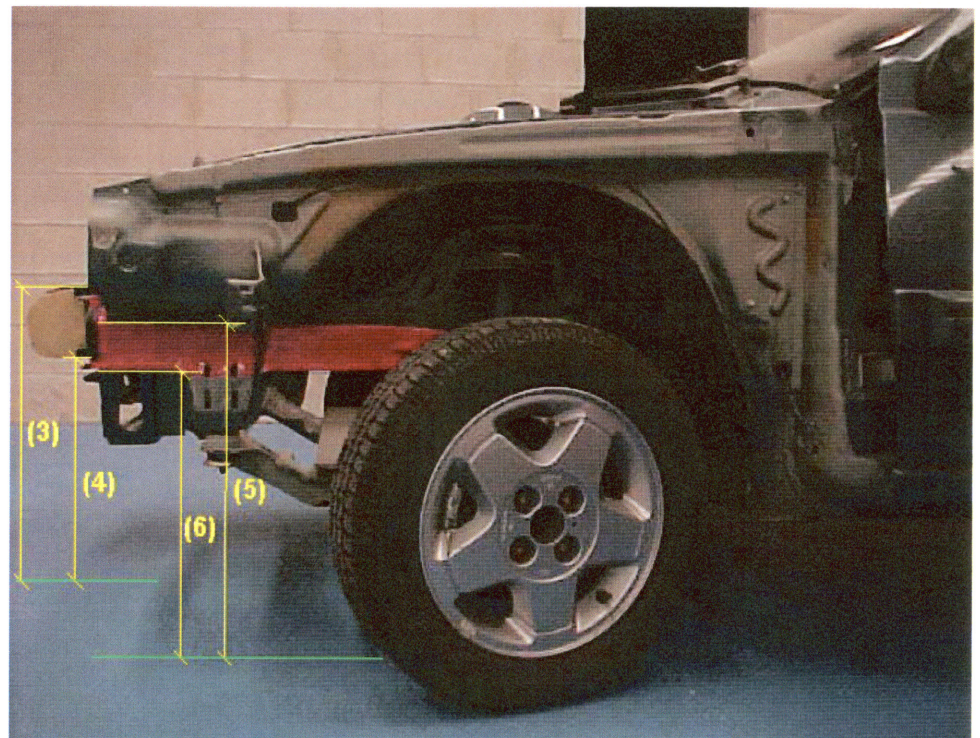


Figure 7.-
Measurements
of the main
resistant
elements. Front
elements 2.

Figure 8.-
Measurements of
the main resistant
elements. Front
elements 3.


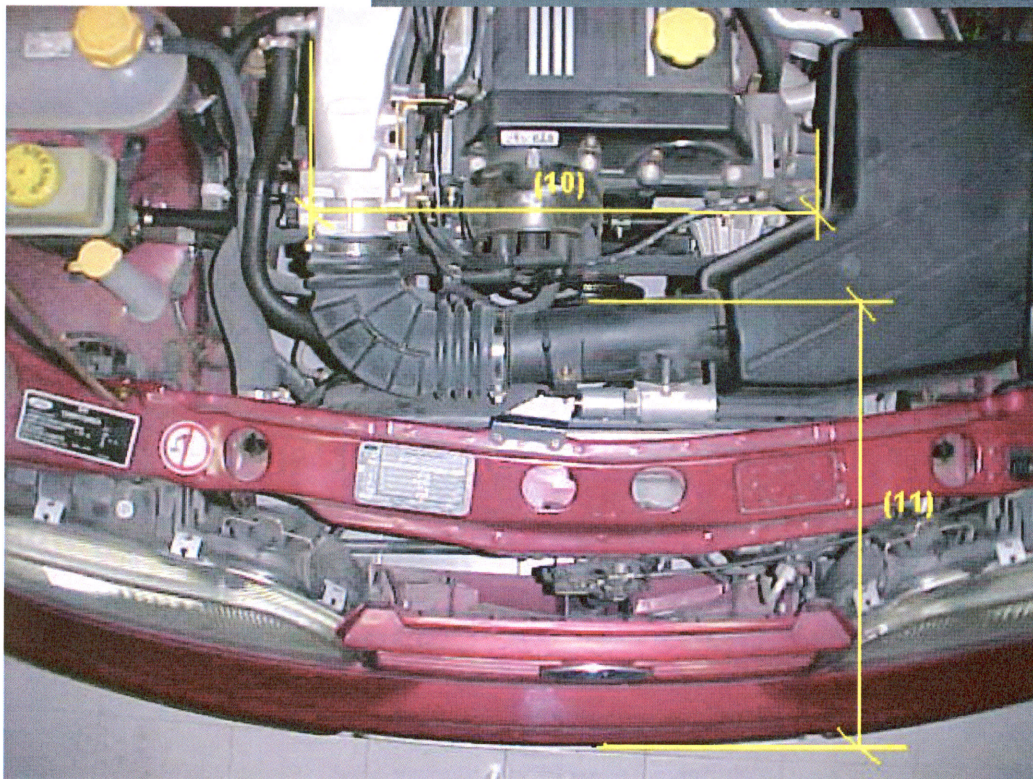


Figure 9.-
Definition of
the main
resistant
elements. Front
elements
(Longitudinal
engine).

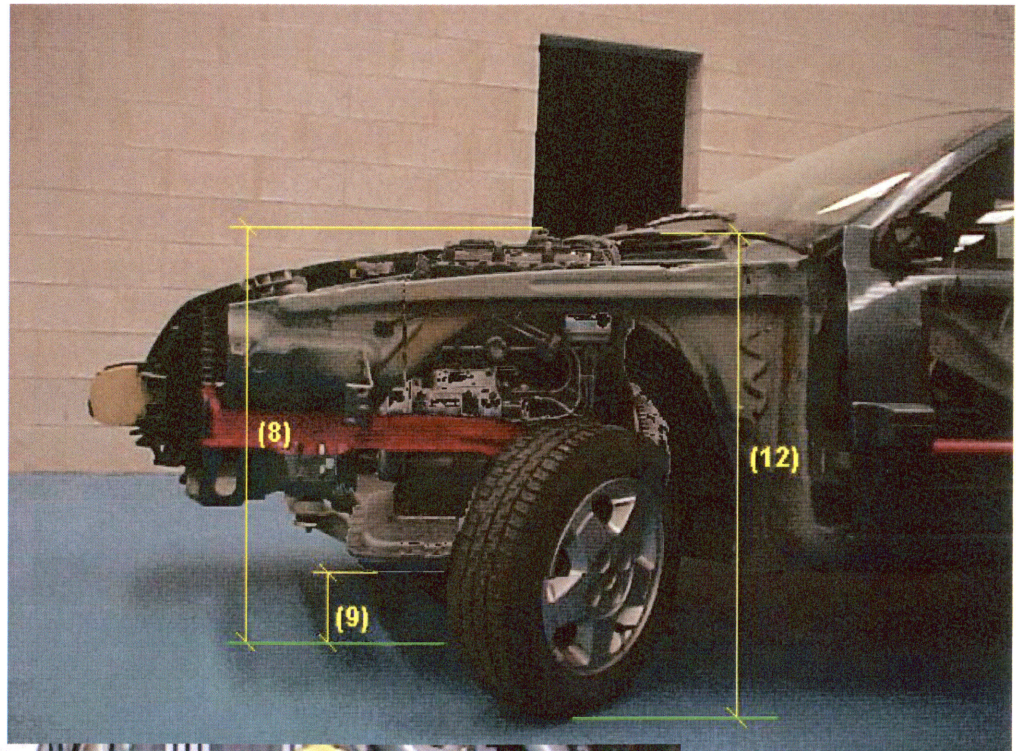

The procedure considered to measure these elements is described as follows, where it is indicated the location of these ones in the Excel Sheet (SURVEY.XLS) into brackets:

FRONT ELEMENTS

- **Total Length –(1)- (Side & Front Sheets - C column):** distance between the point in the front bumper further on and the point in the rear bumper further back.
- **Weight (Side & Front Sheets - D column):** mass, including an average driver weight (70 kg), and the fuel tank mass (at half-capacity).
- **Total Width –(2)- (Side & Front Sheets - E column):** distance between the outer side points in a transverse plane of the vehicle (middle plane between the front and rear axles).
- **Bumper bottom height –(4)- (Front Sheet G column):** distance between the ground and the lowest point on the front bumper, being a resistant member (aerodynamic elements under the front bumper are not considered).
- **Bumper top height –(3)- (Front Sheet H column):** distance between the ground and the highest point on the front bumper, being a resistant member (aerodynamic elements are not considered).
- **Longitudinal member top height –(5)- (Front Sheet I column):** distance between the ground and the highest point on the longitudinal members, measured approximately in the front bumper-longitudinal member joint (when accessible).
- **Longitudinal member bottom height –(6)- (Front Sheet J column):** distance between the ground and the lowest point on the longitudinal members, measured approximately in the front bumper-longitudinal member joint.
- **Distance between longitudinal members (Front Sheet K column):** transverse distance between extreme points in longitudinal members, measured approximately in the front bumper-longitudinal member joint.

Depending on the accessibility of these members, the extreme points are the inner points (I) or the outer points (O).

- **Longitudinal member width -7'- (Front Sheet L column):** width of one of the longitudinal members, measured approximately in the front bumper-longitudinal member joint.



- **Engine top height (8) (Front Sheet N column):** distance between the ground and the highest point on the engine that can be a resistant member in case of accident (usually, the highest point on the head, or the highest point of the inlet or exhaust manifolds).
- **Engine bottom height (9) (Front Sheet M column):** distance between the ground and the lowest point on the engine (usually, the lowest point on the crankcase).
- **Engine and Gearbox width (10) (Front Sheet O & P columns):**
 - *Transverse configuration engine:* distance between extreme points in the gearbox-cylinder block unit or others resistant members attached to the cylinder block unit, i.e. fan belts (from a front point of view).
 - *Longitudinal configuration engine:* distance between extreme points in the cylinder block unit (from a front point of view).
- **Front bumper - Engine distance (11) (Front Sheet Q column):** distance between the point in the front bumper further on and the point in the engine further on that is a resistant element, i.e. the further on point of the exhaust manifold placed in the front of the engine.
- **Front shock absorber fixing width (14) (Front Sheet R column):** transverse distance between the front shock absorber - body car joints.
- **Front shock absorber fixing height (12) (Front Sheet S column):** distance between the ground and the front shock absorber-body car joint.
- **Bonnet leading edge height (Front Sheet T column):** distance between the ground and the bonnet edge further on.

SIDE ELEMENTS

- **Front bumper - Front axle distance (15) (Side Sheet G column):** distance between the point in the front bumper further on and the middle point in the front tyre-road contact patch.
- **Front axle - A Pillar distance (16) (Side Sheet H column):** distance between the middle point in the front tyre-road contact patch and the point in the A-pillar further back.
- **A Pillar - B Pillar distance (17) (Side Sheet I column):** distance between the point in the A-pillar further back and the middle point in the B-pillar.
- **B Pillar - C Pillar distance (19) (Side Sheet J column):** distance between the middle point in the B-pillar and the point in the C-pillar further back (only 4/5-door vehicles).
- **B Pillar - Rear axle distance (18) (Side Sheet K column):** distance between the middle point in the B-pillar and the middle point in the rear tyre-road contact patch.
- **Roof sill bottom height (20) (Side Sheet L column):** distance between the ground and the lowest point on the roof sill, measured in the front door middle point.
- **Roof sill top height (21) (Side Sheet M column):** distance between the ground and the highest point on the roof sill (usually located in the sill-roof joint), measured in the front door middle point.
- **Floor sill bottom height (22) (Side Sheet N column):** distance between the ground and the lowest point on the floor sill, measured in the front door middle point.
- **Floor sill top height (23) (Side Sheet O column):** distance between the ground and the highest point on the floor sill, measured in the front door middle point.

NOTE

- N/A: dimension not available.