

REPORT NUMBER: 301-MGA-2011-010

**SAFETY COMPLIANCE TESTING FOR FMVSS 301R
FUEL SYSTEM INTEGRITY – REAR IMPACT**

**NISSAN MOTOR COMPANY LTD
2011 NISSAN JUKE S
NHTSA NUMBER: CB5202**

**PREPARED BY:
MGA RESEARCH CORPORATION
5000 WARREN ROAD
BURLINGTON, WI 53105**



Test Date: August 19, 2011

Final Report Date: September 8, 2011

FINAL REPORT

**PREPARED FOR:
U.S. DEPARTMENT OF TRANSPORTATION
NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION
ENFORCEMENT
OFFICE OF VEHICLE SAFETY COMPLIANCE
1200 NEW JERSEY AVENUE, S.E., NVS-220
WASHINGTON, D.C. 20590**

This final test report was prepared for the U.S. Department of Transportation, National Highway Traffic Safety Administration, in response to Contract Number DTNH22-06-C-00030.

This publication is distributed by the U.S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Prepared by: Joe Fleck
Joe Fleck, Project Engineer

Date: August 24, 2011

Reviewed by: David Winkelbauer
David Winkelbauer, Facility Director

Date: August 24, 2011

FINAL REPORT ACCEPTED BY:

Edward E. Chan

Digitally signed by Edward E. Chan
DN: cn=Edward E. Chan, o=National Highway Traffic Safety
Administration, ou=Office of Vehicle Safety Compliance,
email=ed.chan@dot.gov, c=US
Date: 2011.09.08 13:40:13 -04'00'

COTR, Rear Impact

9/8/2011
Date of Acceptance

Technical Report Documentation Page

1. Report No. 301-MGA-2011-010	2. Government Accession No.	3. Recipient's Catalog No.	
4. Title and Subtitle Final Report for Fuel System Integrity Test of a 2011 Nissan Juke S NHTSA No.: CB5202		5. Report Date August 24, 2011	
		6. Performing Organization Code MGA	
7. Author(s) Joe Fleck, Project Engineer		8. Performing Organization Report No. 301-MGA-2011-010	
9. Performing Organization Name and Address MGA Research Corporation 5000 Warren Road Burlington, WI 53105		10. Work Unit No.	
		11. Contract or Grant No. DTNH22-06-C-00030	
12. Sponsoring Agency Name and Address U.S. Department of Transportation National Highway Traffic Safety Administration Enforcement, Office of Vehicle Safety Compliance 1200 New Jersey Avenue, S.E., NVS-220 Washington, D.C. 20590		13. Type of Report and Period Covered Final Report August 19, 2011 – September 8, 2011	
		14. Sponsoring Agency Code NVS-220	
15. Supplementary Notes			
16. Abstract A rear impact was conducted on a 2011 Nissan Juke S at MGA Research Corporation on August 19, 2011. This test was conducted to obtain data indicant of FMVSS 301R. The impact velocity was 79.5 km/h. The ambient temperature at the time of impact was 27 degrees Celsius.			
17. Key Words Fuel System Integrity Test 2011 Nissan Juke S NHTSA No: CB5202		18. Distribution Statement Copies of this report are available from: National Highway Traffic Safety Admin., Technical Ref. Division, 1200 New Jersey Avenue, SE Washington, D.C. 20590	
19. Security Classif. (of this report) Unclassified	20. Security Classif. (of this page) Unclassified	21. No. of Pages 57	22. Price

TABLE OF CONTENTS

<u>Section</u>		<u>Page No</u>
1	Purpose and Summary of Test	1
2	Data Sheets	2
<u>Data Sheet No.</u>		<u>Page No.</u>
1	Test Vehicle Specifications	2
2	Pre-Test Data	4
3	Moving Barrier Data	6
4	Post-Test Data	7
5	Static Rollover Test Data	8
<u>Form No.</u>		
1	Test Vehicle Information	10
<u>Appendix</u>		
A	Photographs	A

SECTION 1

PURPOSE AND SUMMARY OF TEST

PURPOSE

This rear impact test is sponsored by the National Highway Traffic Safety Administration (NHTSA) under contract number DTNH22-06-C-00030. The purpose of this test is to reduce deaths and injuries occurring from fires that result from fuel spillage during and after motor vehicle crashes and resulting from ingestion of fuels during siphoning.

SUMMARY

A 2011 Nissan Juke S was impacted by a Moving Deformable Barrier (MDB) at a velocity of 79.5 km/h. The test was performed at MGA Research Corporation on August 19, 2011. Pre-and post-test photographs of the vehicle and dummies can be found in Appendix A.

One real-time camera and five high-speed cameras were used to document the impact event.

- Left Rear Half 1000 fps
- Right Rear Half 1000 fps
- Overhead Overall 1000 fps
- Left Overall 1000 fps
- Right Overall 1000 fps
- Real Time Pan 30 fps

Two ballast Part 572E, 50th percentile male anthropomorphic test devices (ATDs) were placed in the driver and right-front passenger seating positions according to dummy placement instructions specified in the Laboratory Indicant Test Procedure.

There was no Stoddard Solvent leakage after the event or during any phase of the static rollover.

The vehicle appeared to comply with all the requirements of FMVSS No. 301 "Fuel System Integrity."

SECTION 2
DATA SHEETS

DATA SHEET NO. 1
TEST VEHICLE SPECIFICATIONS

Test Vehicle: 2011 Nissan Juke S NHTSA No.: CB5202
Test Program: FMVSS 301 Fuel System Integrity Test Date: 8/19/2011

TEST VEHICLE INFORMATION

Manufacturer	Nissan Motor Company, LTD
Model	Juke S
Body Style	Passenger
Major Options	None
NHTSA No.	CB5202
VIN	JN8AF5MR9BT010122
Color	Gun Metallic
Delivery Date	7/26/2011
Odometer Reading (mile)	51
Dealer	Rosen Nissan
Transmission	Automatic
Final Drive	Front Wheel Drive
Number of Cylinders	4
Engine Displacement (L)	1.6
Engine Placement	Lateral

DATA FROM VEHICLE'S CERTIFICATION LABEL

Manufactured By	Nissan Motor Company LTD
Date of Manufacture	12/10

GVWR (kg)	1800
GAWR Front (kg)	990
GAWR Rear (kg)	840

VEHICLE CAPACITY DATA

Measured Parameter	Front	Rear	Third	Total
Type of Seats	Bucket	Bench		
Number of Occupants	2	3		5
Capacity Wt. (VCW) (kg)				390
Number of Occupants x 68 kg.				340
Cargo Wt. (RCLW) (kg)				50

DATA SHEET NO. 1 (continued)**TEST VEHICLE SPECIFICATIONS**Test Vehicle: 2011 Nissan Juke SNHTSA No.: CB5202Test Program: FMVSS 301 Fuel System IntegrityTest Date: 8/19/2011**DATA FROM VEHICLE'S TIRE PLACARD**

Measured Parameter	Front	Rear
Maximum Tire Pressure (kPa)	308	308
Cold Pressure (kPa)	250	250
Recommended Tire Size	215/55R17	215/55R17
Recommended Load Range	93V	93V
Tire Size on Vehicle	215/55R17	215/55R17
Tire Manufacturer	Goodyear	Goodyear
Location of Placard of Vehicle	Driver Door Post	
Type of Spare Tire (full size/space saver)	Space Saver	

DATA SHEET NO. 2**PRE-TEST DATA**Test Vehicle: 2011 Nissan Juke SNHTSA No.: CB5202Test Program: FMVSS 301 Fuel System IntegrityTest Date: 8/19/2011**WEIGHT OF TEST VEHICLE**

	Units	As Delivered (UVW) (Axle)			As Tested (ATW) (Axle)		
		Front	Rear	Total	Front	Rear	Total
Left	kg	420.0	254.9		465.4	315.7	
Right	kg	428.2	241.3		459.5	294.4	
Ratio	%	63.1	36.9		60.3	39.7	
Totals	kg	848.2	496.2	1344.4	924.9	610.1	1535.0

CALCULATION OF TARGET TEST WEIGHT (TTW)

Measured Parameter	Units	Value
Total Delivered Weight (UVW)	kg	1344.4
Rated Cargo/Luggage Weight (RCLW)	kg	50
Weight of 2 P572E ATDs	kg	148
Calculated Vehicle Target Weight (TVTWT)	kg	1542.4

Vehicle Wheelbase	2535 mm
Vehicle Width	1772 mm
Weight of Ballast Secured in Rear Seat	46.3 kg
Method of Securing Ballast	Ratchet Straps
Vehicle Components Removed for Weight Reduction	None

VEHICLE ATTITUDES

	Units	LF	RF	LR	RR
As Delivered	mm	725	730	750	743
As Tested	mm	717	720	727	729

DATA SHEET NO. 2 (continued)**PRE-TEST DATA**

Test Vehicle: 2011 Nissan Juke S NHTSA No.: CB5202
Test Program: FMVSS 301 Fuel System Integrity Test Date: 8/19/2011

FUEL SYSTEM DATA

	Units: Liters
Usable Capacity of "Standard Tank" (Owner's Manual)	50.0
Usable Capacity Figure Furnished by COTR	50.0
Usable Capacity of "Optional" Tank	
92-94% of Usable Capacity	46.0 to 47.0
Actual Test Volume (entire fuel system filled)	46.8

Test Fluid Type	Stoddard Solvent
Test Fluid Kinematic Viscosity (centistokes)	2.1 cSt @ 20° C
Test Fluid Color	Purple
Type of Vehicle Fuel Pump	Electrical
Activate Electric Fuel Pump Operation with Ignition Switch ON, but Engine OFF	Yes

Comments (noticeable attributes of fuel system components, capacity, etc.)	None
--	------

DATA SHEET NO. 3
MOVING BARRIER DATA

Test Vehicle: 2011 Nissan Juke S NHTSA No.: CB5202
 Test Program: FMVSS 301 Fuel System Integrity Test Date: 8/19/2011

MOVING BARRIER'S TEST WEIGHT

	Units	Front	Rear	Total
Left	kg	401.4	279.6	
Right	kg	368.9	312.5	
Ratio	%	56.0	44.0	
Totals	kg	770.3	592.1	1362.4

Tires (Mfr, line, size)	Kumho
Tire Pressure (kPa)	220
Brake Abort System (Yes/No)?	Yes
Date of Last Calibration	6/24/11

DATA SHEET NO. 4**POST-TEST DATA**

Test Vehicle: 2011 Nissan Juke S NHTSA No.: CB5202
Test Program: FMVSS 301 Fuel System Integrity Test Date: 8/19/2011

IMPACT VELOCITY

	Units: km/h
Required Impact Velocity	80.0
Actual Impact Velocity (Trap No. 1)	79.5
Actual Impact Velocity (Trap No. 2)	79.5
Average Impact Speed	79.5

Temperature at Time of Impact (°C)	29
Test Time	9:12 am

WELDING ROD IMPACT POINT

	Units: mm
Vertical distance from target center (+ above target / - below target)	13 up
Horizontal distance from target center (+ to the right / - to the left)	7 left


DATA SHEET NO. 5 **STATIC ROLLOVER TEST DATA**

Test Vehicle: 2011 Nissan Juke S NHTSA No.: CB5202
 Test Program: FMVSS 301 Fuel System Integrity Test Date: 8/19/2011

STODDARD SOLVENT SPILLAGE MEASUREMENT

- A. From impact until vehicle motion ceases: 0 g
 (Maximum Allowable = 28 grams)
- B. For the 5 minute period after motion ceases: 0 g
 (Maximum Allowable = 28 grams)
- C. For the following 25 minutes: 0 g
 (Maximum Allowable = 28 grams/minute)
- D. Spillage: None

FMVSS 301 STATIC ROLLOVER DATA

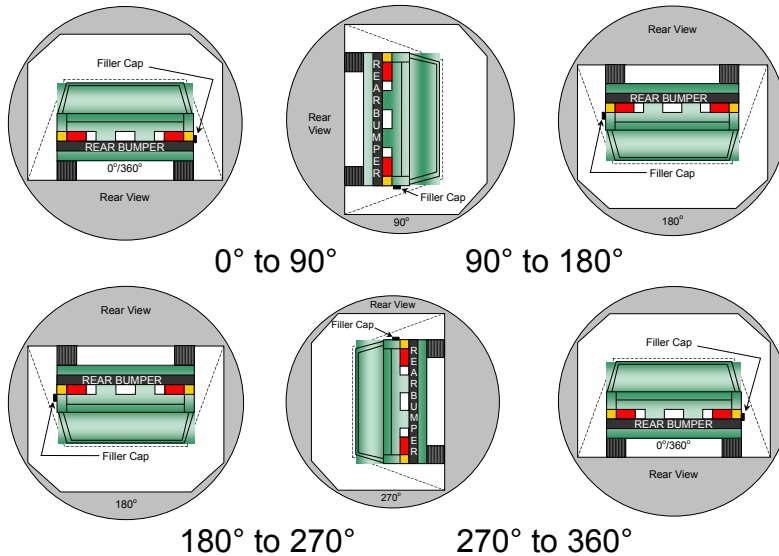

1. The specified fixture rollover rate for each 90° of rotation is 60 to 180 seconds.

2. The position hold time at each position is 300 seconds (minimum).

3. Details of Stoddard Solvent spillage locations: **Not Applicable**

DATA SHEET NO. 5 (continued)

STATIC ROLLOVER TEST DATA

Test Vehicle: 2011 Nissan Juke S

NHTSA No.: CB5202

Test Program: FMVSS 301 Fuel System Integrity

Test Date: 8/19/2011

STODDARD SOLVENT SPILLAGE MEASUREMENT

Hold Time = 5 minutes at all intervals

0° TO 90° Rotation Time (sec) = 120 sec

Test Phase	Spillage (g)	Spillage Details
First 5 minutes from onset of rotation	0	
Sixth minute from onset of rotation	0	
Seventh minute from onset of rotation	0	
Eight minute if required	N/A	

90° TO 180° Rotation Time (sec) = 112 sec

Test Phase	Spillage (g)	Spillage Details
First 5 minutes from onset of rotation	0	
Sixth minute from onset of rotation	0	
Seventh minute from onset of rotation	0	
Eight minute if required	N/A	

180° TO 270° Rotation Time (sec) = 109 sec

Test Phase	Spillage (g)	Spillage Details
First 5 minutes from onset of rotation	0	
Sixth minute from onset of rotation	0	
Seventh minute from onset of rotation	0	
Eight minute if required	N/A	

270° TO 360° Rotation Time (sec) = 118 sec

Test Phase	Spillage (g)	Spillage Details
First 5 minutes from onset of rotation	0	
Sixth minute from onset of rotation	0	
Seventh minute from onset of rotation	0	
Eight minute if required	N/A	


FORM 1 **TEST VEHICLE INFORMATION**

Test Vehicle: 2011 Nissan Juke S
Test Program: FMVSS 301 Fuel System Integrity

NHTSA No.: CB5202
Test Date: 8/19/2011

NORMAL DESIGN RIDING POSITION

With the seat in the mid fore-aft seat track position the angle of the driver's seat back when it is in the nominal riding position is set at the seventh step, forward most defined as 0.

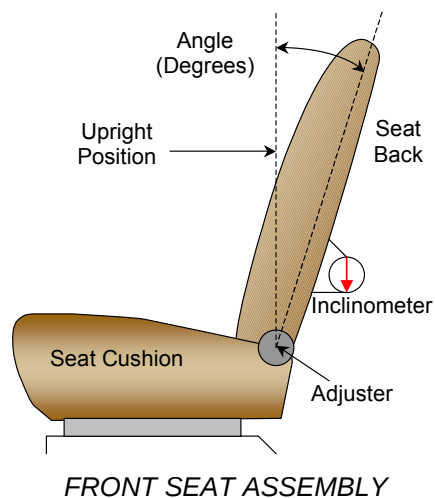

Driver Seat Back Angle	7 th step, 1 st as 0
Passenger Seat Back Angle	7 th step, 1 st as 0

SEAT FORE/AFT POSITIONING

	Total Fore/Aft Travel	Placed in Position #
Driver Seat	24 detents	10 th detent forward most, 1 st as 0
Passenger Seat	24 detents	12 th detent forward most, 1 st as 0

D-RING ADJUSTMENT

The driver and passenger D-rings were full up.

STEERING COLUMN ADJUSTMENT

The steering column was placed in the mid position.

APPENDIX A
PHOTOGRAPHS

TABLE OF PHOTOGRAPHS

Page No.

Photo No. 1.	Vehicle's Certification Label	A-1
Photo No. 2.	Vehicle's Tire Placard	A-2
Photo No. 3.	Pre-Test Front View of Vehicle	A-3
Photo No. 4.	Post-Test Front View of Vehicle	A-4
Photo No. 5.	Pre-Test Left Side View of Vehicle	A-5
Photo No. 6.	Post-Test Left Side View of Vehicle	A-6
Photo No. 7.	Pre-Test Left Rear Close-up View of Vehicle	A-7
Photo No. 8.	Post-Test Left Rear Close-up View of Vehicle	A-8
Photo No. 9.	Pre-Test Right Side View of Vehicle	A-9
Photo No. 10.	Post-Test Right Side View of Vehicle	A-10
Photo No. 11.	Pre-Test Right Rear Close-up View of Vehicle	A-11
Photo No. 12.	Post-Test Right Rear Close-up View of Vehicle	A-12
Photo No. 13.	Pre-Test Rear View of Vehicle	A-13
Photo No. 14.	Post-Test Rear View of Vehicle	A-14
Photo No. 15.	Pre-Test $\frac{3}{4}$ Frontal View From Right Side of Vehicle	A-15
Photo No. 16.	Post-Test $\frac{3}{4}$ Frontal View From Right Side of Vehicle	A-16
Photo No. 17.	Pre-Test $\frac{3}{4}$ Rear View From Right Side of Vehicle	A-17
Photo No. 18.	Post-Test $\frac{3}{4}$ Rear View From Right Side of Vehicle	A-18
Photo No. 19.	Pre-Test $\frac{3}{4}$ Rear View From Left Side of Vehicle	A-19
Photo No. 20.	Post-Test $\frac{3}{4}$ Rear View From Left Side of Vehicle	A-20
Photo No. 21.	Pre-Test Impact Point	A-21
Photo No. 22.	Post-Test Impact Point	A-22
Photo No. 23.	Pre-Test Underbody View 1	A-23
Photo No. 24.	Post-Test Underbody View 1	A-24
Photo No. 25.	Pre-Test Underbody View 2	A-25
Photo No. 26.	Post-Test Underbody View 2	A-26
Photo No. 27.	Pre-Test Underbody View 3	A-27

Page No.

Photo No. 28.	Post-Test Underbody View 3	A-28
Photo No. 29.	Pre-Test Front View of MDB	A-29
Photo No. 30.	Post-Test Front View of MDB	A-30
Photo No. 31.	Pre-Test $\frac{3}{4}$ Right Side View of MDB	A-31
Photo No. 32.	Post-Test $\frac{3}{4}$ Right Side View of MDB	A-32
Photo No. 33.	Pre-Test $\frac{3}{4}$ Left Side View of MDB	A-33
Photo No. 34.	Post-Test $\frac{3}{4}$ Left Side View of MDB	A-34
Photo No. 35.	Pre-Test Top View of MDB	A-35
Photo No. 36.	Post-Test Top View of MDB	A-36
Photo No. 37.	Static Rollover at 90 Degrees	A-37
Photo No. 38.	Static Rollover at 180 Degrees	A-38
Photo No. 39.	Static Rollover at 270 Degrees	A-39
Photo No. 40.	Static Rollover at 360 Degrees	A-40

JN8AF5MR9BT010122



MED BY: NISSAN MOTOR CO., LTD.

DATE 12/10 3968 LBS.

GVWR

GAWR FR: 2183 LBS.

WITH P215/55R17 TRES.

17X7 RIMS. AT36PSI

COLD SINGLE.

GAWR RR: 1852 LBS.

WITH P215/55R17 TRES.

17X7 RIMS. AT36PSI

COLD SINGLE.

THIS VEHICLE CONFORMS
TO ALL APPLICABLE FEDERAL MOTOR VEHICLE SAFETY AND THEFT PREVENTION STANDARDS IN EFFECT ON THE DATE OF MANUFACTURE SHOWN ABOVE.

VIN: JN8AF5MR9BT010122

TYPE: MPV

COLOR	TRIM	TRANS
KAD	G	REOF10B
AXLE	ENGINE	
GN57	MR16 (DDT)	1618CC

Vehicle's Certification Label



TIRE AND LOADING INFORMATION
RENSEIGNEMENTS SUR LES PNEUS ET LE CHARGEMENT

SEATING CAPACITY NOMBRE DE PLACES	TOTAL TOTAL	5	FRONT AVANT	2	REAR ARRIÈRE	3
--------------------------------------	----------------	---	----------------	---	-----------------	---

The combined weight of occupants and cargo should never exceed **390** kg or **859** lbs.
Le poids total des occupants et du chargement ne doit jamais dépasser **390** kg ou **859** lb.

TIRE PNEU	SIZE DIMENSIONS	COLD TIRE PRESSURE PRESSION DES PNEUS À FROID
FRONT AVANT	P215/55R17 93V	250kPa , 36PSI
REAR ARRIÈRE	P215/55R17 93V	250kPa , 36PSI
SPARE DE SECOURS	T135/80D16 101M	420kPa , 60PSI

**SEE OWNER'S
MANUAL FOR
ADDITIONAL
INFORMATION**
**VOIR LE MANUEL
DE L'USAGER
POUR PLUS DE
RENSEIGNEMENTS**

TQ 1KA1B

Vehicle's Tire Placard



Pre-Test Front View of Vehicle



Post-Test Front View of Vehicle



Pre-Test Left Side View of Vehicle



Post-Test Left Side View of Vehicle



Pre-Test Left Rear Close-up View of Vehicle



Post-Test Left Rear Close-up View of Vehicle



Pre-Test Right Side View of Vehicle



Post-Test Right Side View of Vehicle




Pre-Test Right Rear Close-up View of Vehicle



Post-Test Right Rear Close-up View of Vehicle



Pre-Test Rear View of Vehicle

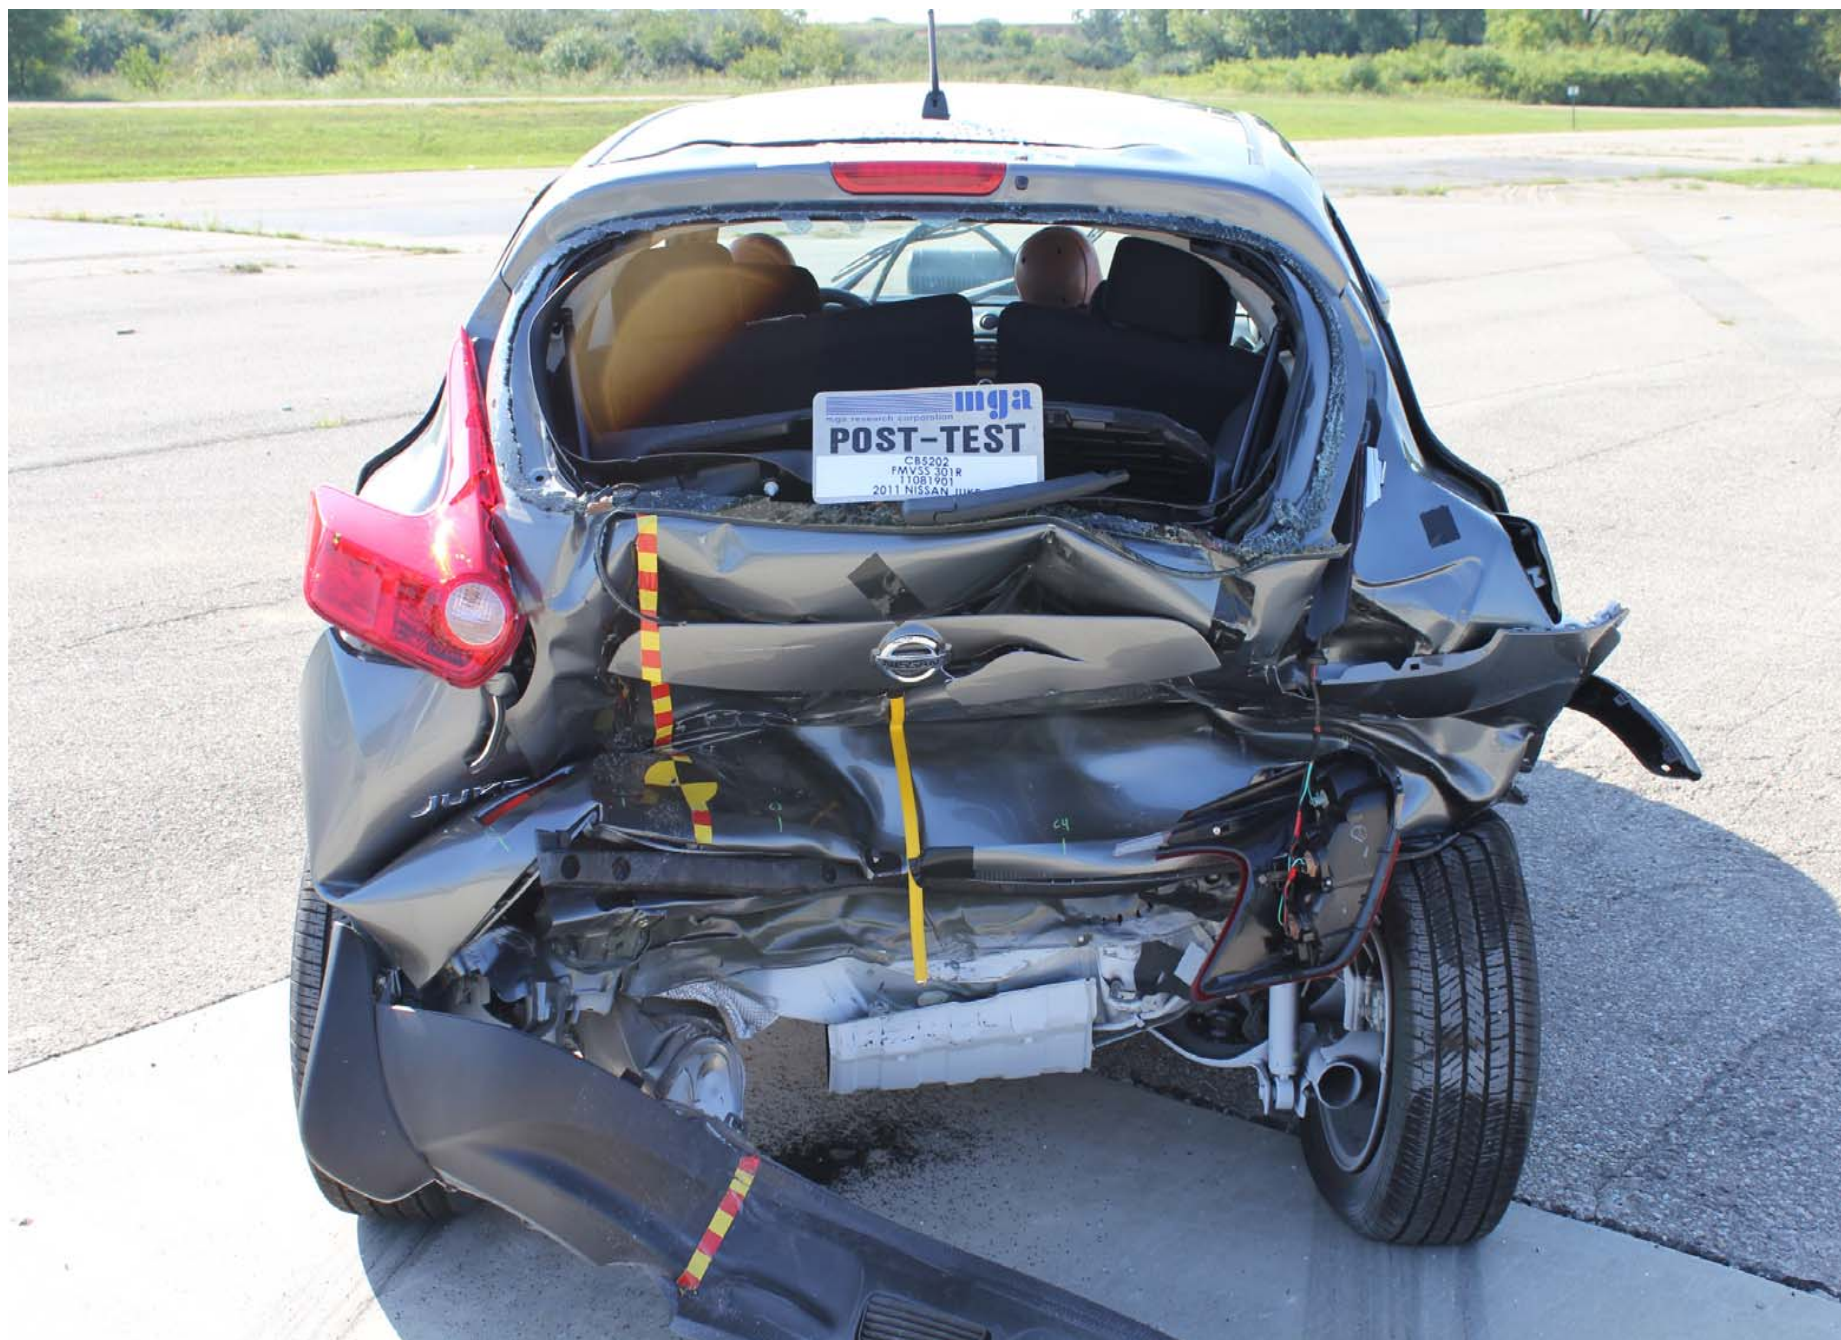

Post-Test Rear View of Vehicle



Pre-Test ¼ Frontal View From Right Side of Vehicle



Post-Test $\frac{3}{4}$ Frontal View From Right Side of Vehicle




Pre-Test ¾ Rear View From Right Side of Vehicle



Post-Test $\frac{3}{4}$ Rear View From Right Side of Vehicle



Pre-Test $\frac{3}{4}$ Rear View From Left Side of Vehicle

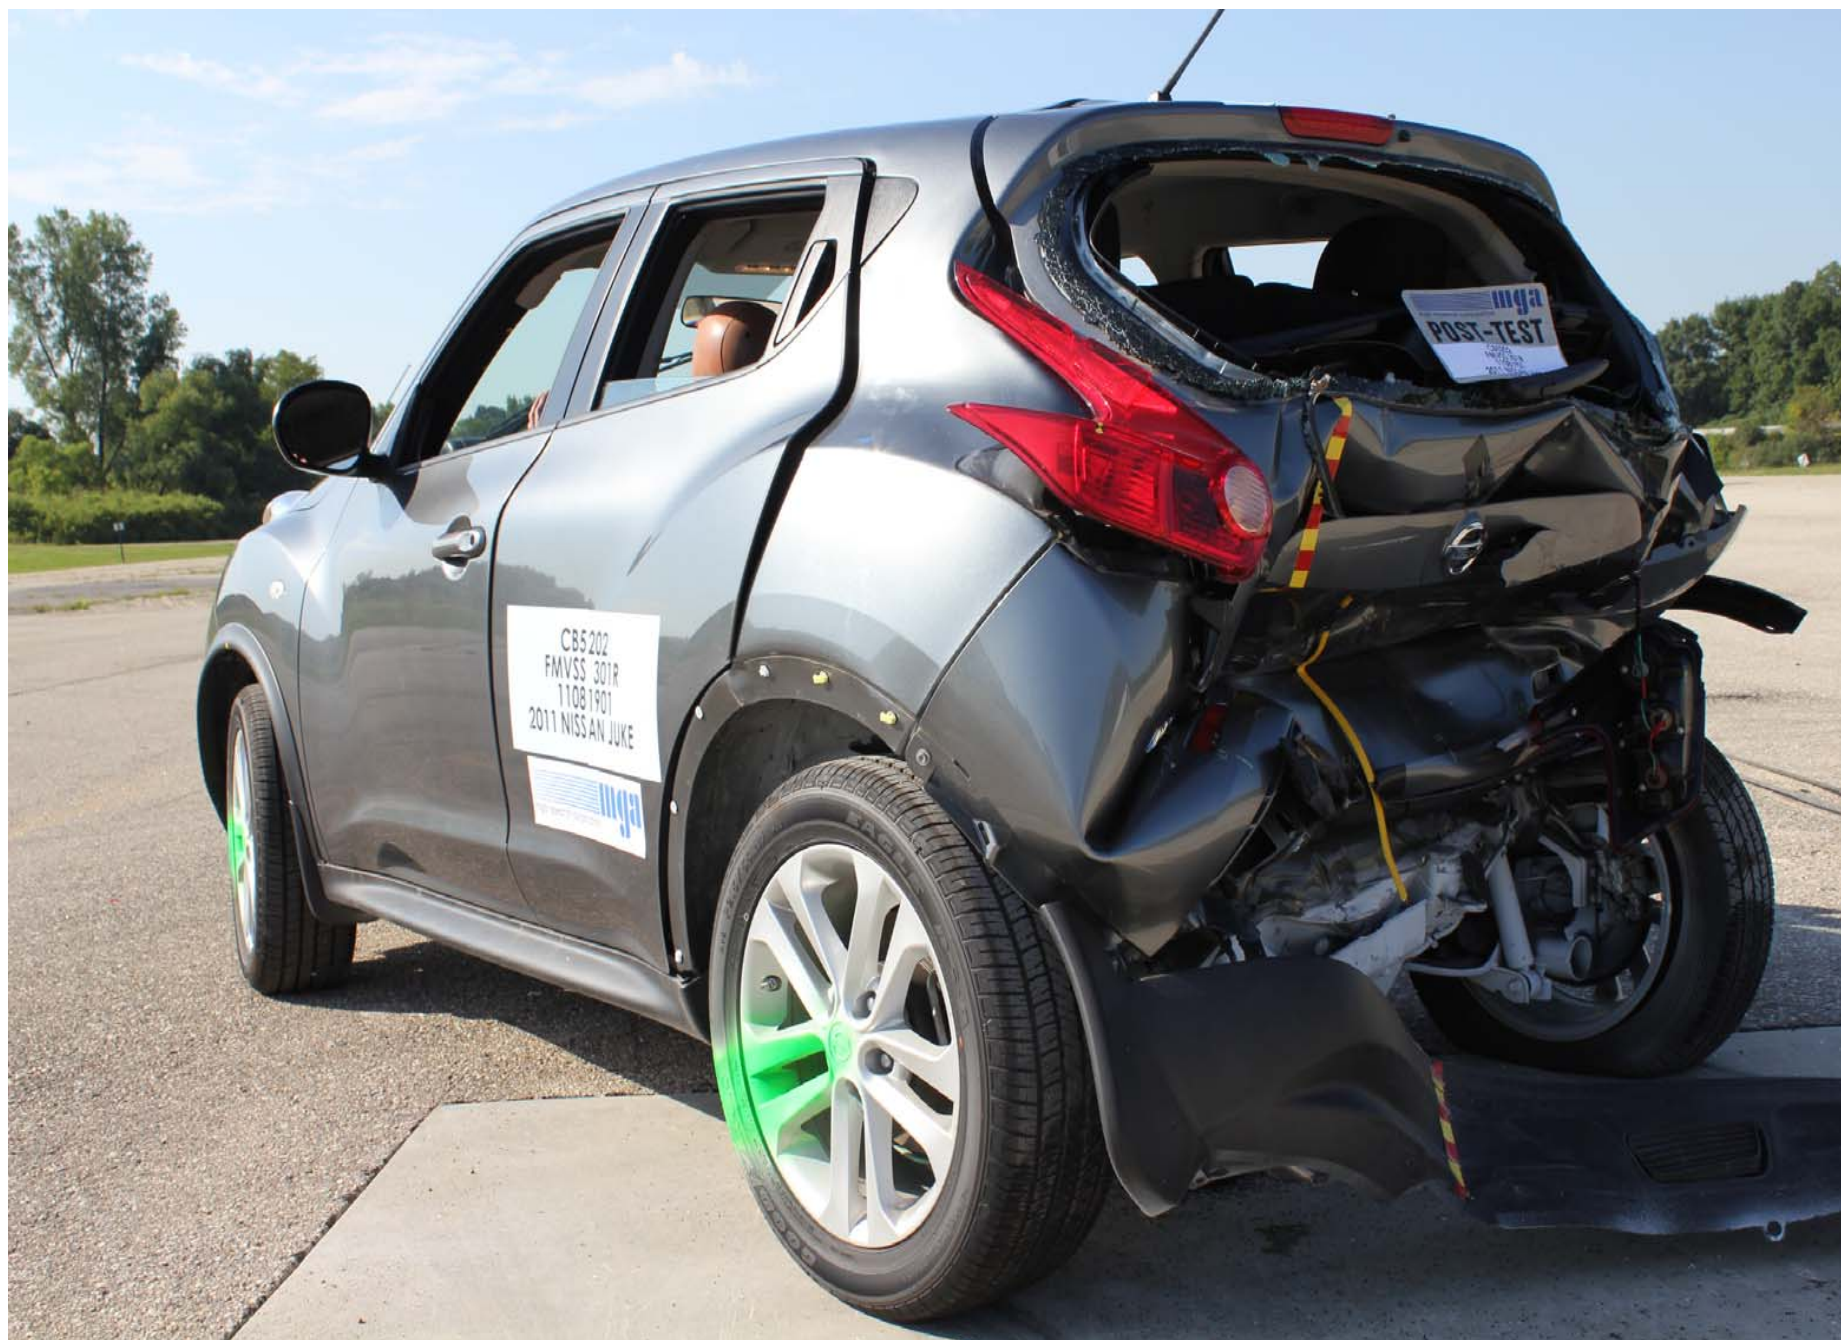


Post-Test ¾ Rear View From Left Side of Vehicle




Pre-Test Impact Point




Post-Test Impact Point

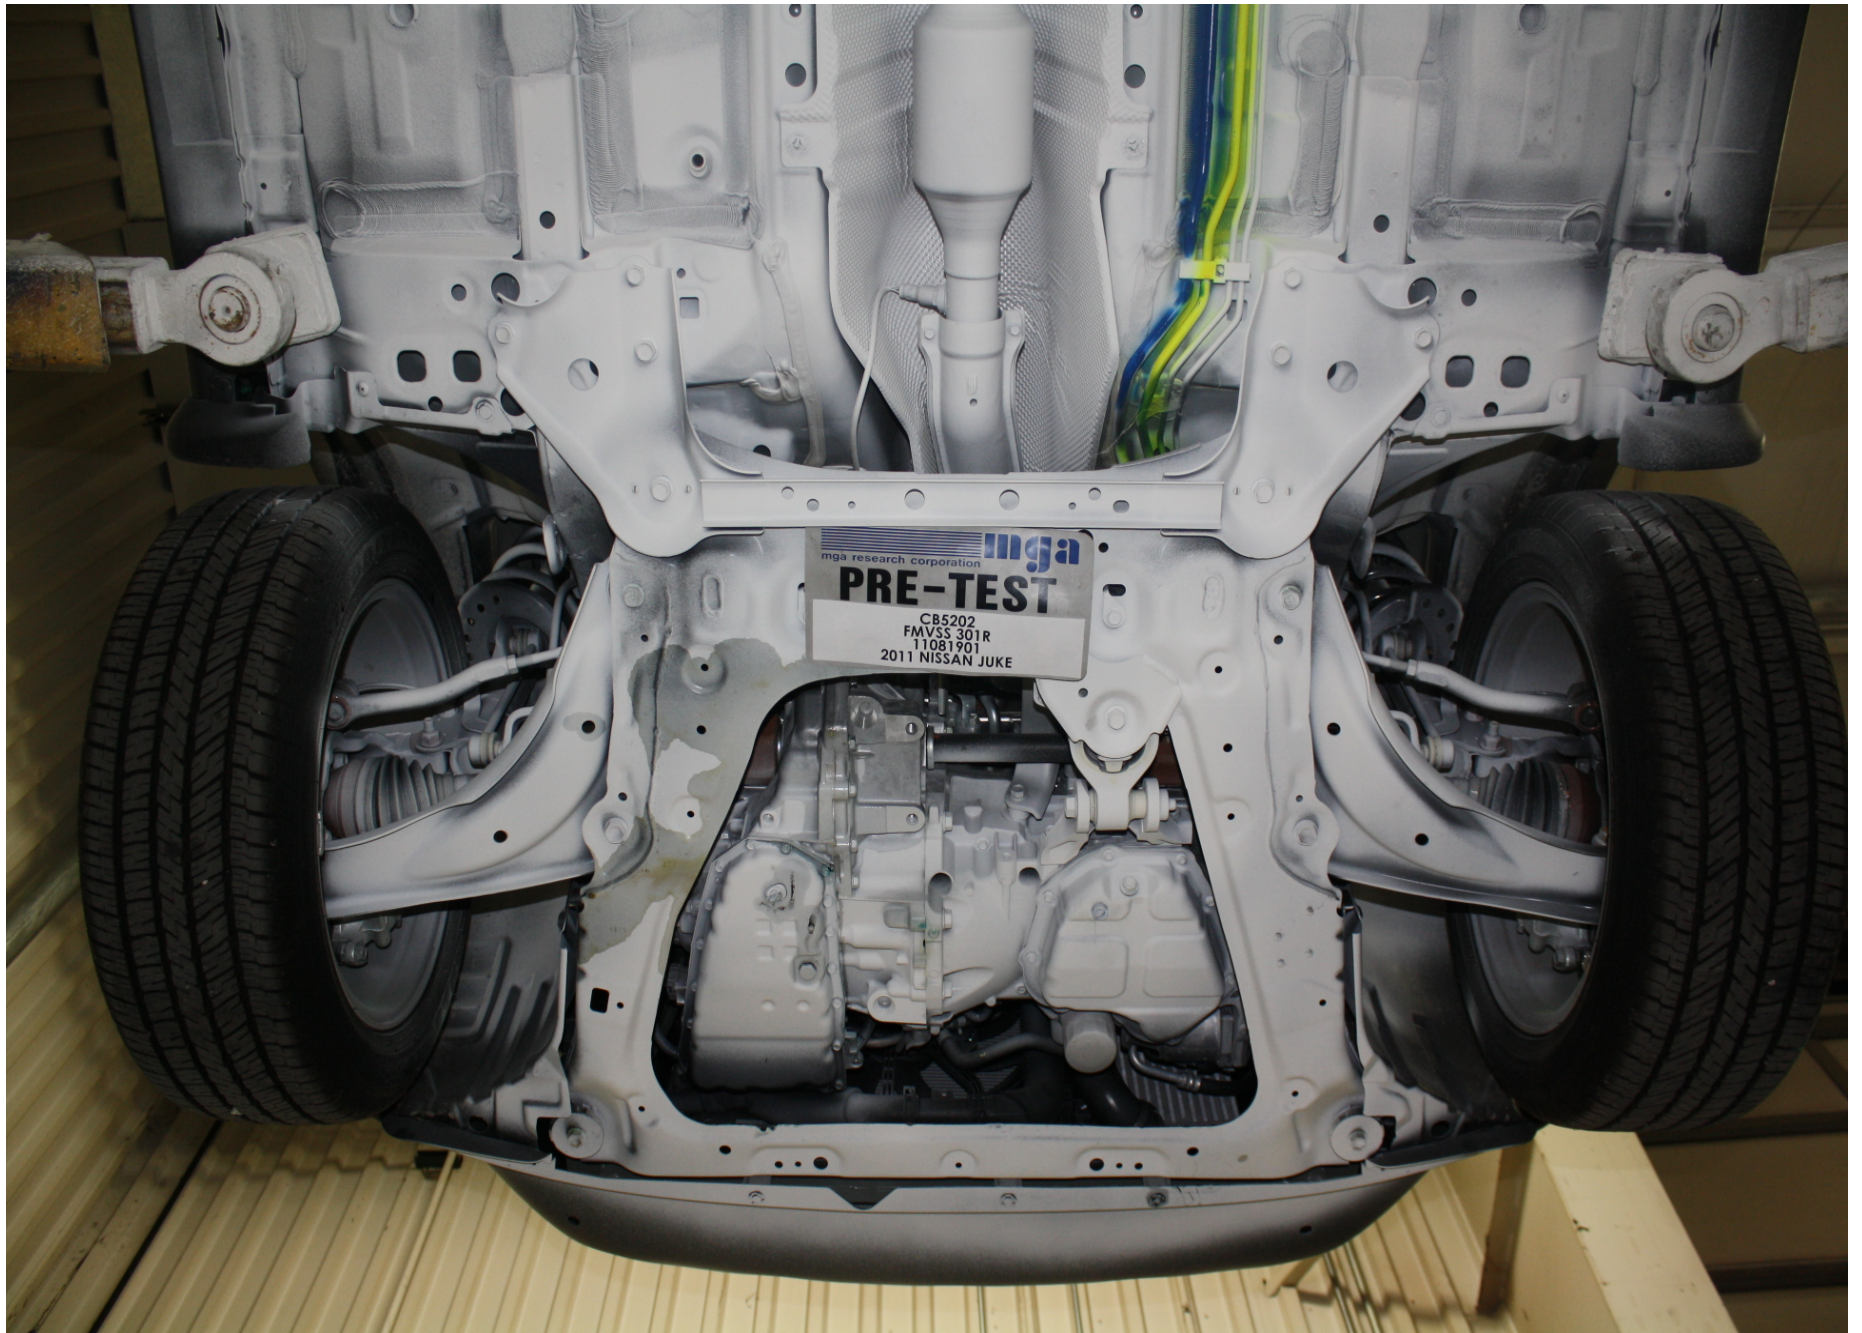


Pre-Test Underbody View 1

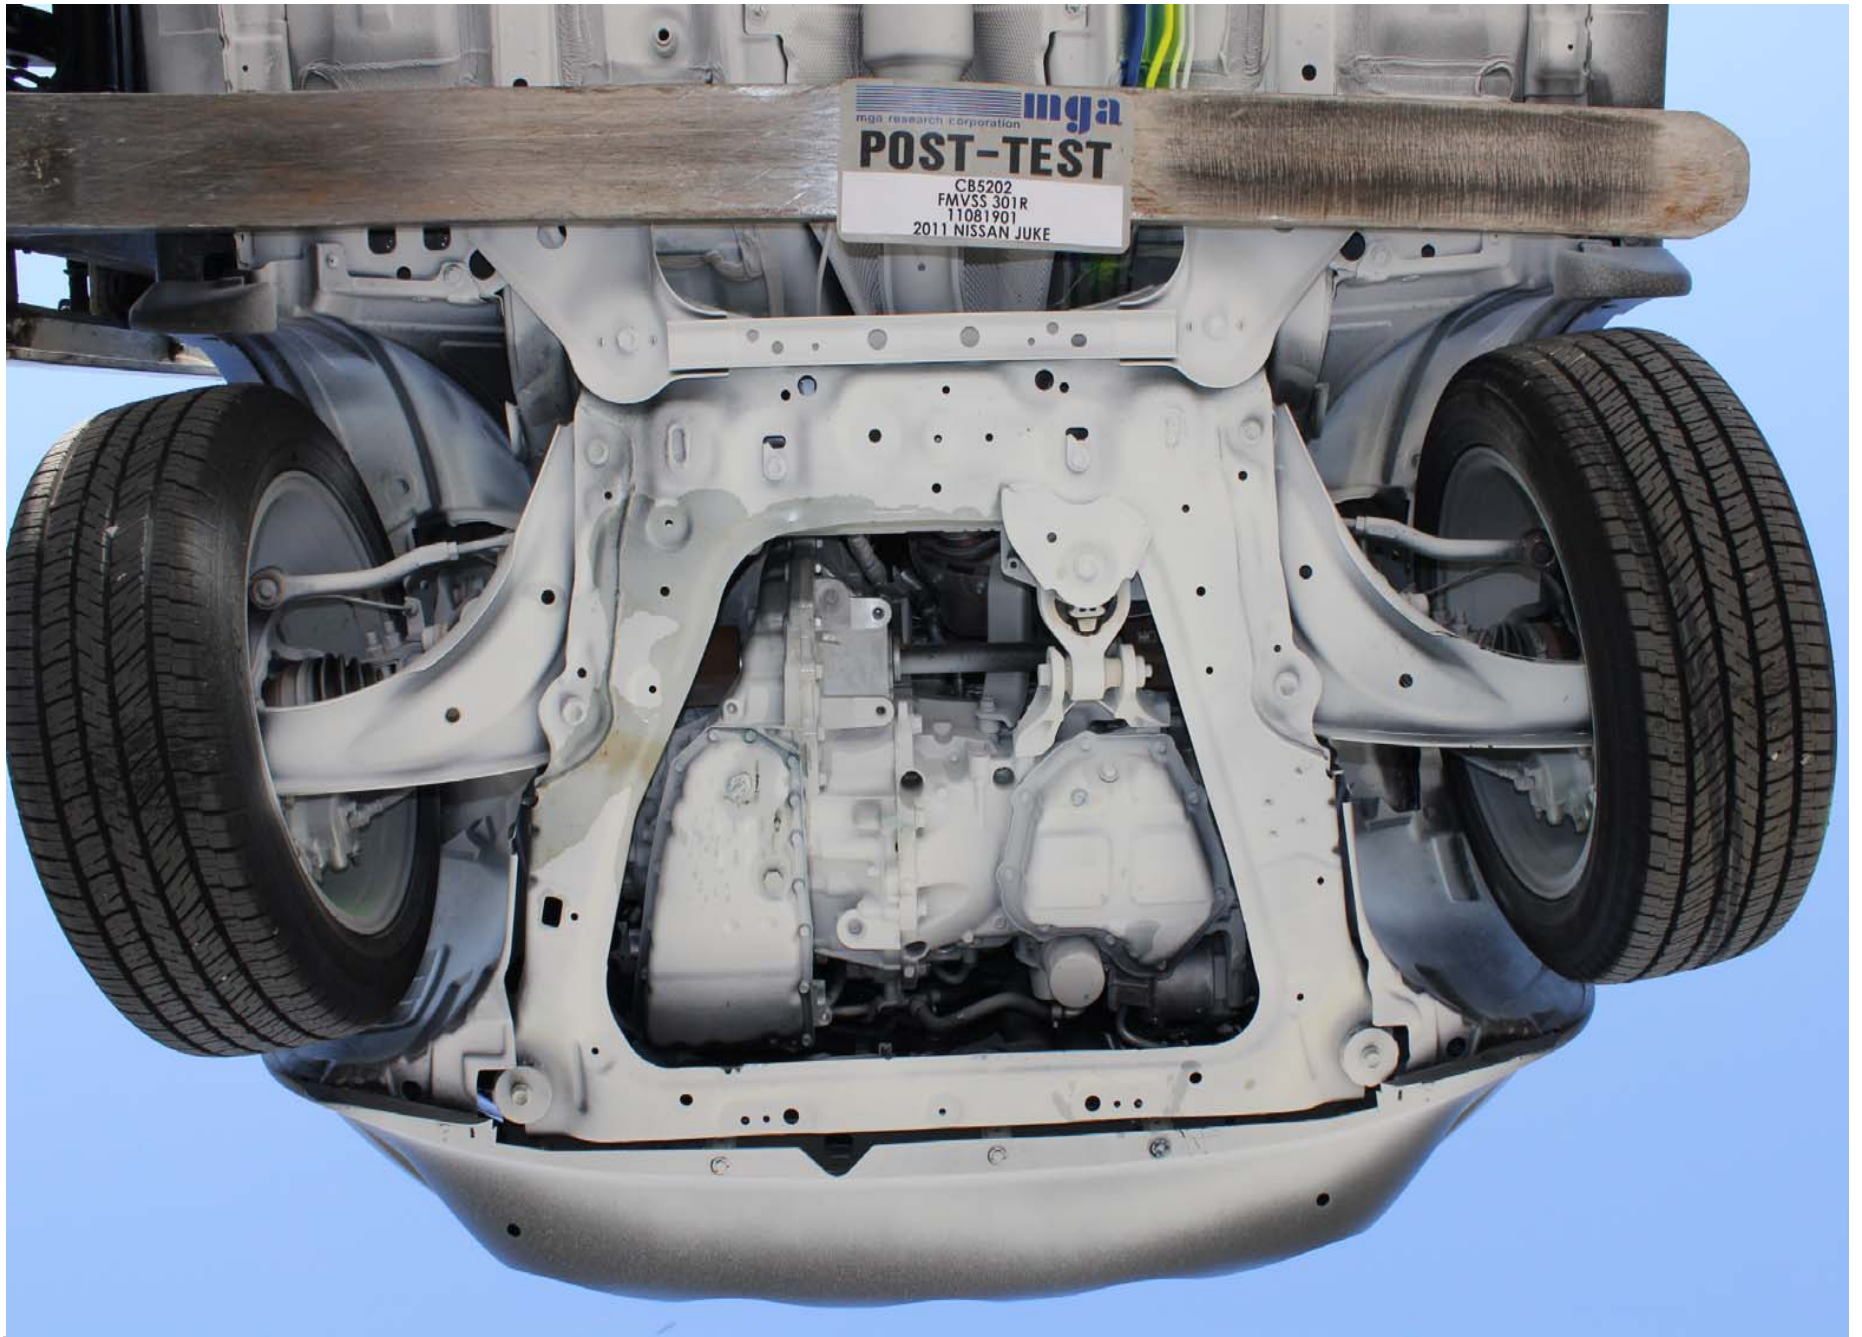


Post-Test Underbody View 1

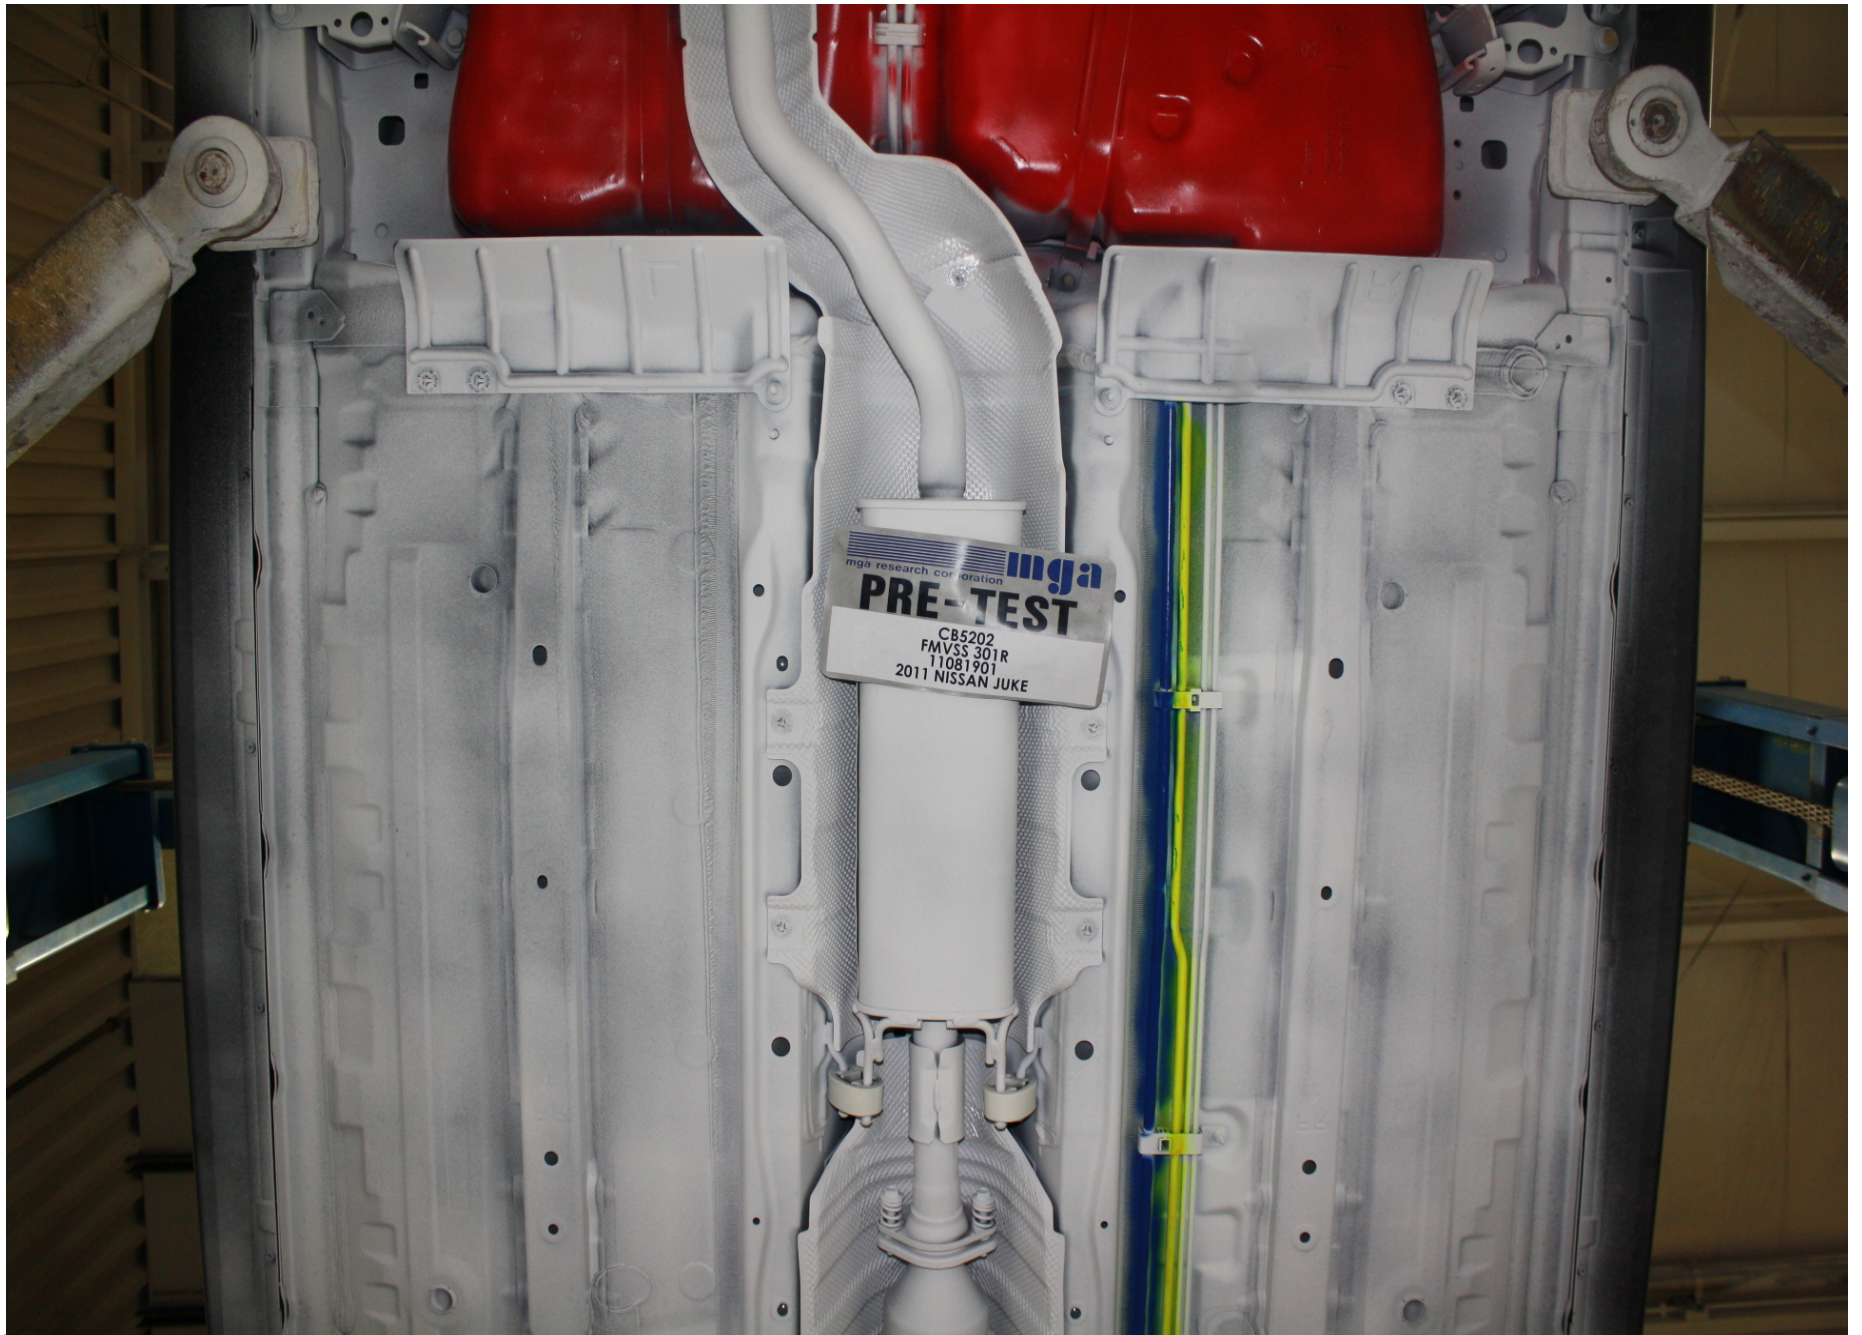


Pre-Test Underbody View 2

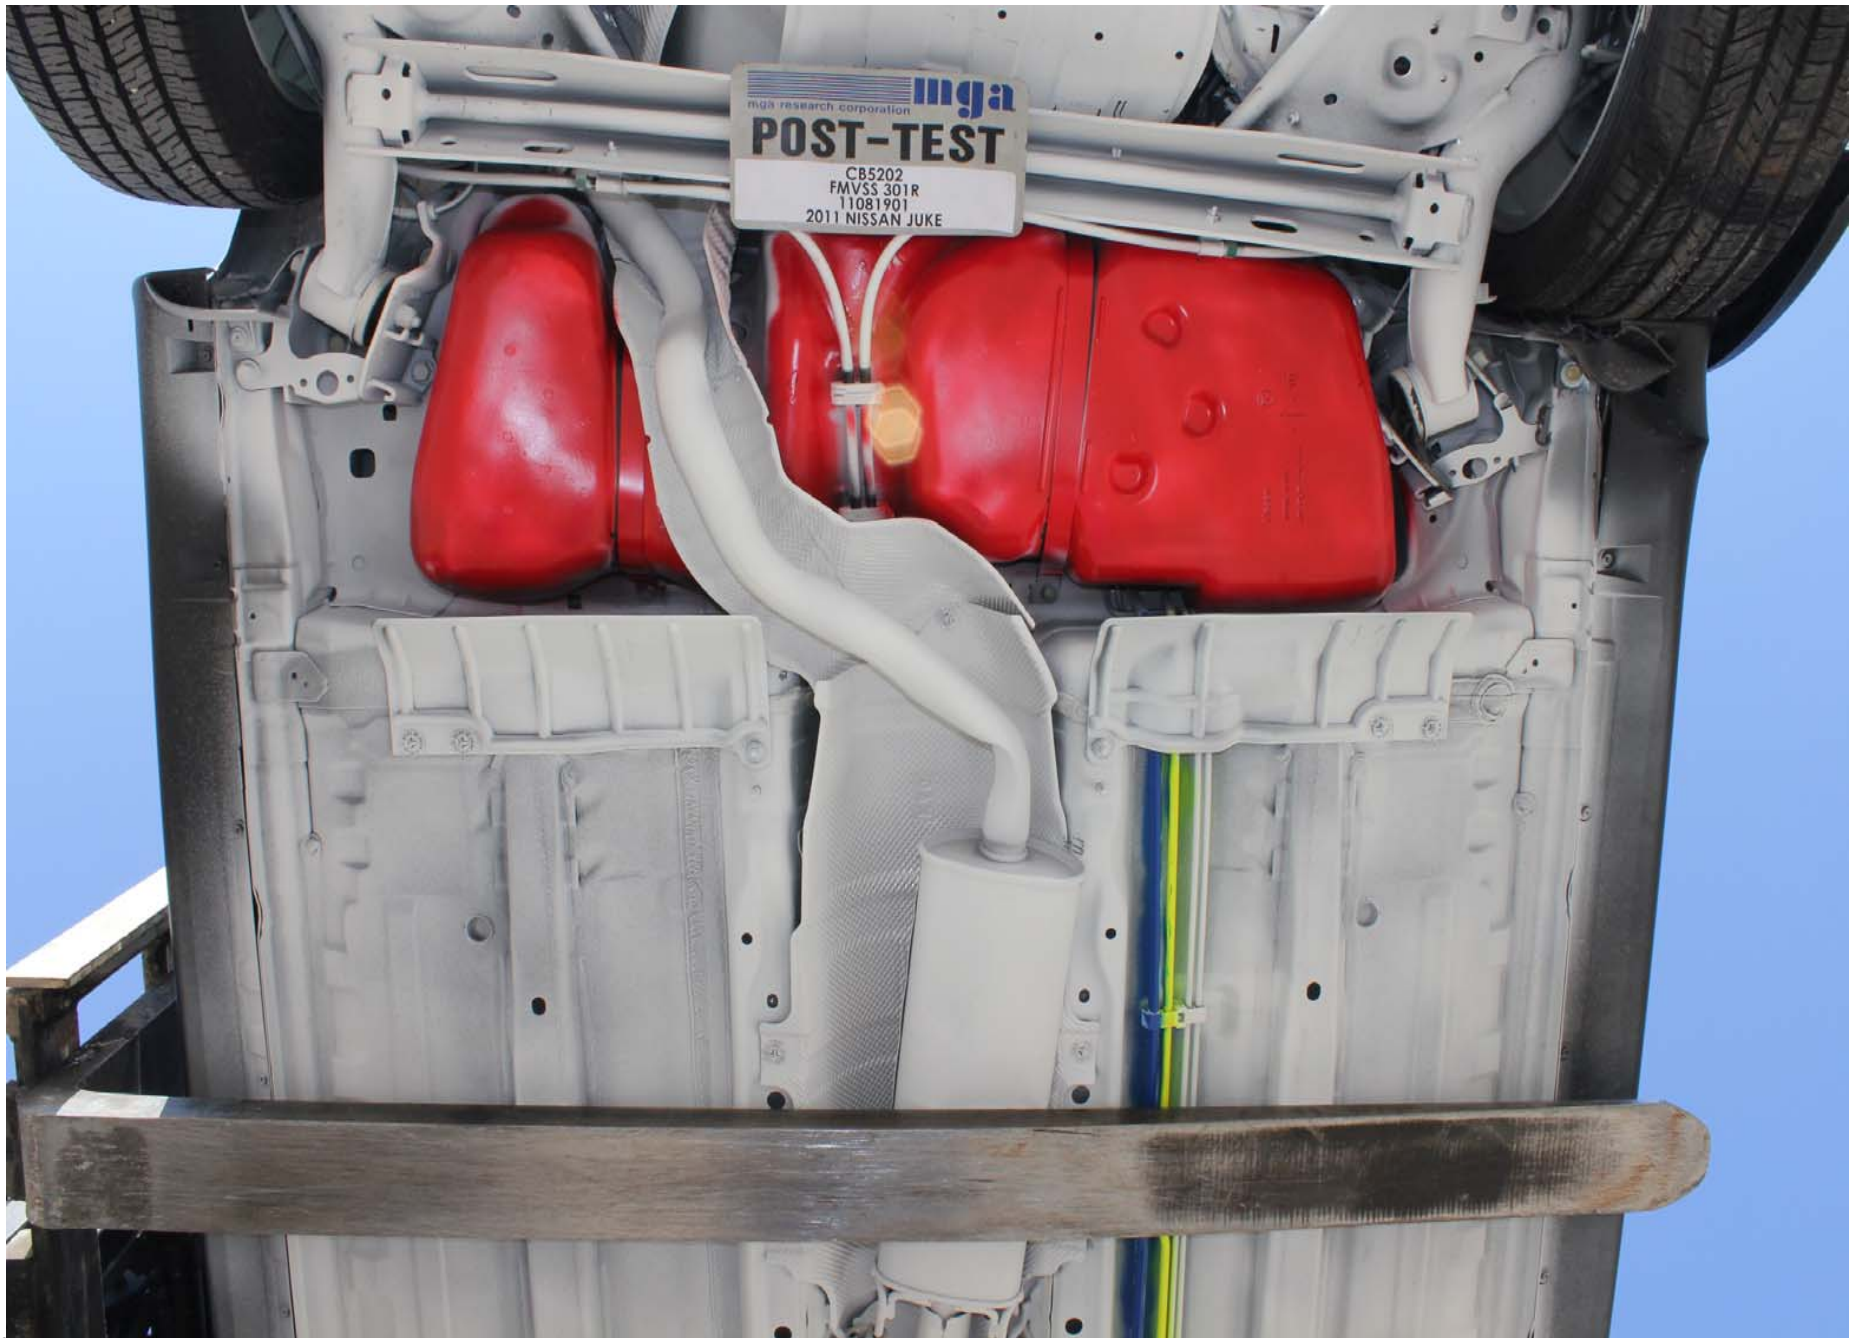

Post-Test Underbody View 2

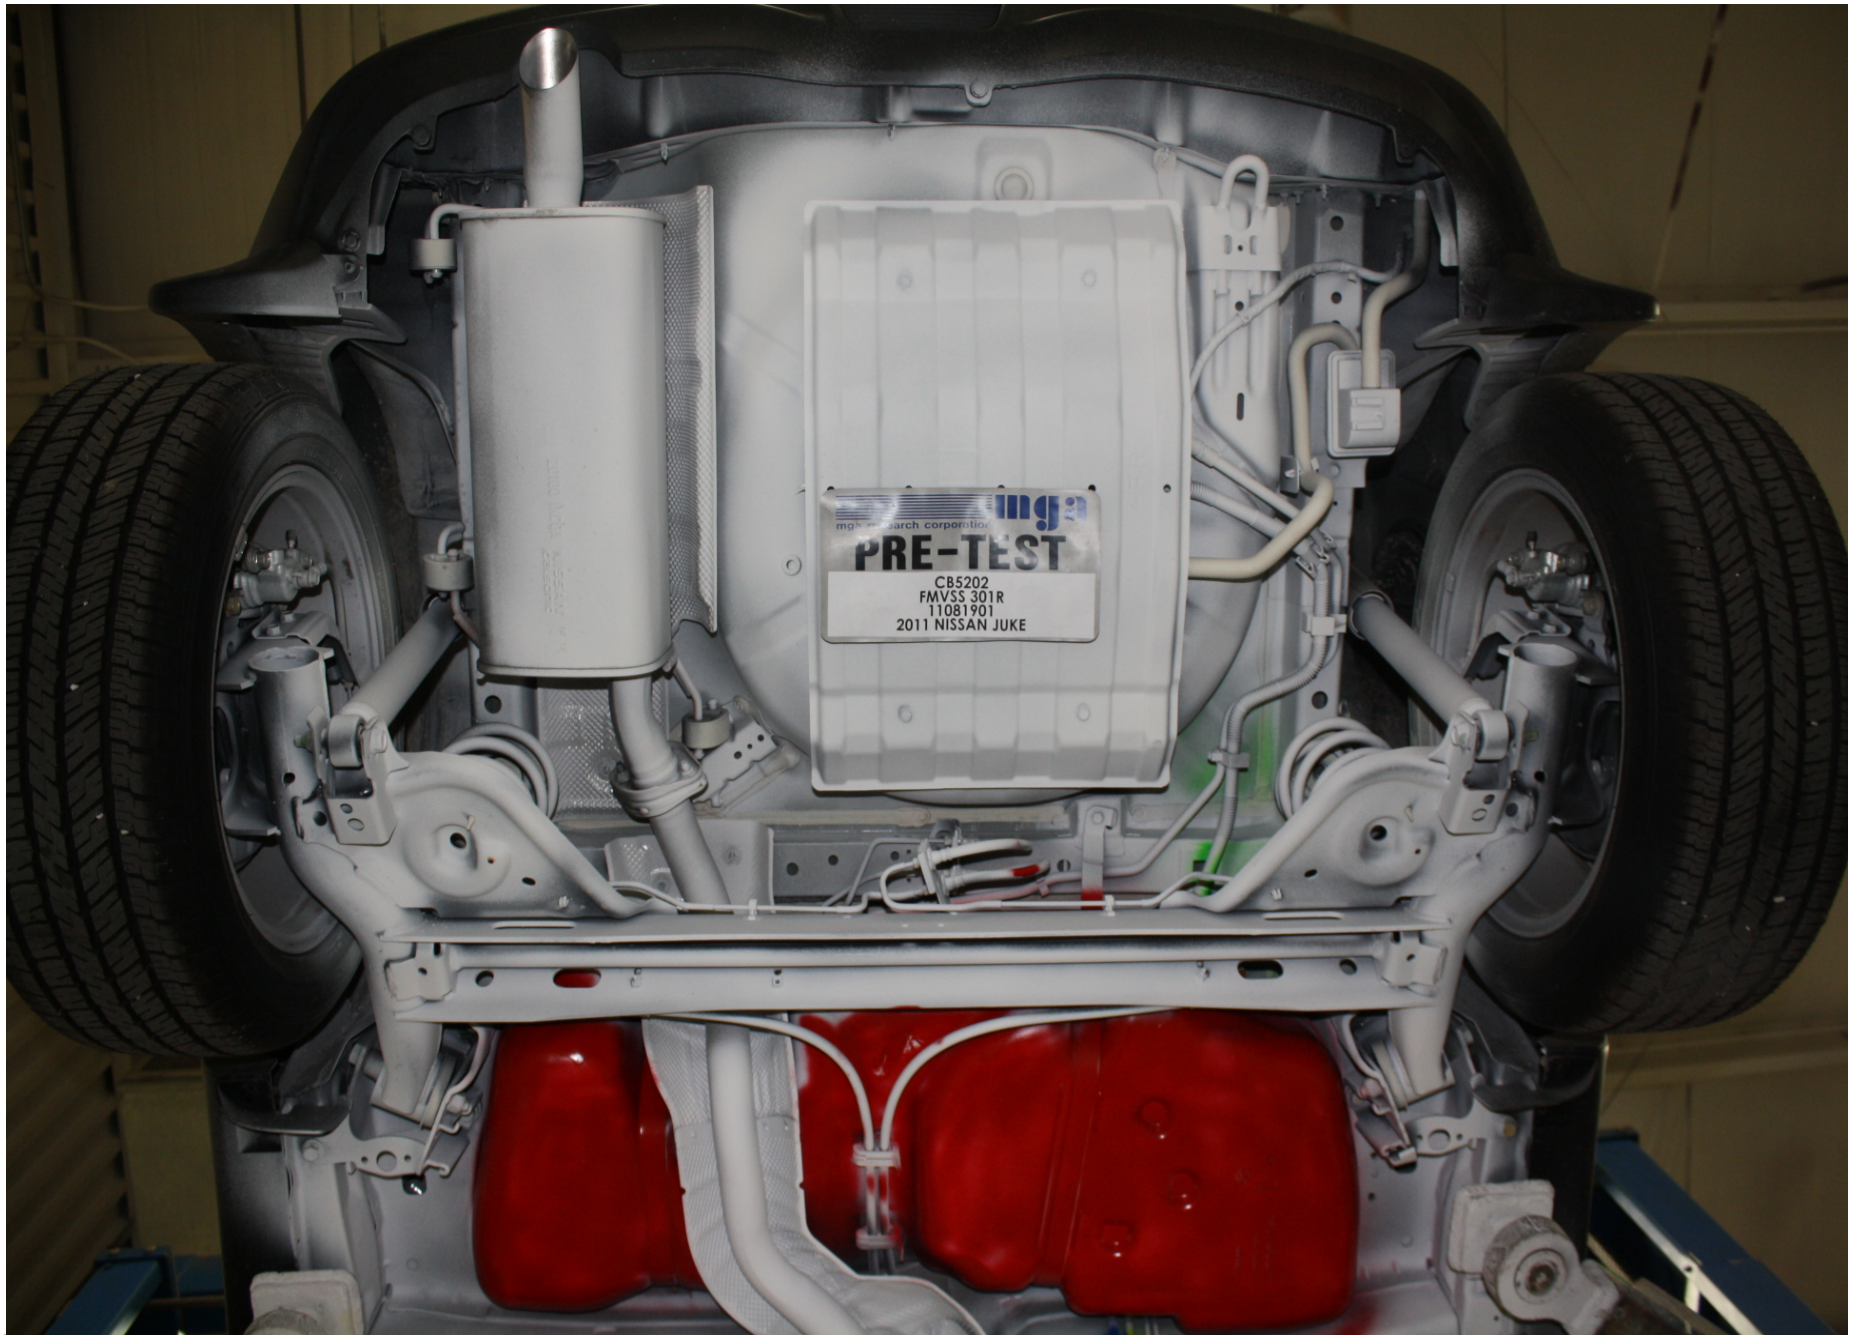

Pre-Test Underbody View 3

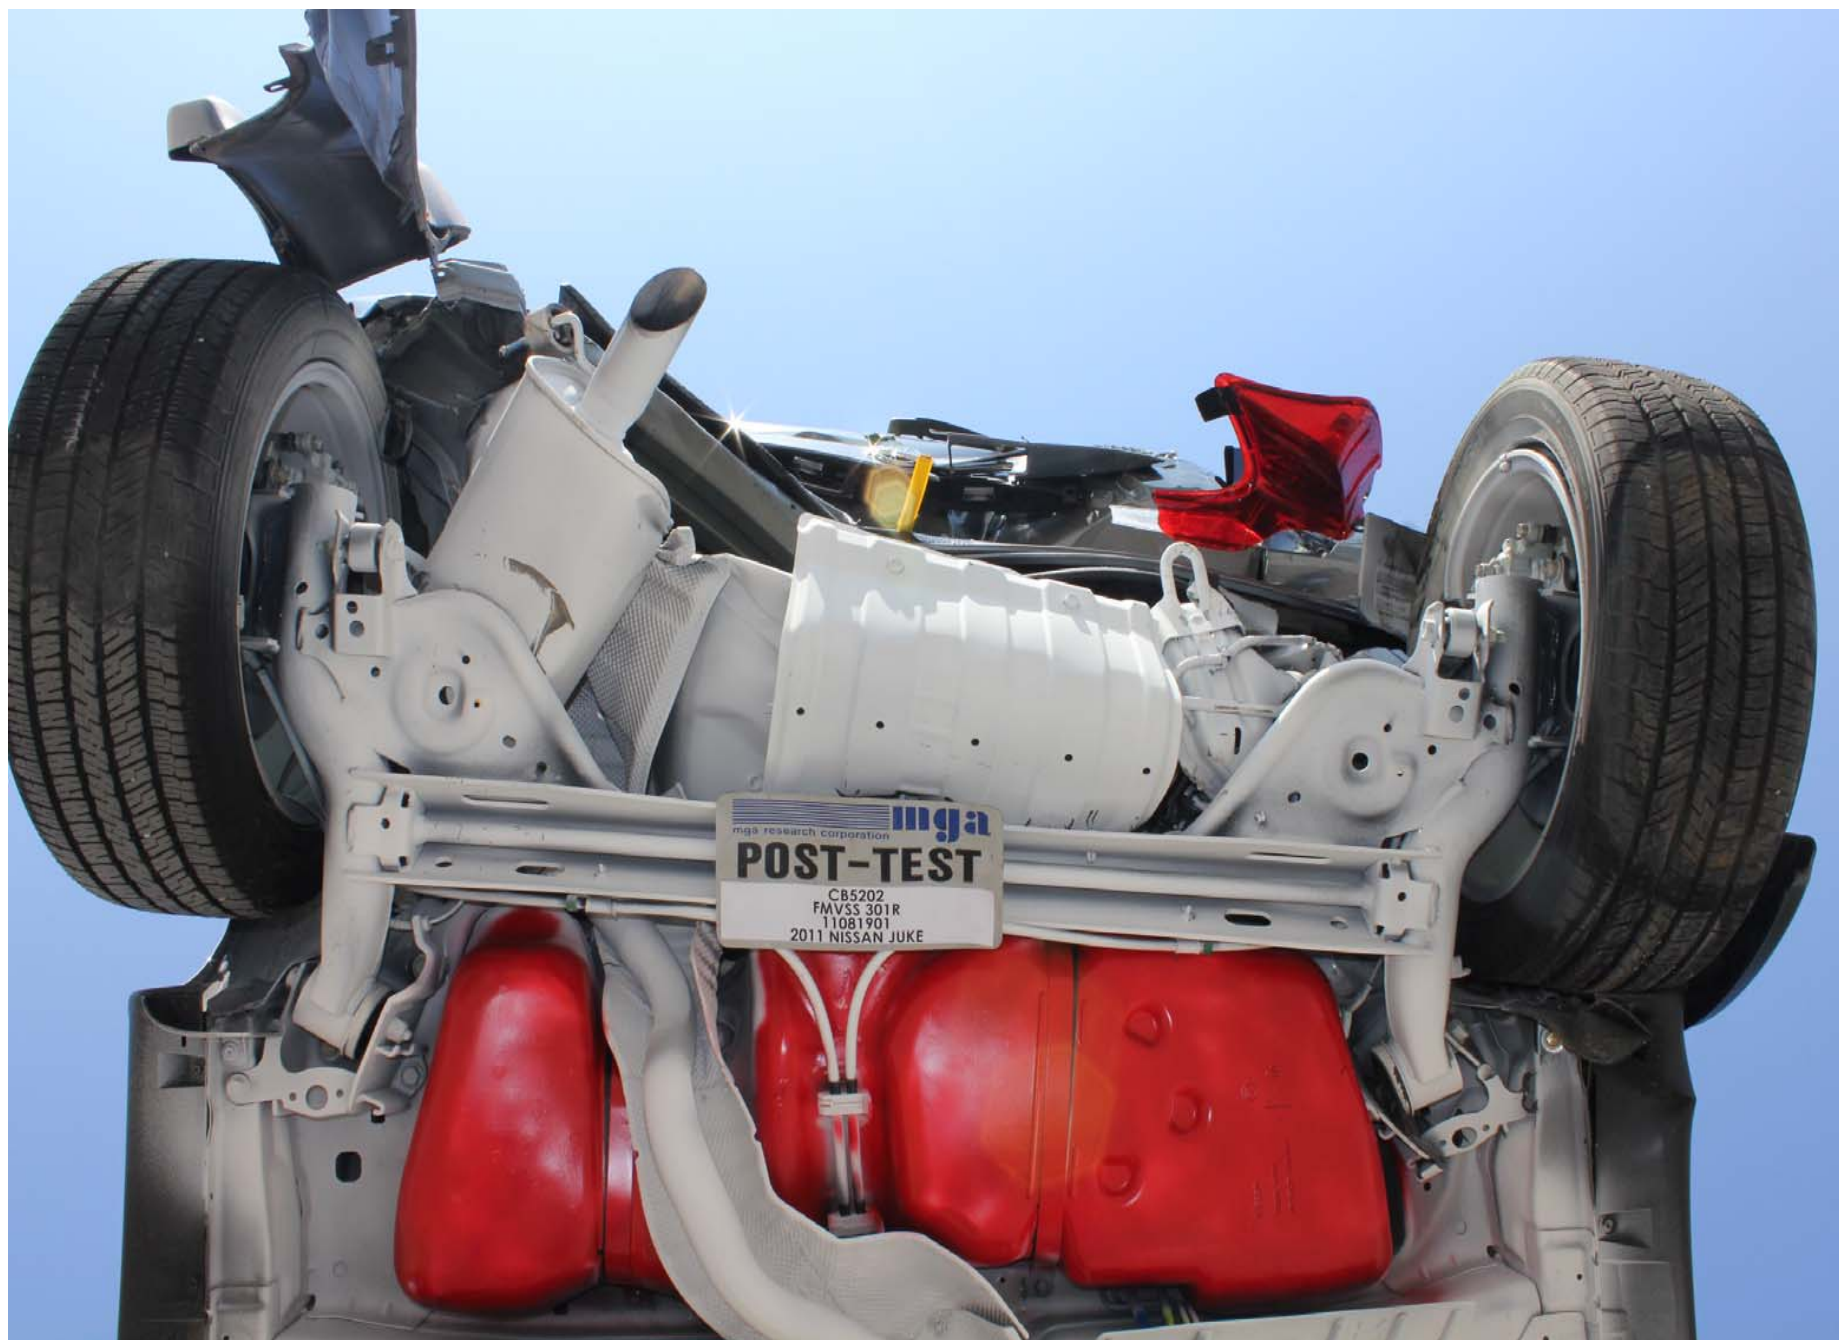

Post-Test Underbody View 3



Pre-Test Front View of MDB



Post-Test Front View of MDB



Pre-Test $\frac{3}{4}$ Right Side View of MDB



Post-Test ¾ Right Side View of MDB



Pre-Test ¾ Left Side View of MDB



Post-Test $\frac{3}{4}$ Left Side View of MDB



Pre-Test Top View of MDB




Post-Test Top View of MDB



Static Rollover at 90 Degrees



Static Rollover at 180 Degrees

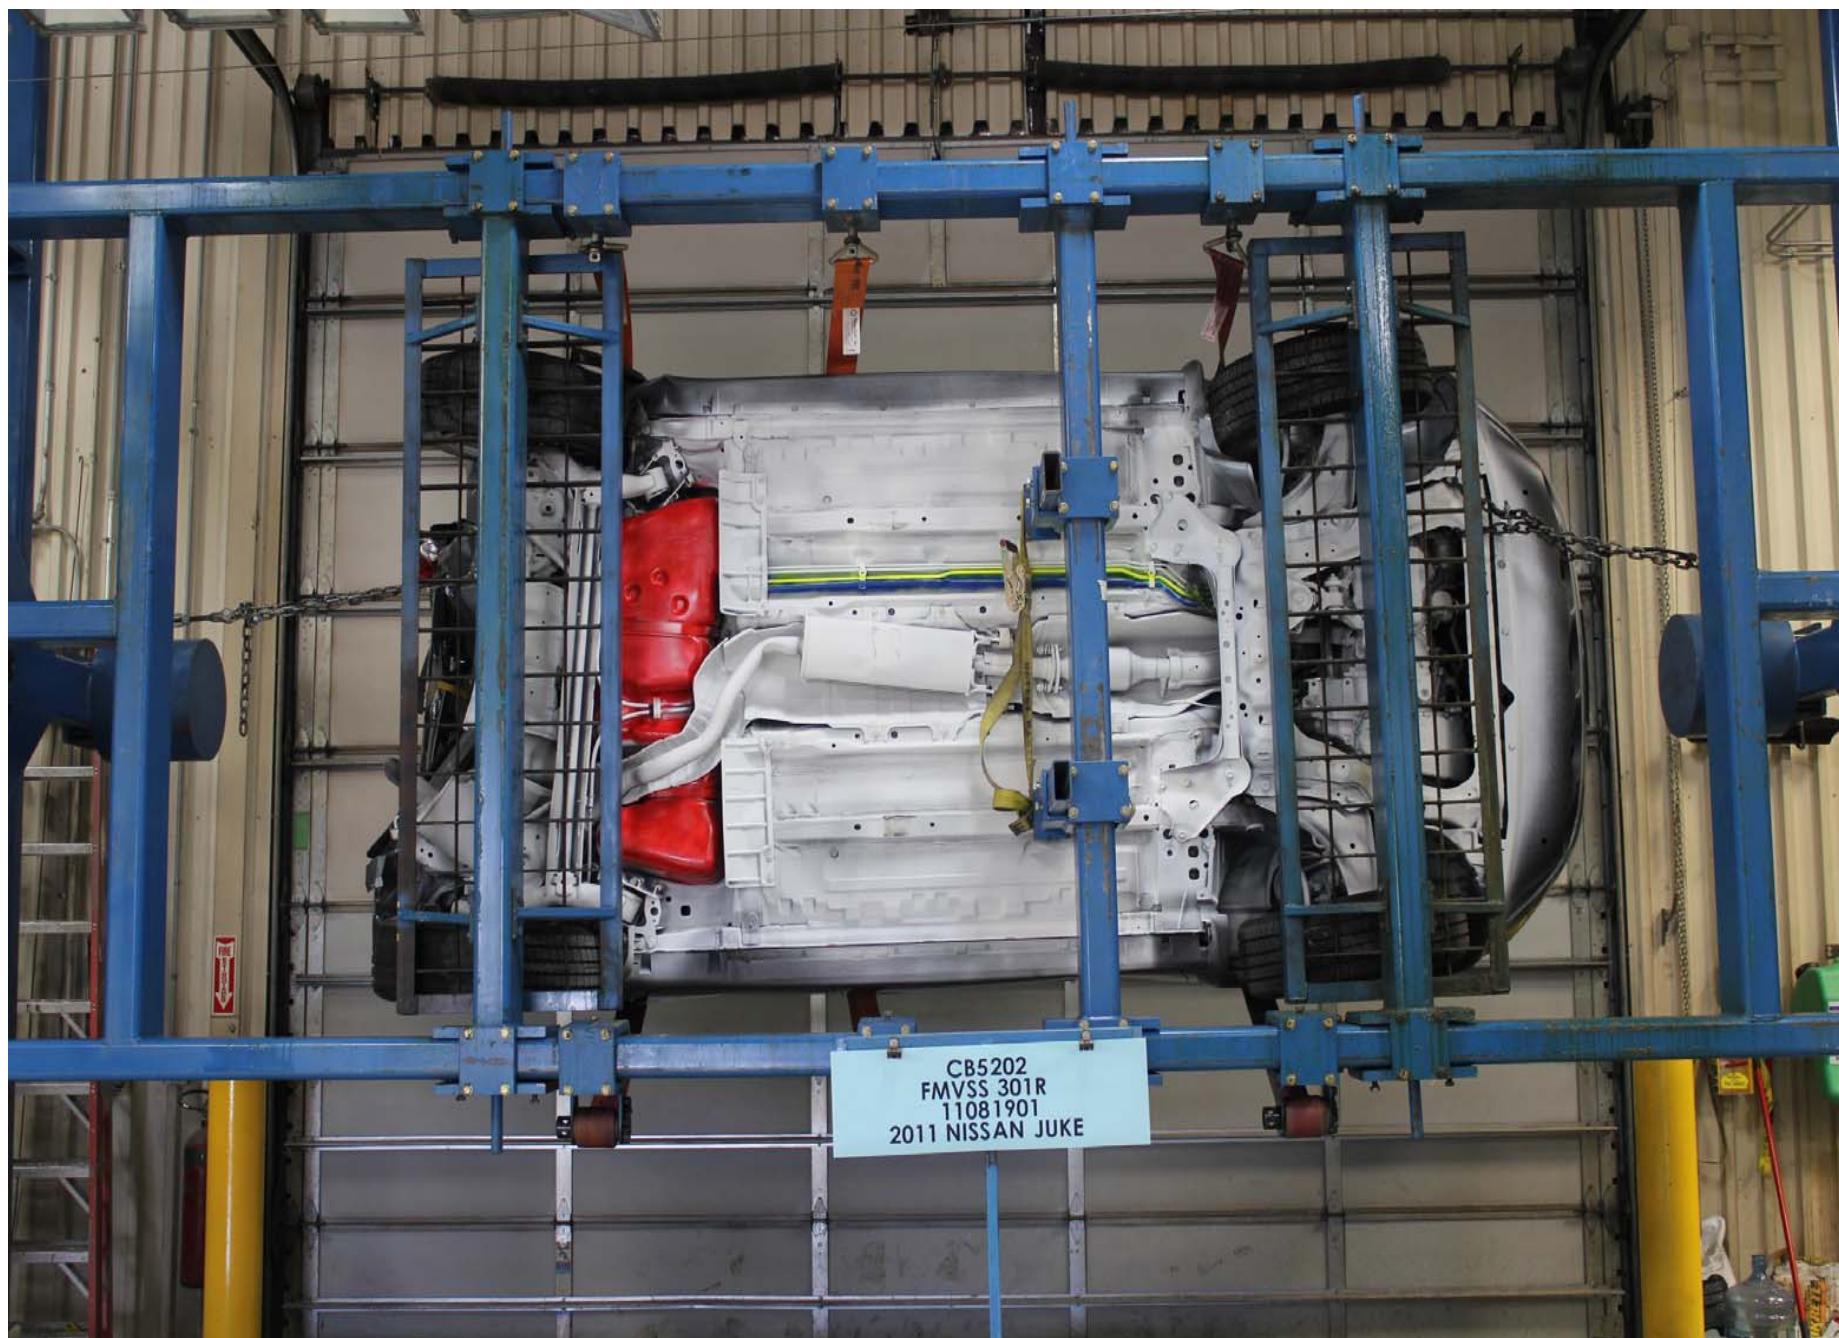

Static Rollover at 270 Degrees



Static Rollover at 360 Degrees