

REPORT NUMBER: TR-P36135-01-NC
SAFETY COMPLIANCE TESTING FOR FMVSS 301R
FUEL SYSTEM INTEGRITY – REAR IMPACT
79.3 KM/H 70% OVERLAP REAR IMPACT

AUDI AG
2016 AUDI A4 4-DOOR SEDAN

NHTSA NUMBER: C20165802

PREPARED BY:
KARCO ENGINEERING, LLC.
9270 HOLLY ROAD
ADELANTO, CA 92301



TEST DATE:
JUNE 8, 2016

REPORT DATE:
JUNE 22, 2016
FINAL REPORT

U.S. DEPARTMENT OF TRANSPORTATION
NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION
ENFORCEMENT
OFFICE OF VEHICLE SAFETY COMPLIANCE
ROOM 6111, NVS-220
400 SEVENTH STREET, SW
WASHINGTON, DC 20590

This publication is distributed by the U.S. Department of Transportation, National Highway Traffic Safety Administration, in the interest of information exchange. The opinions, findings and conclusions expressed in this publication are those of the author(s) and not necessarily those of the Department of Transportation or the National Highway Traffic Safety Administration. The United States Government assumes no liability for its contents or use thereof. If trade or manufacturers' names or products are mentioned, it is only because they are considered essential to the object of the publication and should not be construed as an endorsement. The United States Government does not endorse products or manufacturers.

Prepared By: 
Mr. Javier J. Martinez, Project Engineer
KARCO Engineering, LLC.

Reviewed By: 
Mr. Michael L. Dunlap, Director of Operations
KARCO Engineering, LLC.

Approved By: 
Mr. Frank D. Richardson, Program Manager
KARCO Engineering, LLC.

Approval Date: June 22, 2016

FINAL REPORT ACCEPTANCE BY OVSC:

Date: _____

TECHNICAL REPORT DOCUMENTATION PAGE

1. Report No. TR-P36135-01-NC		2. Government Accession No.		3. Recipient's Catalog No.	
4. Title and Subtitle Final Report of FMVSS 301R 70% Overlap Rear Impact Testing of a 2016 Audi A4 4-Door Sedan C20165802				5. Report Date June 22, 2016	
				6. Performing Organization Code KAR	
7. Authors Mr. Javier J. Martinez, Project Engineer, KARCO Mr. Frank Richardson, Program Manager, KARCO				8. Performing Organization Report No. TR-P36135-01-NC	
9. Performing Organization Name and Address KARCO Engineering, LLC. 9270 Holly Rd. Adelanto, CA 92301				10. Work Unit No.	
				11. Contract or Grant No. DTNH22-11-D-00245	
12. Sponsoring Agency Name and Address U. S. Department of Transportation National Highway Traffic Safety Administration Enforcement Office of Vehicle Safety Compliance Room 6111, NVS-220 400 Seventh Street, SW Washington, D.C. 20590				13. Type of Report and Period Covered Final Test Report, June 8 - June 22, 2016	
				14. Sponsoring Agency Code	
15. Supplementary Notes					
16. Abstract A 79.3 km/h 70% overlap rear impact test was conducted on the subject 2016 Audi A4 4-door sedan in accordance with the specifications of the Office of Vehicle Safety Compliance Laboratory Test Procedure for FMVSS 301R. The test was conducted at the KARCO Engineering, LLC. facility in Adelanto, California on June 8, 2016. The impact velocity was 79.75 km/h and the outside ambient temperature was 38 deg. C. There was no Stoddard solvent leakage immediately after the test or during any portion of the static rollover. The test vehicle appeared to comply with all requirements of FMVSS 301R "Fuel System Integrity - Rear Impact".					
17. Key Words FMVSS 301R 70% Overlap Rear Impact MDB 2016 Audi A4 4-Door Sedan				18. Distribution Statement	
19. Security Classification of this report UNCLASSIFIED		20. Security Classification of this page UNCLASSIFIED		21. No. of Pages 37	22. Price

TABLE OF CONTENTS

<u>Section</u>		<u>Page No.</u>
1	Summary of Test	1
2	Data Sheets	2
<u>Data Sheet No.</u>		<u>Page No.</u>
1	Test Vehicle Specifications	3
2	Pre-Test Data	5
3	Moving Barrier Data	9
4	Post-Test Data	10
5	Static Rollover Test Data	12
<u>Appendix</u>		<u>Page No.</u>
A	Photographs	A

SECTION 1

SUMMARY OF TEST

SUMMARY

The purpose of this rear impact test is to measure the performance of the subject vehicle, a 2016 Audi A4 4-door sedan, for FMVSS 301R "Fuel System Integrity – Rear Impact".

This 79.3 km/h 70% Overlap Rear Impact is sponsored by the National Highway Traffic Safety Administration (NHTSA) under contract number DTNH22-11-D-00245. It was conducted in accordance with the Office of Vehicle Safety Compliance Laboratory Test Procedure TP-301R-02 for FMVSS 301R "Fuel System Integrity – Rear Impact", dated January, 2007.

The test was performed at KARCO Engineering, LLC. on June 8, 2016. Pre- and post- test photographs of the vehicle and ATD's can be found in Appendix A of this report.

Two (2) real-time cameras and three (3) high-speed cameras were used to document the rear impact event.

Two Part 572E 50th percentile male anthropomorphic test devices (ATD) were placed in the driver and right front passenger seating positions. Both ATD's were not instrumented for this test.

There was no Stoddard solvent leakage after the impact or during any portion of the static rollover. The test vehicle appeared to comply with all requirements of FMVSS 301R "Fuel System Integrity – Rear Impact". FMVSS 301 data is summarized in Data Sheets 4 and 5.

SECTION 2
DATA SHEETS

Test Vehicle: 2016 Audi A4 4-Door Sedan

NHTSA No.: C20165802

Test Program: 79.3 km/h 70% Overlap Rear Impact

Test Date: 6/8/16

CONVERSION FACTORS

Quantity	Typical Application	Std Units	Metric Unit	Multiply By
Mass	Vehicle Weight	lb	kg	0.4536
Linear Velocity	Impact Velocity	miles/hr	km/hr	1.609344
Length or Distance	Measurements	in	mm	25.4
Volume	Fuel Systems	gal	liter	3.785
Volume	Small Fluids	oz	mL	29.574
Pressure	Tire Pressures	lbf/in ²	kPa	6.895
Temperature	General Use	°F	°C	$=(T_f - 32)/1.8$
Force	Dynamic Forces	lbf	N	4.448
Moment	Torque	lbf-ft	N•m	1.355

DATA SHEET NO. 1

TEST VEHICLE SPECIFICATIONS

Test Vehicle: 2016 Audi A4 4-Door Sedan NHTSA No.: C20165802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 6/8/16

TEST VEHICLE INFORMATION AND OPTIONS

NHTSA Number	C20165208
Model Year	2016
Make	Audi
Model	A4
Body Style	4-Door Sedan
VIN	WAUAF AFLXGN008854
Body Color	Monsoon Gray Metallic
Odometer Reading (km / mi)	105 / 65
Engine Displacement (L)	2.0
Type / No. of Cylinders	Inline 4
Engine Placement	Transverse
Transmission Type	Automatic
Transmission Speeds	8
Overdrive	Yes
Final Drive	FWD
Roof Rack	No
Sunroof / T-Top	Yes
Running Boards	No
Tilt Steering Wheel	Yes
Power Seats	Yes
Anti-Lock Brakes (ABS)	Yes
Automatic Door Locks (ADLs)	Yes

Traction Control System	Yes
Power Steering	Yes
Power Window Auto-Reverse	Yes
Driver Frontal Airbag	Yes
Driver Curtain Airbag	Yes
Driver Head/Torso Airbag	No
Driver Torso Airbag	No
Driver Torso/Pelvis Airbag	Yes
Driver Pelvis Airbag	No
Driver Knee Airbag	No
Front Pass. Frontal Airbag	Yes
Front Pass. Curtain Airbag	Yes
Front Pass. Head/Torso Airbag	No
Front Pass. Torso Airbag	No
Front Pass. Torso/Pelvis Airbag	Yes
Front Pass. Pelvis Airbag	No
Front Pass. Knee Airbag	No
Driver Seat Belt Pretensioner	Yes
Driver Load Limiter	Yes
Front Pass. Seat Belt Pretensioner	Yes
Front Pass. Load Limiter	Yes
Other	No

Does Owner's Manual provide instructions to turn off automatic door locks?

Yes

DATA FROM CERTIFICATION LABEL

Manufactured By	Audi AG
Date of Manufacture	Aug-15

GVWR (lbs)	4762
GAWR Front (lbs)	2447
GAWR Rear (lbs)	2425

VEHICLE SEATING AND CAPACITY WEIGHT INFORMATION

Measured Parameter	Front	Rear	Third	Total	
Type of Seats	Bucket	Bench			
Designated Seating Capacity	2	3		5	
Capacity Weight (VCW) (kg)				480.0	A
DSC x 68 (kg)				340.0	B
Cargo Weight (RCLW) (kg)				140.0	A-B

DATA SHEET NO. 1 ... (CONTINUED)


TEST VEHICLE SPECIFICATIONS

Test Vehicle: 2016 Audi A4 4-Door Sedan

NHTSA No.: C20165802

Test Program: 79.3 km/h 70% Overlap Rear Impact

Test Date: 6/8/16

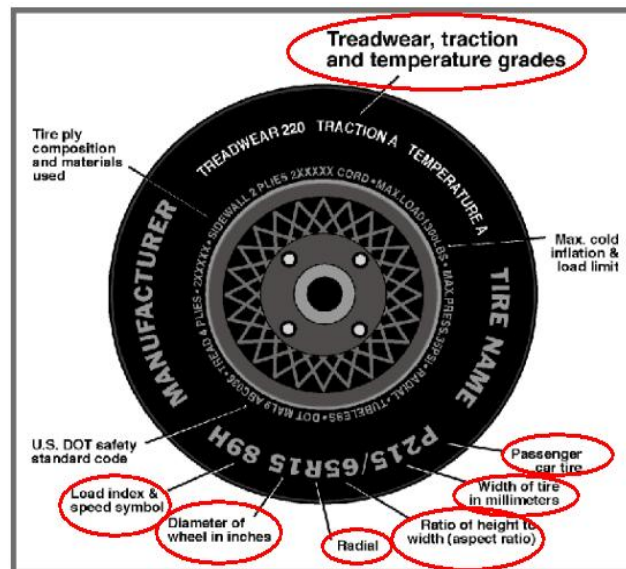

VEHICLE TIRE INFORMATION

Measured Parameter	Front	Rear
Max Tire Pressure (kPa)	300	300
Cold Tire Pressure (kPa)	250	260
Max Load Tire Pressure (kPa)		
Recommended Tire Size	P245/40R18	P245/40R18
Tire Size on Vehicle	P245/40R18	P245/40R18
Tire Manufacturer	Pirelli	Pirelli
Tire Model	Cinturato	Cinturato
Load Range	650	650
Treadwear Rating	500	500
Traction Rating	A	A
Temperature Grades	A	A
Tire Plies Sidewall	2 Rayon	2 Rayon
Tire Plies Body	2 Rayon, 2 Steel, 1 Polyamide	2 Rayon, 2 Steel, 1 Polyamide
Load Index/Speed Symbol	93H	93H
Tire Material	Rayon, Steel, Polyamide	Rayon, Steel, Polyamide
DOT Safety Code Left	93VD P204 2815	93VD P204 2815
DOT Safety Code Right	93VD P204 2815	93VD P204 2815
Type of Spare Tire	T125/70R19	
Location of Tire Placard on Vehicle	Trunk	

DATA SHEET NO. 2**PRE-TEST DATA**Test Vehicle: 2016 Audi A4 4-Door SedanNHTSA No.: C20165802Test Program: 79.3 km/h 70% Overlap Rear ImpactTest Date: 6/8/16**TEST VEHICLE AXLE WEIGHTS**

	Units	As Delivered (UVW)			As Tested (ATW)			Fully Loaded		
		Front	Rear	Total	Front	Rear	Total	Front	Rear	Total
Left	kg	456.0	340.5	796.5	501.0	420.0	921.0	495.0	474.5	969.5
Right	kg	460.0	356.0	816.0	533.0	439.0	972.0	476.5	454.5	931.0
Ratio	%	56.8%	43.2%	100.0%	54.6%	45.4%	100.0%	51.1%	48.9%	100.0%
Total	kg	916.0	696.5	1612.5	1034.0	859.0	1893.0	971.5	929.0	1900.5

TARGET TEST WEIGHT CALCULATION

Measured Parameter	Units	Value	
Total Delivered Weight (UVW)	kg	1612.5	A
Actual Weight of 2 P572 ATDs Used	kg	148.0	B
Rated Cargo/Luggage Wt (RCLW)	kg	140.0	C
Calculated Vehicle Target Wt (TVTW)	kg	1900.5	A+B+C

TEST VEHICLE ATTITUDES

Condition	Units	LF	RF	LR	RR	CG Aft of Front Axle
As Delivered	mm	709	707	711	714	1153
As Tested	mm	691	697	686	686	1305
Fully Loaded	mm	690	695	680	676	1212
Post-Test	mm	686	716	719	765	

GENERAL TEST VEHICLE DATA

Measured Parameter	Units	Value
Total Vehicle Wheel Base	mm	2805
Total Vehicle Length	mm	4720
Total Vehicle Width	mm	1801
Amount of Stoddard Solvent in Fuel Tank	L	58.59

DATA SHEET NO. 2... (CONTINUED)**PRE-TEST DATA**

Test Vehicle: 2016 Audi A4 4-Door Sedan NHTSA No.: C20165802
Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 6/8/16

BALLAST DATA

Description	Value
Type of Ballast	Sand Bottle Dummies
Method of Securing Ballast	Belted into the rear seat
Weight of Ballast	120.0 kg
Weight of Vehicle Components Removed	0.0 kg

VEHICLE COMPONENTS REMOVED TO MEET TEST WEIGHT:


No vehicle components were removed

FUEL TANK CAPACITY

Description	Liters
Fuel System Capacity Listed in Owners Manual	63.03
Usable Capacity of "Standard Tank"	63.03
91 - 94% of Usable Capacity	57.36 - 59.25
Actual Amount of Stoddard Solvent Used	58.59

FUEL PUMP

The vehicle is equipped with an electric fuel pump. The fuel pump operates for a short time when the ignition is in the "on" position to pressurize the system. The fuel pump operates normally when the vehicle is running.

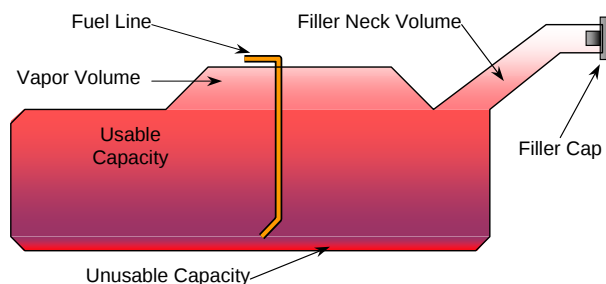

VEHICLE FUEL TANK ASSEMBLY

TEST FLUID

Description	Value
Test Fluid Type	Stoddard Solvent
Test Fluid Specific Gravity	0.76
Test Fluid Kinematic Viscosity	
Test Fluid Color	Purple

DATA SHEET NO. 2... (CONTINUED)

PRE-TEST DATA

Test Vehicle: 2016 Audi A4 4-Door Sedan

NHTSA No.: C20165802

Test Program: 79.3 km/h 70% Overlap Rear Impact


Test Date: 6/8/16

NOMINAL DESIGN RIDING POSITION

Seat back angle is measured using a 600 mm long ruler against the rearmost points of the seat back with a digital inclinometer.


SEAT BACK ANGLE

Seating Position	Degrees
Driver Seat Back Angle	17.0
Passenger Seat Back Angle	17.0

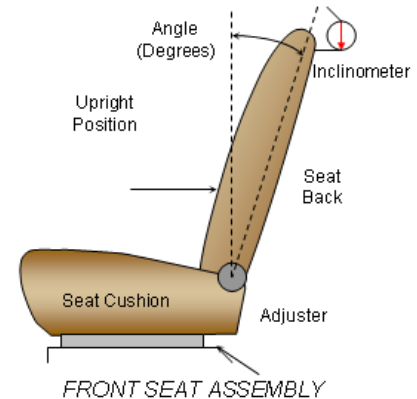

SEAT FORE / AFT POSITIONING

The total seat travel is measured from the forward most possible position to the rear most possible position. The driver's seat is set to the middle of the fore-aft travel. The passenger's seat is set to the middle of the fore-aft travel.

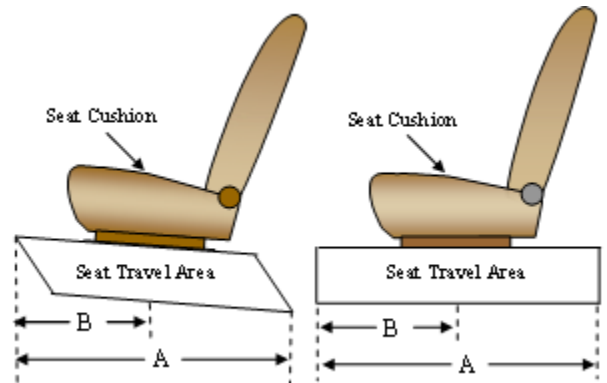

SEAT FORE/AFT POSITIONS

Seating Position	Total Fore-Aft Travel	Placed in Position
Driver Seat	301 mm	151 mm
Passenger Seat	306 mm	153 mm

DATA SHEET NO. 2... (CONTINUED)

PRE-TEST DATA

Test Vehicle: 2016 Audi A4 4-Door Sedan


NHTSA No.: C20165802

Test Program: 79.3 km/h 70% Overlap Rear Impact

Test Date: 6/8/16

STEERING COLUMN ADJUSTMENT

Steering wheel and column adjustments are made so that the steering wheel hub is at the geometric center of the locus it describes when moved through its full range of motion. A digital inclinometer is used to measure a plate which is placed across the rim of the steering wheel for angular measurements. A tape measure is used to measure telescoping steering wheel travel.

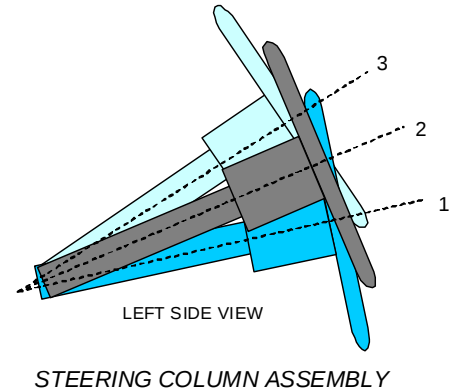

STEERING COLUMN POSITIONING

	Degrees	Fore-Aft Position (mm)
Lowermost Position, No. 1	19.1	60
Geometric Center Position, No. 2	21.9	90
Uppermost Position, No. 3	24.6	120
Telescoping Steering Wheel Travel	5.5	60
Test Position	21.9	90

DATA SHEET NO. 3
MOVING BARRIER DATA

Test Vehicle: 2016 Audi A4 4-Door Sedan NHTSA No.: C20165802
 Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 6/8/16

MOVING BARRIER TEST WEIGHT

	Units	As Delivered Weights (UVW)		
		Front Axle	Rear Axle	Total
Left	kg	377.0	292.5	669.5
Right	kg	389.5	301.5	691.0
Ratio	%	56.3%	43.7%	100.0%
Total	kg	766.5	594.0	1360.5

MOVING BARRIER TIRE INFORMATION

Measured Parameter	Front	Rear
Recommended Tire Size	205/75R15	205/75R15
Tire Size on Vehicle	205/75R15	205/75R15
Tire Manufacturer	Pacemark	Pacemark
Tire Model	All Weather	All Weather
Treadwear	420	420
Traction	A	A
Temperature Grades	B	B
Tire Pressure - Front	220	220
Tire Pressure - Rear	220	220

MOVING BARRIER DIMENSIONS

Measurement Description	Length (mm)
Overall Width	1677
Overall Height	558
Honeycomb Depth	381
Overall Depth	484
Bottom Honeycomb to Bottom Bumper	51
Bumper Height	203
Ground to Top of MDB	787
Ground to Bottom of MDB	228
Ground to Bottom of Bumper	280
Ground to Top of Bumper	483

DATA SHEET NO. 4**POST-TEST DATA**Test Vehicle: 2016 Audi A4 4-Door SedanNHTSA No.: C20165802Test Program: 79.3 km/h 70% Overlap Rear ImpactTest Date: 6/8/16Temperature at Time of Impact: 38°CTest Time: 11:08 AMVIN: WAUAFAPLXGN008854**IMPACT VELOCITY DATA**

Measured Parameter	Units	Value
Trap No. 1 Velocity (Primary)	km/h	79.75
Trap No. 2 Velocity (Redundant)	km/h	79.74

IMPACT POINT LOCATION DATA

Measured Parameter	Units	Tolerance	Value
Vehicle Width	mm		1801
Vertical Impact Reference Line (Left of Vehicle Center Line)	mm		360
Actual Impact Point (Left of Vehicle Center Line)	mm		365
Horizontal Offset (+ right / - left)	mm	± 50 of Intended Impact Point	-5
Vertical Offset (+ down / - up)	mm	± 40 of Intended Impact Point	-5

TARGET VEHICLE STRUCTURAL MEASUREMENTS

No.	Description	Pre-Test	Post-Test	Difference
1	Total Length at Centerline	4720	4414	306
2	Total Length	4720	4303	417
3	Total Width	1801	2010	209
4	Left Side Wheelbase	2805	2784	21
5	Right Side Wheelbase	2805	2668	137

MAXIMUM STATIC CRUSH OF HONEYCOMB FACE

Vertical Location			From Centerline		Max. Crush (mm)
Row	Description	Height (mm)	Distance (mm)	Direction	
A	Center of Bumper	382	800	Left	367
B	Top of Bumper	483	800	Left	346
C	Mid Level	636	800	Left	297
D	Top of Stack	763	800	Left	179

DATA SHEET NO. 4... (CONTINUED)**POST-TEST DATA**

Test Vehicle: 2016 Audi A4 4-Door Sedan NHTSA No.: C20165802
Test Program: 79.3 km/h 70% Overlap Rear Impact Test Date: 6/8/16

DOOR OPENING AND SEAT TRACK INFORMATION

Description	Driver	Passenger
Front Door Opening	Remained closed and latched	Remained closed and latched
Rear Door Opening	Remained closed and latched	Remained closed and latched
Hatch and other doors	Rear Hatch Jammed Shut	

FMVSS 301 FUEL SYSTEM INTEGRITY POST-IMPACT DATA**Stoddard Solvent Spillage Measurements**

From impact until vehicle motion ceases: 0 g

(Maximum allowable = 28 g)

For the 5 minute period after motion ceases: 0 g

(Maximum allowable = 28 g)

For the following 25 minutes: 0 g

(Maximum allowable = 28 g/minute)

Spillage: None


DATA SHEET NO. 5
STATIC ROLLOVER TEST DATA

Test Vehicle: 2016 Audi A4 4-Door Sedan

NHTSA No.: C20165802

Test Program: 79.3 km/h 70% Overlap Rear Impact

Test Date: 6/8/16

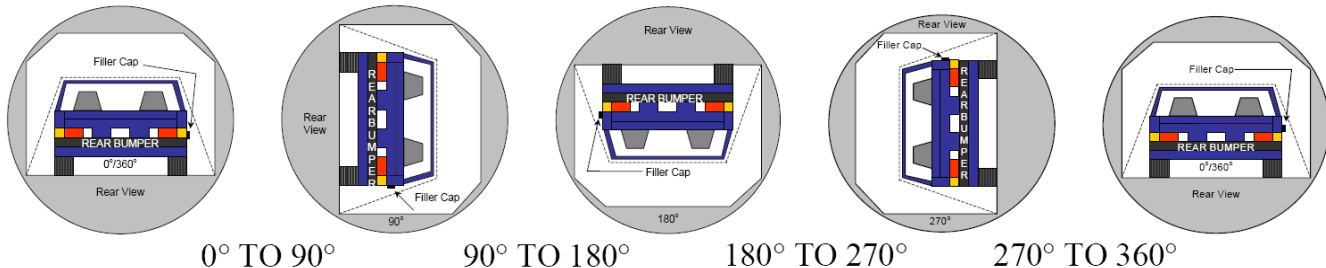

1. The specified fixture rollover rate for each 90° of rotation is 60 to 180 seconds.
2. The position hold time at each position is 300 seconds (minimum).

Details of Stoddard solvent spillage: No Stoddard solvent spillage

SOLVENT COLLECTION TIME TABLE IN SECONDS

Test Phase	Rotation Time	Hold Time	Total Time
0° To 90°	82	300	382
90° To 180°	81	300	381
180° To 270°	76	300	376
270° To 360°	76	300	376

FMVSS 301 SPILLAGE TABLE

Test Phase	First 5 Minutes	Sixth Minute	Seventh Minute	Eighth Minute
0° To 90°	0 g			
90° To 180°	0 g			
180° To 270°	0 g			
270° To 360°	0 g			

SOLVENT SPILLAGE LOCATION TABLE

Test Phase	Spillage Location
0° To 90°	No Spillage
90° To 180°	No Spillage
180° To 270°	No Spillage
270° To 360°	No Spillage

APPENDIX A
PHOTOGRAPHS

TABLE OF PHOTOGRAPHS

Figure		Page
1	As Received Right Front $\frac{3}{4}$ View of Test Vehicle	A-1
2	As Received Left Rear $\frac{3}{4}$ View of Test Vehicle	A-1
3	Test Vehicle Manufacturer's Label	A-2
4	Test Vehicle Tire Information Placard	A-2
5	Pre-Test Front View of Test Vehicle	A-3
6	Post-Test Front View of Test Vehicle	A-3
7	Pre-Test Left Front $\frac{3}{4}$ View Test Vehicle	A-4
8	Post-Test Left Front $\frac{3}{4}$ View Test Vehicle	A-4
9	Pre-Test Left View of Test Vehicle	A-5
10	Post-Test Left View of Test Vehicle	A-5
11	Pre-Test Left Rear $\frac{3}{4}$ View of Test Vehicle	A-6
12	Post-Test Left Rear $\frac{3}{4}$ View of Test Vehicle	A-6
13	Pre-Test Rear View of Test Vehicle	A-7
14	Post-Test Rear View of Test Vehicle	A-7
15	Pre-Test Right Rear $\frac{3}{4}$ View of Test Vehicle	A-8
16	Post-Test Right Rear $\frac{3}{4}$ View of Test Vehicle	A-8
17	Pre-Test Right View of Test Vehicle	A-9
18	Post-Test Right View of Test Vehicle	A-9
19	Pre-Test Right Front $\frac{3}{4}$ View Test Vehicle	A-10
20	Post-Test Right Front $\frac{3}{4}$ View Test Vehicle	A-10
21	Pre-Test Close-Up View of Impact Point Target	A-11
22	Post-Test Close-Up View of Impact Point Target	A-11
23	Pre-Test View of Fuel Filler Cap	A-12
24	Post-Test View of Fuel Filler Cap	A-12
25	Pre-Test Rear Underbody View of Test Vehicle	A-13
26	Post-Test Rear Underbody View of Test Vehicle	A-13
27	Pre-Test Underbody View of Fuel Tank	A-14
28	Post-Test Underbody View of Fuel Tank	A-14
29	Pre-Test Underbody View of Fuel Lines	A-15
30	Post-Test Underbody View of Fuel Lines	A-15
31	Test Vehicle at 0° on FMVSS 301 Static Rollover Device	A-16
32	Test Vehicle at 90° on FMVSS 301 Static Rollover Device	A-16
33	Test Vehicle at 180° on FMVSS 301 Static Rollover Device	A-17
34	Test Vehicle at 270° on FMVSS 301 Static Rollover Device	A-17

TABLE OF PHOTOGRAPHS

Figure		Page
35	Test Vehicle at 360° on FMVSS 301 Static Rollover Device	A-18
36	Impact Event	A-18



FIGURE 1. As Received Right Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 2. As Received Left Rear $\frac{3}{4}$ View of Test Vehicle

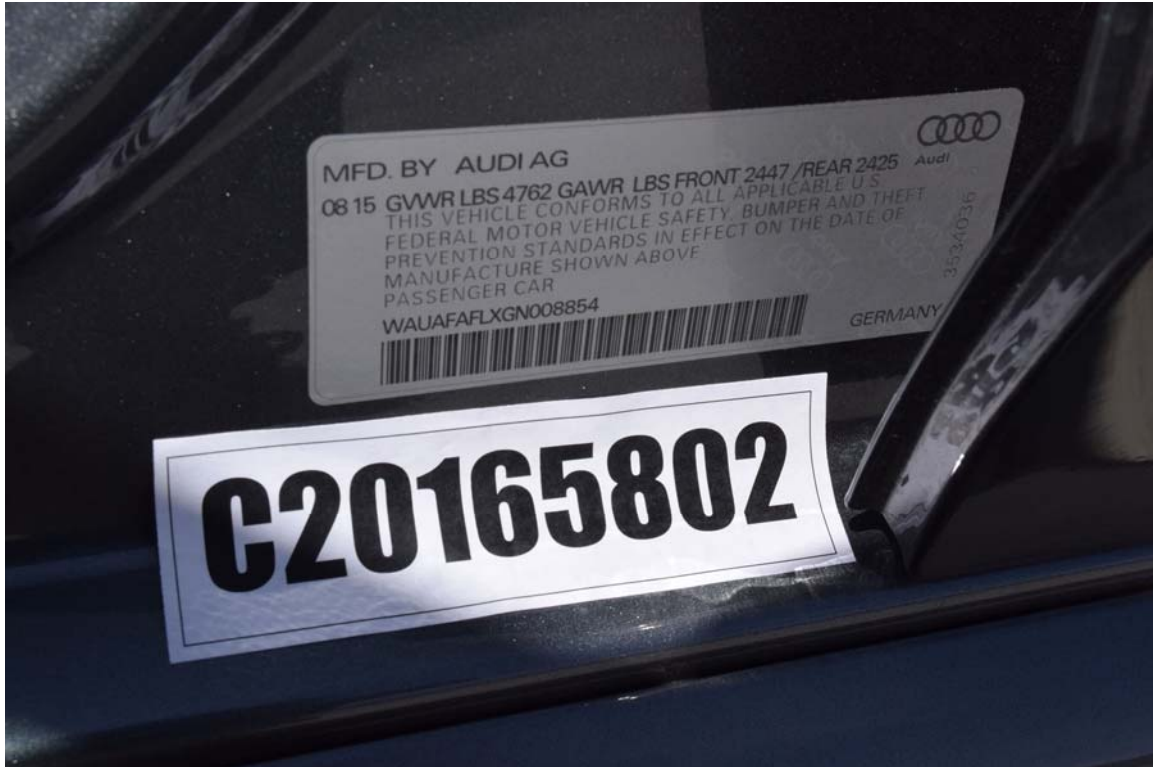


FIGURE 3. Test Vehicle Manufacturer's Label



FIGURE 4. Test Vehicle Tire Information Placard



FIGURE 5. Pre-Test Front View of Test Vehicle



FIGURE 6. Post-Test Front View of Test Vehicle



FIGURE 7. Pre-Test Left Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 8. Post-Test Left Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 9. Pre-Test Left View of Test Vehicle



FIGURE 10. Post-Test Left View of Test Vehicle



FIGURE 11. Pre-Test Left Rear $\frac{3}{4}$ View of Test Vehicle



FIGURE 12. Post-Test Left Rear $\frac{3}{4}$ View of Test Vehicle



FIGURE 13. Pre-Test Rear View of Test Vehicle



FIGURE 14. Post-Test Rear View of Test Vehicle



FIGURE 15. Pre-Test Right Rear $\frac{3}{4}$ View of Test Vehicle

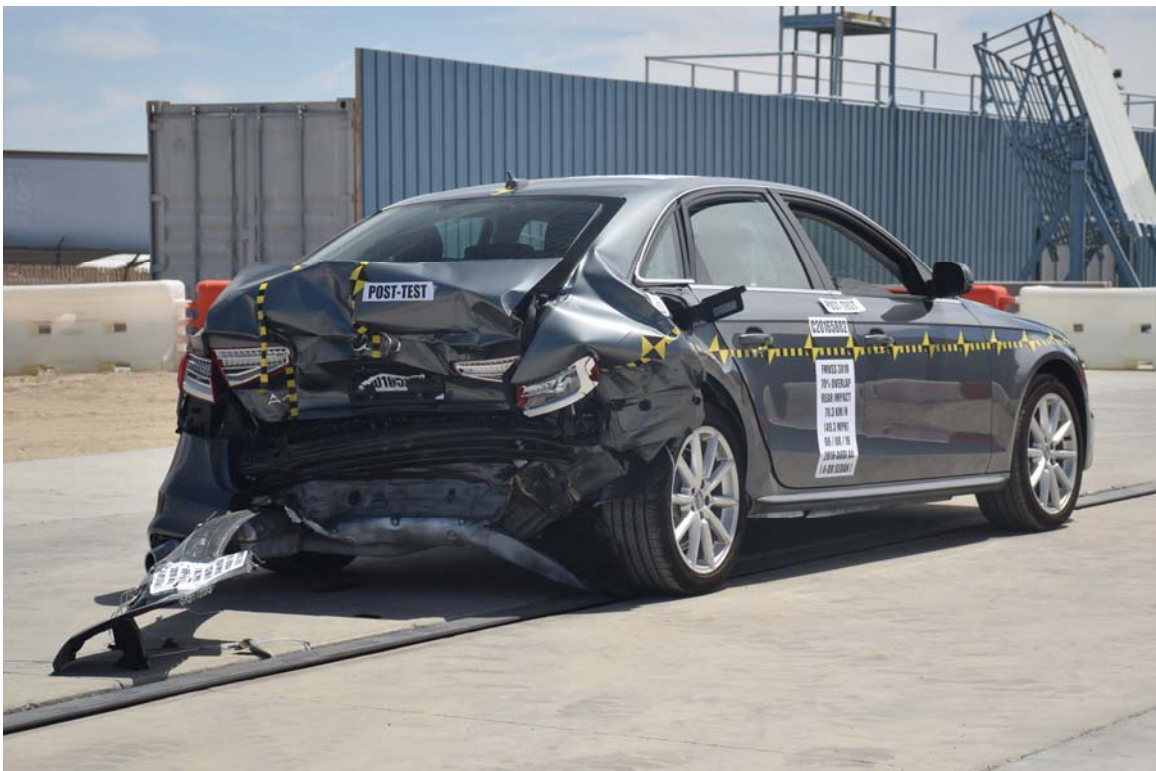


FIGURE 16. Post-Test Right Rear $\frac{3}{4}$ View of Test Vehicle



FIGURE 17. Pre-Test Right View of Test Vehicle



FIGURE 18. Post-Test Right View of Test Vehicle



FIGURE 19. Pre-Test Right Front $\frac{3}{4}$ View of Test Vehicle



FIGURE 20. Post-Test Right Front $\frac{3}{4}$ View of Test Vehicle

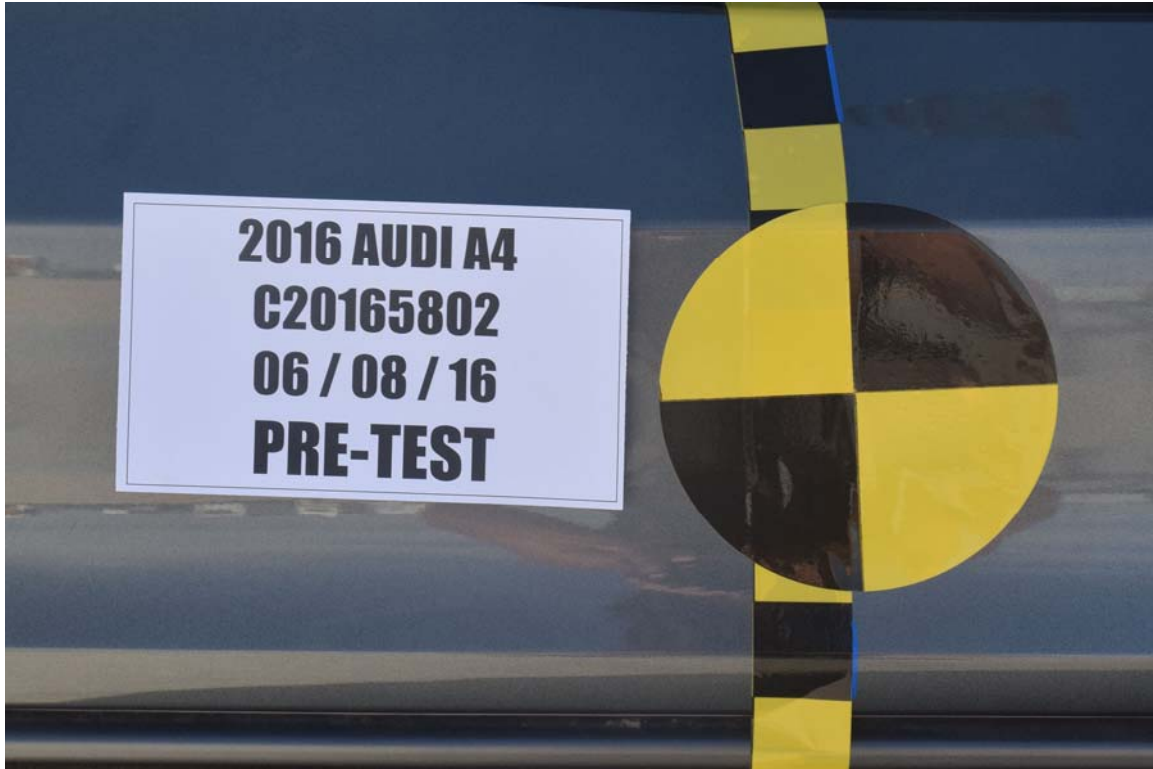


FIGURE 21. Pre-Test Close-Up View of Impact Point Target



FIGURE 22. Post-Test Close-Up View of Impact Point Target



FIGURE 23. Pre-Test View of Fuel Filler Cap



FIGURE 24. Post-Test View of Fuel Filler Cap



FIGURE 25. Pre-Test Rear Underbody View of Test Vehicle

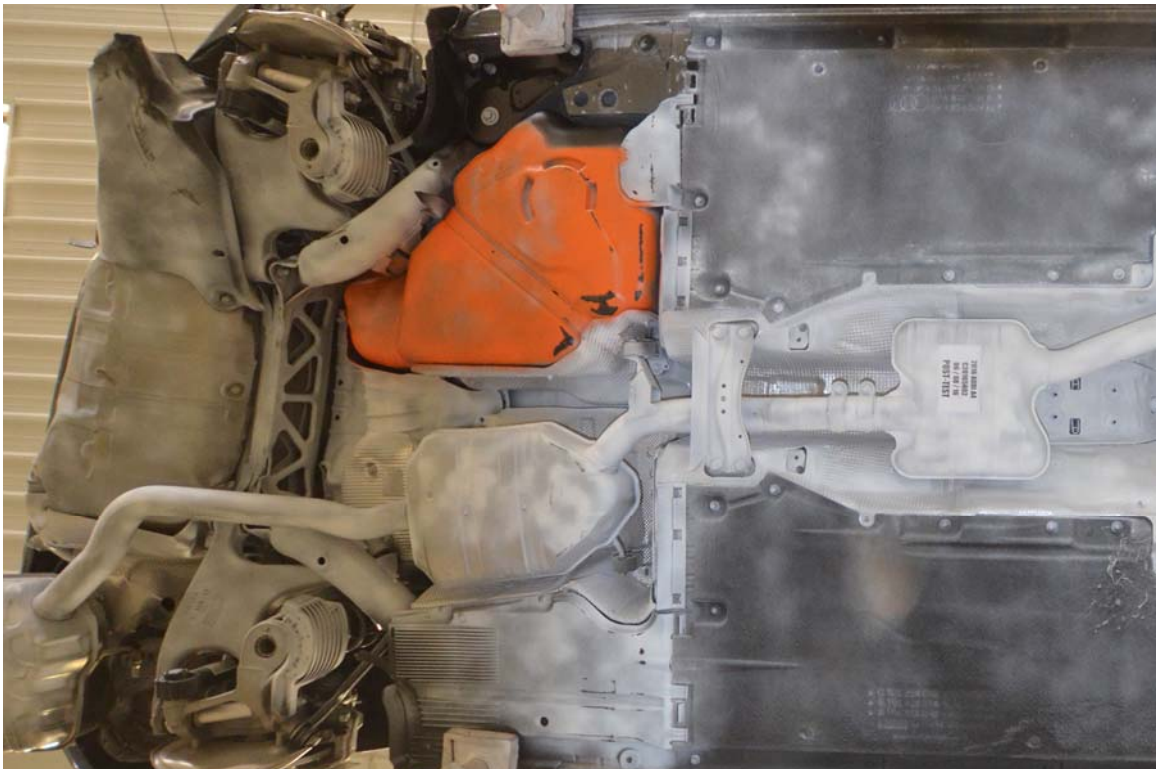


FIGURE 26. Post-Test Rear Underbody View of Test Vehicle

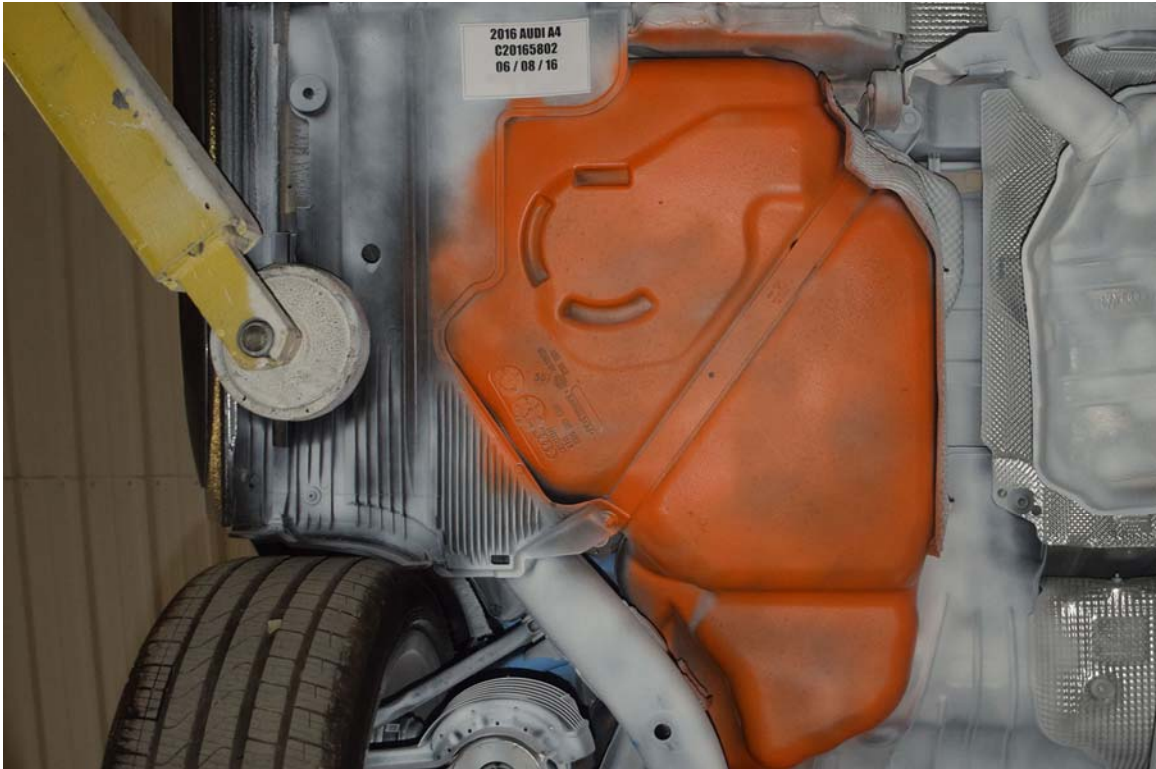


FIGURE 27. Pre-Test Underbody View of Fuel Tank

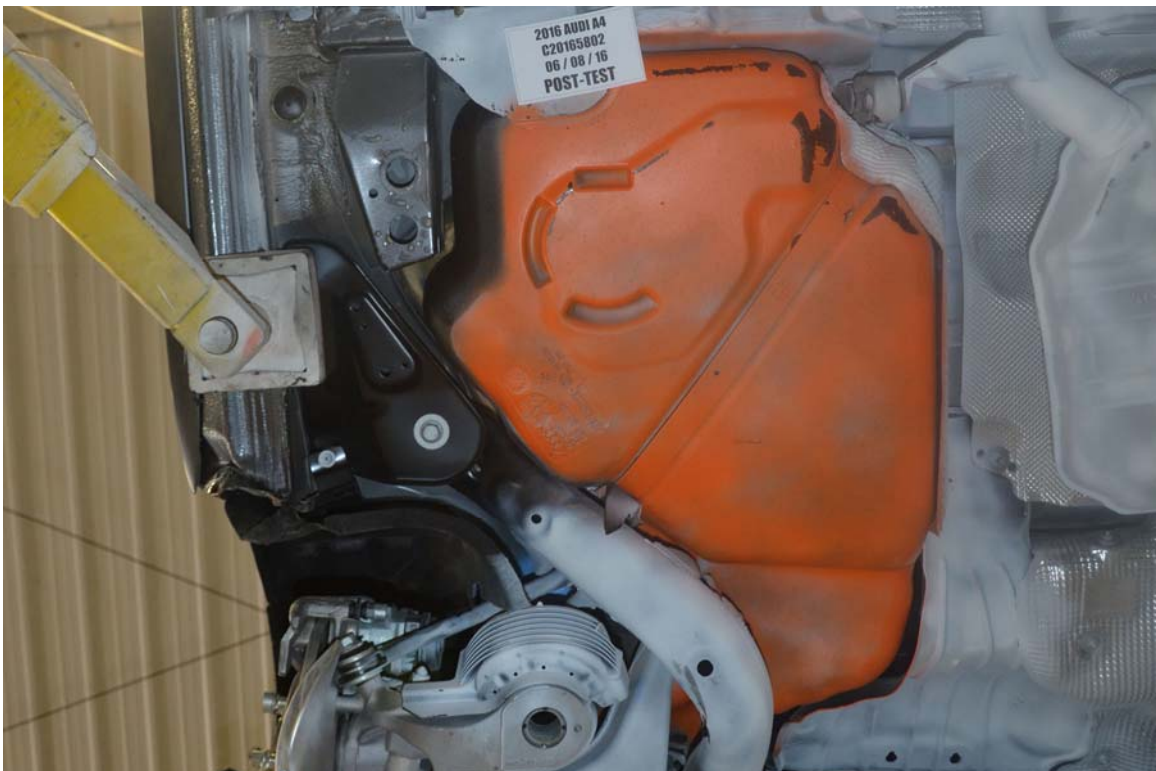


FIGURE 28. Post-Test Underbody View of Fuel Tank

Photograph Not Available

FIGURE 29. Pre-Test Underbody View of Fuel Lines



FIGURE 30. Post-Test Underbody View of Fuel Lines



FIGURE 31. Test Vehicle at 0° on FMVSS 301 Static Rollover Device



FIGURE 32. Test Vehicle at 90° on FMVSS 301 Static Rollover Device



FIGURE 33. Test Vehicle at 180° on FMVSS 301 Static Rollover Device

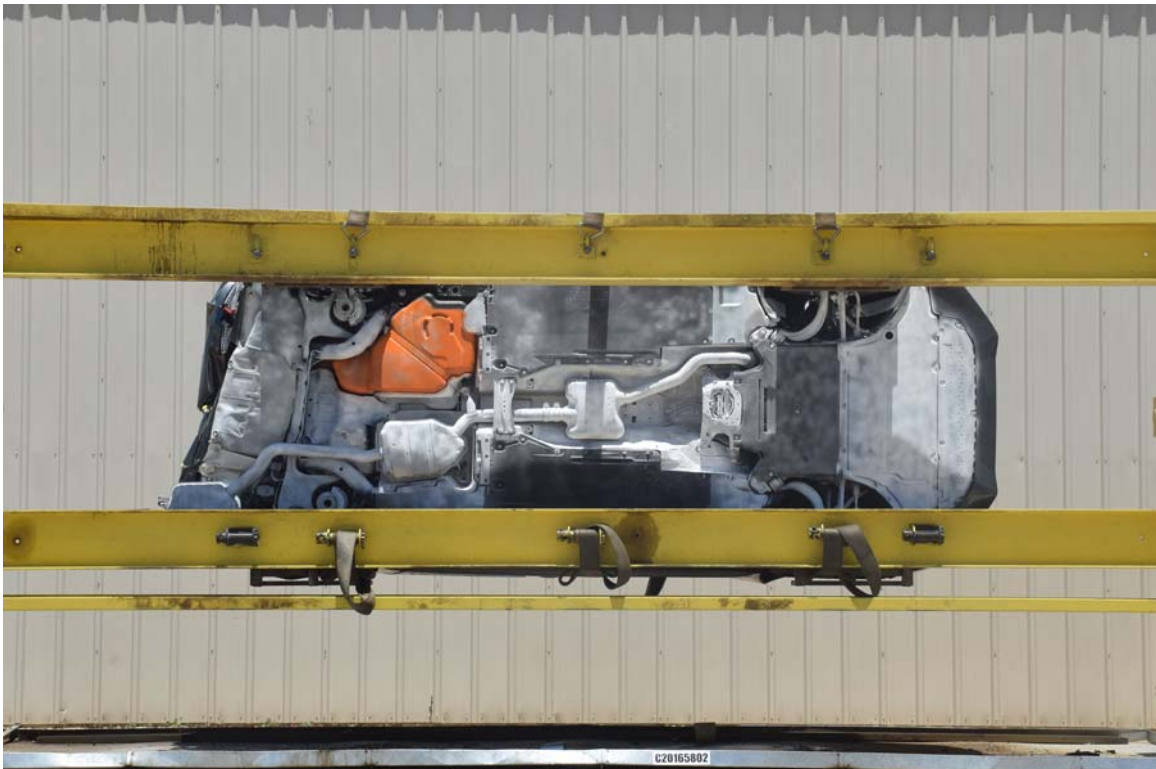


FIGURE 34. Test Vehicle at 270° on FMVSS 301 Static Rollover Device



FIGURE 35. Test Vehicle at 360° on FMVSS 301 Static Rollover Device



FIGURE 36. Impact Event